

Fluke PM6303A/03
Automatic RCL Meter



**Limited Availability
Used and in Excellent Condition**

Open Web Page

<https://www.artisanng.com/77012-1>

All trademarks, brandnames, and brands appearing herein are the property of their respective owners.



Your **definitive** source
for quality pre-owned
equipment.

Artisan Technology Group

(217) 352-9330 | sales@artisanng.com | artisanng.com

- Critical and expedited services
- In stock / Ready-to-ship

- We buy your excess, underutilized, and idle equipment
- Full-service, independent repair center


Artisan Scientific Corporation dba Artisan Technology Group is not an affiliate, representative, or authorized distributor for any manufacturer listed herein.

Automatic RCL Meter

PM6303A

Users Manual

951111

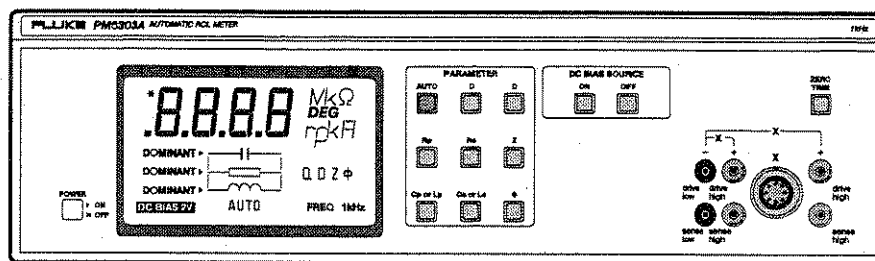

FLUKE®

Please note

In correspondence concerning this instrument, please quote the type number and serial number as given on the type plate.

Bitte beachten

Bei Schriftwechsel über dieses Gerät wird gebeten, die Typennummer und die Gerätenummer anzugeben. Diese befinden sich auf dem Typenschild an der Rückseite des Gerätes.

Noter s.v.p.

Dans votre correspondance et dans vos réclamations se rapportant à cet appareil, veuillez toujours indiquer le numéro de type et le numéro de série qui sont marqués sur la plaquette de caractéristiques.

Important

As the instrument is an electrical apparatus, it may be operated only by trained personnel. Maintenance and repairs may also be carried out only by qualified personnel.

Wichtig

Da das Gerät ein elektrisches Betriebsmittel ist, darf die Bedienung nur durch eingewiesenes Personal erfolgen. Wartung und Reparatur dürfen nur von geschultem, fach- und sachkundigem Personal durchgeführt werden.

Important

Comme l'instrument est un équipement électrique, le service doit être assuré par du personnel qualifié. De même, l'entretien et les réparations sont à confier aux personnes suffisamment qualifiées.

The wordmark Philips and the Philips shieldemblem
are used under licence from Philips Export B.V.

© 1995, 1996 Fluke Corporation.

All rights reserved.

Data subject to change without notice

Printed in Germany

FLUKE®

CONTENTS

Operating manual	(GB)
Gebrauchsanleitung	(D)
Mode d'emploi	(F)
Instrucciones de preparación y de seguridad	(E)
Istruzioni per la messa in funzione e norme di sicurezza	(I)
Instructies met betrekking tot de installatie en veiligheid	(NL)
Inledande anvisningar och säkerhetsanvisningar	(S)
Figures	
Service Centers	

USERS MANUAL

CONTENTS

Page

SHIPMENT NOTE AND INITIAL INSPECTION

1	INSTALLATION AND SAFETY INSTRUCTIONS	1 - 1
1.1	SAFETY INSTRUCTIONS	1 - 1
1.1.1	Maintenance and Repair	1 - 1
1.1.2	Grounding (Earthing)	1 - 2
1.1.3	Connections	1 - 2
1.1.4	Line Voltage Setting and Fuses	1 - 3
1.2	OPERATING POSITION OF THE INSTRUMENT	1 - 4
1.3	RADIO INTERFERENCE SUPPRESSION	1 - 4

2	MAIN FEATURES	2 - 1
----------	----------------------	--------------

3	OPERATING INSTRUCTIONS	3 - 1
3.1	GENERAL INFORMATION	3 - 1
3.2	TURNING THE INSTRUMENT ON	3 - 1
3.3	SELF-TEST ROUTINE	3 - 1
3.4	BRIEF CHECKING PROCEDURE	3 - 2
3.4.1	General	3 - 2
3.4.2	Functional Test	3 - 3
3.5	OPERATION AND APPLICATION	3 - 5
3.5.1	Control Elements, Display and Connections	3 - 5
3.5.2	Measurement Setup and Accessories	3 - 8
3.5.3	Automatic Zero Trim	3 - 13
3.5.4	Component Measurement	3 - 15
3.5.5	Out-of-Range and Error Messages	3 - 17
3.5.6	Component Measurement at Range Limits	3 - 18
3.6	MEASUREMENT PRINCIPLE	3 - 21
3.7	SELF DIAGNOSTICS	3 - 27

4	CHARACTERISTICS	4 - 1
4.1	SAFETY AND EMC REQUIREMENTS	4 - 1
4.2	PERFORMANCE SPECIFICATIONS	4 - 2
4.3	POWER SUPPLY	4 - 6
4.4	ENVIRONMENTAL CONDITIONS	4 - 6
4.5	SAFETY & QUALITY DATA; CABINET	4 - 8
4.6	ACCESSORIES	4 - 9
5	PERFORMANCE TEST	5 - 1
5.1	INTRODUCTION	5 - 1
5.2	RECOMMENDED TEST EQUIPMENT	5 - 1
5.3	SELF-TEST ROUTINE, ERROR MESSAGES	5 - 2
5.4	PERFORMANCE VERIFICATION	5 - 2
5.4.1	Measurement Voltage	5 - 2
5.4.2	Measurement Frequency	5 - 3
5.4.3	Open-Circuit Trimming	5 - 3
5.4.4	Short-Circuit Trimming	5 - 4
5.4.5	Resistor Measurement	5 - 4
5.4.6	Capacitance/Inductance Measurement	5 - 5
6	LIMITED WARRANTY & LIMITATION OF LIABILITY, DECLARATION OF CONFORMITY	6 - 1

INSTALLATION AND SAFETY INSTRUCTIONS IN FOREIGN LANGUAGES

FIGURES

Fig. 1	Front view
Fig. 2	Rear view
Fig. 3	PM 9540/TWE, SMD Tweezers
Fig. 4	PM 9540/BAN, 4-wire test cable with banana plugs
Fig. 5	PM 9541A, 4-wire test cable
Fig. 6	Single and double test posts
Fig. 7	PM 9542SMD, SMD Adapter
Fig. 8	PM 9542A, RCL Adapter

SERVICE CENTERS

SHIPMENT NOTE

The following parts should be included in the shipment:

- 1 Fluke PM6303A Automatic RCL Meter 1 kHz
- 1 Users Manual
- 1 Power Cable
- 2 Fuses
- 2 Single Test Posts

INITIAL INSPECTION

Check that the shipment is complete and note whether any damage has occurred during transport. If the contents are incomplete or there is damage, file a claim with the carrier immediately, and notify the Fluke Sales or Service organization to facilitate the repair or replacement of the instrument. The addresses are listed in the back of the manual.

The performance of this instrument can be tested by using the Performance Test in Chapter 5 of this manual.

Chapter **1**

INSTALLATION AND SAFETY INSTRUCTIONS

1 INSTALLATION AND SAFETY INSTRUCTIONS

1.1 SAFETY INSTRUCTIONS

Upon delivery from the factory the instrument complies with the required safety regulations (see Chapter 4). To maintain this condition and to ensure safe operation, the instructions below must be followed carefully.

1.1.1 Maintenance and Repair

Failure and excessive stress:

If the instrument is suspected of being unsafe, remove it from operation immediately and secure it against any unintended operation. The instrument is considered to be unsafe when any of the following conditions exist:

- It shows physical damage.
- It does not function anymore.
- It is stressed beyond the tolerable limits (e.g., during storage and transportation).

Disassembling the Instrument:

WARNING

Calibration, maintenance, and repair of the instrument must be performed only by trained personnel who are aware of the hazards involved. To avoid electric shock, do not remove the cover unless you are qualified to do so.

Before removing the cover, disconnect the instrument from all power sources. The capacitors in the instrument may remain charged for several seconds after all power has been disconnected.

1.1.2 Grounding (Earthing)

Before any other connection is made the instrument must be connected to a protective earth conductor via the three-wire power cable.

The power plug shall be inserted only into a grounded outlet.

Do not defeat the protective action by using an extension cord without a grounded conductor.

Do not connect a protective ground conductor into the measurement contacts on the front panel, the four contacts of the connector to which the circuit ground is applied, or the external contact of the connector plug.

WARNING

Any interruption of the protective ground conductor inside or outside the instrument or disconnection of the protective ground terminal, is likely to make the instrument dangerous. Intentional interruption is prohibited.

1.1.3 Connections

The circuit ground potential is applied to four of the eight contacts of the front panel connector and is connected to the instrument case via parallel-connected capacitors and a resistor. The external contact of the connector is connected to the instrument case. This avoids ac ground loops while providing good RF grounding.

If the circuit ground potential in a measurement setup is different from the protective ground potential, make sure that the four contacts of the front panel connector are not live.

1.1.4 Line Voltage Setting and Fuses

Before plugging in the line cable, make sure that the instrument is set to the correct line voltage.

WARNING

To avoid injury or death, changing fuses and modifying line cables to local power must be done by qualified service personnel who are aware of the hazards involved.

On delivery from the factory, the instrument is set to one of the following line voltages:


Type	Code No.	Line Voltage	Delivered Power Cable
PM6303A	9452 063 03101	220 V	Universal Europe
PM6303A	9452 063 03103	120 V	North America
PM6303A	9452 063 03104	240 V	England (U.K.)
PM6303A	9452 063 03105	220 V	Switzerland
PM6303A	9452 063 03108	240 V	Australia

The line voltage setting and the corresponding fuse specification are indicated on the rear panel.

Make sure that replacement fuses are of the type and current rating specified. The use of repaired fuses and/or the short-circuiting of fuse holders are prohibited. Do not defeat this important safety feature.

The instrument can be set to the following line voltages: 100 V, 120 V, 220 V and 240 V ac. These nominal voltages can be selected by means of the voltage selector, located on the rear panel, next to the line voltage connector. The fuse is located in a holder at the same place. For line voltage selection or replacement of the fuse, remove the line cable and pry open the compartment with a small screwdriver (see illustration).

Turn the selector to select the appropriate voltage range. If necessary, insert the specified fuse (T0.1A or T0.2A according to IEC127 or T0.125A or T0.25A according to CSA/UL198G) that matches the line voltage setting into the fuse holder.

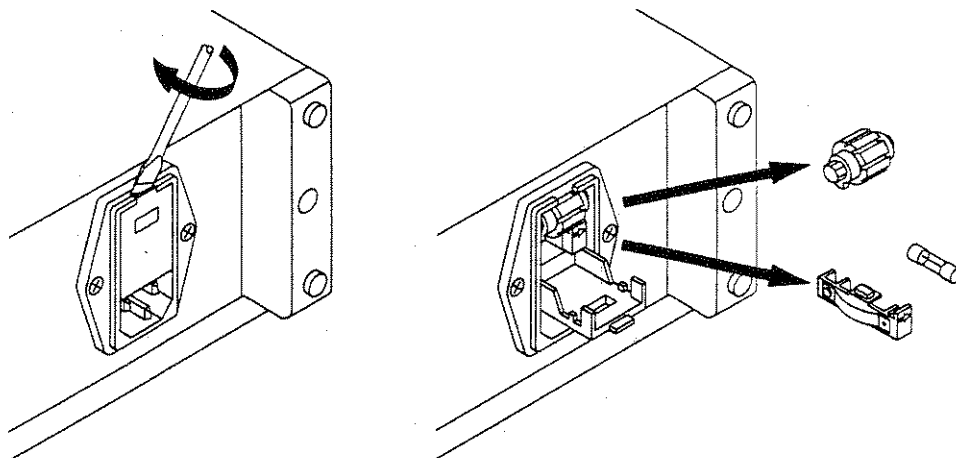

1.2 OPERATING POSITION OF THE INSTRUMENT

The instrument can be operated on a horizontal surface in a flat position or with the tilt bale extended. Ensure that the ventilation holes are free of obstruction. Do not position the instrument in direct sunlight or on any surface that produces or radiates heat.

1.3 RADIO INTERFERENCE SUPPRESSION

Radio interference of the instrument is suppressed and checked carefully. If radio frequency interferences occurs in connection with deficient suppressed other instruments, further suppression actions may be required.

Chapter **2**

MAIN FEATURES

2 MAIN FEATURES

The **PM6303A Automatic RCL Meter** is used for precise measurements of resistance, capacitance and inductance. The instrument provides auto-function and auto-ranging facility. It allows fast and high precision measurements of passive components over a wide range.

The component to be measured is connected to the instrument via front panel test posts, the PM 9541A four-wire test cable, or the PM 9542A four-terminal test adapter. The Adapter PM 9542SMD or the PM 9540/TWE SMD Tweezers for surface-mounted components are also available.

The measurement result, the numerical value, dimension, and the equivalent circuit symbol, is immediately displayed on the large four-digit liquid-crystal display (LCD), which is updated at a rate of two measurements per second.

A microprocessor controls the measurement process, computes the measurement value, and transfers the result to the display.

In the AUTO mode the dominant parameter, either R, C, or L of the component under test is automatically selected for display.

For example, for an inductance with a quality factor Q between 1 and 500, the instrument indicates the measurement value of the series inductance and as equivalent circuit symbol, the series connection of a resistance and an inductance.

In addition to the AUTO mode, eight component parameters can be selected manually by pressing pushbuttons:

- Quality factor Q
- Dissipation factor D
- Parallel resistance R_p
- Series resistance R_s
- Impedance Z
- Parallel capacitance C_p or parallel inductance L_p
- Series capacitance C_s or series inductance L_s
- Phase angle Φ

An internal DC BIAS voltage can be added to the measurement voltage for electrolytic capacitors.

The PM6303A RCL Meter is especially suited for use in laboratories, for quality control, in service workshops, and for educational purposes.

Chapter **3**

OPERATING INSTRUCTIONS

3 OPERATING INSTRUCTIONS

3.1 GENERAL INFORMATION

This section outlines the procedure and precautions necessary for operation. It identifies and briefly describes the functions of the front and rear panel controls and the display, and explains the practical aspects of operation.

3.2 TURNING THE INSTRUMENT ON

WARNING

Before turning the instrument on, ensure that it has been installed in accordance with the instructions in Chapter 1.

After the instrument has been connected to the line voltage in accordance with Section 1.1.4, it can be turned on by setting the **POWER** switch on the front panel to **ON**.

The specifications given in chapter 4 are valid when the instrument is installed in accordance with the instructions in chapter 1 and a warm-up period of 5 minutes.

After turning the power off, wait at least 5 seconds before turning it on again. This allows all power to completely discharge and the instrument to reset.

3.3 SELF-TEST ROUTINE

After power on, the instrument performs a self-test of the PROM, processor RAM, and external RAM. After this the software version is indicated in the upper line of the display for approximately 1 second. All segments of the display field are shown for approximately 2 seconds, and the instrument automatically recalls its instrument state before power off.

A possible fault is indicated as follows:

e.g. **Err2**

The digits mean:

- 1 Program memory checksum
- 2 RAM processor
- 3 External RAM defective
- 4 Backup memory

For detailed information see Section 3.5.5.

3.4 BRIEF CHECKING PROCEDURE

3.4.1 General

This procedure checks the instrument functions with a minimum of steps. It is assumed that the operator doing the test is familiar with the instrument and its characteristics. If this test is started within a short period after power on, test steps may be out of specification due to insufficient warm-up time.


WARNING

Before turning the instrument on, ensure that it has been installed in accordance with the instruction in Chapter 1.

3.4.2 Functional Test

Immediately after power on a self-test routine is performed. Then the instrument automatically recalls measurement settings prior to the last power off (see Section 3.3).

Insert the test posts supplied into the connector on the front panel (Logos face to face).

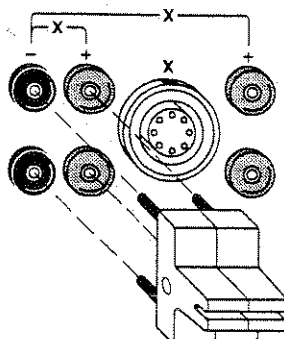

Press the green **AUTO** key.



The display shows:

AUTO

Press the **ZERO TRIM** key.



The display shows
for approximately 3 seconds:

6U54


If the ZERO TRIM operation
is unsuccessful, the display shows:
Refer to Section 3.5.3.

FAIL

If the ZERO TRIM operation
is successful, the display shows:


PASS

Insert a known component into
the test posts, e.g., a 1 k Ω resistor.

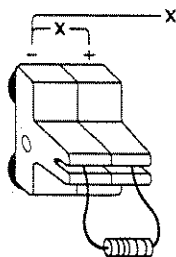

The display shows:

When the display is correct
the functional test is finished.

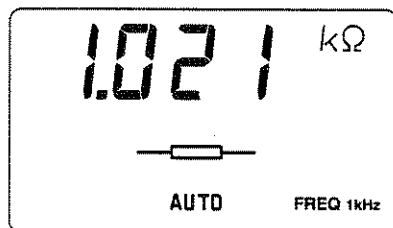

3.5

OPERATION AND APPLICATION

3.5.1

Control Elements, Display and Connections

3.5.1.1

Front Panel

Keyboard

Description	Function
POWER ON OFF	Power switch
PARAMETER AUTO Q D Rp Rs Z Cp or Lp Cs or Ls Φ	Keypad used to select required measurement: AUTO Automatic measurement mode: the dominant parameter is automatically displayed. Q Quality factor ($\tan \phi$; $Q = 1/D$). D Dissipation factor ($\tan \delta$; $D = 1/Q$). Rp Parallel resistance Rs Series resistance Z Impedance (image impedance) Cp or Lp Parallel capacitance/inductance Cs or Ls Series capacitance/inductance Φ Phase angle
DC BIAS SOURCE ON OFF	Key used to switch the internal 2 V dc bias on or off (to measure electrolytic capacitors).
ZERO TRIM	Key used for automatic trimming of ▪ Open-circuit impedance ($>100\text{ k}\Omega$) ▪ Short-circuit impedance ($<10\text{ }\Omega$)

Description

Function

Display Section

***8.8.8.8**

Maximum of four digits for the measurement value.
The asterisk indicates that the component is outside the 0.25 % accuracy range of the instrument.

MkΩ
DEG
npkF

Display of measuring unit:

M Ω **kΩ** **Ω**

For resistances

DEG (degree)

 
For phase angle

n F **p F** **μ F** **m F**

For capacitances

μ H **m H** **H** **kH**

For inductances



Equivalent circuit symbols with marker for dominant component.

Q D Z Φ

Display of selected parameter

Q : Quality factor

D : Dissipation factor

Z : Impedance

Φ : Phase angle

DC BIAS 2V

Indication that internal bias voltage is turned on.

AUTO

Automatic measurement of dominant parameter.


FREQ 1kHz

Measurement frequency 1 kHz (fixed).

Description


Function

Connections

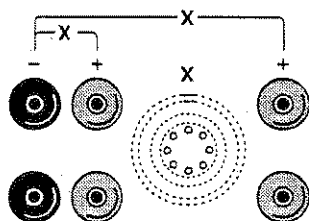

Connectors for


- Test posts for four-wire measurement.
- PM 9542SMD, SMD ADAPTER

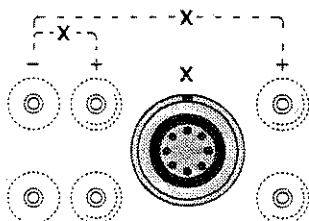

Connector for

- PM 9541A 4-wire Kelvin Clip Test Cable
- PM 9542A RCL Adapter
- PM 9540/TWE, SMD TWEEZERS
- PM 9540/BAN, 4-WIRE TEST CABLE with banana plugs

3.5.1.2 Rear Panel

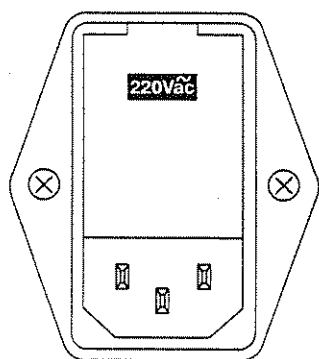

Input power module with fuse and voltage selector.

~ ac (alternating current).

For details, see Section 1.1.4:


Line Voltage Setting and Fuses.

3.5.2 Measurement Setup and Accessories


For best accuracy, you should perform ZERO TRIM (see Section 3.5.3) when you change the measurement setup.

Test posts

Most common components can be measured with the supplied test posts plugged into the front panel connectors.

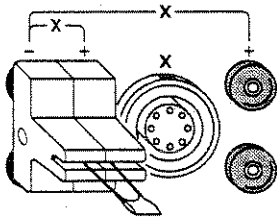

Radial-Lead Component

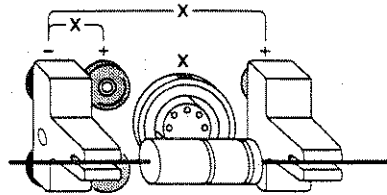


Axial-Lead Component

PM 9541A Test Cable with Kelvin Clips


Use the test cable to measure in-circuit components or components of large size.

The test cable is connected to the instrument via the round plug (red markings face to face). The plug locks automatically. To unlock the plug, pull on the ridged part.

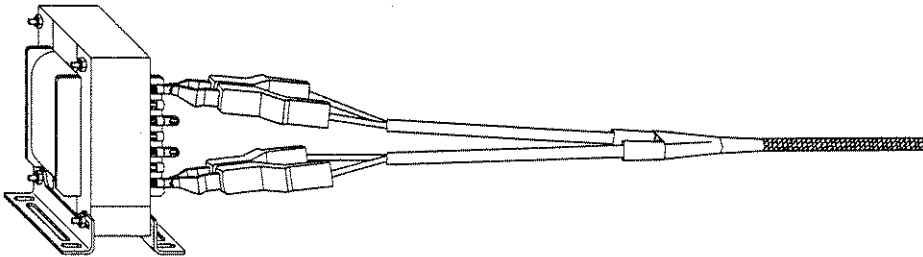

PM 9542A RCL Adapter

The RCL adapter allows you to make component measurements away from the front panel of the instrument. The RCL adapter can also handle larger components than the front panel connector can.

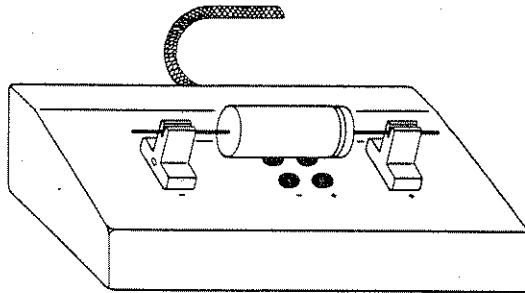

The RCL adapter is connected to the instrument via the round plug on the front panel (red markings face to face).

The supplied single test posts and the double test post can also be directly inserted into the front panel connector of the instrument.


Note: For accurate measurements you should insert only the test posts, cable, or adapter that you need for the actual measurement.

PM 9542SMD, SMD Adapter


The SMD adapter can be used to measure SMD components with a length of 2 to 10 mm, depth >1 mm, height >0.5 mm, or a diameter >1 mm.

For easy and quick insertion and removal of components, insert the SMD adapter into the PM 9542A RCL Adapter.

You can also insert the SMD adapter directly into the front panel connector of the instrument. To ease insertion of components, set the instrument in a sloping position (handle folded down)

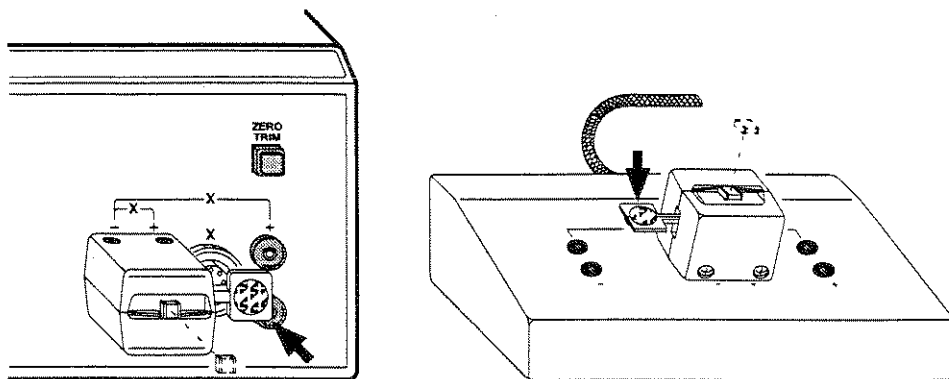


When you use the SMD adapter to measure very small capacitances especially below 100 pF, you must take into account the alteration of the stray fixture capacitances, depending on the separation of the contacts.

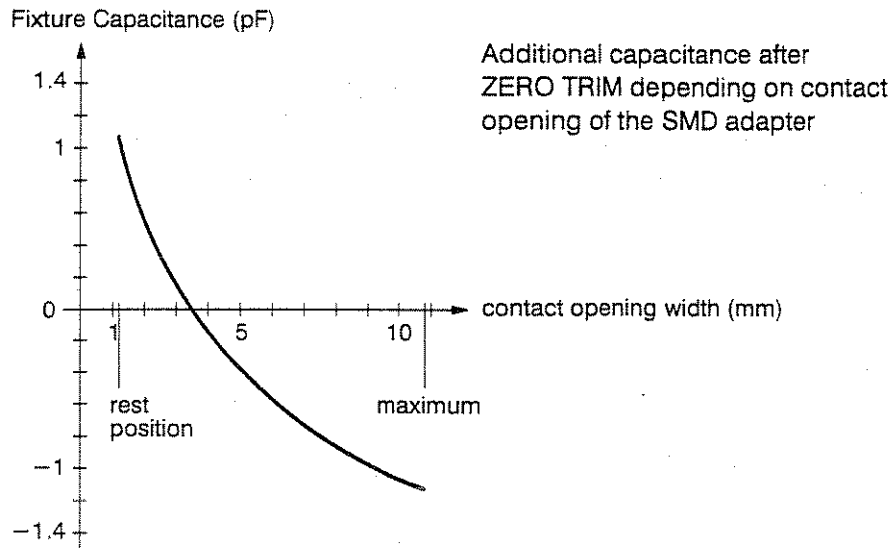

PM 9540/TWE SMD Tweezers

Use the SMD Tweezers to measure single SMD components or in-circuit SMD components.

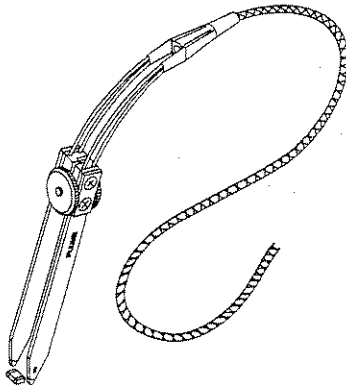


The SMD Tweezers are connected to the instrument via the round plug on the front panel (red marking face to face).

For open-circuit trimming when you are measuring small capacitances, set the opening of the tweezers to the size of the component.

The two-wire measuring technique and the pressure applied by the tips of the tweezers can cause a measuring error in addition to the basic error of the RCL Meter, due to the additional serial resistance (typical 0.02Ω). The presence of dirt or contaminants on the tips of the tweezers can also affect measurements. The tips may be periodically cleaned with alcohol and a non-abrasive cloth.

PM 9540/BAN Test Cable with Banana Plugs

Use the test cable if you need banana plugs for your own special applications.

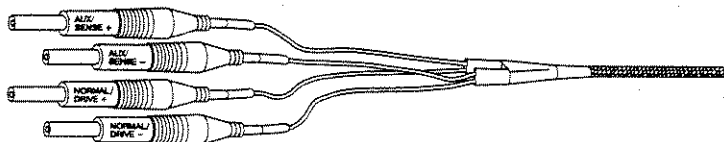


The test cable is connected to the instrument via the round plug on the front panel (red marking face to face).

When you perform ZERO TRIM short-circuit DRIVE+ with SENSE+ and DRIVE- with SENSE- for the open-circuit trimming. Short-circuit all four plugs for the short-circuit trimming.

Two-Wire Measurements

You can measure components with normal test leads in two-wire mode by using the upper two connectors. To reduce stray capacitances and interferences, use short leads. These connections are also available on the eight-pole round connector.

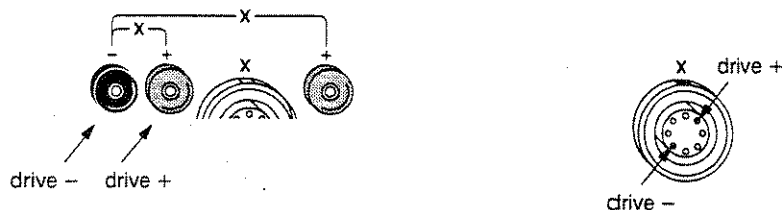

The technical specifications given in chapter 4 are valid for four-wire measurements, which are particularly important for low resistance components and large capacitances.

3.5.3 Automatic Zero Trim

When pressing the **ZERO TRIM** key for approximately 2 seconds the instrument performs an impedance measurement of the measurement setup and stores the value determined. The display shows **PR55**. For all further measurements this value will be taken into consideration. **To ensure best measuring accuracy you should perform ZERO TRIM when you change the measurement setup.**

If you press the **ZERO TRIM** key with a component connected with an impedance of $<10\ \Omega$ or $>100\ \text{k}\Omega$, the value of the component will be taken into consideration. At open or short-circuited contacts of the measurement setup the instrument now indicates a negative resistance value, for instance, or an inductance in case of a connected capacitance (or a capacitor in case of a an inductance.) Please perform ZERO TRIM once again without any component connected in order to obtain correct values.

The TRIM data are stored in a memory and will persist even if the instrument is switched off.

Short-Circuit Trimming

For measuring low impedances, below $100\ \Omega$ in particular, please short-circuit the contacts of the measurement setup and press the **ZERO TRIM** key for approximately 2 seconds. The display shows **bU5Y**. The instrument now performs a measurement and stores the value determined, which is the short circuit impedance. The display shows **PR55**. For all further measurements this value is taken into consideration, including the line and contact impedances.

If during short circuit trimming the measured impedance is $>10\ \Omega$, **FRIL** will be displayed.

Open-Circuit Trimming


When you measure low capacitances the open-circuit impedance of the measurement setup may affect the result. Remove any connected component and press the **ZERO TRIM** key for approximately 2 seconds. The display shows **bU5Y**. The instrument again performs a measurement considering the value determined, which is the open-circuit impedance, for all following measurements. The display shows **PR55**.

If the impedance measured during open-circuit trimming is $<100\ \text{k}\Omega$, the display shows **FRIL**.

For the **ZERO TRIM** the contacts **DRIVE+** and **SENSE+** as well as **DRIVE-** and **SENSE-** should be connected. As far as the adapters available from Fluke are concerned, this is normally ensured automatically, except for the PM 9540/BAN cable and for the PM 9542SMD SMD Adapter.

If you use the PM 9540/BAN cable in your own special application short-circuit **DRIVE+** with **SENSE+** and **DRIVE-** with **SENSE-** for the open-circuit trimming. Short-circuit all four plugs for the short-circuit trimming.

As far as the SMD Adapter is concerned the contacts are insulated from each other. The contacts are only closed when a component is inserted.

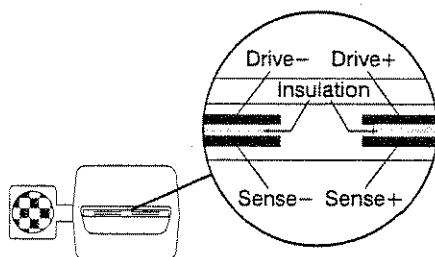


Contacts of the PM 9542SMD, SMD Adapter


To perform ZERO TRIM at an open adapter with the DRIVE/SENSE contacts connected, the SMD Adapter is equipped with SMD components with an impedance of $Z \rightarrow \infty$. Please use this component for open-circuit trimming. For short-circuit trimming you can use one of the attached components with an impedance of $Z \rightarrow 0 \Omega$. These components have a real resistance of typical 4 m Ω . You should take into account this value if you measure low impedances.

If you need spare sets you can order them via your Service Organization with the following number: 5322 310 32275.

 $Z \rightarrow 0 \Omega$



$Z \rightarrow \infty$

 

3.5.4 Component Measurement


Choose a convenient measurement setup (see Section 3.5.2) and, if necessary, press the **ZERO TRIM** key. Insert the component.

CAUTION: To avoid damage of the instrument discharge capacitors with high residual charge (>5 V) before connecting them to the instrument.

After power on, the instrument automatically recalls measurement settings prior to the last power off. The measurement frequency is 1 kHz fixed.

In most cases you will be interested in the dominant parameter of the component under test. This is automatically detected and displayed in AUTO mode. Press the green **AUTO** key. The display shows AUTO, the value of the dominant parameter and the appropriate equivalent circuit symbol.

The decision criterion for defining the dominant parameter is $Q = D = 1$ (see Section 3.6). Values Q and D are related to the internal measurement frequency 1 kHz.

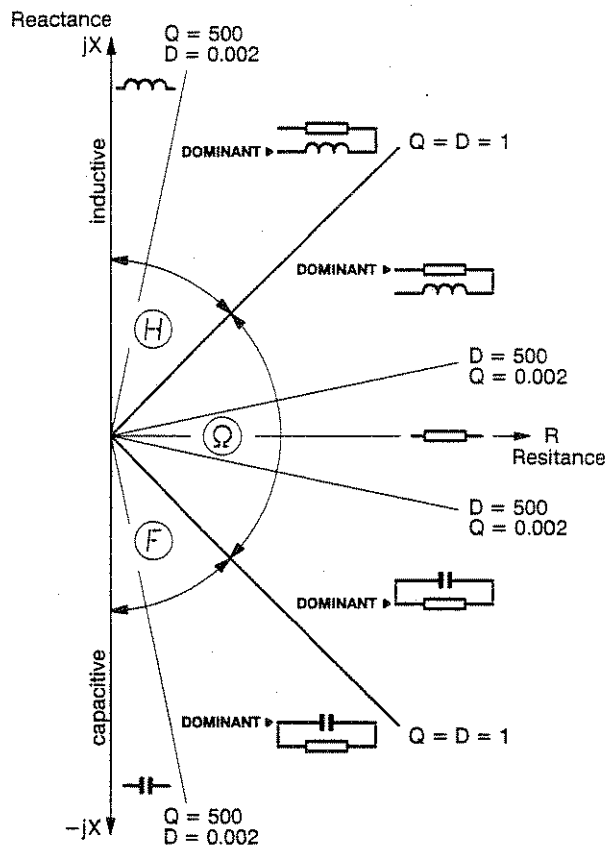

AUTO Mode Decision Diagram

If you want to display any other parameter, press the appropriate key:

Q	Quality factor ($\tan \phi$; $Q = 1/D$)
D	Dissipation factor ($\tan \delta$; $D = 1/Q$)
Rp	Parallel resistance
Rs	Series resistance
Z	Impedance (image resistance)
Cp or Lp	Parallel capacitance/inductance
Cs or Ls	Series capacitance/inductance
Φ	Phase angle

Electrolytic capacitors should be measured with the internal bias voltage on. Press the **DC BIAS ON** key; the display shows **DC BIAS 2V**.

3.5.5 Out-of-Range and Error Messages

The center segments of the digits flash when the following limits are exceeded:

- Resistances > 200 M Ω
- Capacitances > 100 mF
- Inductances > 20 kH
- Quality/dissipation factor > 500

The segments also flash when **DC BIAS** is switched on during measurement of resistors or inductors, indicating that direct current is being sourced to the component.

The asterisk in front of the digits indicates that the measured component is outside the 0.25 % accuracy range of the instrument.

During operation the instrument checks the trim data, the measurement range setting, the counter, and the communication to the storage register. Errors are indicated as follows:

Err3	External RAM defective
Err5	Trim data error
Err6	Error of measurement range setting
Err7	Counter overflow
Err8	Error of reference measurement

1, 2, and 4 are error messages that occur during power-on; see Section 3.3.

3.5.6 Component Measurement at Range Limits

As described in previous chapters, in AUTO mode the instrument determines and displays the dominant parameter of the component under test. The measurement frequency determines whether the reactance or the resistance is dominant. PM6303A measures at 1 kHz. You must take this into account when you measure low-resistance capacitors and inductors or high value resistors. For example, a 10 M Ω resistor may appear to be more capacitive than resistive to the instrument because the shunt capacitance across the resistor is dominant.

Lossy inductors:

When you measure small lossy inductances, the series loss resistance is often identified as the dominant parameter and is displayed, because at 1 kHz, the series reactance is very low. Therefore, for Ls or Lp display, press **Cs or Ls** or the **Cp or Lp** key.

Lossy capacitors with high capacitance, e.g. electrolytic capacitors:

Because the reactance of large capacitors is very low, the series resistance may be dominant, resulting in $Q < 1$ and display of the parallel resistance Rp. Therefore, for capacitance display, press **Cp or Lp** or the **Cs or Ls** key.

High-resistance resistors:

When you measure resistors in the higher M Ω range, the parasitic parallel capacitance may be displayed as the dominant parameter. Press **Rp or Rs** to display the resistance value.

Large inductance paralalled by a parasitic capacitance:

The resonant frequency of the component may be below the measurement frequency of 1 kHz. At 1 kHz the component represents a capacitance, and the display shows a parallel capacitance as the dominant parameter.

Large inductors in the kHz range:


The measurement result may be influenced by relatively small parallel capacitances. Be sure to use the **ZERO TRIM** function to remove stray capacitance effects from the fixture.

Inductors with ferromagnetic cores:


When you measure inductors with ferrite cores the inductance decreases with increasing voltage and current amplitudes due to saturation effects. Smaller test signals may be required.

In the PM6303A, the open-circuit voltage is 2 Vrms with 400 Ω internal resistance. The impedance of the component determines the amplitudes. For lower amplitudes, an additional resistor $\geq 71.5 \Omega$ may be connected between measurement output and circuit ground potential. For this the PM 9541A 4-Wire Kelvin Clip Test Cable is best suited.

Adding this resistor lowers the drive level through the voltage divider relationship as shown in the following illustrations.

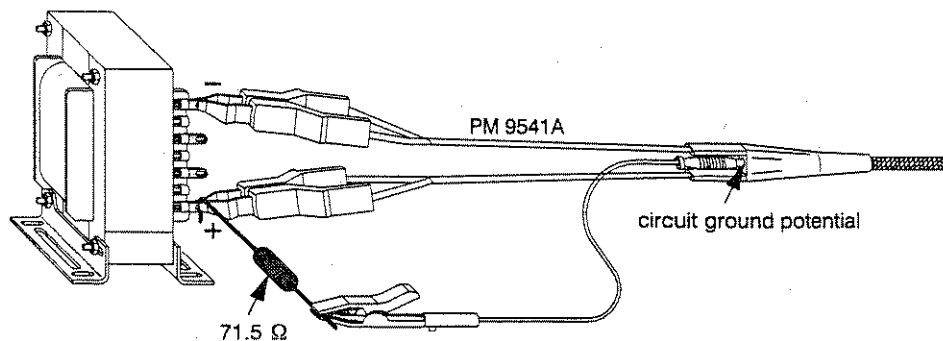

For a parallel resistor of 71.5Ω the following diagram shows the measurement voltage and current as a function of the test component impedance. The error limit in the inductance range shown increases to a maximum of 0.5 % with this load resistor.

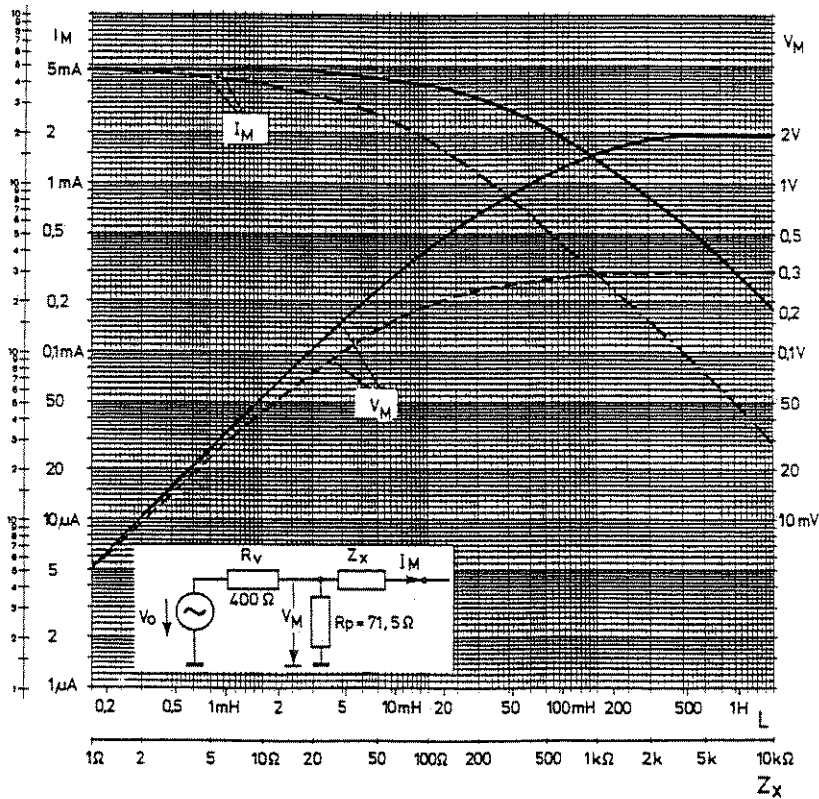

Ignoring the impedance of the component under test you can calculate R_p for different drive levels V_M :

$$V_M = \frac{R_p}{R_p + 400 \Omega} \times V_0 \quad V_0 = 2 V$$

3.6 MEASUREMENT PRINCIPLE

The component measurement is based on the current and voltage technique. The component voltage and the component current are measured and converted into binary values. The CPU calculates the electrical parameters of the component from these values. Depending on the parameters that were selected on the front panel, either the dominant parameter is automatically displayed (in **AUTO** mode resistance, capacitance, or inductance) or the selected parameter is displayed.

Each measurement cycle lasts approximately 0.5 seconds and consists of five single measurements, the results of which are stored and arithmetically evaluated. Finally the result is transferred to the display. The five single measurements are as follows:

1. Reference measurement

At the beginning of each measurement cycle, a reference measurement is performed. The measured value serves as reference for the subsequent four measurements.


2. Voltage measurement: 0°

3. Voltage measurement: 90°


4. Current measurement: 0°

5. Current measurement: 90°

At the end of the single measurements, the five measured values are stored. Using the measurement values, the microprocessor calculates the equivalent series resistance R_s , the equivalent series reactance X_s , and the quality factor $Q = X_s/R_s$ of the component. In **AUTO** mode, the microprocessor determines the dominant parameter, R_s , R_p , C_p , or L_s , calculates its value, and displays it together with the equivalent circuit symbol. If one of the other parameters is manually selected, this parameter is calculated and displayed. After that the next measurement cycle starts with the next five single measurements.

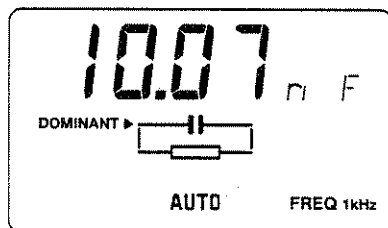

The following phase diagrams and formulas show the mathematic basics for internal calculation of the component value.

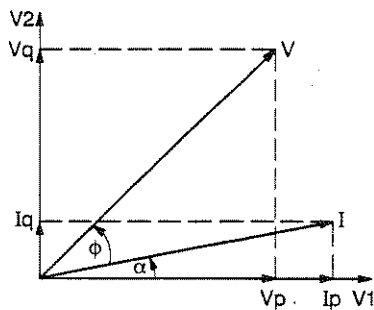

V: voltage
I: current
V1, V2: 0°-voltage, 90°-voltage

The phase angle between I and V is ϕ .
The phase angle between I and V1 is α .

In the diagram the phase relation between I and V happens to be a lossy inductance.

In each measurement cycle, the following components are determined:


V_p , V_q , I_p , I_q .

The series resistance and reactance are calculated from these components.

$$R_s = \frac{V_p I_p + V_q I_q}{I_p^2 + I_q^2} \quad (1)$$

$$X_s = \frac{V_q I_p - V_p I_q}{I_p^2 + I_q^2} \quad (2)$$

The following equivalent circuit is valid:

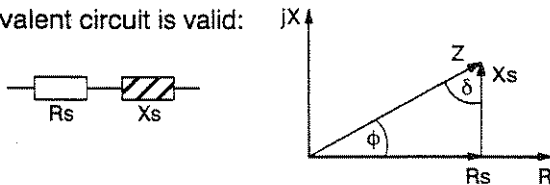

Quality factor: $Q = \tan \phi = 1/D = \frac{|X_s|}{R_s} \quad (3)$

Dissipation factor: $D = \tan \delta = 1/Q = \frac{|R_s|}{X_s} \quad (4)$

The magnitude of Q and the sign of X_s determine which parameter of the component is dominant.

X_s positive = inductive
 X_s negative = capacitive

The formulas for the various parameters are as follows:

$$Q = \frac{|X_s|}{R_s} \quad \text{see equation (3)}$$

$$Z = \sqrt{R_s^2 + X_s^2}$$

$$D = \frac{1}{Q}$$

$$C_p = \frac{1}{\omega(1 + 1/Q^2)|X_s|} \quad \text{if } X_s < 0$$

$$R_p = (1 + Q^2) \times R_s$$

$$L_p = \frac{(1 + 1/Q^2)|X_s|}{\omega} \quad \text{if } X_s > 0$$

$$R_s \quad \text{see equation (1)}$$

$$C_s = \frac{1}{\omega|X_s|} \quad \text{if } X_s < 0$$

$$L_s = \frac{|X_s|}{\omega} \quad \text{if } X_s > 0$$

$$\text{Impedance } Z = R + jX$$

$$\text{Admittance } Y = 1/Z$$

Example:

By using the five measurements, the instrument has calculated R_s and X_s in accordance with formulas 1 and 2, for example,


$$R_s = 3.037 \text{ k}\Omega$$

$$X_s = -15.197 \text{ k}\Omega$$

From this the instrument calculated:

$$Q = \frac{|X_s|}{R_s} = 5.004$$

The instrument displays the corresponding equivalent circuit symbol with the dominant parameter, according to the criteria of the Auto Mode Decision Diagram on page 3 - 16; in this case, as X_s is negative and $1 < Q < 500$:

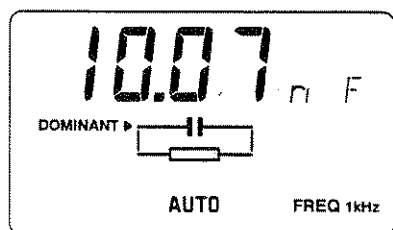

The calculation of the dominant parameter C_p was done according to the following formula:

$$C_p = \frac{1}{\omega(1 + 1/Q^2)|X_s|}$$

$$C_p = \frac{1}{2\pi \times 1 \text{ kHz} (1 + 1/5.004^2) \times 15.197 \text{ k}\Omega} = 10.068 \text{ nF}$$

The maximum display is four digits ± 1 digit tolerance.

Calculation of the other selectable parameters are performed as follows:

$$D = \frac{1}{Q} = \frac{1}{5.004} = 0.199$$

$$R_p = (1 + Q^2) \times R_s = (1 + 5.004^2) \times 3.037 \text{ k}\Omega = 79.08 \text{ k}\Omega$$

$$R_s = 3.037 \text{ k}\Omega \text{ (calculated by the instrument according to formula 1)}$$

$$Z = \sqrt{R_s^2 + X_s^2} = \sqrt{(3.037 \text{ k}\Omega)^2 + (15.197 \text{ k}\Omega)^2} = 15.497 \text{ k}\Omega$$

$$C_s = \frac{1}{\omega|X_s|} = \frac{1}{2\pi \times 1 \text{ kHz} \times 15.197 \text{ k}\Omega} = 10.472 \text{ nF}$$



Φ : The instrument calculates



$$\tan \Phi = \frac{|X_s|}{R_s} = \frac{15.197 \text{ k}\Omega}{3.037 \text{ k}\Omega} = 5.004$$

and gets Φ from an internal tangent table similar to a calculator

$$\Phi = -78.7 \text{ DEG}$$

If you are interested in mathematics, the following two pages show the phasor diagrams and formulas for the various components as an appendix.

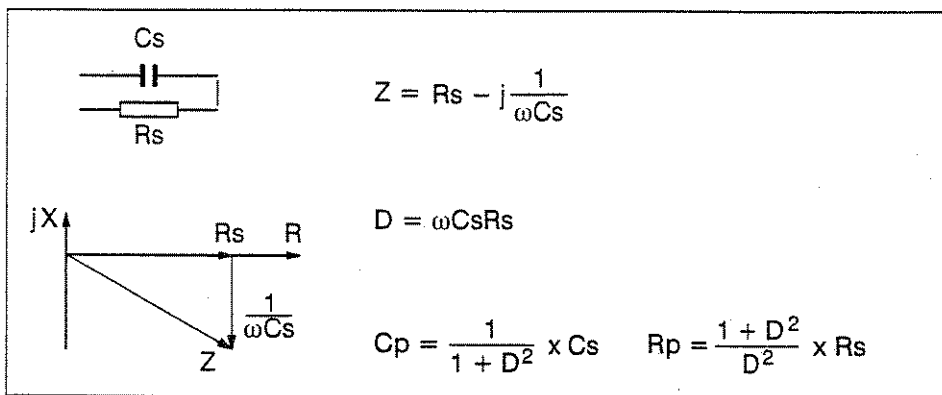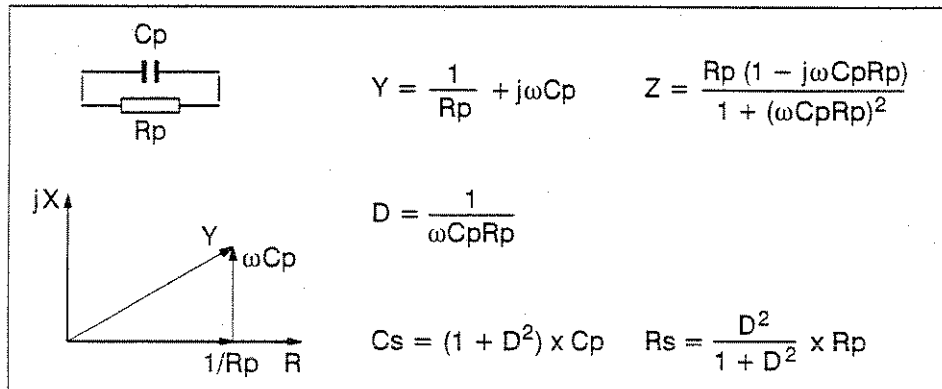

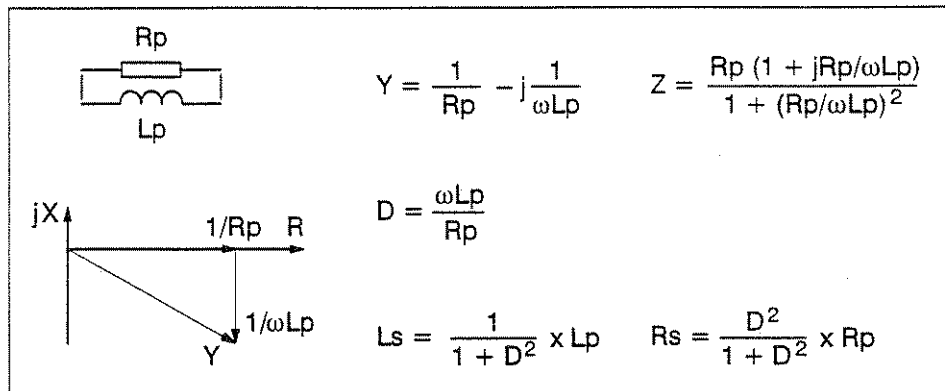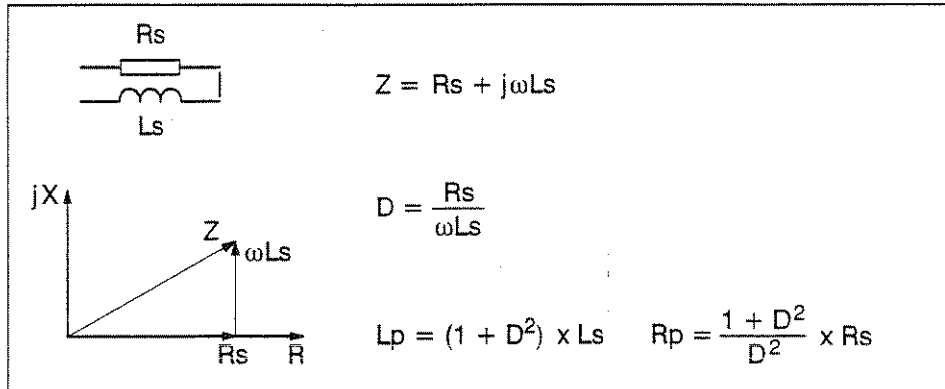

3.7 SELF DIAGNOSTICS

The test program contains the following six subprograms:

<i>Pro 1</i>	Display test
<i>Pro 2</i>	Keyboard test
<i>Pro 3</i>	Storage register test
<i>Pro 4</i>	Test of the single measurement steps
<i>Pro 5</i>	Test of a measurement cycle
<i>Pro 6</i>	Test of measurement range settings

Tests 4, 5, and 6 serve as an aid to the Service Technician for trouble shooting. In-circuit measurements with an open instrument are necessary; therefore, those tests are described in the Service Manual.

Press the **AUTO** key, while turning the instrument on. After the power-on routine the letters **TEST** appear in the display, then the menu of subprograms Pro 1 to 6 appears. Press any key briefly to select and carry out the test required. Press a key again for about 1 second to return to the subprogram menu. To leave the test program, turn the instrument off.

Program 1: Display Test

The display test checks the liquid crystal display and the respective decoders/drivers. When the text *Pro 1* appears in the subprogram menu, press a key. All segments of the display are switched on one after the other. You can stop and release the test with any key. The instrument then waits with the total display lit up until you press any key to return to the submenu or until you leave the test program.

Program 2: Keyboard Test

This test checks the function of each key as well as those of the keyboard encoder.

Press any key when the text **Prø2** appears in the submenu; the display shows **b[od**. If you briefly press any key in random, the current number of this key appears in the display alone with a control number, e.g., **2-3** when key **Q** is pressed. This control number is generated by the keyboard encoder and can be changed to 0, 1, 2, or 3 by pressing this key again. The keys are numbered row by row from left to right. For example, the **ZERO TRIM** key has the number 6; and the **Z** key has number 9. To return to the subprogram menu, press any key for one second.

Program 3: Memory Register Test

This test checks the memory for the storage of instrument settings and trim data (**ZERO TRIM**). The contents of this memory are not written over or deleted during the test and can be used as usual when the test has been completed.

The test runs automatically. The display shows **rEE** and then shows **PA55** at the end of the test. If the test finds an error, the display shows **E-r**. Press any key to return to the subprogram menu.

To leave the test program, turn the instrument off.

Chapter **4**

CHARACTERISTICS

4 CHARACTERISTICS, SPECIFICATIONS

4.1 SAFETY AND EMC REQUIREMENTS

The PM6303A Automatic RCL Meter DC – 1 MHz is

in accordance with EN 61010-1,

respectively IEC 1010-1 (safety requirements),

an instrument for measurement and test including accessories

- intended for professional, industrial process, and educational use.
- Overvoltage Category II, Pollution Degree 1.
- a Class I equipment.

in accordance with EN 55011,

respectively CISPR 11 (radio interference suppression),

an ISM equipment (industrial, scientific, and medical RF-equipment)

- of Group I,
which intentionally generates and/or uses conductively coupled radio frequency energy which is necessary for the internal functioning of the equipment itself.
- of Class B,
suitable for use in domestic establishments and in establishments directly connected to a low voltage power supply network which supplies buildings used for domestic purposes.

in accordance with EN 50082-1 (radio frequency immunity)

an instrument for use in all locations which

- are characterized by being supplied directly at low voltage from the public mains.
- are considered to be residential, commercial or light-industrial, both indoor and outdoor.

4.2 PERFORMANCE SPECIFICATIONS

Properties expressed in numerical values with stated tolerance are guaranteed by the manufacturer. Specified non-tolerance numerical values indicate those that could be nominally expected from the mean of a range of identical instruments. This specification is valid after the instrument has warmed up for 5 minutes. For reference conditions, see Sections 4.3 and 4.4.


PARAMETERS	AUTO	For AUTO the dominant
9 pushbuttons for the parameters	Q Quality factor D Dissipation factor Rp Rs Z Cp or Lp Cs or Ls Φ Phase angle	parameter R, C, or L is automatically determined.
DC BIAS SOURCE	2 V ON and OFF	Internal bias voltage for galvanic non-conducting components, e.g., electrolytic capacitors.
Meas. voltage (rms)	2 V ±0.2 V	Voltage source with 2 V
Max. measurement current (rms)	5 mA ±0.5 mA	open-circuit voltage and 400 Ω internal resistance.
Meas. frequency	1 kHz ±0.025 %	Fixed
Meas. update rate	2 measurements per second.	

Display LCD: liquid-crystal backlit display

Measurement value Maximum 4 digits

Units Ω , k Ω , M Ω ,
pF, nF, μ F, mF
 μ H, mH, H, kH
DEG

11 equivalent circuit symbols.

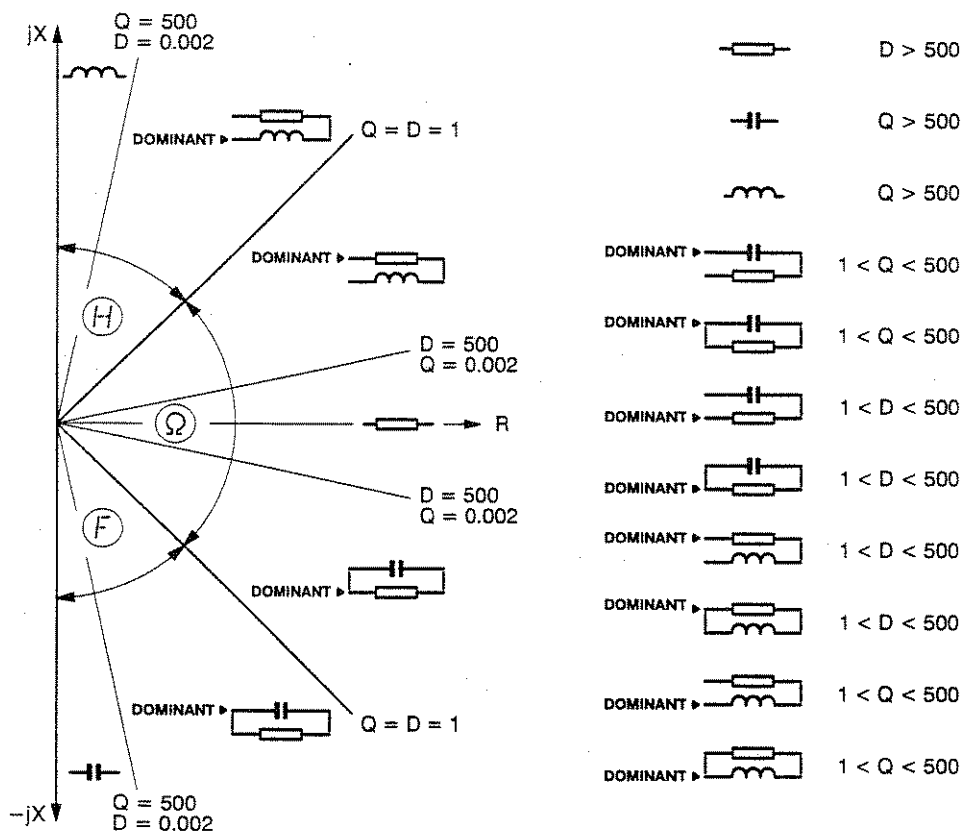

Equivalent circuit symbol and dominant parameter in the sectors of the phasor plane (AUTO mode).

Measurement ranges

0.000 Ω to 200 M Ω	R, Z	} Overrange indicated by flashing of the center segments of the four digits
0.0 pF to 100 mF	C	
0.0 μ H to 32 kH	L	
0.002 to 500	Q, D	
-90.0 to +90.0 DEG	Φ	

ZERO TRIM key

- For open adapter compensation of the open-circuit impedance if this is > 100 k Ω .
- For short-circuit adapter compensation of short-circuit impedance if this is < 10 Ω .

Component connection

4-wire connection by Kelvin clips via:

- Test posts, inserted into the front panel banana sockets.
- PM 9541A, 4-WIRE TEST CABLE
- PM 9542A, RCL ADAPTER
- PM 9542SMD, SMD ADAPTER

PM 9540/BAN, 4-WIRE TEST CABLE with banana plugs.

2-wire connection by PM 9540/TWE, SMD TWEEZERS.

Front panel connector

Six 2 mm connector
8-pole round connector

Max. ext. DC voltage

± 5 V

Between each connector.

Meas. accuracy


Data are valid for 4-wire component connection and after ZERO TRIM as described.

Limit for basic accuracy $\pm 0.25\% \pm 1$ digit
for dominant R, C, L,
and for Z.

R: $0.4\ \Omega$ to $4\ \text{M}\Omega$ $D \geq 1$
C: $40\ \text{pF}$ to $400\ \mu\text{F}$ $Q \geq 1$
L: $63\ \mu\text{H}$ to $630\ \text{H}$ $Q \geq 1$
Z: $0.4\ \Omega$ to $4\ \text{M}\Omega$

The asterisk $\star$ on display lights if component exceeds measurement range for basic accuracy. For example, a $10\ \text{pF}$ capacitor can be measured with $< 1.5\%$ accuracy.

Accuracy limits for error $E \pm 1$ digit
domin. R, C, L and for Z
in total meas. range

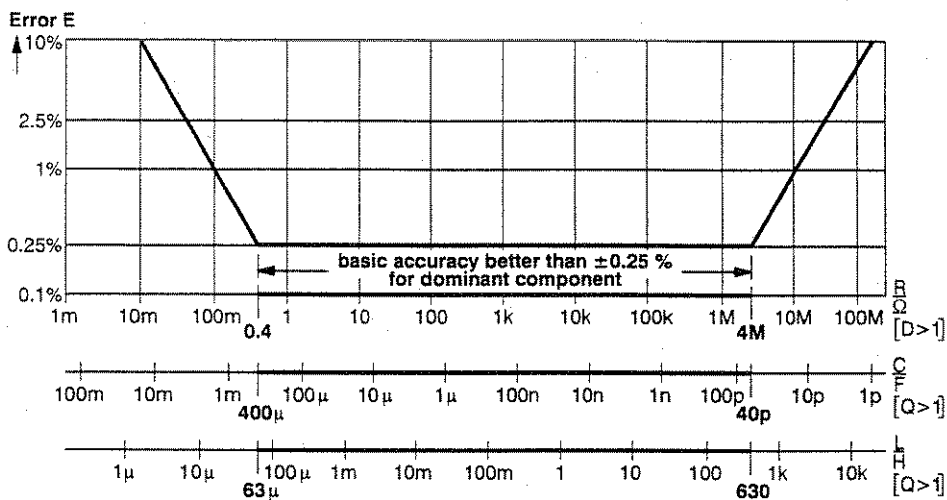

Accuracy limits	$E \times Q \pm 1$ digit	For R, $Q \geq 1$
for secondary R, C, L,	$E \times D \pm 1$ digit	For C and L, $D > 1$
and for Z	$E \pm 1$ digit	For Z

Accuracy limits	
For $Q \geq 1$	$E \times (1 + Q) \pm 1$ digit
$D > 1$	$E \times (1 + D) \pm 1$ digit
Φ	$1.2 \times E \pm 1$ digit

$E = \text{Error}$

See figure above.

4.3 POWER SUPPLY

AC power

- Nominal voltage rms 100 V, 120 V, 220 V, or 240 V
selectable at power input connector.
- Reference voltage 220 V ± 2 %
- Operating limits nominal voltage ± 10 %
- Nominal frequency range 50 Hz to 100 Hz
 - Operating limit 47.5 to 105 Hz
- Power consumption 16 VA
- Power cable versions Alternatively supplied for
 - Universal Europe
 - North America
 - England (U.K.)
 - Switzerland
 - Australia

4.4 ENVIRONMENTAL CONDITIONS

Ambient temperature:

- Reference value $+23^{\circ}\text{C} \pm 1\text{ K}$
- Nominal working range $+ 0^{\circ}\text{C}$ to $+50^{\circ}\text{C}$
- Storage and transport range -40°C to $+70^{\circ}\text{C}$

Relative humidity:

- Reference range 45 % to 75 %
- Nominal working range 20 % to 80 %
- Limit range of use 10 % to 90 %
- Range for storage and transport 0 % to 90 %

Air pressure

- Reference value 1013 hPa
- Nominal working range 800 to 1060 hPa

Air speed

- Reference range 0 to 0.2 m/s
- Nominal working range 0 to 0.5 m/s

Heat radiation

Direct sunlight radiation not allowed.

Vibration

- Limits for storage and transport Max. amplitude 0.35 mm,
max. acceleration 5 g (10 to 150 Hz)

Functional shock

MIL-T-28800D

- Acceleration

20 g

Operating position

Normally upright on feet or with tilt bale
extended

Warm-up time

5 minutes

4.5 SAFETY & QUALITY DATA; CABINET

Safety	According to EEC regulation 73/23, HD 401 S1, IEC 348 Ed. 2, CSA 22.2 no. 231.
Protection type	IP 20 (IEC 529)
Protection class	Class I, protective conductor (IEC 348).
EMC	According to EEC regulation 89/336. Emission according to EN 55 011, Group 1, Class B, respectively CISPR 11. Immunity according to EN 50 082-1, inclusive IEC 801-2, -3, -4.
Call rate	<0.05 units per year
MTBF (calculated)	35,000 hours
Cabinet dimensions	▪ Width 315 mm (12.4") ▪ Height 105 mm (4.13") ▪ Depth 405 mm (15.9") ▪ Weight 3.8 kg (8.4 lb)

4.6 ACCESSORIES

STANDARD
ACCESSORIES

- Power cable
- Fuses
- Test post red 5322 264 30351
- Test post black 5322 264 30352
- Users Manual 4822 872 10158

OPTIONAL
ACCESSORIES

- PM 9540/BAN, 4-WIRE TEST CABLE with banana plugs
- PM 9540/TWE, SMD TWEEZERS
- PM 9541A, 4-WIRE TEST CABLE
- PM 9542A, RCL ADAPTER with 2 single test posts and 1 double test post
- PM 9542SMD, SMD ADAPTER
- PM 9563, RACK MOUNT KIT (3E high)
- PM 9564, RACK MOUNT KIT (2E high)
- Service Manual 4822 872 15161
- Test Set 5322 310 10634

Chapter **5**

PERFORMANCE TEST

5 PERFORMANCE TEST

5.1 INTRODUCTION

This chapter describes the performance test for the key parameters of the PM6303A RCL Meter using the instrument specifications in Chapter 4 as the performance standard.

These performance tests may be used as an acceptance test upon receipt of the instrument, as an indication that repair and/or adjustment is required, or as a performance verification after repair or adjustment of the instrument.

The PM6303A must be warmed up with all covers in place for at least 5 minutes before starting the tests. The reference conditions, described in Sections 4.3 and 4.4, must be met.

5.2 RECOMMENDED TEST EQUIPMENT

AC rms Voltmeter FLUKE 8920A
DC Voltmeter Philips PM 2535
Counter PHILIPS PM 6665

For the voltmeter and counter, no critical specification is required.

2 Single Test Posts PM6303A standard accessory

Test Set of precision metal film resistors and capacitor, code no. 5322 264 30353.

Quantity	Component Value	Max. Tolerance for Test
1	R 1 Ω (see label)	± 0.05 % (of labeled value)
1	R 34.8 Ω	± 0.05 %
1	R 3.48 k Ω	± 0.05 %
1	R 34.8 k Ω	± 0.05 %
1	R 348 k Ω	± 0.05 %
1	R 3 M Ω	± 0.05 %
1	R 100 M Ω	± 1 %
1	C 10 nF (see label)	± 0.05 % (of labeled value)

If you use your own test components, the values of which are exactly known, the test result must be calculated accordingly (instrument tolerance is ± 0.25 %, or ± 5 % for 100 M Ω , each ± 1 digit).

5.3 SELF-TEST ROUTINE, ERROR MESSAGES

After power on, the instrument checks the PROM, the processor RAM, and the external RAM. After that, it displays the current software version (Vx.x) and automatically recalls its settings before power off. The instrument also generates error messages if there are faults during measurements or trimming.

A possible fault is indicated as follows:

Err?

The digits mean:

- 1 = PROM checksum error
- 2 = Error in processor RAM
- 3 = External RAM defective
- 4 = Error in backup memory

During normal operation the instrument checks the trim data, the measurement range setting, the counter, and the communication to the storage register. **Error Messages** indicate the following:

- 5 = Trim data error
- 6 = Error of measurement range setting
- 7 = Counter overflow
- 8 = Error of reference measurement

5.4 PERFORMANCE VERIFICATION

5.4.1 Measurement Voltage

No component connected to PM6303A.

Test equipment: AC rms Voltmeter, DC Voltmeter

- Set PM6303A to AUTO and to DC BIAS OFF.
- Connect the AC rms voltmeter with tips to pin 8 (HIGH terminal) and pin 1 (circuit ground) of the round connector.
Pin 1 must be connected to the outer part (ground) of the BNC connector of the voltmeter.



Test result: 1.8 to 2.2 V rms

- Connect the DC voltmeter to pin 8 and pin 1.
- Set PM6303A to DC BIAS ON.

Test result: 1.8 to 2.2 V dc

5.4.2 Measurement Frequency

Test equipment: Counter

- Press the **DC BIAS OFF** key.
- Set counter to 1 s gate time.
- Connect counter with tips between pin 8 and 1 of the round connector.

Test result: 999.75 to 1000.25 Hz

5.4.3 Open-Circuit Trimming

- Insert the two single test posts into the **two left** positions (logos face to face).
- Press the **Cp or Lp** key.
- Press the **ZERO TRIM** key.

Test result:

The display shows **BUSY PASS** and finally **0.0 pF**

- Press the **Rp** key.

Test result:

The display shows overrange **- - - - (flashing)**

5.4.4 Short-Circuit Trimming

- Short circuit the test posts by a clean wire, with a minimum diameter of 1 mm.
- Press the **Rs** key.
- Press the **ZERO TRIM** key.

Test result:

The display shows **BUSY PASS** and finally **0.000 Ω**

5.4.5 Resistor Measurement

- Set the PM6303A to AUTO.

For test 1, the 1 Ω resistor must completely be inserted into the test posts.

The **test result** is calculated in accordance with the instrument tolerance ($\pm 0.25\%$ or $\pm 5\%$ for 100 M Ω) and the resolution of the display, ± 1 digit in general.

Test	Component Value	Instrument Accuracy	Test Result
1	R 1 Ω (see label)	$\pm 0.25\%$	Value on label $\pm 0.25\% \pm 1$ digit
2	R 34.8 Ω	$\pm 0.25\%$	34.70 to 34.90 Ω
3	R 3.48 k Ω	$\pm 0.25\%$	3.470 to 3.490 k Ω
4	R 34.8 k Ω	$\pm 0.25\%$	34.70 to 34.90 k Ω
5	R 348 k Ω	$\pm 0.25\%$	347.0 to 349.0 k Ω
6	R 3 M Ω	$\pm 0.25\%$	2.992 to 3.009 M Ω
7	R 100 M Ω	$\pm 5\%$	94.9 to 105.1 M Ω

5.4.6 Capacitance/Inductance Measurement

After the measurement accuracy is checked by precision resistors, it is necessary to test the capacitance/inductance measurement function by only one capacitor measurement or by one dissipation factor measurement with one of the resistors:

Test	Component Value	Instrument Accuracy	Test Result
8 or 9	10 nF; exact value see label	$\pm 0.25 \%$	Value on label $\pm 0.25 \% \pm 1$ digit
	3.48 k Ω	not applicable	---- flashing display indicates overrange, i.e., dissipation factor >500

If you cannot meet the test result for test 8 it might be that the test capacitor has drifted from its labeled original value. Please check whether the capacitor should be measured again.

The measurement uncertainty must be $< 0.02 \%$.

You can also order a new capacitor; code number 5322 126 13738.

The original measurement date is indicated on the bag for the capacitor.

The capacitance drift is specified to $< 0.2 \%$ in 3 years.

According to our experience the drift is much lower: $< 0.04 \%$ in 3 years.

There are no capacitors with lower drift at the low price of this capacitor on the market.

If you have access to a low-drift standard capacitor in your calibration laboratory or elsewhere, please make use of.

Chapter **6**

LIMITED WARRANTY & LIMITATION OF LIABILITY

DECLARATION OF CONFORMITY

6 LIMITED WARRANTY & LIMITATION OF LIABILITY

Each Fluke product is warranted to be free from defects in material and workmanship under normal use and service. The warranty period is one year and begins on the date of shipment. Parts, product repairs and services are warranted for 90 days. This warranty extends only to the original buyer or end-user customer of a Fluke authorized reseller, and does not apply to fuses, disposable batteries or to any product which, in Fluke's opinion, has been misused, altered, neglected or damaged by accident or abnormal conditions of operation or handling. Fluke warrants that software will operate substantially in accordance with its functional specifications for 90 days and that it has been properly recorded on non-defective media. Fluke does not warrant that software will be error free or operate without interruption.

Fluke authorized resellers shall extend this warranty on new and unused products to end-user customers only but have no authority to extend a greater or different warranty on behalf of Fluke. Warranty support is available if product is purchased through a Fluke authorized sales outlet or Buyer has paid the applicable international price. Fluke reserves the right to invoice Buyer for importation costs of repair/replacement parts when product purchased in one country is submitted for repair in another country.

Fluke's warranty obligation is limited, at Fluke's opinion, to refund of the purchase price, free of charge repair, or replacement of a defective product which is returned to an Fluke authorized service center within the warranty period.

To obtain warranty service, contact your nearest Fluke authorized service center or send the product, with a description of the difficulty, postage and insurance prepaid (FOB Destination), to the nearest Fluke authorized service center. Fluke assumes no risk for damage in transit. Following warranty repair, the product will be returned to Buyer, transportation prepaid (FOB Destination). If Fluke determines that the failure was caused by misuse, alteration, accident or abnormal condition of operation or handling, Fluke will provide an estimate of repair costs and obtain authorization before commencing the work. Following repair, the product will be returned to the Buyer transportation prepaid and the Buyer will be billed for the repair and return transportation charges (FOB Shipping Point).

THIS WARRANTY IS BUYER'S SOLE AND EXCLUSIVE REMEDY AND IS IN LIEU OF ALL OTHER WARRANTIES, EXPRESS OR IMPLIED, INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. FLUKE SHALL NOT BE LIABLE FOR ANY SPECIAL, INDIRECT, INCIDENTAL OR CONSEQUENTIAL DAMAGES OR LOSSES, INCLUDING LOSS OF DATA, WHETHER ARISING FROM BREACH OF WARRANTY OR BASED ON CONTRACT, TORT, RELIANCE OR ANY OTHER THEORY.

Since some countries or states do not allow limitation of the term of an implied warranty, or exclusion or limitation of incidental or consequential damages, the limitations and exclusions of this warranty may not apply to every buyer. If any provision of this Warranty is held invalid or unenforceable by a court of competent jurisdiction, such holding will not affect the validity or enforceability of any other provision.

product32994rjm

Fluke Corporation
P.O. Box 9090
Everett, WA
98206-9090
USA

Fluke Industrial B.V.
P.O. Box 680
7600 AR
Almelo
The Netherlands

FLUKE.

DECLARATION OF CONFORMITY
for

FLUKE
Automatic RCL Meter
PM 6303A

Manufacturer
Fluke Deutschland GmbH
Meiendorfer Str. 205
D-22145 Hamburg
Germany

Statement of Conformity

Based on test results using appropriate standards, the product is in conformity with
Electromagnetic Compatibility Directive 89/336/EEC
Low Voltage Directive 73/23/EEC

Sample tests

Standards used:

EN 55011 (1992)
Radio Frequency Product-Family Emission Standard

EN 50082-1 (1992)
Electromagnetic Compatibility; Generic Immunity Standard:
IEC 801-2 (1984), IEC 801-3 (1984), IEC 801-4 (1988)

HD 401 S1 (1988)
Safety Requirements for Electronic Measuring Apparatus:
IEC 348 (1978)

The tests have been performed in a typical configuration.

This Conformity is indicated by the symbol **CE**, i.e. "Conformité européenne".

FIGURES

SERVICE CENTRES

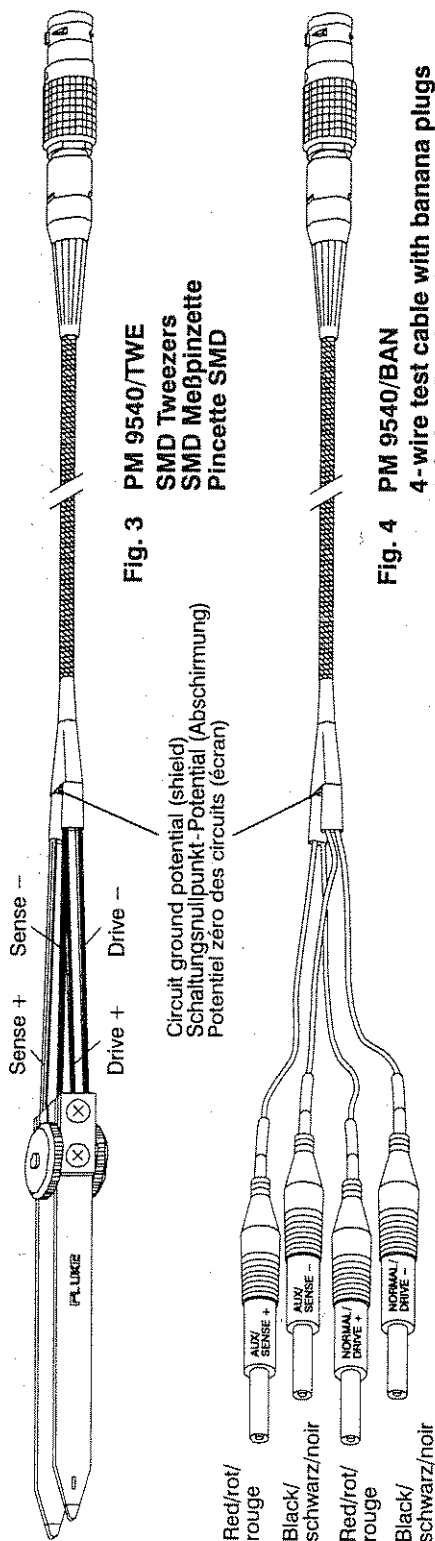


Fig. 3 PM 9540/TWE

SMD Tweezers
SMD Meßpinzette
Pincette SMD

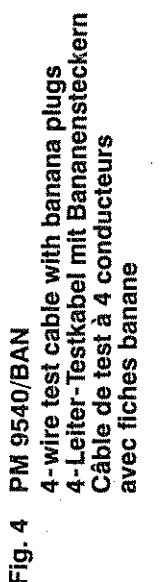


Fig. 4 PM 9540/BAN

Circuit ground potential (shield)
Schaltungsnullpunkt-Potential (Abschirmung)
Potential zéro des circuits (écran)

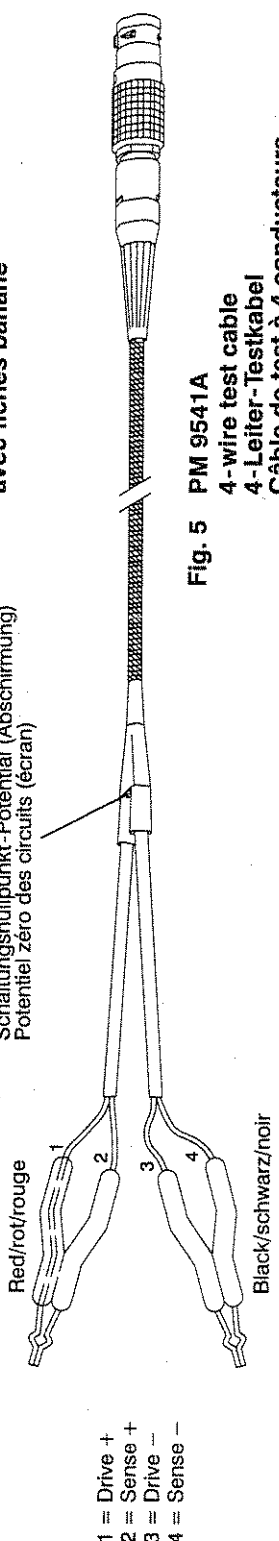


Fig. 5 PM 9541A

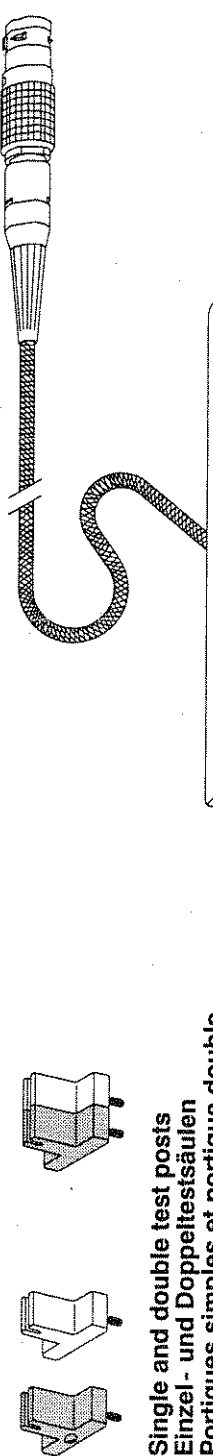


Fig. 6 Single and double test posts
Einzel- und Doppeltestsäulen
Portiques simples et portique double

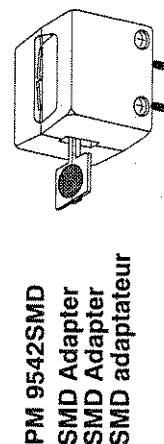


Fig. 7 PM 9542SMD



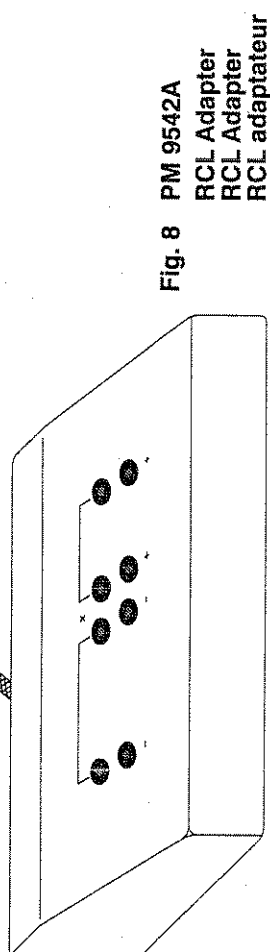


Fig. 8 PM 9542A

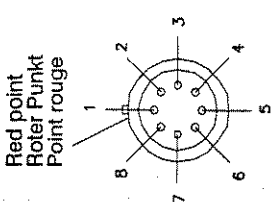


View into the plug
Blick in den Stecker
Vue avant du prise

- Pin 1 = Shield of sense - / circuit ground
- Pin 2 = Sense -
- Pin 3 = Shield of drive -
- Pin 4 = Drive -
- Pin 5 = Shield of Sense +
- Pin 6 = Sense +
- Pin 7 = Shield of Drive +
- Pin 8 = Drive +

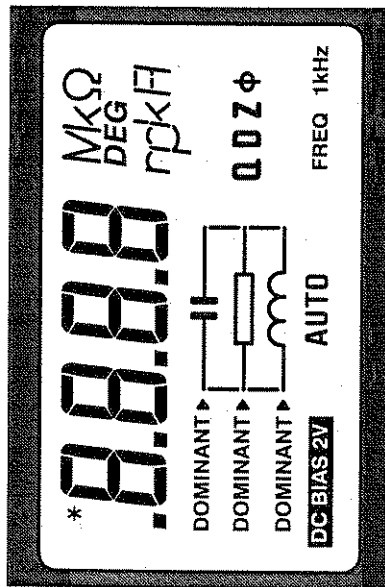


RESET
○

PARAMETER

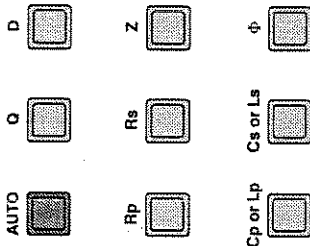


DC BIAS

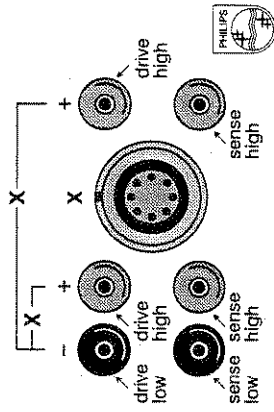


until serial number LO 646 605

Fig. 1
Front view
Frontansicht
Face avant

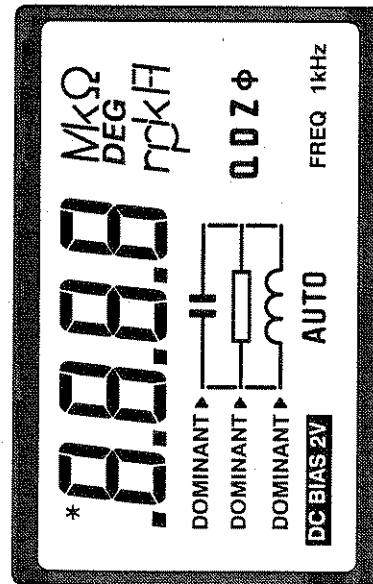


POWER
ON OFF


PARAMETER

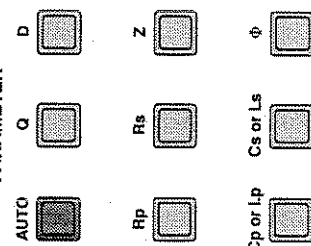

DC BIAS SOURCE

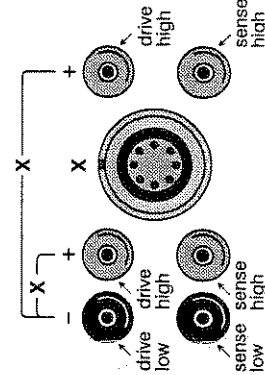


onwards serial number LO 646 606

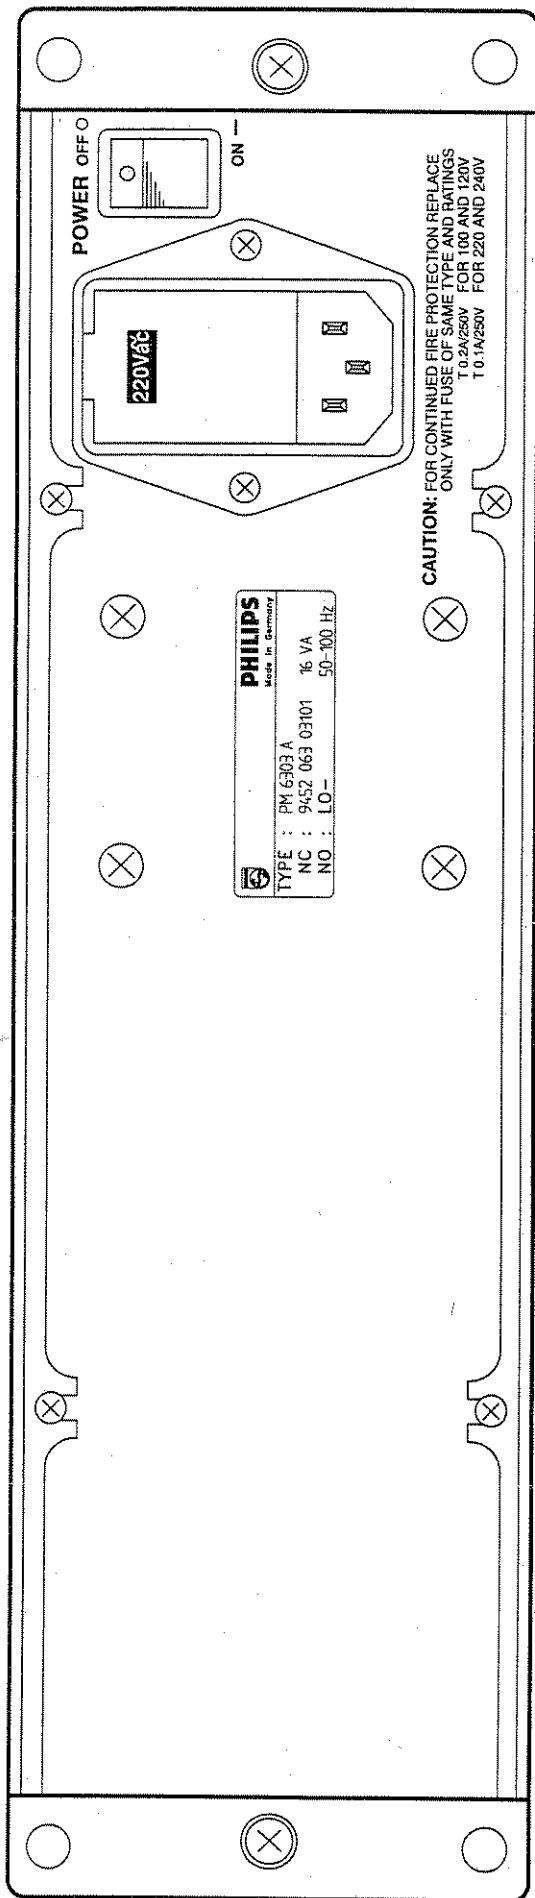

until serial number LO 646 605

Fig. 2
Rear view
Rückansicht
Face arrière

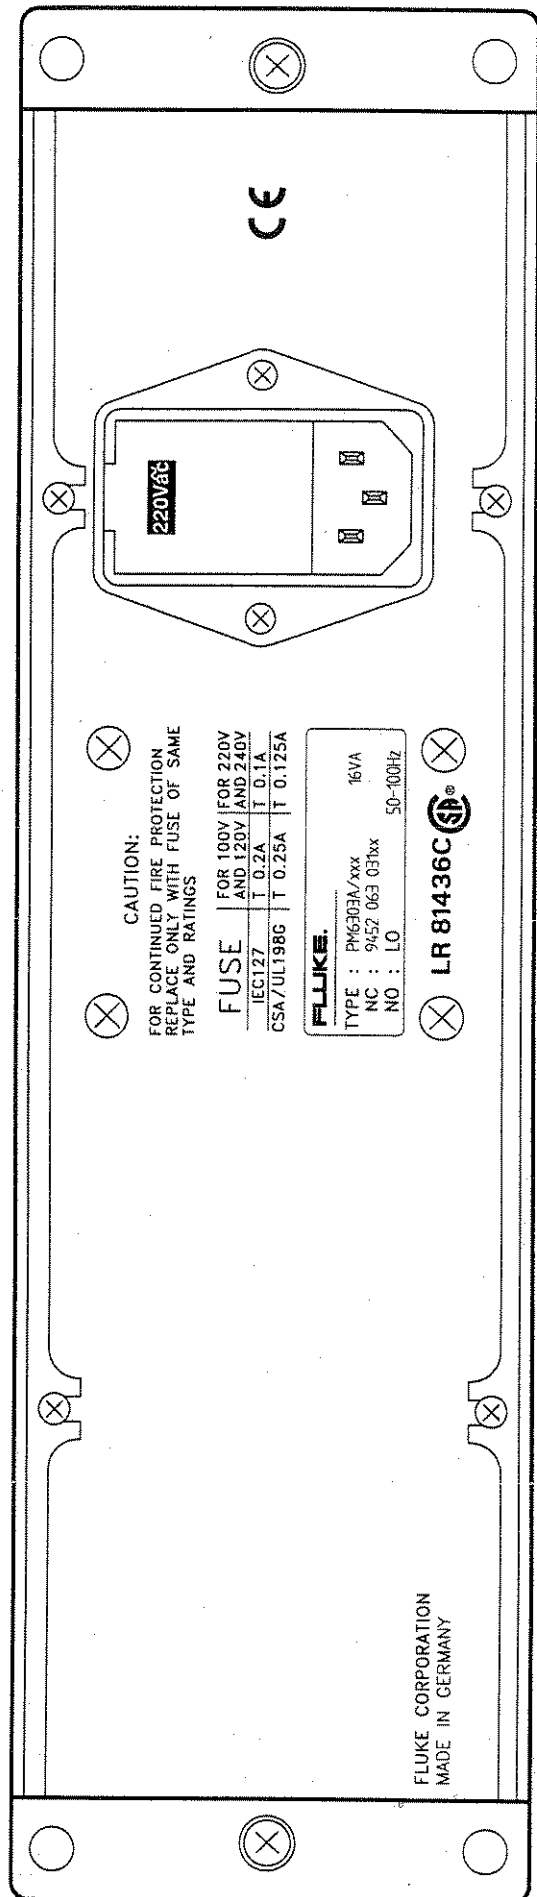

onwards serial number LO 646 606

SERVICE CENTERS

Argentina

Viditec S.A.
Lacarra 234
Buenos Aires CP 1407
Phone: +54-1-636-1200
Fax: +54-1-636-2185

Australia

Philips Scientific & Industrial,
Pty., Ltd.
34 Waterloo Road
North Ryde, N.S.W. 2113
Phone: +61-2-888-8222
Fax: +61-2-888-0440

Austria

Fluke Vertriebsges GmbH
Südstrandstraße 7
P.O. Box 10
A 1232 Wien
Phone: +43-1-61410-30
Fax: +43-1-61410-10

Bahrain

Mohammed Fakhroo & Bros.
P.O. Box 439 Bahrain
Phone: +973-253529
Fax: +973-275996

Belgium

N.V. Fluke Belgium S.A.
Sales & Service Department
Langeveldpark - Unit 5 & 7
P. Basteleusstraat 2 - 4 - 6
1600 St. Pieters-Leeuw
Phone: +32-2-331-2777
[Ext 218]
Fax: +32-2-331-1489

Bolivia

Coasin Bolivia S.R.L.
Casilla 7295
Calle Ayacucho No. 208
Edificio Flores, 5to. Piso
La Paz
Phone: +591-2-317531
Fax: +591-2-317545

Brazil

Sistest
Av. Ataulfo De Paiva
135 S/ 1117 - Leblon
22.449-900 - Rio De Janeiro
Phone: +55-21-259-5755
Fax: +55-21-259-5743

Brazil

Sigtron Instrumentos E. Servicos
Ltda
Rua Alvaro Rodrigues
269 - Brooklin
Sao Paulo
Phone: +55-11-240-7359
Fax: +55-11-533-3749

Brazil

Philips Medical Syst., Ltda.
Av. Interlagos North
3493 - Campo Grande
04661-200 Sao Paulo S.P.
Phone: +55-11-523-4811
Fax: +55-11-524-4873 (ID2148)

Bulgaria

Ac Sophilco
Customer Support Services
P.O. Box 42
1309 Sofia
Phone: +359-2-292-1815
Fax: +359-2-292-1915

Canada

Fluke Electr. Canada, Inc.
400 Britannia Road East, Unit #1
Mississauga, Ontario
L4Z 1X9
Phone: +1-905-890-7600
Fax: +1-905-890-6866

Chile

Intronica
Instrumentacion Electronica
S.A.C.I
Guardia Vieja 181 Of. 503
Casilla 16500
Santiago 9
Phone: +56-2-232-3888
Fax: 56-2-231-6700

China

Fluke Int'l Corporation
Room 2111 Scite Tower
Jianguomenwai Dajie
Beijing 100004, Prc
Phone: +86-10-512-3436
Fax: +86-10-512-3437

China

China Academy Of Science
Guangzhou Institute Of
Ele. Researc
100 Xian Lie Road Central
Guangzhou
Phone: +86-20-776-9464
Fax: +86-20-776-9464

Colombia

Sistemas E Instrumentacion, Ltda.
Calle 83, No. 37-07 Barrio Patria
Ap. Aereo 29583 Bogota
Phone: +57-1-635-7266
Fax: +57-1-623-3334

Costa Rica

Electronic Engineering, S.A.
Carretera De Circunvalacion
Sabanilla Av. Novena
P.O. Box 4300-1000
San Jose
Phone: +506-*253-3759
Fax: +506-*225-1286

Countries not listed

For Eastern Europe And Middle
East
Export Sales
Science Park Eindhoven 5110
5692 EC Son
The Netherlands
Phone: +31-402-678 265
Fax: +31-402-678 260

Croatia

Kaltim - Zagreb
Fluke Sales & Service
Draga 8
41425 Sveta Jana
Phone: +385-41-837115
Fax: +385-41-837237

Cyprus

D. Ouzounian, M. Soultanian & Co.
P.O. Box 1775
Nicosia
Phone: +357-2-442220
Fax: +357-2-459885

Czech Republic

Eiso
NA. Berance 2
16000 Prague 6
Phone: +42-2-316-4810
Fax: +42-2-364-986

SERVICE CENTERS

Czech Republic

Eiso
Branch Office
Optatova 17a
63700 Brno
Phone: +42-5-41220263
Fax: +42-5-524742

Denmark

Fluke Danmark A/S
Ejby Industrivej 40
DK 2600 Glostrup
Phone: +45-43-44-1900
Fax: +45-43-43-9192

Ecuador

Proteco Coasin Cia., Ltda.
Av. 12 de Octubre 2449 y
Orellana
P.O. Box 17-03-228-A
Quito
Phone: +593-2-230283
Fax: +593-2-561980

Egypt

EEMCO
Nasr City
19 Shararah Bldgs.
Hassan Mamoun Street
Cairo
Phone: +20-2-2718873
Fax: +20-2-2718873

Finland

Fluke Finland Oy
Sinikalliontie 5
P.L. 151
SF 02631 Espoo
Phone: +358-0-61525-620
Fax: +358-0-61525-630

France

Fluke France S.A.
37, rue Voltaire
B.P. 112
93700 Drancy
Phone: +33-1-4896-6310
Fax: +33-1-4896-6330

Germany

Fluke Deutschland GmbH
Oskar Messter Straße 18
85737 Ismaning
München
Phone: +49-89-99611-260
Fax: +49-89-99611-270

Germany

Fluke Deutschland GmbH
Meiendorfer Straße 205
22145 Hamburg
Phone: +49-40-67 960 434
Fax: +49-40-67 960 421

Greece

George D. Zis & SIA O.E.
Fluke Sales & Service
Zacharitsa 27
117 41 Athens
Phone: +30-1-922 1581
Fax: +30-1-924 9087

Hong Kong

Schmidt & Co., Ltd.
1st Floor
323 Jaffe Road
Wanchai
Phone: +852-2223-5623
Fax: +852-2834-1848

Hungary

Mta-Mmsz Kft.
Etele Ut. 59 - 61
P.O. Box 58
H 1502 Budapest
Phone: +361-203-4319
Fax: +361-203-4328

Hungary

MTA-MMSZ Kft.
Etele Ut. 59 - 61
P.O. Box 58
H 1502 Budapest
Phone: +361-203-4298
Fax: +361-203-4353

Iceland

Taeknivai Hf
P.O. Box 8294
Skeifunni 17
128 Reykjavik
Phone: +354-550-4000
Fax: +354-550-4001

India

Hinditron Services Pvt., Ltd.
204-206 Hemkunt Tower
98 Nehru Place
New Delhi 110 019
Phone: +91-11-641-3675
Fax: +91-11-642-9118

India

Hinditron Services Pvt., Ltd.
Castle House, 5th Floor
5/1 A, Hungerford Street
Calcutta 700 017
Phone: +91-33-247-9094
Fax: +91-33-247-6844

India

Hinditron Services Pvt., Ltd.
Emerald House, 5th Floor
114 Sarojini Devi Road
Secunderabad 500 003
Phone: +91-40-844033
Fax: +91-40-847585

India

Hinditron Services Pvt., Ltd.
Hinditron House, 23-B
Mahal Industrial Estate
Mahakali Caves Road,
Andheri East
Mumbai 400 093
Phone: +91-22-836-4560
Fax: +91-22-836-4682

India

Hinditron Services Pvt., Inc.
33/44A 8th Main Road
Raj Mahal Vilas Extension
Bangalore 560 080
Phone: +91-80-334-8266
Fax: +91-80-334-5022

Indonesia

P.T. Daeng Brothers
Philips House
J/n H.R. Rasuna Said Kav. 3-4
Jakarta 12950
Phone: +62-21-520-1122
Fax: +62-21-520-5189

Israel

R.D.T Equipment & Systems
(1993) Ltd.
P.O. Box 58072
Tel Aviv 61580
Phone: +972-3-645-0745
Fax: +972-3-647-8908

Italy

Fluke Italia S.R.L.
Viale Delle Industrie, 11
20090 Vimodrone (MI)
Phone: +39-2-268-434-203
Fax: +39-2-250-1645

SERVICE CENTERS

Japan

Fluke Corporation Japan
Sumitomo Higashi Shinbashi
Bldg.
1-1-11 Hamamatsucho
Minato-ku, Tokyo 105
Phone: +81-3-3434-0181
Fax: +81-3-3434-0170

Jordan

Jordan Medical Supplies and
Services
P.O. Box 140415
Amman 11814
Phone: +962-6-699353
Fax: +962-6-663556

Korea

Fluke Korea Co., Ltd.
5th Floor, Juan Bldg
646-14, Yuksam-Dong
Kangnam-Ku
Seoul 135-080
Phone: +82-2-539-6311
Fax: +82-2-539-6311

Kuwait

Yusuf A. Alghanim & Sons
W.L.L.
P.O. Box 223 Safat
Alghanim Industries
Airport Road Shuwaikh
13003 Kuwait
Phone: +965-4842988
Fax: +965-4847244

Lebanon

DC Electronics S.A.R.L.
Autostrada Dora
Hayek Building
P.O. Box 90
1388 Beirut
Phone: +961-1-884271
Fax: +961-1-898842

Macedonia

Tehnokom
Koco Racin 42
91000 Skopje
Phone: +389-91-236817
Fax: +389-91-236851

Malaysia

Cnn Sdn. Bhd.
17D, 2nd Floor
Lebuhraya Batu Lancang
Taman Seri Damai
11600 Jelutong Penang
Phone: +60-4-657-9584
Fax: +60-4-657-0835

Malta

Cam Services Ltd.
Cam Centre
Triq 1 - Industria
Qormi QRM 09
Phone: +356-484640
Fax: +356-447174

Mexico

Metrologia Y Calibraciones Ind.,
S.A. De C.V.
Industrial S.A. De C.V.
Calle Diagonal No. 27 - 4 Piso
Colonia Del Valle
Mexico 03100 D.F.
Phone: +52-5-682-8040
Fax: +52-5-687-8695

Netherlands

Fluke Nederland B.V.
Customer Support Services
Science Park Eindhoven 5108
5692 EC Son
Phone: +31-402-678 310
Fax: +31-402-678 321

New Zealand

Philips Scientific & Industrial,
Pty., Ltd.
Private Bag 41904
St. Lukes, 2 Wagener Place
Mt. Albert
Auckland 3
Phone: +64-9-849-4160
Fax: +64-9-849-7814

Norway

Fluke Norge A/S
Customer Support Services
P.O. Box 6054
Etterstad
N 0601 Oslo
Phone: +47-22-65-3400
Fax: +47-22-65-3407

Pakistan

Philips Electrical Industries Of
Pakistan Ltd.
Islamic Chamber of Commerce
St-2/A, Block 9
KDA Scheme 5, Clifton
Karachi 75600
Phone: +92-21-587-4641
Fax: +92-21-577-0348

Peru

Importaciones &
Representaciones
Jr. Pumacahua 955
Lima 11
Phone: +51-14-235099
Fax: +51-14-310707

Philippines

Spark Electronics Corporation
P.O. Box 610, Greenhills
Metro Manila 1502
Phone: +63-2-700621
Fax: +63-2-721-0491

Poland

Electronic Instrument Service
(E.I.S.)
UL. Malechowska 6
60 188 Poznan
Phone: +48-61-681998
Fax: +48-61-682256

Portugal

ARESAGANTE
Representacoes Estudos e
Servicos, Lda.
Rua Oliveira Gaio, 333 P/C, Esq.
4465 S.Mamede Infesta
Phone: +351-2-906.00.22
Fax: +351-2-901.68.72

Qatar

Darwish Trading Co.
P.O. Box 92
Doha
Phone: +974-422781
Fax: +974-417599

Rep. of Belarus

Component & Systems Ltd.
7, Melnikaitė Str.
220004 Minsk
Phone: +375-172-292103
Fax: +375-172-292110

Romania

RONEXPRIM S.R.L.
Str. Transilvaniei Nr. 24
70778 Bucharest - I
Phone: +40-1-6143597
Fax: +40-1-6594468

Russia

Swemel Innovation Enterprise
15, 4-Th Likhachevskiy Lane
125438 Moscow
Phone: +7-095-154-5181
Fax: +7-095-154-0201

SERVICE CENTERS

Russia C.I.S.

Infomedia
Petrovsko Razumovsky
Proezd. 29
103287 Moscow
Phone: +7-095-2123833
Fax: +7-095-2123838

Saudi Arabia

A. Rajab & Silsilah Co.
Sales & Service Department
P.O. Box 203
21411 Jeddah
Phone: +966-2-6610006
Fax: +966-2-6610558

Singapore

Fluke Singapore Pte., Ltd.
#27-03 PSA Building
460 Alexandra Road
Singapore 119963
Phone: +65*-276-5161
Fax: +65*-276-5929

Slovak Republic

Eiso
Stef nikova 20
911 01 Trenčin
Phone: +42-8313-1410
Fax: +42-8313-1592

Slovenia

Micom Electronics d.o.o.
Resljeva 34
61000 Ljubljana
Phone: +386-61-317830
Fax: +386-61-320670

Slovenia

Elacss d.o.o.
Medvedova 28
61000 Ljubljana
Phone: +385-61-317178
Fax: +385-61-301595

South Africa

Spescom Measuregraph Pty., Ltd.
SPESCOM Park
Cm. Alexandra Rd. & Second St.
Halfway House
Midrand 1685
Phone: +27-11-315-0757
Fax: +27-11-805-1192

Spain

Fluke Ib,rica S.L.
Centro Empresarial Euronova
C/Ronda De Poniente, 8
28760 - Tres Cantos
Madrid
Phone: +34-1-804-2301
Fax: +34-1-804-2496

Sultanate Of Oman

Mustafa & Jawad Science &
Industry Co. LLC.
P.O. Box 1918
112 Ruwi - Muscat
Phone: +968-602009
Fax: +968-607066

Sweden

Fluke Sverige AB
P.O. Box 61
S 164 94 Kista
Phone: +46-8-751-0235
Fax: +46-8-751-0480

Switzerland

Fluke Switzerland A.G.
Rütistrasse 28
CH 8952 Schlieren
Phone: +41-1-730-3310
Fax: +41-1-730-3720

Taiwan, R.O.C.

Schmidt Scientific Taiwan, Ltd.
6f, No. 109, Tung Hsing St.
Taipei
Phone: +886-2-767-8890
Fax: +886-2-767-8820

Thailand

Measuretronix Ltd.
2102/31 Ramkamhang Road
Bangkok 10240
Phone: +66-2-375-2733
Fax: +66-2-374-9965

Turkey

Pestas Prof. Elektr. Sistemler
Tic. ve San. A.S.
Meydan Sokak
Meydan Apt. No. 6/23
Akatlar 80630
Istanbul
Phone: +90-212-2827839
Fax: +90-212-283-0987

U.A.E.

Hans Al-Afaq Ltd.
P.O. Box 8141
Dubai
Phone: +971-4-283623
Fax: +971-4-281285

U.S.A.

Fluke Corporation
Service Center - Palatine
1150 W. Euclid Avenue
Palatine, IL 60067
Phone: +1-847-705-0500
Fax: +1-847-705-9989

U.S.A.

Fluke Corporation
Service Center - Paramus
West 75 Century Road
Paramus, NJ 07652-0930

U.S.A.

Fluke Corporation
Service Center - Everett
P.O. Box 9090
Everett, WA 98206-9090
Phone: +1-206-356-5531
Fax: +1 206 356 6390

U.S.A.

Fluke Calibration Center
C/o Flw Service Corporation
3505 Cadillac Ave., Bldg E.
Costa Mesa, Ca 92626
Phone: +1-714-863-9031
Fax: +1-714-751-0213

U.S.A.

Fluke Corporation
Service Center
42711 Lawrence Place
Fremont, CA 94538
Phone: +1-510-651-5112
Fax: +1-510-651-4962

U.S.A.

Fluke Corporation
Service Center - Dallas
2104 Hutton Drive
Suite 112
Carrollton, TX 75006
Phone: +1-214-406-1000
Fax: +1-214-247-5642

SERVICE CENTERS

United Kingdom

Fluke United Kingdom Ltd.
Colonial Way
Watford
Hertfordshire WD2 4TT
Phone: +44-1923-240511
Fax: +44-1923-212157

Uruguay

Coasin Instrumentos S.A.
Acevedo Diaz 1161
11200 Montevideo
Montevideo
Phone: +598-2-492-436
Fax: +598-2-492-199

Venezuela

Coasin C.A.
Calle 9 Con Calle 4
Edif Edinurbi Piso - 3
La Urbina
Caracas 1070-A
Phone: +58-2-242-7466
Fax: +58-2-241-1939

Vietnam

Schmidt-Vietnam Co., Ltd.
8/f. Schmidt Tower
Hanoi International Technology
Ctr
Km8, Highway 32, Cau Giay
Tu Liem, Hanoi
Phone: +84-4-8346-186
Fax: +84-4-8346-188

All other countries

Fluke Corporation
P.O. Box 9090
Mail Stop 268C
Everett, WA 98206-9090
USA

July-1996

Artisan Technology Group is an independent supplier of quality pre-owned equipment

Gold-standard solutions

Extend the life of your critical industrial, commercial, and military systems with our superior service and support.

We buy equipment

Planning to upgrade your current equipment? Have surplus equipment taking up shelf space? We'll give it a new home.

Learn more!

Visit us at [artisanTG.com](https://www.artisanTG.com) for more info on price quotes, drivers, technical specifications, manuals, and documentation.

Artisan Scientific Corporation dba Artisan Technology Group is not an affiliate, representative, or authorized distributor for any manufacturer listed herein.

We're here to make your life easier. How can we help you today?

(217) 352-9330 | sales@artisanTG.com | [artisanTG.com](https://www.artisanTG.com)

