

ARTISAN®
TECHNOLOGY GROUP

Your **definitive** source for quality pre-owned equipment.

Artisan Technology Group
(217) 352-9330 | sales@artisantg.com | artisantg.com

Full-service, independent repair center
with experienced engineers and technicians on staff.

We buy your excess, underutilized, and idle equipment
along with credit for buybacks and trade-ins.

Custom engineering
so your equipment works exactly as you specify.

- Critical and expedited services
- In stock / Ready-to-ship
- Leasing / Rentals / Demos
- ITAR-certified secure asset solutions

Expert team | Trust guarantee | 100% satisfaction


All trademarks, brand names, and brands appearing herein are the property of their respective owners.

Find the *Heidenhain ND221* at our website: ***Click HERE***

HEIDENHAIN

Working with the measured value display unit

ND 221

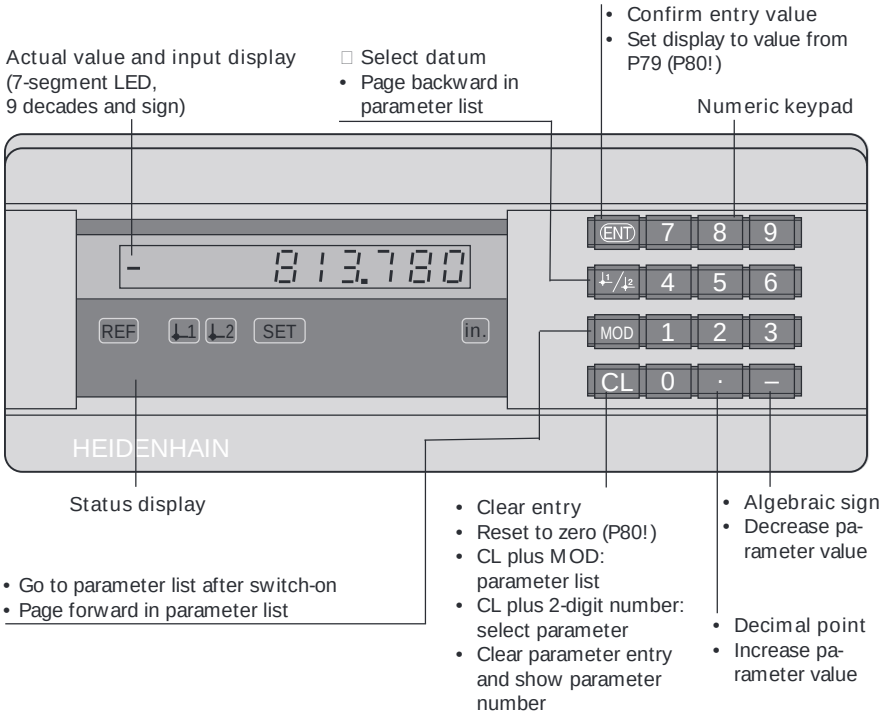

Indicator	Meaning
REF	If decimal points are blinking: Display is waiting for the reference mark to be crossed over. If decimal points are not blinking: Reference mark was crossed over – datum points are now stored in nonvolatile memory. Blinking: Waiting for operator to press ENT or CL.
in.	Position values displayed in inches.
⊥1 / ⊥2	Datum 1 / Datum 2 currently active.
SET	Blinking: Waiting for operator to confirm entry values.


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

The ND 221 is designed primarily for use with HEIDENHAIN MT Length Gauges. MT gauges feature one reference mark. When the reference mark is crossed over, it generates a signal identifying that position as a reference point.

After switch-on, simply crossing over the reference mark re-establishes the relationship between axis positions and display values as it was last defined by datum setting.

It is also possible to use other photoelectric linear encoders (see " Parameter Settings for HEIDENHAIN Linear Encoders"). These encoders have one or more reference marks, which may also be *distance-coded*. With distance-coded reference marks, a maximum traverse of only 20 mm after switch-on suffices to re-establish the datum.

Switch-On

0 ➤ 1 Ent...CL	Turn on the power (switch located on rear panel) • Display shows ERR. . .CL. • REF blinks.
ENT 5 , 6 9 7	Switch on reference mark evaluation • The display shows the value last assigned to the reference mark position. • REF indicator glows. • Decimal point blinks.
	Cross over reference mark Move the axis until the display becomes active and the decimal point no longer blinks.

If you do not wish reference mark evaluation, press CL instead of ENT.

Setting the Datum

The datum setting procedure assigns a display value to a specific axis position. The ND 221 allows you to set two separate datum points.

↓1/↓2	Select datum 1 or 2.
4 0 4 0	Enter a value, such as 40.
ENT	Confirm entered value.

You can switch from one datum to the other at any time.
Use datum 2 when you want to display incremental dimensions.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Operating Parameters

The parameters are divided into “ user parameters“ and “ protected operating parameters," which can only be accessed by entering a code number.

User parameters

User parameters are operating parameters that you can change without entering the code number: They are designated P00 to P30, P50, P51, P79, P86

Calling user parameters

To call user parameters immediately after switch-on:

➤ Press the MOD key as long as [ENT. . .CL] is visible in the display.

To call user parameters during operation:

➤ Press and hold the CL key, then press MOD.

To go directly to a specific user parameter:

➤ Press and hold the CL key, then press the first digit of the parameter number.

➤ Release both keys and press the second digit.

Protected operating parameters

Before you can change protected operating parameters you must enter the code number 95 148 through [P00 CODE] : They remain accessible until you switch off the position display.

To page through the parameter list

➤ Forward paging: Press the MOD key.

➤ Backward paging: Press the ⊥1 / ⊥2 key.

By paging on, you automatically enter any change you've made in a parameter.

To change operating parameters

➤ Increase the parameter value with the decimal point key, or

➤ Decrease the parameter value with the minus key, or

➤ Enter the numerical value for the operating parameter, e.g. for P41 ([SET] blinks).

To correct your entries and show the parameter designation

➤ Press the CL key.

To exit the operating parameters

➤ Press ENT. All changes made become effective.

Operating Parameter List

Parameter	Meaning	Function / Effect	Setting
P00 CODE	Enter code number 95 148 to change a protected operating parameter.		
P01 INCH	Unit of measure	Display in millimeters	OFF
		Display in inches	ON
P30 DIR *Direction*	Counting direction	Normal (*Positive*)	POS
		Inverse (*Negative*)	NEG
P32 SUBD *Subdivision*	Subdivision of encoder signal period 400, 320, 256, 200, 160, 128, 100, 80, 50, 40, 20, 10, 8, 5, 4, 2, 1, 0.8, 0.5, 0.4, 0.2, 0.1		

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Operating Parameter List — *continued*

Parameter	Meaning	Function / Effect	Setting
P33 StEP	Counting mode	0 - 1 - 2 - 3 - 4 - 5 - 6 - 7 - 8 - 9 - 0	1
		0 - 2 - 4 - 6 - 8 - 0	2
		0 - 5 - 0	5
P38 dEC *Decimal point*	Decimal places 1 / 2 / 3 / 4 / 5 / 6 (up to 8 with inch display)		
P41 COMP *Compensation*	Linear error compensation[1)] –99 999,9 < P41 < + 99 999,9 [µm/m]		
P43 rEF	Reference marks	One reference mark	SINGLE
		Distance-coded with 500 • SP (SP = signal period)	500
		Distance-coded with 1000 • SP (e.g. for LS 303 C / LS 603 C)	1000
		Distance-coded with 2000 • SP	2000
		Distance-coded with 5000 • SP	5000
P44 rEF	Reference mark evaluation	Evaluation	rEF On
		No evaluation	rEF OFF
P45 EnCd *Encoder*	Encoder monitoring	No monitoring (*Alarm Off*)	ALAr. OFF
		Contamination	ALAr. C
		Frequency	ALAr. F
		Contamination and frequency	ALAr. CF
P50 U24	Baud rate bAUd	110, 150, 300, 600, 1200, 2400, 4800, 9600	
P51 U24	Additional line feeds L InEFd.	0 to 99 (*Linefeed*)	
P79 PrSt *Preset*	Value for datum	Enter numerical value for datum setting with the ENT key	
P80 SEt	Reset/ Preset	No zero reset/preset with CL/ENT	SEt OFF
		Zero reset with CL (*Set Zero*), no preset with ENT	SEt ZEro
		Zero reset with CL and preset with ENT to value in P79	PrESEt
P82 MESG *Message*	Display after switch-on	ENt. .CL message displayed	MESG On
		ENt. .CL message not displayed	MESG OFF
P86 Mod *Mode*	Inhibit PRINT function	PRINT inhibited	Pr Int OFF
		PRINT not inhibited	Pr Int On

1) Determine entry value for P41

Example: Displayed measuring length L_a = 620.000 mm
Actual length (determined with, for example, the VM 101 comparator system from HEIDENHAIN) L_t = 619.876 mm
Length difference $\Delta L = L_t - L_a = -124$ µm
Compensation factor k:
$k = \Delta L / L_a = -124$ µm / 0.62 m = –200 [µm/m]

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Parameter Settings for HEIDENHAIN Linear Encoders

Model	Signal period [µm]	Reference marks	P 43	Display step (unit: P01) mm	Display step (unit: P01) inches	The following settings apply for mm: Subdivision P32	Count. mode P33	Decimal places P38
CT	2	one	single	0,0005	0,00002	4	5	4
MT xx01				0,0002	0,00001	10	2	4
LIP 401		none	-	0,0001	0,000005	20	1	4
		one	single	0,00005	0,000002	40	5	5
				Recommended only for LIP 401				
				0,00002	0,000001	100	2	5
				0,00001	0,0000005	200	1	5
				0,000005	0,0000002	400	5	6
LF 103	4	one	single	0,001	0,00005	4	1	3
LF 401		dist.c.	5000	0,0005	0,00002	8	5	4
LIF 101				0,0002	0,00001	20	2	4
LIP 501				0,0001	0,000005	40	1	4
LIP 101		one	single	0,00005	0,000002	80	5	5
				Recommended only for LIP 101				
				0,00002	0,000001	200	2	5
				0,00001	0,0000005	400	1	5
MT xx	10	one	single	0,0005	0,00002	20	5	4
				0,0002	0,00001	50	2	4
				0,0001	0,000005	100	1	4
LS 303	20	one	single	0,01	0,0005	2	1	2
LS 603		dist.c.	1000	0,005	0,0002	4	5	3
LS 106	20	one	single	0,001	0,00005	20	1	3
LS 406		dist.c.	1000	0,0005	0,00002	40	5	4
LS 706								
ST 1201		none	-					
LB 302	40	one	single	0,005	0,0002	8	5	3
LIDA 10x		dist.c.	2000	0,002	0,0001	20	2	3
				0,001	0,00005	40	1	3
				0,0005	0,00002	80	5	4
				Recommended only for LB 302				
				0,0002	0,00001	200	2	4
				0,0001	0,000005	400	1	4
LB 301	100	one	single	0,005	0,0002	20	5	3
		dist.c.	1000	0,002	0,0001	50	2	3
				0,001	0,00005	100	1	3
LIM 102	12800	one	single	0,1	0,005	128	1	1
				0,05	0,002	256	5	2

Example: Set parameters for any encoder
Linear encoder with signal period s = 10 µm
Desired display step a = 0.000 1 mm
Subdivision P32 = 0.001 □s / a **=** 100
Counting mode P33 = 1 (display counts 1, 2, 3 ...)
Decimal places of a: P38 = 4

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Data Output

There are two ways to output data:


- ➤ PRINT function: Press MOD (this method can be inhibited with operating parameter P86); or
- ➤ Enter the command STX (CTRL B) over the RXD input.

A connecting cable (to a PC, for example) is available from HEIDENHAIN (Id.-Nr. 274 545 ..); cable length up to 20 m (66 ft).

Operating parameters for data output: P50, P51

Wiring, pin layout

Connecting cable is either completely wired (left) or only partially wired (right).

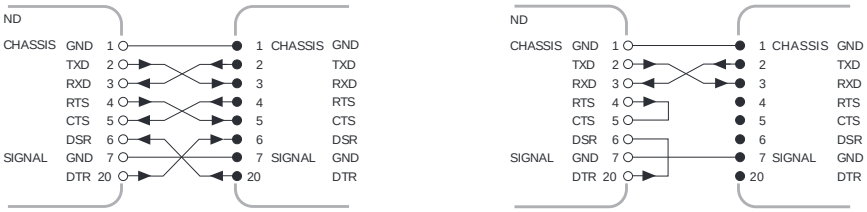

CHASSIS GND: Chassis Ground; TXD: Transmitted Data; RXD: Received Data; RTS: Request To Send; CTS: Clear To Send; DSR: Data Set Ready; SIGNAL GND: Signal Ground; DTR: Data Terminal Ready

Signals	Signal level "active"	Signal level "not active"
TXD, RXD	–3 V to –15 V	+3 V to +15 V
RTS, CTS, DSR, DTR	+3 V to +15 V	–3 V to –15 V

Data transfer format and transmission control characters

Format	ASCII code
Data word	1 start bit, 7 data bits, parity bit (even parity), 2 stop bits
Control characters	Call measured value: STX (CTRL B), interrupt DC3 (CTRL S), resume DC1 (CTRL Q) Enquire error message: ENQ (CTRL E)
Sequence	• Sign • Numerical value with decimal point • Blank space • Unit (blank space = mm, " = inches, ? = error) • 2 blank spaces • Carriage return • Line feed

Storage and transfer times

The duration of data transfer depends on the selected baud rate and on the number of additional line feeds.

Latch signal	Storage time	Data transfer time
STX (CTRL) B	≤ 1 ms	≤ 23 ms
PRINT	≤ 22 ms	≤ 44 ms

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Error Messages

To clear error message ERROR :
When you have removed the cause of the error,
➤ press CL.

Message	Cause and effect
ERROR 01	Last measured value not yet latched
ERROR 02	External device not ready for data transfer (ERROR 02 only appears once)
ERROR 03	Data interface: Parity error or wrong data transfer format
ERROR 10	Incorrect input value
ERROR 50	Encoder signal too weak (encoder may be contaminated)
ERROR 51	Input frequency too high for encoder input (will occur for example when the scale is moved too quickly)
ERROR 53	Internal counter overflow
ERROR 55	Error while crossing over reference marks
ERROR 80 ERROR 83 ERROR 84 ERROR 86	To clear the error message: Switch off the display unit. Should any of these error codes recur, contact your HEIDENHAIN service agency.
ERROR 94	Offset compensation values for encoder signals have been erased: contact your HEIDENHAIN service agency.
ERROR 99	Erase the operating parameters.

If all decimal points light up, the measured value is too large or too small.
In this case, set a new datum or retract.

Distance-To-Go Mode


The standard setting for the display unit is to show the encoder position value. Particularly on machine tools and for tasks in automation, however, it can be very helpful for the display to instead show the distance remaining to a manually entered nominal position. You can then position the tool by simply moving the axis to the display value zero. Code number 246 582 provides access to distance-to-go mode.

Display	Meaning
DELTA OFF	No distance-to-go display
DELTA ON	Distance-to-go display

“Traverse to zero” with distance-to-go display
➤ Select datum 2.
➤ Enter the nominal position.
➤ Move the axis to zero.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Rear Panel

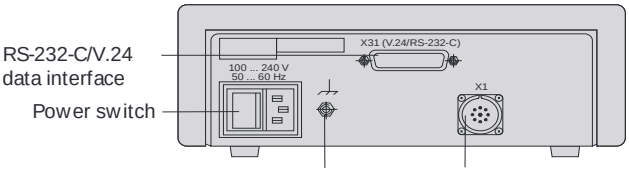


Input for HEIDENHAIN linear encoder with sinusoidal output signals (7μA_{PP} to 16 μA_{PP}), connecting cable max. 30 m (98.5 ft), maximum permissible input frequency 100 kHz

Interface X1 complies with the recommendations in EN 50 178 for separation from line power.

Installation

You can fix the display unit to a mounting surface with M4 bolts.

The units can also be stacked. Adhesive inserts (included in delivery) prevent them from sliding.

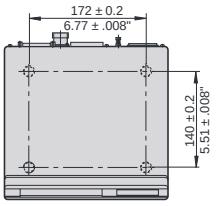

Power Supply and Connection

Danger of electrical shock!
Unplug the power cord before opening the housing.
Connect a protective ground. This connection must never be interrupted.

Danger to internal components!
Do not engage or disengage any connections while the unit is under power.
Use only original replacement fuses.

Primary-clocked power supply.
Voltage range 100 V to 240 V (–15% to +10 %) Frequency 48 Hz to 62 Hz
Power consumption typ. 8 W Line fuse F 1 A (in unit)
Minimum cross-section of power line: 0.75 mm^2

To increase the noise immunity, connect the ground terminal on the rear panel to the central ground point of the machine. (Minimum cross-section 6 mm^2)

Ambient Conditions

Temperature range	Operation: 0° C to + 45° C (32° F to 113° F) Storage: –30° C to + 70° C (–22° F to 158° F)
Rel. humidity	Annual average: < 75%; maximum: < 90%
Weight	1.5 kg

DR. JOHANNES HEIDENHAIN GmbH
Dr.-Johannes-Heidenhain-Straße 5
D-83301 Traunreut, Deutschland
☎ (08669) 31-0
FAX (08669) 5061

☎ Service (08669) 31-1272
☎ TNC-Service (08669) 31-1446
FAX (08669) 9899

http://www.heidenhain.de

284 249-25 · SW 246 181 01 · 3 · 3/2000 · H · Printed in Germany · Subject to change without notice

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Artisan Technology Group is an independent supplier of quality pre-owned equipment

Gold-standard solutions

Extend the life of your critical industrial, commercial, and military systems with our superior service and support.

We buy equipment

Planning to upgrade your current equipment? Have surplus equipment taking up shelf space? We'll give it a new home.

Learn more!

Visit us at **artisantg.com** for more info on price quotes, drivers, technical specifications, manuals, and documentation.

Artisan Scientific Corporation dba Artisan Technology Group is not an affiliate, representative, or authorized distributor for any manufacturer listed herein.

We're here to make your life easier. How can we help you today?

(217) 352-9330 | sales@artisantg.com | artisantg.com

ARTISAN® TECHNOLOGY GROUP