

ARTISAN®
TECHNOLOGY GROUP

Your **definitive** source for quality pre-owned equipment.

Artisan Technology Group
(217) 352-9330 | sales@artisantg.com | artisantg.com

Full-service, independent repair center
with experienced engineers and technicians on staff.

We buy your excess, underutilized, and idle equipment
along with credit for buybacks and trade-ins.

Custom engineering
so your equipment works exactly as you specify.

- Critical and expedited services
- In stock / Ready-to-ship
- Leasing / Rentals / Demos
- ITAR-certified secure asset solutions

Expert team | Trust guarantee | 100% satisfaction

All trademarks, brand names, and brands appearing herein are the property of their respective owners.

Find the *Keysight / Agilent 5518A* at our website: ***Click HERE***

このドキュメントについて

このドキュメントは、アジレント・テクノロジー ウェブサイトによって、お客様に製品のサポートをご提供するために公開しております。印刷が判読し難い箇所または古い情報が含まれている場合がございますが、ご容赦いただけますようお願いいたします。
今後、新しいコピーが入手できた場合には、アジレント・テクノロジー ウェブサイトに追加して参ります。


本製品のサポートについて

この製品は、既に販売終了またはサポート終了とさせていただいている製品です。弊社サービスセンターでは、この製品の校正は実施できる可能性があります（修理部品が不要な場合など）が、その他のサポートはご提供いたしかねます。誠に恐縮ではございますが、ご理解願います。
なお、この製品に関するその他の情報や、代替製品情報などは、弊社 電子計測 ウェブサイト http://www.agilent.co.jp/find/tm にて、できるだけご提供しておりますので、ご利用ください。

訂正のお願い

本文中に「HP」または「YHP」とある語句を、「Agilent」と読み替えてください。
また、「横河・ヒューレット・パッカード株式会社」、「日本ヒューレット・パッカード株式会社」とある語句は、それぞれ、「アジレント・テクノロジー株式会社」と読み替えてください。
ヒューレット・パッカード社の電子計測、自動計測、半導体製品、ライフライフサイエンスのビジネス部門は、1999年11月に分離独立してアジレント・テクノロジー社となりました。
社名変更に伴うお客様の混乱を避けるため、製品番号の前に付されたブランドのみ
HPからAgilent へと変更しております。
（例：旧製品名 HP 8648は、現在 Agilent 8648として販売いたしております。）

Agilent Technologies

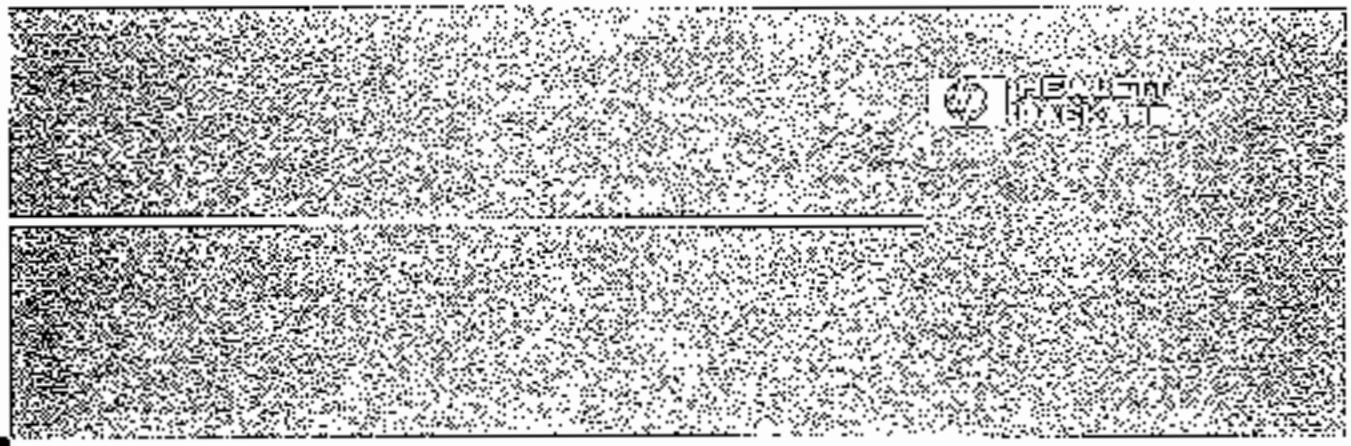

Service Manual

HP 5528A
Laser Measurement System

©Copyright Hewlett-Packard Company 1988, 1994, 1995

All Rights Reserved. Reproduction, adaptation, or translations without prior written permission is prohibited, except as allowed under the copyright laws.

Printed: April 1995

Printed in USA

Manual part number 05328-90023

Certification

Hewlett-Packard Company certifies that this product met its published specification at the time of shipment from the factory. Hewlett-Packard further certifies that its calibration measurements are traceable to the United States National Institute of Standards and Technology (formerly National Bureau of Standards), to the extent allowed by the Institute's calibration facility, and to the calibration facilities of other International Standards Organization members.

Warranty

This Hewlett-Packard instrument product is warranted against defects in material and workmanship for a period of three years from date of shipment. During the warranty period, Hewlett-Packard Company will, at its option, either repair or replace products which prove to be defective. For warranty service or repair, this product must be returned to a service facility designated by HP. Buyer shall prepay shipping charges to HP and HP shall pay shipping charges to return the product to Buyer. However, Buyer shall pay all shipping charges, duties, and taxes for products returned to HP from another country.

HP warrants that its software and firmware designed by HP for use with an instrument will execute its programming instructions when properly installed on that instrument. HP does not warrant that the operation of the instrument, or software, or firmware will be uninterrupted or error free.

Limitation of Warranty

The foregoing warranty shall not apply to defects resulting from improper or inadequate maintenance by Buyer. Buyer-supplied software or interfacing, unauthorized modification or misuse, operation outside the environmental specifications for the product, or improper site preparation or maintenance.

NO OTHER WARRANTY IS EXPRESSED OR IMPLIED. HP SPECIFICALLY DISCLAIMS THE IMPLIED WARRANTIES OR MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE.

Exclusive Remedies

THE REMEDIES PROVIDED HEREIN ARE BUYER'S SOLE AND EXCLUSIVE REMEDIES. HP SHALL NOT BE LIABLE FOR ANY DIRECT, INDIRECT, SPECIAL, INCIDENTAL, OR CONSEQUENTIAL DAMAGES, WHETHER BASED ON CONTRACT, TORT, OR ANY OTHER LEGAL THEORY.

Assistance

Product maintenance agreements and other customer assistance agreements are available for Hewlett-Packard products.

For any assistance, contact your nearest Hewlett-Packard Sales and Service Office.

Safety Considerations

General

This product and related documentation must be reviewed for familiarization with this safety markings and instructions before operation.

Warning Symbols That May Be Used In This Book



Instruction manual symbol: the product will be marked with this symbol when it is necessary for the user to refer to the instruction manual.



Indicates hazardous voltages.



Indicates ground terminal

WARNING BODILY INJURY OR DEATH MAY RESULT FROM FAILURE TO HEED A WARNING. DO NOT PROCEED BEYOND A WARNING SIGN UNTIL THE INDICATED CONDITIONS ARE FULLY UNDERSTOOD AND MET.

CAUTION Damage to equipment, or incorrect measurement data, may result from failure to heed a caution. Do not proceed beyond a *CAUTION* sign until the indicated conditions are fully understood and met.

These CAUTION labels are required by the United States Center for Devices and Radiological Health. Failure to follow their instructions may result in personal injury.

This symbol indicates laser radiation.





Hewlett-Packard Company
Santa Clara Division
5301 Stevens Creek Boulevard
Santa Clara, California 95052-8059

HP 5528A
LASER MEASUREMENT SYSTEM

SERVICE MANUAL

Including:

5518A	Laser Head
5508A	Measurement Display
05508-60021	Remote Control Unit
10751A/B	Air Sensor
10757A/B/C	Material Temperature Sensors
10753A	Tripod
10759A	Footspacing Kit
10766A	Linear Interferometer
10767A	Linear Retroreflector
10770A	Angular Interferometer
10771A	Angular Reflector
10772A	Turning Mirror
10773A	Flatness Mirror
10774A	Short Range Straightness Optics
10775A	Long Range Straightness Optics
10776A	Straightness Accessory Kit
10777A	Optical Square
10784A	Base
10785A	Height Adjuster and Post
55280A	Linear Measurement Kit
55281A	Angular Optics
55282A	Flatness Accessory Kit
55283A	Straightness Measurement Kit

SERIAL PREFIX EFFECTIVITY

This manual applies directly to HP 5528A equipment with the serial prefixes listed in Table 1-1. Lower number serial prefixes are covered in Section VII. Higher number serial prefixes are documented with "Manual Changes" supplements as described in Paragraph 1-10.

©HEWLETT-PACKARD COMPANY 1986, 1994, 1996
3000 STEVENS CREEK BLVD. SANTA CLARA, CA 95052-8059

MANUAL PART NUMBER : 05528-90023

Printed: February 1996

HEWLETT® PACKARD

Warranty (con't)

For warranty service or repair, this product must be returned to a service facility designed by HP. Buyer shall prepay shipping charges to HP and HP shall pay shipping charges to return the product to Buyer. However, Buyer shall pay all shipping charges to return the product to Buyer. However Buyer shall pay all shipping charges, duties, and taxes for products returned to HP from another country

HP warrants that its software and firmware designed by HP for use with an instrument will execute its programming instructions with properly installed on that instrument. HP does not warrant that the operation of the instrument, or software, or firmware will be uninterrupted or error free.

Limitation of Warranty

The foregoing warranty shall not apply to defects resulting from improper or inadequate maintenance by Buyer. Buyer-supplies software or interfacing, unauthorized modification or misuse, operation outside the environmental specifications for the product, or improper site preparation or maintenance.

NO OTHER WARRANTY IS EXPRESSED OR IMPLIED. HP SPECIFICALLY DISCLAIMS THAT IMPLIED WARRANTIES OR MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE.

Exclusive Remedies

THE REMEDIES PROVIDED HEREIN ARE BUYER'S SOLD AND EXCLUSIVE REMEDIES HP SHALL NOT BE LIABLE FOR ANY DIRECT, INDIRECT, SPECIAL, INCIDENTAL, OR CONSEQUENTIAL DAMAGES, WHETHER BASED ON CONTRACT, TORT, OR ANY OTHER LEGAL THEORY.

Assistance

Product maintenance agreements and other customer assistance agreements are available for Hewlett-Packard products.

For any assistance, contact your nearest Hewlett-Packard Sales and Service Office

Warning

Any interruption of the protective grounding conductor (inside or outside the instrument) or disconnecting the protective earth terminal will cause a potential shock hazard that could result in personal injury. (Grounding one conductor of a two-conductor outlet is not sufficient protection.)

Whenever it is likely that the protection has been impaired, the instrument must be made inoperative and be secured against any unintended operation.

If this instrument is to be energized via an autotransformer (for voltage reduction) make sure the common terminal is connected to the earthed pole terminal (neutral) of the power source.

For continued protection against fire, replace the line fuse(s) only with 250V fuse(s) of the same current rating and type (for example, normal blow, time delay). Do not use repaired fuses or short-circuited fuseholders.

Laser Head Safety Considerations

CAUTION

LASER RADIATION IS EMITTED FROM THE APERTURE ON THE 5518A LASER HEAD AS ILLUSTRATED ON THE FOLLOWING PAGE. DO NOT STARE INTO BEAM. THIS PRODUCT IS A CLASS II LASER PRODUCT CONFORMING TO FEDERAL BUREAU OF RADIOLOGICAL HEALTH REGULATIONS 21 CFR 1040.10 AND 1040.11 AND TO INTERNATIONAL LASER SAFETY REGULATIONS. THE MAXIMUM RADIANT POWER OUTPUT IS 1 MILLIWATT. THE PULSE SPECIFICATION IS CONTINUOUS WAVE.

Safety Considerations (con't)

THE LASER MEDIUM IS HELIUM-NEON, AND THE WAVELENGTH IS 632.991 NANOMETERS.

USE OF CONTROLS OR ADJUSTMENTS OR PERFORMANCE OF PROCEDURES OTHER THAN THOSE SPECIFIED HEREIN MAY RESULT IN HAZARDOUS RADIATION EXPOSURE.

Acoustic Noise Emissions

HP 5508A
LpA <45.1 dB at operator position, at normal operation, tested per EN 27779. All data are the results from type test

HP 5518A
LpA <40 dB: no fan installed.

Geräuschemission

HP 5508A
LpA<48.1 dB am Arbeits platz, normaler Betrieb, geprüft nach EN 27779. Die Angaben beruhen auf Ergebnissen von Typprüfungen.

HP 5518A
LpA <40 dB; kein Ventilator eingebaut

Electrostatic Discharge Immunity Testing


When the product is tested with 8kV AD, 4kV CD and 4kV ID according to IEC 801-2, a system error may occur that may affect measurement data made during these disturbances. After these occurrences, the system has to be reset to continue operation.

Radio Frequency Interference

This is a Class A product. In a domestic environment this product may cause radio interference, in which case, the user may be required to take adequate measures.

LASER HEAD SAFETY LABELS



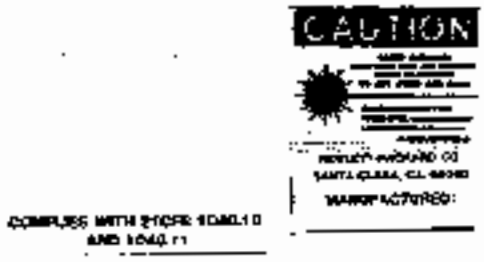



(U.S.A. ONLY)

FEDERAL COMMUNICATIONS COMMISSION RADIO FREQUENCY INTERFERENCE STATEMENT

Warning: This equipment generates, uses, and can radiate radio frequency energy and if not installed and used in accordance with the instructions manual, may cause interference to radio communications. As temporarily permitted by regulation it has not been tested for compliance with the limits for Class A computing devices pursuant to Subpart J of Part 15 of FCC Rules, which are designed to provide reasonable protection against such interference. Operation of this equipment in a residential area is likely to cause interference in which case the user at his own expense will be required to take whatever measures may be required to correct the interference.

TABLE OF CONTENTS

Section	Title	Page
I	**GENERAL INFORMATION**	1-1
	1-2. Introduction	1-1
	1-4. Manual Organization	1-1
	1-6. How To Locate Information	1-2
	1-10. Instruments Covered By The Manual	1-2
	1-15. Safety Considerations	1-3
	1-17. Specifications	1-3
	1-19. 5528A Laser Measurement System Description	1-12
	1-21. Equipment Description	1-12
	1-23. 5518A Laser Head	1-12
	1-25. 5508A Measurement Display	1-13
	1-35. 05508-60021 Remote Control Unit	1-14
	1-37. 10751A/B Air Sensor	1-15
	1-39. 10757A/B/C Material Temperature Sensor	1-15
	1-41. 10753A Tripod	1-16
	1-44. 10759A Footspacing Kit	1-17
	1-47. 10766A Linear Interferometer	1-18
	1-49. 10767A Linear Retroreflector	1-18
	1-51. 10770A Angular Interferometer	1-19
	1-53. 10771A Angular Reflector	1-19
	1-55. 10772A Turning Mirror	1-20
	1-58. 10773A Flatness Mirror	1-20
	1-60. 10774A Short Range Straightness Optics	1-21
	1-62. 10775A Long Range Straightness Optics	1-21
	1-64. 10776A Straightness Accessory Kit	1-22
	1-67. 10777A Optical Square	1-23
	1-69. 10784A Base	1-23
	1-71. 10785A Height Adjuster and Base	1-24
	1-73. Optical Kits	1-25
	1-75. 55280A Linear Measurement Kit	1-25
	1-77. 55281A Angular Optics	1-26
	1-79. 55282A Flatness Accessory Kit	1-26
	1-81. 55283A Straightness Measurement Kit	1-27
	1-83 Other Compatible Equipment	1-28
	1-85. System Configurations	1-28
	1-87. Recommended Test Equipment	1-29
	1-89. Warranty	1-30
II	**INSTALLATION**	2-1
	2-1. Introduction	2-1
	2-3 Initial Inspection	2-1
	2-5. Preparation for Use	2-1
	2-6. Power Requirements	2-1
	2-8. Line Voltage and Fuse Selection	2-2
	2-10. Power Cable	2-3
	2-12. 5518A to 5508A Interconnecting Cable	2-5
	2-14. 10751A/B Air Sensor Connection	2-5
	2-16. 10757A/B/C Material Temperature Sensor Connection	2-5
	2-18. Remote Control Box Connection	2-5
	2-20. HP-IB Cable and Connectors	2-5

TABLE OF CONTENTS (Continued)

Section	Title	Page
II	**INSTALLATION (Cont'd)**	
	2-23. Operational Verification Check	2-7
	2-25. Operating Environment	2-7
	2-27. Storage and Shipment	2-7
	2-28. Environment	2-7
	2-31. Packaging	2-7
	2-35. Mounting and Fixturing	2-8
III	**OPERATION**	3-1
	3-1 Introduction	3-1
	3-4 5508A Measurement Display, Front Panel Controls and Keyboard Features	3-1
	3-6 5508A Measurement Display, Rear Panel Connectors and Controls	3-10
	3-8 Error Messages	3-12
	3-11. 5518A Laser Head, Front Panel Controls and Indicators	3-13
	3-13. 5518A Laser Head, Rear Panel Indicators and Connectors	3-14
	3-15. 10751A/B Air Sensor Controls	3-15
	2-16. 10757A/B/C Material Temperature Sensors	3-15
	3-21. Remote Control Unit 05508-60021 Controls and Indicators	3-16
	3-23. Operator's Check	3-17
	3-25. Equipment Required	3-17
	3-27. Procedure	3-17
	3-26. Self-Test and Warm-Up Countdown	3-21
	3-30. Data Transfer to External Devices (HP-IB)	3-22
	3-31. Introduction	3-22
	3-35. 5528A Data Transfer Without An HP-IB Controller	3-22
	3-40 5508A Operation With An HP-IB Controller	3-22
	3-42 5508A Instrument Function Codes	3-23
	3-44 Using Instrument Function Codes	3-23
	3-47 HP-IB Bus Commands	3-25
	3-50. HP-IB Bus Commands and 5508A Responses	3-25
	3-52 Status Byte	3-27
	3-54 Clearing Error Conditions	3-27
	3-56. Output	3-27
	3-58. Sensor Errors	3-27
	3-60. Interrupt Capability	3-28
	3-62. HP-IB Switches	3-28
	3-65. Operator's Maintenance	3-30
	3-67. Fuses	3-30
	3-69. Air Filter Cleaning	3-30
	3-71. Procedures for Cleaning Measurement Optics	3-30
IV	**PERFORMANCE TESTS AND CALIBRATION**	4-1
	4-1. Introduction	4-1
	4-3. Safety Considerations	4-1
	4-5. Recommended Test Equipment	4-1
	4-7. Test Record	4-1
	4-9. 5528A Performance Tests	4-1
	4-11. 5508A Performance Tests	4-2
	4-14. 5518A Performance Tests	4-2
	4-16 Laser Power Output Test	4-2
	4-18. Procedure	4-2
	4-19. Receiver Gain Test	4-2
	4-22. Procedure	4-3

TABLE OF CONTENTS (Continued)

Section	Title	Page
V	**PERFORMANCE TESTS AND CALIBRATION (Continued)**	
	4-23. 10751A/B and 10757A/B/C Performance Tests	4-3
	4-25. Calibration Cycle	4-3
	4-27. 5508A Calibration Procedures	4-3
	4-31. Preliminary Procedures	4-4
	4-32. −10Vref Calibration Procedure	4-4
	4-33. +0.5Vref Calibration	4-7
	4-35. Procedure	4-7
	4-38. 10751A Calibration Procedures	4-9
	4-40. Temperature Calibration Procedure	4-9
	4-43. Air Pressure Calibration Procedure	4-12
	4-45. 10757A/B/C Calibration Matching Procedures	4-15
	4-47. 10757A/B/C Calibration Procedures	4-16
	4-52. HP-IB Diagnostics	4-19
	4-55. Quick Diagnostic Checks	4-20
	4-57. Instrument Function Codes Diagnostic	4-29
V	**ADJUSTMENTS**	5-1
	5-1. Introduction	5-1
	5-3. Safety Considerations	5-1
	5-5. Recommended Test Equipment	5-1
	5-7. Factory Selected Components	5-1
	5-9. Adjustment Procedures	5-1
	5-11. 5518A Receiver Adjustments	5-2
	5-15. Procedure	5-3
	5-16. 5518A Reference Temperature Adjustments	5-4
	5-19 Preliminary Procedure	5-4
	5-22. 5518A Laser Tube Current Adjustment	5-5
VI	**REPLACEABLE PARTS**	6-1
	6-1. Introduction	6-1
	6-3. Summary of Tables and Figures	6-1
	6-5. Abbreviations	6-1
	6-7 Ordering Information	6-1
	6-10. Direct Mail Order System	6-1
VII	**MANUAL CHANGES**	7-1
	7-1. Introduction	7-1
	7-3. Newer Instruments	7-1
	7-5. Older Instruments	7-1
VIII	**SERVICE**	8-1
	8-1. Introduction	8-1
	8-3. Section Organization	8-1
	8-5. Theory of Operation	8-1
	8-7. Troubleshooting and Repair	8-2
	8-9. Recommended Test Equipment	8-2
	8-11. Service Aids	8-2
	8-13. Schematic Diagram Symbols and Reference Designators	8-2
	8-16. Safety Considerations	8-4
	8-16. Safety Symbols	8-5
	8-20. Before and After Service Product Safety Checks	8-6

TABLE OF CONTENTS (Continued)

Section	Title	Page
VII	**SERVICE (Cont'd)**	
	8-26. Logic Symbols	8-6
	8-28. Logic Concepts	8-6
	8-30. Negation	8-7
	8-32. Logic Implementation and Polarity Indication	8-7
	8-41 Other Symbols	8-9
	8-43. Dependency Notation "C" "G" "V" "F"	8-10
	8-45. Control Blocks	8-11
	8-47. Complex Logic Devices	8-12
VIII-A	**5528A LASER MEASUREMENT SYSTEM**	8-A-1
	8-A-1. 5528A Block Diagram Description	8-A-1
	8-A-2. Introduction	8-A-1
	8-A-5. 5518A Laser Head	8-A-1
	0 A 11. 5508A Measurement Display	8-A-2
	8-A-16. Compensation Number	8-A-2
	8-A-23. Power-Up Self Test and Warm-Up Countdown	8-A-3
	8-A-25. Beam Strength Signal	8 A-3
	8-A-27. Basic Measurement Technique	8-A-3
	8-A-31. Smoothing	8-A-4
	8-A-33. System Troubleshooting	8-A-5
	8-A-34 Introduction	8-A-5
	8-A-37. Signal Connection and Indicator Diagram	8-A-5
	8-A-39. Troubleshooting Tables	8-A-5
	8-A-41. Indicators	8-A-5
	8-A-44. Error Messages	8-A-8
	8-A-48. 10751 and 10757 Sensor Errors	8-A-13
	8-A-50. 10751 and 10757 Signal Characteristics	8-A-13
	8-A-51. Temperature Measurements	8-A-13
	8-A-53. Pressure Measurement	8-A-13
	8-A-55. Humidity Switch	8-A-13
	8-A-57. Unused 10757A/B/C and 10751A/B Connectors	8-A-13
	8-A-59. 5508A Keyboard and Front Panel Display	8-A-13
	8-A-61. Power-Up Failures	8-A-14
	8-A-63. No Laser Light	8-A-14
	8-A-65. 5508A Isolation	8-A-14
	8-A-68. Beam Strength Meter Test	8-A-15
	8-A-70. 5518A Isolation	8-A-15
	8-A-73. Straightness Measurements	8-A-15
	8-A 75. Linear Measurements	8-A-15
	8-A-77. Angular/Flatness Measurements	8-A-16
	8-A-79. 10751A/B Isolation	8-A-16
	8-A-81. 10757A/B/C Isolation	8-A-17
	8-A-83. Power Supply Troubleshooting	8-A-17
	8-A-85. 5508A Primary Power	8-A-18
	8-A-87. 5518A Power	8-A-18
	8-A-89. Instrument Current Requirements	8-A-18
	8-A-91. Connectors and Cables	8-A-19

TABLE OF CONTENTS (Continued)

Section	Title	Page
VIII-B	**5508A MEASUREMENT DISPLAY**	8-B-1
	8-B-1. 5508A Measurement Display Block Diagram Description	8-B-1
	8-B-4. A2 Processor Board and A3 Counter Board	8-B-1
	8-B-12. A1 Keyboard/Display Board	8-B-2
	8-B-14. 5508A Measurement Display Trouble Isolation	8-B-2
	8-B-16. 5508A Indicators	8-B-2
	8-B-17. 5508A Self Test	8-B-2
	8-B 24. Preliminary Checks	8-B-3
	8 B 25. Symptoms and Probable Causes	8-B-4
	8-B-27. 5508A Internal Switch Summary	8-B-5
	8-B-28. 5508A Assembly Removal Instructions	8-B-7
	8-B-31. 5508A A1 Keyboard/Display Circuit Theory	8-B-10
	8-B-34. Display Circuitry	8-B-10
	8-B-39 Keyboard Scanning and Interrupt Circuitry	8-B-11
	8 B 42. 5508A A1 Keyboard/Display Troubleshooting	8-B-12
	8-B-44. Initial Checks for A1 Problems	8-B-21
	8-B-45. Troubleshooting Tips	8-B-11
	8-B-49 Signature Analysis Procedure	8-B-12
	8-B-51. 5508A A2 Processor Board Circuit Theory	8-B-17
	8-B-54. Processor and English/Metric Switch	8-B-17
	8-B-59. Master Reset Section	8-B-17
	8-B-61. Priority Interrupt	8-B-17
	8-B-64. ROM and RAM	8-B-18
	8-B-66. Data Bus Driver	8-B-18
	8-B-68. Address Decode Section	8 B-18
	8-B-71. HP-IB Circuits	8-B-18
	8-B-73. 5508A A2 Processor Board Troubleshooting	8-B-18
	8-B-76. Processor Board Test Switch	8-B-19
	8-B-78. Troubleshooting Procedures	8-B-19
	8-B 79. Test 1. Kernel Test	8-B-20
	8-B-83. Test 2. All ROMS Test	8-B-22
	8-B-85. Test 3. Decode Test	8-B-23
	8-B-87. Test 4. All RAM Test	8-B-24
	8-B-88. Test 5. Data Buffer	8-B-25
	8-B-89. Test 6. Interrupt Encoder Test	8-B-26
	8-B-91. Tests 7, 8, and 9. ROM Tests	8-B-27
	8-B-93. Test 10. Internal RAM Test	8-B-29
	8-B-94. HP-IB Troubleshooting	8-B 30
	8-B-98. HP-IB Verification	8-B-30
	8-B-99. Data Bus Fault Location	8-B-31
	8-B-106. Bus Line is Stuck Low	8-B-32
	8-B-107. Data Line is Toggling	8-B-32
	8-B-108. Bus Line Shorted to Vcc	8-B-32
	8-B-110. 5508A A3 Counter Board	8-B-47
	8-B-112. 5508A A3 Counter Board Block Diagram Description	8-B-47
	8-B-120. 5508A A3 Counter Control Circuit Theory	8-B-48
	8-B-124. Input Address and Control Signals	8-B-48
	8-B-127. Address Decode	8-B-48
	8-B-132. Test F/F, Error Latches, Test Latches	8-B-49
	8-B-134. Control Counter	8-B-49

TABLE OF CONTENTS (Continued)

Section	Title	Page
VIII-B	**5508A MEASUREMENT DISPLAY (Continued)**	
	8-B-138. NMI Generator and ECL References	8-B-50
	8-B-143. External Record and External Reset	8-B-50
	8-B-146. 5508A A3 Reference Frequency Channel and Measurement Frequency Channel Circuit Theory	8-B-50
	8-B-150. X16 Frequency Multiplier	8-B-51
	8-B-156. PLL Error Detect	8-B-51
	8-B-159. Pulse Counters	8-B-51
	8-B-162. Swallow Counter and Control	8-B-52
	8-B-167. Troubleshooting Procedures for A3 Control Circuits, Reference Frequency Channel, and Measurement Channel	8-B-52
	8-B-167a. TTL and ECL Logic Levels	8-B-52
	8-B-167e. Setting ECL Threshold on the 5005A	8-B-53
	8-B-168. Data Probe Grounds on the 5005A	8-B-53
	8-B-170. Standard Troubleshooting Procedures	8-B-54
	8-B-172. Order of Tests	8-B-54
	8-B-174. Menu of Tests	8-B-54
	8-B-175. Test 1. Initial Checks and Preliminary Procedures	8-B-55
	8-B-176. Purpose of Test	8-B-55
	8-B-178. Procedure	8-B-55
	8-B-179. Test 2. MPU Interface and Control	8-B-56
	8-B-180. Purpose of Test	8-B-56
	8-B-182. Scheme of Test	8-B-56
	8-B-184. Procedure	8-B-56
	8-B-185. Test 3. X16 Frequency Multipliers	8-B-58
	8-B-186 Purpose of Test	8-B-58
	8-B-188 Scheme of Test	8-B-58
	8-B-190 Limitations of the Test	8-B-58
	8-B-192 Procedure	8-B-58
	8-B-194. Test 4. Phase Accumulators and Swallow Counters	8-B-60
	8-B-194. Purpose of Test	8-B-60
	8-B-196 Scheme of Test	8-B-60
	8-B-198 Procedure	8-B-60
	8-B-199 Test 5. Error Detectors, External Record, and External Reset	8-B-62
	8-B-200 Purpose of Test	8-B-62
	8-B-202. Scheme of Test	8-B-62
	8-B-204. Procedure	8-B-62
	8-B-205. Test 6. Status Buffer (U20)	8-B-64
	8-B-206. Purpose of Test	8-B-64
	8-B-208. Procedure	8-B-64
	8-B-209. Test 7. Output Buffers	8-B-65
	8-B-210. Purpose of Test	8-B-65
	8-B-212 Test 8. Not Used	8-B-65
	8-B-214. Test 9. Pulse Counters	8-B-65
	8-B-215. Purpose of Test	8-B-65
	8-B-217. Scheme of Test	8-B-66
	8-B-219 Procedure	8-B-66
	8-B-221. Test 10. Swallow Counters	8-B-67
	8-B-222. Purpose of Test	8-B-67
	8-B-224. Scheme of Test	8-B-67
	8-B-226. Procedure	8-B-68

TABLE OF CONTENTS (Continued)

Section	Title	Page
VIII-B	**5508A MEASUREMENT DISPLAY (Continued)**	
	8-B-228. 5508A A3 Analog Subsystem Block Diagram Description	8-B-77
	8-B-230. 5508A A3 Analog Subsystem Circuit Theory	8-B-78
	8-B-233. Analog-To-Digital Converter	8-B-78
	8-B-237. Voltage Reference and Digital Calibration Switches	8-B-78
	8-B-242. Analog Input Circuits	8-B-79
	8-B-245. Channel Multiplexer	8-B-79
	8-B-247. Analog Switches	8-B-79
	8-B-249. Analog Channel Scanning (Test Chip)	8-B-79
	8-B-252. Unplugged State Comparator	8-B-80
	8-B-255. Power-Up Self-Test Provisions	8-B-80
	8-B-258. System Clock and Bus Address Decoder	8-B-80
	8-B-265. Clock Divider	8-B-82
	8-B-267. 5508A A3 Analog Subsystem Troubleshooting	8-B-82
	8-B-268. General Measurements	8-B-82
	8-B-270. Latch-Up Warning	8-B-82
	8-B-273. Preliminary Checks	8-B-82
	8-B-274. Analog Subsystem Troubleshooting Specifications	8-B-82
	8-B-275. Sensor Data Errors	8-B-83
	8-B-277. 10751A/B and 10757A/B/C Signal Characteristics	8-B-83
	8-B-278. Temperature Measurements	8-B-83
	8-B-280. Pressure Measurement	8-B-83
	8-B-282. Humidity Switch	8-B-83
	8-B-284. Unused 10757A/B/C and 10751A/B Connectors	8-B-83
	8-B-286. Voltmeter Mode	8-B-84
	8-B-289. Troubleshooting Procedure for "FAIL 4" Error Message	8-B-85
	8-B-293. Procedure	8-B-85
	8-B-294. Digital Calibration Switches Troubleshooting	8-B-86
	8-B-296. A to D Digital Circuitry Troubleshooting Procedure	8-B-86
	8-B-298. Procedure	8-B-87
	8-B-299. Calibration Number Buffer Verification	8-B-88
	8-B-301. Interrupt Latch Troubleshooting	8-B-89
	8-B-303. Procedure	8-B-89
	8-B-304. Unplugged Comparator Troubleshooting	8-B-90
	8-B-306. Preliminary Checks	8-B-90
	8-B-307. Procedure	8-B-90
	8-B-308. Multiplexer Troubleshooting	8-B-91
	8-B-310. A to D Converter Troubleshooting	8-B-91
	8-B-313 A to D Converter Accuracy Test	8-B-92
	8-B-315. Procedure	8-B-92
	8-B-317. Analog Ground Troubleshooting	8-B-93
	8-B-322. +10 Vref Troubleshooting	8-B-94
	8-B-325. +05 Vref Troubleshooting	8-B-95
	8-B-327. 5508A A4 Connector Board Circuit Theory	8-B-100
	8-B-331. 5508A A4 Connector Board Troubleshooting	8-B-100
	8-B-333. 5508A A5 Power Supply Board Circuit Theory	8-B-102
	8-B-338. Primary Power Circuits	8-B-102
	8-B-343. +5 Volt Power Supply	8-B-102
	8-B-351. −15 Volt Head Power Supply	8-B-103
	8-B-356. −15 Volt Regulators	8-B-103
	8-B-359. Beam Strength Amplifier	8-B-104
	8-B-362. 5508A Power Supply Board Troubleshooting	8-B-104

TABLE OF CONTENTS (Continued)

Section	Title		Page
VIII-C	**5508A LASER HEAD**		8-C-1
	8-C-1.	5518A Laser Head Block Diagram Description	8-C-1
	8-C-7.	Laser Tuning	8-C-4
	8-C-18.	Laser Assembly Optics	8-C-8
	8-C-21.	Reference Receiver	8-C-8
	8-C-23.	Measurement Frequency Receiver	8-C-9
	8-C-26.	Turret Optics	8-C-9
	8-C-30.	Assembly/Schematic Locations of 5518A Block Diagram Elements	8-C-10
	8-C-31.	5518A Indicators	8-C-10
	8-C-32	Built-In Test Aids	8-C-10
	8-C-35.	Trouble Isolation	8-C-11
	8-C-36.	Quick Tuning Checkout Procedure	8-C-11
	8-C-40	Testing the Liquid Crystal Switch	8-C-13
	8-C-43	5518A Trouble Isolation Procedure	8-C-15
	8-C-45	Test Setup	8-C-16
	8-C-46	Procedure	8-C-16
	8-C-47	5518A Assembly Removal Instructions	8-C-18
	8-C-49.	5518A A1 Connector Board Circuit Theory	8-C-19
	8-C-52.	5518A A1 Connector Board Troubleshooting	8-C-19
	8-C-54.	5518A Laser High Voltage Section Circuit Theory	8-C-19
	8-C-57.	5518A Laser High Voltage Power Supply Troubleshooting	8-C-20
	8-C-59.	5518A A2 Measurement Receiver and 5518A Turret Switch Assembly Circuit Theory	8-C-21
	8-C-69.	5518A A2 Measurement Receiver Troubleshooting	8-C-22
	8-C-71.	5518A A3 Controller/Reference Board and A4 Sampler Board	8-C-24
	8-C-73.	5518A A3 Controller/Reference Board Circuit Theory	8-C-24
	8-C-76.	Clock	8-C-24
	8-C-78.	Dividers	8-C-24
	8-C-80.	State Machine	8-C-24
	8-C-85	Liquid Crystal	8-C-25
	8-C-88	Photodiode and Amplifier	8-C-25
	8-C-90	Warm-Up Error Amplifiers and Comparator	8-C-25
	8-C-93	Subtracting Sample and Hold	8-C-25
	8-C-97	Power Amplifier	8-C-26
	8-C-100.	Reference Receiver	8-C-26
	8-C-104.	Line Drivers	8-C-26
	8-C-106.	Power-On Reset (POR)	8-C-26
	8-C-108.	Power	8-C-26
	8-C-110.	5518A A4 Sampler Board Circuit Theory	8-C-27
	8-C-112.	5518A A3 Controller/Reference Board Troubleshooting	8-C-27
	8-C-115.	Standard Troubleshooting Procedures	8-C-27
	8-C-117	Digital Troubleshooting	8-C-28
	8-C-120	Photodiode and Amplifier Troubleshooting	8-C-31
	8-C-122	Liquid Crystal Troubleshooting	8-C-31
	8-C-124.	Subtracting Sample and Hold Troubleshooting	8-C-32
	8-C-126.	Power Amplifier Troubleshooting	8-C-33
	8-C-127.	Warm-Up Error Amplifier Troubleshooting	8-C-34
	8-C-129.	Power Supplies Troubleshooting	8-C-34
	8-C-131.	Reference Receiver Troubleshooting	8-C-35

TABLE OF CONTENTS (Continued)

Section	Title	Page
VIII-D	**10751A/B AIR SENSOR**	8-D-1
	8-D-1. 10751A/B Air Sensor Circuit Theory	8-D-1
	8-D-5. Air Pressure	8-D-1
	8-D-6. Pressure Signal Offset Circuitry	8-D-1
	8-D-10. Pressure Signal Gain Circuitry	8-D-2
	8-D-14. R/2R Network R16	8-D-4
	8-D-17. Output Buffer U1	8-D-5
	8-D-20. Air Temperature	8-D-5
	8-D-23. Air Humidity	8-D-5
	8-D-25. Analog Ground	8-D-5
	8-D-28 10751A/B Air Sensor Troubleshooting	8-D-6
	8-D-31 Air Sensor Errors	8-D-7
	8-D-37. Humidity Indicator Troubleshooting	8-D-8
	8-D-39. Air Temperature Troubleshooting	8-D-8
	8-D-40. Air Pressure Troubleshooting	8-D-8
VIII-E	**10757A/B/C MATERIAL TEMPERATURE SENSOR**	8-E-1
	8-E-1. 10757A/B/C Material Temperature Sensor Circuit Theory	8-E-1
	8-E-3. Thermistor Network	8-E-1
	8-E-7. Offset Network	8-E-2
	8-E-12. Analog Ground Buffer	8-E-2
	8-E-15. 10757A/B/C Material Temperature Sensor Troubleshooting	8-E-3
VIII-F	**OPTICS**	8-F-1
	8-F-1. Introduction	8-F-1
	8-F-3. Angular and Flatness Measurements	8-F-1
	8-F-4. 10770A Angular Interferometer	8-F-1
	8-F-6. 10771A Angular Reflector	8-F-1
	8-F-8. Angular Measurement Theory	8-F-1
	8-F-12. Flatness Measurement Theory	8-F-1
	8-F-14. Straightness Measurements	8-F-2
	8-F-15. 10774A Short Range and 10775A Long Range Straightness Interferometer and Reflector	8-F-2
	8-F-16. Straightness Measurement Theory	8-F-2
	8-F-20. Optical Repair	8-F-2
	8-F-22. Procedures for Cleaning Measurement Optics	8-F-3

SECTION I
GENERAL INFORMATION

1-1. INTRODUCTION

1-2. This Service Manual contains information required to install, test, adjust, and service the Hewlett-Packard Model 5518A Laser Measurement System. It is intended primarily for use by those concerned with installing and servicing the system. A separate User's Guide is supplied that describes information required to setup, align, and apply the system to various types of measurements. Sufficient operating information is presented in this manual to allow service personnel to repair the instruments available for the system.

1-3. The HP part number of this manual is listed on the title page.

1-4. MANUAL ORGANIZATION

1-5. This Service Manual is organized as follows:

SECTION I GENERAL INFORMATION covers Manual Organization, Instruments Covered by the Manual, Safety Considerations, Specifications, System Description, Equipment Descriptions. Optical Kits, Compatible Equipment, System Configurations, Recommended Test Equipment, and Warranty Information.

SECTION II INSTALLATION covers Preparation for Use, Power Requirements, Line voltage and Fuse Selection, Interconnecting Cabling, Operating and Storage Environments, Storage and Shipment, and Packaging.

SECTION III OPERATION provides operating information for the Service Technician and covers Equipment Front and Rear Panel Features, Error Messages, Operator's Check, Self Test and Warm-up Countdown description, Data Transfer to External Devices, Instrument Function Codes, HP-IB Operation, HP-IB Switches, and Operator's Maintenance. A separate User's Guide is supplied for those concerned with applying the system to perform precision measurements.

SECTION IV PERFORMANCE TESTS provides Safety Considerations, Calibration Procedures and Cycles, HP-IB Diagnostics, and a Test Record.

SECTION V ADJUSTMENTS covers Safety Considerations, Adjustment Procedures, Test Equipment Required, and an Adjustment Record.

SECTION VI REPLACEABLE PARTS includes Tables of Replaceable Parts, including illustrated parts breakdowns of chassis and mechanical assemblies, Abbreviations, and Ordering Information.

SECTION VII MANUAL CHANGES describes how to update or backdate the manual for prefixes other than those listed in Table I-1.

SECTION VIII SERVICE contains Safety Considerations, Theory and Block Diagram Descriptions, Trouble Isolation, Troubleshooting, Disassembly Procedures, Schematics, and Component Locations.



Figure 1-0 Typical 5528A Laser Measurement System

Figure 1-2
TYPICAL 5528A LASER MEASUREMENT SYSTEM

(See Page 1-0)

SECTION I
GENERAL INFORMATION

Introduction, Serial Numbers, Safety, Specifications, Descriptions, System Configurations, Test Equipment, Warranty

SECTION II
INSTALLATION

Initial Inspection, Preparation for Use, Interconnecting Cables, HP-IB Cables, Storage and Shipment

SECTION III
OPERATION

5508A Controls, 5518A Controls, Compensation, Error Messages, Operating Instructions, HP-IB Operation, Operator Maintenance

SECTION IV
PERFORMANCE CHECKS

Equipment Required, Test Record, Operational Verification, Calibration Cycle, Calibration Procedures, Performance Tests

SECTION V
ADJUSTMENTS

Equipment Required, Factory Selected Components, Adjustment Procedures

SECTION VI
REPLACEABLE PARTS

Abbreviations, Ordering Information, Direct Mail Order System, PC Board Replaceable Parts, Exploded Views and Chassis Parts

SECTION VII
MANUAL CHANGES

Newer Instruments, Older Instruments

SECTION VIII
SERVICE

Theory, Trouble Isolation, Troubleshooting, Component Locators, Schematic Diagrams

HOW TO LOCATE INFORMATION

Three methods are used to assist in locating information, a Table of Contents preceding Section I, a Tab System that divides the manual into sections and subsections, and an alphabetical index of subjects located at the back of the manual.

The Table of Contents lists all first, second and third paragraph headings, all Tables, and all Figures used throughout the manual.

The Tab System divides the contents of the manual into sections. In addition, tabs are used to divide Section VIII into subsections for each instrument to allow for easy access of service information. Tabs are provided for the 5528A, 5508A, 5518A, 10751A/B/C, and the Optics. A section Table of Contents is included on the backside of each tab divider.

SECTION I
GENERAL INFORMATION

Page

Introduction 1-1
Manual Organization 1-1
How to Locate Information 1-2
Instruments Covered by the Manual 1-2
Safety Considerations 1-3
Specifications 1-3
5528A Laser Measurement System Description 1-12

Equipment Description 1-12
- 5518A Laser Head 1-12
- 5508A Measurement Display 1-13
- 05508-60021 Remote Control Unit 1-14
- 10751A/B Air Sensor 1-15
- 10757A/B/C Material Temperature Sensors 1-15
- 10753A Tripod 1-16
- 10759A Footspacing Kit 1-17
- 10766A Linear Interferometer 1-18
- 10767A Linear Retroreflector 1-18
- 10770A Angular Interferometer 1-19
- 10771A Angular Reflector 1-19
- 10772A Turning Mirror 1-20
- 10773A Flatness Mirror 1-20
- 10774A Short Range Straightness Optics 1-21
- 10775A Long Range Straightness Optics 1-21
- 10776A Straightness Accessory Kit 1-22
- 10777A Optical Square 1-23
- 10784A Base 1-23
- 10785A Height Adjuster and Post 1-24

Optical Kits
- 55280A Linear Measurement Kit 1-25
- 55281A Angular Optics 1-26
- 55282A Flatness Accessory Kit 1-26
- 55283A Striaghtness Measurement Kit 1-27

Other Compatible Equipment 1-28
System Configurations 1-28
Recommended Test Equipment 1-29
Warranty 1-30

SECTION I
GENERAL INFORMATION

1-1. INTRODUCTION

1-2. This Service Manual contains information required to install, test, adjust, and service the Hewlett-Packard Model 5528A Laser Measurement System. It is intended primarily for use by those concerned with installing and servicing the system. A separate User's Guide is supplied that describes information required to setup, align, and apply the system to various types of measurements. Sufficient operating information is presented in this manual to allow service personnel to repair the instruments available for the system.

1-3. The HP part number of this manual is listed on the title page. Also listed is a microfiche part number which may be used to order 4- × 6- inch microfilm transparencies of the manual. The microfiche package also includes the latest "Manual Changes" supplement and any pertinent Service Notes.

1-4. MANUAL ORGANIZATION

1-5 This Service Manual is organized as follows:

SECTION I GENERAL INFORMATION covers Manual Organization, Instruments Covered by the Manual, Safety Considerations, Specifications, System Description, Equipment Descriptions, Optical Kits, Compatible Equipment, System Configurations, Recommended Test Equipment, and Warranty Information.

SECTION II INSTALLATION covers Preparation for Use, Power Requirements, Line Voltage and Fuse Selection, Interconnecting Cabling, Operating and Storage Environments, Storage and Shipment, and Packaging.

SECTION III OPERATION provides operating information for the Service Technician and covers Equipment Front and Rear Panel Features, Error Messages, Operator's Check, Self Test and Warm-up Countdown description, Data Transfer to External Devices, Instrument Function Codes, HP-IB Operation, HP-IB Switches, and Operator's Maintenance. A separate User's Guide is supplied for those concerned with applying the system to perform precision measurements.

SECTION IV PERFORMANCE TESTS provides Safety Considerations, Calibration Procedures and Cycles, HP-IB Diagnostics, and a Test Record.

SECTION V ADJUSTMENTS covers Safety Considerations, Adjustment Procedures, Test Equipment Required, and an Adjustment Record.

SECTION VI REPLACEABLE PARTS includes Tables of Replaceable Parts including illustrated parts breakdowns of chassis and mechanical assemblies, Abbreviations, Ordering Information, and the HP Direct Mail Order System.

SECTION VII MANUAL CHANGES describes how to update or backdate the manual for prefixes other than those listed in Table 1-1.

SECTION VIII SERVICE contains Safety Considerations, Theory and Block Diagram Descriptions, Trouble Isolation, Troubleshooting, Disassembly Procedures, Schematics, and Component Locations.

1-6. HOW TO LOCATE INFORMATION

1-7. Three methods are used to assist in locating information, a Table of Contents preceding Section I, a Tab System that divides the manual into sections and subsections, and an alphabetical index of subjects located at the back of the manual.

1-8. The Table of Contents lists all first, second and third paragraph headings all Tables, and all Figures used throughout the manual.

1-9. The Tab System divides the contents of the manual into sections. In addition, tabs are used to divide Section VIII into subsections for each instrument to allow for easy access of service information. Tabs are provided for the 5528A, 5508A, 5518A, 10751A/B, 10757A/B/C, and the Optics. A section Table of Contents is included on the backside of each tab divider.

1-10. INSTRUMENTS COVERED BY THE MANUAL

1-11. Table 1-1 lists the instruments, optics, and accessories that comprise the 5528A Laser Measurement System. Table 1-1 also lists the equipment's serial prefixes that this manual applies to. Equipment with lower numbered serial prefixes than those listed in Table 1-1 are covered in Section VII, Backdating. Higher numbered serial prefixes are documented with a "Manual Changes" supplement printed on yellow paper.

1-12. Attached to each instrument of the 5528A System is a serial plate. The serial number is in the form: 0000A00000 or 1A00000 on instruments where serial number space is limited. It is in two parts; the first digits and the letter are the serial prefix and the last five digits are the suffix. The prefix is the same for all identical instruments; it changes only when a change is made to the instrument. The suffix is assigned sequentialy and is unique to the individual instrument. The contents of this manual apply to instruments with the serial number prefixes listed in Table 1-1.

1-13. An instrument manufactured after the printing of this manual may have a serial number prefix that is not listed in Table 1-1. This unlisted serial number prefix indicates the instrument is different from those described in this manual. The manual for this newer instrument is accompanied by a yellow "Manual Changes" supplement. This supplement contains updating information that explains how to change the manual to be applicable to newer instruments.

1-14. In addition to the new series prefix change information, the supplement may contain information for correcting errors in the manual (errata). To keep this manual as current and as accurate as possible Hewlett-Packard recommends that you periodically request the latest "Manual Changes" supplement. The supplement for this manual is identified with the manual print date and part number, both of which appear on the manual title page. Complimentary copies of the supplement are available. If you order additional equipment for your system after the initial system order, this manual may not contain applicable documentation for the new equipment. Contact your local sales and service office for manual updating information.

Table 1-1. 5528A Equipment and Manual Serial Prefix Effectivity

5526A System Component	Manual Serial Prefix Effectivity
5508A Measurement Display	3124A
5518A Laser Head	3020A
10751A/B Air Sensor	2452A
10757A/B/C Material Temperature Sensor	2416A
05508-60021 Remote Control Unit	2108A
10753A Tripod	None
10759A footspacing Kit	2216A
10766A Linear Interferometer	1A
10767A Linear Retroreflector	1A
10770A Angular Interferometer	1A
10771A Angular Reflector	1A
10772A Turning Mirror	1A
10773A Flatness Mirror	1A
10774A Short Range Straightness Optics	1A
10775A Long Range Straightness Optics	1A
10776A Straightness Accessory Kit	2216A
10777A Optical Square	2216A
10784A Base	2216A
10785A Height Adjuster and Post	None

1-15. SAFETY CONSIDERATIONS

1-16. The 5518A system is a Safety Class I product and has been designed and tested in accordance with international safety standards, including HD 194 and IEC* 348. It is also a Class II Laser Product certified as conforming to Bureau of Radiological Health Regulations 21 CFR** 1040.10 and 1040.11, and to international laser safety regulations. The instruments and the manual should be inspected and reviewed for safety markings and instructions before operation. A safety summary is included on the page following the title page.

1-17. SPECIFICATIONS

1-18. Table 1-2 lists specifications and performance characteristics for the 5528A Laser Measurement System.

*IEC = International Electrotechnical Commission
**CFR = Code of Federal Regulations (U.S.A.)

Table 1-2. Specifications and Supplemental Characteristics

GENERAL

Basic Measurements: The measurements that can be made with the system are Distance, Velocity, Angle, Short Range Straightness, and Long Range Straightness. Each requires appropriate optical components. Flatness is derived from Angle. Parallelism and Squareness are derived from Straightness.

System Configuration: The minimum system includes an HP 5508A Measurement Display, an HP 5518A Laser Head, and optics and accessories for each desired measurement type. An HP 10751A/B Air Sensor may be added to compensate for changes in the velocity of light due to the temperature, pressure, or relative humidity of the air. From one to three 10757A/B/C Material Temperature Sensors may be added to compensate for the expansion or contraction of material with temperature.

Environmental Conditions:

Temperature (Operating): 0-40°C (32-104°F)

Temperature of optical products must be stabilized to ±2°C.

Relative Humidity (Operating): 0-95% Non-condensing.

Vibration: All product designs have been tested to withstand 0.25 mm (0.010 inch) peak-to-peak excursion at 10-55 Hz for 15 minutes and 30 g shock for 11 milliseconds on each of three orthogonal axes.

Power Requirements:

Source: 100, 120, 220, or 240 V (-10%, +5%)

Frequency: 48-66 Hz

Consumption: 175 VA maximum

Maximum Allowable Beam Power Loss: The system will operate normally with up to 95% laser beam power loss in one beam (either reference or measurement) or up to 80% loss in each when both beams are affected.

HP 5508A MEASUREMENT DISPLAY

Description: The HP 5508A Measurement Display is a microprocessor based instrument that controls the 5518A Laser Measurement System. It supplies power to the entire system. It contains circuits to process signals from the 5518A Laser Head and from the HP 10751A/B and HP 10757A/B/C sensors. The front panel has a keyboard that may be used to set up measurements. The instrument can display measurement results and setup parameters or output these to another instrument for processing, storing, or plotting. Some of the capabilities of the HP 5508A are described below under the heading SYSTEM OPERATING CHARACTERISTICS.

Dimensions:

Main Unit: 45 × 23 × 19 cm

Remote Control Unit: (Excluding cable) 87 × 61 × 38 mm

Weight:

Main Unit: 8.7 kG

Remote Control Unit: (Including cable) 700 grams

HP 5518A LASER HEAD

Description: The HP 5518A Laser Head contains an automatically-tuned Helium-Neon laser, circuits to control the laser, and optical receivers. The laser generates a coherent, collimated, two frequency beam of light. This is a Class II Laser Product conforming to Federal Bureau of Radiological Health Regulations 21 CFR 1040.10 and 1040.11.

Split Frequency: 1.7 - 2.4 MHz

Vacuum Wavelength: 632.991 nanometres

Vacuum Wavelength Stability: $\pm 2 \times 1^{-8}$, typical

Wavelength Stability:

Short Term (1 Hour): ±0.002 ppm, typical

Long Term (lifetime): ±0.02 ppm, typical

Beam Diameter: 6mm typical

Maximum Power: Output: 1mW

Warm-up Time: less than 10 minutes (4 minutes typical)

Dimensions: 48 × 19 × 12 cm

Weight: 5.5 Kg

HP 10751A/B AIR SENSOR

Description: The 10751A/B contains sensors for measuring air temperature and air pressure. It has a switch to select relative humidity. A cable is attached for connection to the HP 5508A Measurement Display.

Cable Length:

10751A: 5m (16 feet)

10751B: 15 m (49 feet)

Operating Range:

Temperature: 0-40°C (32 -104°F)

Absolute Pressure: 517.2-775.7mm Hg (20.4-30.5 in Hg)

Table 1-2 Specifications and Supplemental Characteristics (Continued)

HP 10751 A/B AIR SENSOR (Continued)

Twelve Month Calibration Interval Sensor Accuracy:

Operating Temp Ranges	Max Air Pressure Error	Max Air Temperature Error
20°C	1.80 mm Hg	0.55°C
15-25°C	2.20 mm Hg	0.60°C
0-40°C	4.20 mm Hg	1.15°C

If the 10751 A/B Air Sensor is incorrectly mounted, add 2° to the listed temperature errors.

Zero Month Calibration Interval Sensor Accuracy:

Operating Temp Ranges	Max Air Pressure Error	Max Air Temperature Error
20°C	0.60 mm Hg	0.45°C
15-25°C	1.40 mm Hg	0.50°C
0-40°C	3.60 mm Hg	1.10°C

If the 10751A/B Air Sensor is incorrectly mounted, add 2° to the listed temperature errors.

Dimensions: (Excluding cable) 18 × 8 × 10 cm

Weight:
10751A: 840 grams
10751B: 1.5 Kg

HP 10757A/B/C MATERIAL TEMPERATURE SENSOR

Description: The 10757A/B/C contains a thermistor type temperature sensor mounted in a remote oil immersible "button" with a magnetic base. A cable is attached to the button for connection to the HP 5508A Measurement Display. Up to three Material Temperature Sensors can be used in the system.

Cable Lengths:
10757A: 5m (16 feet)
10757B: 15m (49 feet)
10757C: 25m (82 feet)

Maximum Sensor Error:
(With 12 month calibration interval)
Over Temperature Range 0-40° C:
±0.10°C when cal match adjusted for a particular HP 5508A Measurement Display.
±0.35°C unadjusted.

Dimensions: (Excluding cable) 32 mm diameter × 15 mm height

Weight:
10757A: 255 grams
10757B: 525 grams
10757C: 795 grams

HP 55280A LINEAR MEASUREMENT KIT

HP 10766A LINEAR INTERFEROMETER

Description: The Linear Interferometer is designed to be used with two Linear Retroreflectors for making linear distance measurements. One Linear Interferometer is supplied with each Linear Measurement Kit.

Alignment Requirements Relative to the Laser Head:
(With the reference reflector mounted above or below the interferometer)
Pitch: ±2°
Yaw: ±5°
Roll: ±1°

Alignment Requirements Relative to the Laser Head:
(With the reference retroreflector mounted on the side of the interferometer)
Pitch: ±5°
Yaw: ±2°
Roll: ±1°

Dimensions: 40 × 40 × 40 mm

Weight: 310 grams

HP 10767A LINEAR RETROREFLECTOR

Description: The Linear Retroreflector is designed to be used with the Linear Interferometer. One retroreflector attaches to the interferometer to establish a reference beam path. A second retroreflector is used in the measurement beam path. The system measures changes in the distance between the interferometer and the measurement retroreflector. Two Linear Retroreflectors are supplied with each Linear Measurement Kit.

Alignment Requirements of the Measurement Retroreflector:
Normal to Incident Beam: ±10°
Roll: Not critical

Dimensions:
Without Attachment Screws: 40 × 40 × 25 mm
With Attachment Screws: 40 × 40 × 35 mm

Weight: 225 grams

Table 1-2. Specifications and Supplemental Characteristics (Continued)

HP 55280A LINEAR MEASUREMENT KIT (Continued)

HP 10784A BASE

Description: The Base is a flat ground stainless steel plate designed to accommodate the Post. It can be used either free standing or clamped to a reference surface. Two Bases are supplied with each Linear Measurement Kit.

Dimensions: 90 × 50 × 11.7 mm

Weight: 365 grams

HP 10785A HEIGHT ADJUSTER AND POST

Description: The Post can be attached to a Base or to a suitable spindle to provide a secure mounting for optical components. The Height Adjuster is designed to mount onto the Post. It contains the system standard 30 mm square bolt pattern to accommodate the optical components. The adjustment range of the Height Adjuster on the Post is 70 mm. Three Height Adjusters and Posts are supplied with each Linear Measurement Kit.

Dimensions:
Height Adjuster: 72 × 40 × 40 mm
Post: Without threaded extension: 19 mm diameter × 110 mm length
Post: With threaded extension, 19 mm diameter × 117.5 mm length

Weight:
Height Adjuster: 215 grams
Post: 230 grams

HP 10786A LINEAR/ANGULAR CASE

Description: The Linear/Angular Case is designed to carry all the optical products and accessory hardware needed to perform linear and angle measurements. It provides protection from both shock and contamination to the components during normal transportation and handling. One Linear/Angular Case is supplied with each Linear Measurement Kit.

Dimensions: 47 × 38 × 15 cm

Weight: 4 Kg, nominal

HP 55281A ANGULAR OPTICS

HP 10770A ANGULAR INTERFEROMETER

Description: The Angular Interferometer is designed to be used with the Angular Reflector to make angle measurements. One Angular Interferometer is supplied with each set of Angular Optics.

Alignment Requirements Relative to the Laser Head:
Pitch: ±2°
Yaw: ±2°
Roll: ±1°

Dimensions: 40 × 40 × 72.6 mm

Weight: 550 grams

HP 10771A ANGULAR REFLECTOR

Description: The Angular Reflector is designed to be used with the Angular Interferometer to make angle measurements. One Angular Reflector is supplied with each set of Angular Optics.

Alignment Requirements:
Pitch/Yaw: ±10 arc-min autoreflection angle
Roll: ±1°, relative to the measurement plane

Dimensions: 40 × 40 × 72.6 mm

Weight: 650 grams

Table 1-2. Specifications and Supplemental Characteristics (Continued)

HP 55282A FLATNESS ACCESSORY KIT

HP 10759A FOOTSPACING KIT

Description: The Footspacing Kit consists of three separate precision ground plates with hardened surface pads. They are designed to be used with the Angular Interferometer and Angular Reflector to make surface plate flatness measurements. One Footspacing Kit is supplied with each Flatness Accessory Kit.

Foot Pad Wear Spec: USA Fed Spec GGG-P-463

Dimensions:
2 inch: 63.5 × 50 × 12 mm
4 inch: 114 × 50 × 12 mm
6 inch: 165 × 50 × 12 mm

Weight:
2 inch: 230 grams
4 inch: 450 grams
6 inch: 650 grams

HP 10773A FLATNESS MIRROR

Description: The Flatness Mirror is designed to provide multi-direction plane beam bending for surface plate flatness measurements. It is designed to be used with the Angular Interferometer, the Angular Reflector, and the Footspacing Kit. Two Flatness Mirrors are supplied with each Flatness Accessory Kit.

Perpendicularity of Mirror to Foot Pad Plane: ±1 arc-minute

Rotation of Mirror on Base: ±360°

Dimensions: 80 × 110 × 46 mm

Weight: 660 grams

HP 55283A STRAIGHTNESS MEASUREMENT KIT

HP 10774A SHORT RANGE STRAIGHTNESS OPTICS

Description: The Short Range Straightness Optics consist of a matched interferometer and reflector mirror set. These are designed for making straightness measurements. These must be used as a set; an interferometer from one set cannot be used with a reflector mirror from another set. One set of Short Range Straightness Optics is supplied with each Straightness Measurement Kit.

Alignment Requirements:
Interferometer Normal to Beam: ±1°
Interferometer Roll Relative to the Straightness Reflector: ±4 arc-min
Axial Deviation of Reflector Normal to Split Beam Plane: ±1.5 mm

Dimensions:
Interferometer: 32 × 32 × 82 mm
Reflector: 40 × 40 × 110 mm

Weight:
Interferometer: 165 grams
Reflector: 900 grams

HP 10772A TURNING MIRROR

Description: The Turning Mirror consists of a reflector mirror and an adjustable mounting mechanism. The mirror is mounted in the housing at a 45° angle. Attached to the adjustable mount, it serves as a general purpose beam bender. One Turning Mirror is supplied with each Straightness Measurement Kit.

Adjustment Range of Leveling Plate, Two Axes: ±6°

Dimensions:
Mirror: 40 × 40 × 40 mm
Mount: 46 × 46 × 30 mm

Weight:
Mirror: 320 grams
Mount: 190 grams

Table 1-2. Specifications and Supplemental Characteristics (Continued)

HP 55283A STRAIGHTNESS MEASUREMENT KIT (Continued)

HP 10776A STRAIGHTNESS ACCESSORY KIT

Description: The Straightness Accessory Kit consists of a Straightness Retroreflector, an Adaptor Plate for mounting the Straightness Interferometer, a Reflector Mount for providing an adjustable mount for the Straightness Reflector, a Base Assembly to provide a stable platform for the Reflector Mount, two long posts and one short post. One Straightness Accessory Kit is supplied with each Straightness Measurement Kit.

Adjustment Range of Reflector Mount, Two Axes: −3° to +5°

Dimensions:
- **Base Assembly:** 106 × 51 × 55 mm
- **Straightness Retroreflector:** 75 × 85 × 100 mm
- **Adapter Plate:** 40 × 40 × 10 mm
- **Reflector Mount:** 70 × 120 × 140 mm
- **Post:** 19 mm diameter × 108 mm length, 2 ea.
  19 mm diameter × 55 mm length, 1 ea.

Weights:
- **Base Assembly:** 910 grams
- **Straightness Retroreflector:** 375 grams
- **Adapter Plate:** 110 grams
- **Reflector Mount:** 1.8 Kg
- **Post:** 230 grams ea (Qty: 2)
  120 grams ea Qty: 1)

HP 10787A STRAIGHTNESS/SQUARENESS CASE

Description: The Straightness/Squareness Case is designed to carry all the optical products and accessory hardware needed to perform straightness and squareness measurements. It provides protection from both shock and contamination to the components during normal transportation and handling. One Straightness/Squareness Case is supplied with each Straightness Measurement Kit.

Dimensions: 47 × 38 × 15 cm

Weight: 4 Kg, nominal

OTHER OPTICAL PRODUCTS

HP 10775A LONG RANGE STRAIGHTNESS OPTICS

Description: The Long Range Straightness Optics consist of a matched interferometer and reflector mirror set. These are designed for making straightness measurements. These must be used as a set an interferometer from one set cannot be used with a reflector mirror from another set.

Alignment Requirements:
- **Interferometer Normal to Beam:** ±1°
- **Interferometer Roll Relative to the Straightness Reflector:** ±40 arc-min
- **Axial Deviation of Reflector Normal to Split Beam Plane:** ±1.5 mm

Dimensions:
- **Interferometer:** 32 × 32 × 32 mm
- **Reflector:** 40 × 40 × 110 mm

Weights:
- **Interferometer:** 165 grams
- **Reflector:** 800 grams

HP 10777A OPTICAL SQUARE

Description: The Optical Square consists of an optical square and a precision mounting base. It is used in conjunction with straightness optics to make squareness measurements. Refer to the Straightness Optics Specifications for the associated specs.

Incident to Reflected Beam Perpendicularity: ±2 arc-sec

Specified Angle of Each Optical Square: ±0.1 arc-sec

Alignment Requirement: ±5 arc-min autoreflection angle

Dimensions:
- **Mirror and Housing:** 43 × 145 × 145 mm
- **Mount:** 93 × 140 × 152 mm

Weight:
- **Mirror and Housing:** 1.5 Kg
- **Mount:** 2.5 Kg

Table 1-2. Specifications and Supplemental Characteristics (Continued)

LINEAR DISTANCE AND VELOCITY MEASUREMENTS

Linear Distance Measurement Accuracy: Distance measurements are accurate within the following tolerances depending on the velocity of light compensation method and operating temperature. Values shown apply at a known material temperature with a known coefficient of thermal expansion.[1]

Operating Temperature Range[2]	Velocity of Light (VOL) Compensation Method	
	Manual (VOL Exactly Known in Beam Path)	Automatic[3] (Using 10751A/B Air Sensor)
19.5 – 20.5°C	±0.1 ppm	±1.5 ppm
15 – 25°C	±0.1 ppm	±1.7 ppm
0 – 40°C	±0.1 ppm	±3.0 ppm

[1] If automatic material temperature sensing is used, the system error will be increased by Te (ppm).
Te(ppm) = coefficient in ppm/°C x average sensor error in °C.
(See 10757A/B/C Maximum Sensor Error Specification.)

[2] Temperatures of all system components are stabilized anywhere within the temperature range shown.

[3] 10751A/B mounted in recommended orientation. 12 month calibration interval used. Humidity switch set to position closest to actual humidity. If humidity switch set to 50%, tolerances are 1.75 ppm at 20°C, 2.00 ppm at 15–25°C, and 3.70 ppm at 0–40°C. If 10751A/B mounted incorrectly, add 2 ppm.

[4] With VOL known exactly in the beam path, the accuracy is ±0.02 ppm if the HP 5518A Laser Head is factory calibrated to MIL STD 45662.

Linear Distance Measurement Resolution:
Metric Units Mode: 0.02 micron (0.00002 mm)
English Units Mode: 1 microinch

Velocity Measurement Accuracy: ± 0.1%

Velocity Measurement Resolution:
Metric Units Mode: 0.1 mm/minute
English Units Mode: 0.01 in/minute

Maximum Velocity: ± 27000 mm/minute (± 1060 in/min)

Measurement Range/Axial Separation: Typical, with proper alignment, 15–25° C).

Maximum Separation and Range	Optics Configuration	
	Moving Retroreflector (Interferometer Within 5 Metres of Laser Head)	Moving Interferometer
Axial Separation (Head to Retroreflector)	50 metres (165 feet)	15 metres (50 feet)
Measurement Range (Distance of Travel)	40 metres (130 feet)	15 metres (50 feet)

ANGLE MEASUREMENTS

Angle Measurement Accuracy: Angle measurements are accurate within ± 0.2% of displayed value ± 0.05 arc-sec per meter of traveled distance of the moving optic.

Angle Type: Pitch and yaw

Angle Measurement Resolution: 0.1 arc-sec

Angle Measurement Range:
± 36000 arc-sec

Axial Separation: (typical, with proper alignment, 15–25° C, distance between the Laser Head and the Reflector.)
15 Meters (50 feet)

FLATNESS MEASUREMENTS

The following specifications assume that the optional Dimensional Metrology Analysis System is used in conjunction with the HP 5528A to gather, analyze and plot flatness calibration results and that the temperature of all optical components is stabilized in the range 15-25° C. Values do not include effects of surface cleanliness or operator positioning repeatability.

Flatness Measurement Accuracy:
±0.2% of displayed value

Flatness Measurement Resolution (Per Step):

Footspacing Dimension	Resolution
2 in	0.03 micron (1.0 microinch)
4 in	0.06 micron (2.0 microinch)
8 in	0.08 micron (3.0 microinch)

Table 1-1. Specifications and Supplemental Characteristics (Continued)

FLATNESS MEASUREMENTS (Continued)

Reference Plane Accuracy: The uncertainty of a surface plate flatness measurement is bounded by two parallel planes separated by the value below.
Metric Units Mode: 0.03 M^2 microns
English Units Mode: 0.12 F^2 microinches
where:
M = length of the surface diagonal in metres
F = length of the surface diagonal in feet

Lateral Offset and Flatness Range: The combination of lateral offset and maximum flatness deviation must not displace the Reflector more that ±1 mm from the beam path in any direction.

STRAIGHTNESS AND SQUARENESS MEASUREMENTS

The following specifications assume that the optional Dimensional Metrology Analysis System is used in conjunction with the HP 5528A to provide averaging and calculation capabilities for Straightness, Parallelism and Squareness measurements and that the Optical Square is aligned within 5 arc-min using autoreflection techniques.

Straightness Measurement Accuracy: Overall accuracy is the sum of the two components below.[1]

Overall Accuracy = Optical Reference Accuracy + Measurement Accuracy

Optical Reference Accuracy:[2]

Short Range Optics:
Metric Units Mode: 0.15 M^2 microns TIR
English Units Mode: 0.5 F^2 microinches TIR

Long Range Optics:
Metric Units Mode: 0.015 M^2 microns TIR
English Units Mode: 0.05 F^2 microinches TIR
where:
TIR = Total Indicated Reading
M = distance of travel of the moving optics in meters
F = distance of travel of the moving optic in feet

Measurement Accuracy:

Short Range Optics:

Temperature Range	Displayed Value	
	0–10 microns (0–400 microinches)	10–1500 microns (400–60000 microinches)
15–25° C	± 5%	± 1% ± 0.25 microns (10 microinches)
0–40° C	± 6%	± 1% ± 0.5 microns (20 microinches)

Long Range Optics:

Temperature Range	Displayed Value	
	0–100 microns (0–4000 microinches)	100–1500 microns (4000–60000 microinches)
15–25° C	± 5%	± 2.5% ± 2.5 microns (100 microinches)
0–40° C	± 7.5%	± 2.5% ± 5 microns (200 microinches)

[1] This is analogous to the traditional straightedge and indicator method of measuring straightness, where Optical Reference Accuracy corresponds to the straightedge accuracy, and Measurement Accuracy corresponds to the indicator accuracy.

[2] Optical reference error can be eliminated by using straightedge (mirror) reversal techniques.

Straightness Measurement Resolution:

Short Range Optics:
Metric Units Mode: 0.01 microns (0.00001 mm)
English Units Mode: 1 microinch

Long Range Optics:
Metric Units Mode: 0.1 microns (0.0001 mm)
English Units Mode: 10 microinches

Straightness Measurement Range: ± 1.5 mm (0.060 inch)

Axial Separation Range: (Typical with proper alignment, 15–25°C, distance between the Interferometer and the Reflector.)

Short Range Optics: 0.1–3 meters (4–120 inches)

Long Range Optics: 1–30 meters (3–100 feet)

Squareness Measurement Accuracy:

Short Range Optics:
Metric Units Mode: (± 1.0" + 0.1M) arc-sec ±1% of θ
English Units Mode: (± 1.0" + 0.03M) arc-sec ±1% of θ

Long Range Optics:
Metric Units Mode: (± 1.0" + 0.01M) arc-sec ±2.5% of θ
Metric Units Mode: (± 1.0" + 0.003M) arc-sec ±2.5% of θ
where:
θ = calculated out-of-squareness angle in arc-sec
M = distance of travel of the moving optic in meters
F = distance of travel of the moving optic in feet

NOTE

"1.0" can be as large as 1.2 arc-sec with maximum allowable misalignment of the optical square as per the alignment procedure.

Table 1-2. Specifications and Supplemental Characteristics (Continued)

SYSTEM OPERATING CHARACTERISTICS

Velocity of Light (VOL Compensation)

Manual: Compensation factory is entered via keyboard. Range is 0.0 to 999.9 ppm.

Automatic: Requires 10751A/B Air Sensor. Displays of pressure, temperature, R.H. switch setting, and computed VOL are provided.

Material Expansion Coefficient: Entered via keyboard Range is -100 to +100 ppm per °C or °F.

Maximum Compensation Update Time: 2.5 seconds, typical.

Material Temperature:

Manual: Entered via keyboard. Range is 0-50°C or 32-122°F.

Automatic: Requires 1 to 3 10757A/B/C Material Temperature Sensors. Display of individual readings and average of all connected sensors is provided Average value is used in all calculations.

Display: 9½ digits with a - sign. Displayed resolution is selectable.

Preset Capability: Measurements can be preset to user selected values within the ranges shown below. Presets either add or multiply as indicated.

Measurement Type	Range in Metric Units Mode	Range in English Units Mode	Math Function
Distance	-50000 to +50000 mm	-2000 to +2000 in	Add
Velocity	-20000 to +20000 mm/min.	-720 to +720 in/min.	Add
Angle	0. to 2	0 to 2	Multiply
Straightness: Long Range or Short Range	0 to 3	0 to 3	Multiply

Direction Sense: Reverses sign of measurement direction. Does not change sign of preset value.

Units Selection: Rear panel switch selects Metric units (Millimeters, °C) or English units (inches, °F) for all displays and data entry.

Digital Output: Data is output in ASCII format via HP-IB (the Hewlett-Packard Interface Bus). Capabilities include: full TALKER, limited LISTENER, and no CONTROLLER. The following IEEE 488 Interface Function Codes are available: C0, T5, L4, SH1, AH1, SR1, RL1, PP0 DC1, and DT1. The maximum average output rate for each measurement type equals the Update Rate for that measurement type.

Update Rates: (Nominal) Measurement data are updated at the following average rates:

AVERAGE MEASUREMENT UPDATE RATES

Measurement Type	Auto Record	HP-IB Triggered
Distance	20/s	20/s
Velocity	20/s	15/s
Angle	20/s	12/s
Straightness		
Not Max Resolution	20/s	25/s
Max Resolution	5/s	5/s

Auto Record: Outputs the value currently displayed at fixed intervals of time selected by the user. The range is 0.05 to 12.0 seconds in increments of 0.05 second, typical

Remote Record: Via Remote Control connector on rear panel of 5508A. TTL level (high to low) activates data output.

Remote Control Unit: Includes RESET and RECORD buttons and SIGNAL STRENGTH indicator for initiating data output from up to 15 meters away from the 5508A Measurement Display unit. Supplied with 5508A.

Data Smoothing: Smoothing (averaging) to reduce the effects of vibration and noise is automatically applied to all displayed measurement data. Smoothing can be turned off if desired.

1-19. 5528A LASER MEASUREMENT SYSTEM DESCRIPTION

1-20. The Hewlett-Packard Model 5528A Laser Measurement System (Figure 1-0) is a portable, lightweight dimensional measurement device capable of making single axis measurements including distance, velocity, angular, flatness, and straightness and squareness measurements. The system consists of the 5518A Laser Head, 5506A Measurement Display, several optical instruments, and the optional 10751A/B Air Sensor and 10757A/B/C Material Temperature Sensor.

1-21. EQUIPMENT DESCRIPTION

1-22. The following paragraphs describe the equipment and accessories supplied or available for the measurement system.

1-23. 5518A Laser Head

1-24. The 5518A Laser Head (Figure 1-1) is supplied with a Test Attenuator HP Part No. 1000-0818, a Test Polarizer HP Part No. 1000-0016, an Adjustment Screw HP Part No. 05518-20316, a Lock Nut HP Part No. 05518-20317, and 3 Screws M6 × 1.25 × 25 mm HP Part No. 0515-0796.

1-25. The 5518A Laser Head (Figure 1-1) consists of a thermally-tuned laser tube, control circuits, a reference receiver, a measurement receiver, and a high voltage power supply. The tube provides a coherent collimated light source consisting of two orthogonally polarized frequency components. One component is polarized parallel to the plane of the mounting feet and the other is polarized perpendicular to that plane.

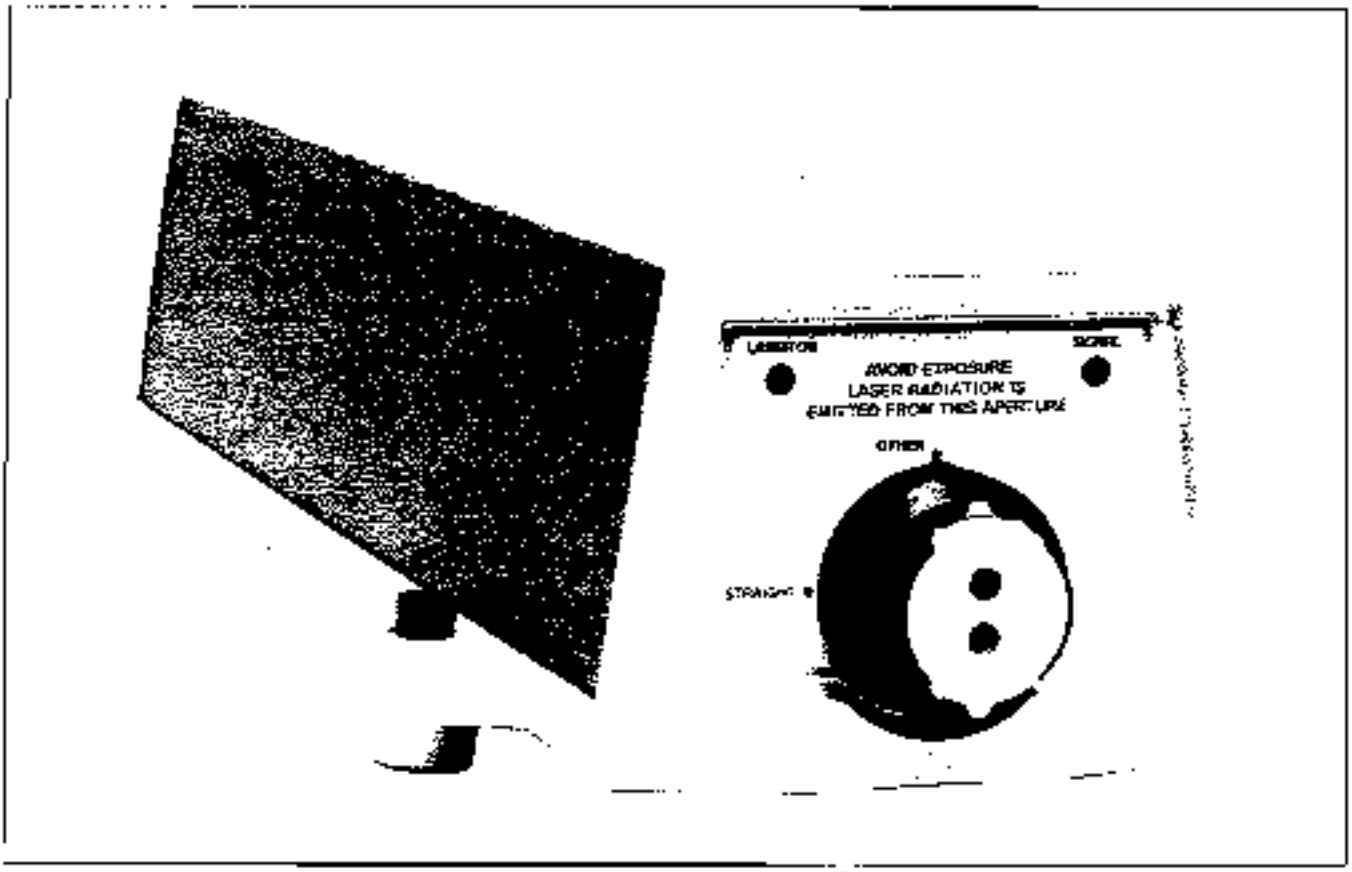


Figure 1-1. 5518A Laser Head

1-26. Before the laser beam is emitted from the Laser Head, a portion of it is sampled. Most of this sample is fed into the reference receiver to determine the difference in frequency between the two optical components. This difference frequency is called the **Reference Frequency**. The remainder of the sampled beam is used to control the tuning of the laser.

1-27. During a measurement, the laser beam is directed through measurement optics and then returned to the measurement receiver to determine the measurement difference frequency. If the optics remain stationary the **Measurement Frequency** and the **Reference Frequency** are the same. Relative motion between the measurement optics results in a change of the **Measurement Frequency**. The 5508A compares the measurement frequency to the reference frequency and calculates the displacement of the optics.

1-28. 5508A Measurement Display

1-29. The 5508A Measurement Display (Figure 1-2) is supplied with Remote Control Unit 05508-60021.

1-30. The Measurement Display (Figure 1-2) consists of measurement and reference pulse counters, analog-to-digital converter circuits, HP-IB circuits, a data bus system, keyboard-display, processor, and power supplies. An extensive self-test feature is built into the 5508A which runs immediately after power-up, thereby giving a high degree of confidence that the equipment is operating properly.

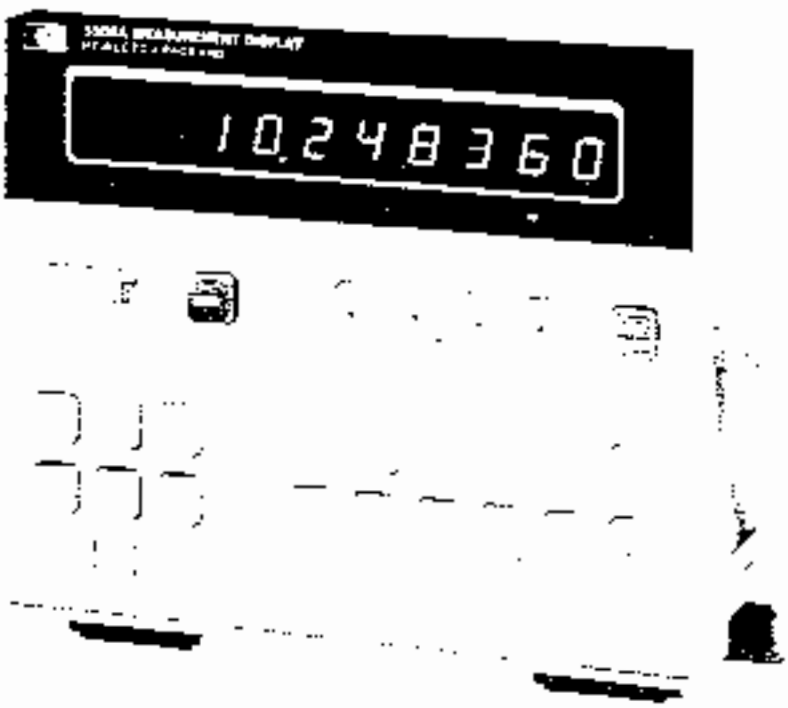


Figure 1-2. 5508A Measurement Display

1-31. The major function of the Measurement Display is to continuously subtract the reference counter contents from the measurement counter contents and display the difference. The 5508A can also correct the difference count by first multiplying the difference count value by a compensation factor.

1-32. The compensation factor is used to correct for the dependence of laser wavelength on air temperature, pressure and humidity. It is also used to correct for thermal expansion of the material being measured. The compensation factor can be determined by the user and entered into the 5508A via the front panel or can be calculated automatically by the 5506A if the optional 10751A/B Air Sensor and/or 10757A/B/C Material Temperature Sensors are used.

1-33. The keyboard on the Measurement Display unit allows the operator to select operating modes and displays, enter data, and has provision for reset and record functions.

1-34. The HP-IB circuits allow the Laser Display to be interfaced with an external controller such as a calculator or computer. Data may be either input or output via the bus. The HP-IB also allows all front panel keyboard functions to be remotely programmed via HP-IB. A "talk only" mode allows transfer of data to a recording device without using an HP-IB controller. The Hewlett-Packard Interface Bus (HP-IB) is HP's implementation of the ANSI/IEEE-488 Standard Interface.

1-35. 05508-60021 Remote Control Unit

1-36. The Remote Control Unit (Figure 1-3) is supplied with the 5508A and allows the Measurement Display to be reset from a remote location. Operation of the Laser Head is unaffected by the reset function. Provision is also made to remotely select the record function to output data to calculators, plotters, and monitors. A beam strength meter is included in the remote control unit.

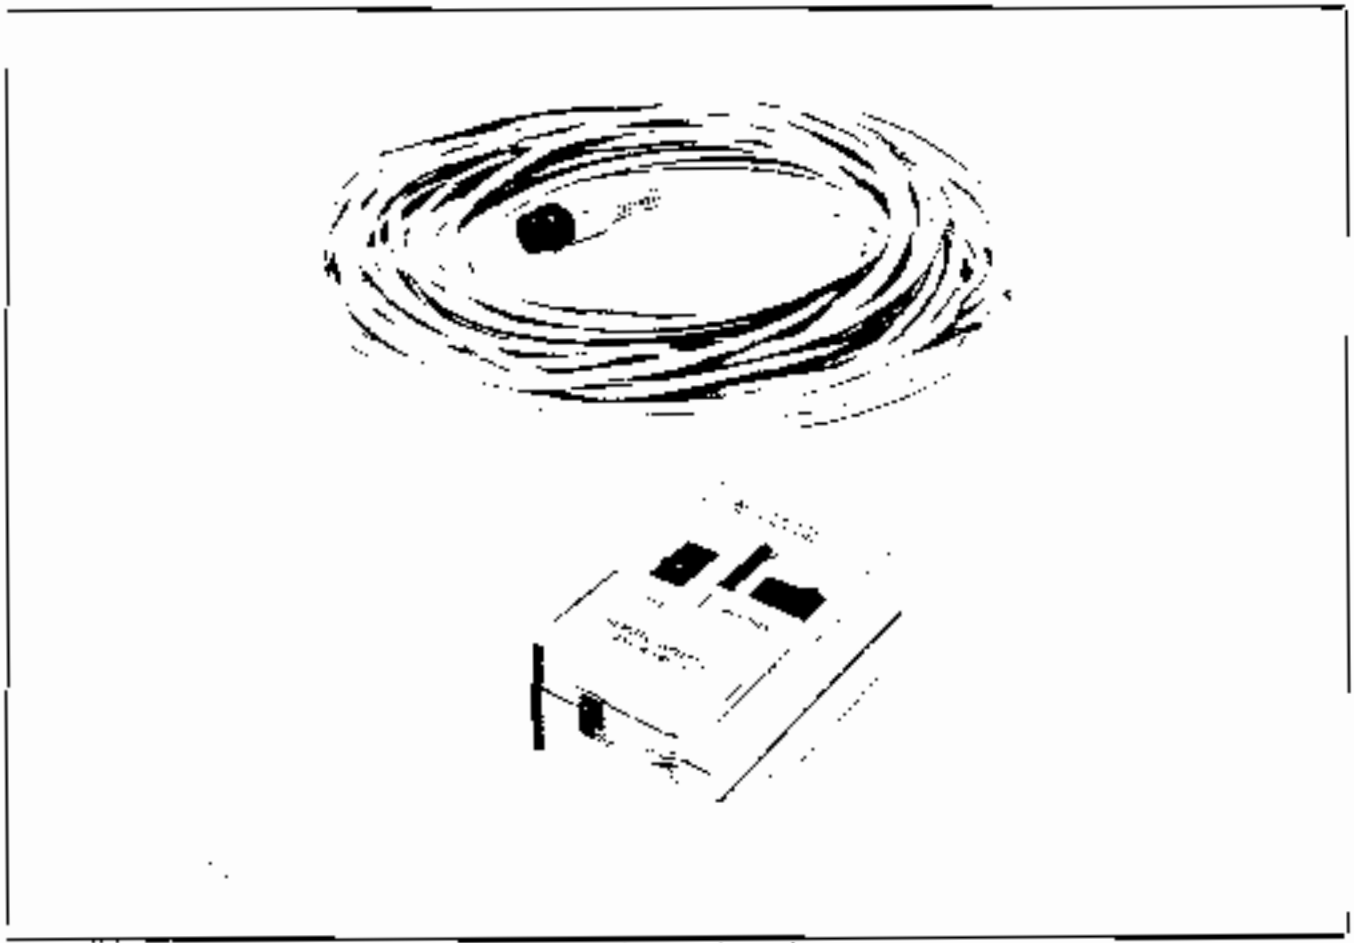


Figure 1-3. Remote Control Unit

1-37. 10751A/B Air Sensor

1-38. The 10751A/B (Figure 1-4) measures air temperature and pressure, and has provision for manually setting in a factor for low, mid, or high humidity. The sensor output connects to an analog-to-digital converter in the Measurement Display. The difference between the A and B models is the cable length. the 10751A cable length is 5 metres (16 feet), and the 10751B cable is 15 metres (49 feet).

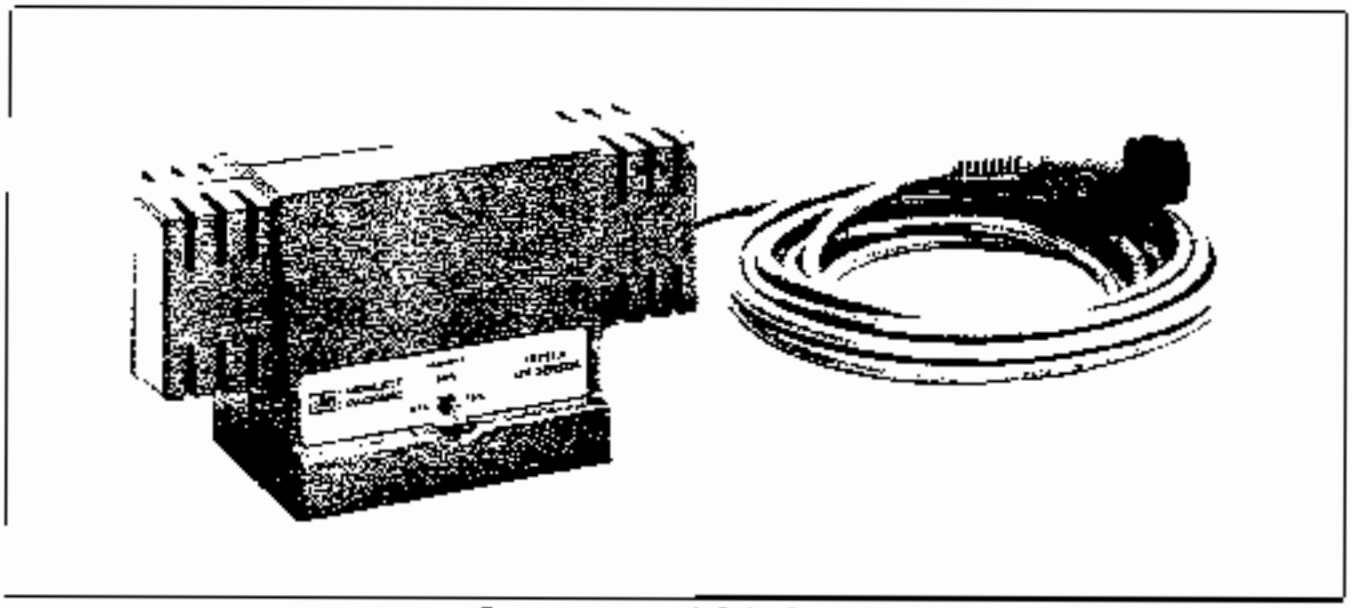


Figure 1-4. 10751A/B Air Sensor

1-39. 10757A/B/C Material Temperature Sensors

1-40. Up to three 10757A/B/C Material Temperature Sensors (Figure 1-5) can be used to sense the temperature of the workpiece. The Measurement Display has provision to enter the workpiece coefficient of expansion from the keyboard. Material temperature and the coefficient of expansion are used in computing the total compensation factor used for computations. The difference in the A, B, and C models is the cable length. the 10757A cable length is 5 metres (16 feet), the 10757B cable length is 15 metres (49 feet), the 10757C cable length is 25 metres (82 feet).

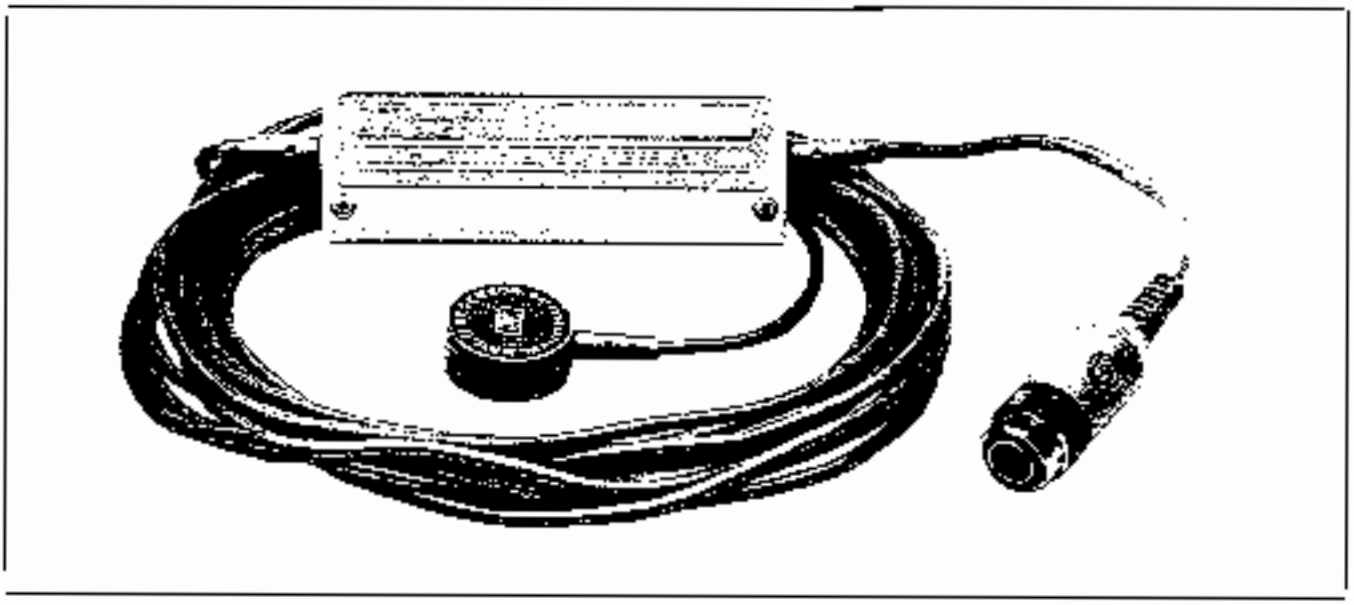


Figure 1-5. 10757A/B/C Material Temperature Sensor

1-41. 10753A Tripod

1-42. The optical instruments used in the system can be remotely located from the Laser Head for greater accuracy and convenient fixturing. By locating the Laser Head away from the measurement setup, a potential source of heat is eliminated

1-43. The Model 10753A (Figure 1-6) is especially designed for this purpose, allowing rapid alignment and easier setups. It is equipped with a heavy duty mounting plate and can be adjusted for tilt, height, rotation, and lateral movement. The tripod is collapsible and portable. The tripod consists of a Mounting Plate, HP Part No. 10753-60001, a Cross Slide Assembly, HP Part No. 1000-0387, a Column Adapter, HP Part No. 1531-0052, and a Tripod Assembly, HP Part No. 1520-2168.



Figure 1-6. 10753A Tripod

1-44. 10759A Footspacing Kit

1-45. The footspacing kit (Figure 1-7) consists of:

1 each, Footspacer, 101.6 mm; HP Part No. 10759-20001
1 each, Footspacer, 152.2 mm; HP Part No. 10759-20002
1 each, Footspacer, 50.8 mm; HP Part No. 10759-20003
6 each, Hex Head Screws, M3 × 8L; HP Part No. 0515-0348
1 each, Hex Wrench, size 2.5 mm; HP Part No. 8710-1181

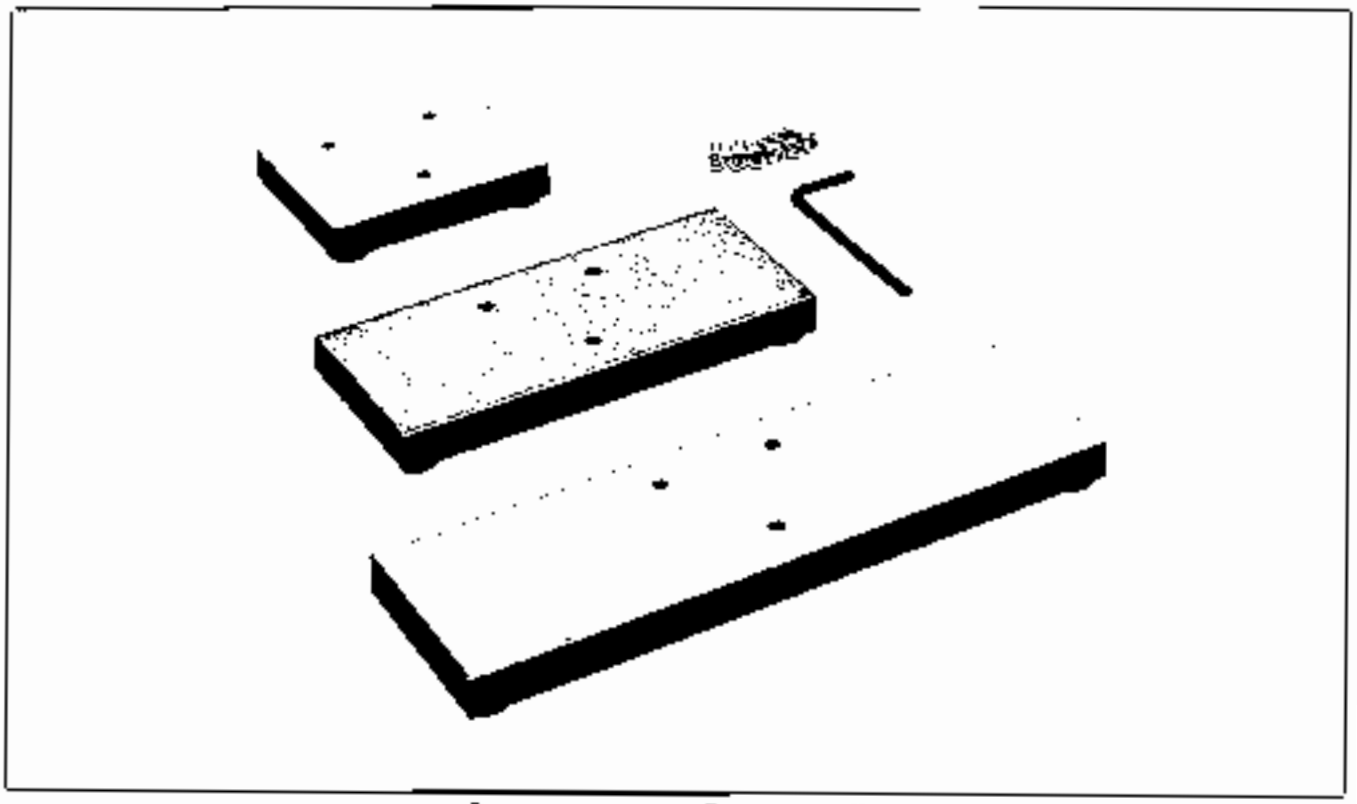


Figure 1-7. 10759A Footspacing Kit

1-46. The footspacing kit is used with the 10770A Angular Interferometer and the 10771A Angular Reflector to minimize grid setup time and data accumulation time required in checking the flatness of a surface plate. Each foot has three carbide pads to minimize wear.

1-47. 10766A Linear Interferometer

1-48. This interferometer (Figure 1-8) is a passive optical device designed to separate the two frequency components of the 5518A laser beam. The components are recombined by the interferometer after being reflected from their respective optical paths. The two optical paths determined by the interferometer are at right angles to each other. For this reason, linear displacement can be measured parallel or perpendicular to the 5518A laser beam output. The 10760A is supplied with a package of Lens Tissue, HP Part No. 9281-0368.

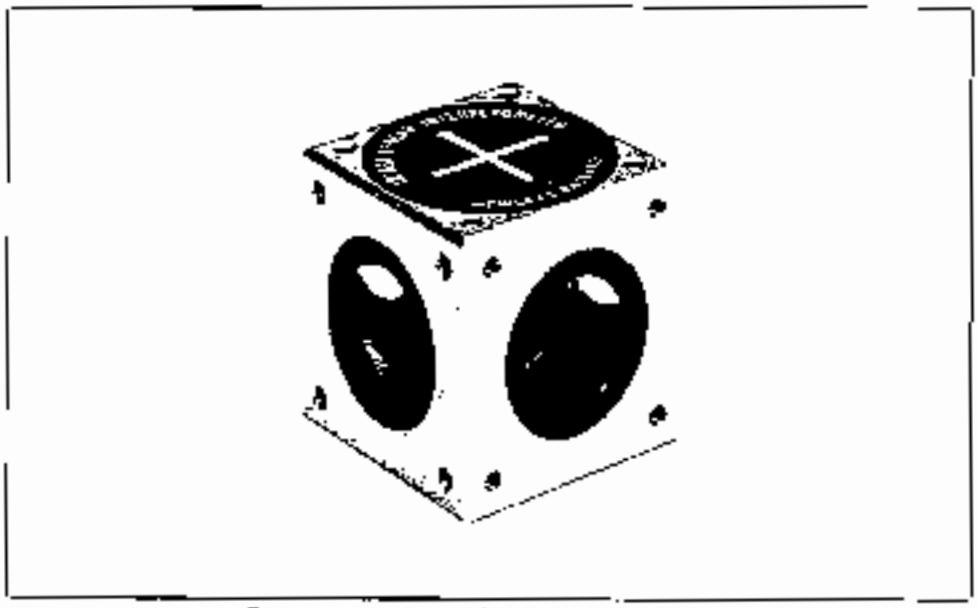


Figure 1-8. 10766A Linear Interferometer

1-49. 10767A Linear Retroreflector

1-50. The retroreflector (Figure 1-9) is used to return the laser beam components to the 10766A Linear Interferometer. It contains a cube corner which has the property that an incident laser beam is reflected parallel to the incoming beam within seconds of arc. The 10767A is supplied with 2 captive screws, HP Part No. 10767-20004, a package of Lens Tissue, HP Part No. 9281-0363, and Alignment Target, HP Part No. 10767-87001

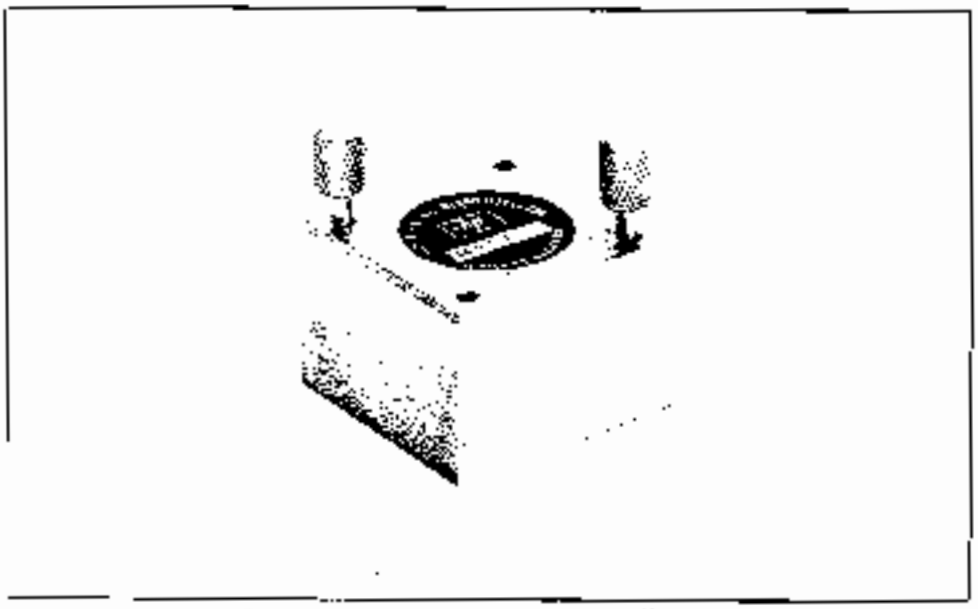


Figure 1-9. 10767A Linear Retroreflector

1-51. 10770A Angular Interferometer

1-52. The angular interferometer (Figure 1-0) provides the capability of making pitch and yaw measurements as well as flatness with the 5528A system. Two beams exit the 10770A spaced to be compatible with the 10771A Angular Reflector. Rotation of either the 10770A or 10771A results in differential path changes which are interpreted by the 5508A as angular displacement. The 10770A is supplied with a package of Lens Tissue, HP Part No. 9281-0368, and Alignment Target, HP Part Number 10767-67001.

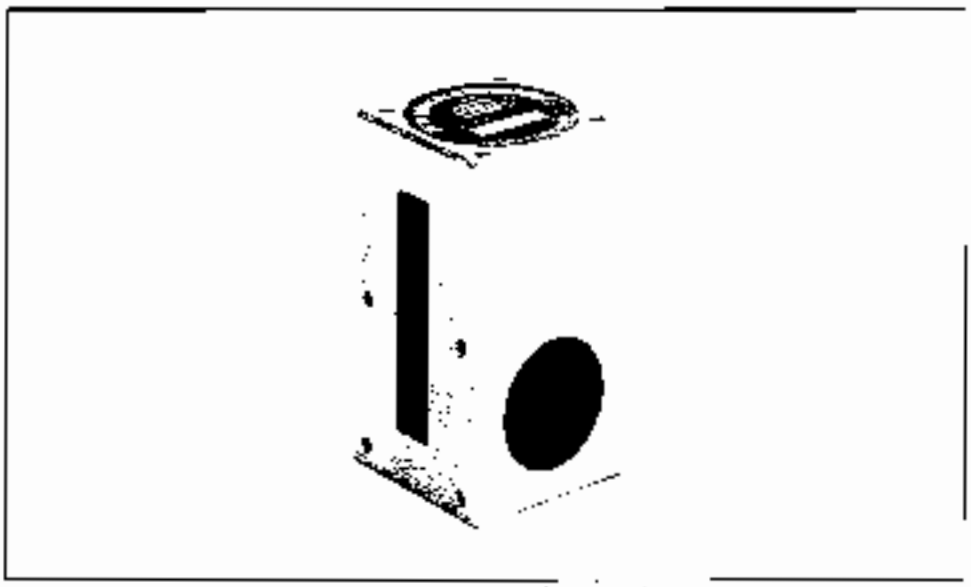


Figure 1-10. 10770A Angular Interferometer

1-53. 10771A Angular Reflector

1-54. The angular reflector (Figure 1-11) is used with the 10770A Angular Interferometer. It consists of two retroreflectors whose center to center spacing is carefully controlled to coincide with the two beams from the 10770A interferometer. Rotation of the 10771A or 10770A results in differential path changes which are interpreted by the 5508A as angular displacement. The 10771A is supplied with a package of Lens Tissue, HP Part No. 9281-0368, and Alignment Target, HP Part No. 10767-67001.

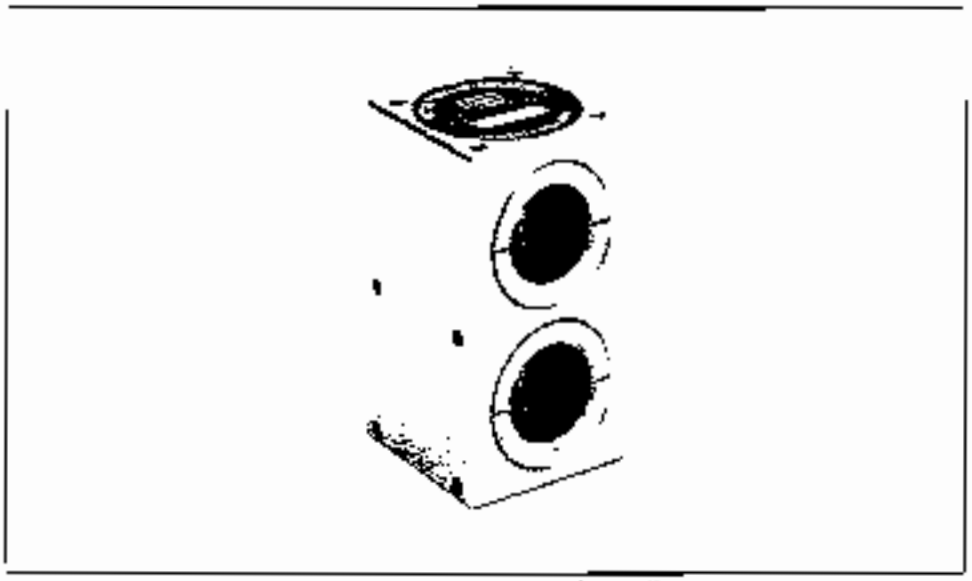


Figure 1-11. 10771A Angular Reflector

1-55. 10772A Turning Mirror

1-56. The 10772A consists of:

1 each, Turning Mirror; HP Part No. 10772-67002
1 each, Leveling Plate; HP Part No. 10772-67001
1 each, Mounting Screw; HP Part No. 10772-67003

1-57. The turning mirror is a high quality front surface mirror housed in a mount that is compatible with the other optics. The 10772A is supplied with a package of Lens Tissue HP Part No. 9261-0363.

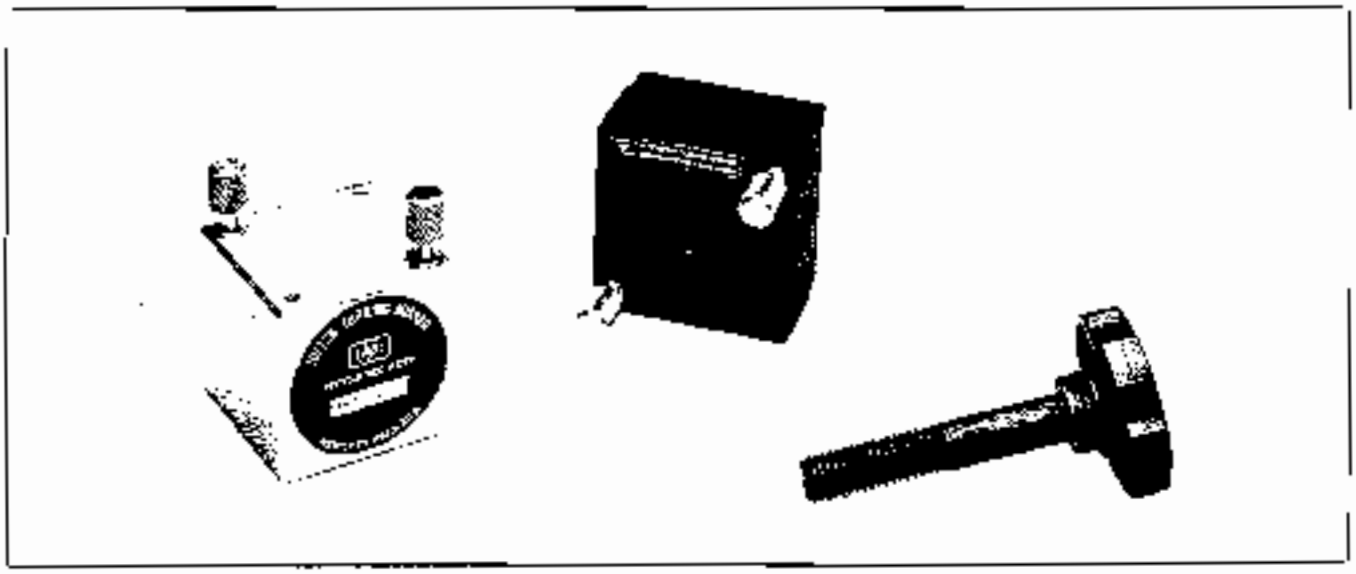


Figure 1-12. 10772A Turning Mirror

1-58. 10773A Flatness Mirror

1-59. The flatness mirror (Figure 1-13) consists of the mirror, eight hex screws M3 × 8L (HP Part No. 0515-0348), and a 2.5 mm hex wrench (HP Part No. 8710-1781). The Flatness Mirrors are used for convenience in surface plate calibration applications.

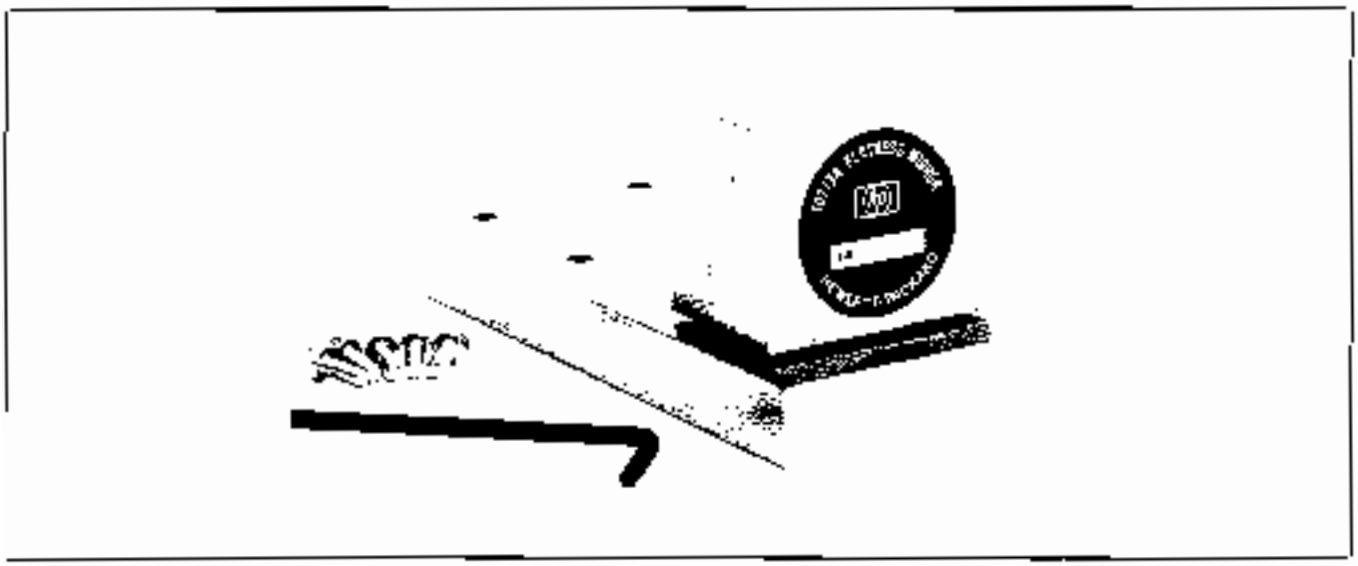


Figure 1-13. 10773A Flatness Mirror

1-60. 10774A Short Range Straightness Optics

1-61. The 10774A (Figure 1-14) permits straightness measurements over the range of 100 mm to 3000 mm (4 in to 120 in). The interferometer consists of 2 parts, a rotatable prism and a reflector containing 2 mirrors. The straightness interferometer measures lateral displacement between the prism assembly and the reflector assembly. The prism and reflectors are shipped as matched optical sets that are accurately calibrated to each other. They should never be used separately with other similar components. Displacement is measured in a line parallel to the long axis of the straightness reflector and perpendicular to the laser beam. Displacement range is ±1.5 mm (±0.1 in). The 10774A is supplied with a package of Lens Tissue, HP Part No. 9281-0363, and Alignment Target, HP Part No. 10774-67001.

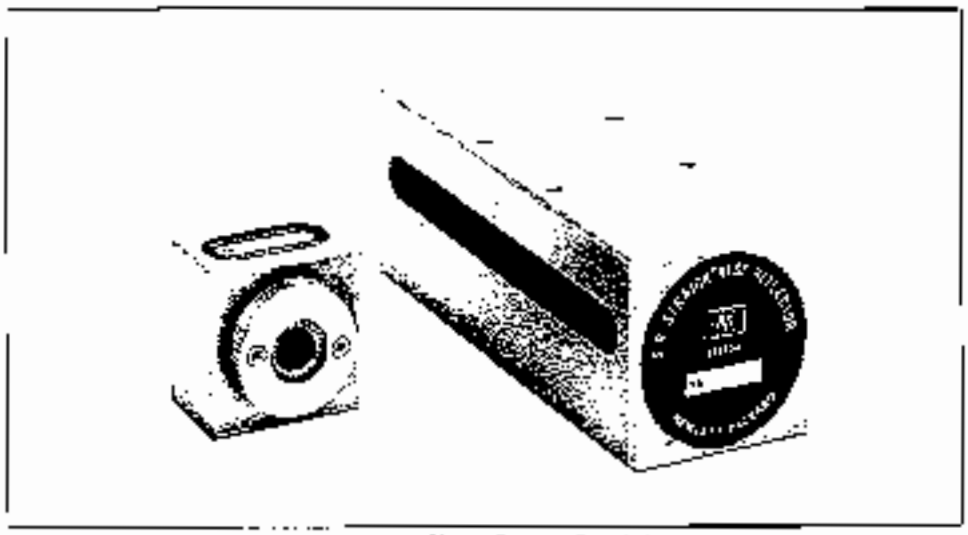


Figure 1-14. 10774A Short Range Straightness Optics

1-62. 10775A Long Range Straightness Optics

1-63. The 10775A (Figure 1-15) permits straightness measurements over the range of 1000 mm to 30,000 mm (40 in to 1200 in). The interferometer is similar to the 10774A. Optics changes have been made to give longer range traded off for less resolution. The prism and reflectors are shipped as matched optical sets that are accurately calibrated to each other. They should never be used separately with other similar components. The 10775A is supplied with a package of Lens Tissue, HP Part No. 9281-0363, and Alignment Target, HP Part No. 10774-67001.

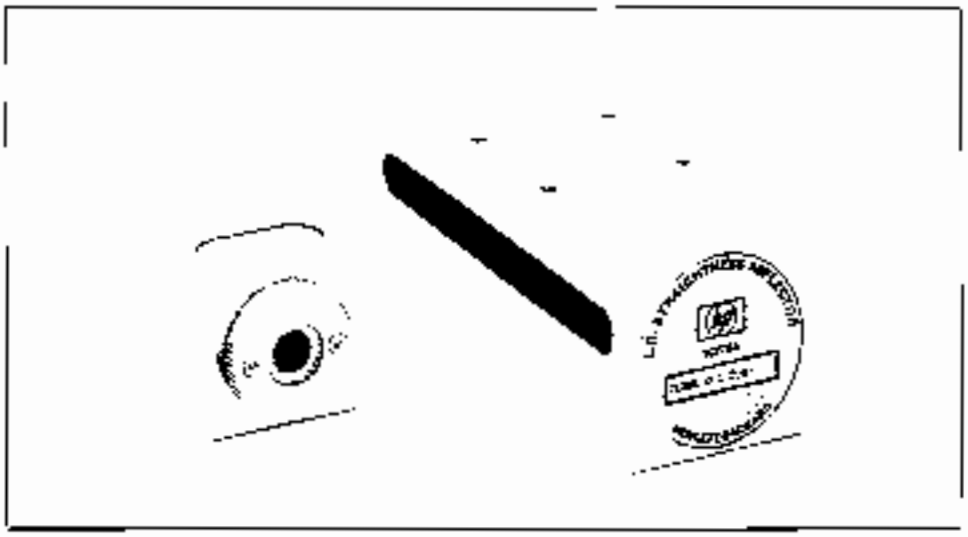


Figure 1-15. 10775A Long Range Straightness Optics

1-64. 10776A Straightness Accessory Kit

1-65. 10776A Straightness Accessory Kit consists of:

1 each, Base Assembly; HP Part No. 10776-67003
1 each, Straightness Retroreflector; HP Part No. 10776-67001
1 each, Reflector Mount; HP Part No. 10776-67002
1 each, Adapter Plate, HP Part No. 10770-20001
1 each, Post; HP Part No. 10776-20008
2 each, Post; HP Part No. 10785-20005
4 each, Screw Machine, M3 × 0.005 × 16 mm; HP Part No. 0515-0078
4 each, Screw Socket Head, M3 × 0.05 × 8 mm; HP Part No. 0515-0348
1 each, Hex Wrench; HP Part No. 8710-1181

1-66. These mounts simplify straightness measurement setups.

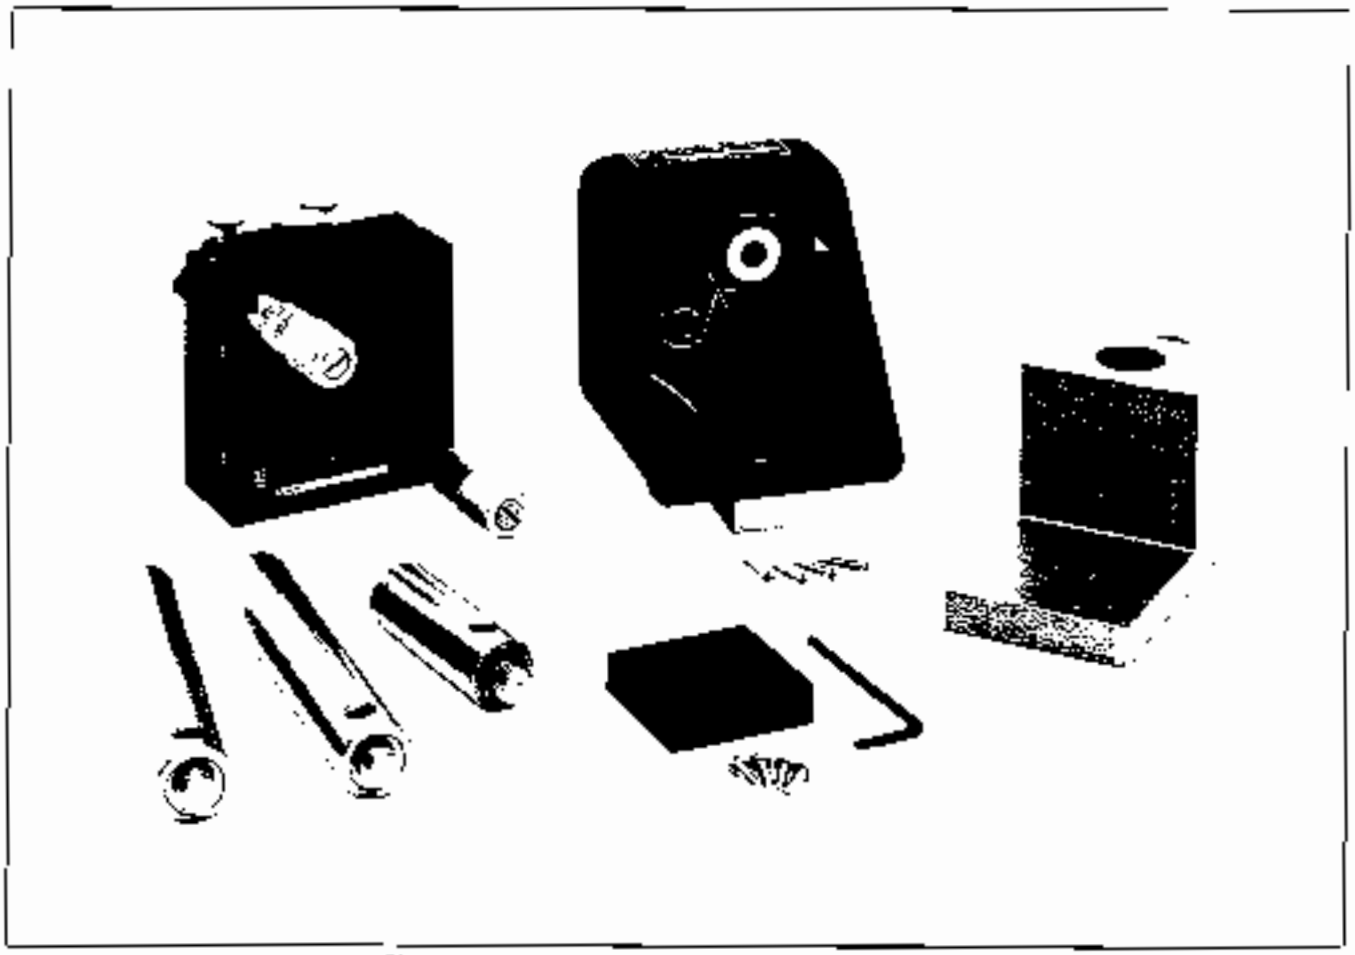


Figure 1-16. 10776A Straightness Accessory Kit

1-67. 10777A Optical Square

1-68. The optical square (Figure 1-17) consists of the optical square, a mount, and a gage block. HP Part Number 8750-0860. The square bends an optical path at a defined 90° angle. It is used to establish a right angle reference for measurements of squareness between two machine tool axes using the system straightness optics. In addition, it can be used with many other optics for calibration measurements.

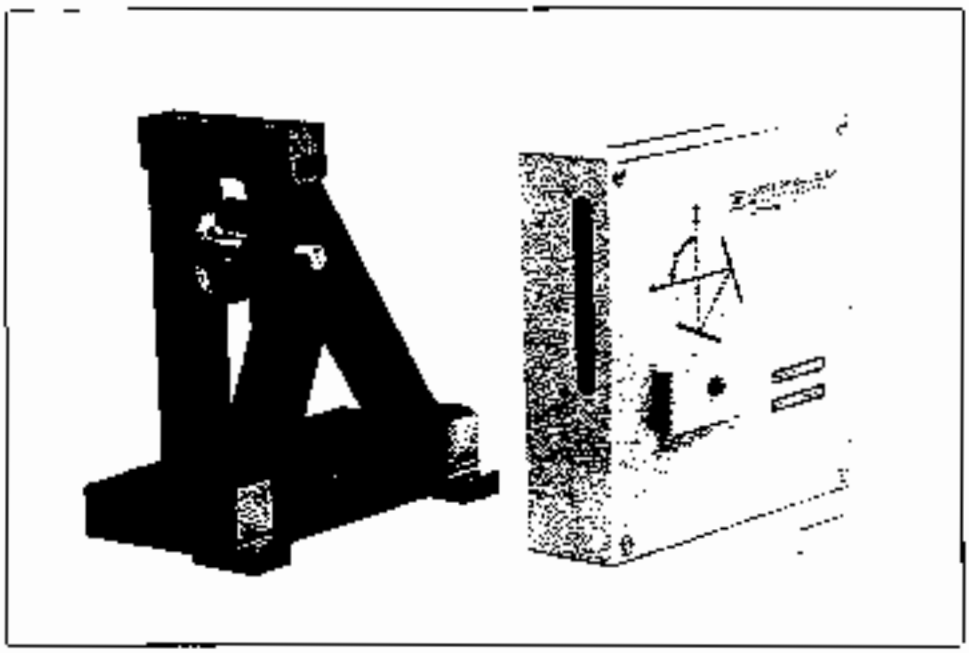


Figure 2-17. 10777A Optical Square

1-69. 10784A Base

1-70. Figure 1-18 shows the base used for clamping optics to machine surfaces. The optics mount to the 10780A Height Adjuster which is fixed to the base through the post.

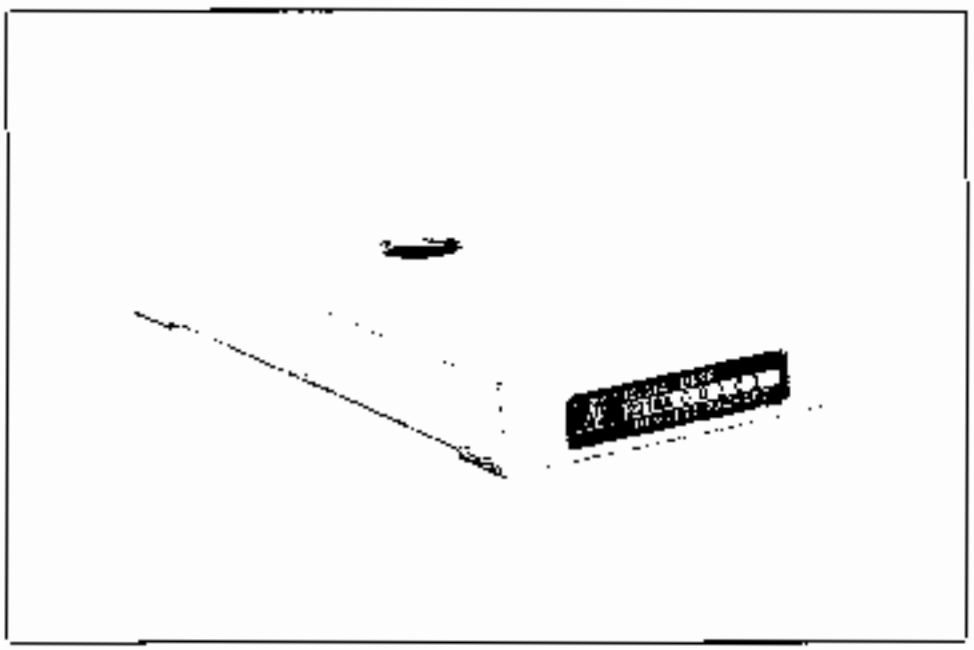


Figure 2-18. 10784A Base

1-71. 10785A Height Adjuster and Post

1-72. The 10785A Height Adjuster and Post (HP Part No. 10785-20005) can accommodate linear and angular optics as well as the small leveling plate. The 10785A (Figure 1-19) provides a convenient adjustment for optical alignment. The 10785A is supplied with 2 captive screws, HP Part No. 10785-20002.

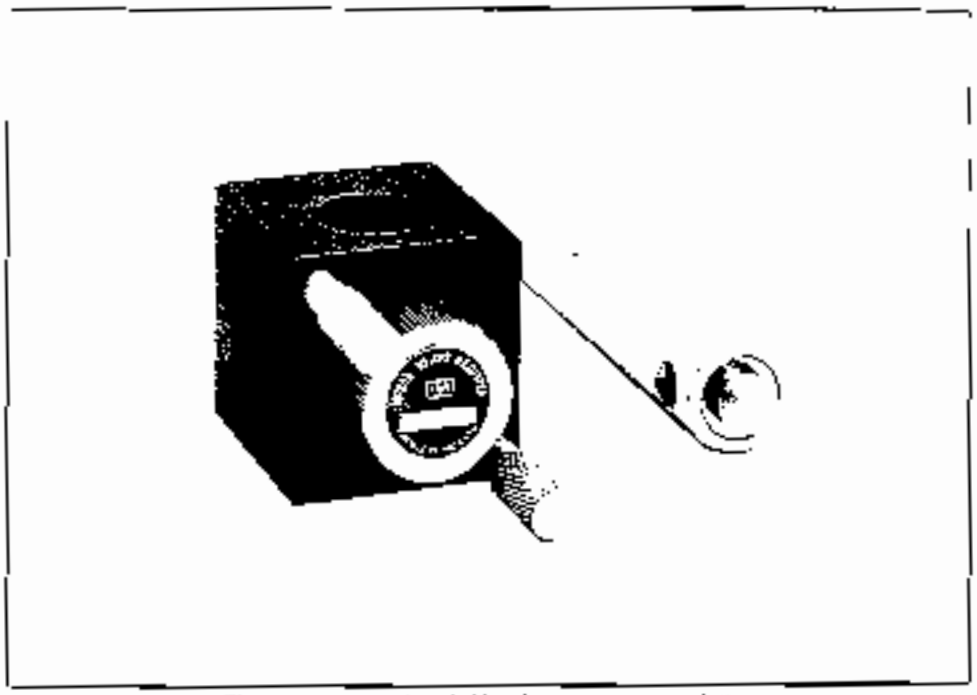


Figure 1-19. 10785A Height Adjuster and Post

1-73. OPTICAL KITS

1-74. The optics are available in kits designed to provide the necessary equipment to perform particular types of measurements. Kits are available for linear measurements, angular optics, flatness accessory, and straightness measurements.

1-75. 55280A Linear Measurement Kit

1-76. This kit consists of the following equipment:

1 each, 10766A Interferometer
2 each, 10767A Linear Retroreflector
2 each, 10764A Base
3 each, 10765A Height Adjuster and Post
1 each, 10768A Linear Angular Carrying Case

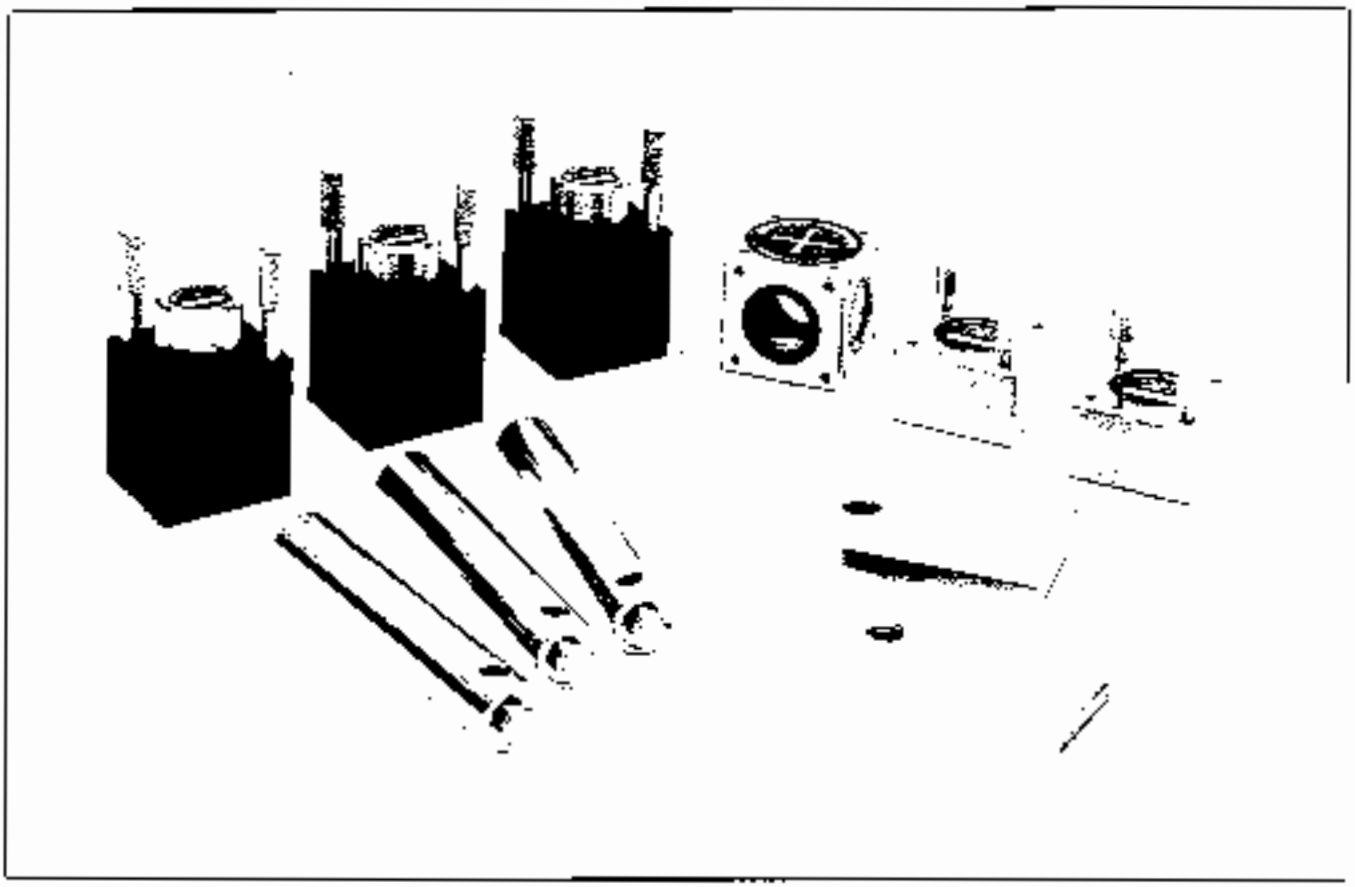


Figure 1-20. 55280A Linear Measurement Kit

1-77. 55281A Angular Optics

1-78 This kit contains the following equipment

1 each, 10770A Angular Interferometer
1 each, 10771A Angular Reflector

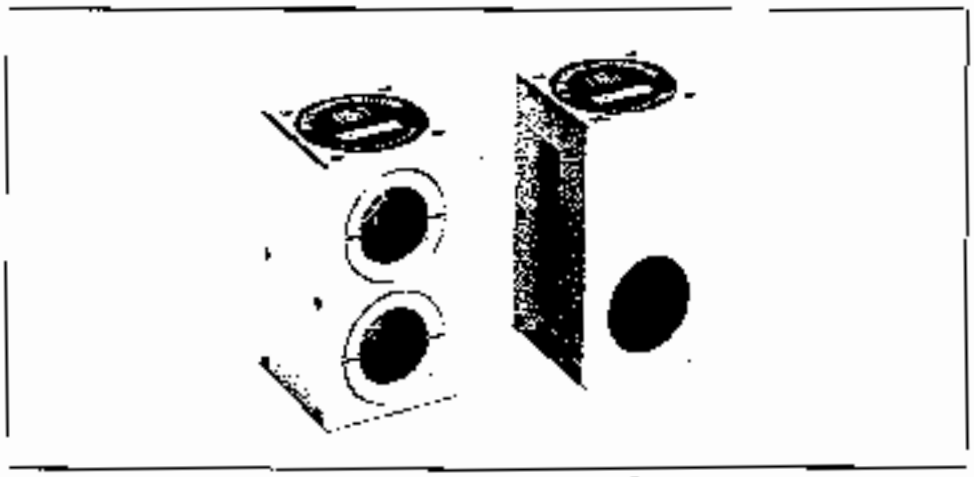


Figure 1-21. 55281A Angular Optics

1-79. 55282A Flatness Accessory Kit

1-80. This kit requires the use of the 55281A Angular Optics to make flatness measurements. The flatness mirror can be rotated 360° on its base while maintaining a very accurate perpendicular alignment to the mounting surface. The flatness accessory kit consists of the following equipment.

2 each, 10772A Flatness Mirror
1 each, 10759A Footspacing Kit

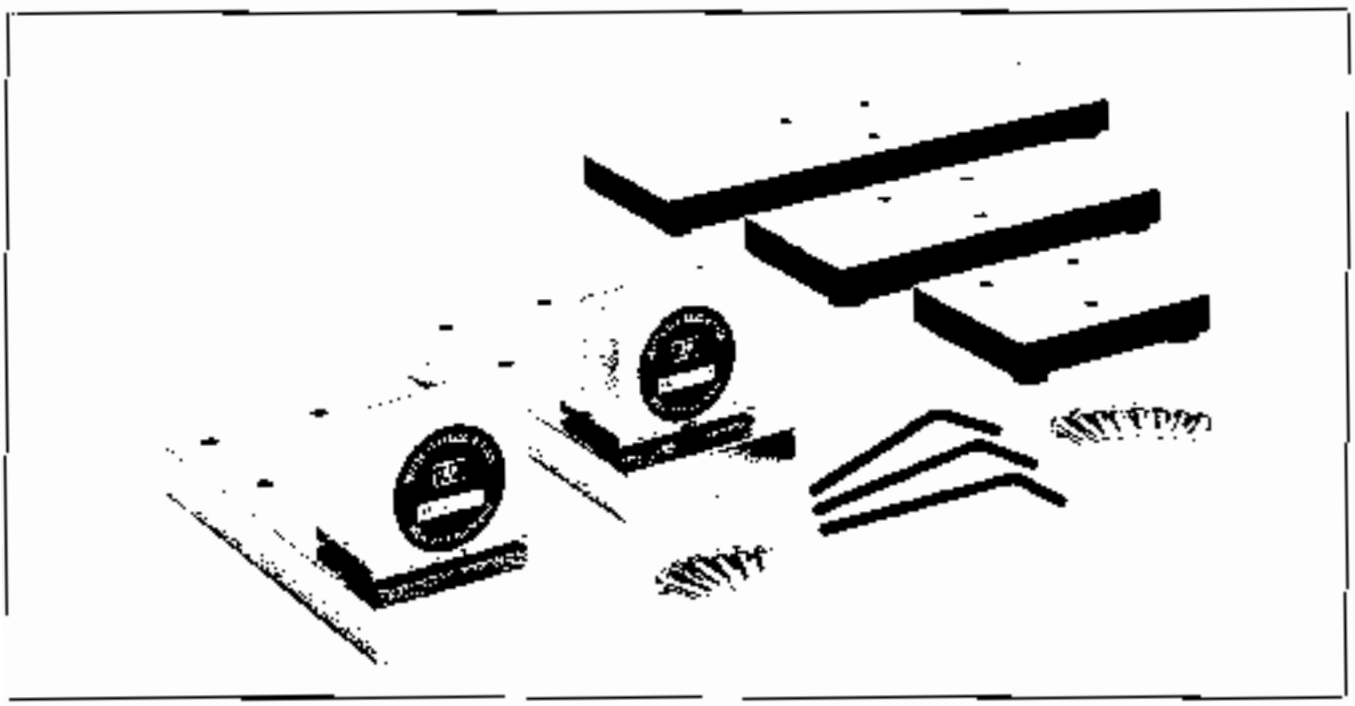


Figure 1-22. 55282A Flatness Accessory Kit

1-81. 55283A Straightness Measurement Kit

1-82 This kit includes the following equipment:

1 each 10772A Turning Mirror
1 each 10774A Short Range Straightness Optics
1 each 10776A Straightness Accessory Kit
1 each 10787A Straightness-Squareness Carrying Case

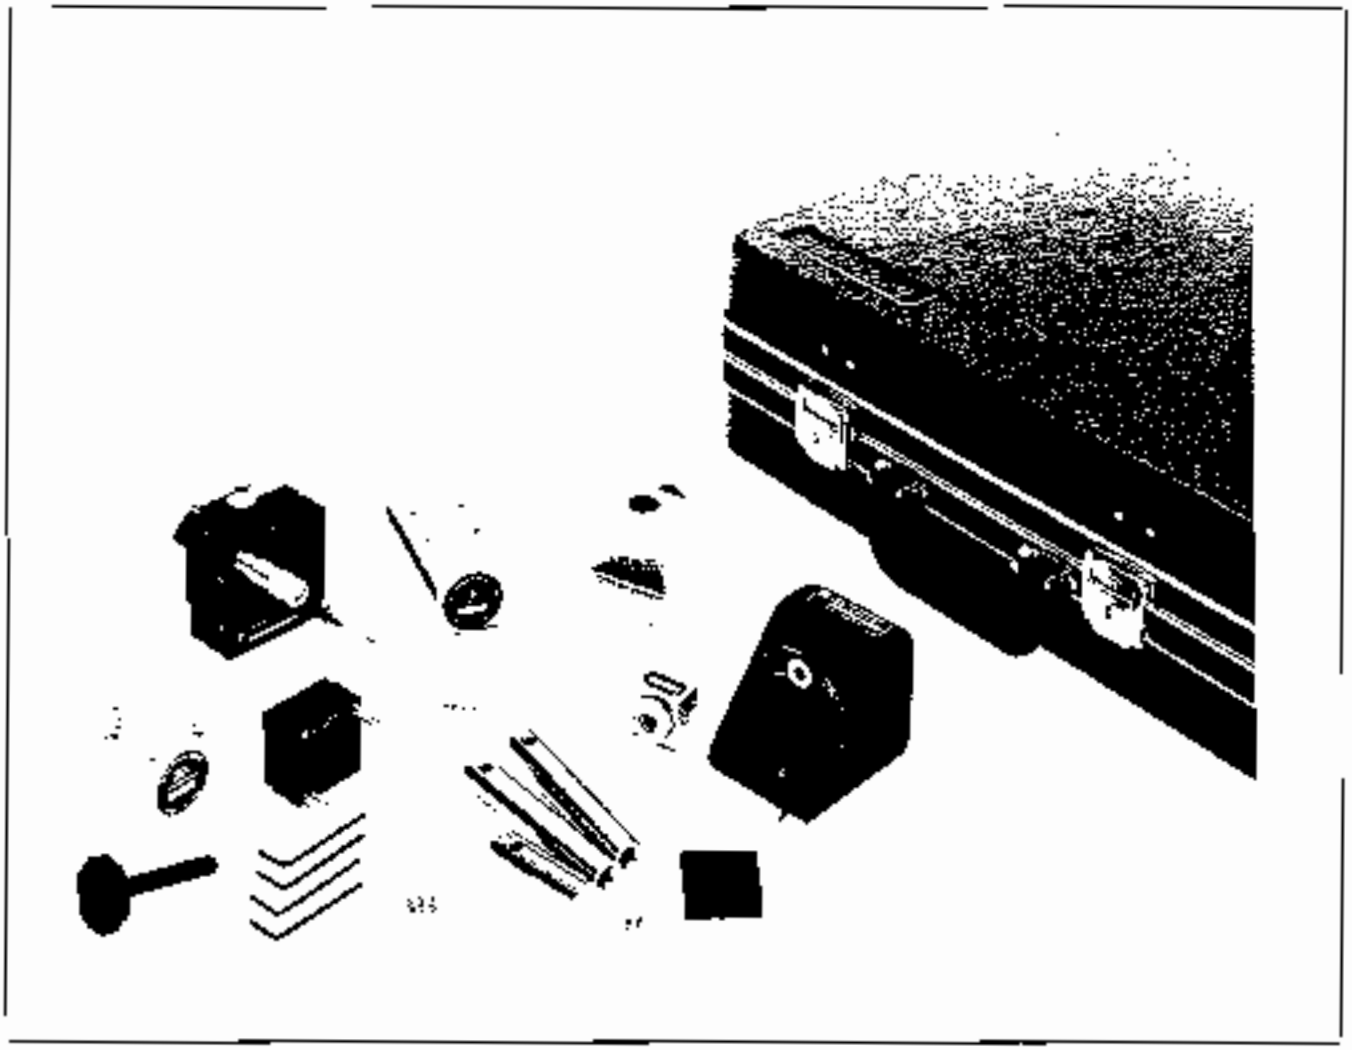


Figure 1-23. 55283A Straightness Measurement Kit

1-83. OTHER COMPATIBLE EQUIPMENT

1-84. Since the 5528A has HP-IB capability, the system may be used with other HP-IB equipment such as calculators and recorders.

1-85. SYSTEM CONFIGURATIONS

1-86. System configurations include linear, angular, flatness, straightness-short range, straightness-long range and squareness. Suggested configurations are shown in Table 1-3.

Table 1-3. Suggested System Configurations

	Linear	Angular	Flatness	Short Range Straightness	Long Range Straightness	Squareness
5519A	1	1	1	1	1	1
5508A	1	1	1	1	1	1
10753A	1	1	1	1	1	1
55280A	1	1				
55281A		1	1			
55282A			1			
55283A				1	1	1
10775A					1	
10777A						1
10751A/B	1					
10757A/B/C	1, 2, 3					
55288A	1	1	1	1	1	1

1-87. RECOMMENDED TEST EQUIPMENT

1-88 Equipment required to maintain the Laser Measurement System is listed in Table 1-4. Other equipment may be substituted if it meets or exceeds the critical specifications listed in the table.

Table 1-4 Recommended Test Equipment

Instrument	Use *	Specifications	Recommended Equipment (Equipment Having Equivalent Characteristics May be Substituted)
For 5508A, 5518A, 10751A/B, 10757A/B/C			
Signature Multimeter	T	Detect TTL and ECL level signals	HP 5006A
Oscilloscope	T	100 MHz Bandwidth	No Recommendation
Laser Power Meter	T	Range: 1 microwatt to 1 milliwatt Accuracy: ±10%	Graseby Optronics, Model 351L (Phone 407-282-1406)
High Voltage Probe	T	Capable of handling 15K Vdc	HP 34111A
Milliammeter	T,A	10 mA range Accuracy: ±0.1 mA	HP 428B
Neutral Density Filter	A	31.6% Transmission	Oriel Manufacturing Model 5034
Logic Pulser	T	TTL	HP 546A
Current Tracer	T	Sensitivity: 1 mA to 1 amp	HP 547A
Logic Clip	T	TTL Compatible 16-pin IC mounting	HP 549A
Logic Probe	T	TTL/CMOS Capability with Pulse Memory	HP 545A
Digital Voltmeter	T,C	DC Volts: Floating Inputs Input Resistance: $10^{10}\ \Omega$ 10V Range Accuracy: ±250 microvolts 1V Range Accuracy: ± 62 microvolts	HP 3456A
THE FOLLOWING EQUIPMENT IS USED FOR CALIBRATING THE 10751A/B AND 10757A/B/C. THIS EQUIPMENT WILL NOT BE NECESSARY IF THE 10751A/B AND 10757A/B/C ARE RETURNED TO HEWLETT-PACKARD FOR PERIODIC CALIBRATION.			
Quartz Thermometer or Glass Thermometer with Probe	51, 57	Range: 0°C - 40°C Accuracy: ±0.04°C	HP 2804A and HP 18120A Laboratory Probe calibrated within past 3 months
Temperature Bath	51, 57	Volume: 15 Liters Uniformity: ±0.01°C	Benco Grant Model SP15
Refrigeration Unit for Temperature Bath	51, 57		Benco Grant Model CC-15
Dielectric Liquid for Temperature	51, 57		Flourinet FC-40 3M Company
Precision Pressure Controller	51	Range: 22 - 31 in Hg (minimum) (558.8 - 787.4 mm Hg) Accuracy: ±0.0125% of reading	Texas Instruments Model 156-02
Calibration Accessories Kit	51, 57	Extender Cables and Adapter	HP Model K16-59995A

* P = Performance Test; C = Calibration; A = Aquistments T = Troubleshooting
51 = 10751A/B Calibration 57 = 10757A/B/C Calibration

1-89. WARRANTY

1-90. The warranty statement for the instrument including the laser tube is located on the inside cover of this manual.

SECTION II
INSTALLATION

Page

Introduction 2-1
Initial Inspection 2-1

Preparation for Use 2-1
Power Requirements 2-1
Line Voltage and Fuse Selection 2-2
Power Cable 2-3
5518A to 5508A Interconnecting Cable 2-5
10751A/B Air Sensor Connection 2-5
10757A/B/C Material Temperature Sensor Connection 2-5
Remote Control Box Connection 2-5
HP-IB Cables and Connectors 2-5

Operational Verification Check 2-7

Operating Environment 2-7

Storage and Shipment 2-7
Environment 2-7
Packaging 2-7

Mounting and Fixturing 2-8

SECTION II
INSTALLATION

2-1. INTRODUCTION

2-2. This section provides installation instructions for the Model 5528A Laser Measurement System. This section also includes information about initial inspection and damage claims, preparation for use, packaging, and storage.

2-3. INITIAL INSPECTION

WARNING

TO AVOID HAZARDOUS ELECTRICAL SHOCK, DO NOT PERFORM ELECTRICAL TESTS WHEN THERE ARE SIGNS OF SHIPPING DAMAGE TO ANY PORTION OF THE OUTER ENCLOSURE (COVERS, PANELS, METERS).

2-4. Inspect the shipping container for damage. If the shipping container or cushioning material is damaged, it should be kept until the contents of the shipment have been checked for completeness and the instrument has been checked mechanically and electrically. Procedures for checking electrical performance are given in Section IV. If the contents are incomplete, if there is mechanical damage or defect, or if the system or some component fails the performance tests, notify the nearest Hewlett-Packard Office. If the shipping container is damaged, or the cushioning material shows signs of stress, notify the carrier as well as the Hewlett-Packard office. Keep the shipping materials for the carrier's inspection. The HP office will arrange for repair or replacement at HP's option without waiting for a claim settlement.

2-5. PREPARATION FOR USE

2-6. Power Requirements

2-7. The HP 5528A Measurement System draws all of its required power from the 5508A Measurement Display. The 5508A draws a maximum of 175 VA from the primary mains and may be connected to the following 48 to 66 Hertz sources:

100 Volts +5, -10%
120 Volts +5, -10%
220 Volts +5, -10%
240 Volts +5, -10%

2-8. Line Voltage and Fuse Selection

CAUTION

Before connecting the instrument to ac power lines, be sure that the voltage selector is properly positioned as described below.

2-9. The line voltage is selected by means of a printed circuit located in the power line module on the rear panel of the 5308A. To check or change the line voltage selection, proceed as follows:

a. On the 5308A, disconnect the power cable from the power line module.

b. Slide the clear plastic window to the left. Pull the small lever marked FUSE PULL outward from the power line module. Remove the fuse and note its value.

c. Using a pair of long nose pliers, pull the pc card out of the power line module.

d. The pc card is marked in such a manner that only one line voltage selection will read right side up in a particular orientation as shown in Figure 2-1 below.

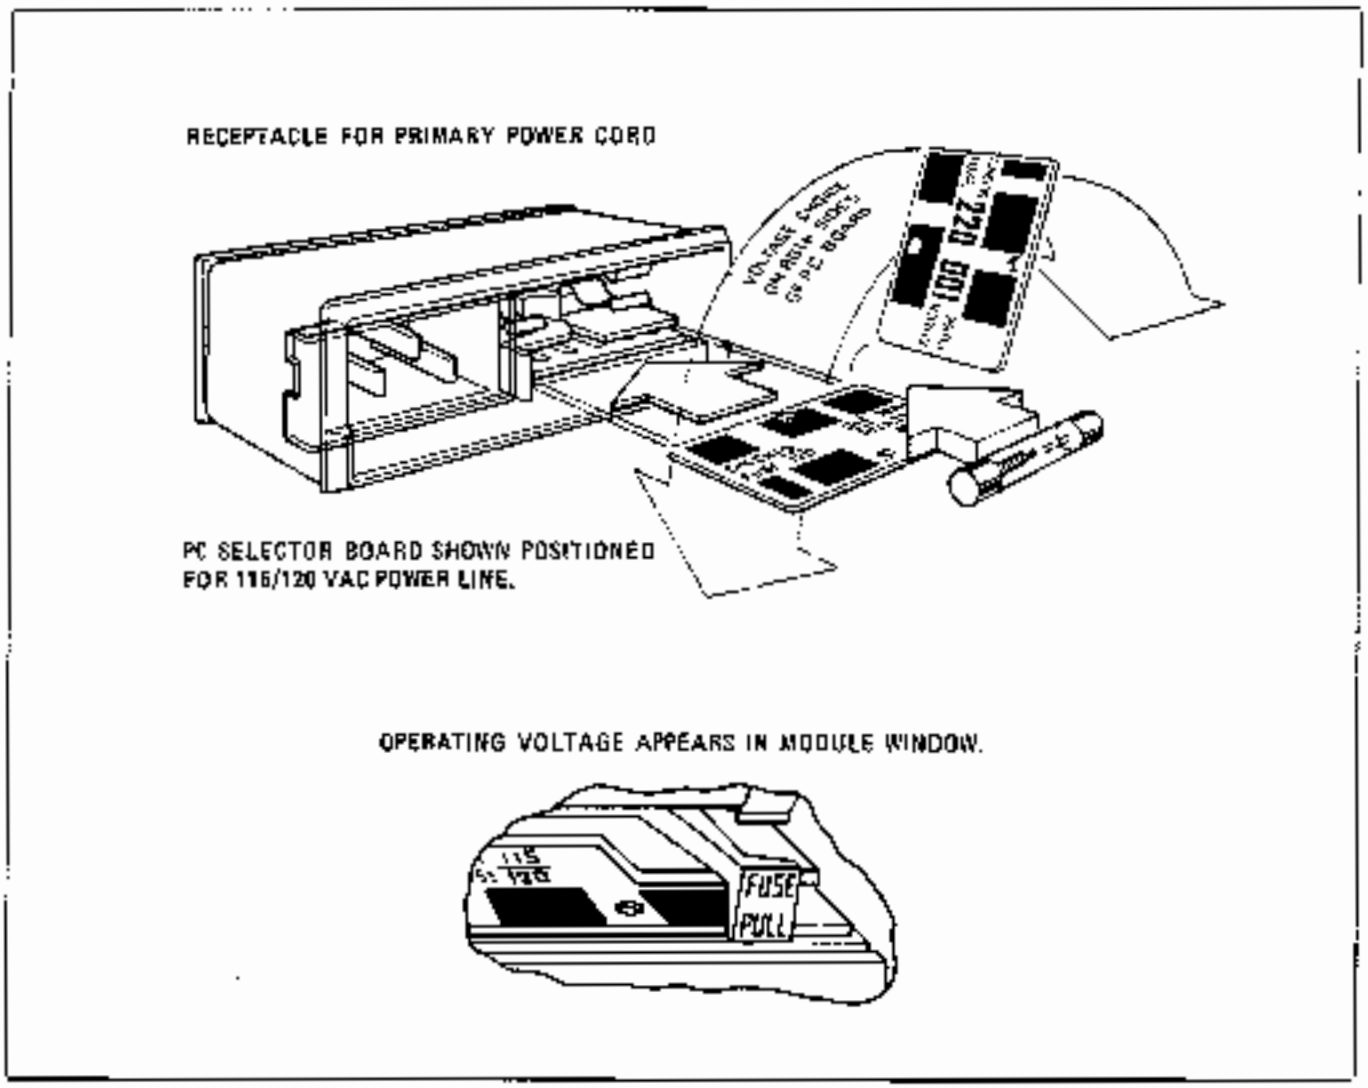


Figure 2-1. Line Voltage Selection

e. Orient the pc card until the desired voltage selection is right side up [Figure 2-1 is oriented for a 115/120 volt line selection]

f. Insert the pc card into the line module.

g. Push the FUSE PULL lever into the power line module before installing the fuse.

h. Insert the proper size fuse [marked on the rear panel] for the line voltage selected. Orient the fuse parallel to and near the top of the power module and push into place. Fuse values and part numbers are as follows:

100 to 120 Volt Lines — 2 Amp 250V Fast Blo Fuse. HP P/N 2110-0002

198 to 240 Volt Lines — 1 Amp 250V Fast Blo Fuse. HP P/N 2110-0001

i. Slide the plastic window to the right side of the power module.

⚠ 2-10. Power Cable

WARNING

BEFORE SWITCHING ON THIS INSTRUMENT, THE PROTECTIVE EARTH TERMINAL OF THIS INSTRUMENT MUST BE CONNECTED TO THE PROTECTIVE CONDUCTOR OF THE (MAINS) POWER CORD. THE MAINS PLUG SHALL BE INSERTED ONLY IN A SOCKET OUTLET PROVIDED WITH A PROTECTIVE EARTH CONTACT. THE PROTECTIVE ACTION MUST NOT BE NEGATED BY THE USE OF AN EXTENSION CORD (POWER CABLE) WITHOUT A PROTECTIVE EARTH CONDUCTOR.

2-11. The 5328A is shipped with a three-wire power cable. When the cable is connected to an appropriate ac power source, this cable connects the chassis to earth ground. The type of power cable shipped with each instrument depends on the country of destination. Refer to Figure 2-2 for the part numbers of the power cable and plug configurations available.

PLUG TYPE	CABLE HP PART NO.	*CD	PLUG DESCRIPTION	CABLE LENGTH (INCHES)	CABLE COLOR	FOR USE IN COUNTRY
250V 	8120-1351 8120-1703	0 6	Straight **BS1363A 90°	90 90	Mint Gray Mint Gray	United Kingdom, Cyprus, Nigeria Rhodesia, Singapore
250V 	8120-1369 8120-0696	0 4	Straight **NZSS198/ASC112 90°	79 87	Gray Gray	Australilia, New Zealand
250V 	8120-1689 8120-1692	7 2	Straight **CEE7-Y11 90°	79 79	Mint Gray Mint Gray	East and West Europe. Saudi Arabia. Egypt, So Africa, India (Unpolarized in many nations)
125V 	8120-1348 8120-1398 8120-1754 8120-1378 8120-1521 8120-1676	5 5 7 1 6 2	Straight **NEMA5-15P 90° Straight **NEMA5-15P Straight **NEMA5-15P 90° Straight **NEMA5-15P	80 80 36 80 80 30	Black Black Black Jade Gray Jade Gray Jade Gray	United States, Canada, Japan (100V or 200V), Mexico, Philippines, Taiwan
250V 	8120-2104	3	Straight **SEV1011 1959-24507 Type 12	79	Gray	Switzerland
250V 	8120-0698	6	Straight **NEMA6-15P			United States, Canada
220V 	8120-2956 8120-2957	2 3	Straight **DHCK 107 90°	79 79	Gray Gray	Denmark

*CD = Check Digit (refer to Section VI).
**Part number shown for plug is industry identifier for plug only. Number shown for cable is HP Part Number for complete cable including plug.
E = Earth Ground L = Line N = Neutral

Figure 2-2. AC Power Cables Available

2-12. 5518A to 5508A Interconnecting Cable

2-13. The 5518A interconnects to the 5506A with an 18-conductor cable HP Part Number 10793A/B/C. This cable has identical end connectors and provides all of the required power and signal interconnections. The HP logo on the cable is aligned with the connector key so that when the logo is oriented upward, the cable connector key will align properly with the rear panel connector. Connect one end to the 5508A rear panel jack marked LASER SOURCE. Connect the other end to the 18-pin connector on the rear panel of the 5518A Laser Head.

2-14. 10751A/B Air Sensor Connection

2-15. The 10751 has an interconnecting cable as an integral part of its assembly. Orient the HP logo on the cable upward and connect the 10-pin connector of the 10751 cable to the 5508A rear panel connector marked AIR SENSOR.

2-16. 10757A/B/C Material Temperature Sensor Connection


The 10757A/B/C has an interconnecting cable as an integral part of its assembly. Orient the HP logo on the cable upward and connect the 6-pin connector of the 10757A/B/C cable to the 5508A rear panel connectormarked MATERIAL TEMPERATURE. Up to three 10757A/B/C's may be used with the system.

2-18. Remote Control Box Connection

2-19. The Remote Control Box HP Part Number 05508-60021 contains RESET and RECORD switches and a BEAM strength meter. The interconnecting cable is an integral part of the box. Connect the 4-pin connector of the cable to the 5508A rear panel jack marked RMT CONT.

2-20. HP-IB Cables and Connectors

2-21. The HP-IB connector on the 5508A rear panel (marked IEEE STD 488 PORT) connects to external equipment such as a controller by means of controller cable accessories or HP-IB Interconnection cables HP 10631A/B/C/D or 10833A/B/C/D. Each end of the cable has a piggy-back connector which will accommodate both male and female mating connectors. This allows cables to be stacked to accommodate up to 15 instruments on the bus. The maximum length of cable that can be used to connect a group of instruments should not exceed 2 metres (6.5 feet) times the number of instruments to be interconnected or 20 metres (65.6 feet), whichever is less. Figure 2-3 shows the HP-IB connector, mating connector part numbers, available cables, logic levels, and signal name information.

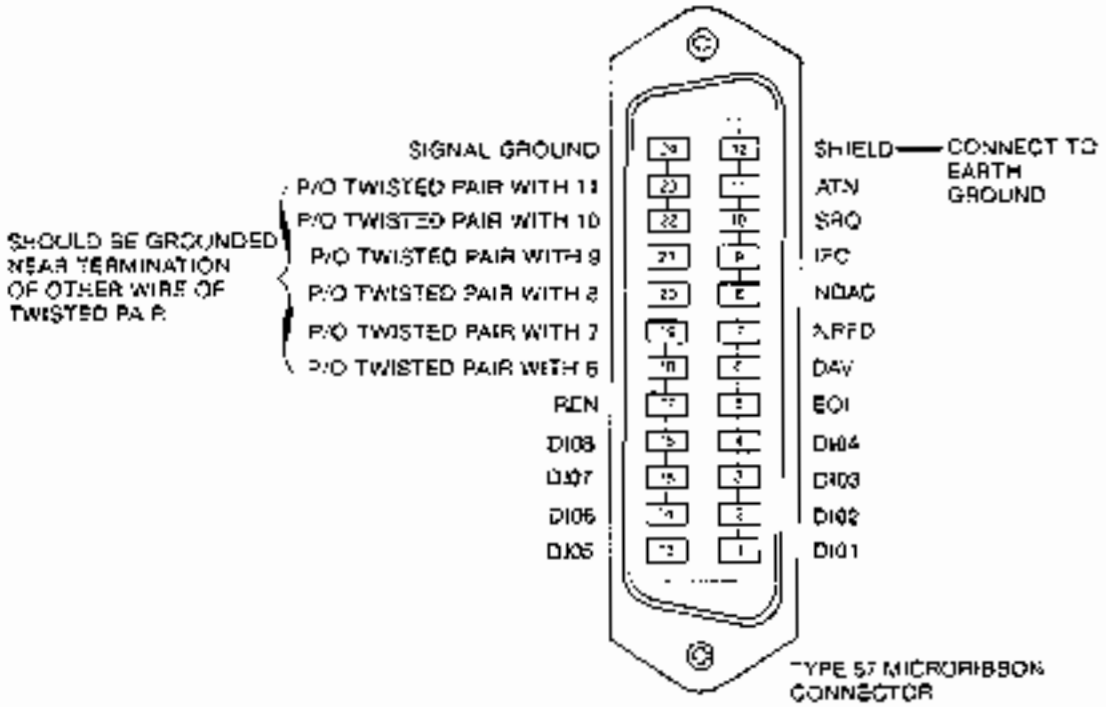

Logic Levels:

The Hewlett-Packard Interface Bus logic levels are TTL compatible, i.e., the true (1) state is 0.0 Vdc and the false (0) state is +2.5 Vdc to +5.0 Vdc.

Mating Connector:

HP 1251-0293; Amphenol 57-30240

Mating Cables Available.

HP 10631A or 10833A, 1.0 metre (3 feet)
HP 10631B or 10833B, 2.0 metres (6 feet)
HP 10631C or 10833C, 4.0 metres (12 feet)
HP 10631D or 10833D, 0.5 metre (1.5 feet)

Figure 2-3. Hewlett-Packard Interface Bus Connections

2-22. The information below the IEEE STD 488 PORT lettering describes the HP-IB capabilities for the 5528A system. See *Table 1-1* for details. HP-IB operation and programming are all covered in Section III.

2-23. OPERATIONAL VERIFICATION CHECK

2-24. Refer to Paragraph 3-23 for a step-by-step procedure to verify proper equipment operation.

2-25. OPERATING ENVIRONMENT

2-26. The system equipment can be operated in environments within the following limits:

Temperature: 0 to 40 °C (32 to 104°F)

Altitude: 3,048 meters (10,000 feet)

2-27. STORAGE AND SHIPMENT

2-28. Environment

2-29. The system can be stored or shipped in environments within the following limits:

Temperature: -40 to 75 °C (-40 to 167°F)

Altitude: 15,240 meters (50,000 feet)

2-30. The instrument should also be protected from temperature extremes which could cause condensation within the instrument.

3-21. Packaging

NOTE

The laser tube assembly MUST be shipped in an approved HP container.

2-32. The laser tube assembly (05518-60301) should only be shipped in an HP container designed for that purpose. In addition, the container must indicate that the laser tube contains magnetic material. To exchange the laser assembly, first order the replacement assembly and upon receipt return the old assembly in the same container. If it is necessary to ship a laser assembly, contact your nearest HP Sales office for an approved container.

2-33. Tagging for Service.

2-34. Original Packaging. Containers and materials identical to those used in factory packaging are available through Hewlett-Packard offices. If the instrument is being returned to HP for servicing, attach a tag indicating the type of service required, return address, model number, and full serial number. Also mark the container "FRAGILE" to ensure careful handling. The container for the 5518A should indicate the instrument contains magnetic material. in any correspondence, refer to the instrument by model number and full serial number.

2-35. Other Packaging. The following general instructions should be used for re-packing the system components with commercially available materials. These methods DO NOT apply to the laser tube assembly (05518-60301) which MUST be shipped in an HP approved container. If the laser assembly has not been removed from the 5518A, the 5518A may be packaged and shipped with the methods below.

a. Wrap instrument in heavy paper or plastic. (If shipping to Hewlett-Packard office or service center, attach a tag indicating the type of service required, return address, model number, and full serial number.)

b. Use a strong shipping container. A double-wall carton made of 350-pound test material is adequate.

c. Use a layer of shock-absorbing material 70 to 100mm (3 to 4 inches) thick around all sides of the instrument to provide firm cushioning and prevent movement inside the container. Protect the front panel with cardboard.

d. Seal shipping container securely.

e. Mark shipping container FRAGILE to ensure careful handling. Indicate if magnetic material is enclosed.

f. In any correspondence, refer to instrument by model number and full serial number.

2-36. MOUNTING AND FIXTURING

2-37. Instructions for mounting the laser head, optics, and the display unit are contained in the User's Guide for the 5528A System.

SECTION III
OPERATION

Page

Introduction 3-1
5508A Measurement Display, Front Panel Controls and Keyboard Features 3-1
5508A Measurement Display, Rear Panel Connectors and Controls 3-10
Error Messages 3-12
5518A Laser Head, Front Panel Controls and Indicators 3-13
5518A Laser Head, Rear Panel Indicators and Connectors 3-14
10751A/B Air Sensor Controls 3-15
10757A/B/C Material Temperature Sensors 3-15
Remote Control Unit 05508-60021 Controls and Indicators 3-16

Operator's Check 3-17
  Equipment Required 3-17
  Procedure 3-17
Self-Test and Warm-Up Countdown 3-21

Data Transfer to External Devices (HP-IB) 3-22
  Introduction 3-22
  5528A Data Transfer without an HP-IB Controller 3-22
  5508A Operation with an HP-IB Controller 3-22
  5508A Instrument Function Codes 3-23
  Using Instrument Function Codes 3-23
  HP-IB Bus Commands 3-25
  HP-IB Bus Commands and 5508A Responses 3-25
  Status Byte 3-27
  Clearing Error Conditions 3-27
  Output 3-27
  Sensor Errors 3-27
  Interrupt Capability 3-27
  HP-IB Switches 3-28

Operator's Maintenance 3-29
  Fuses 3-29
  Air Filter Cleaning 3-30
  Procedures for Cleaning Measurement Optics 3-30

QUICK KEY REFERENCE

Key	Page	Key	Page
[1]	3-2	[Menu]	3-4
[.]	3-2	[Clear]	3-5
[+]	3-2	[Enter]	3-6
[▲]	3-3	[+/-]	3-7
[▲]	3-3	[Exp]	3-8
[▼]	3-3	[←]	3-8
[Local]	3-3	[Cancel]	3-9

SECTION III
OPERATION

3-1. INTRODUCTION

3-2. This section provides operating information for personnel responsible for the installation and maintenance of the 5528A Laser Measurement System. A separate User's Guide is supplied that is written for those using the system to perform precision measurements. This section describes operation features of the instruments including front and rear panel controls and connectors, operator's checks, self-tests, and data transfer capabilities.

3-3. The 5528A User's Guide contains information required to apply and operate the 5528A system for various measurements. Included are measurement accuracy considerations, and setup and alignment instructions.

3-4. 5508A MEASUREMENT DISPLAY, FRONT PANEL CONTROLS AND KEYBOARD FEATURES

3-5. Following are descriptions of the 5508A front panel features shown in Figure 3-1.

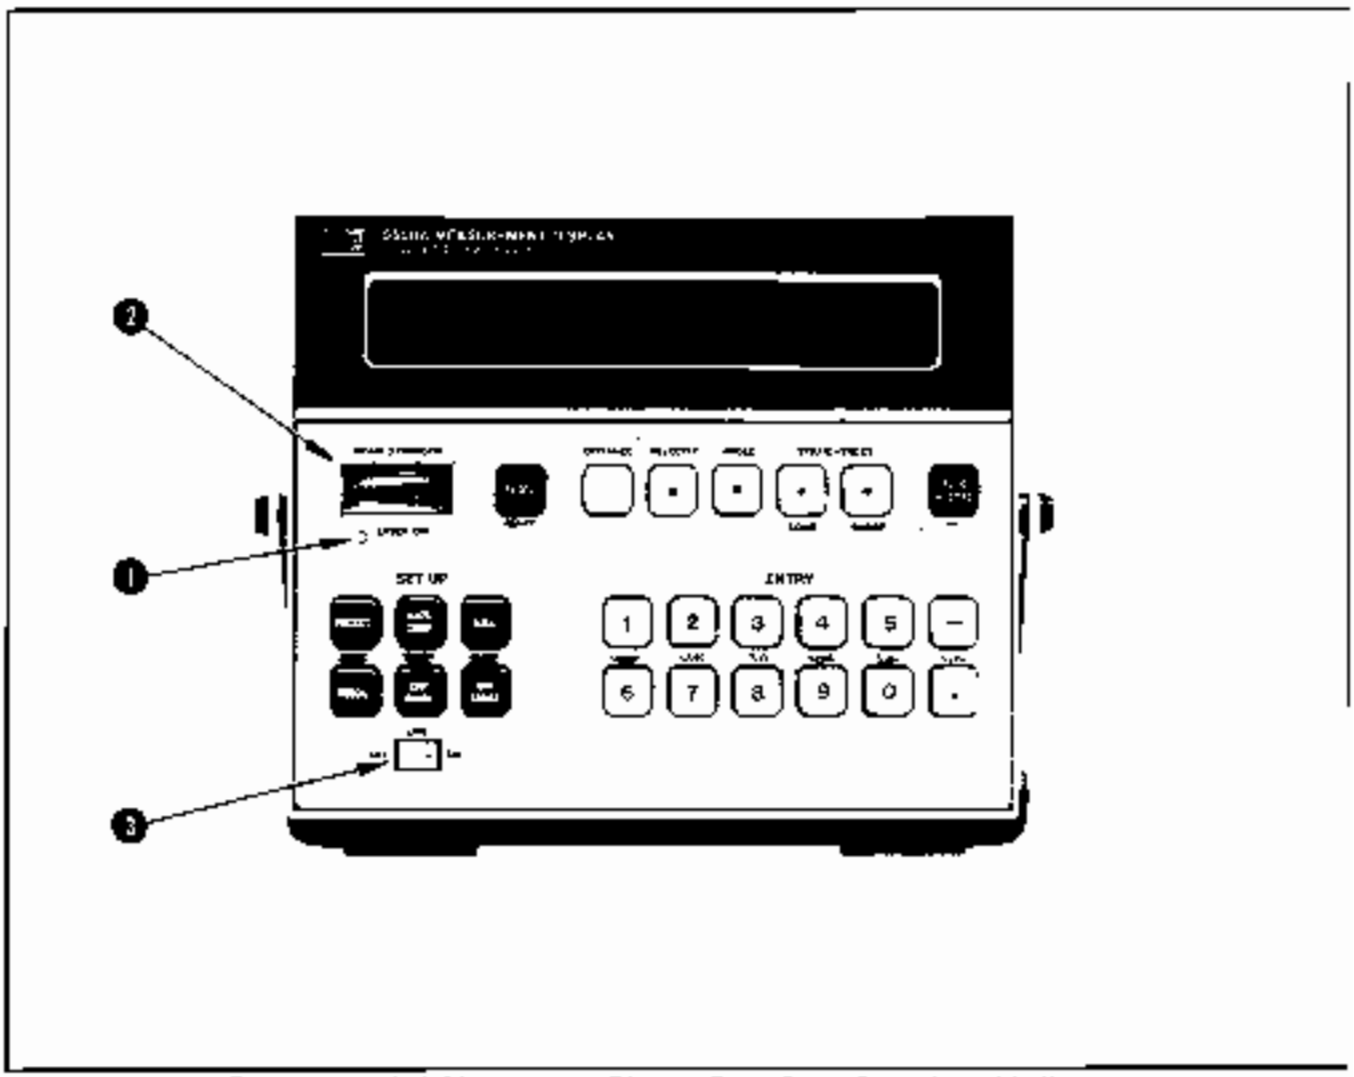



Figure 3-1. 5508A Measurement Display, Front Panel Controls and Indicators

❶

LASER ON Indicator. A yellow LED indicator installed to alert the operator that the 5518A Laser Head is activated and emitting a laser beam. Electrically, this indicator monitors the 5500A +5 Volt power supply line.

❷

BEAM STRENGTH Meter. Indicates the relative strength of the laser beam measurement signal. The meter reading can be used to aid in optimizing the optical alignment of the laser and measurement optics. Beam strength indications within the green area of the meter are required for proper operation.

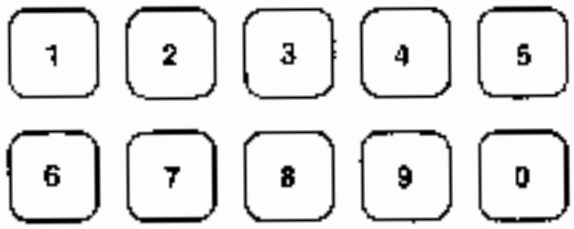

ENTRY Keys. The ENTRY keys allow the user to assign values to certain parameters. No measurement information is lost when entering numbers into the Measurement Display.



DISTANCE Key. The distance mode should be selected when linear measurements are performed. The 10766A Linear Interferometer and the 10707A Retroreflector are the optical instruments required for linear measurements. The positions of the interferometer and the retroflector at the time that the RESET key is pressed determine the zero reference point for the measurement.



VELOCITY Key. The velocity mode is used for linear measurements only. Velocity can be monitored momentarily during linear measurements with no loss of data.



ANGLE Key. Selects the angular mode to measure, calculate, and display the relative angular displacement between the 10770A Angular Interferometer and the 10771A Angular Retroreflector.



LONG STRAIGHTNESS Key. Selects the long range straightness mode to measure and display the relative motion between the 10775A Optics. The 10775A consists of a long range straightness interferometer and a long range straightness reflector. The measurement is made in an axis parallel to the long side of the straightness reflector



SHORT STRAIGHTNESS Key. Selects the short range straightness mode to measure and display the relative motion between the 10774A Optics. The measurement is made in an axis parallel to the long side of the straightness reflector. The 10774A consists of a short range straightness interferometer and a short range straightness reflector.



PRESET Key. Selects a function depending on the current measurement mode. Offset values can be preset in the distance and velocity modes. Multiplication factors can be preset in the angular and straightness modes. The default values are zero for distance and velocity, and 1 for angular and straightness. The PRESET key can be used any time without loss of measurement data. Changing a preset value in any one particular mode does not affect the preset values of the other modes

TO ENTER A PRESET NUMBER, select the preset value with the ENTRY keys and press PRESET. The preset value is displayed as long as the PRESET key remains depressed. Upon release, the 5508A returns to its current measurement mode.

TO VIEW THE CURRENT PRESET NUMBER, press the PRESET key and the preset number will be displayed until either the PRESET key is pressed again, or another mode of operation is selected. The preset functions, default values, and ranges are given in Table 3-1.

INCORRECT PRESET VALUES will result in an error, see Table 3-1 for limits. If an attempt is made to enter a preset value outside of the ranges listed in Table 3-1, the display will indicate "Or Error" or "Ur Error". The Or Error message appears for out of range positive entries, the Ur Error message occurs for out of range negative entries. Another press of the PRESET key, results in the display indicating the maximum value (positive or negative) allowable in the current mode of operation, and still another press of the PRESET key results in a return to the current measurement mode with the maximum value entered as the preset value. If it is not desired to enter the maximum value, use the ENTRY keys to select the desired value and press PRESET. "Or Error" and "Ur Error" are cleared by the above sequence without loss of measurement data.

Table 3-1. Preset Key Functions, Default Values, and Ranges

	Distance	Velocity	Angle	Straightness
FUNCTION	Display = Measured Displacement + Preset	Display = Measured Velocity + Preset	Display = Measured Angle × Preset	Display = Measured Displacement × Preset
DEFAULT	0	0	1	1
RANGE	±50.000 mm	±20,000 mm/min	0* to 2	0* to 3

*The 5508A will accept zero for a multiplier in the angle and straightness modes without displaying an error message. However, measurements will not be displayed, i.e., measurement × zero = zero.



RESOL Key. Selects or displays the number of significant decimal places displayed on the 5508A during measurements. This key also sets the smoothing function on or off. The RESOL key can be used any time without loss of measurement data.

TO SELECT RESOLUTION, the resolution number (number of digits following the decimal point) is entered using the ENTRY keys followed by pressing the RESOL key.

TO DISPLAY THE CURRENT RESOLUTION, press the RESOL key. Pressing the key again reverts back to the current measurement mode.

INCORRECT RESOLUTION VALUES. If an attempt is made to enter a resolution number beyond the capability of the 5508A, the display will indicate "Or Error" or "Ur Error". The Or Error message appears for incorrect positive entries, the Ur Error appears for incorrect negative entries. Another press of the RESOL key, results in the display indicating the maximum resolution value allowed in the current measurement mode, and still another press of the RESOL key results in a return to measurement mode with the maximum (positive or negative) value selected for the resolution number. If it is not desired to enter the maximum value, simply enter the desired number and press RESOL. "Or Error" and "Ur Error" are cleared by the above sequence without loss of measurement data.

RESOLUTION LIMITS are different for each measurement mode with english unit resolution one place greater than the metric equivalent. This may be observed by viewing the current resolution and toggling the ENGLISH-METRIC switch on the 5508A rear panel. Except as noted below, changing the unit switch setting does not alter the smoothing function.


SMOOTHING. Displacement data is averaged by the 5508A to reduce display jitter. The smoothing function can be defeated when selecting the display resolution. To defeat smoothing, enter the desired resolution number preceeded by a minus sign (- key in the ENTRY key group).

EXAMPLE (distance mode with english mode selected)



sets the display to 4 places after the decimal point with smoothing on.

EXAMPLE (distance mode with english mode selected)



sets the display to 5 places after the decimal point with smoothing off.

NOTE

Smoothing is disabled in the Linear measurement mode by measurement velocities in excess of 38.1 mm/minute. Smoothing is also disabled in the Velocity mode by measurement accelerations in excess of 13,750 mm/minute/minute.



MATL TEMP Key. The HP 10757A/B/C Material Temperature Sensors are used to compensate for thermal expansion or contraction of the material being measured by the HP 5528A System. The MATL TEMP key can be used any time without loss of measurement data. The MATL TEMP key can be used to:

a. display the average temperature of all sensors connected
b. display the temperature of each individual sensor connected
c. display the default average temperature value (20°C or 68°F) if all sensors are disconnected
d. enter an average workpiece temperature when all sensors are disconnected

THE RANGE of the HP 10757A/B/C Material Temperature Sensor is 0° to 40°C (32° to 104°F). When sensors reach temperatures outside of this range, appropriate error messages are displayed by the HP 5508A. See Paragraph 3-8 ERROR MESSAGES for explanation of these messages. The same error messages are used when temperature signal errors occur due to hardware failures.

TO DISPLAY THE AVERAGE TEMPERATURE, press the MATL TEMP key. An "A" (average) appears on the left-hand side of the display, and the temperature (fixed to two decimal places) is shown on the right followed by a "C" or an "F" (centigrade or fahrenheit) depending on the setting of the ENGLISH-METRIC switch.

Each successive press of the TEMP key will display the temperature of the sensors in the order, 1, 2, and 3. If the next sensor to be read is disconnected, the 5508A will skip that reading. Thus, if only sensors 1 and 3 are connected, successive presses will give the average temperature, the temperature of sensor 1, the temperature at sensor 3, and a return to the measurement mode. If all sensors are disconnected, successive presses will show the average temperature and then a return to mode.

While displaying the temperature of a particular sensor, if another function is selected, and then MATL TEMP is selected again, the display reverts back to the last displayed sensor. Successive presses will then go through the remaining sensors as described above.

For example, assume all three temperature sensors are connected and the temperature of sensor number 2 is displayed. If the VELOCITY key is pressed to determine how fast the optics are moving, and then the MATL TEMP key is pressed again, the temperature at sensor number 2 will be displayed again. Successive presses will then yield the temperature at sensor 3, and then a return to mode.

TO ENTER AN AVERAGE TEMPERATURE the temperature is entered (in F or C depending on the position of the ENGLISH-METRIC switch) followed by pressing the MATL TEMP key. Upon pressing the MATL TEMP key, the entered temperature will be displayed (fixed to two decimal places) and when released, the 5508A will return to its former mode of operation. The default value (no sensors connected) for the average temperature is 68°F or 20°C

NOTE

The average temperature can be entered by the user only when the 10757A/B/C Material Temperature Sensors are NOT ATTACHED to the 5508A.

If an average temperature is entered when there are sensors connected, the 5508A will ignore the entered value and simply average the temperatures coming from the sensors. This process may take up to three seconds, however, and if the MATL TEMP key is pressed quickly after an average temperature is entered, the entered temperature may be observed on the display for a short time.

The only exception to the above is when a sensor error occurs. That is, when a temperature sensor either malfunctions or goes out of range while still connected. When this type of error occurs, a sensor error message is displayed and the next press of the MATL TEMP key will yield "A ERROR" indicating a problem with one of the sensors. Successive presses will scroll through the sensors which are in range and pass over the bad sensor(s), as if it were disconnected.

INCORRECT MATL TEMP VALUES will result in an error. If an attempt is made to enter a temperature outside the range of 0 to 50°C (32 to 122°F) the display will indicate "Or Error" or "Ur Error". The Or Error occurs for entries over 50°C, the Ur Error message occurs for entries below 0°C. Another press of the MATL TEMP key, results in the display indicating the maximum or minimum temperatures allowable, and still another press of the MATL TEMP key results in a return to mode with the maximum or minimum temperature selected as the average temperature. If it is not desired to enter the maximum value, use the ENTRY keys to select the desired value and press MATL TEMP. "Or Error" and "Ur Error" are cleared the above sequence without loss of measurement data.

NOTE

If a sensor is connected or disconnected while the 5508A is in operation, a measurement error may result



EXP COEFF Key. Used to enter and display the expansion coefficient of the material being measured. The expansion coefficient is expressed in parts per million per degree of temperature, hereafter referred to as ppm. The expansion coefficient range is -720 to +720 ppm and the default for this key is 0.0. The EXP COEFF key can be used any time without loss of measurement data.

TO ENTER AN EXPANSION COEFFICIENT VALUE, enter the value with the ENTRY keys and press the EXP COEFF key. The value will be displayed until the key is released. Upon releasing the key, the 5508A display will return to the current measurement mode.

TO VIEW THE EXPANSION COEFFICIENT, press the EXP COEFF key and the value will be displayed until either the EXP COEFF key is pressed again, thus returning to the current mode, or another key is pressed.

INCORRECT EXP COEFF VALUES will result in an error. If an attempt is made to enter an expansion coefficient value in excess of ±720 ppm, the display will indicate "Or Error" or "Ur Error". The Or error occurs for incorrect positive entries, the Ur Error occurs for incorrect negative entries. Another press of the EXP COEFF key will display the maximum value allowed (±720 ppm). Another press of the EXP COEFF key will return the 5508A to the measurement mode with the maximum value entered. If it is not desired to enter the maximum value, use the ENTRY keys to select the desired value and press EXP COEFF. "Or Error" and "Ur Error" are cleared by the above sequence without loss of measurement data.



V.O.L. Key. The V.O.L. key can be used to display or select the Velocity of Light Compensation number. The V.O.L. number is used by the 5508A to correct for the dependence of laser wavelength on atmospheric conditions. The V.O.L. number used by the 5508A is 0.999abcd, however, only the abcd part of this number is displayed on the 5508A in the form abc.d. The 5508A multiplies measurement data by the V.O.L. Compensation numbers before the data is displayed. Velocity of Light Compensation is not necessary for angular or straightness measurements but can be used for all others.

The V.O.L. number is derived from measurements provided by the 10751A/B Air Sensor. If the 10751A/B is not used, the V.O.L. number defaults to 728.8. The DEFAULT VALUE (728.8) corresponds to 20°C air temperature, 760 mm Hg air pressure, and 50% relative humidity.

TO VIEW THE CURRENT COMPENSATION NUMBER, press the V.O.L. key. Successive presses will give the air temperature, the air pressure, and finally the air humidity. Since all three values are provided by the 10751A/B, unless a failure or sensor error occurs, they are either all present, or all absent. If the 10751A/B is used, the compensation number is updated approximately every three seconds by the 5508A.

While displaying the value of a particular air sensor measurement, if another function is selected, and then the V.O.L. key is pressed again, the display reverts back to the last displayed value. Successive presses will then go through the remaining sensors as described above.

For example, if the air pressure is being monitored, and it is desired to momentarily select another function, when the V.O.L. button is pressed again, the first data displayed will be the air pressure. Successive presses of the V.O.L. key will then give air humidity and then a return to the current measurement mode.

TO ENTER IN A NEW COMPENSATION NUMBER, enter the number with the ENTRY keys and press the V.O.L. key. The number, fixed to one decimal place will be displayed until the key is released. When the key is released, the 5508A returns to the current measurement mode.

NOTE

The Velocity of Light Compensation number can be selected by the user only when the 10751A/B Air Sensor is NOT ATTACHED to the 5508A.

INCORRECT COMPENSATION NUMBERS will result in an error. If an attempt is made to enter a displayed compensation number in excess of 999.9 or a negative value, the display will indicate "Or Error" or "Ur Error", respectively. Another press of the V.O.L. key, results in the display indicating the maximum (1000.0) or minimum (0.0) values allowable, and still another press of the V.O.L. key results in a return to measurement mode with the maximum value or minimum value entered as the compensation number. "Or Error" and "Ur Error" are cleared by the above sequence without loss of measurement data.

NOTE

The 5508A will allow 1000.0 to be entered as the displayed compensation number. This is a special case that sets the V.O.L. Compensation number to exactly 1.0000000.

WHEN AIR SENSOR ERRORS OCCUR, the appropriate message immediately appears on the display (unless there is a higher priority error) and the next press of the V.O.L. key will yield "CERROR" indicating that an error condition exists with one of the air sensor measurements. Successive presses will display the valid air sensor data, and pass over the invalid sensor data.

NOTE

Connecting or disconnecting the 10751A/B Air Sensor during a measurement may result in a measurement error.



DIR SENSE Key. Reverses the sense of the measurement. For example, if the optics are moving apart and the display indicates an increasing positive displacement, pressing the DIR SENSE key will result in the same movement causing an increasing negative displacement or a decreasing positive displacement.

The DIR SENSE key may be pressed at any time without losing the current data. Also this key reflects the current position about the preset value. For example, if the preset value is 5.00000 and the display reads 7.00000, pressing the DIR SENSE key will result in a display of 3.00000.



RESET Key. When pressed, all measurment data taken up to that time is lost. While the key is being held in, the display fills with zeros and upon release the 5508A returns to the measurement mode selected prior to RESET.

NOTE

The RESET key clears only the measurement data. If user selectable values have been entered via the 5508A ENTRY keys, these values will not be changed by RESET.

ERROR MESSAGES are displayed for certain operational errors, measurement errors and failures. These error messages are cleared by pressing RESET. After measurement errors or failures have been corrected, press RESET. However, error messages that occur due to improper use of a SET UP key can be cleared by the SET UP key without loss of measurement data. See the particular SET UP key description. Paragraph 3-8 contains a list of all 5508A ERROR MESSAGES.

If measurement errors or failures are not corrected when the RESET key is released, the 5508A will try to return to its former mode of operation and the same error message will again be displayed. This message will appear almost instantaneously with the exception of sensor errors which could take up to three seconds to reappear.

If the RESET key is pressed while viewing a temperature sensor value, resolution number, etc., the 5508A will return to the most recently selected measurement mode.

THE HP-IB LOCAL FUNCTION is performed by the RESET key. The HP-IB LOCAL function releases the instrument from HP-IB control.



AUTO RECORD Key. This key provides a means to record data on external devices at user selectable rates. The 5508A is designed with HP-IB capability to allow this type of data transfer. HP-IB (Hewlett-Packard Interface Bus) is Hewlett-Packard Company's implementation of the IEEE Standard 488 Interface Bus.

To use the AUTO RECORD function, connect an HP-IB compatible device to the bus connector on the 5508A rear panel (IEEE STD 488 PORT). The recording device should be configured as an HP-IB listener according to its Operating Manual. Further information on HP-IB terminology and capabilities is provided in Paragraph 3-30. Data Transfer to External Devices, through Paragraph 3-64

NOTE

To transfer data to a device configured in its HP-IB "Listen Only" mode, the 5508A must be configured in its "Talk Only" mode. See Paragraph 3-62 for instructions on selecting the "Talk Only" mode.

SELECTING AUTO RECORD OUTPUT RATES. Time increments over the nominal range of 0.05 seconds to 12 seconds in steps of 0.05 second are allowed, however time increments should be selected which do not exceed the maximum input rate of the listening device

To record timed samples, enter the time increment with the ENTRY keys, and press the AUTO RECORD key. The RCD annunciator will turn on, and the current display will be transmitted over the HP-IB bus once per selected time increment. For example, 2 AUTO RECORD will cause output samples every 2 seconds. To turn off the auto record, press AUTO RECORD.

NOTE

HP-IB ERRORS can occur when listener rates are not compatible. During auto record, the "Lr Error" (listener error) will be displayed when an attempt is made to output a data sample while the previous data sample has not yet been completely accepted by the HP-IB listener. This error will not occur if there is no listener connected and the 5508A is configured to Talk-Only on HP-IB

MAXIMUM AUTO RECORD RATE. Pressing [.] [GHz] transfers data to the listener at the rate of the slowest listening device. If a data sample has been completely transferred, then at the end of a 5508A update cycle, the updated display value will be held and made available for transfer.

❸

LINE Switch. When set to ON, power is applied to the HP 5508A Measurement Display, HP 5518A Laser Head, HP 10751A/B Air Sensor, and 10757A/B/C Material Temperature Sensors. The LASER ON indicators illuminate and the laser tube is powered. Also upon application of power, the system starts into a warm-up period during which a self-test diagnostic routine is executed.

3-6. 5508A MEASUREMENT DISPLAY, REAR PANEL CONNECTORS AND CONTROLS

3-7 Following are descriptions of the 5508A rear panel features shown in Figure 3-2.

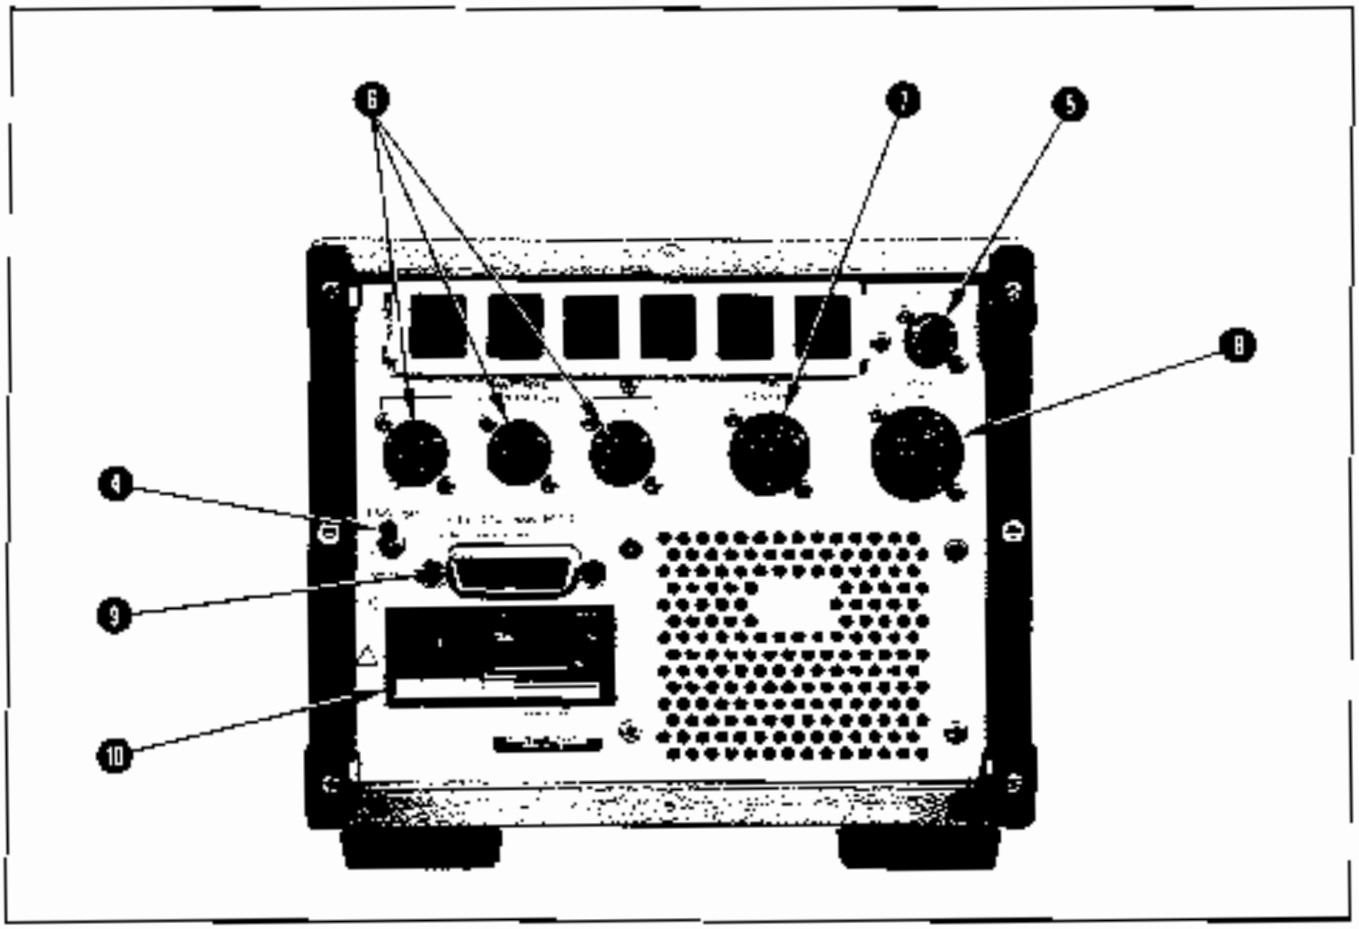


Figure 3-2. 5508A Measurement Display, Rear Panel Controls and Connectors

4

ENGLISH METRIC Switch. Determines the units of measurements, either English (inches, °F) or Metric (millimetres, °C).

The switch setting may be changed regardless of the 5508A function without loss of measurement data. It converts all temperatures, distances, and related constants while the 5508A remains in the current measurement mode. No RESET is required.

5

RMT CONT Connector. A 4-pin connector used to interconnect the 5508A with the remote control unit. The cable used to interconnect these two units is part of the remote control unit.

❻

MATERIAL TEMPERATURE (1 through 3) Connectors. Three 6-pin connectors used to interconnect the 5508A with the 10757A/B/C Material Temperature Sensors. The cable used to interconnect these two units is part of the material temperature sensor

❼

AIR SENSOR Connector. A 10-pin connector used to interconnect the 5508A to the 10751A/B Air Sensor. The cable used to interconnect these two units is part of the air sensor

❽

LASER SOURCE Connector. An 18-pin connector used to interconnect the 5508A Measurement Display to the 5518A Laser Head. Use interconnecting cable HP Part Number 8120-3491. If this connector is left open when turning on the system, the 5508A display will read LASr FAIL after the unit goes through its full warm-up countdown.

❾

IEEE STD 488 PORT (HP-IB) Connector. A 24-pin type-57 microribbon connector used to connect the 5508A to other equipment. The lettering just above the connector denotes the IEEE STD 488 (HP-IB) capabilities for the 5528A (see Table 3-5 for details). HP-IB is a Hewlett-Packard Company implementation of the IEEE 488 Standard Interface. See Section II for pinouts, signal names, and logic conventions. Information required to use the 5508A with HP-IB is covered in Paragraph 3-20, Data Transfer to External Devices through Paragraph 3-64.

❿

POWER LINE Module. Contains a connector for the line cord, a fuse, and a line voltage selector. Details of line voltage selection, and power requirements, and line cords are contained in Section II

3-8. ERROR MESSAGES

3-9. Table 3-2 lists error messages and their meaning. Note that the 5509A display is a 7-segment type and not alphanumeric thus messages appear in a mixture of upper and lower case. These error messages will appear on the 5508A display for the listed conditions.

Table 3-2. Error Messages

Error on Display	Condition
A Error	Material temperature average error
AE Error	Air Sensor temperature signal error
AH Error	Air Sensor humidity signal error
AP Error	Air Sensor pressure signal error
C Error	Compensation error (due to a sensor error)
FAIL 1	Failed part of power-up self test
FAIL 2	Failed part of power-up self test
FAIL 3	Failed part of power-up self test
FAIL 4	Failed part of power-up self test
Hd Error	Laser Head error
LASr FAIL	Flashes instead of L... when 5518A is not ready for operation at the end of the warm-up countdo...
Lr Error	Listener too slow (HP-IL)
Or Error	Overrange error. Parameter ... range permits.
P1 Error	Material Temper...
P2 Error	Material T...
P3 Error	M... sensor No...
PA Error	Be... – could indicate ... m beam in measurement path.
Pr Error	Pro... ...ming error (check user soft... P-IB controller).
SL Error	Signal loss error, could indicate excess... ty or problem in the measurement path.
Sr Error	Sample rate too high
SS Error	Processor failure or keyboard problem
Ur Error	Underrange error. Parameter value is smaller or more negative than range permits.

3-10. If these errors cannot be remedied by operator controls and appear to be hardware failures, refer to troubleshooting procedures in Section VIII.

3-11. 5518A LASER HEAD. FRONT PANEL CONTROLS AND INDICATORS

3-12. Followed are descriptions of the 5518A front panel features shown in Figure 3-3.

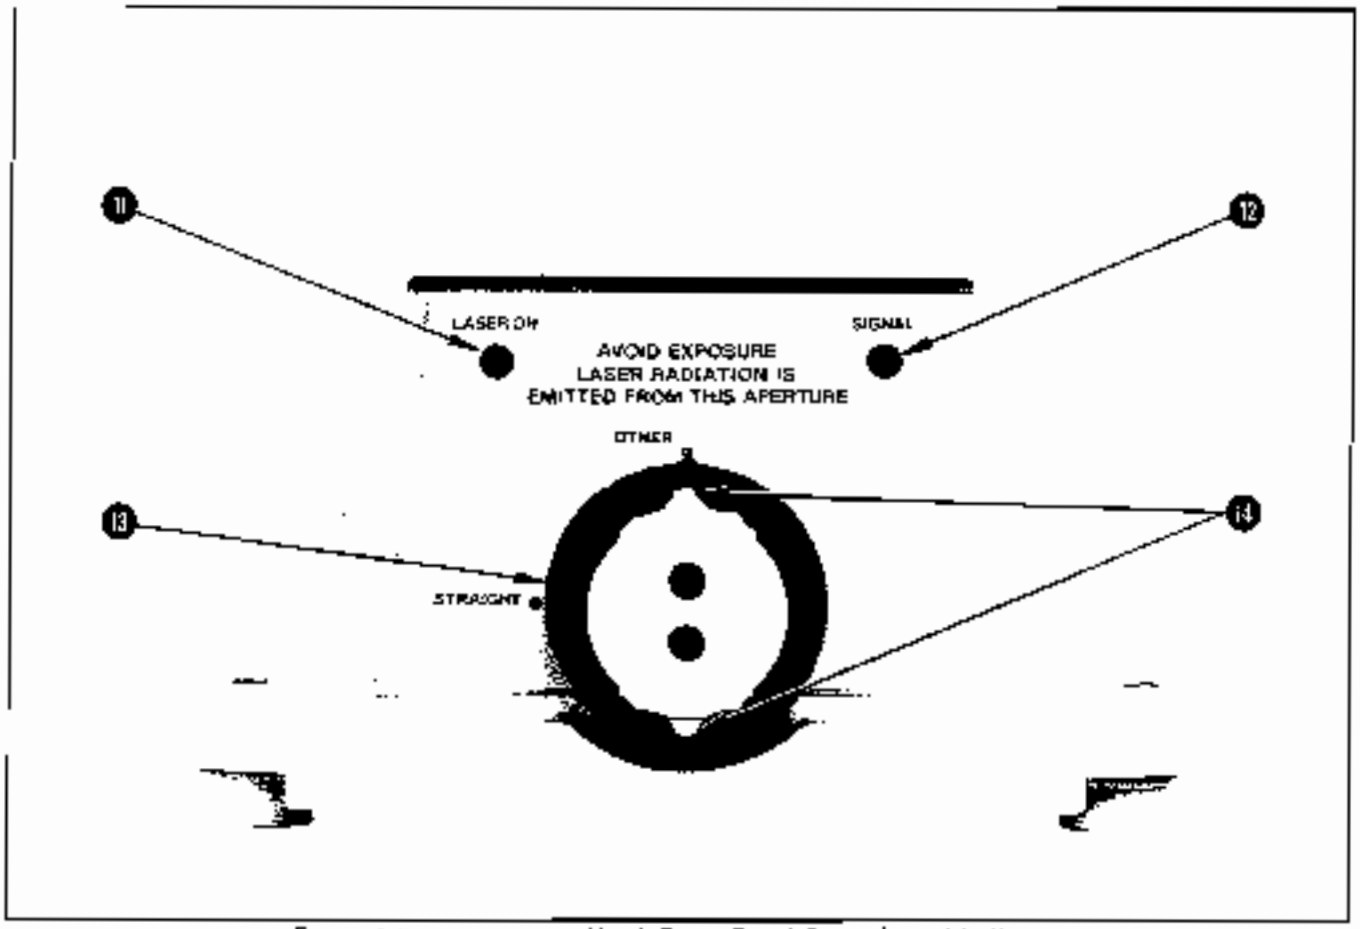


Figure 3-3 5518A Laser Head. Front Panel Controls and Indicators

11

LASER ON INDICATOR. An amber indicator installed to alert the operator that the 5518A Laser Head is activated and emitting a laser beam. Electrically, this indicator monitors the +15 Volt line supplied by the 5508A which is used by the 5518A to generate its operating power.

12

SIGNAL Indicator. An amber indicator that indicates when a sufficient laser beam measurement signal is returned to the measurement receiver assembly within the 5518A.

13

TURRET Ring. A two-position measurement-type selector used to configure the 5518A for straightness measurements in the STRAIGHTNESS position or for all other types of measurements in the OTHER position.

⑭

TURRET Shutters. Shutters are located behind both apertures in the turret. For the exit shutter (top), three positions can be selected: open, reduced aperture, or closed. For the return shutter (bottom), two positions can be selected, open aperture or alignment target.

3-13. 5518A LASER HEAD, REAR PANEL INDICATORS AND CONNECTORS

3-14. Following are descriptions of the 5518A rear panel features shown in Figure 3-4.

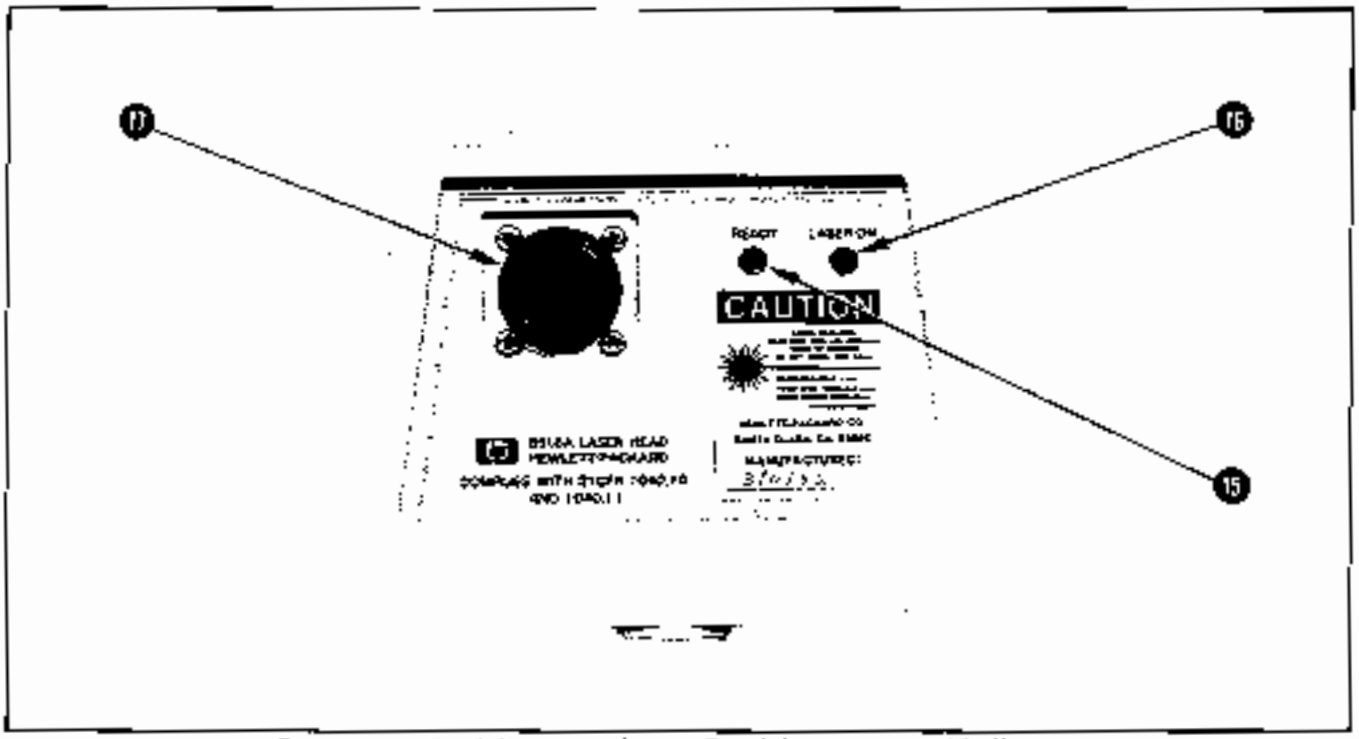


Figure 3-4. 5518A Laser Head, Rear Panel Connectors and Indicators

⑮

READY Indicator. About half way through the laser warm-up period, this indicator will blink on and off to indicate that the laser is in the process of warming up. When the 5518A is ready for use, the LED assumes a steady on condition.

⑯

LASER ON Indicator. An amber indicator installed to alert the operator that the 5518A Laser Head is activated and emitting a laser beam. Electrically, this indicator monitors the −15 Volt line supplied by the 5508A which is used by the 5518A to generate the operating power.

⑰

5508A Connector. An 18-pin connector used to connect the 5518A Laser Head to the 5508A Measurement Display. Use interconnecting cable HP Part Number 8120-5491. If this connector is left open when turning on the system, the 5508A display will read LASr FAIL after the unit goes through its self test and warm-up count down (approximately 10 minutes).

3-15. 10751A/B Air Sensor Controls

3-16. The Air Sensor (Figure 3-5) measures the atmospheric conditions and supplies the 5508A with data to derive the Velocity of Light Compensation number. The compensation number is used to correct for the dependence of laser wavelength on atmospheric conditions. The 10751A/B contains sensors for air temperature and air pressure. The relative humidity is set with the HUMIDITY switch. Three positions are available, 25, 50, and 75%. See V.O.L. key description on Page 3-7 for further information. Also see AIR SENSOR connector on Page 3-12.

3-17. The following guidelines should be used to minimize V.O.L. Compensation errors when setting the Humidity switch. See 5528A system specifications in Section I.

Switch Setting	Humidity Range
25%	0 to 37.5%
50%	37.5% to 62.5%
75%	62.5% to 95%

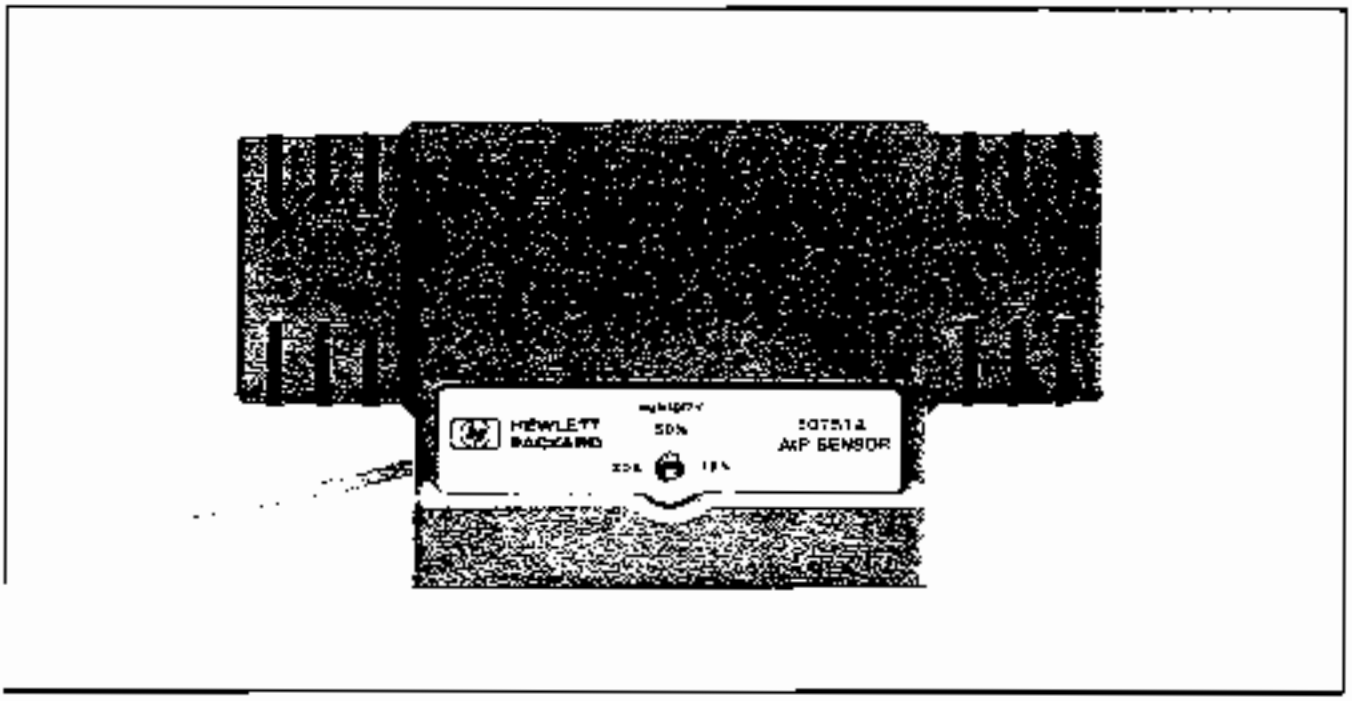


Figure 3-5. 10751A/B Air Sensor Controls

3-18. 10757A/B/C MATERIAL TEMPERATURE SENSORS

3-19. The Material Temperature Sensors (Figure 3-6) are used to compensate for thermal expansion or contraction of the material being measured by the 5508A System. There are no controls or indicators. See MATL TEMP key description on Page 3-5 for further information. Also see MATERIAL TEMPERATURE connectors on Page 3-11.

3-20. THE RANGE of the 10757A/B/C Material Temperature Sensor is 0°C to 40°C (32°F to 104°F). When sensors reach temperatures outside of this range, appropriate error messages are displayed by the 5508A. See Paragraph 3-8 ERROR MESSAGES for explanation of these messages. The same error messages are used when temperature signal errors occur due to hardware failures.

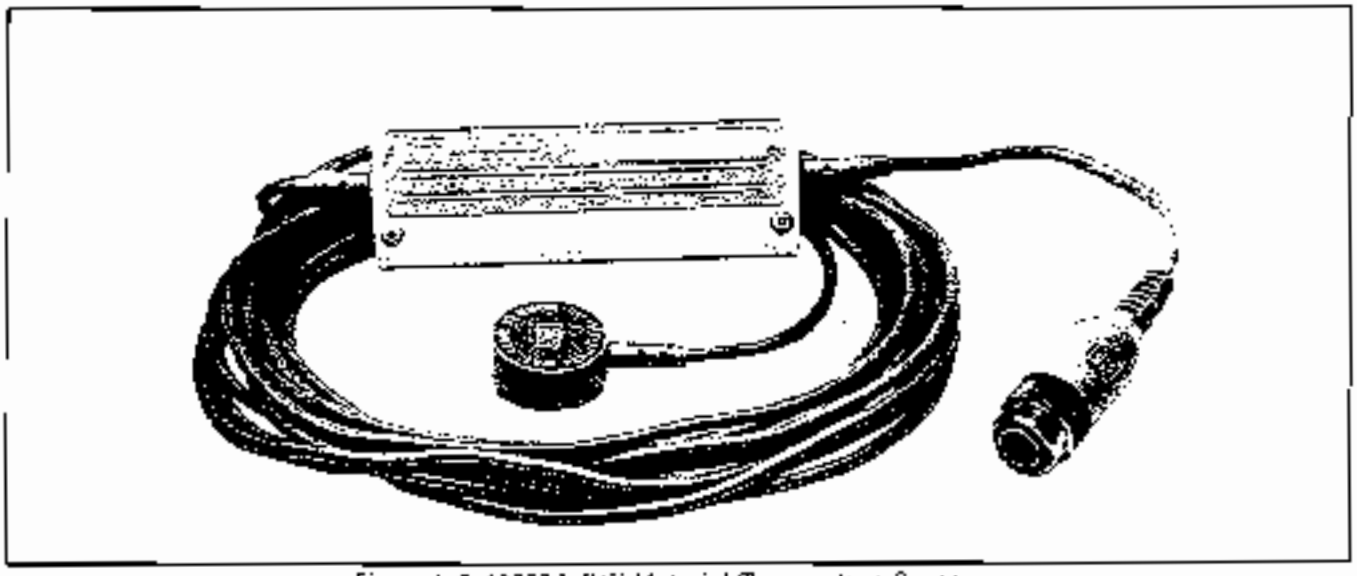


Figure 3-6. 10757A/B/C Material Temperature Sensors

3-21. REMOTE CONTROL UNIT 05508-60021 CONTROLS AND INDICATORS

3-22. The Remote Control Unit (Figure 3-7) provides three remote functions. The beam strength meter duplicates the function of the 5508A BEAM STRENGTH meter, see Page 3-2. The RESET switch duplicates the 5508A RESET function, see Page 3-8. The RECORD switch is used to trigger the 5508A in order to transmit selected data to external devices. This function is similar to the AUTO RECORD function, see description of the 5508A AUTO RECORD key on Page 3-9 for information required to output data to an HP-IB listener. Also see RMT CONT connector on Page 3-10.

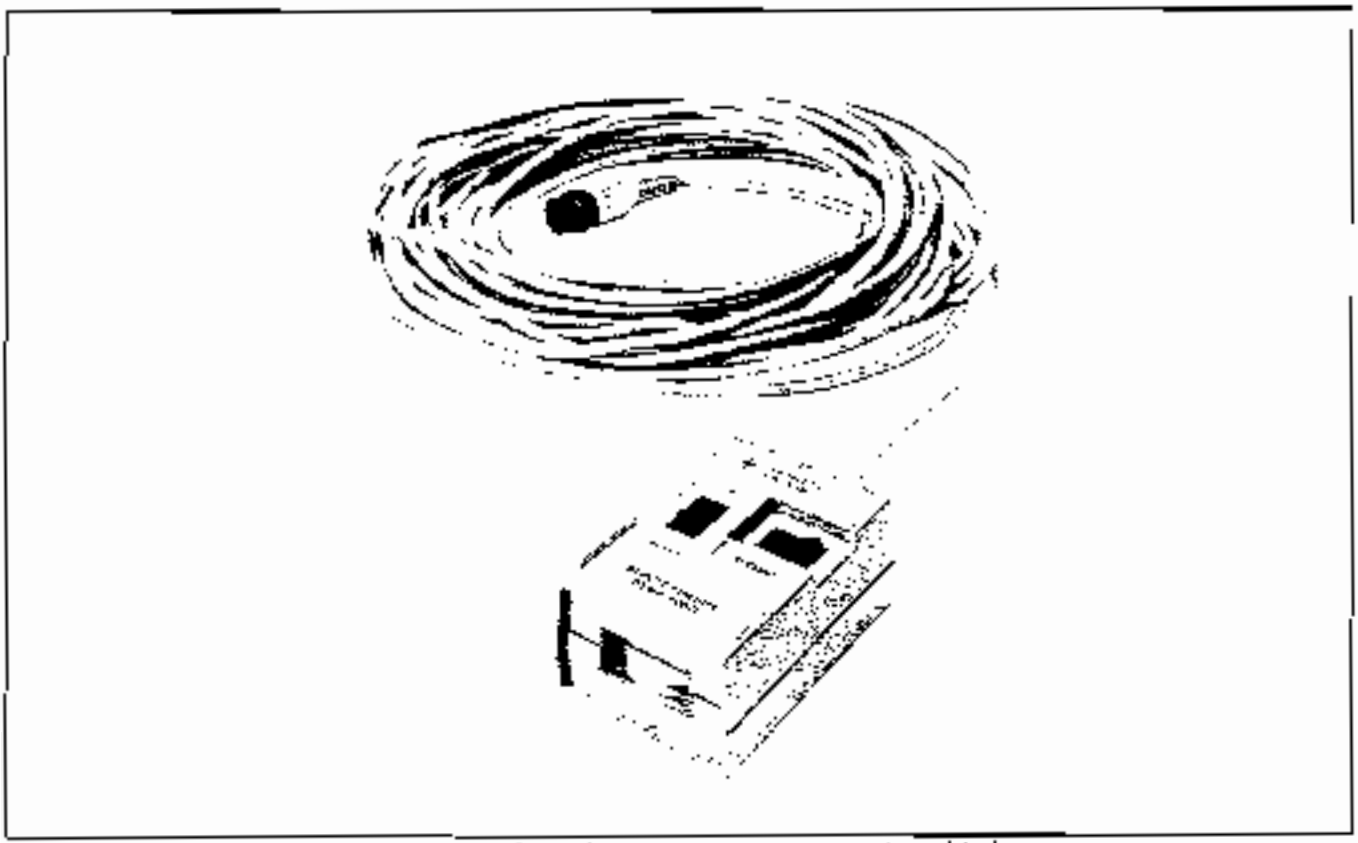


Figure 3-7. Remote Control Unit 05508-60021, Controls and Indicators

3-23. OPERATOR'S CHECK

WARNING

BEFORE THE 5508A IS SWITCHED ON, ALL PROTECTIVE EARTH TERMINALS, EXTENSION CORDS, AUTO-TRANSFORMERS AND DEVICES CONNECTED TO IT SHOULD BE CONNECTED TO A PROTECTIVE EARTH GROUNDED SOCKET. ANY INTERRUPTION OF THE PROTECTIVE EARTH GROUNDING WILL CAUSE A POTENTIAL SHOCK HAZARD THAT COULD RESULT IN PERSONAL INJURY.

FOR CONTINUED PROTECTION AGAINST FIRE, ONLY FUSES WITH THE REQUIRED RATING AND SPECIFIED TYPE SHOULD BE USED. DO NOT USE REPAIRED FUSES OR SHORT CIRCUITED FUSEHOLDERS.

LASER RADIATION IS EMITTED FROM THE APERTURE ON THE 5518A LASER HEAD.

CAUTION

Before switching on the AC power, the 5508A must be set to the voltage on the power source, or damage to the instrument may result. See Section II.

3-24. The following operating procedure describes a simple setup to allow a quick familiarization of the system operating controls and indicators. The optical alignment described here is adequate to perform the check but is not sufficient to make precision measurements. See the separate 5528A User's Guide for detailed optical alignment information.

3-25. Equipment Required

3-26. The following equipment is needed to perform the check:

1 5508A Measurement Display
1 5518A Laser Head
1 10751A/B Air Sensor (optional)
3 10757A/B/C Material Temperature Sensors (optional)
2 10784A Base
2 10785A Height Adjuster and Post
2 10767A Retroreflector
1 10760A Linear Interferometer
1 Bar or Straight Edge

3-27. Procedure

1. Refer to Section II, Paragraph 2-8, to determine if the 5508A is set up for the available line voltage.
2. Connect the 5518A as described in Paragraphs 2-10 through 2-17 in Section II, Installation. Do not connect the 10751A/B or 10757A/B/C.
3. Assemble the retroreflector assembly (see Figure 3-8) using a 10767A Retroreflector, a 10785A Height Adjuster and Post, and a 10784A Base. Throughout the remainder of this check this assembly will be referred to as the retroreflector assembly.

4. Assemble the interferometer assembly (see Figure 3-8) using a 10766A Interferometer, a 10767A Retroreflector, a 10785A Height Adjuster and Post, and a 10784A Base. Throughout the remainder of this check this assembly will be referred to as the interferometer assembly.

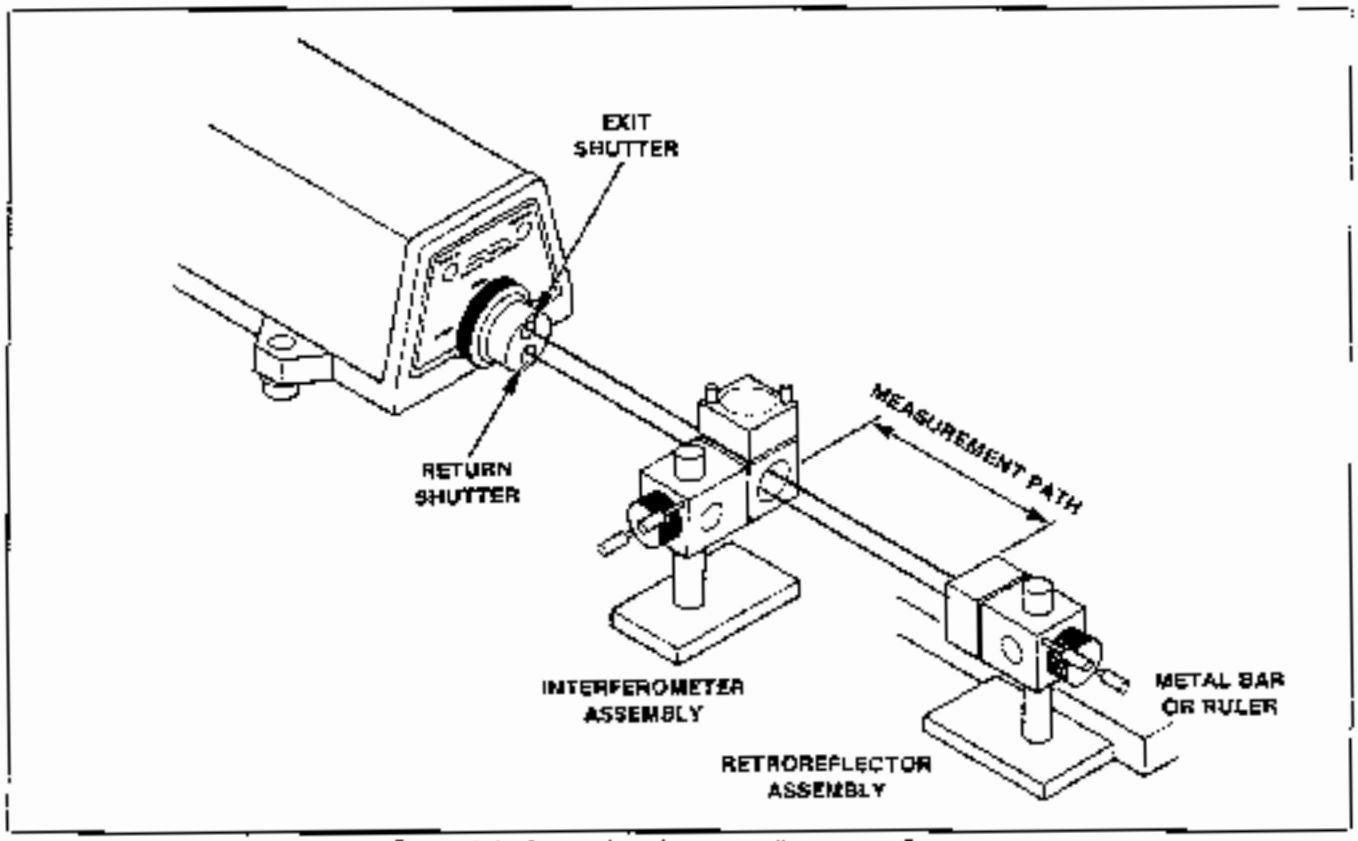


Figure 3-8. Linear Interferometer Equipment Setup

5. On 5508A rear panel set units switch to the ENGLISH position.

WARNING

DO NOT STARE INTO THE LASER BEAM.

6. On the 5508A, set the LINE switch to ON and check that the 5518A Laser Head emits a red laser beam. If the beam is not obvious, a piece of white card stock may be used to view the beam. The diameter of the laser beam is controlled by the exit shutter (see Figure 3-3). Set the exit shutter to its full aperture position.

   The system will go through a self-test and warm-up period which requires approximately 3 to 10 minutes to complete. The 5508A self-test sequence is described in Paragraph 3-26. The 5528A READY indicator will begin to blink during the warm-up period. When READY assumes a constant lighted condition, the 5518A is ready for use. The warm-up period should end with "PA Error" (path error) on the display. If the 5508A fails its self test or the warm-up countdown does not end with PA Error, see 5528A Block Diagram and System Troubleshooting in Section VIII.

7. Align the optics as follows:

   a. A bar or straight edge can be used as a straight reference line for the optics. Lay a bar or tape a straight edge on a bench along the line of the intended laser beam path.

b. Position the 5518A Laser Head so that the laser beam is in line with and parallel to the long dimension of the straight edge.

c. Place the retroreflector assembly (see Figure 3-6) about 2 feet from the laser head using the straight edge as a guide.

d. On the laser head, dial in the alignment target on the return shutter. Dial in the small diameter aperture on the exit shutter.

e. Adjust the retroreflector assembly and laser head so that the laser beam returns to the center of the crosshairs on the return shutter.

f. Place the interferometer assembly (see Figure 3-2) in between the laser head and the retroreflector assembly such that the laser beam passes through the interferometer according to the diagram on the 10706A Interferometer label.

g. Now that the interferometer assembly is in the path, there will be two beams returned to the 5518A instead of a single beam. One beam is returned from a reference optical path within the interferometer assembly and the other beam is returned from the measurement path between the interferometer assembly and the retroreflector assembly. Adjust the position of the interferometer assembly and/or retroreflector assembly as described below. Maximize the overlap of the two returned beams.

h. Between the interferometer assembly and retroreflector assembly, block the beam with a piece of card stock and observe if the remaining beam is incident on the center of the crosshairs. If so, the interferometer assembly is properly aligned. If not, reposition the interferometer assembly.

i. Unblock the beam and observe that the two returned beams are overlapped. If not, adjust the retroreflector assembly or 5518A for both beams overlapping at the center of the crosshairs.

j. When overlap is maximized, place the return shutter to the open position and the exit shutter to the large diameter position. The SIGNAL light on the 5508A should be ON and the BEAM STRENGTH meter should be steady and indicating in the green area.

8. Press RESET, the display should read "0.00000 IN". Note that the – (minus sign) may be on or flashing and the low order digits may dither.

9. Move the retroreflector assembly away from the linear interferometer assembly approximately 1 inch. The display should indicate the displacement.

10. Press minus 55, then press MATL TEMP key. The display should read "Or Error". Press MATL TEMP again, the display should read "A 32.00 F". Press MATL TEMP again, the display should return to the distance mode and read approximately 1 inch. Press MATL TEMP again, the display should read "A 32.00 F".

11. Press 150, then press MATL TEMP key. The display should read "Or Error". Press MATL TEMP again, the display should read "A 122.00 F". Press MATL TEMP again, the display should return to the distance mode and read approximately 1 inch. Press MATL TEMP again, the display should read "A 122.00 F".

12. Press EXP COEFF, the display should read the expansion coefficient default value of 0.0. Press EXP COEFF again to return to the measurement mode. Write down the exact value of the displacement. Press 720 EXP COEFF, note the new value of the displacement. The new value should be less than the old value by 38,880 parts per million (|122 –66| × 720 ppm = 38,880 ppm). Press 0.0 EXP COEFF to disable material temperature compensation.

13. Press V.O.L., the display should read the V.O.L. compensation number default value of 728.6 ppm. Press V.O.L. again to return to the measurement mode. Write down the exact value of the displacement. Press 1000.0 V.O.L. Note the new value of the displacement. The new value should be greater than the old value by 271.2 parts per million (1000.0 ppm - 728.8 ppm = 271.2 ppm).

14. Press the following ENTRY keys 12 DECIMAL POINT. Then press PRESET. The display should read 12. plus the value of the distance measurement (approximately 13. inches).

15. Press 3000, then press PRESET. The display should read "Or Error". Press PRESET again, the display should read "2000.00000". Press PRESET again, the display should read approximately 2002 inches.

16. Press MINUS 3000, then press PRESET. The display should read "Or Error". Press PRESET again, the display should read "-2000.00000". Press PRESET again, the display should read approximately -1999 inches.

17. Press 12. PRESET. The display should read approximately 13 inches.

18. Press DIR SENSE, the display should read 12 minus the last distance measurement made (approximately 11 inches). Press DIR SENSE again, display should read approximately 13 inches.

19. Press MINUS 6 RESOL this disables the smoothing function and extends the resolution to 1 microinch causing the last digit to jitter considerably. The display should read approximately 13 inches to six decimal places.

20. Press 9, then press RESOL key. The display should read "Or Error". Press RESOL again, the display should read "6.". Press RESOL again, the display should return to the distance mode and read approximately 13 inches to 6 decimal places, with the smoothing function on.

21. Press minus 9, then press RESOL key. The display should read "Or Error". Press RESOL again, the display should read "-6.". Press RESOL again, the display should return to the distance mode and read approximately 13 inches to 6 decimal places with the smoothing function off.

22. On the 5508A, set the LINE switch to off. Connect the 10751A-B to the 5508A rear panel jack marked AIR SENSOR. Connect the 10757A/B/C to the 5508A rear panel jacks marked MATERIAL TEMPERATURE 1, 2, 3. Set the 5508A LINE switch to ON. Wait for the 5508A to display LASEr UP

23. Press MATL TEMP. If one or more sensors are connected, the display should read "A xx.xxF" where xx.xx is the average temperature of the sensors connected.

24. Press MATL TEMP again. The display should read "1 xx.xxF", the temperature of material sensor no. 1. If no sensor is connected to no. 1 jack, the display should read the number and temperature of the next sensor that is connected.

25. If more than one material sensor is connected, repeated pressing of the MATL TEMP key should display the next sensor number and its temperature reading. After the last sensor temperature has been displayed, the display should return to the distance mode

26. Press V.O.L. The display should read "C xxx.xx" where xxx.xx is the compensation number (approximately 730 at sea level and at normal room temperature).

27. Press V.O.L. again, the display should read "A xx.xxF", the air temperature.

28. Press V.O.L. again, the display should read "P xx.xx IN", the air pressure.

29. Press V.O.L again. the display should read "H xx." the selected humidity value. The value displayed is selected with the humidity switch on the 10751A/9. Set this switch to all three positions and check that the display reads "H 75.", "H 50.", "H 25.".

3-28. SELF-TEST AND WARM-UP COUNTDOWN

3-29. When power is first applied to the 5508A, the instrument goes through a self-test diagnostic routine. Successful completion of this self-test gives a high degree of confidence that the 5508A is functioning properly. At the end of the self-test, the 5508A begins a warm-up countdown sequence. The front panel display and annunciators should indicate in the following sequence:

Sequence	MSD	LSD
1	-1	
2	5.	
3	9	
4	8.	
5	8.	
6	8.	
7	8.	
8	8	
9	8.	
10		8.
11	0 Scrolling	0
12	1	1
13	2	2
14	3	3
15	4	4
16	5	5
17	6	6
18	7	7
19	8	8
20	9	9
21	ARC-SEC annunciator on with same display as 20	
22	mm annunciator on with same display as 20	
23	IN annunciator on with same display as 20	
24	/MIN annunciator on with same display as 20	
25	RCD annunciator on with same display as 20	
26	SHORT STRAIGHTNESS annunciator on with same display as 20	
27	LONG STRAIGHTNESS annunciator on with same display as 20	
28	ANGLE annunciator on with same display as 20	
29	VELOCITY annunciator on with same display as 20	
30	DISTANCE annunciator on with same display as 20	
31	PASS 1 on display (FAIL 1 if a circuitry problem is found)	
32	PASS 2 on display (FAIL 2 if a circuitry problem is found	
33	PASS 3 on display (FAIL 3 if a circuitry problem is found	
34	PASS 4 on display (FAIL 4 if a circuitry problem is found	
35	CAL A xxx. on display (where xxx = internal calibration switch setting	
36	CAL b xx. on display (where xx = internal calibration switch setting)	
37	Addr xx. or Addr OFF on display (where xx is the HP-IB address setting factory setting = 3; OFF = talk only mode)	
38	600 on display (first step of warm-up countdown	
39	599 on display	
40	598 on display	
41	597 on display	
42	596 on display	
43	LASr COLD on display	
44	Cycle repeats with condition of the head (LASr COLd) displayed at multiples of 5. This continues until the 5518A Laser Head is ready for use (5508A will display flashing LASr UP) or 0 count is reached (flashing LASr FAIL). If a LASr FAIL display occurs, refer to Section VIII, Trouble Isolation	

3-30. DATA TRANSFER TO EXTERNAL DEVICES (HP-IB)

3-31. Introduction

3-32. The 5508A Measurement Display is compatible with the Hewlett-Packard Interface Bus (HP-IB). HP-IB is Hewlett-Packard Company's implementation of the IEEE* Standard 488-1978 "Standard Digital Interface for Programmable Instrumentation". The HP-IB capability of the 5508A provides the user with a straightforward means of outputting measurement data to recording devices or, for more automated applications, the 5508A functions can be completely controlled via the interface.

3-33. HP-IB compatible devices are used in HP-IB systems in one or more of the following ways. As a LISTENER, a device must be capable of accepting data from the interface. Examples of Listeners are printers and plotters. As a TALKER, a device must be capable of outputting data to the interface. Examples of Talkers are voltmeters and tape readers. As a CONTROLLER, a device must be capable of specifying the Talker and Listener(s) of a data transfer (including itself).

3-34. The 5508A has full Talker capability, limited Listener capability, and no Controller capability. A listing of the 5508A HP-IB capabilities, called out in terms of the IEEE 488 Interface Function Codes, appears in Table 3-5, 5500A HP-IB Capabilities.

3-35. 5528A Data Transfer without an HP-IB Controller

3-36. The minimum HP-IB system configuration consists of a Talker and Listener(s) without a Controller. In this configuration, data transfer is limited to direct transfer from the Talker to the Listener(s). The 5508A uses the special HP-IB Talk-Only mode for this type of system. To set the 5508A to Talk-Only, the Talk-Only Addressable switch should be set accordingly. See Paragraph 3-62, HP-IB switches.

3-37. To configure the 5508A with a Listener, HP-IB Interconnecting Cable (HP 10833A/B/C/D) will generally be required. For example, if the 5528A is used with an HP-IB compatible printer, the intended printer may not be supplied with a cable. The Hewlett-Packard Catalog contains a special section on HP-IB compatible devices and accessories that are currently available.

NOTE

HP-IB cable connectors have anchor screws used to secure them to HP-IB jacks. The 5508A requires the metric version of these screws. Metric threaded HP-IB screws have a black finish, english thread HP-IB screws have a metallic finish. All HP-IB cables are currently shipped with metric screws.

3-38. Information required to operate a particular device as an HP-IB Listener is contained in its Operating Manual. For example, to use a printer with the 5508A it will generally be required that the operator manually set the printer to the Listen-Only mode. This mode is typically selectable using a switch located on the printers' rear panel. IEEE Interface Function Codes L1 or L3 indicates listen only capability.

3-39. When the 5508A is configured with an HP-IB listener, the AUTO RECORD key on the front panel, or the RECORD key on the Remote Control Unit are used to control data transfer. See the AUTO RECORD key description, Page 3-9 and the RECORD switch description, Paragraph 3-22.

3-40. 5508A Operation with an HP-IB Controller

3-41. The HP-IB capability of the 5508A Measurement Display allows all of its measurement functions to be controlled via the interface. An HP-IB Controller can control the 5508A using BUS COMMANDS and the 5508A INSTRUMENT FUNCTION CODES. When the 5508A is used with a Controller its Talk-Only/Addressable Switch must be set to Addressable. See paragraph 3-62 HP-IB Switches.

*IEEE = Institute of Electrical and Electronic Engineers.

3-42. 5506A Instrument Function Codes

3-43. The 5508A recognizes a set of Instrument Function Codes that allows its' measurement functions to be controlled via HP-IB. All measurement modes can be selected by an HP-IB Controller and parameter values, such as Average Material Temperature, can be accessed or entered depending on user requirements.

3-44. Using Instrument Function Codes

3-45. Controlling the 5508A using Instrument Function Codes is accomplished by outputting the Instrument Function Codes to the interface and addressing the 5508A to listen. The programming statements required to use a Controller to send Instrument Function Codes and address the intended bus device to listen will depend on the particular Controller.

EXAMPLES

A fixed point number preceding an Instrument Function Code is used to enter a value into the 5506A or to select an operating mode.

78TA	Set average material temperature to 78°.
2RC	Output data samples to HP-IB every 2 seconds.
1TP	Material Temperature Sensor #2 and #3 disabled.

3-46. Not all Instrument Function Codes can have preceding numbers. Those that can are indicated in Table 3-3. Numbers preceding other Instrument Function Codes are ignored.

MORE EXAMPLES (Note that Function Codes can be programmed as strings)

M1	Go into distance measurement mode.
72TA. M1	Set averaged material temperature to 72° and go into distance mode.
TA, RC	Load HP-IB output buffer with Average Material Temperature, output to HP-IB.
VL, RC	Load HP-IB output buffer with Velocity of Light Compensation Number and output to HP-IB.

NOTE

The front panel of the 5508A will indicate modes controlled by the HP-IB in the same way that it indicates the modes when selected using the front panel keys. For example when the value of TA is requested via HP-IB, the value of TA will also be displayed on the front panel display.

Table 3-5. 5508A Instrument Function Codes

Instrument Function Code	5508A Function
M1	Distance Mode
M2	Velocity Mode
M3	Angular Mode
M4	Long Straightness Mode
M5	Short Straightness Mode
P1*	Distance Preset
P2*	Velocity Preset
P3*	Angular Preset
P4*	Long Straightness Preset
P5*	Short Straightness Preset
R1*	Distance Display Resolution
R2*	Velocity Display Resolution
R3*	Angular Display Resolution
R4*	Long Straightness Display Resolution
R5*	Short Straightness Display Resolution
T1	Material Temperature Sensor No. 1
T2	Material Temperature Sensor No. 2
T3	Material Temperature Sensor No. 3
TA*	Average Material Temperature
AP	Air Pressure
AH	Air Humidity
AT	Air Temperature
VL*	V.O.L. Compensation Number
EC*	Expansion Coefficient
RC*	Record Output to HP-IB
RS	Reset
D1	Direction Sense at Power On
D2	Direction Sense Opposite to Power On
UE	English Units
UM	Metric Units
C0	Disables Compensation Number Air and Material Temperature Updating
C1	Enables Compensation Number (Air and Material Temperature Updating
TP*	Selected Material Temp Sensor Enable
A0	Disables Velocity of Light Compensation Number Updating
A1	Enables Velocity of Light Compensation Number Updating
	Additional Comments:
P1 through P5	Also Changes 5508A to Associated Measurement Mode
R1 through R5	Also Changes 5508A to Associated Measurement Mode
RC	If Auto Record is On, RC turns it Off
TP	TP is used with a preceding numeric value to selectively enable the 10757A/B/C Material TemperatureSensor readings. Disabled sensors still update temperature but the data is not used for compensation.

Numeric Value Preceding TP	Active Sensors		
	T3	T2	T1
1	No	No	Yes
2	No	Yes	No
3	No	Yes	Yes
4	Yes	No	No
5	Yes	No	Yes
6	Yes	Yes	No
7	Yes	Yes	Yes

A0	Air sensors still update atmospheric data but a new velocity of light compensation number is not calculated.

*Asterisk indicates commands that can be preceded by a numeric value. Also see additional comments that follow.

3-47. HP-IB Bus Commands

3-48. Bus Commands can be UNIVERSAL COMMANDS, ADDRESSED COMMANDS, or UNADDRESSED COMMANDS. HP-IB compatible devices are designed to respond only to those Bus Commands that have useful meaning to them and to ignore all others. For example, a printer need not talk on the interface bus and could be designed to ignore all Bus Commands related to the talk function. The 5508A responds to a set of Bus Commands consisting of selected Universal Commands and Addressed Commands.

3-49. There are certain advantages to using Bus Commands instead of Instrument Function Codes but Bus Commands are not necessary for the 5508A. Programming Controllers to send Bus Commands requires less syntax than is required to send Instrument Function Codes. Also, program statements for Bus Commands are executed more quickly than those containing Instrument Function Codes and can also reduce Controller software requirements.

3-50. HP-IB Bus Commands and 5508A Responses

3-51. There are certain Bus Commands that are valid for the 5508A. Table 3-4, Valid Bus Commands lists these Bus Commands and 5508A responses. The 5508A must first be initialized to accept these Bus Commands. A program statement that accomplishes this should be included in the Controller software. The initializing statement will vary with different Controllers as will HP-IB control statements in general. In terms of the interface bus, the 5508A is initialized by setting the Single Line Command REMOTE ENABLE true (REN on Figure 3-9, HP-IB Structure) and addressing the 5508A to listen. After the 5508A is initialized for Bus Commands it will not respond to the front panel keys. The exception to this is the RESET key. The RESET key performs the HP-IB LOCAL function in addition to resetting the measurement. The HP-IB LOCAL function releases the instrument from bus control and therefore re-enables the keyboard.

Table 3-4. Valid Bus Commands

Addressed Commands		
Selected Device Clear	SCD	Clears HP-IB Output Buffer; VOL Compensation and Materiel Expansion/ Expansion/Contraction Compensation are Enabled if 10751A/B and 10757A/B/C are attached
Group Execute Trigger	GET	Triggers Data Output
Go To Local	GTL	Enables front panel keys
Universal Commands		
Device Clear	DCL	Same as for Selected Device Clear above
Local Lockout	LLO	Disables all Front Panel Keys including RESET

Table 3-5. HP-IB Capabilities

IEEE Function Code	Description
C0	No Controller Capability
T5	Basic Talker, Serial Poll, Talk Only Mode, Untalk if My Listen Address
L4	Basic Listener, No Listen Only Mode, Unlisten if My Talk Address
SH1	Source Handshake Capability
AH1	Acceptor Handshake Capability
SR1	Service Request Capability
RL1	Remote-Local Capability including Local Lock Out
PP0	No Parallel Poll Capability
DC1	Device Clear Capability
DT1	Device Trigger Capability
E1	Open Collector Outputs

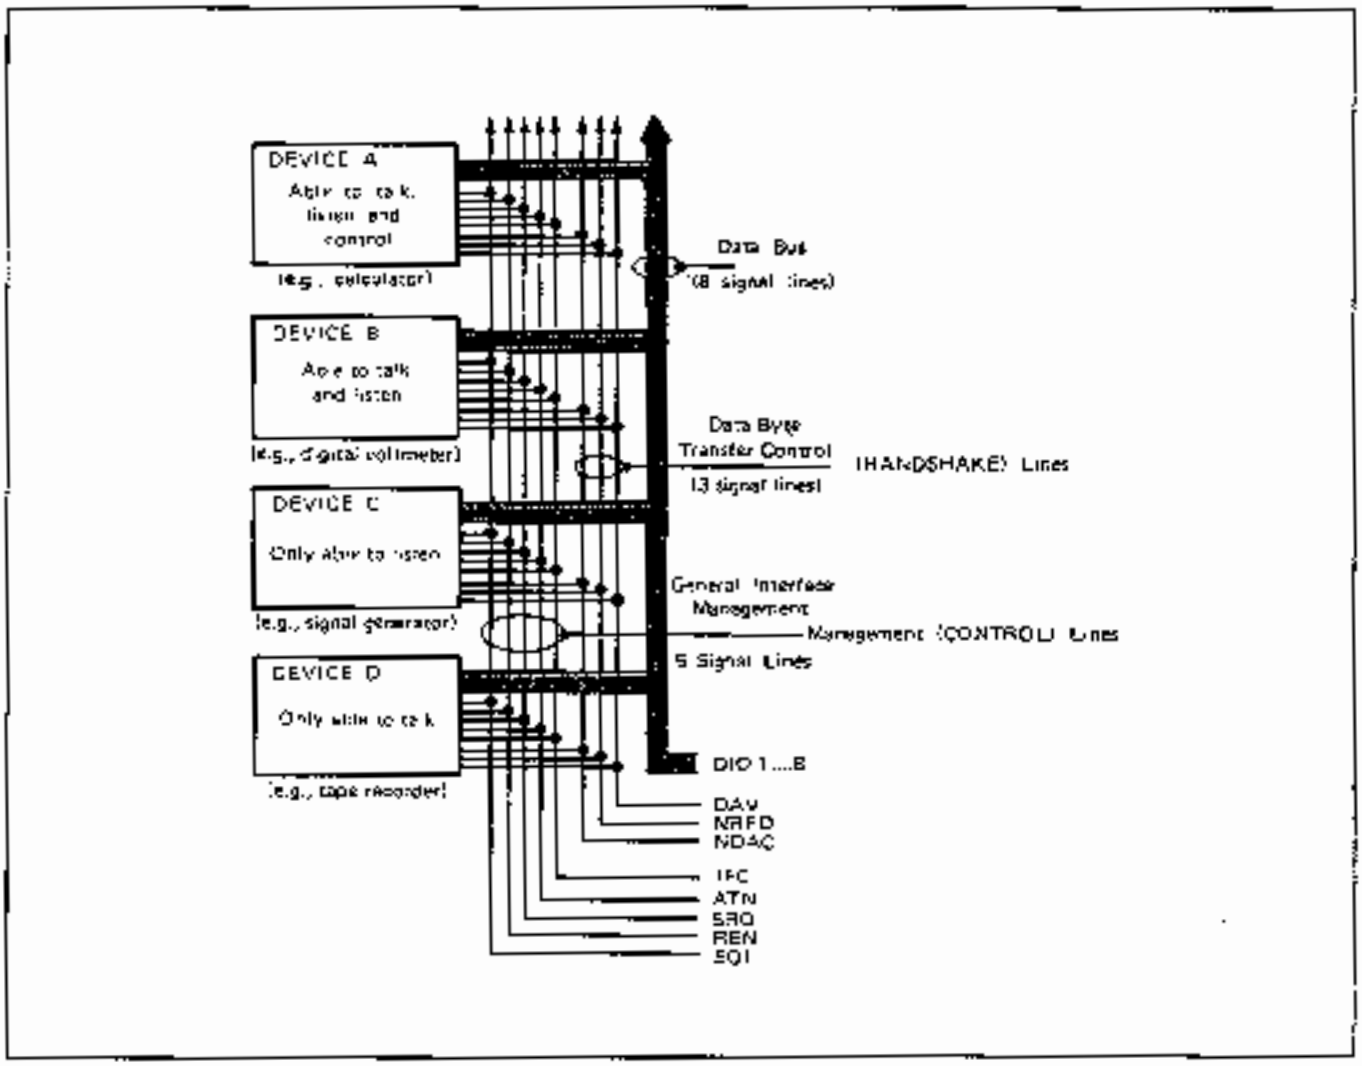


Figure 3-9. HP-IB Structure

3-52. Status Byte

3-53. An HP-IB Controller reads the status byte of the 5306A by executing an HP-IB serial poll. The status byte will return one of the following values. . . . .

Decimal		Displayed Error Message
0	Normal Operation	
55	Data Available for Output	
68, 69	Programming Error	Pr Error
70, 71	Underrange Error	Ur Error
72, 73	Overrange Error	Or Error
74, 75	Humidity Sensor Error (switch)	AH Error
76, 77	Pressure Transducer Error	AP Error
78, 79	Air Temp Sensor Error	AE Error
80, 81	MTS 3 Error	P3 Error
82, 83	MTS 2 Error	P2 Error
84, 85	MTS 1 Error	P1 Error
86, 87	Sample Rate Error (too high)	Sr Error
88, 89	Listener Error (too slow)	Lr Error
90, 91	Signal Error	SL Error
92, 93	Beam Path Error	PA Error
94, 95	Laser Head Error	Hd Error

NOTE

If multiple errors are present, only the highest value is output.

NOTE

The 5508A should be placed in a measurement mode before reading the status byte.

3-54. Clearing Error Conditions

3-55. Errors are cleared by correcting the condition then either by sending a reset (RS) for laser head errors, (Status Byte = 90, 91, 92, 93, 94, 95) or, for all other errors, sending any Instrument Function Code will clear the Error Message without loss of measurement data.

3-56. Output

3-57. Output may be obtained from the 5508A either by sending the Instrument Function Code RC, sending the HP-IB GROUP EXECUTE TRIGGER command (GET), or by using the AUTO RECORD key or the RECORD switch.

a. When the RC Instrument Function Code is used alone, measurement data will be unsmoothed.

b. When AUTO RECORD is initialized via HP-IB (Fixed Point Number)RC or from the front panel, the first sample will be unsmoothed and the rest will be smoothed.

c. The RECORD switch on the Remote Control Unit causes only smoothed data to be output.

d. Via HP-IB, the Bus Command GROUP EXECUTE TRIGGER (GET) or a DEVICE TRIGGER also yield smoothed data.

3-58. Sensor Errors

3-59. The 5508A will return a value of 999999999 whenever a controller requests a measurement reading from a sensor that is not plugged into the rear panel. Also, if a sensor is overranged the 5508A will return 111111111

3-60. Interrupt Capability

3-61. The Single Line Command SERVICE REQUEST (SRQ in Figure 3-9) is sent by the 5508A on conditions which cause the status byte to assume a value greater than or equal to 65 decimal. This message can be utilized to implement interrupt driven routines in the Controller software.

3-62. HP-IB Switches

WARNING

BEFORE REMOVING THE 5508A TOP COVER AND CHECKING THE HP-IB SWITCH SETTING, REMOVE THE 5508A POWER CORD. IF THE POWER CORD IS CONNECTED TO THE 5508A, 100 TO 240 VOLTS AC MAY BE PRESENT EVEN WHEN THE FRONT POWER SWITCH IS SET TO OFF. CHECKING OR CHANGING THE HP-IB SWITCH SETTING SHOULD BE PERFORMED ONLY BY SERVICE TRAINED PERSONNEL WHO ARE AWARE OF THE HAZARDS INVOLVED (FOR EXAMPLE, FIRE AND ELECTRIC SHOCK).

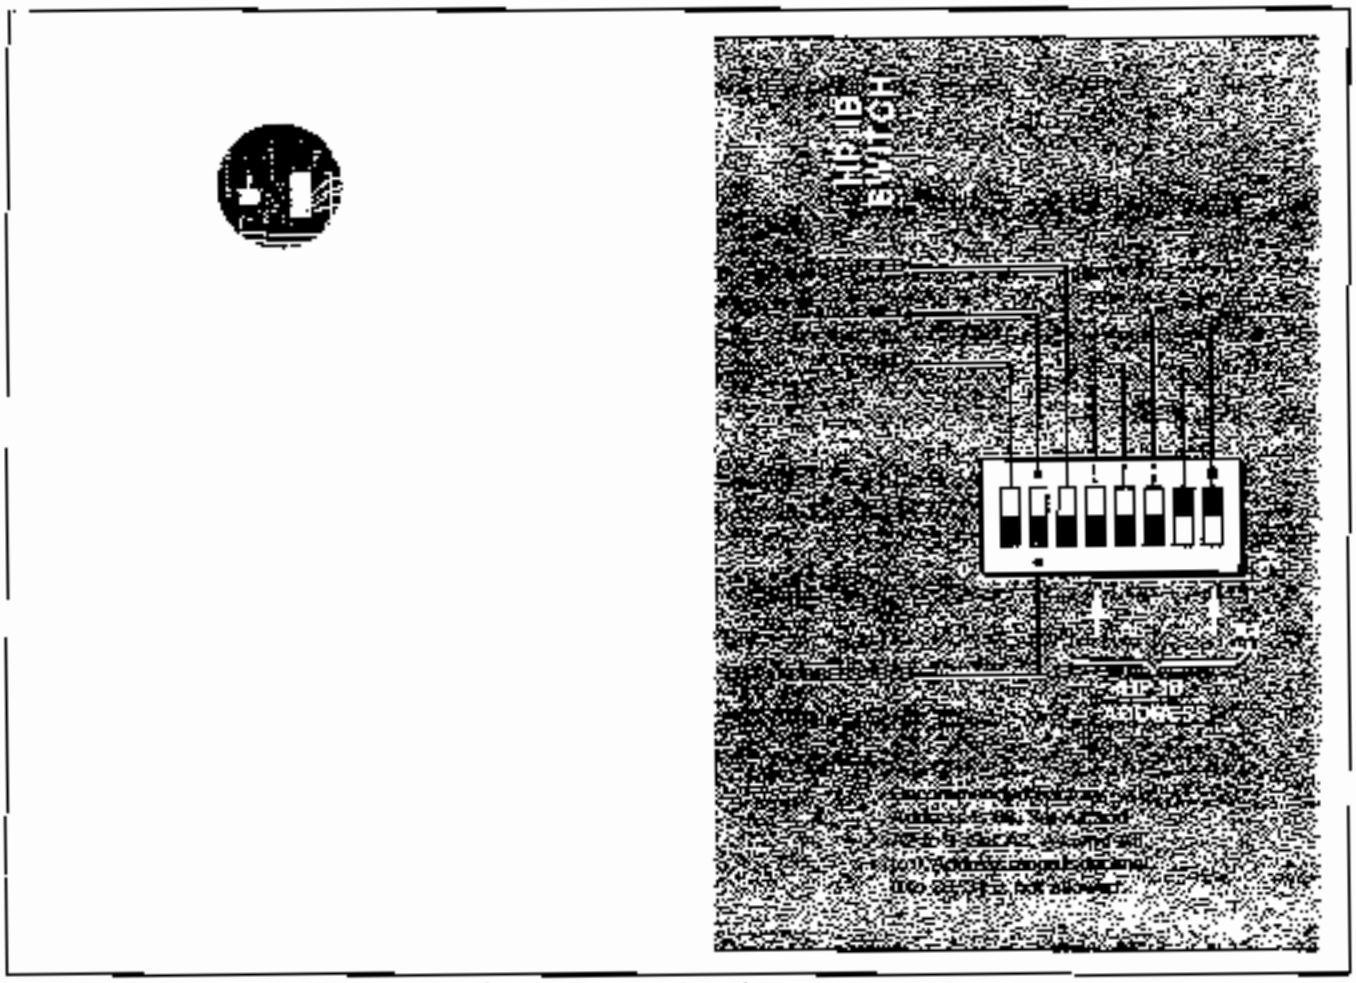


Figure 3-19. HP-IB Address Switch

Table 3-6. HP-IB Addresses

Address (in decimal)	HP-IB Switch Settings				
	A5 (16)	A4 (8)	A3 (4)	A2 (2)	A1 (1)
0	0	0	0	0	0
1	0	0	0	0	1
2	0	0	0	1	0
3	0	0	0	1	1
4	0	0	1	0	0
5	0	0	1	0	1
6	0	0	1	1	0
7	0	0	1	1	1
8	0	1	0	0	0
9	0	1	0	0	1
10	0	1	0	1	0
11	0	1	0	1	1
12	0	1	1	0	0
13	0	1	1	0	1
14	0	1	1	1	0
15	0	1	1	1	1
16	1	0	0	0	0
17	1	0	0	0	1
18	1	0	0	1	0
19	1	0	0	1	1
20	1	0	1	0	0
21	1	0	1	0	1
22	1	0	1	1	0
23	1	0	1	1	1
24	1	1	0	0	0
25	1	1	0	0	1
26	1	1	0	1	0
27	1	1	0	1	1
28	1	1	1	0	0
29	1	1	1	0	1
30	1	1	1	1	0
31	Not Allowed				

3-63. An 8-section DIP switch contains the HP-IB ADDRESS switches and the TALK ONLY-ADDRESSABLE switch. These are located on the 5508A Processor board (A2) just below the top cover. To gain access to these switches, disconnect primary power, loosen the screw at the back of the top cover and slide the cover rearward and remove. Figure 3-10 shows the HP-IB ADDRESS switch. The switch is factory set to 08 decimal (A1 and A2 switches set to 1). Allowable addresses are decimal 0 to decimal 30. decimal 31 is not allowed.

3-64. The TALK ONLY-ADDRESSABLE switch allows the instrument to output data in the TALK ONLY mode or to function as a Talker and Listener under the control of an HP-IB Controller in the ADDRESSABLE mode. For TALK ONLY operation, set the switch to 1, for ADDRESSABLE operation set the switch to 0. The switch is factory set to ADDRESSABLE.

3-65. OPERATOR'S MAINTENANCE

3-66. Operator's maintenance is limited to routines that can be accomplished without removing the instrument covers

3-67. Fuses

WARNING

THE MAINS POWER FUSE IS DIFFERENT FOR 100-120V OPERATION AND 220-240V OPERATION. TO PROTECT THE INSTRUMENT FROM FIRE, REPLACEMENTS MUST BE OF THE SAME RATING AND TYPE.

3-68. The power line fuse is located in the power line module on the rear panel. To replace the fuse, proceed as follows:

a. On the 5508A, disconnect the power cable from the power line module.

b. Slide the clear plastic window to the left. Pull the small lever marked FUSE PULL outward from the power line module. Remove the fuse and note its value.

c. Push the FUSE PULL lever into the power line module before installing the fuse.

d. Insert the proper size fuse (marked on the rear panel) for the line voltage selected. Orient the fuse parallel to and near the top of the power module and push into place. Fuse values and part numbers are as follows:

100 to 120 Volt Lines — 2 Amp 250V Fast Blo Fuse HP P/N 2110-0002

198 to 240 Volt Lines -- 1 Amp 250V Fast Blo Fuse HP P/N 2110-0001

e. Slide the plastic window to the right side of the power module.

3-69. Air Filter Cleaning

3-70. The air filter is located at the rear of the 5508A and should be cleaned periodically or when it has collected excessive dirt. To clean the filter proceed as follows:

a. On the rear panel of the 5508A, remove the postdrive screw on the right side of the filter holder. Pull the filter and filter holder away from the chassis. The filter element may be replaced by ordering HP Part No. 4208-0348.

b. Remove the filter from the holder and clean it by blowing compressed air through it from the inside out. If the filter is too dirty to clean with air, wash the filter element in hot water and a mild detergent. Dry the filter before reinstalling.

3-71. Procedures for Cleaning Measurement Optics

WARNING

THE FOLLOWING OPTICAL CLEANING PROCEDURES DO NOT APPLY TO THE OPTICS OF THE LASERS HEAD. CLEANING OF THE LASER HEAD OPTICS IS RARELY REQUIRED AND REQUIRES ACCESS TO THE INTERIOR OF THE INSTRUMENT WHERE HIGH VOLTAGES CAN BE PRESENT. ALL LASER HEAD MAINTENANCE SHOULD BE PERFORMED BY A QUALIFIED TECHNICIAN WHO IS AWARE OF THE HAZARDS INVOLVED.

3-72. If an Optics Instrument is visibly dirty or its optical surfaces, the following cleaning procedures should be used.

3-73. The optics should be handled with care so that nothing comes in contact with the exposed glass surfaces. Fingerprints will collect dust and dirt which will attenuate and disperse the laser beam. Cleaning the optics should be avoided unless the signal intensity of the beam is noticeably reduced as indicated by the BEAM STRENGTH meter.

3-74. If cleaning of the optics is required, be careful to avoid rubbing particles into the coated surfaces. Permanent reduction of signal intensity could result. If particles are observed on the optics surface, remove by blowing off with clean pressurized air or preferably dry nitrogen. If unavailable, commercially available products such as Kodak Laboratory Sprayer or Micro Duster TX600 from the Texwipe Company may be used. Each optical instrument is shipped with a package of lens tissue which is made specifically for cleaning optics. Use these tissues (or equivalent) with a pure industrial grade methanol in the following manner:

1 Fold the tissue into an approximate 1-inch square.

2 Wet the tissue with methanol (do not saturate) and gently wipe across optical surface. Use only enough pressure to remove the contaminant.

3 Do not reuse the tissue. For additional cleaning, repeat process with a new tissue.

3-75. For optical surfaces hard to reach, the tissue may be held with a clamping tweezer such as a hemostatic forcep. However, care must be taken to not scratch the coated surface.Do not scrub the surface with a dry tissue.

3-76. Avoid alcohol contamination with the following precautions:

a. Use only new, previously unopened containers. Alcohol absorbs water if left exposed to air. This will result in water spots when the alcohol evaporates.

b. Transfer the alcohol to a squeeze bottle that can be capped and made airtight.

c. Never transfer alcohol back into the original container.

SECTION IV
PERFORMANCE TESTS AND CALIBRATION

	Page
Introduction	4-1
Safety Considerations	4-1
Recommended Test Equipment	4-1
Test Record	4-1
5528A Performance Tests	4-1
5508A Performance Tests	4-2
5518A Performance Tests	4-2
Laser Power Output Test	4-2
Procedure	4-2
Receiver Gain Test	4-2
10751A/B and 10757A/B/C Performance Tests	4-3
Calibration Cycle	4-3
5508A Calibration Procedures	4-3
Preliminary Procedures	4-4
+10Vref Calibration Procedure	4-4
+0.5Vref Calibration	4-7
10751A/B Calibration Procedures	4-9
Temperature Calibration Procedure	4-9
Air Pressure Calibration Procedure	4-12
10757A/B/C Calibration Matching Procedures	4-15
10757A/B/C Calibration Procedures	4-18
HP-IB Diagnostics	4-19
Quick Diagnostic Checks	4-20
Instrument Function Codes Diagnostic	4-29

SECTION IV
PERFORMANCE TESTS AND CALIBRATION

4-1. INTRODUCTION

4-2. This section contains performance tests and calibration procedures for the 5528A Laser Measurement system. A test record is included to record calibration results for future comparison.

4-3. SAFETY CONSIDERATIONS

4-4. The following warning contains information that must be understood for your safety.

WARNING

MAINTENANCE DESCRIBED HEREIN IS PERFORMED WITH POWER SUPPLIED TO THE INSTRUMENT, AND PROTECTIVE COVERS REMOVED. 100 VOLTS TO 240 VOLTS AC MAY BE PRESENT IN THE 5508A EVEN WHEN THE FRONT PANEL POWER SWITCH IS SET TO OFF. MAINTENANCE SHOULD BE PERFORMED ONLY BY SERVICE-TRAINED PERSONNEL WHO ARE AWARE OF THE HAZARDS INVOLVED (FOR EXAMPLE, FIRE AND ELECTRIC SHOCK). WHERE MAINTENANCE CAN BE PERFORMED WITHOUT POWER APPLIED, THE POWER CORD SHOULD BE REMOVED.

4-5. RECOMMENDED TEST EQUIPMENT

4-6 Test equipment required for the performance tests and calibration procedures are included in the procedures Detailed critical specifications for the required test equipment are contained in Table 1-4, Recommended Test Equipment. Any equipment that satisfies the critical specifications given in the table may be substituted for the recommended model(s).

4-7. TEST RECORD

4-8. Results of the performance tests and calibration procedures may be tabulated on the test record in Table 4-3.

4-9. 5528A PERFORMANCE TESTS

4-10. The Operator's Check listed in Section III can be used as a performance test of the 5528A System. The Operator's check is sufficient for incoming inspection and periodic and post repair verification. The results of the Operator's checks at incoming inspection can be used for comparison in periodic maintenance and troubleshooting.

4-11. 5508A PERFORMANCE TESTS

4-12. The 5508A self-test that is automatically performed at power-up extensively checks the following 5508A circuitry:

a. Read-Only Memory

b. Read/Write Memory

c. Measurement and Reference Signal Counter Circuits

d. A/D Converter Subsystem

4-13. Refer to Paragraph 3-28, Self-Test and Warm-Up Countdown, to verify proper self-test execution.

4-14. 5518A PERFORMANCE TESTS

4-15 The 5518A performance tests include a laser power output test and a measurement receiver gain test.

4-16 Laser Power Output Test

4-17. Test Equipment Required. The following test equipment is required to test the laser output power.

Laser Power Meter, Graseby Optronics, Model 351L (Phone 407 282-1408)

4-18. Procedure

a. Connect the 5508A to the 5518A using Interconnect cable HP Part Number 10793A/B/C. Connect one end to the 5508A rear panel jack marked LASER SOURCE, connect the other end to the 18-pin connector on the rear panel of the 5518A.

b. On the 5518A, set the turret to OTHER. Set the exit shutter of the turret assembly to its open aperture position.

c. On the 5508A, set the Line switch to ON and wait until the 5508A displays PA Error. If the 5508A fails self test or the warm-up countdown does not terminate with PA Error, see 5528A Block Diagram and System Troubleshooting in Section VIII.

d. Using the Laser Meter, align the power meter detector for maximum reading.

e. If the laser power output is less than 100 microwatts, see Laser High Voltage Troubleshooting in Section VIII-C.

f. Leave power applied and continue to the receiver gain test.

4-19. Receiver Gain Test

4-20. The receiver gain test should only be performed after the Laser Power Output Test, Paragraph 4-16, has been successfully completed.

4-21. Test Equipment Required. The following test equipment is required to test the receiver gain:

Retroreflector, HP Model 10767A
Optical Attenuator, HP Part Number 1000-0598

Additional Equipment for Convenience

Height Adjuster and Post, HP Model 10765A
Base, HP Model 10784A

4-22. Procedure

a. Position the 10767A Retroreflector in the beam path at a maximum distance of 6 inches from the laser turret assembly and align the return beam for maximum indication on the 5508A beam strength meter. Place a piece of white card stock in the return beam path. If there is a dark line in the beam rotate the 10767A 90°.

b. Remove the card stock. On the 5508A, press RESET.

c. The 5508A should display 0.00000 inches. If not, check the rear panel ENGLISH/METRIC switch position and see 5526A Block Diagram and Troubleshooting Procedure in Section VIII.

d. Place optical attenuator, HP Part Number 1000-0598 in either the exit or return laser beam path, but not both. Realign return beam for maximum reading on the beam strength meter. Observe that the SIGNAL LED remains lighted. If not, see Paragraph 5-11, Receiver Gain Adjustment.

4-23. 10751A/B AND 10757A/B/C PERFORMANCE TESTS

4-24. Performance Tests for the 10751A/B Air Sensor and the 10757A/B/C Material Temperature Sensor require the same equipment as is recommended for calibration. Tests for performance verification are described as part of the calibration procedure for each instrument.

4-25. CALIBRATION CYCLE

3

4-26. The 5526A System requires periodic calibration. The 5506A, 10751A/B, 10757A/B/C should be calibrated using the following procedures every 12 months or when required because of repair. The 5518A does not require calibration. It is recommended that the 10751A/B and 10757A/B/C be returned to Hewlett-Packard for calibration.

4-27. 5508A CALIBRATION PROCEDURES

NOTE

5508A calibration is only necessary for 5526A Systems that use the 10751A/B Air Sensor or the 10757A/B/C Material Temperature Sensor.

4-28. The calibration procedures for the 5508A consist of calibrating the +10V and +6.3V internal voltage references. These are performed with the 5518A, 10751A/B, and 10757A/B/C disconnected.

4-29. The 5508A Voltage References are used for Analog to Digital Conversion of the 10751A/B and 10757A/B/C signals. For detailed operation verification, an A/D accuracy test located in Section VIII can be used.

4-30. Test Equipment Required. The following test equipment is required for these procedures:

Digital Voltmeter, HP Model 3456A
Calibration Label, HP Part Number 7121-2013

4-31. Preliminary Procedures

NOTE

When calibrating the 5508A, the unit must be operated at an ambient temperature between 18°C and 27°C.

a. Set the 3456A Digital Voltmeter controls as follows:

FUNCTION to DC Volts

AUTO ZERO to ON

FILTER to OFF

N DIG DISP = 6 (provides 10 microvolt resolution during +10Vref calibration and 1 microvolt resolution during +0.5Vref calibration

N CYC INT = 10 (integration period = 10 power line cycles)

b. Remove the top cover of the 5508A.

CAUTION

Avoid finger contact with components and pc board in the vicinity of A3U65. Contamination may effect A/D Converter accuracy.

c. On the 5508A, set the LINE switch to ON and wait until the 5508A displays LASr FAIL. If the 5508A fails its self-test or the warm-up countdown does not terminate with LASr FAIL, check set-up and see 5328A Block Diagram and System Troubleshooting in Section VIII.

4-32. +10Vref Calibration Procedure

a. Connect positive lead of DVM to test point A3TP40, marked +10VR and the negative lead to test point A3TP39 marked AG, for Analog Ground on the 5508A A3 Board.

b. The voltage indicated on the DVM should be 10V ±10 millivolts. If not, check setup and see +10Vref Troubleshooting in Section VIII. Record the measured voltage on line 3, +10Vref, of the Test Record Table 4-3.

c. Using a calculator, compute the following.


$$(V - 9.999976) \times 12500$$

where V = voltage measured by the DVM

d. Round the calculated value to an integer and enter that number in binary form on the 8-bit switch A3S1 marked "CAL A" on the 5508A Counter Board A3. Refer to Table 4-1 for the binary value that corresponds to the decimal number obtained in the computation.

EXAMPLE

Assume the voltage read was 10.00500 Volts. Using the formula above (10.005 - 9.99976 × 12500 = 190.5. Round this off to 191. Converted to binary 191 equals 10111111. This binary value would be entered into A3S1 as shown.

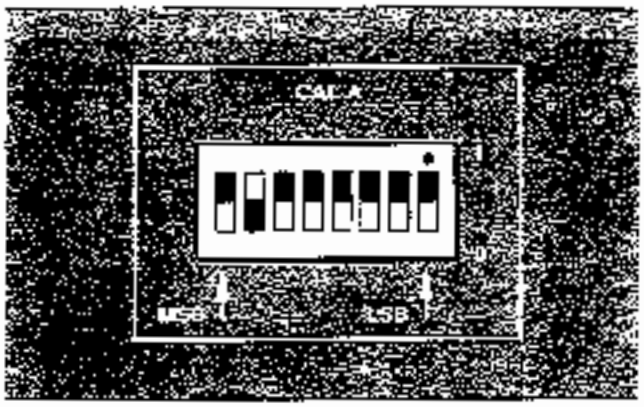

c. Enter value for CAL A (decimal) on calibration label and attach to the 5528A rear panel next to the serial number plate. The CAL A value can also be recorded on the Test Record, Table 4-3.

Table 4-1 Converting Decimal Numbers to Binary Format

Decimal	Binary	Decimal	Binary	Decimal	Binary	Decimal	Binary
0	00 000 000	30	00 011 110	60	00 111 100	90	01 011 010
1	00 000 001	31	00 011 111	61	00 111 101	91	01 011 011
2	00 000 010	32	00 100 000	62	00 111 110	92	01 011 100
3	00 000 011	33	00 100 001	63	00 111 111	93	01 011 101
4	00 000 100	34	00 100 010	64	01 000 000	94	01 011 110
5	00 000 101	35	00 100 011	65	01 000 001	95	01 011 111
6	00 000 110	36	00 100 100	66	01 000 010	96	01 100 000
7	00 000 111	37	00 100 101	67	01 000 011	97	01 100 001
8	00 001 000	38	00 100 110	68	01 000 100	98	01 100 010
9	00 001 001	39	00 100 111	69	01 000 101	99	01 100 011
10	00 001 010	40	00 101 000	70	01 000 110	100	01 100 100
11	00 001 011	41	00 101 001	71	01 000 111	101	01 100 101
12	00 001 100	42	00 101 010	72	01 001 000	102	01 100 110
13	00 001 101	43	00 101 011	73	01 001 001	103	01 100 111
14	00 001 110	44	00 101 100	74	01 001 010	104	01 101 000
15	00 001 111	45	00 101 101	75	01 001 011	105	01 101 001
16	00 010 000	46	00 101 110	76	01 001 100	106	01 101 010
17	00 010 001	47	00 101 111	77	01 001 101	107	01 101 011
18	00 010 010	48	00 110 000	78	01 001 110	108	01 101 100
19	00 010 011	49	00 110 001	79	01 001 111	109	01 101 101
20	00 010 100	50	00 110 010	80	01 010 000	110	01 101 110
21	00 010 101	51	00 110 011	81	01 010 001	111	01 101 111
22	00 010 110	52	00 110 100	82	01 010 010	112	01 110 000
23	00 010 111	53	00 110 101	83	01 010 011	113	01 110 001
24	00 011 000	54	00 110 110	84	01 010 100	114	01 110 010
25	00 011 001	55	00 110 111	85	01 010 101	115	01 110 011
26	00 011 010	56	00 111 000	86	01 010 110	116	01 110 100
27	00 011 011	57	00 111 001	87	01 010 111	117	01 110 101
28	00 011 100	58	00 111 010	88	01 011 000	118	01 110 110
29	00 011 101	59	00 111 011	89	01 011 001	119	01 110 111

(Continued)

Table 4-2. Converting Decimal Numbers to Binary Format (Continued)

Decimal	Binary	Decimal	Binary	Decimal	Binary	Decimal	Binary
120	01 111 000	154	10 011 010	188	10 111 100	222	11 011 110
121	01 111 001	155	10 011 011	189	10 111 101	223	11 011 111
122	01 111 010	156	10 011 100	190	10 111 110	224	11 100 000
123	01 111 011	157	10 011 101	191	10 111 111	225	11 100 001
124	01 111 100	158	10 011 110	192	11 000 000	226	11 100 010
125	01 111 101	159	10 011 111	193	11 000 001	227	11 100 011
126	01 111 110	160	10 100 000	194	11 000 010	228	11 100 100
127	01 111 111	161	10 100 001	195	11 000 011	229	11 100 101
128	10 000 000	162	10 100 010	196	11 000 100	230	11 100 110
129	10 000 001	163	10 100 011	197	11 000 101	231	11 100 111
130	10 000 010	164	10 100 100	198	11 000 110	232	11 101 000
131	10 000 011	165	10 100 101	199	11 000 111	233	11 101 001
132	10 000 100	166	10 100 110	200	11 001 000	234	11 101 010
133	10 000 101	167	10 100 111	201	11 001 001	235	11 101 011
134	10 000 110	168	10 101 000	202	11 001 010	236	11 101 100
135	10 000 111	169	10 101 001	203	11 001 011	237	11 101 101
136	10 001 000	170	10 101 010	204	11 001 100	238	11 101 110
137	10 001 001	171	10 101 011	205	11 001 101	239	11 101 111
138	10 001 010	172	10 101 100	206	11 001 110	240	11 110 000
139	10 001 011	173	10 101 101	207	11 001 111	241	11 110 001
140	10 001 100	174	10 101 110	208	11 010 000	242	11 110 010
141	10 001 101	175	10 101 111	209	11 010 001	243	11 110 011
142	10 001 110	176	10 110 000	210	11 010 010	244	11 110 100
143	10 001 111	177	10 110 001	211	11 010 011	245	11 110 101
144	10 010 000	178	10 110 010	212	11 010 100	246	11 110 110
145	10 010 001	179	10 110 011	213	11 010 101	247	11 110 111
146	10 010 010	180	10 110 100	214	11 010 110	248	11 111 000
147	10 010 011	181	10 110 101	215	11 010 111	249	11 111 001
148	10 010 100	182	10 110 110	216	11 011 000	250	11 111 010
149	10 010 101	183	10 110 111	217	11 011 001	251	11 111 011
150	10 010 110	184	10 111 000	218	11 011 010	252	11 111 100
151	10 010 111	185	10 111 001	219	11 011 011	253	11 111 101
152	10 011 000	186	10 111 010	220	11 011 100	254	11 111 110
153	10 011 001	187	10 111 011	221	11 011 101	255	11 111 111

4-33. +0.5Vref Calibration

4-34. The +0.5 Volt reference should only be calibrated after the +10 Volt reference calibration procedure has been properly completed.

4-35. Procedure

a. Move the positive lead of the DVM from +10Vref test point to A3U65 pin 36, +0.5Vref. The voltage indicated by the DVM should be equal to 0.5 Volt ±1.25 millivolts. If not check setup and see +0.5Vref Troubleshooting in Section VIII.

b. Note DVM reading of 0.5 Vref and find the reading, ±40 microvolts, in Table 4-2. Set the CAL B switches with the corresponding binary value. Enter the value for CAL B (decimal) on the TEST RECORD, Table 4-3.

EXAMPLE

Assume the DVM indicates 0.498835 Volt. From Table 4-2, 0.498800 Volt is the nearest value. The corresponding binary number, 00001, would be entered into the CAL B switches, part of A3S2, as shown below.

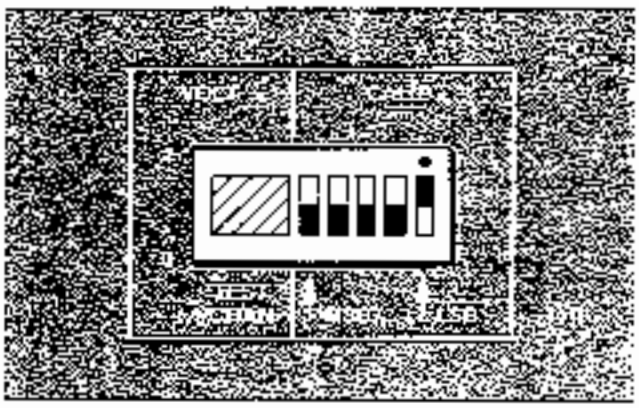


Table 4-2. +5.3 Vref Calibration Table

V (Volts)	Cal B (Decimal)	Cal B (Binary)
0.498720	0	00000
0.498800	1	00001
0.498880	2	00010
0.498960	3	00011
0.499040	4	00100
0.499120	5	00101
0.499200	6	00110
0.499280	7	00111
0.499360	8	01000
0.499440	9	01001
0.499520	10	01010
0.499600	11	01011
0.499680	12	01100
0.499760	13	01101
0.499840	14	01110
0.499920	15	01111
0.500000	16	10000
0.500080	17	10001
0.500160	18	10010
0.500240	19	10011
0.500320	20	10100
0.500400	21	10101
0.500480	22	10110
0.500560	23	10111
0.500640	24	11000
0.500720	25	11001
0.500800	26	11010
0.500880	27	11011
0.500960	28	11100
0.501040	29	11101
0.501120	30	11110
0.501200	31	11111

NOTE

The 5508A reads the calibration switches only at power-up, therefore, calibration switch changes will not affect 5508A operation until A.C. power has been cycled and the 5508A executes its self-test. Alternatively, the 5508A MASTER RESET, A2S2, can be toggled to cause the 5508A to read the new switch settings without turning power off.

4-36. 10751A CALIBRATION PROCEDURES

4-37. Due to the complexity of the calibration procedures and the test equipment required, it is recommended that the 10751A/B be returned to Hewlett-Packard for calibration.

4-38. The 10751A/B Pressure and Temperature circuitry both require a 12 month calibration cycle. Also calibration should be performed after repair is made to any of the 10751A/B circuits except the humidity switch circuit.

4-39. Equipment Required. Refer to Table 1-4 in Section I for a list of test equipment required for the 10751A/B calibration procedures. In addition, the procedures require the 5500A Measurement Display and a HP 3456A Digital Voltmeter. Also for convenience, the following additional equipment is recommended:

Accessories for Temperature Calibration

*Extender Cable, (10751-60201/60202 to 10751-60001)
*Extender Cable, (10751-60003 to 10751-60002)

Accessories for Pressure Calibration

*Extender Cable, (10751-60201/60202 to 10751-60001)
*Adaptor, (1/4 inch I.D. Pneumatic Hose to 10751A/B Pressure Transducer)

*These items are available from HP by ordering Model #K16-59295A

WARNING

MAINTENANCE DESCRIBED HEREIN IS PERFORMED WITH POWER SUPPLIED TO THE INSTRUMENT, AND PROTECTIVE COVERS REMOVED. 100 VOLTS TO 240 VOLTS AC MAY BE PRESENT IN THE 5500A EVEN WHEN THE FRONT PANEL POWER SWITCH IS SET TO OFF. MAINTENANCE SHOULD BE PERFORMED ONLY BY SERVICE-TRAINED PERSONNEL WHO ARE AWARE OF THE HAZARDS INVOLVED (FOR EXAMPLE, FIRE AND ELECTRIC SHOCK). WHERE MAINTENANCE CAN BE PERFORMED WITHOUT POWER APPLIED, THE POWER CORD SHOULD BE REMOVED.

CAUTION

The 10751A/B circuitry is susceptible to damage from electrostatic discharge, therefore use an anti-static work station and ground straps when handling printed circuit assemblies during assembly or disassembly.

4-40. Temperature Calibration Procedure

4-41. The air temperature transducer calibration is performed with the temperature transducer assembly, 10751-60002, immersed in a temperature controlled bath at 20°C ±1°C.

NOTE

The 10751-60002 should only be immersed in dielectric liquid, Flourinet FC-40 or equivalent. The 10751-60002 should not be immersed in water.

4-42. The equipment in Table 1-4 should be configured to form the system depicted in Figure 4-1.

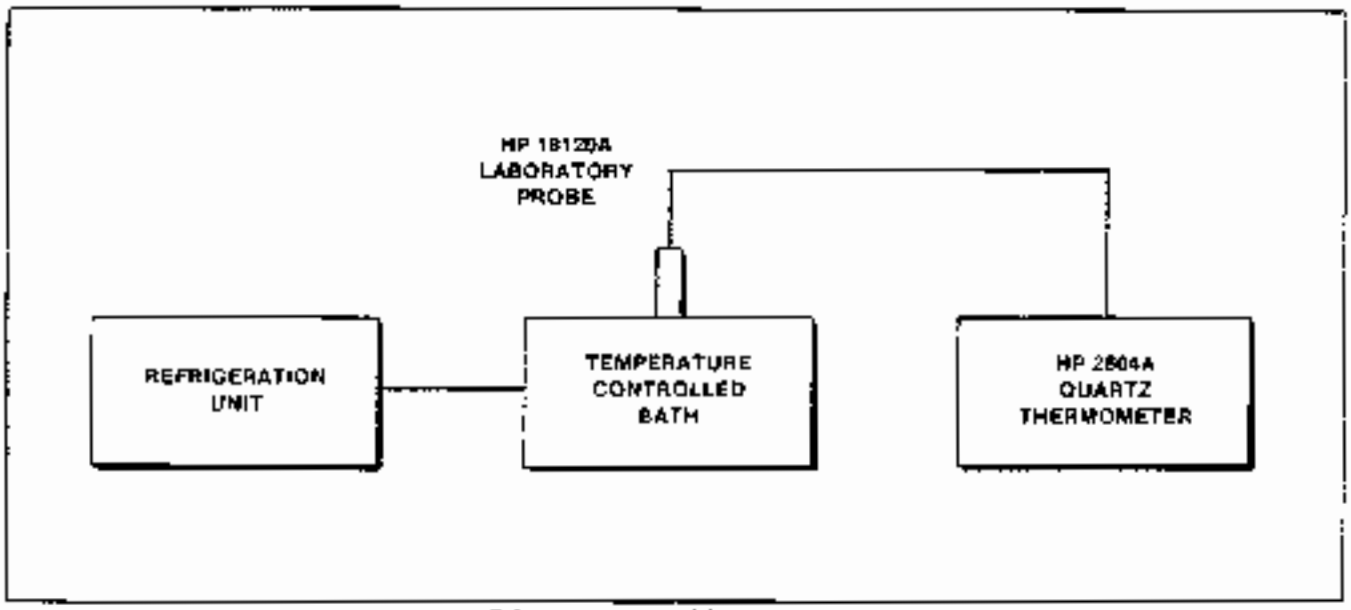


Figure 4-1. 10751A/B Temperature Calibration Test System Configuration

a. On the 10751A/B, remove the label on the humidity switch side of the housing

b. Remove the pozi-drive screws located beneath the label.

c. Carefully remove the 10752A/B cover noting how the printed circuit boards are mounted between the cover and the cable assembly.

d. Detach the 10751 60001 board from the cable assembly. Check that the key is inserted in the unused contact at the cable assembly connector corresponding to the missing pin on the 10751-60001 plug.

e. Inspect cable and connectors for damage.

f. Install extension cable HP Part Number 10751-60204 between cable assembly and 10751-60001.

g. Secure 10751-60001 such that power can be applied and the TEMP potentiometer, A1R1, can be adjusted.

h. Install extension cable HP Part Number 10751-60203 between 10751-60001 board and 10751-60002 board.

i. Immerse 10751-60002 board in the bath in close proximity to the quartz thermometer probe without resting either on the inside of the bath housing.

j. Connect 10751 cable assembly to 5508A rear panel connector marked AIR SENSOR.

k. On the 5508A rear panel, set the ENGLISH/METRIC switch to METRIC.

l. Connect the positive lead of the DVM to test point A3TP40, marked +10VR, and the negative lead to test point A3TP39 marked AG, for Analog Ground on the 5508A A3 Board

m. Plug 5508A into AC outlet and set the LINE switch to ON.

n. Wait until the 5508A goes through its warm-up countdown sequence and the display flashes LASr FAIL. If the 5508A fails its self test or the warm-up countdown does not end with LASr FAIL, check setup and see 5528A Block Diagram and System Troubleshooting in Section VIII.

o. Monitor the quartz thermometer to be sure that the bath temperature is stable at 20°C ± 1°C to within 0.03°C for a 1 minute period.

p. Note the value of +10Vref indicated by the DVM. The measured value should be +10V ± 10 millivolts. If not, check set-up and see −10Vref Troubleshooting in Section VIII. Record the value of +10Vref for use in step r.

q. Connect floating negative terminal of DVM to test point TP39, marked AG on 5508A A3 and positive terminal of DVM to pin 5 of A3R56.

r. Note the reading of the quartz thermometer (in °C) and calculate the adjustment voltage, V, as follows:

$$V = 0.67502 - (0.0035 \times T) - dV$$

where: T is the reading of the quartz thermometer and dV = +10Vref-10.


s. Adjust TEMP potentiometer, A1R1, such that the DVM reading equals V from step r ±250 microvolt.

t. The accuracy of the 10751A/B temperature measurement can be checked using the quartz thermometer and stable bath temperatures within the operating range of the 10751A/B, 0 to 40°C.

Procedure

1 Perform the 5508A Calibration Procedures, Paragraph 4-27 through 4-35.

2 Set 5508A Test Switches A2S3 to 0101 0000 and toggle the 5508A Master Reset switch A2S2.

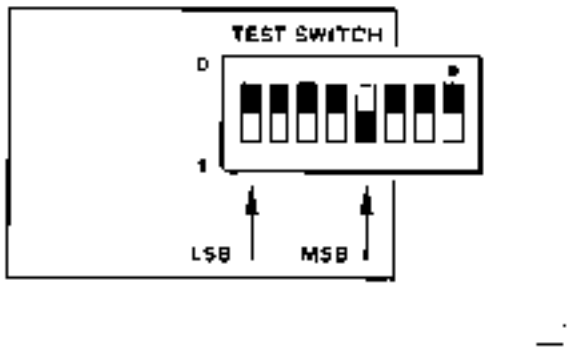

3. Press V.O L. twice on 5508A front panel to display.

E XX.XX C

where XX.XX is the temperature measured by the 10751A/B temperature transducer.

4. The bath temperature can now be adjusted to various temperatures within the range of 0 to 40°C in order to verify temperature measurement specifications of the 10751A/B. The reading of the quartz thermometer should be allowed to stabilize at each selected temperature to within ±0.03°C for 1 minute before comparing the reading to that on the 5508A display. An offset of +0.78°C should be added to the 5508A display for comparison purposes. Adding this offset corrects for the fact that bath temperature instead of air temperature is being measured by the 10751A/B temperature sensor.

5. If any reading within the operating range indicates measurement error outside the accuracy specification of the 10751A/B, the temperature transducer assembly, 10751 60002, should be replaced and the calibration procedure repeated.

u. Turn 5500A AC power off.

v. Remove 10751-60002 from the bath and allow to dry.

w. Disconnect 10751A/B and reassemble or continue with pressure calibration.

4-43. Air Pressure Calibration Procedure

4-44. The equipment listed in Table 1-4 should be configured to form the system depicted in Figure 4-2.

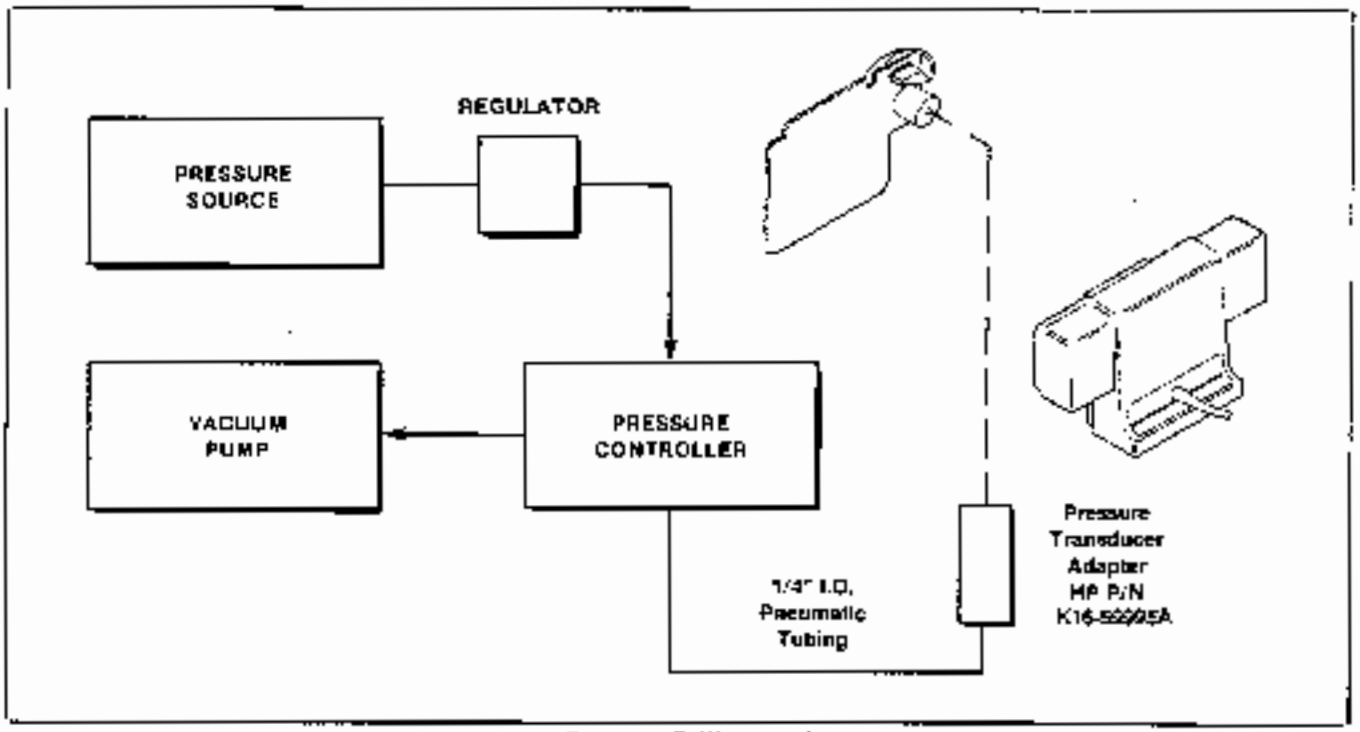


Figure 4-2. 10751A/B Air Pressure Calibration Test System Configuration

a. On the 10751A/B, remove the label on the humidity switch side.

b. Remove the pozi-drive screws located beneath the label.

c. Carefully remove the 10751A/B cover noting how the printed circuit boards are mounted between the cover and the cable assembly.

d. Detach cable assembly from the 10751-60001 board. Check that the key is inserted in the unused contact of the cable assembly corresponding to the missing pin on the 10751-60001 connector.

e. Inspect cable and connectors for damage.

f. Install extension cable HP Part Number 10751-60204 between cable assembly and 10751-60001.

CAUTION

Do not expose the 10751A/B Air Pressure Transducer A2U1 to pressures outside its operating range 517 to 776.5 mm Hg.

g. Secure the 10751-60001 board such that power can be applied and the GAIN and OFFSET jumpers can be adjusted.

h. On the 10751-60001 board, turn GAIN potentiometer, A1R8, fully clockwise. Set the pressure calibration GAIN jumpers to the position shown below.



i. Attach pressure controller to 10751A/B pressure transducer, 10751-60303, using Adaptor, HP Part Number 10751-20005 and 1/4 inch I.D. pneumatic tubing.

NOTE

The pressure transducer cylinder axis must be horizontal during calibration.

j. Attach 10751A/B to 5508A rear panel connector marked AIR SENSOR.

k. On 5508A rear panel, Set ENGLISH/METRIC switch to METRIC.

l. Remove 5508A top cover.

m. Connect the 5508A power cable to an AC main and set the LINE switch to ON.

n. Connect floating negative terminal of the DVM to test point, A3TP89, marked AG on 5508A A3. Connect positive terminal of DVM to A3R56 pin 3.

o. Wait for 30 minutes with power applied to the 5508A and 10751A/B.

NOTE

Steps p through s are to be performed for each GAIN jumper in descending order. At this time the MSB jumper should already be set to 2 and all others to 0.

p. Set pressure controller such that pressure applied to 10751A/B pressure transducer is 517 mm Hg ±0.1 mm Hg and write down the voltage indicated by the 3456A. This voltage will be referred to as Vap[517] in step r.

q. Set pressure controller to 775.5 ±0.1 mm Hg and write down the voltage indicated by the 3456A. This voltage will be referred to as Vap(775.5) in step r.

r. If Vap(517) - Vap(775.5) >1.0106 Volts, then leave the jumper at 1.

If Vap[517] - Vap[775.5] <1.0106 Volts, then set the jumper from 1 to 0.

s. Place next GAIN jumper to 2 from 0.

t. Repeat steps p through s for each GAIN jumper.

u. Adjust GAIN potentiometer A1R8 such that

Vap(517) - Vap(775.5) = 1.0106 Volts ±200 microvolts


v. Adjust OFFSET jumpers such that Vap = 0.0000 V ±200 microvolts at a controller pressure of 700.2 ±0.1 mm Hg.

w. The 10751A/B pressure measurement accuracy can be verified by using the pressure controller to check the 10751A/B pressure measurement within the operating range of the 10751A/B, 517 to 775.5 mm Hg.

Procedure

1. Perform the 5508A Calibration Procedures, Paragraph 4-27 through 4-35.

2. Set 5508A Test Switches A2S3 to 0001 0000 and toggle the 5508A Master Reset switch A2S2.

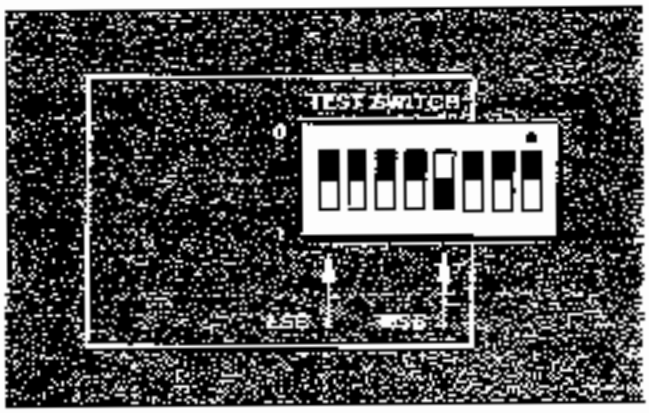

The 5508A display should read 0.0000 mm. If not check A2S3 switch setting and see 5528A Block Diagram and System Troubleshooting.

3. On 5508A, press V.O.L 0 times to display

P XX.XX

where XX.XX is the pressure measured by the 10751A/B in mm of Hg.

4. The pressure controller can now be adjusted to various pressures within the range of 517 to 775.5 mm Hg in order to verify pressure measurement specifications of the 10751A/B

5. If any reading within the operating range indicates measurement error outside the accuracy specification of the 10751A/B, the pressure transducer assembly, HP Part Number 10751-60303 should be replaced and the calibration procedure repeated.

x. Turn 5508A AC power off.

y. Disconnect the test setup and reassemble the 10751A/B.

4-45. 10757A/B/C CALIBRATION MATCHING PROCEDURES

4-46. This procedure tailors the output characteristics of the 10757A/B/C Material Temperature Sensor to exactly match a particular 5508A Measurement Display. This allows an improvement in material temperature measurement accuracy to 0.1°C over an operating range of 0°C to 40°C. To adjust the sensors, proceed as follows:

a. Remove the four screws holding the two case halves together. Carefully separate the two case halves, leaving the printed circuit board and cable boots in place in the bottom half (see Figure 6-11).

b. Remove DIP jumper J81 and replace with a jumper HP Part Number 1810-0520.

c. Connect the 5508A (to which the 10757A/B/C is to be matched) to primary ac power. Set the LINE switch to ON and observe the 5508A display for the CAL A number. The display will appear as "CAL A xxx", where xxx is the CAL A number. Record this number for use in the next step. Set the 5508A LINE switch to OFF.

d. Referring to Table 4-1, find the binary equivalent of the CAL A number determined in step c. This binary number will be entered into the 10757A/B/C's calibration match DIP jumper.

e. Starting with the most significant digit (MSB), punch out each portion of the DIP jumper which corresponds to a "1" in the binary CAL A number.

EXAMPLE

If CAL A was 78 (01 001 110 binary), the cal match DIP jumper should appear as follows after punching the appropriate holes.

U
P
U
U
P
P where U is an unpunched conductor and
P P is a punched (broken) conductor.
U

f. Replace the top case cover and install the four case screws. Using a permanent marking pen, record the CAL A value on the calibration label.

g. Repeat the calibration match process for other 10757A/B/C's to be used with the same 5508A Measurement Display.

4-47. 10757A/B/C CALIBRATION PROCEDURES

4-48. Due to the complexity of the calibration procedures and test equipment required, it is recommended that the 10757A/B/C be returned to Hewlett-Packard for periodic calibration.

4-49. The 10757A/B/C temperature circuitry requires a 12 month calibration cycle. Also calibration should be performed after repair is made to any of the 10757A/B/C circuits.

4-50. Equipment Required. Refer to Table 1-4 in Section I for a list of test equipment required for the 10757A/B/C calibration procedures. In addition, the procedures require the 5508A Measurement Display and an HP 3456A Digital Voltmeter. If a 2804A Quartz Thermometer is used, it should have been checked at ice point within the previous 3 months. Glass thermometers should be checked at ice point just prior to performing the instrument calibration.

WARNING

MAINTENANCE DESCRIBED HEREIN IS PERFORMED WITH POWER SUPPLIED TO THE INSTRUMENT, AND PROTECTIVE COVERS REMOVED. 100 VOLTS TO 240 VOLTS AC MAY BE PRESENT IN THE 5508A EVEN WHEN THE FRONT PANEL POWER SWITCH IS SET TO OFF. MAINTENANCE SHOULD BE PERFORMED ONLY BY SERVICE-TRAINED PERSONNEL WHO ARE AWARE OF THE HAZARDS INVOLVED (FOR EXAMPLE, FIRE AND ELECTRIC SHOCK). WHERE MAINTENANCE CAN BE PERFORMED WITHOUT POWER APPLIED, THE POWER CORD SHOULD BE REMOVED.

CAUTION

The 10757A/B/C circuitry is susceptible to damage from electrostatic discharge, therefore use an anti-static work station and ground straps when handling printed circuit assemblies during assembly or disassembly.

NOTE

The 10757A/B/C temperature sensor should only be immersed in dielectric liquid, Fluorinert FC-40 or equivalent. The sensor should not be immersed in water.

4-51. The equipment in Table 4-1 should be configured to form the system depicted in Figure 4-1.

a. Remove the four screws on the 10757A/B/C enclosure.

b. Remove the 10757A/B/C cover noting how the printed circuit board is mounted.

c. Inspect cable and connectors for damage.

d. Secure 10757-60001 circuit board into one case half such that power can be applied and potentiometer A1R1 and A1R6 can be adjusted.

e. Immerse the sensor head into the bath in close proximity to the quartz thermometer probe without resting either on the inside of the bath housing.

f. Connect 10757A/B/C cable assembly to 5508A rear panel connector marked MATERIAL TEMPERATURE 1.

g. On the 5500A rear panel, set the ENGLISH/METRIC switch to METRIC.

h. Plug 5500A into AC outlet and set the LINE switch to ON.

i. Wait 10 minutes until 5500A goes through its warm-up countdown sequence and the display flashes LASr FAIL. If the 5500A fails its self-test or the warm-up countdown does not end with LASr FAIL, check setup and see 5528A Block Diagram and System Troubleshooting, in Section VIII.

j. Replace cal match jumper JB1 with a new jumper. HP Part Number 1810-0520. Punch one conductor to match the jumper to the following diagram.

P where P is a punched (broken) conductor and
U U is an unpunched conductor.
U
U
U
U
U
U
U

k. Set bath temperature to 0°C ±1°C. Place the thermometer and 0757A/B/C sensor cable end in close proximity in bath away from bath walls.

l. Allow bath to stabilize for an additional 20 minutes after the bath temperature has reached 0°C ±1°C.

m. Connect DVM + and – leads to TP1 and TP2, respectively. Note DVM reading (this reading will be referred to as V_0). Note thermometer reading (this reading will be referred to as T_0).

n. Set bath temperature to 40°C ±3°C. Allow bath to stabilize for an additional 20 minutes after the bath reaches 40°C ±3°C.

o. Read DVM (this reading will be called V_{40}). Note thermometer reading (this reading will be called T_{40}).

p. Next, calculate the adjustment voltage V_{A1}:

$$V_{A1} = V_{40} + \left[(145.2 - T_{40}) \times \left(\frac{V_{40} - V_0}{T_{40} - T_0} + 0.0335 \right) \right]$$

q. Adjust the gain trimport A1R6 until the DVM reads this voltage.

r. Again note the 2804A reading (new T_{40}). Calculate V_{A2}:

$$V_{A2} = -0.0335 (T_{40} - 25.36)$$


s. Adjust the offset trimport A1R1, and if necessary the coarse offset adjustment jumper S1, until the DVM reads V_{A2}.

t. The accuracy of the calibration may be checked, if desired, by performing a calibration match to the 5500A using during testing (see Paragraph 4-45) and adjusting the bath temperature over the 0°C to 40°C operating range.

Procedure:

1. Perform the 5508A Calibration, Paragraphs 4-27 through 4-35.

2. Set 5508A Test Switch A2S3 to 0001 0000 and toggle the 5508A Master Reset switch A2S2.

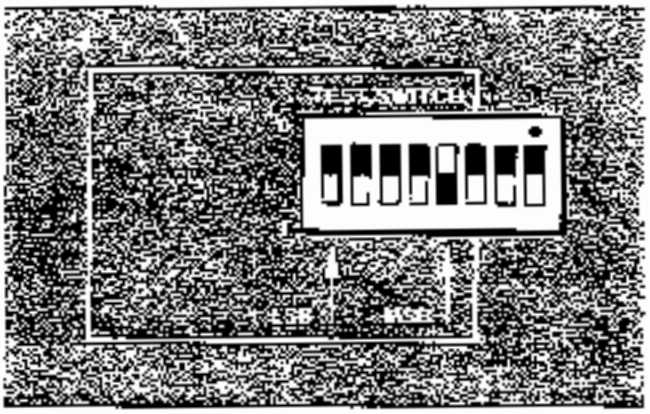

The 5508A display should read 0.0000 mm, if not, check A2S3 setting and see 5528A Block Diagram and System Troubleshooting

3. On 5508A, press MATL TEMP twice on 5508A front panel to display

t XX.XX C

where XX.XX is the temperature measured by the 10757A/B/C.

4. Perform the calibration matching procedure (see Paragraph 4-45) to adjust the 10757A/B/C sensor for the 5500A Measurement Display in use.

5. The bath temperature can now be adjusted to various temperatures within the range of 0°C to 40°C in order to verify temperature measurement specifications of the 10757A/B/C. The reading of the thermometer should be allowed to stabilize at each selected temperature to within ±0.03°C for 10 minutes before comparing the reading to that on the 5500A Measurement Display.

If any reading within the operating range indicates measurement error outside the accuracy specification of the 10757A/B/C, the Temperature Sensor Assembly (see Figure 6-12) should be replaced and the calibration procedure repeated.

6. Turn 5500A AC power off.

7. Remove 10757A/B/C temperature sensor from the bath and allow to dry.

8. Reassemble 10757A/B/C.

Table 4-3 Test Record

	Test or Calibration	Date/Entry	Date/Entry
1.	5518A Laser Power Output Test	____/____	____/____
2.	5518A Receiver Gain Test	____/____	____/____
3.	5508A +10V_{ref}	____/____	____/____
4.	CAL A (decimal)	____/____	____/
5.	5508A +0.5V_{ref}	____/____	____/____
6.	CAL B (decimal)	____/____	____/____
7.	10751A/B Calibration	____/____	____/____
8.	10757A/B/C Calibration	____/____	____/____

4-52. HP-IB DIAGNOSTICS

4-53. The following paragraphs present diagnostic tests to verify proper operation of the 5508A HP-IB. Two methods are presented, the first gives several short programs that can be quickly entered into an HP 85 Controller to check if the HP 85 can control the 5508A using the HP-IB. The second method consists of an extensive check of the program codes and may be entered into the HP 85 then stored on a tape cartridge for future use.

4-54 The diagnostic checks require the following equipment:

a HP 85 Computer with HP 82937A HP-IB Interface.

b HP 82936A ROM Drawer.

c. HP 82903A 16K Memory Module.

d. HP 5508A Measurement Display.

e. HP 10751A/B Air Sensor.

f. HP 10757A/B/C Material Temperature Sensor.

4-55. Quick Diagnostic Checks

4-55. To run these checks, proceed as follows:


a. On the 5508A, set LINE switch to OFF.

b. Using the HP 82937A Interface Cable, connect the large connector to the HP 85. Connect the other connector (24 pin) of the HP 82937A to the 5508A Connector marked IEEE STD 488 PORT.

c. Connect the HP 10751A/B to the 5508A rear panel jack marked AIR SENSOR.

d. Connect HP 10757A/B/C to the 5508A rear panel jack marked MATERIAL TEMPERATURE 1

e. Refer to Paragraph 3-62 and set the HP-IB address to 03. Also while the top cover is off, set the TEST SWITCH on A2 as shown below

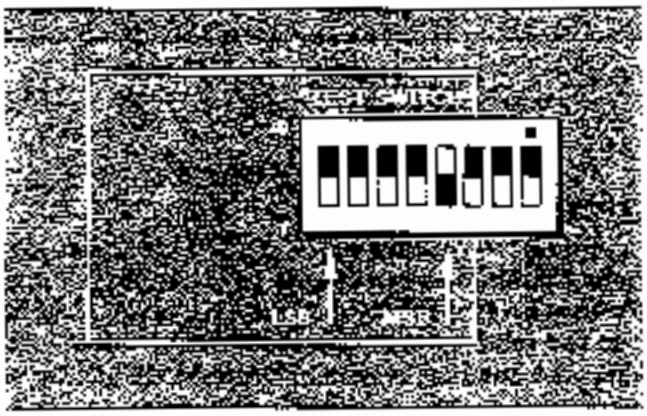

f. Apply power to the 5508A and toggle the MASTER RESET switch on A2.

g. Type the following program into the HP 85. The program may be stored on the tape cartridge by typing STORE "TESTA" then END LINE.

********** TESTA **********

```
10 REM :TESTA

20 OUTPUT 703 USING "K" ; "UET1"

30 OUTPUT 703 USING "K" ; "RC"

40 ENTER 703 ; A$
```

Send program codes "UE" and "T1" to 5508A. This configures the 5508A to English units and loads T1 data into the output buffer.

Send program code "RC" to trigger 5508A to send the data back to the HP 85.

Enter the data into string variable A$.

(Continued)

```
50 PRINT "MATERIAL SENSOR TEMP
   IS:";A$;" DEGREES F"
```

On the HP 85 printer, print the information in quotes and the data in A$.

```
60 END
```

h. On the 5508A front panel, press RESET.

i. On the 5508A, press RUN. The 5508A display should read the temperature of Material Temperature Sensor 1 and a printout similar to that shown below should appear on the HP 85 printer.

```
MATERIAL SENSOR TEMP IS:
   77.633 DEGREES F
```

j. Repeat the procedure for the following tests. TEST8 through TESTH.

********** **TEST8** **********

```
10 REM : TEST8
```

```
20 OUTPUT 703 USING "K" ; "AP"
```

5508A loads air pressure data into the output buffer.

```
30 OUTPUT 703 USING "K" ; "PC"
```

Trigger 5508A to send measurement back to HP 85.

```
40 ENTER 703 ; A$
```

Enter data into A$.

```
50 PRINT "AIR PRESSURE IS:
      ";A$;" INCHES HG"
```

Print air pressure measurement.

```
60 END
```

HP 85 PRINTOUT

```
AIR PRESSURE IS:
   29.93 INCHES HG
```

```
********** TESTC **********
```

```
10 REM :TESTC
```

```
20 OUTPUT 703 USING "K" ; "AH"
```

5508A loads air humidity data into the output buffer.

```
30 TRIGGER 703
```

Alternate method to command 5508A to send data to HP 85.

```
40 ENTER 703 ; A$
```

Enter data into A$.

```
50 PRINT "THE HUMIDITY SWITCH O
   N 10751A IS SET TO:";A$
```

Print the air humidity switch setting.

```
60 END
```

HP 85 PRINTOUT

```
THE HUMIDITY SWITCH ON 10751A IS
 SET TO:      50,
```

```
********** TESTD **********
```

```
10 REM :TESTD
```

```
20 DATA "UEAT","F","UMAT","C"
```

Establishes data to be read by lines 40 and 80. "UEAT" and "F" will be used to load english air temp into the output buffer. "UMAT" and "C" makes a metric measurement.

```
*30 FOR I=1 TO 2
```

```
*40 READ B$
```

Read from line 20 and assign to B$. When I = 1, B$ = "UEAT" from line 20, when I = 2, B$ = "UMAT".

(Continued)

```
* 50 OUTPUT 703 USING "K" ; B$
```

Command 5508A to assume the program code in B$. When I = 1, B$ = "UEAT", when I = 2, B$ = "UMAT".

```
* 60 TRIGGER 703
```

```
* 70 ENTER 703 ; A$
```

```
* 80 READ C$
```

Read from line 20 and assign to C$. When I = 1, C$ = F, when I = 2, C$ = C".

```
* 90 PRINT "10751A AIR TEMP IS:
          ";A$;" DEGREES ";C$
```

Print air temperature in degrees F when I = 1, in degrees C when I = 2.

```
*100 NEXT I
```

```
 110 END
```

* For-next loop

HP 85 PRINTOUT

```
10751A AIR TEMP IS:
       82.52 DEGREES F
10751A AIR TEMP IS:
       28.06 DEGREES C
```

********** TESTE **********

```
  10 REM *TESTE
```

```
  20 A=0
```

Set variable = 0

```
  30 OUTPUT 703 USING "K" ; "UE"
```

Command 5508A to English mode.

(Continued)

```
* 40 DATA "10P1UE","inches","10P1
   UM","mm"
```

Data to read by lines 60 and 100.

```
* 50 FOR I=1 TO 2

* 60 READ B$

* 70 OUTPUT 703 USING "K" , B$

* 80 TRIGGER 703

* 90 ENTER 703 ; A$

*100 READ C$

*110 A=A+1
```

Increment A by 1.

```
*120 IF A>1 THEN GOTO 140
```

Prints preset distance in English units when A = 1. Prints in Metric units when A = 2.

```
*130 PRINT "DISTANCE IS PRESET TO
     :    ";A$;"    ";C$

*140 IF A>1 THEN PRINT "
          OK          ";A$;"    ";C$
```

(Continued)

```
*150 NEXT I

*160 END
```

* For-next loop

HP 85 PRINTOUT

```
'DISTANCE IS PRESET TO:
10.00000 inches
OR
254.0000 mm
```

```
********************************** TESTF **********************************
*10 REM :TESTF

*20 DATA "5P1","10P1","15P1","20
    P1","25P1"
```

Data to be used in line 40.

```
*30 FOR I=1 TO 5

*40 READ N$

*50 OUTPUT 703 USING "K" ; N$

*60 TRIGGER 703

*70 ENTER 703 ; A$
```

(Continued)

```
* 80 PRINT A$



* 90 NEXT I



100 END
```

*For-next loop will loop 5 times to read 5 items in line 20.

HP 85 PRINTOUT

```
 5.0000
10.0000
15.0000
20.0000
25.0000
```

**********TESTG**********

```
 10 REM :TESTG



 20 DATA "1R11.1P1","2R12.22P1",
    "3R13.333P1","4R14.4444P1","
    5R15.55555P1","6R16.666666P1
    "
```

Data to be used by line 4.

```
 30 FOR I=1 TO 6



 40 READ N$



 50 OUTPUT 703 USING "K" : N$
```

(Continued)

```
60 TRIGGER 703

70 ENTER 703 , A$

80 PRINT A$

90 WAIT 1000

100 NEXT I

110 END
```

Pause approximately 1 second so operator can read 5508A display.

HP 85 PRINTOUT

```
 1.1
2.22
3.333
4.4444
5.55555
0 ERROR
```

Occurs if 5508A is in metric and an attempt is made to preset the measurement to six places beyond the decimal point.

```
********************************* TESTH *********************************
```

Same test as "TESTG" except line 20 sets 5508A to English units so no error occurs for last data item ("6's").

```
  10 REM  TESTH

  20 OUTPUT 703 USING "K" ; "UE"

  30 DATA "1R11.1F1","2R12.22PI",
     "3R13.333P1","4R14.4444P1","
     5R15.55555P1","6R16.666666P1
     "

  40 FOR I=1 TO 6

  50 READ N$

  60 OUTPUT 703 USING "K" ; N$

  70 TRIGGER 703

  80 ENTER 703 ; A$

  90 PRINT A$

 100 WAIT 1000
```

(Continued)

```
110 NEXT I



120 END
```

HP 85 PRINTOUT

```
1.1
2.22
3.333
4.4444
5.55555
6.666666
```

Corrected by line 20.

4-57. Instrument Function Codes Diagnostic

4-58. This test performs the following:

a. Sends instrument function codes from the HP 85 to the 5508A. This configures the 5508A into a particular mode with a corresponding measurement. For example, when code T3 is sent the 5508A is configured to measure the temperature of Material Temperature Sensor No. 3. Note that when a sensor is disconnected, the "measurement" is "999999999".

b. Triggers the 5508A to send the measurement data to the HP 85.

c. Compares the received data to expected data. The expected data is written into the program. If the received data is the same as the expected data, the test continues to the next code to be tested. If all tests pass, a message to that effect is printed on the HP 85. If the data does not compare properly, a fail test message is printed along with the received data and the expected data, then the program halts.

4-59. To run this test, connect the equipment as described in paragraph 4-56 except DO NOT connect the Air or Material Sensors. The sensors are not used so that known data (999999999.) will be returned to the controller. Set the HP-IB address switch and the A2 TEST switch as described in paragraph 4-56e.

a. Type the following program into the HP 85. After entry, the program may be stored on a tape cartridge for future use by typing STORE "HPTEST".

b. On the 5508A front panel, press RESET.

c. On the HP 85, press RUN and follow the instructions on the HP 85 display. If all tests pass, the printout will be the same as shown below.

d. The results of a failed test may be observed by connecting an Air Sensor or a Material Temperature Sensor to the 5508A. With a sensor connected, the 5508A will return a measured sensor value instead of the expected "999999999." (the data returned for a disconnected probe).

PRINTOUT FOR A SUCCESSFUL DIAGNOSTIC

```
5508A HP-IB DIAGNOSTIC
DATE:  JULY 12 1983

PROG CODE   RCVD DATA  EXPECT DATA
   M1      1.00000      1.00000
   M2          1.0          1.0
   5P1P1      5.00000      5.00000
   7P2P2          7.0          7.0
   2P3P3     2.000000     2.000000
   2P4P4     2.000000     2.000000
   2P5P5     2.000000     2.000000
   1R1R1           1.           1.
   2R2R2           2.           2.
   1R3R3           1.           1.
   4R4R4           4.           4.
   5R5R5           5.           5.
   2ECEC          2.0          2.0
   T1   999999999.   999999999.
   T2   999999999.   999999999.
   T3   999999999.   999999999.
   TA       68.000       68.000
   AP   999999999.   999999999.
   AH   999999999.   999999999.
   AT   999999999.   999999999.
   VL        720.8        720.8
   UMAT  999999999.   999999999.

ALL TESTS PASSED
```

********** HPTEST **********

```
10 REM =HPTEST

20 DISP "ENTER DATE (MONTH DAY
   YEAR) USE NO COMMAS PRESS EN
   D LINE" @ INPUT D$

30 PRINT "5508A HP-IB DIAGNOSTI
   C" @ PRINT "DATE:  ";D$

40 DISP "PRINT DATA? Y=YES N=NO
    PRESS END LINE" @ PRINT ""

50 INPUT W$
```

@ sign allows multi-statement lines. Input D$ stops the program requiring a keyboard input in this instance, the date.

Prints date entered in 20.

Allows user to select data printed or no data.

W$ will be equal to Y or N for future use.

(Continued)

```
60 OUTPUT 703 USING "K" ; "UE";
   "RS";"1P1";"1P2";"1P3";"1P4"
   ;"1P5";"5R1";"1R2";"0R3";"4R
   4"
```

Initial program codes to configure 5508A to proper values before running test.

```
70 OUTPUT 703 USING "K" ; "5R5"
   ;"0EC";"728 8VL";"68TA"
```

Data values to be used during test. See typing aid following this program listing to help typing in the blank spaces before the numbers.

```
80 DATA "M1","      1.00000","M2
   ","          1.0","5P1P1","
     5.00000","7P2P2","
    7.0"
```

```
90 DATA "2P3P3","    2.000000",
   "2P4P4","    2.000000","2P5P
   5","    2.000000","1R1R1"
```

```
100 DATA "          1.","2R2R2",
    "         2.","1R3R3","
        1.","4R4R4","
     4."
```

```
110 DATA "5R5R5","          5 ",
    "2ECEC","          2.0","T1",
    "  999999999.","T2","  99999
    9999."
```

```
120 DATA "T3","  999999999.","TA
    ","      68.000","AP","  999
    999999.","AH","  999999999."
```

```
130 DATA "AT","  999999999.","VL
    ","      728.8","UMAT","  9
    99999999."
```

(Continued)

*140 FOR I=1 TO 22 @ READ N$	Reads data from lines 80 through 130. When I = 1, reads "M1".
*150 OUTPUT 703 USING "K" ; N$	Sends N$ (Program code) to 5508A.
*160 OUTPUT 703 USING "K" ; "RC"	Triggers 5508A to send measurement back to HP 85.
*170 ENTER 703 ; A$	Place measurement in A$.
*180 GOSUB 220	GOSUB for comparison test of received data and expected data.
*190 NEXT I	
200 PRINT "" @ PRINT "ALL TESTS PASSED" @ PRINT "" @ PRINT "" @ PRINT "" @ PRINT ""	If all tests pass, after 22 loops, program executes this line, then goes to line 210.
210 END	Ends Program.
220 READ Z$	Reads expected data from line 80 through 130. When I = 1, reads bbbb01.00000, where b = blank spaces.
230 IF A$=Z$ THEN GOTO 270 ELSE PRINT N$;" FAILED"	Test comparison. If expected data equals received data, program goes to 270, otherwise prints test failed message.
240 BEEP 70,300 @ BEEP 70,300 @ BEEP 70,300 @ BEEP 115,500	Sound effects to signal that test failed.

(Continued)

* For-next loop

```
250 PRINT "DATA SHOULD BE:" @ PR
    INT Z$
```

Prints the data for the failed test.

```
260 PRINT "DATA WAS:" @ PRINT A$
    @ END
```

```
270 IF W$="Y" AND N$="M1" THEN P
    RINT "PROG CODE";"  RCVD DAT
    A";" EXPECT DATA"
```

Used when operator specifies to print data (W$ = "Y").

```
280 IF W$="Y" THEN PRINT "    ";N
    $;A$;Z$
```

```
290 RETURN
```

Returns to 190.

Line	Instrument Function Code	TYPING AID Numeric Value and Blanks			
80	M1				
80	M1	bbbbb1.00000	6b's	5-0's,	b is equivalent
80	M1	bbbbbbbbb1.0	9b's	1-0	to pressing space
80	5P1P1	bbbbb5.00000	5b's	5-0's	bar when entering program
80	7P2P2	bbbbbbbbb7.0	9b's	1-0	
90	8P3P3	bbbb2.000000	4b's	6-0's	
90	8P4P4	bbbb2.000000	4b's	6-0's	
90	8P5P5	bbbb2.000000	4b's	6-0's	
90, 100	1R1R1	bbbbbbbbbb1.	10b's	no 0's	
100	2R2R2	bbbbbbbbbb2.	10b's	no 0's	
100	3R3R3	bbbbbbbbbb1.	10b's	no 0's	
100	4R4R4	bbbbbbbbbb4.	10b's	no 0's	
110	5R5R5	bbbbbbbbbb5.	10b's	no 0's	
110	2EOEO	bbbbbbbbb2.0	9b's	1-0	
110	T1	bb999999999.	2b's	9-9's	
110	T2	bb999999999.	2b's	9-9's	
120	T3	bb999999999	2b's	9-9's	
120	TA	bbbbbbb68.000	6b's	3-0's	
120	AP	bb999999999.	2b's	9-9's	
120	AH	bb999999999	2b's	9-9's	
130	AT	bb999999999	2b's	9-9's	
130	VL	bbbbbbb728.2	7b's		
130	UNAT	bb999999999	2b's	9-9's	

SECTION V
ADJUSTMENTS

	Page
Introduction	5-1
Safety Considerations	5-1
Recommended Test Equipment	5-1
Factory Selected Components	5-1
Adjustment Procedures	5-1
5518A Receiver Adjustments	5-2
5518A Reference Temperature Adjustments	5-4
5518A Laser Tube Current Measurement	5-5

SECTION V
ADJUSTMENTS

5-1. INTRODUCTION

5-2. This section describes adjustments and checks required to return the 5528A instruments to peak operating capabilities when repairs have been made. Included in this section are test equipment required, equipment setups and procedures to perform the adjustments.

5-3. SAFETY CONSIDERATIONS

5-4. The following warnings contain information that must be understood for your safety.

WARNING

FROM 1.8 KILOVOLTS TO 12 KILOVOLTS DC IS PRESENT ON THE ANODE OF THE LASER TUBE IN THE 5516A. EXERCISE EXTREME CAUTION WHEN WORING INSIDE THE INSTRUMENT. THE HIGH VOLTAGE COULD CAUSE SERIOUS PERSONAL INJURY IF CONTACTED. THE FOLLOWING ADJUSTMENTS SHOULD BE PERFORMED BY SERVICE-TRAINED PERSONNEL.

5-5. RECOMMENDED TEST EQUIPMENT

5-6. Test equipment required for each adjustment is included in the adjustment procedure. Detailed critical specifications for the required test equipment are contained in Table 1-4. Any equipment that satisfies the critical specifications given in the table may be substituted for the recommended model(s).

5-7. FACTORY SELECTED COMPONENTS

5-8 As of the publication date on the title page of this manual there re no factory selected components.

5-9. ADJUSTMENT PROCEDURES

5-10. The following paragraphs contain the adjustment procedures for the Laser Measurement System. Performance test and calibration procedures are located in Section IV.

5-11. 5518A Receiver Adjustments

5-12. This adjustment sets the 5518A receiver gain so that the SIGNAL indicator illuminates when the returned laser beam power is 8.5% of the laser output power. This also corresponds to 10% of the signal returned from a typical 10767A Retroreflector.

5-13. Test Equipment Required. The receiver gain adjustment requires the following test equipment:

Neutral Density Filter 31.6% Transmission, Oriel* Model 5034

Laser Power Meter, United Detector Technology Model 351J.

Retroreflector, HP Model 10767A

Additional Equipment for Convenience

Height Adjuster and Post. HP Model 10785A

Base, HP Model 10784A

5-14. Preliminary Procedure. Observe the safety precautions in Paragraph 5-3 and proceed as follows.

a. On the Laser Head, remove the 4 pozi-drive screws at each corner of the top cover.

b. Remove the Laser Head top cover by pulling up on each end.

c. On the 5518A, set the turret to OTHER and both turret shutters to the largest aperture.

d. On the 5508A, set the LDNE switch to ON. Wait until the system completes the warm-up cycle (approximately 3 to 10 minutes). PA Error will be displayed when the warm-up cycle is complete. If the 5508A fails self test or the warm-up countdown does not end with PA Error, see 5528A Block Diagram and System Troubleshooting in Section VIII.

5-15. Procedure

a. Using the Laser Power Meter, align the power meter detector for maximum reading.

b. If the laser power output is less than 100 microwatts, see Laser High Voltage Troubleshooting in Section VIII.

c. Place the Retroreflector assembly about 6 inches from the Laser Head and align the Retroreflector to return the laser beam to the return aperture. Place a piece of white card stock in the return beam path. If there is a dark line in the beam, rotate the 10767A 90°. Remove the card stock.

d. Place the 31.6% filter flush with the turret so that both the emitted beam and the return beam will pass through the filter. Align for maximum indication on the 5505A BEAM STRENGTH meter.

e. On A2, adjust R3 GAIN potentiometer (Figure 5-1) clockwise until the SIGNAL indicator goes off when the beam is blocked and on when the beam is unblocked. If the indicator does not come on, readjust A2R3 slightly more counter-clockwise and repeat.

g. Replace the Laser Head top cover.

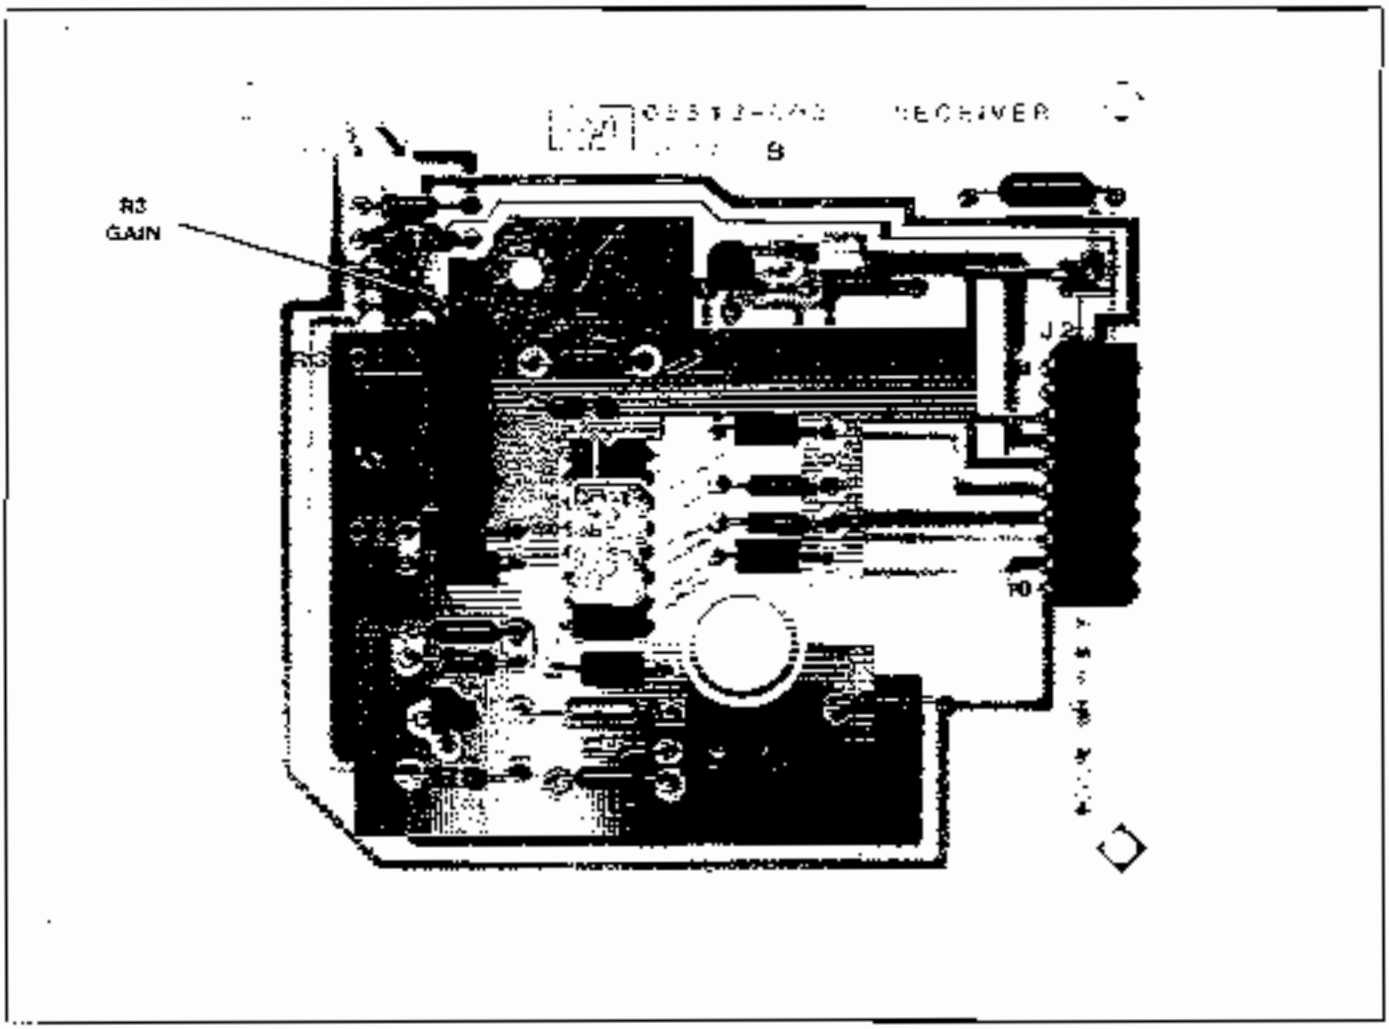


Figure 5-1. 5518A A2 Receiver Board, Adjustment Location

5-16. 5518A Reference Temperature Adjustments

5-17. This adjustment sets the laser preheat temperature to 105°C (221°F). The adjustment must be performed at room temperature, 21 to 25°C (69.8 to 77.0°F).

5-18. Test Equipment Required. The reference temperature adjustment requires the following test equipment:

Digital Voltmeter, HP 3456A

5-19. Preliminary Procedure

5-20. The adjustment may be made from either a cold start or when power has been applied for some period of time. In either case with power on or off, observe the safety precautions in paragraph 5-3 and proceed as follows:

a. On the Laser Head, remove the 4 pozi-drive screws at each corner of the top cover.

b. Remove the Laser Head top cover by pulling up on each end.

c. On A3, change the small blue HEATER jumper from NORM to OFF. See Figure 5-2.

d. Apply power to the Digital Voltmeter and set its controls to the 1 volt DC range. Connect the positive lead of the Digital Voltmeter to A3TP11, connect the negative lead to A3TP1. See Figure 5-2.

e. If primary power has been off for less than 2 hours, set the 5508A LINE switch to ON and wait until the Digital Voltmeter reading stabilizes to within 1 millivolt in 10 minutes, then proceed with the adjustment procedure. Stabilization may take up to 2 hours.

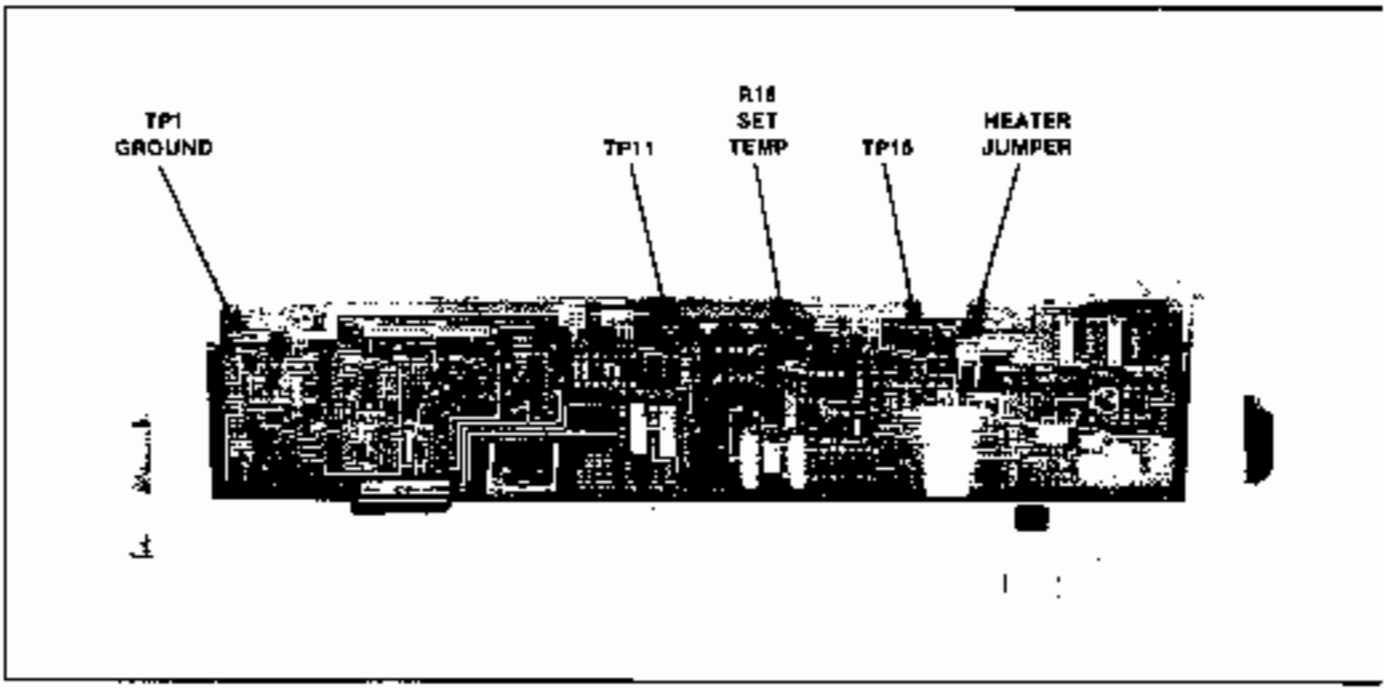


Figure 5-2. 5518A A3 Controller/Ref Board, Jumpers, Test Points, and Adjustment Locations

5-21. Procedure. To adjust the reference temperature, proceed as follows:

a. Check that the Voltmeter reads between 0.2V and 0.3V. This voltage is V(A3TP11) and must be stable to within +1 millivolt within a 10 minute period. see step f in the preliminary procedure above.

b. Calculate the heater adjust set point using the following equation V_{set} = 1.285 x V(A3TP11).

c. Connect Digital Voltmeter positive lead to A3TP15. Connect the negative lead to ground. See Figure 5-3.

d. Check that the voltage at A3TP15 equals V_{set} ±1 millivolt as calculated in step b. If not, adjust A3R16 SET TEMP (See Figure 5-2). Note that the value for V_{set} will be different for each laser tube.

e Note and record the SET TEMP voltage in Table 5-1.

f. On A3, change the small blue HEATER jumper back to NORM. Remove the test equipment leads, and reinstall the laser Head cover.

5-22. 5518A Laser Tube Current Adjustment

5-23. This procedure adjusts the laser tube current to 3.5 milliamperes +0.1 milliampere.

5-24. Test Equipment Required. The laser current adjustment requires the following test equipment.

Millammeter, HP Model 428B

5-25. Procedure. To adjust the laser tube current, observe the safety precautions in Paragraph 5-3 and proceed as follows:

a. Set the 5508A LINE switch to OFF.

b. On the Laser Head, remove the 4 pozi-drive screws at each corner of the top cover.

c. Remove the Laser Head top cover by pulling up on each end.

d. Set the milliammeter to the 10 milliampere range.

e. Locate the anode lead that connects between the high voltage power supply and the ballast resistor. See Figure 5-3. Clip the milliammeter probe to this lead with the arrow on the probe pointing away from the power supply. Keep the probe as far as possible from and perpendicular to the magnet assemblies. It may be necessary to prop up the probe to achieve the perpendicular orientation.

f. On the milliammeter, adjust for zero indication. If zero indication cannot be obtained, degauss the probe as directed on the back of the milliammeter.

NOTE

After the zero setting has been made on the milliammeter, do not move the probe, this will negate the zero setting.

g. On the 5508A, set the LINE switch to ON.

h. Adjust A1R3 (Figure 5-1) for 3.5 milliamperes ±0.1 milliampere.

i. Record the Laser Tube current in Table 5-1

j. Set the 5508A LINE switch to OFF, disconnect the probe, and reinstall the Laser Head cover.

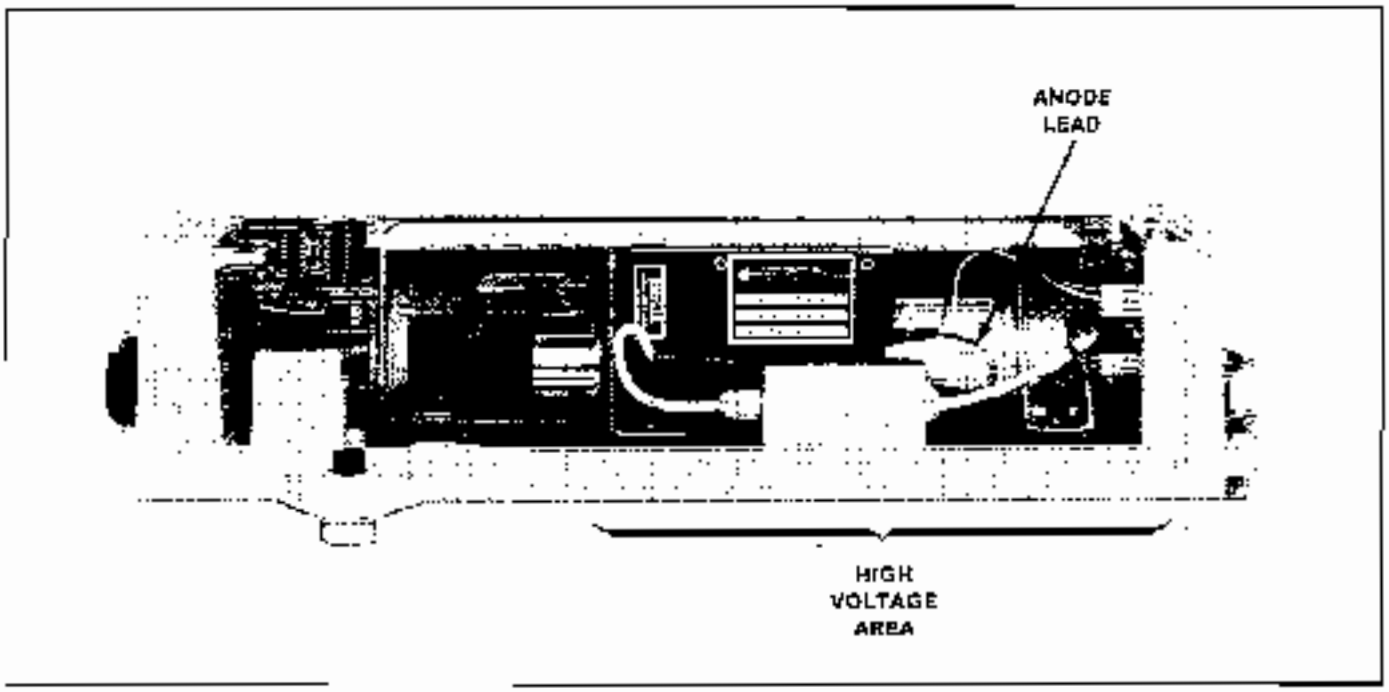


Figure 5-3. 5518A High Voltage Area and Anode Lead

Table 5-1. Adjustment Record

Adjust	Date / Value	Date / Value	Date / Value	Date / Value
Laser Output Power	_____ / _____ uW	_____ / _____ uW	_____ / _____ uW	_____ / _____ uW
Vset	_____ / _____ V	_____ / _____ V	_____ / _____ V	_____ / _____ V
Laser Tube Current	_____ / _____ ma	_____ / _____ ma	_____ / _____ ma	_____ / _____ ma

SECTION VI
REPLACEABLE PARTS

	Page
Introduction	6-1
Summary of Tables and Figures	6-1
Abbreviations	6-1
Ordering Information	6-1
Direct Mail Order System	6-1
Replaceable Parts, Tables and Figures	6-2
5508A PC Board Assemblies Replaceable Parts	6-4
5518A PC Board Assemblies Replaceable Parts	6-14
10751-60001 PC Board Assemblies Replaceable Parts	6-18
10751-60002 Temperature Transducer Assembly Replaceable Parts	6-20
10757-60001 PC Board Assembly Replaceable Parts	6-21
5508A Cabinet Parts	6-23
5508A Rack Mount Kit	6-25
5508A Exploded Chassis View	6-27
5508A Heat Sink Exploded View	6-29
5508A Front Panel Exploded View	6-31
5508A Rear Panel Exploded View	6-33
5508A Cable Assembly Exploded View	6-35
Remote Control Unit, Exploded View	6-37
5518A Exploded View	6-39
10751A/B Replaceable Parts	6-41
10757A/B/C Exploded View	6-45
10753A Tripod Replaceable Parts	6-47

SECTION VI
REPLACEABLE PARTS

6-1. INTRODUCTION

6-2. This chapter contains information for ordering parts. The following replaceable parts lists are included

Table 6-1	Replaceable Parts, Tables, and Figures
Table 6-2	Reference Designations and Abbreviations
Tables 6-3 through 6-6	Replaceable Parts
Table 6-7	Manufacturer's Codes

6-3. REFERENCE DESIGNATIONS

6-4. *Table 6-2* lists the abbreviations and reference designations used in the parts lists, block diagrams, and throughout the manual.

6-5. REPLACEABLE PARTS

6-6. Tables 6-3 through 6-6 are the lists of replaceable parts and are organized as follows:

1. Electrical assemblies in alphanumerical order by reference designation.
2. Chassis-mounted electrical parts in alphanumerical order by reference designation.
3. Chassis-mounted mechanical parts in alphanumerical order by reference designation.

6-7. The information given for each part consists of the following:

1. Reference Designation
2. Hewlett-Packard part number.
3. Part number check digit (CD)
4. Total quantity (QTY) in instrument. The total quantity is given once and at the first appearance of the part number in the list.
5. Description of the part.
6. Typical manufacturer's part number for the part.

6-8. EXCHANGE ASSEMBLIES

6-9. The Laser Tube assembly may be replaced on an exchange basis. Factory repaired and tested exchange assemblies are available only on a trade-in basis; therefore, the defective assemblies must be returned for credit. For this reason, assemblies required for spare parts stock must be ordered by the "new assembly" part number. The part numbers for the Laser Tube Assembly are listed below:

ASSEMBLY	NEW ASSEMBLY HP PART NUMBER	EXCHANGE ASSEMBLY HP PART NUMBER
Laser Tube Assembly	05517-60801	05517-60501

6-10. HOW TO ORDER A PART

6-11. Hewlett-Packard wants to keep your parts ordering process as simple and efficient as possible. Think of the process as having the following steps:

- Identifying the part and the quantity that you want.
- Determining the ordering method to be used and contacting Hewlett-Packard.

6-12. Parts Identification

6-13. To identify the part(s) you want, first refer to the replaceable parts lists (*Tables 6-3 and 6-6*) in this chapter.

6-14. When ordering from Hewlett-Packard, the important numbers to note from the Parts List are the HP Part Number and part-number check digit (in the "CD" column), and the quantity of the part you want.

6-15. If the part you want is NOT identified in the manual, you can call on Hewlett-Packard for help (see the following section ("Contacting Hewlett-Packard"). Please have the following information at hand when you contact HP for help:

- Instrument Model Number (example "HP 5505A").
- Complete instrument Serial Number (example "1234A56789"). Information about where to find the serial number is given in the preface of this manual in the "HOW TO USE THIS MANUAL" section.
- Description of the part and its use.
- Quantity of the part required.

6-16. Contacting Hewlett-Packard

6-17. Depending on where you are in the world, there are one or more ways in which you can get parts or parts information from Hewlett-Packard.

- Outside the United States, contact your local HP sales office. HP sales offices are listed at the back of this manual.
- Within the United States, we encourage you to order replacement parts or request parts information directly by telephone or mail from the HP Support Materials Organization, using the telephone numbers or address listed below. (You can also contact your local HP sales office. HP sales offices are listed at the back of this manual.)

6-18. By telephone:

a. For Parts Ordering, use our toll-free number (800) 227-8164. Monday through Friday (except Holidays), 6 am to 5 pm (Pacific Time).

b. If you need a part in a hurry, an extra-cost Hotline phone ordering service is available, 24 hours a day. Use the toll free number above at the times indicated, at other times, use (916) 785-8460.

c. For Parts Identification Assistance, call us at (916) 783-0804. Our Parts Identification hours are from Monday through Friday, 6 am to 5 pm (Pacific Time).

6-19. For mail correspondence, use the address below:

Hewlett-Packard
Support Materials Roseville
P.O. Box 1145
Roseville, Ca 95661-1145

6-20. CABINET PARTS AND HARDWARE:

6-21. To locate and identify miscellaneous cabinet parts, refer to *Figures 6-1 through 6-12*. These figures provide exploded views of the cabinet, with the parts identified by reference designations; the reference designations correspond with the ones in *Tables 6-3 through 6-6*.

Table 6-2. Reference Designations and Abbreviations

REFERENCE DESIGNATIONS

A	= assembly	DL	= delay line	K	= relay	T	= transformer
AT	= attenuator, power (non-variable)	DS	= annunciator, signaling device (audible or visual) (lamp, LED)	L	= coil, inductor	TB	= terminal board
B	= fan, motor	E	= miscellaneous electrical part	M	= meter	TC	= thermocouple
BT	= battery	F	= fuse	MP	= mechanical part	TP	= test point
C	= capacitor	FL	= filter	P	= electrical connector (movable portion); plug	U	= integrated circuit, microcircuit
CP	= coupler	H	= hardware	Q	= transistor, SCR, triode thyristor	V	= electron tube
CR	= diode, diode thyristor, varistor	HY	= circulator	R	= resistor	VR	= voltage regulator, breakdown diode
DC	= directional coupler	J	= electrical connector, (stationary portion); jack	RT	= thermistor	W	= cable, transmission path, antenna
				S	= switch	X	= socket
						Y	= crystal unit, piezoelectric
						Z	= tuned circuit, tuned stage

ABBREVIATIONS

A	= amperes	HD	= head	HF	= high	SPST	= single-pole, single-throw
AC	= alternating current	HDW	= hardware	HFR	= half-wave rectifier	SSB	= single-sideband
ACCESS	= accessory	HEX	= hexagon	HT	= height	SST	= stainless steel
ADJ	= adjust, adjustment	HG	= high	HZ	= hertz, cycles	SQ	= square
AF	= audio frequency	HP	= Hewlett-Packard	NOM	= nominal	SWR	= standing-wave ratio
AFC	= automatic frequency control	HPF	= high-pass filter	NORM	= normal	SYNC	= synchronize
AGC	= automatic gain control	HR	= hour (used in parts list)	NPN	= negative-positive-negative	T	= time-slow-blow fuse
AL	= aluminum	HV	= high voltage	NPO	= negative-positive zero (zero temperature coefficient)	TA	= tantalum
ALC	= automatic level control	HZ	= hertz	NRFRD	= not recommended for field replacement	TC	= temperature compensating
AM	= amplitude modulation	IC	= integrated circuit		= nanosecond	TD	= time delay
AMPL	= amplifier	ID	= inside diameter	NSP	= not separately replaceable	TERM	= terminal
APC	= automatic phase control	IF	= intermediate frequency	NW	= network	TET	= thin film transistor
ASSY	= assembly	INTG	= integrating, integrator	OBD	= order by description	TGL	= toggle
AUX	= auxiliary	IN	= inch	OBS	= obsolete	THD	= thread
AVG	= average	INCD	= incandescent	OD	= outside diameter	THRU	= through
AWG	= American wire gage	INCL	= including	OH	= over head	TI	= titanium
BAL	= balance	INP	= input	OP AMPL	= operational amplifier	TOL	= tolerance
BCD	= binary coded decimal	INS	= insulation	OPT	= option	TRIM	= trimmer
BD	= board	INT	= internal	OSC	= oscillator	TSTR	= transistor
BE CU	= beryllium copper	kg	= kilogram	OX	= oxide	TTL	= transistor-transistor logic
BFO	= beat frequency oscillator	kHz	= kilohertz	oz	= ounce	TV	= television
BH	= binder head	kΩ	= kilohm	P	= peak, used in parts list	TVI	= television interference
BKDN	= breakdown	kV	= kilovolt	P	= pico, used in parts list	TWT	= traveling wave tube
BP	= bandpass	lb	= pound	PAM	= pulse-amplitude modulation	U	= micro (10^{-6}) used in parts list
BPF	= bandpass filter	LC	= inductance-capacitance	PC	= printed circuit	UF	= microfarad, used in parts list
BRS	= brass	LED	= light-emitting diode	PCM	= pulse-code modulation (pulse-count modulation)	UHF	= ultra high frequency
BWO	= backward-wave oscillator	LF	= low frequency	PDM	= pulse-duration modulation	UNREG	= unregulated
CAL	= calibrate	LG	= long	PEM	= photoelectromagnetic	V	= volt
CAP	= counterbored hole	LH	= left hand	PH	= phosphor	VA	= volt-amperes
CER	= ceramic	LIN	= linear taper (used in parts list)	PH BRZ	= phosphor bronze	VAR	= varistor
CM	= centimeter	lin	= length	PHL	= Phillips	VCO	= voltage-controlled oscillator
CMO	= cabinet mount only	LK WASH	= lock washer	PIV	= peak inverse voltage	VDC	= volts dc
COAX	= coaxial	LOG	= logarithmic taper (used in parts list)	pk	= peak	VDCW	= volts, dc working (used in parts list)
COM	= common	lap	= lagging current	PL	= phase lock	VFD	= variable frequency oscillator
CONN	= connection	LPF	= low-pass filter	PLO	= phase lock oscillator	VHF	= very high frequency
CONPL	= complete	LV	= low voltage	PM	= phase modulation	Vpk	= volts peak
CRT	= cathode-ray tube	m	= meter (distance)	PNP	= positive-negative-positive	Vp-p	= volts peak-to-peak
CTL	= current-sensing transistor logic	mA	= milliampere	POS	= position	Vrms	= volts rms
cw	= continuous wave	MAX	= maximum	POSC	= precision	VSWR	= voltage standing wave ratio
cw	= counterweight	MΩ	= megohm	PQS	= quadrature (component (vector) perpendicular to)	VTO	= voltage-tuned oscillator
DIA	= diameter	MEG	= meg (10^6, used in parts list)			VTVM	= vacuum-tube voltmeter
dB	= decibel	MEG OHM	= megohm	PRESH	= pressure	W	= watt, watthead
dBm	= decibel referenced to 1mW	MET OX	= metal oxide	POT	= potentiometer	W	= watt
dc	= direct current	MF	= medium frequency, microfarad (used in parts list)	pp	= peak-to-peak	W	= with
deg	= degree (temperature interval or difference)	MFR	= manufacturer	PP	= push-to-push (used in parts list)	WW	= working inverse voltage
°	= degree (plane angle)	mg	= milligram	PPM	= pulse-position modulation	WITH	= wirewound
°C	= degree Celsius (centigrade)	MHz	= megahertz	PRR	= pulse-repetition frequency	WO	= without
°F	= degree Fahrenheit	mH	= millihenry	PRR	= pulse-repetition rate	XFMR	= transformer
°K	= degree Kelvin	mho	= conductance	pk	= picosecond		
DPDT	= double-pole double-throw	MIN	= minimum	PT	= point		
DET	= detector	mm	= millimeter (fiber)	PTM	= pulse-time modulation		
diam	= diameter	' "	= minute (plane angle)	PWM	= pulse-width modulation		
DIP	= dual in-line package	MINAT	= mounting	PWV	= peak working voltage		
DPST ANPL	= double-pole single-throw	mtg	= mounting	RC	= resistance-capacitance		
div	= division	MOD	= modulator	RECT	= rectifier		
DPDT	= double-pole double-throw	MOM	= momentary	REF	= reference		
DR	= drive	MOS	= metal-oxide semiconductor	REG	= regulated		
DSB	= double sideband	ms	= millisecond	REPL	= replaceable		
DTL	= diode-transistor logic	MTG	= mounting	RF	= radio frequency		
DVM	= digital voltmeter	MTR	= meter (measuring device)	RFI	= radio frequency interference		
ECL	= emitter-coupled logic	mV	= millivolt	RH	= round head; right hand		
EMF	= electromotive force	mVac	= millivolt ac	R,L,C	= resistance-inductance-capacitance		
EDP	= electronic data processing	mVdc	= millivolt dc	RMS	= root-mean-square		
ELECT	= electrolytic	mVpk	= millivolt, peak	ms	= nanosecond (square)		
ELCAP	= electrolytic	mVp-p	= millivolt, peak-to-peak	RND	= round		
EXT	= external	mVrms	= millivolt, rms	ROM	= read-only memory		
F	= farad	mm	= millimeter	RSR	= rack and panel		
FET	= field-effect transistor	mVdc	= multiplex	RWV	= reverse working voltage		
FF	= flip-flop	MY	= Mylar	S	= scanning assembly		
FH	= flat head	μA	= microampere	s	= second (time)		
FIL H	= fillister head	μC	= microcoulomb	...	= second (plane angle)		
FM	= frequency modulation	μH	= microhenry	SCR	= screw		
FP	= front panel	μmho	= micromho	SCR	= silicon controlled rectifier; semiconductor		
FREQ	= frequency	μs	= microsecond	SE	= selenium		
FXD	= fixed	μV	= microvolt	SECT	= sections		
g	= gram	μVac	= microvolt, ac	SEMICONDUCTOR	= semiconductor		
GE	= germanium	μVdc	= microvolt, dc	SHF	= super-high frequency		
GHz	= gigahertz	μVpk	= microvolt, peak	si	= silicon		
GL	= glass	μVp-p	= microvolt, peak-to-peak	Si	= silicon		
GND	= ground (ed)	μVrms	= microvolt, rms	SL	= slide		
H	= henry	μW	= microwatt	SNR	= signal-to-noise ratio		
h	= hour	mA	= milliampere	SPDT	= single-pole, double-throw		
HET	= heterodyne	NC	= normally closed	SPG	= spring		
HEX	= hexagonal	NC	= normally closed	SPL	= split ring		

NOTE
All abbreviations in this parts list will be in upper case.

MULTIPLIERS

Abbreviation	Prefix	Multiple
T	tera	10^{12}
G	giga	10^{9}
M	mega	10^{6}
k	kilo	10^{3}
da	deka	10^{1}
d	deci	10^{-1}
c	centi	10^{-2}
m	milli	10^{-3}
μ	micro	10^{-6}
n	nano	10^{-9}
p	pico	10^{-12}
f	femto	10^{-15}
a	atto	10^{-18}

Search Results:

Parts found matching your search criteria :47

Highlighted part numbers have images. Click the [redacted] icon to view part image.

Notes with asterisks (* Notes) are populated with note information

			HP Part Number	PRIME 1 Descript.	PRIME 2 Descript.	EDC Descript. (SMO Internal Use)
Part to Product	SAM	Notes	05508-00001	PANEL, FRONT		PANEL, FRONT
Part to Product	SAM	Notes	05508-00002	PANEL, SUB		PANEL, SUB
Part to Product	SAM	Notes	05508-00003	CHASSIS		CHASSIS
Part to Product	SAM	Notes	05508-00004	PANEL, REAR		PANEL, REAR
Part to Product	SAM	Notes	05508-00005	COVER, REAR		COVER, REAR
Part to Product	SAM	Notes	05508-00006	BRACKET LEFT		BRACKET, LEFT
Part to Product	SAM	Notes	05508-00007	BRACKET RIGHT		BRACKET RIGHT
Part to Product	SAM	Notes	05508-00008	COVER-LASER HEAD	BELOW SERIES 2536A	COVER-LASER HEAD
Part to Product	SAM	Notes	05508-00009	BRACKET, PC BD SUPPORT		BRACKET, PC BD SUPPORT
Part to Product	SAM	Notes	05508-00011	COVER-LASER HEAD	SERIES 2536A & UP	COVER-LASER HEAD
Part to Product	SAM	Notes	05508-00013	FRAME, FILTER		FRAME, FILTER
Part to Product	SAM	Notes	05508-00015	FOAM RUBBER PAD		FOAM RUBBER PAD
Part to Product	SAM	Notes	05508-20301	HEATSINK		HEATSINK
Part to Product	SAM	Notes	05508-20302	DISPLAY, WINDOW		DISPLAY WINDOW
Part to Product	SAM	Notes	05508-20303	BAR, PC BD SPRI		BAR, PC BD SPRI
Part to Product	SAM	Notes	05508-20305	FASTENER		FASTENER
Part to Product	SAM	Notes	05508-20307	FASTENER, PC BD UPPER		FASTENER PC BD UPPER
Part to Product	SAM	Notes	05508-40001	COVER, REMOTE CONTROL		COVER, REMOTE CONTROL
Part to Product	SAM	Notes	05508-40002	BASE, REMOTE CONTROL		BASE, REMOTE CONTROL
Part to Product	SAM	Notes	05508 60001	KYBD DSPL BD ASSY		KYBD DSPL BD ASSY

Part to Product	SAM	Notes	05508-60002	PROCESSOR BD ASSY		PROCESSOR BD ASSY
Part to Product	SAM	Notes	05508-60003	COUNTER A/D BD ASSY		COUNTER A/D BD ASSY
Part to Product	SAM	Notes	05508-60004	CONNECTOR BD AY		CONNECTOR BD AY
Part to Product	SAM	Notes	05508-60005	POWER SUPPLY BD AY		POWER SUPPLY BD AY
Part to Product	SAM	Notes	05508-60020	REMOTE CONTROL BD ASSY		REMOTE CONTROL BD ASSY
Part to Product	SAM	Notes	05508-60021	RMT CNTRL BOARD ASSY		RMT CNTRL BOARD ASSY
Part to Product	SAM	Notes	05508-60201	CONTR I CBL ASSY		CONTR I CBL ASSY
Part to Product	SAM	Notes	05508-60202	ANALOG MPIB CBL ASSY		ANALOG MPIB CBL ASSY
Part to Product	SAM	Notes	05508-60203	LASER PWR CBL ASSY		LASER PWR CBL ASSY
Part to Product	SAM	Notes	05508-60204	PWR AC CBL ASSY		PWR AC CBL ASSY
Part to Product	SAM	Notes	05508-60205	REG CBL ASSY		REG CBL ASSY
Part to Product	SAM	Notes	05508-60206	TRANSFORMER		TRANSFORMER
Part to Product	SAM	Notes	05508-60208	FAN CBL ASSY		FAN CBL ASSY
Part to Product	SAM	Notes	05508-60209	METER CBL AY		METER CBL AY
Part to Product	SAM	Notes	05508-60210	ORDER 05508-60211		FIRMWARE UPDATE KIT
Part to Product	SAM	Notes	05508-60211	EPROM KIT		EPROM KIT
Part to Product	SAM	Notes	05508-60212	CABLE ADAPTOR, REMOTE		CABLE ADAPTOR, REMOTE
Part to Product	SAM	Notes	05508-60301	HINGE, PC BD		HINGE, PC BD
Part to Product	SAM	Notes	05508-80005	EPROM, A2 U5		EPROM, A2 U5
Part to Product	SAM	Notes	05508-80006	EPROM, A2 U6		EPROM, A2 U6
Part to Product	SAM	Notes	05508-80007	EPROM, A2 U7		EPROM, A2 U7
Part to Product	SAM	Notes	05508-80008	EPROM, A2 U8		EPROM, A2 U8
Part to Product	SAM	Notes	05508-80009	EPROM, A2 U9		EPROM, A2 U9
Part to Product	SAM	Notes	05508-80012	EPROM, A2U5		EPROM, A2U5
Part to Product	SAM	Notes	05508-80013	INSULATOR, PC BOARD		INSULATOR, PC BOARD
Part to Product	SAM	Notes	05508-90015	MANUAL, INSTALL PROC		MANUAL, INSTALL PROC
Part to Product	SAM	Notes	05508-90016	PACKING, LIST	NOT NEED FOR SUPPORT	PACKING, LIST

Table 6-3. Replaceable Parts

Reference Designation	HP Part Number	C D	Qty	Description	Mfr Code	Mfr Part Number
A1	05508-60009	6	1	A1 KEYBOARD/DISPLAY BOARD (DATE CODE 8126)	28480	05508-60009
A1C1	0160-4554	7	8	CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A1C2	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A1C3	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A1C4	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A1C5	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A1C6	0180-2929	8	9	CAPACITOR-FXD 68UF +-10% 10VDC TA	28480	0180-2929
A1C7	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A1C8	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A1C9	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A1C10	0180-2929	8		CAPACITOR-FXD 68UF +-10% 10VDC TA	28480	0180-2929
A1DS1	1990-0681	2	*	DISPLAY-ALPHA-SEG 1-CHAR .408-H RED	28480	5082-7655
A1DS2	1990-0574	2	9	DISPLAY-NUM-SEG 1-CHAR .43-H	28480	5082-7651
A1DS3	1990-0574	3		DISPLAY-NUM-SEG 1-CHAR .43-H	28480	5082-7651
A1DS4	1990-0574	3		DISPLAY-NUM-SEG 1-CHAR .43-H	28480	5082-7651
A1DS5	1990-0665	3	5	LED-LAMP LUM-INT=1MCD IF=20MA-MAX BVR=5V	28480	1990-0665
A1DS6	1990-0574	3		DISPLAY-NUM-SEG 1-CHAR .43-H	28480	5082-7651
A1DS7	1990-0665	3		LED-LAMP LUM-INT=1MCD IF=20MA-MAX BVR=5V	28480	1990-0665
A1DS8	1990-0574	3		DISPLAY-NUM-SEG 1-CHAR .43-H	28480	5082-7651
A1DS9	1990-0699	3	1	LED-LIGHT BAR MODULE LUM-INT=3MCD	28480	1LM1-2350
A1DS10	1990-0665	3		LED-LAMP LUM-INT=1MCD IF=20MA-MAX BVR=5V	28480	1990-0665
A1DS11	1990-0574	3		DISPLAY-NUM-SEG 1-CHAR .43-H	28480	5082-7651
A1DS12	1990-0574	3		DISPLAY-NUM-SEG 1-CHAR .43-H	28480	5082-7651
A1DS13	1990-0699	3	4	LED-LIGHT BAR MODULE LUM-INT=3MCD	28480	1LM1-2350
A1DS14	1990-0665	3		LED-LAMP LUM-INT=1MCD IF=20MA-MAX BVR=5V	28480	1990-0665
A1DS15	1990-0574	3		DISPLAY-NUM-SEG 1-CHAR .43-H	28480	5082-7651
A1DS16	1990-0699	0		LED-LIGHT BAR MODULE LUM-INT=3MCD	28480	1LM1-2350
A1DS17	1990-0665	3		LED-LAMP LUM-INT=1MCD IF=20MA-MAX BVR=5V	28480	1990-0665
A1DS18	1990-0574	3		DISPLAY-NUM-SEG 1-CHAR .43-H	28480	5082-7651
A1DS19	1990-0699	0		LED-LIGHT BAR MODULE LUM-INT=3MCD	28480	1LM1-2350
A1DS20	1990-0699	0		LED-LIGHT BAR MODULE LUM-INT=3MCD	28480	1LM1-2350
A1DS21	1990-0487	7	1	LED-LAMP LUM-INT=1MCD IF=20MA-MAX BVR=5V	28480	5082-4684
A1J1	1251-6705	8	1	CONNECTOR 50-PIN M POST TYPE	28480	1251-6705
A1J2	1251-3618	6	1	CONNECTOR- 2-PIN M POST TYPE	28480	1251-3618
A1R1	1810-0277	3	1	NETWORK-RESISTOR 10-SIP 2.2K OHM X 9	01121	210922
A1R2	0698-0032	7	1	RESISTOR 464 1% .125W F TC=0+-100	28480	C4-1/8-TO-4640-F
A1R3	0698-3442	9	1	RESISTOR 237 1% .125W F TC=0+-100	28480	C4-1/8-TO-237R-F
A1S1	5060-9436	7	25	SWITCH-PUSHBUTTON (7)	28480	5060-9436
	5041-0751	1	*	KEY-BUTTON - 7	28480	5041-0751
A1S14	5060-9436	7		SWITCH-PUSHBUTTON (ANGLE)	28480	5060-9436
	5041-0254	8	5	KEY-BUTTON - LIGHT PIPE	28480	5041-0254
A1S15	5060-9436	7		SWITCH-PUSHBUTTON (3)	28480	5060-9436
	5041-0823	3	1	KEY-BUTTON - 3	28480	5041-0823
A1S16	5060-9436	7	1	SWITCH-PUSHBUTTON (6)	28480	5060-9436
	5041-0752	2	1	KEY-BUTTON - 6	28480	5041-0752
A1S17	5060-9436	7		SWITCH-PUSHBUTTON (LONG)	28480	5060-9436
	5041-0254	8		KEY-BUTTON - LIGHT PIPE	28480	5041-0254
A1S18	5060-9436	7		SWITCH-PUSHBUTTON (4)	28480	5060-9436
	5041-0748	8	1	KEY-BUTTON - 4	28480	5041-0748
A1S19	5060-9436	7		SWITCH-PUSHBUTTON (9)	28480	5060-9436
	5041-0753	9	1	KEY-BUTTON - 9	28480	5041-0753
A1S20	5060-9436	7		SWITCH-PUSHBUTTON (SHORT)	28480	5060-9436
	5041-0254	8		KEY-BUTTON - LIGHT PIPE	28480	5041-0254
A1S21	5060-9436	7		SWITCH-PUSHBUTTON (5)	28480	5060-9436
	5041-0749	7	1	KEY-BUTTON - 5	28480	5041-0749
A1S22	5060-9436	7		SWITCH-PUSHBUTTON (0)	28480	5060-9436
	5041-0754	4	1	KEY-BUTTON - 0	28480	5041-0754
A1S23	5060-9436	7		SWITCH-PUSHBUTTON (AUTO RECORD)	28480	5060-9436
	5041-0891		1	KEY-BUTTON - AUTO RECORD	28480	5041-0891
A1S24	5060-9436	7		SWITCH-PUSHBUTTON (-)	28480	5060-9436
	5041-0746	4	1	KEY-BUTTON - MINUS	28480	5041-0746

See introduction to this section for ordering information.
*Indicates factory selected value

Table 6-3. Replaceable Parts (Continued)

Reference Designation	HP Part Number	C D	Qty	Description	Mfr Code	Mfr Part Number
A1S25	5060-9436	7		SWITCH-PUSHBUTTON (;	28480	5060-9436
	5041-0755	5	1	KEY-BUTTON - DECIMAL POINT	28480	5041-0755
A1U1	1823-1686	9	2	82259 ICM7486MIAY LED	32293	ICM7218A
A1U2				NOT ASSIGNED		
A1U3	1823-1112	5	1	IC FF TTL LS D-TYPE POS-EDGE TRIG	01295	SN74LS74AN
A1U4	1823-1144	5	1	IC GATE TTL LS NOR QUAD 2 INP	01295	SN74LS02N
A1U5	1823-2244	9	1	IC FF TTL LS D TYPE POS-EDGE TRIG COM	01295	SN74LS75N
A1U6	1820-1858	9	1	IC FF TTL LS D-TYPE OCTL	01295	SN74LS377N
A1U7	1820-2102	8	1	IC LCH TTL LS D-TYPE OCTL	01295	SN74LS373N
A1U8	1820-1086	9		IC DRVR CMOS DSPL LED	32293	ICM7486P1ICM7218A
A1U9	1820-0070	5	1	IC GATE TTL NAND 8-INP	01295	SN7430N
A1U10	1820-2068	1	1	IC FF TTL LS D-TYPE POS-EDGE-TRIG DUAL	01295	SN74LS374N
A1XDS1	1200-0638	7	10	SOCKET-14-CONT DIP-SLDR	28480	1200-0638
A1XDS2	1200-0638	7		SOCKET-14-CONT DIP-SLDR	28480	1200-0638
A1XDS3	1200-0638	7		SOCKET-14-CONT DIP-SLDR	28480	1200-0638
A1XDS4	1200-0638	7		SOCKET-14-CONT DIP-SLDR	28480	1200-0638
A1XDS5	1200-0638	7		SOCKET-14-CONT DIP-SLDR	28480	1200-0638
A1XDS7	1200-0638	7		SOCKET-14-CONT DIP-SLDR	28480	1200-0638
A1XDS8	1200-0688	7	3	SOCKET-STRP 11-CONT DIP-SLDR	28480	1200-0688
A1XDS11	1200-0638	7		SOCKET-14-CONT DIP-SLDR	28480	1200-0638
A1XDS12	1200-0638	7		SOCKET-14-CONT DIP-SLDR	28480	1200-0638
A1XDS13	1200-0688	7		SOCKET-STRP 11-CONT DIP-SLDR	28480	1200-0688
A1XDS15	1200-0638	7		SOCKET-14-CONT DIP-SLDR	28480	1200-0638
A1XDS16	1200-0688	7		SOCKET-STRP 11-CONT DIP-SLDR	28480	1200-0688
A1XDS18	1200-0638	7		SOCKET-14-CONT DIP-SLDR	28480	1200-0638
A1XDS19	1200-0688	7		SOCKET-STRP 11-CONT DIP-SLDR	28480	1200-0688
A1XDS20	1200-0688	7		SOCKET-STRP 11-CONT DIP-SLDR	28480	1200-0688
	5041-0826		1	KEY BUTTON, 5	28480	5041-0826
	5041-0827		1	KEY BUTTON, 2	28480	5041-0827
	5041-1890		1	KEY BUTTON, PRESET	28480	5041-1890
	5041-1892		1	KEY BUTTON, RESOL	28480	5041-1892
	5041-1894		1	KEY BUTTON, V.C.L	28480	5041-1894
	5041-1895		1	KEY BUTTON, DIR SENSE	28480	5041-1895
	5041-1896		1	KEYBUTTON, EXP COEF	28480	5041-1896
	5041-2008		1	KEY BUTTON, MATERIAL TEMPERATURE	28480	5041-2008

See introduction to this section for ordering information
*Indicates factory selected value

Table 6-3 Replaceable Parts (Continued)

Reference Designation	HP Part Number	C D	Qty	Description	Mfr Code	Mfr Part Number
A2	05528-60007	F	1	A2 PROCESSOR BOARD ASSEMBLY DATE CODE 9212	28480	05528-60092
A2C1	0180-4134	1	4	CAPACITOR-FXD 22UF 15V TA +-10% LVDC	56289	178D226X9015X
A2C2	0160-4554	7	18	CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A2C3	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A2C4	0180-4134	1		CAPACITOR-FXD 22UF 15V TA +-10% LVDC	56289	178D226X9015X
A2C5	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A2C6	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A2C7	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A2C8	0180-3773		1	CAPACITOR-FXD .01UF +-20% 50VDC CER	56289	293D686X9010D8T
A2C9	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A2C10	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A2C11	0160-4765	7	2	CAPACITOR-FXD 27PF +-5% 100VDC CER 0+-30	28480	0160-4765
A2C12	0160-4765	7		CAPACITOR-FXD 27PF +-5% 100VDC CER 0+-30	28480	0160-4765
A2C13	0180-4134	1		CAPACITOR-FXD 22UF 15V TA +-10% LVDC	56289	178D226X9015X
A2C14	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A2C15	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A2C16	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A2C17	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A2C18	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A2C19	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A2C20	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A2C21	0180-4134	1		CAPACITOR-FXD 22UF 15V TA +-10% LVDC	56289	178D226X9015X
A2C22	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A2CR1	1901-1065	1	9	DIODE-SCHOTTKY 1N5817 20V 1A	28480	1901-1065
A2CR2	1901-1065	1		DIODE-SCHOTTKY 1N5817 20V 1A	28480	1901-1065
A2CR3	1901-0538	3		DIODE-SM SIG SCHOTTKY	28480	1901-0538
A2CR4	1901-0538	3		DIODE-SM SIG SCHOTTKY	28480	1901-0538
A2CR5	1901-0539	3		DIODE-SM SIG SCHOTTKY	28480	1901-0539
A2CR6	1901-0539	3		DIODE-SM SIG SCHOTTKY	28480	1901-0539
A2CR7	1901-0539	3		DIODE-SM SIG SCHOTTKY	28480	1901-0539
A2CR8	1901-0539	3		DIODE-SM SIG SCHOTTKY	28480	1901-0539
A2CR9	1901-0539	3		DIODE-SM SIG SCHOTTKY	28480	1901-0539
A2CR10	1901-0539	3		DIODE-SM SIG SCHOTTKY	28480	1901-0539
A2CR11	1901-0539	3		DIODE-SM SIG SCHOTTKY	28480	1901-0539
A2RN1	1810-0620	5	1	NETWORK SHUNT 16-PIN DIP 8 SECTIONS 1	28480	1810-0620
A2R1	1810-0279	5	4	NETWORK RES 10-SIP 4.7K OHM X 9	01121	210A472
A2R2	0757-0442	9	8	RESISTOR 10K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1002-F
A2R3	0757-0394	0	1	RESISTOR 511 1% .125W F TC=0+-100	24546	C4-1/8-TO-511R-F
A2R4	1810-0231	3	1	NETWORK RES 8-SIP 2.2K OHM X 7	01121	208A222
A2R5	0757-0458	7	1	RESISTOR 51.1K 1% .125W F TC=0+-100	24546	C4-1/8-TO-5112-F
A2R6	0757-0442	9		RESISTOR 10K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1002-F
A2R7	1810-0279	5		NETWORK-RES 10-SIP 4.7K OHM X 9	01121	210A472
A2R8	0757-0442	9		RESISTOR 10K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1002-F
A2R9	1810-0279	5		NETWORK-RES 10-SIP 4.7K OHM X 9	01121	210A472
A2R10	0757-0442	9		RESISTOR 10K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1002-F
A2R11	0757-0442	9		RESISTOR 10K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1002-F
A2R12	0757-0442	9		RESISTOR 10K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1002-F
A2R13	0757-0279	0	1	RESISTOR 5.11K 1% .125W F TC=0+-100	24546	C4-1/8-TO-5111-F
A2R14	0757-0442	9		RESISTOR 10K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1002-F
A2R15	0757-0465	2	1	RESISTOR 3K 1% .125W F TC=0+-100	24546	C4-1/8-TO-3001-F
A2R16	0757-0442	9		RESISTOR 10K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1002-F
A2R17				NOT ASSIGNED		
A2R18	1810-0279	5		NETWORK-RES 10-SIP 4.7K OHM X 9	01121	210A472
A2S1	3101-2747	5	2	SWITCH-SL DIP 8 PC 0.1A 30VDC	00779	435353-5
A2S2	3101-2429	0	1	SWITCH-TGL SUBMIN SPDT .02A 20V=DC PC	28480	3101-2429
A2S3	3101-2747	5		SWITCH-SL DIP 8 PC 0.1A 30VDC	00779	435353-5
A2TP1 - TP11	1251-4707	8	11	CONNECTOR-SGL CONT PIN .031-.41 BSC-SZ	28480	1251-4707

See introduction to this section for ordering information
*Indicates factory selected value

Table 6-3. Replaceable Parts (Continued)

Reference Designation	HP Part Number	C D	Qty	Description	Mfr Code	Mfr Part Number
A2U1	1818-0438	4	2	IC-NMOS 4096 (4K) STAT RAM 450 NS 3-S	01295	TMS2114-45NL
A2U2	1818-0438	4		IC-NMOS 4096 (4K) STAT RAM 450 NS 3-S	01295	TMS2114-45NL
A2U3	1821-2284	3	1	IC DRVR TTL LS LINE DRVR OCTL	01295	SN74LS244N
A2U4	1820-2075	4	1	IC TRANSCEIVER TTL LS BUS OCTL	01295	SN74LS245N
A2U5	05528-80012	1	1	ROM-PROGRAMMED	28480	05528-80012
A2U6,U10				NOT ASSIGNED		
A2U11	1820-0885	1	1	IC GATE TTL S NAND QUAD 4-INP	01295	SN74S20N
A2U12	1820-2121	1	1	IC ENCODER TTL LS	01295	SN74LS348N
A2U13	1820-2582	4	1	IC NMOS 8-BIT MPU	28480	1820-2582
A2U14	1820-2108	8		IC LSH TTL LS D-TYPE OCTL	01295	SN74LS373N
A2U15	1820-1425	8	1	IC SCHMITT-TRIG TTL LS NAND QUAD 2-INP	01295	SN74LS132N
A2U16	1820-1205	0	1	IC GATE TTL LS AND QUAD 4-INP	01295	SN74LS21N
A2U17	1820-0810	6	1	IC INV TTL S HEX 1-INP	01295	SN74S04N
A2U18	1820-2424	7	2	IC TRANSCEIVER TTL MSTR-BUS IEEE-488	04713	MC3447P
A2U19	1820-1216	3	2	IC DCDR TTL LS 3-TO-8-LINE 3-INP	01295	SN74LS138N
A2U20	1820-1202	7	1	IC GATE TTL LS NAND TPL 3-INP	01295	SN74LS10N
A2U21	1820-1216	3		IC DCDR TTL LS 3-TO-8-LINE 3-INP	01295	SN74LS138N
A2U22				NOT ASSIGNED		
A2U23	1820-2424	7		IC TRANSCEIVER TTL INSTR BUS IEEE-488	04713	MC3447P
A2U24	1820-2118		1	IC MICROPROC-ACCESS NMOS	04713	MC68488L
A2XJMP1				NOT ASSIGNED		
A2XJMP2	1200-0607	0	1	SOCKET-IC 16-CONT DIP DIP-SLDR	28480	1200-0607
A2XU5	1200-0567	1		SOCKET-IC DIP 28-CONT DIP DIP-SLDR	00779	2-641466-1
A2W1	0159-0005	0	1	RESISTOR-ZERO OHMS 22AWG LEAD DIA	28480	0159-0005
A2Y1	0410-1160	0	1	CRYSTAL-QUARTZ 4.000 MHZ HC-18/U-HLDR	28480	0410-1160
				MISCELLANEOUS A2 PARTS		
A2MP1	5040-6058	1	2	BAR-SUPPORT	28480	5040-6058
A2MP2	5040-6058	1		BAR-SUPPORT	28480	5040-6058
A2MP3	0370-0103	5	2	KNOB BLK THRD FEMALE INSRT-BLK PLSTC	28480	0370-0103
A2MP4	5040-7787	5	2	PC BOARD HINGE HALF	28480	5040-7787
A2MP5	0403-0113	4	4	BUMPER FOOT-ADH MTG 0.94 WD 0.25 HT	28480	0403-0113
A2MP6	5040-7787	5	2	PC BOARD HINGE-HALF	28480	5040-7787
A2MP7	0370-0103	5	2	KNOB BLK THRD FEMALE INSERT BLK PLSTC	28480	0370-0103
	0624-0077		8	SCREW, TAPTITE 4-40 .312-LG POZI PAN HD	00000	ORDER BY DESCRIPTION
	2510-0043		2	SCREW-MACH 6-32 .312 IN-LG POZI PAN HD W/LKWR	00000	ORDER BY DESCRIPTION

See introduction to this section for ordering information
*Indicates factory selected value

Table 6-3. Replaceable Parts (Continued)

Reference Designation	HP Part Number	C D	Qty	Description	Mfr Code	Mfr Part Number
A7	05509-60003	8	1	A9 COUNTER BOARD	28480	05509-60003
A9C1	0180-0130	7	2	CAPACITOR-FXD 2.2UF 20V TA	56289	173D225X9020V
A9C2	0160-4554	7	51	CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C3	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C4	0160-4557	6	15	CAPACITOR-FXD .1UF ±20% 50VDC CER	16299	CAC04X7410M050A
A9C5	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C6	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C7	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C8	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C9	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C10	0180-0134	1	2	CAPACITOR-FXD 22UF 15V TA	56289	173D226X9015X
A9C11	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C12	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C13	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C14	0160-3874	2	2	CAPACITOR-FXD 10PF ±5% 200VDC CER	28480	0160-3874
A9C15	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C16	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C17	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C18	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C19	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C20	0160-4799	2	8	CAPACITOR-FXD 2.2PF ±.25PF 100VDC CER	28480	0160-4799
A9C21	0160-4799	2		CAPACITOR-FXD 2.2PF ±.25PF 100VDC CER	28480	0160-4799
A9C22	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C23	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C24	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C25	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C26	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C27	0160-4557	6		CAPACITOR-FXD .1UF ±20% 50VDC CER	16299	CAC04X7410M050A
A9C28	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C29	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C30	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C31	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C32	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C33	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C34	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C35	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C36	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C37	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C38	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C39	0160-4557	6		CAPACITOR-FXD .1UF ±20% 50VDC CER	16299	CAC04X7410M050A
A9C40	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C41	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C42	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C43	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C44	0160-4557	6		CAPACITOR-FXD .1UF ±20% 50VDC CER	16299	CAC04X7410M050A
A9C45	0160-4557	6		CAPACITOR-FXD .1UF ±20% 50VDC CER	16299	CAC04X7410M050A
A9C46	0180-0134	1		CAPACITOR-FXD 22UF 15V TA	56289	173D226X9015X
A9C47	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C48	0180-0236	1	2	CAPACITOR-FXD .47UF ±20% 50VDC	84411	HDW 349
A9C49	0160-4554	1		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C50	0160-4554	1		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C51	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C52	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C53	0160-3874			CAPACITOR-FXD 10PF ±5% 200VDC CER	28480	0160-3874
A9C54	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C55	0160-4799	2		CAPACITOR-FXD 2.2PF ±.25PF 100VDC CER	28480	0160-4799
A9C56	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C57	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C58	0180-0134	7		CAPACITOR-FXD 22UF 20V TA	56289	173D226X9020V
A9C59	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
A9C60	0160-4799	2		CAPACITOR-FXD 2.2PF ±.25PF 100VDC CER	28480	0160-4799

See introduction to this section for ordering information
*Indicates factory-selected value

Table 6-3. Replaceable Parts (Continued)

Reference Designation	HP Part Number	C D	Qty	Description	Mfr Code	Mfr Part Number
A3C61	0180-4965	7		CAPACITOR-FXD 47uF ±20% 50VDC	84411	HEW 346
A3C62	0160-4554	7		CAPACITOR-FXD .01uF ±20% 50VDC CER	28480	0160-4554
A3C63	0160-4554	7		CAPACITOR-FXD .01uF ±20% 50VDC CER	28480	0160-4554
A3C64	0160-3702	5	L	CAPACITOR-FXD .027uF ±5% 50VDC	28480	0160-3702
A3C65	0160-4554	7		CAPACITOR-FXD .01uF ±20% 50VDC CER	28480	0160-4554
A3C66	0160-4554	7		CAPACITOR-FXD .01uF ±20% 50VDC CER	28480	0160-4554
A3C67	0160-4554	7		CAPACITOR-FXD .01uF ±20% 50VDC CER	28480	0160-4554
A3C68	0160-4557	0		CAPACITOR-FXD .1uF ±20% 50VDC CER	16299	CAC04X7410M4360A
A3C69	0160-4554	7		CAPACITOR-FXD .01uF ±20% 50VDC CER	28480	0160-4554
A3C70	0160-4557	0		CAPACITOR-FXD .1uF ±20% 50VDC CER	16299	CAC04X7410M4360A
A3C71	0160-4557	0		CAPACITOR-FXD .1uF ±20% 50VDC CER	16299	CAC04X7410M4360A
A3C72	0160-4557	0		CAPACITOR-FXD .1uF ±20% 50VDC CER	16299	CAC04X7410M4360A
A3C73	0160-4557	0		CAPACITOR-FXD .1uF ±20% 50VDC CER	16299	CAC04X7410M4360A
A3C74	0160-4557	0		CAPACITOR-FXD .1uF ±20% 50VDC CER	16299	CAC04X7410M4360A
A3C75	0160-4557	0		CAPACITOR-FXD .1uF ±20% 50VDC CER	16299	CAC04X7410M4360A
A3C76	0160-4557	0		CAPACITOR-FXD .1uF ±20% 50VDC CER	16299	CAC04X7410M4360A
A3C77	0160-4557	0		CAPACITOR-FXD .1uF ±20% 50VDC CER	16299	CAC04X7410M4360A
A3C78	0160-4554	7		CAPACITOR-FXD .01uF ±20% 50VDC CER	28480	0160-4554
A3C79	0160-4554	7		CAPACITOR-FXD .01uF ±20% 50VDC CER	28480	0160-4554
A3CR1 - CR5	1901-0040	1	17	DIODE-SWITCHING 80V 50MA 2NS DO-35	28480	1901-0040
A3CR6				NOT ASSIGNED		
A3CR7 CR18	1901-0040	1		DIODE-SWITCHING 80V 50MA 2NS DO-35	28480	1901-0040
A3DS1 - DS2	1990-0698	0	2	LED-LAMP RUM-INT=1NCD IF=15MA-MAX	28480	HLMP-6600
A3J1 - J5	1251-4882	6	5	CONNECTOR 3-PIN M-POST TYPE	28480	1251-4882
A3R1	0698-3279	5	4	RESISTOR 4.99K 1% .125W TF TC=0±100	24637	CRB14 OR CRB25
A3R2	0757-0180		2	RESISTOR 31.6% .125W F TC=0±100	28480	0757-0180
A3R3	0698-3279	0		RESISTOR 4.99K 1% .125W TF TC=0±10	24637	CRB14 OR CRB25
A3R4	0698-0082	7	4	RESISTOR 464 1% .125W F TC=0±100	24546	C4-1/8-TO-4640-F
A3R5	1810-0264	9	6	NETWORK RESISTOR 6-SIP 470.0 OHM X 5	01121	206A471
A3R6	1810-0264	9		NETWORK RESISTOR 6-SIP 470.0 OHM X 5	01121	206A471
A3R7	0757-0441	8	4	RESISTOR 8.25K 1% .125W F TC=0±100	24546	C4-1/8-TO-8251-F
A3R8	0757-0441	8		RESISTOR 8.25K 1% .125W F TC=0±100	24546	C4-1/8-TO-8251-F
A3R9	0698-3438	3	4	RESISTOR 147 1% .125W F TC=0±100	24546	C4-1/8-TO-147R-F
A3R10	0698-3438	3		RESISTOR 147 1% .125W F TC=0±100	24546	C4-1/8-TO-147R-F
A3R11	1810-0264	5	4	NETWORK RESISTOR 6-SIP 470.0 OHM X 5	01121	206A471
A3R12	1810-0264	5		NETWORK RESISTOR 6-SIP 470.0 OHM X 5	01121	206A471
A3R13	1810-0264	9		NETWORK RESISTOR 6-SIP 470.0 OHM X 5	01121	206A471
A3R14	0757-0803	6	3	RESISTOR 2K 1% .125W F TC=0±100	24546	C4-1/8-TO-2001-F
A3R15	0698-3445	2	2	RESISTOR 348 1% .125W F TC=0±100	24546	C4-1/8-TO-348R-F
A3R16	0698-3445	2		RESISTOR 348 1% .125W F TC=0±100	24546	C4-1/8-TO-348R-F
A3R17	0757-0442	9	5	RESISTOR 10K 1% .125W F TC=0±100	24546	C4-1/8-TO-1002-F
A3R18	0757-0401	0	2	RESISTOR 100 1% .125W F TC=0±100	24546	C4-1/8-TO-101-F
A3R19	0757-0803	6		RESISTOR 2K 1% .125W F TC=0±100	24546	C4-1/8-TO-2001-F
A3R20	0698-3445	2		RESISTOR 348 1% .125W F TC=0±100	24546	C4-1/8-TO-348R-F
A3R21	0698-3445	2		RESISTOR 348 1% .125W F TC=0±100	24546	C4-1/8-TO-348R-F
A3R22	0757-0346	8	2	RESISTOR 42.2 1% .125W F TC=0±100	24546	C4-1/8-TO-42R2-F
A3R23	0698-0083	7		RESISTOR 464 1% .125W F TC=0±100	24546	C4-1/8-TO-4640-F
A3R24	0757-0401	0		RESISTOR 100 1% .125W F TC=0±100	24546	C4-1/8-TO-101-F
A3R25	0757-0346	8		RESISTOR 42.2 1% .125W F TC=0±100	24546	C4-1/8-TO-42R2-F
A3R26	0698-0083	7		RESISTOR 464 1% .125W F TC=0±100	24546	C4-1/8-TO-4640-F
A3R27	0757-0442	9		RESISTOR 10K 1% .125W F TC=0±100	24546	C4-1/8-TO-1002-F
A3R28	1810-0264	6	1	NETWORK RESISTOR 6-SIP 1.0K OHM X 7	01121	206A102
A3R29	0757-0449	6	7	RESISTOR 20K 1% .125W F TC=0±100	24546	C4-1/8-TO-2002-F
A3R30	0698-3279	0		RESISTOR-FXD 4.99K 1% .125W TF TC=0±100	24637	CRB14 OR CRB25
A3R31	0698-3442	9		RESISTOR 237 1% .125W F TC=0±100	24546	C4-1/8-TO-237R-F
A3R32	0698-3279	0		RESISTOR-FXD 4.99K 1% .125W TF TC=0±100	24637	CRB14 OR CRB25
A3R33	0757-0449	6		RESISTOR 20K 1% .125W F TC=0±100	24546	C4-1/8-TO-2002-F
A3R34	0757-0283	8		RESISTOR 2K 1% .125W F TC=0±100	24546	C4-1/8-TO-2001-F
A3R35	1810-0264	5		NETWORK RESISTOR 6-SIP 470.0 OHM X 7	01121	206A471

See introduction to this section for ordering information.
*Indicates factory-selected value.

Table 6-3. Replaceable Parts (Continued)

Reference Designation	HP Part Number	C D	Qty	Description	Mfr Code	Mfr Part Number
A2R35	1810-0303	5		NETWORK RESISTOR 5-SIP 470.0 OHM X 7	01121	208A471
A2R37	1810-0304	8		NETWORK RESISTOR 5-SIP 470.0 OHM X 5	01121	208A471
A2R38	0698-3445	2		RESISTOR 348 1% .125W F TC=0+100	24546	C4-1/8-TO-348R-F
A2R39	0698-3445	2		RES STOR 348 1% .125W F TC=0+100	24546	C4-1/8-TO-348R-F
A2R40	1810-0304	5		NETWORK RES-STOR 5-SIP 470.0 OHM X 5	01121	208A471
A2R41	1810-0304	9		NETWORK RESISTOR 5-SIP 470.0 OHM X 5	01121	208A471
A2R42	1810-0271	2	2	NETWORK RESISTOR 9-SIP 100K OHM X 7	01121	208A104
A2R43	0698-0082	7		RESISTOR 464 1% .125W F TC=0+100	24546	C4-1/8-TO-464R-F
A2R44	0698-3435	0		RESISTOR 147 1% .125W F TC=0+100	24546	C4-1/8-TO-147R-F
A2R45	0757-0441	6		RESISTOR 5.23K 1% .125W F TC=0+100	24546	C4-1/8-TO-5231-F
A2R46	0757-0441	8		RESISTOR 5.23K 1% .125W F TC=0+100	24546	C4-1/8-TO-5231-F
A2R47	0757-0458	7	1	RESISTOR 31.6K 1% .125W F TC=0+100	19701	CRD1/8 OR CRD25
A2R48	0698-3438	3		RESISTOR 147 1% .125W F TC=0+100	24546	C4-1/8-TO-147R-F
A2R49	1810-0271	8		NETWORK RESISTOR 9-SIP 100K OHM X 7	01121	208A104
A2R50	1810-0498	0	1	NETWORK RESISTOR 4-SIP MULT VALUE	28480	1810-0498
A2R51	0757-0442	9		RESISTOR 10K 1% .125W F TC=0+100	24546	C4-1/8-TO-1002-F
A2R52	0698-0844	2	1	RES STOR 95K 1% .125W F TC=0+25	28480	0698-6944
A2R53	0757-0442	9		RES STOR 10K 1% .125W F TC=0+100	24546	C4-1/8-TO-1002-F
A2R54	0757-0442	9		RES STOR 10K 1% .125W F TC=0+100	24546	C4-1/8-TO-1002-F
A2R55	1810-0058	9	2	NETWORK RESISTOR 10-SIP 22K OHM X 8	11236	750-1C10-R22K
A2R56 A2R57 - R59	1810-0274 NOT ASSIGNED	4	1	NETWORK RESISTOR 14-DIP 330 OHM X 7	01121	214B331
A2R60	1810-0058	9		NETWORK RESISTOR 10-SIP 22K OHM X 8	11236	750-1C10-R22K
A2R61	0757-1102	8	1	RESISTOR 100 1% .125W F TC=0+100	24546	C4-1/8-TO-101-F
A2R62	0757-0709	1	1	RESISTOR 80.1 1% .05W F TC=0+100	24546	C5-1/8-TO-80R1-F
A2S1 - 50	3101-1956	5	2	SWITCH-SLIDE DIP-SLIDE ASSY .1A 50VDC	28480	3101-1956
A2TP1 - *140	0360-0129	3	40	CONNECTOR-SGL CONT PIN .04-IN-BSC-SZ PIN	28480	0360-0129
A2U1	1820-1430	3	6	IC-CNTR TTL LS BIN SYNCHRO POS-EDGE-TRIG	01295	SN74LS161AN
A2U2	1820-1430	3		IC-CNTR TTL LS BIN SYNCHRO POS-EDGE-TRIG	01295	SN74LS161AN
A2U3	1820-0810	2	1	IC GATE ECL OR-NOR TPL	04713	MC10102P
A2U4	1820-0126	5	1	IC CNTR ECL HEXADEC SYNCHRO	04713	MC10138P
A2U5	1820-0817	5	1	IC FF ECL D M/S DUAL	04713	MC10131P
A2U6	1828-0120	2	1	IC TIMER TTL MONO-S-ASTBL	15324	Nissan
A2U7	1820-1997	7	1	IC FF TTL LS D-TYPE POS-EDGE-TRIG PRI-IN	34335	AM74LS374AP
A2U8	1820-1420	3		IC CNTR TTL LS BIN SYNCHRO POS-EDGE-TRIG	01295	SN74LS161AN
A2U9	1820-0817	4		IC FF ECL D-M/S DUAL	04713	MC10131P
A2U10	1820-2125	4		IC CNTR ECL HEXADEC SYNCHRO	04713	MC10136P
A2U11	1820-1532	7	2	IC CNTR ECL BIN ASYNCHRO POS-EDGE-TRIG	04713	MC10178P
A2U12	1820-0782	8	2	IC PLL LOOP	28480	1826-0782
A2U13	1820-1997	7		IC FF TTL LS D-TYPE POS-EDGE-TRIG PRI-IN	34335	AM74LS374AP
A2U14	1820-2144	0	4	IC RCVR TTL LINE RCVR QUAD	04713	MC3486P
A2U15	1820-2144	3		IC RCVR TTL LINE RCVR QUAD	04713	MC3486P
A2U16	1820-0810	2		IC GATE ECL OR-NOR TPL	04713	MC10102P
A2U17	1820-1199	3	2	IC FF ECL D TYPE COM CLOCK HEX	04713	MC10175P
A2U18	1820-1244	6	2	IC PLL LOOP 14-DIP-C PKG	04713	MC12040L
A2U19	1820-2244	9	1	IC FF TTL LS D-TYPE POS-EDGE-TRIG DUAL	01295	SN74LS273N
A2U20	1820-0689	6	2	IC INV TTL S HEX 1-INP	01295	SN74S04N
A2U21	1820-1272	1	1	IC BFR TTL LS NOR QUAD 2-INP	01295	SN74LS02N
A2U22	1820-1112	8	5	IC FF TTL LS D-TYPE POS-EDGE-TRIG	01295	SN74LS74AN
A2U23	1820-1112	8		IC FF TTL LS D-TYPE POS-EDGE-TRIG	01295	SN74LS74AN
A2U24	1820-1237	2	1	IC GATE TTL LS NAND 8-INP	01295	SN74LS30N
A2U25	1820-2809	6	1	IC RCVR ECL LINE RCVR QUAD 2-INP	04713	MC10115P
A2L26	1820-2024	3	4	IC DRVR TTL LS LINE DRVR OCTL	01295	SN74LS844N
A2L27	1820-1216	5	2	IC DCDR TTL LS 3-TO-8 LINE S INP	01295	SN74LS138N
A2L28	1820-1201	5	1	IC INV TTL LS HEX	01295	SN74LS05N
A2L29	1820-1112	8		IC FF TTL LS D-TYPE POS EDGE TRIG	01295	SN74LS74AN
A2L30	1820-1112	8		IC FF TTL LS D-TYPE POS EDGE TRIG	01295	SN74LS74AN
A2L31	1826-0138	9	1	IC DP AMP OP DUAL 8-DIP-P PKG	3L585	CA1458F
A2L32	1820-1425	4	1	IC INV TTL LS MONOSTBL RETRIG DUAL	01295	SN74LS123N
A2L33	1820-1997	7		IC FF TTL LS D-TYPE POS-EDGE-TRIG PRI-IN	34335	AM74LS374AP

See introduction to this section for ordering information
*Indicates factory-selected value

Table 6-3 Replaceable Parts (Continued)

Reference Designation	HP Part Number	C D	Qty	Description	Mfr Code	Mfr Part Number
A3U34	1820-0143	5		IC DRVR TTL LINE RCVR QUAD	04713	MC3486P
A3U35	1820-2144	6		IC RCVR TTL LINE RCVR QUAD	04713	MC3486P
A3U36	1820-0820	7		IC GATE ECL OR-NOR TPL	04713	MC10105P
A3U37	1820-1399	3		IC FF ECL D-TYPE DCN CLOCK HEX	04713	MC10107P
A3U38	1820-1344	3		IC PLL LOOP 4-DIP-C PKG	04713	MC12040L
A3U39	1820-1997	7		IC FF TTL LS D-TYPE POS-EDGE TRIG PRE-IN	34335	AM74LS374PC
A3U40	1820-1430	3		IC CNTR TTL LS BIN SYNCHRO POS-EDGE-TRIG	01295	SN74LS161AN
A3U41	1820-1611	4		IC FF ECL D-M/S DUAL	04713	MC10131P
A3U42	1820-2126	8		IC CNTR ECL HEXADEC SYNCHRO	04713	MC10136P
A3U43	1820-1832	7		IC CNTR ECL BIN ASYNCHRO POS-EDGE-TRIG	04713	MC10179P
A3U44	1858-0782	8		IC PLL LOOP	25480	1876-0782
A3U45	1820-1431	3		IC CNTR TTL LS BIN SYNCHRO POS-EDGE-TRIG	01295	SN74LS161AN
A3U46	1820-1430	3		IC CNTR TTL LS BIN SYNCHRO POS-EDGE-TRIG	01295	SN74LS161AN
A3U47	1820-0803	2		IC GATE ECL OR-NOR TPL	04713	MC10105P
A3U48	1820-2125	8		IC CNTR ECL HEXADEC SYNCHRO	04713	MC10136P
A3U49	1820-0847	8		IC FF ECL D-M/S DUAL	04713	MC10131P
A3U50	1820-2084	3		IC DRVR TTL LS LINE DRVR OCTL	01295	SN74LS244N
A3U51	1820-1216	3		IC DCDR TTL LS 3-TO-8-LINE INV	01295	SN74LS138N
A3U52	1820-0683	6		IC INV TTL S HEX 1-INP	01295	SN74S04N
A3U53	1820-1201	8	1	IC GATE TTL LS AND QUAD 2-INP	01295	SN74LS08N
A3U54	1820-1112	8		IC FF TTL LS D-TYPE POS-EDGE-TRIG	01295	SN74LS74AN
A3U55	1820-2096	9	1	IC CNTR TTL LS BIN DUAL 4-BIT	01295	SN74LS393N
A3U56	1820-1119	5		IC FF TTL LS D-TYPE POS EDGE TRIG	01295	SN74LS75AN
A3U57	1826-0056	3	1	IC COMPARATOR PRCN 8-DIP-P PKG	27014	LM311DC
A3U58	1820-2024	3		IC DRVR TTL LS LINE DRVR OCTL	01295	SN74LS244N
A3U59	1820-2056	1	1	IC FF TTL LS D-TYPE POS-EDGE TRIG DCM	01295	SN74LS377N
A3U60	1826-1799	2	2	IC ANALOG SWITCH 4-SPST 16-DIP-P	27014	LF13331N
A3U61	1826-0035	2	1	IC V REG TP TO 92	04713	MC79L05C
A3L62	1820-2024	3		IC DRVR TTL LS LINE DRVR OCTL	01295	SN74LS244N
A3L63	1820-1858	3		IC FF TTL LS D-TYPE OCTL	01295	SN74LS377N
A3L64	1200-0610	6	1	IC PACKAGE	28480	1200-0610
A3L65	1826-1053	4	1	AID 12-BIT 40-DIP-C CMOS	15818	7109CD
A3L66	1826-1795	3		IC ANALOG SWITCH 4-SPST 16-DIP-P	27014	LF13331N
A3L67	1826-0965	9	1	IC AD 564KH	28480	1826-0965
				MISCELLANEOUS A3 PARTS		
	0340-0962	A	3	TERMINAL-STUD SPCL-FEEDTHRU PRESS FIT	95291	011 8829 000 205
	0340-0992	D	3	TERMINAL-STUD SPCL-FEEDTHRU PRESS FIT	28480	0340-0992
	0360-2694		2	SPACER-SNAP-IN 0.5CD	28480	0360-0694
	0624-2077	6	8	SCREW-TPG 4-40 .312-IN-LG PAN-HD-POZ	28480	0624-2077
	0624-2072		2	SCREW-TPG 6-32 .375-IN-LG PAN-HD POZ	28480	ORDER BY DESCRIPTION
	0380-0113	7	2	SCREW-MACH 4-32 .25-IN-LG PAN-HD POZI	28480	ORDER BY DESCRIPTION
	1258-0141		5	JUMPER, REMOVABLE	28480	1258-0141
	5040-6068		2	BAR-SUPPORT	28480	5040-6065
	5040-7721	7	2	HINGE-PC BOARD	28480	5040-7721
	05503-00007	1	2	FASTENER-PC BOARD INTERLOCK	28480	05503-00007
A4	**05503-60004**	**9**	**1**	**A4 CONNECTOR BOARD ASSEMBLY**	**28480**	**05503-60004**
A4C1-C9	0160-3879	7	9	CAPACITOR-FXD .01 UF +-20% 100VDC CER	28480	0160-3879
A4CR1	1902-3182	0	1	DIODE ZNR 12.1V 5% DO-35 PD=.4W	28480	1902-3182
A4J1	1251-6708	9	1	CONNECTOR 26-PIN M POST TYPE	28480	1251-6708
A4J2 - J3	1251-6702	6	3	CONNECTOR 6-PIN F CIRCULAR	28480	1251-6702
A4J4	1251-6702	6	1	CONNECTOR 10-PIN F CIRCULAR	28480	1251-6702
A4J5	1251-4740	7	1	CONNECTOR 14-PIN M POST TYPE	28480	1251-4740
A4J7	1251-8247	9	1	CONNECTOR 4-PIN F CIRCULAR	28480	1251-8247
A4J8	1251-7189	5	1	CONNECTOR 18-PIN F CIRCULAR	28480	1251-7189
A4R1	1810-0258	2	1	NETWORK-RESISTOR 6-SIP 10 CK OHM X 5	01121	10A10C
A4R2 - R3	0757-0289	5	2	RESISTOR 82.5 1% .125W F TC=0+-100	28480	C4-1/8-TO-82R5-F
A4S1	3101-2411	C	1	SWITCH-TGL SUBMIN SPDT CBA BOX/ACTDC PC	28480	3101-2411
	0380-0836	5	12	STANDOFF-RVT-DN .438-IN-LG 6-32 THD	00000	ORDER BY DESCRIPTION

See introduction to this section for ordering information
*Indicates factory-selected value.

Table 6-3. Replaceable Parts (Continued)

Reference Designation	HP Part Number	C D	Qty	Description	Mfr Code	Mfr Part Number
A5	05508-60005	0	1	A5 POWER SUPPLY (SERIES 2628)	28480	05508-60005
A5C1	0180-3579	6	1	CAPACITOR-FXD 500UF +75-10% 80VDC AL	28480	0180-3579
A5C2	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A5C3	0180-0049	9	2	CAPACITOR-FXD 20UF +75-10% 50VDC AL	56289	30D206G050CC2
A5C4	0160-4812	0	2	CAPACITOR-FXD 220PF +-5% 100VDC CER	28480	0160-4812
A5C5	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A5C6	0160-4557	0	4	CAPACITOR-FXD .1UF +-20% 50VDC CER	56289	C410C104M5R5-4
A5C7	0160-4557	0		CAPACITOR-FXD .1UF +-20% 50VDC CER	56289	C410C104M5R5A
A5C8	0180-0049	9		CAPACITOR-FXD 20UF +75-10% 50VDC AL	56289	30D206G050CC2
A5C9	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A5C10	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A5C11	0180-3238	4	1	CAPACITOR-FXD 25 300UF	28480	0180-3238
A5C12	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A5C13	0160-4557	0		CAPACITOR-FXD .1UF +-20% 50VDC CER	56289	C410C104M5R5A
A5C14	0160-4812	0		CAPACITOR-FXD 220PF +-5% 100VDC CER	28480	0160-4812
A5C15	0160-4557	0		CAPACITOR-FXD .1UF +-20% 50VDC CER	56289	C410C104M5R5A
A5C16	0180-3418	3	1	CAPACITOR-FXD 3.3UF +75-10% 75VDC AL	28480	0180-3418
A5CR1	1901-0040	1	3	DIODE-SWITCHING 30V 50MA 2NS DO-35	28480	1901-0040
A5CR2	1901-0731	5	4	DIODE-POWER RECT 400V 1A	28480	1901-0731
A5CR3	1901-0731	7		DIODE-POWER RECT 400V 1A	28480	1901-0731
A5CR4				NOT ASSIGNED		
A5CR5	1901-0040	1		DIODE-SWITCHING 30V 50MA 2NS	28480	1901-0040
A5CR6	1902-0049	2	2	DIODE-ZNR 6.19V 5% DO-35 PD=.4W	28480	1902-0049
A5CR7	1902-0049	2		DIODE-ZNR 6.19V 5% DO-35 PD=.4W	28480	1902-0049
A5CR8	1902-0074		1	DIODE-ZENER 7.15V 5% DO-35 PD=.4W	28480	1902-0074
A5CR9				NOT ASSIGNED		
A5CR10	1901-0731	7		DIODE-POWER RECT 400V 1A	28480	1901-0731
A5CR11	1901-0731	7		DIODE-POWER RECT 400V 1A	28480	1901-0731
A5CR12	1902-0048	6	1	DIODE-ZNR 1N5340B 6V 5% PD=5W IR=1UA	04713	1N5340B
A5CR13	1902-0632	9	1	DIODE-ZNR 1N5348 11V 5% PD=5W TC=+.5%	04713	1N5348
A5CR14	1901-0040	1		DIODE-SWITCHING 30V 50MA 2NS DO-35	28480	1901-0040
A5CR15	1901-0697	9	2	DIODE-PWR RECT 200V 3A 200NS	04713	MR852
A5CR16	1901-0697	9		DIODE-PWR RECT 200V 3A 200NS	04713	MR852
A5CR17	1902-0184	6	1	DIODE-ZNR 10.2V 5% DO-35 PD=.4W	28480	1902-0184
A5DS1	1990-0487	7	2	LED-LAMP LUM-INT=1MCD IF=20MA-MAX BVR=5V	28480	5082-4584
A5DS2	1990-0485	5	2	LED-LAMP LUM-INT=800UCD IF=20MA-MAX	28480	5082-4684
A5DS3	1990-0487	7		LED-LAMP LUM-INT=1MCD IF=20MA-MAX BVR=5V	28480	5082-4584
A5DS4	1990-0485	5		LED-LAMP LUM-INT=800UCD IF=20MA-MAX	28480	5082-4684
A5F1	2110-0010	9	2	FUSE 3A 250V NTD 1.25X.25 UL	75915	312006
A5F2	2110-0010	9		FUSE 3A 250V NTD 1.25X.25 UL	75915	312006
A5J1	1251-6706	8	1	CONNECTOR 50-PIN M POST TYPE	28480	1251-6706
A5J3	1251-4740	7	1	CONNECTOR 14-PIN M POST TYPE	28480	1251-4740
A5J4	1251-5322	5	1	CONNECTOR 6-PIN M POST TYPE	28480	1251-5322
A5J5	1251-5999	2	1	CONNECTOR 15-PIN M POST TYPE	28480	1251-5999
A5Q1	1854-0215	8	2	TRANSISTOR NPN SI PD=310MW FT=300MHZ	04713	SPS9014
A5Q2	1854-0215	8		TRANSISTOR NPN SI PD=310MW FT=300MHZ	04713	SPS9014
A5R1				NOT ASSIGNED		
A5R2	0757-0280	3	6	RESISTOR 1K 1% .125W F TC=0+-100	24546	C4-1/8-TC-1001-F
A5R3	0698-3443	8	2	RESISTOR 3.16 1% .125W F TC=0+-100	24546	C4-1/8-TC-3160-F
A5R4	0757-0198	2	1	RESISTOR 100 1% .5W F TC=0+-100	28480	0757-0198
A5R5	0811-3499	5	2	RESISTOR .07 5% 2.5W TC=0+-90	28480	0811-3499
A5R6				NOT ASSIGNED		
A5R7	0757-0280	3		RESISTOR 1K 1% .125W F TC=0+-100	24546	C4-1/8-TC-1001-F
A5R8	0757-0458	7	3	RESISTOR 51.1K 1% .125W F TC=0+-100	24546	C4-1/8-TC-5112-F
A5R9	0757-0458			RESISTOR 51.1K 1% .125W F TC=0+-100	24546	C4-1/8-TC-5112-F
A5R10				NOT ASSIGNED		

See introduction to this section for ordering information
*Indicates factory selected value.

Table 6-3. Replaceable Parts (Continued)

Reference Designation	HP Part Number	C D	Qty	Description	Mfr Code	Mfr Part Number
A5R11				NOT ASSIGNED		
A5R12	0698-0084	9	2	RESISTOR 2.15K 1% .125W F TC=0+-100	24546	C4-1/8-TO-2151-F
A5R13	0757-0466	6	2	RESISTOR 100K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1003-F
A5R14	0698-3156	1	1	RESISTOR 4.64K 1% .125W F TC=0+-100	24546	C4-1/8-TO-4641-F
A5R15	0757-0280	3		RESISTOR 1K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1001-F
A5R16	0698-3157	0	1	RESISTOR 16.9K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1692-F
A5R17				NOT ASSIGNED		
A5R18	0811-3459	X		RESISTOR .07 5% 5W PW TC=0+-50	28480	0811-3459
A5R19	0757-0280	1		RESISTOR 1K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1001-F
A5R20				NOT ASSIGNED		
A5R21	0757-0280	1		RESISTOR 1K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1001-F
A5R22	0727-0298	1	1	RESISTOR 9.09K 1% .125W F TC=0+-100	19701	MF4C1/8-TO-9091-F
A5R23	0757-0465	6		RESISTOR 100K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1003-F
A5R24	0698-3448	1		RESISTOR 316 1% .125W F TC=0+-100	24546	C4-1/8-TO-316R-F
A5R25	0757-0443	7		RESISTOR 7.5K 1% .125W F TC=0+-100	24546	C4-1/8-TO-7501-F
A5R26				NOT ASSIGNED		
A5R27	0757-0438	3	1	RESISTOR 5.11K 1% .125W F TC=0+-100	24546	C4-1/8-TC-5111-F
A5R28	0757-0442	9		RESISTOR 10K 1% .125W F TC=0+-100	24546	C4-1/8-TC-1002-F
A5R29	0757-0280	3		RESISTOR 1K 1% .125W F TC=0+-100	24546	C4-1/8-TC-1001-F
A5R30	0698-5375	3	1	RESISTOR 499K 1% .125W F TC=0+-100	24546	C4-1/8-TC-1003-F
A5R31	0757-0714	5		RESISTOR 4.21K 1% .25W F TC=0+-100	28480	0757-0714
A5R32	0698-3441	8		RESISTOR 215 1% .125W F TC=0+-100	24546	C4-1/8-TO-215R-F
A5R33	0757-0458			RESISTOR 34.0K 1% .125W F TC=0+-100	24546	C4-1/8-TO-3402-F
A5R34	0698-3430	5	1	RESISTOR 21.5 1% .125W F TC=0+-100	03888	PME55-1/8-TO-21R5-F
A5R35	0698-3094	9		RESISTOR 2.15K 1% .125W F TC=0+-100	24546	C4-1/8-TO-2151-F
A5TP1 - TP5	0360-0124	0	5	CONNECTOR-SOL CONT PIN 0.64/0.650-SZ-BRD	28480	0360-0124
A5U1	1826-0630	9		IC VOLT-REG ADJ 2.5/100 TO-99 PKG	28480	1826-0630
A5U2	1826-0490	1	2	IC OP AMP GP 8-DIP-P PKG	04713	LM301AN
A5U3	1826-0214	1		IC V-REGULATOR TO-220	04713	MC7915CT
A5U4	1826-0491	6	1	IC OP AMP GP 8-DIP-P PKG	27014	LM308N
A5U5	1826-0490	1		IC OP AMP GP 8-DIP-P PKG	27014	LM301AN
A5U6	1826-0607	6	1	IC-REGULATOR 7815	28480	1826-0607
A5XF1 - F2	2110-0269	0	2	FUSEHOLDER-CLIP TYPE 3AG-FUSE	28480	2110-0269
				MISCELLANEOUS A5 PARTS		
	1205-0403	4	2	HEAT SINK ASY TO-220-CS	28480	1205-0403
	2190-0018	5	2	WASHER-LK HLCL NO 6 .141-ID	28480	2190-0018
	2190-0034	5	4	WASHER-LK HLCL NO 10 .194-ID	28480	2190-0034
	2420-0003	7	2	NUT-HEX-DBL-CHAM 4-40-THD .094-THK	28480	2420-0003
	0360-0127	6	4	SCREW-MACH 10-32 .312-PN-LG	07000	ORDER BY DESCRIPTION
	1400-0694	9	1	CLAMP 5L CA 75-WD NYLON	28480	1400-0694
A6	05508-60021	0	1	A6 REMOTE CONTROL UNIT (SERIES 2108)	28480	05508-60021
A6A1	05508-60020	8	1	REMOTE CONTROL PC BOARD ASSEMBLY	28480	05508-60020
A6A1C1	0160-4130		1	CAPACITOR-FXD 6.8UF 20V TA	56289	1C3D225X9020V
A6A1C2	0160-4561	0	2	CAPACITOR-FXD .01UF +-20% 50VDC CER	12969	CAC08K7R1C+MC20A
A6A1C3	0160-4561	0		CAPACITOR-FXD .01UF +-20% 50VDC CER	12969	CAC08K7R1C+MC20A
A6A1CR1	1902-3070	5	1	DIODE-ZENER 6.22V 5% DO-35 0W 4W	28480	1902-3070
A6A1R1	0757-0428	1	1	RESISTOR 1.82K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1821-F
A6A1R2	0757-0394	0	1	RESISTOR 51.1 1% .125W F TC=0+-100	24546	C4-1/8-TO-51R1-F
A6A1S1	3101-2489	2	2	SWITCH-PUSH SUBMIN SPST .024 25VAC/DC PC	28480	3101-2489
A6A1S2	3101-2489	2		SWITCH-PUSH SUBMIN SPST .024 25VAC/DC PC	28480	3101-2489
				FOR 5508A MISCELLANEOUS AND CHASSIS PARTS SEE FIGURES 6-1 THROUGH 6-8		

See introduction to this section for ordering information
*Indicates factory selected value

Table 6-4. Replaceable Parts (Continued)

Reference Designation	HP Part Number	C D	Qty	Description	Mfr Code	Mfr Part Number
A1	05518-60001	9	1	A1 CONNECTOR BOARD ASSY (DATE CODE 8232)	28480	05518-60001
A1C1	0160-4557	0	5	CAPACITOR-FXD .1UF +-20% 50VDC CER	16299	C4CD43Y5R104M050A
A1C2	0180-4133	9	1	CAPACITOR-FXD 6.8UF 35V TA	56289	173D685X9035X
A1C3	0160-4557	0		CAPACITOR-FXD .1UF +-20% 50VDC CER	04222	C4CDC10AW1B5CA
A1C4	0180-2867	3	1	CAPACITOR-FXD 330UF +10-10% 40VDC AL	28480	0180-2867
A1C5	0160-4557	0		CAPACITOR-FXD .1UF +-20% 50VDC CER	04222	C4CDC10AW1B5CA
A1CR1	1901-0731	3	1	DIODE-PWR RECT 400V 1A	28480	1901-0731
A1CR2	1902-0632	9	1	DIODE-ZNR 1N5354B 17V 5% PD=5W TC=+.76%	04713	1N5354B
A1DS1 - DS3	1990-0895	1	3	LED-LAMP LUM INT=60MCD IF=100UA MAX	28480	1990-0895
A1F1	2110-0007	4	1	FUSE 1A 250V TD 1.25X.25UL	75915	313001
A1J1	1251-6777	4	1	CONNECTOR 20-PIN F POST TYPE	28480	1251-6777
A1J2	1251-7150	5	1	CONNECTOR 16-PIN F CIRCULAR	28480	1251-7150
A1J3	1251-6010	8	1	CONNECTOR 9-PIN M POST TYPE	28480	1251-6010
A1J4	1251-3179	9	1	CONNECTOR 24-PIN M POST TYPE	28480	1251-3179
A1R1	0757-0338	2	2	RESISTOR 1K 1% .25W F TC=0+-100	28548	C5-1/4-TO-1001-F
A1R2	0757-0338	2		RESISTOR 1K 1% .25W F TC=0+-100	28548	C5-1/4-TO-1001-F
A1R3	3100-3274	2	1	RESISTOR-TRMR 10K 10% C SIDE-ADJ 1-TRN	28480	3100-3274
A1R4	0757-0279	0	1	RESISTOR 3.16K 1% .125W F TC=0+-100	28548	C4-1/8-TO-3161-F
A1S1 - S2				REPLACED BY JUMPER WIRE (PN 8150-0025)		
A1XF1	2110-0269	0	2	FUSEHOLDER-CLIP TYPE 250-AUSE	28480	2110-0269
				MISCELLANEOUS A1 PARTS		
	0380-1548	6	4	STANDOFF-RIVET 10 LM 2.5	28480	0380-1548
	0380-1814	4	2	STANDOFF-HEX	28480	0380-1814
A2	05518-60002	9	1	A2 RECEIVER BOARD ASSY (SERIES 2524)	28480	05518-60002
A2C1	0180-4554	7	3	CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0180-4554
A2C2	0160-4557	0	5	CAPACITOR-FXD .1UF +-20% 50VDC CER	16299	C4CD43Y5R104M050A
A2C3	0160-4557	0		CAPACITOR-FXD .1UF +-20% 50VDC CER	16299	C4CD43Y5R104M050A
A2C4	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A2C5	0160-4557	0		CAPACITOR-FXD .1UF +-20% 50VDC CER	16299	C4CD43Y5R104M050A
A2C6	0180-4120	4	1	CAPACITOR-FXD 10UF 35V TA	56289	173D106X9035W
A2C7	0180-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0180-4554
A2C8	0160-4557	0		CAPACITOR-FXD .1UF +-20% 50VDC CER	16299	C4CD43Y5R104M050A
A2C9	0160-4557	0		CAPACITOR-FXD .1UF +-20% 50VDC CER	16299	C4CD43Y5R104M050A
A2CR2	1901-0518	8	1	DIODE-SM SIG SCHOTTKY	28480	1901-0518
A2CR3	1990-0770	1	1	PHOTODIODE ID=30NA MAX	32864	OP 913 (SELECTED)
A2DS1 - DS7	1990-0885	1	2	LED-LAMP LUM INT=50MCD IF=10.0UA MAX	28480	1990-0885
A2J1	1251-3179	9	1	CONNECTOR 24-PIN M POST TYPE	28480	1251-3179
A2J2	1251-6779	6	1	CONNECTOR 10-PIN F POST TYPE	28480	1251-6779
A2Q1	1855-0082	2	1	TRANSISTOR J-FET P-CHAN D-MODE SI	28480	1855-0082
A2Q2	1854-0215	1	1	TRANSISTOR NPN SI PD=350MW FT=300MHZ	04713	2N3904
A2R1	0757-0441	7	1	RESISTOR 8.25K 1% .125W F TC=0+-100	28480	0757-0441
A2R2	0698-8859	3	2	RESISTOR 619K 1% .25W F TC=0+-100	28480	0698-8859
A2R3	3100-3109	2	1	RESISTOR-TRMR 2K 10% C SIDE-ADJ 1-TRN	02111	43P202
A2R4	0698-3160	6	1	RESISTOR 31.6K 1% .125W F TC=0+-100	24546	C4-1/8-TO-3162-F
A2R5	0757-0440	7	1	RESISTOR 7.5K 1% .125W F TC=0+-100	24546	C4-1/8-TO-7501-F
A2R6	0698-3447	1	1	RESISTOR 316 1% .125W F TC=0+-100	24546	C4-1/8-TO-3160-F
A2R7	0757-0451	2	1	RESISTOR 68.1K 1% .125W F TC=0+-100	24546	C4-1/8-TO-6812-F
A2R8	0757-0416	7	4	RESISTOR 511 1% .125W F TC=0+-100	24546	C4-1/8-TO-5110-F
A2R9	0757-0416	7		RESISTOR 511 1% .125W F TC=0+-100	24546	C4-1/8-TO-5110-F
A2R10	0757-0416	7		RESISTOR 511 1% .125W F TC=0+-100	24546	C4-1/8-TO-5110-F

See introduction to this section for ordering information.
*Indicates factory-selected value.

Table 6-4. Replaceable Parts (Continued)

Reference Designation	HP Part Number	C D	Qty	Description	Mfr Code	Mfr Part Number
A2R11	0698-8155	1	1	RESISTOR 4.64K 1% .25W F TC=0+-100	24546	C4-1/8-TO-4641-F
A2R12	0757-0338	2	1	RESISTOR 1K 1% .25W F TC=0+-100	24546	C8-1/4-C0-1001-F
A2R13	0698-8959	3		RESISTOR 619K 1% .125W F TC=0+-100	28480	0698-8959
A2TP1	0360-0124	5	1	CONNECTOR SGL CONT PIN .04-IN-BSC-.52 BNZ	28480	0360-0124
A2U1	1826-0775	8	*	IC 16 CHP P PKG	28480	1826A
				MISCELLANEOUS A2 PARTS		
	0340-0807	6	1	INSULATOR-TRANSISTOR NYLON	28480	0340-0807
	4040-1814	4	2	STANDOFF LED	76480	4040-1814
A3	05316460003	0	1	A3 CONTROLLER/REFERENCE (SD DATE CODE 8102Y)	28480	05316-60003
A3C1	0180-2829	8	1	CAPACITOR-FXD 68UF +-10% 16VDC TA	28480	0180-2829
A3C2	0160-4554	7	11	CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A3C3	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A3C4	0180-4132	0	1	CAPACITOR-FXD 20V TA	56289	173D156X9020F
A3C5	0160-4557	0		CAPACITOR-FXD 1UF +-20% 50VDC CER	16299	CAC04X7R105M050A
A3C6	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A3C7	0180-1735	2	1	CAPACITOR-FXD 22UF +-10% 35VDC TA	56289	150D226X9035A2
A3C8	0140-4813	0	1	CAPACITOR-FXD 220PF +-5% 100VDC CER	28480	0140-4813
A3C9	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A3C10	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A3C11	0180-0049	9	2	CAPACITOR-FXD 20UF +75-10% 50VDC AL	56289	30D206G050CC2
A3C12	0180-0049	9		CAPACITOR-FXD 20UF +75-10% 50VDC AL	56289	30D206G050CC2
A3C13	0160-3872	2	2	CAPACITOR-FXD 1UF +-10% 100VDC MET-POLYE	28480	0160-3872
A3C14	0160-3872	2		CAPACITOR-FXD 1UF +-10% 100VDC MET-POLYE	28480	0160-3872
A3C15	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A3C16	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A3C17	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A3C18	0160-2453	4	1	CAPACITOR-FXD .22UF +-10% 50VDC POLYE	28480	0160-2453
A3C19	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A3C20	0180-0237	5	1	CAPACITOR-FXD 01UF +-20% 50VDC CER	28480	0160-0237
A3C21	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A3C22	0160-0576	5	3	CAPACITOR-FXD .1UF +-20% 50VDC CER	28480	0160-0576
A3C23	0160-4557	0		CAPACITOR-FXD 1UF +-20% 50VDC CER	16299	CAC04X7R105M050A
A3C24	0160-4557	0		CAPACITOR-FXD 1UF +-20% 50VDC CER	16299	CAC04X7R105M050A
A3C25				NOT ASSIGNED		
A3C26	0160-0576	5		CAPACITOR-FXD .1UF +-20% 50VDC CER	28480	0160-0576
A3C27	0160-0576	5		CAPACITOR-FXD .1UF +-20% 50VDC CER	28480	0160-0576
A3C28	0180-0058	4	1	CAPACITOR-FXD 4.7UF +-20% 10VDC TA	56289	1500475X0010A2
A3C29	0160-4557	0		CAPACITOR-FXD 1UF +-20% 50VDC CER	16299	CAC04X7R104M050A
A3C31	0160-4824	4	1	CAPACITOR-FXD 680PF +-5% 100VDC CER	28480	0160-4824
A3CR1	1901-0040	1	1	DIODE-SWITCHING 50V 50mA 2NS DO-35	28480	1901-0040
A3CR2	1901-0731	7	1	DIODE-POWER RECT 400V 1A	28480	1901-0731
A3CR3	1902-3069	0	1	DIODE-ZENER 3.83V 6% DO-35 PD= 4W	28480	1902-3069
A3CR4	1902-0551	1	1	DIODE-ZNR 6.2V 5% PD= 1W IR= 10UA	28480	1902-0551
A3CR5	1990-0770	1	1	PHOTODIODE IR=830NA-MAX	30014	OP910 (SELECTED)
A3CR6	1901-0518	9	1	DIODE-SM SIG SCHOTTKY	28480	1901-0518
A3J1	1251-4047	2	1	CONNECTOR 20-PIN M POST TYPE	28480	1251-4047
A3J2	1251-5601	3	1	CONNECTOR 4-PIN M POST TYPE	28480	1251-5601
A3J3	1251-6716	3	1	CONNECTOR 10-PIN M POST TYPE	28480	1251-6716
A3J4P1	1251-4047	7	3	CONNECTOR 9-Pin M POST TYPE	28480	1251-4047
A3J4P2	1251-4813	6	3	CONNECTOR 5-Pin M POST TYPE	28480	1251-4813
A3J4P3	1251-6957	2	1	CONNECTOR 4 Pin M POST TYPE	28480	1251-6957
A3J4P4	1251-4813	5		CONNECTOR 5 Pin M POST TYPE	28480	1251-4813
A3J4P5	1251-4047	7		CONNECTOR 9-PIN M POST TYPE	28480	1251-4047
A3J4P6	1251-4813	5		CONNECTOR 5-PIN M POST TYPE	28480	1251-4813
A3J4P7	1251-4047	7		CONNECTOR 9-Pin M POST TYPE	28480	1251-4047

See introduction to this section for ordering information.
*Indicates factory-selected value

Table 6-4. Replaceable Parts (Continued)

Reference Designation	HP Part Number	C D	Qty	Description	Mfr Code	Mfr Part Number
A3L1	9100-1630	7	2	INDUCTOR RF-CH-MLD 510UH 5% .166DX.365LG	28480	9100-1630
A3L2	9100-1630	7		INDUCTOR RF-CH-MLD 510UH 5% .166DX.365LG	28480	9100-1630
A3L3	9140-0158	6	2	INDUCTOR RF-CH-MLD 1UH 10% .135DX.25LG	28480	9140-0158
A3L4	9140-0158	6		INDUCTOR RF-CH-MLD 1UH 10% .135DX.25LG	28480	9140-0158
A3Q1 - Q2						
A3Q3	1853-0347		1	TRANSISTOR PNP SI TO-18 PD=.4W FT=1MHZ	04713	MJE800
A3Q4				NOT ASSIGNED		
A3Q5	1854-0215	1	2	TRANSISTOR NPN SI PD=350MW FT=300MHZ	04713	2N3904
A3Q6	1854-0215	1		TRANSISTOR NPN SI PD=350MW FT=300MHZ	04713	2N3904
A3R1 - R4				NOT ASSIGNED		
A3R5	1810-0279	5	1	NETWORK RESISTOR 10SIP 4.7K OHM X 9	01121	210A472
A3R6	0698-0069	2	4	RESISTOR 2.15M 1% .125W F TC=0+-100	28480	0698-0069
A3R7	0757-0465	7		RESISTOR 51.1K 1% .125W TF TC=0+-100	75042	CRB1/8-OR-CR625
A3R8	0757-0440	7	1	RESISTOR 3.5K 1% .125W F TC=0+-100	24546	C4-1/8-TO-7501-F
A3R9	0757-0514	8	1	RESISTOR 511 1% .5W F TC=0+-100	28480	0757-0514
A3R10	0698-6360	6	4	RESISTOR 10K 1% .125W F TC=0+-25	28480	0698-6850
A3R11	0698-6360	6		RESISTOR 10K 1% .125W F TC=0+-25	28480	0698-6830
A3R12 - R18				NOT ASSIGNED		
A3R19	0698-6360	6		RESISTOR 10K 1% .125W F TC=0+-25	28480	0698-6830
A3R15	0698-6360	6		RESISTOR 10K 1% .125W F TC=0+-25	28480	0698-6830
A3R16	2100-3151	6	1	RESISTOR TRMR 20K 10% C SIDE-ADJ 17-TURN	02111	43P203
A3R17	0698-3457	5	1	RESISTOR 3.01K 1% .125W F TC=0+-100	28480	0698-3457
A3R18	0757-0446	3	1	RESISTOR 15K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1502-F
A3R19	0757-0416	7	2	RESISTOR 511 1% .125W F TC=0+-100	24546	C4-1/8-TO-511R-F
A3R20	0757-0280	3	4	RESISTOR 1K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1001-F
A3R21	0757-0280	3		RESISTOR 1K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1001-F
A3R22	0757-0435	3	3	RESISTOR 5.11K 1% .125W F TC=0+-100	24546	C4-1/8-TO-5111-F
A3R23	0698-3260	5	1	RESISTOR 464K 1% .125W F TC=0+-100	50491	0698-3260
A3R24	0757-0435	3		RESISTOR 5.11K 1% .125W F TC=0+-100	24546	C4-1/8-TO-5111-F
A3R25	0757-0442	5	9	RESISTOR 10K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1002-F
A3R26	0757-0442	5		RESISTOR 10K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1002-F
A3R27	0699-0059	2		RESISTOR 2.15M 1% .125W F TC=0+-100	28480	0699-0059
A3R28	0757-0443	6	1	RESISTOR 11K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1102-F
A3R29	0757-0280	3		RESISTOR 1K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1001-F
A3R30	0757-0472	5	1	RESISTOR 200K 1% .125W F TC=0+-100	24546	C4-1/8-TO-2003-F
A3R31	0698-3454	3	7	RESISTOR 215K 1% .125W F TC=0+-100	24546	C4-1/8-TO-2153-F
A3R32	0699-0079	7		RESISTOR 2.15M 1% .125W F TC=0+-100	28480	0699-0079
A3R33	0698-3454	3		RESISTOR 215K 1% .125W F TC=0+-100	24546	C4-1/8-TO-2153-F
A3R34 - R35				NOT ASSIGNED		
A3R36	0757-0442	5		RESISTOR 10K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1002-F
A3R37	0757-0280	3		RESISTOR 1K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1001-F
A3R38	0698-3059	8	2	RESISTOR 1.96K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1961-F
A3R39	0757-0451	9	1	RESISTOR 402 1% .25W F TC=0+-100	24546	C5-1/4-TO-402R-F
A3R40	0698-3448	9	1	RESISTOR 383 1% .125W F TC=0+-100	24546	C4-1/8-TO-383R-F
A3R41	0698-3086	0	1	RESISTOR 2.61K 1% .125W F TC=0+-100	24546	C4-1/8-TO-2611-F
A3R42				NOT ASSIGNED		
A3R43	0698-3083	6		RESISTOR 1.96K 1% .125W F TC=0+-100	24546	C4-1/8-TO-1961-F
A3R44	0757-0428	5		RESISTOR 5.11K 1% .125W F TC=0+-100	24546	C4-1/8-TO-5111-F
A3R45	0757-0416	7		RESISTOR 511 1% .125W F TC=0+-100	24546	C4-1/8-TO-511R-F
A3R46	3698-3165	1	1	RESISTOR 4.64K 1% .125W F TC=0+-100	24546	C4-1/8-TO-4641-F
A3R47				NOT ASSIGNED		
A3R48	1810-0274	1	1	NETWORK RESISTOR 6-SIP 1K OHM X a	01121	206B1G2
A3R49	3698-0071	8	2	RESISTOR 4.64M 1% .125W F TC=0+-100	28480	0698-0071
A3R50	3698-0069	6		RESISTOR 2.15M 1% .125W F TC=0+-100	28480	0698-0069
A3R51	3698-0071	8		RESISTOR 4.64M 1% .125W F TC=0+-100	28480	0698-0071
A3R52	0757-0279	7	1	RESISTOR 61.9 1% .125W F TC=0+-100	24546	C4-1/8-TO-61R9-F
A3R53	0757-0416	7		RESISTOR 511 1% .125W F TC=0+-100	24546	C4-1/8-TO-511R-F
A3TP1 - TP20	1251-5177	4	20	CONNECTOR-SGL CONT PIN .061IN SQ .92	28480	1251-5177

See Introduction to this section for ordering information
*Indicates factory-selected value

Table 6-1. Replaceable Parts (Continued)

Reference Designation	HP Part Number	C D	Qty	Description	Mfr Code	Mfr Part Number
A3U1	1820-1416	5	1	IC SCHMITT-TRG TTL LS INV -EX 1-INP	01295	SN74LS14N
A3U2	1820-1259	8	1	IC GATE TTL LS AND TPL 3-INP	01295	SN74LS11N
A3U3	1820-1112	6	1	IC FF TTL LS D-TYPE POS EDGE TRIG	01295	SN74LS74AN
A3U4	1820-2078	7	1	IC CNTR TTL LS DECD DUAL 4-BIT	01295	SN74LS490N
A3U5	1820-1201	6	1	IC GATE TTL LS AND QUAD 2-INP	01295	SN74LS08N
A3U6	1820-2096	9	1	IC CNTR TTL LS BIN DUAL 4-BIT	01295	SN74LS393N
A3U7	1858-0125	3	1	IC TRSE V REG,TR TO-220	07263	7805UC
A3U8	1820-0804	7	1	IC FF CMOS D-TYPE POS-EDGE-TRIG DUAL	3L650	CD4013BE
A3U9				NOT ASSIGNED		
A3U10	1820-2405	7	1	IC TIMER CMOS	27298	ILM7555IPA
A3U11	1826-0600	3	1	IC OP AMP LOW-BIAS-I-FET QUAD 14-PIN	04713	TL074CN
A3U12	1820-1795	3	1	IC ANALOG SWITCH 4-SPST 16-DIP-P	27014	DG333DJ
A3U13	1826-0492	8	1	IC OP AMP LOW-BIAS-I-FET 8-DIP P PKG	04713	MLM308AP1
A3U14	1826-0256	8	1	IC OP AMP GP 8-DIP P PKG	28480	1826-0256
A3U15	1826-0082	0	1	IC COMPARATOR PRCN 8-DIP P PKG	50345	UPC311C
A3U16	1820-2668	1	2	IC DVR TTL LINE DRVR DUAL 3-INP	01295	SN75114N
A3U17	1826-0775	9	1	IC LINEAR DATU	28480	1DA1C
A3U18	1820-2669	1		IC DRVR TTL LINE DRVR DUAL 3-INP	01295	SN75113N
A3U19	1820-0477	0	1	IC INV TTL HEX 1-INP	01295	SN7406N
				MISCELLANEOUS A3 PARTS		
	1258-0141	8	7	JUMPER-REMOVABLE FOR 0.025 IN SQ P NS	28480	1258-0141
	0340-0907	8	1	INSULATOR TRANSISTOR-NYLON	28480	0340-0907
A4	05516-60004	1	1	A4 SAMPLER BOARD (SERIES 2256)	28480	05516-60004
A4CR1	1990-0770	1		PHOTODIODE ID=30NA-MAX	28480	OP 919 (SELECTED)
A4P1	1251-8778	5	1	CONNECTOR 4-PIN P POST TYPE	28480	1251-8778
				MISCELLANEOUS A4 PARTS		
	0340-0907	8	1	INSULATOR TRANSISTOR-NYLON	28480	0340-0907

FOR 5516A MISCELLANEOUS AND CHASSIS PARTS- SEE FIGURE 6-9.

See introduction to this section for ordering information.
*Indicates factory selected value.

Table 6-5. Replaceable Parts (Continued)

Reference Designation	HP Part Number	C D	Qty	Description	Mfr Code	Mfr Part Number
A1	10751-60001	3	1	A1 PC BOARD ASSEMBLY	28480	10751-60001
A1C1	0160-4557	0	0	CAPACITOR-FXD .1UF 50VDC CER	56289	C4D04X7R1H104M050A
A1C2	0160-4554	7	7	CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A1C3	0160-3072	2	6	CAPACITOR-FXD 1UF +-10% 100VDC MET-POLYP	28480	0160-3072
A1C4	0160-4557	0		CAPACITOR-FXD .1UF 50VDC CER	56289	C4D04X7R1H104M050A
A1C5	0160-3072	2		CAPACITOR-FXD 1UF +-10% 100VDC MET-POLYE	28480	0160-3072
A1C6	0160-3573	0	2	CAPACITOR-FXD 10UF +-10% 35VDC TA	28480	0160-3573
A1C7	0160-3573	0		CAPACITOR-FXD 10UF +-10% 35VDC TA	28480	0160-3573
A1C8	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A1C9	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A1C10	0160-3072	2		CAPACITOR-FXD 1UF +-10% 100VDC MET-POLYE	28480	0160-3072
A1C11	0160-3072	2		CAPACITOR-FXD 1UF +-10% 100VDC MET-POLYE	28480	0160-3072
A1C12	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A1C13	0160-4557	0		CAPACITOR-FXD .1UF 50VDC CER	56289	C4D04X7R1H104M050A
A1C14	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A1C15	0160-3072	2		CAPACITOR-FXD 1UF +-10% 100VDC MET-POLYE	28480	0160-3072
A1C16	0160-3072	2		CAPACITOR-FXD 1UF +-10% 100VDC MET-POLYE	28480	0160-3072
A1C17	0160-4557	0		CAPACITOR-FXD .1UF 50VDC CER	56289	C4D04X7R1H104M050A
A1C18	0160-4809	5	1	CAPACITOR-FXD 330PF +-5% 100VDC CER	28480	0160-4809
A1C19	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A1C20	0160-4557	0		CAPACITOR-FXD .1UF 50VDC CER	56289	C4D04X7R1H104M050A
A1C21	0160-4557	0		CAPACITOR-FXD .1UF 50VDC CER	56289	C4D04X7R1H104M050A
A1C22	0160-4557	0		CAPACITOR-FXD .1UF 50VDC CER	56289	C4D04X7R1H104M050A
A1C23	0160-4554	7		CAPACITOR-FXD .01UF +-20% 50VDC CER	28480	0160-4554
A1C24	0160-4557	0		CAPACITOR-FXD .1UF 50VDC CER	56289	C4D04X7R1H104M050A
A1CR1	1902-0032	3	1	DIODE-ZNR 5.49V 5% DO-35 PD=.4W	28480	1902-0032
A1CR2	1902-3070	5	1	DIODE-ZNR 4.22V 5% DO-35 PD=.4W	28480	1902-3070
A1CR3	1901-0050	3	3	DIODE-SWITCHING 80V 200MA 6NS DO-35	28480	1901-0050
A1CR4	1901-0050	3		DIODE-SWITCHING 80V 200MA 6NS DO-35	28480	1901-0050
A1CR5	1901-0050	3		DIODE-SWITCHING 80V 200MA 6NS DO-35	28480	1901-0050
A1J1	1251-4989	8	*	CONNECTOR 5-PIN M POST TYPE	28480	1251-4989
A1J2	1251-5778	5	*	CONNECTOR 4 PIN F POST TYPE	28480	1251-5778
A1J3	1251-8855	9	*	CONENCTOR 6-PIN M POST TYPE	28480	1251-0855
A1Q1, Q2	1853-0281	9	2	TRANSTOR PNP 2N2907A,S TO-18 FD=400MW	04713	2N2907A
A1R1	2100-3875	5	1	RESISTOR-TRMR 1K 25% C TOP-ADJ 17-TRN	28480	2100-3875
A1R2	0698-3156	4	1	RESISTOR 33.2K 1% .125W F TC=0+-100	24546	C4-1/8-TC-3322-F
A1R3	0698-3811	2	1	RESISTOR 38K .1% .125W F TC=0+-5	28480	0698-3811
A1R4	0757-0418	8	5	RESISTOR 619 1% .125W F TC=0+-100	24546	C4-1/8-TC-619R-F
A1R5	0698-3456	4	1	RESISTOR 261K 1% .125W F TC=0+-100	24546	C4-1/8-TC-2613-F
A1R6	0757-0472	5	1	RESISTOR 200K 1% .125W F TC=0+-100	24546	C4-1/8-TC-2003-F
A1R7	1810-0504	9	2	NETWORK RESISTOR 16P MULTI-VALUE	28480	1810-0504
A1R8	2100-3875	9	1	RESISTOR-TRMR 2K 25% C TOP-ADJ 17-TRV	28480	2100-3875
A1R9	1810-0599	2	1	RESISTOR NETWORK 8P5 S VAL 1WF	28480	1810-0599
A1R10	0757-0418	8		RESISTOR 619 1% .125W F TC=0+-100	24546	C4-1/8-TC-619R-F
A1R11	0698-8003	0	1	RESISTOR 75 .1% .1W F TC=0+-15	07716	MARE 1/10 T10 75R0 B
A1R12	0698-0642	7	1	RESISTOR 10K .1% .1W F TC=0+-5	28480	0698-3642
A1R13	0757-0438	3	2	RESISTOR 5.11K 1% .125W F TC=0+-100	28480	0757-0438
A1R14	0698-7222		1	RESISTOR 261 1% .05W	28480	0698-7222
A1R15	1810-0598	1	1	RESISTIVE NETWORK 4K 4PIN 3 VAL 1WF	28480	1810-0598
A1R16	1810-0504	9		NETWORK RESISTOR 16-DIF MULTI-VALUE	28480	1810-0504
A1R17	0757-0280	3	1	RESISTOR 1K 1% .125W F TC=0+-100	24546	C4-1/8-TC-1001-F
A1R18	0757-0438	3	1	RESISTOR 5.11K 1% .125W F TC=0+-100	24546	C4-1/8-TC-5111-F
A1R19	1810-0597	0	1	RESISTIVE NETWORK 4PER 10K OHM 1WF	80460	1810-0597
A1R20	0698-0082	7	1	RESISTOR 464 1% .125W F TC=0+-100	24546	C4-1/8-TC-4640-F
A1R21	0757-0407	8	1	RESISTOR 806 1% .125W F TC=0+-100	24546	C4-1/8-TC-806-F
A1S1 - S17	1251-4662	8	17	CONNECTOR 3-PIN M POST TYPE	28480	1251-4662
A1S18	3101-1782	8	1	SWITCH TGL SUBMIN SPDT 2A 250VAC PC	28480	3101-1782
A1TP1 - TP5	0360-0124	3	5	CONNECTOR-SGL CONT PIN .04 IN-SQ-GD BRZ	28480	0360-0124

See introduction to this section for ordering information
*Indicates factory selected value

Table 6-5. Replaceable Parts (Continued)

Reference Designation	HP Part Number	C D	Qty	Description	Mfr Code	Mfr Part Number
A1U1	1826-0543	9	4	IC OP AMP LOW-DRIFT TO-99 PKG	06665	OP-07CJ
A1U6	1826-0543	9		IC OP AMP LOW DRIFT TO-99 PKG	06665	OP-07CJ
A1U2	1826-0761		*	IC MSTPM AMP 14-PIN DIP-C	27293	ICL7650C-N
A1U4	1826-0543	9		IC OP AMP LOW-DRIFT TO-99 PKG	06665	OP-07CJ
A1U5	1826-0965	6	*	IC AD 554CH	28480	1826-0965
A1U8	1826-0543	9		IC OP AMP LOW DRIFT TO-99 PKG	06665	OP 07CJ
	1258-0141	8	17	JUMPER-REMOVABLE FOR 0.025in SQ PINS	28480	1258-0141
A2	10731-60002	8	1	A2 AIR TEMP TRANSDUCER ASSEMBLY	28480	10731-60002
A2C1	0160-3879	7	2	CAPACITOR-FXD .01UF +-20% 100VDC CER	28480	0160-3879
A2C2	0160-3879	7		CAPACITOR-FXD .01UF +-20% 100VDC CER	28480	0160-3879
A2P2	1251-5864	6	1	CONNECTOR-4-PIN M POST TYPE	28480	1251-5864
	0380-1539	5	2	STANDOFF-NYLON SLM 3.0	28480	0380-1539
	0515-0753	3	4	SCREW-MACHINE M3 X 5	28480	0515-0753
	10731-20003	0	1	HEATSINK	28480	10731-20003
				FOR 10731 MISCELLANEOUS AND CHASSIS PARTS, SEE FIGURE 6-10		

See Introduction To This Section For Ordering Information
*Indicates Factory Selected Value

Table 6-7. Replaceable Parts

Reference Designation	HP Part Number	C D	Qty	Description	Mfr Code	Mfr Part Number
A1	10757-60001	4	1	BOARD, MATERIAL TEMPERATURE SENSOR	28480	10757-60001
A1C1	0160-4557	9	5	CAPACITOR-FXD .1UF +80% 50VDC CER	16299	C4C04X7R1C4M050A
A1C2	0160-4557	0		CAPACITOR-FXD .1UF +80% 50VDC CER	16299	C4C04X7R1C4M050A
A1C3	0160-4557	0		CAPACITOR-FXD .1UF +80% 50VDC CER	16299	C4C04X7R1C4M050A
A1C4	0160-3335	0	4	CAPACITOR-FXD 470 PF +10% 100VDC CER	28480	0160-3335
A1C5	0160-4557	0		CAPACITOR-FXD .1UF +80% 50VDC CER	16299	C4C04X7R1C4M050A
A1C6	0160-3335	0		CAPACITOR-FXD 470 PF +10% 100VDC CER	28480	0160-3335
A1C7	0160-3335	0		CAPACITOR-FXD 470 PF +10% 100VDC CER	28480	0160-3335
A1C8	0160-4557	0		CAPACITOR-FXD .1UF +80% 50VDC CER	16299	C4C04X7R1C4M050A
A1C9	0160-3335	0		CAPACITOR-FXD 470 PF +10% 100VDC CER	28480	0160-3335
A1C10	0160-3828	7	1	CAPACITOR-FXD .47UF +10% 50VDC	28480	0160-3828
A1U8	1810-0660	8	1	NETWORK-SHUNT 16-PIN DIP; 8-SECTIONS; 1	28480	1810-0660
A1R1	2100-3128	0	1	RESISTOR-TRMR 50K 10% C SIDE-ADJ 17-TRN	02111	43P5C1
A1R2	0698-3446	3	1	RESISTOR 383 1% .125W F TC=0+100	24546	C4-1/8-TO-383R-F
A1R3	0698-4409	0	1	RESISTOR 127 1% .125W F TC=0+100	24546	C4-1/8-TO-127R-F
A1R4	0698-4396	4	1	RESISTOR 63.4 1% .125W F TC=0+100	24546	C4-1/8-TO-63R4-F
A1R5	0757-0401	0	1	RESISTOR 100 1% .125W F TC=0+100	24546	C4-1/8-TO-100-F
A1R6	0757-0180	2	1	RESISTOR 81.9 1% .125W F TC=0+100	28480	0757-0180
A1R7	0698-1117	3	1	RESISTOR 4.02 1% .125W F TC=0+100	28480	0698-1117
A1R8	0698-4361	3	1	RESISTOR 15.8 1% .125W F TC=0+100	03888	PME65-1/8-TO-15R8-F
A1R9	0757-0407	6	1	RESISTOR 200 1% .125W F TC=0+100	24546	C4-1/8-TO-201-F
A1R10	0698-0644	8	1	RESISTOR 7.87 1% .125W F TC=0+100	28480	0698-0644
A1R11	0698-1115	1	1	RESISTOR 47.5K 1% .1W F TC=0+5	28480	0698-1115
A1R12	0698-1116	2	1	RESISTOR 49.9K 1% .1W F TC=0+5	28480	0698-1116
A1R13	0698-0118	2	1	RESISTOR 20K .1% .1W F TC=0+5	28480	0698-0118
A1R14	0698-1112	8	1	RESISTOR 5K .1% .1W F TC=+5	28480	0698-1112
A1R15	0698-1113	9	1	RESISTOR 2.98K .1% .1W F TC=0+5	28480	0698-1113
A1R16	2100-3154	7	1	RESISTOR-TRMR 1K 10% C SIDE-ADJ 17 TRN	02111	43P102
A1R17	0698-1114	0	1	RESISTOR 7.96K .1% .1W F TC=0+5	28480	0698-1114
A1R18	0698-8825	0	1	RESISTOR 1K .1% .1W F TC=0+5	28480	0698-8825
A1R19	0698-1111	7	1	RESISTOR 238 1% .1W F TC=0+5	28480	0698-1111
A1S1	1251-4047	7	1	CONNECTOR 8-PIN M POST TYPE	28480	1251-4047
A1TP1	0360-0124	3	2	CONNECTOR-SGL CONT PIN .64 IN BSC-SZ AND	28480	0360-0124
A1TP2	0360-0124	3		CONNECTOR-SGL CONT PIN .64 IN BSC-SZ AND	28480	0360-0124
A1U1	1826-0650	8	1	IC-AD584KH	28480	1826-0650
A1U2	1826-0685	0	3	IC OP AMP LOW-OFS 8-DIP-P PKG	06665	OP-07CP
A1U3	1826-0685	0		IC OP AMP LOW-OFS 8-DIP-P PKG	06665	OP-07CP
A1U4	1826-0685	0		IC OP AMP LOW-OFS 8-DIP-P PKG	06665	OP-07CP
				MISCELLANEOUS PARTS		
	1200-0637	0	1	SOCKET-IC 16-CONT DIP DIP-SLDR	28480	1200-0637
	1250-0141	8	1	JUMPER REMOVABLE FOR 0.025-IN SQ PINS	28480	1250-0141
				FOR "0757" MISCELLANEOUS AND CHASSIS PARTS, SEE FIGURE 6-11		

See introduction to this section for ordering information
*Indicates factory selected value

Table 6-8. Manufacturer's Code List

Mfr No.	Manufacturer Name	Address		Zip Code
00545	Nippon Electric Co	Tokyo	JP	
00000	Any Satisfactory Supplier			
01121	Allen-Bradley Co.	Milwaukee	WI	53204
01295	Texas Instr Inc Semicond Cmpnt Div	Dallas	TX	75222
02111	Spectrol Electronics Corp	City of Ind	CA	91745
03888	K D I Pyrofilm Corp	Whippany	NJ	07981
04713	Motorola Semiconductor Products	Phoenix	AZ	85008
06665	Precision Monolithics	Santa Clara	CA	95050
07263	Fairchild Semiconductor Div	Phoenix	AZ	85008
07716	TRW Inc Burlington Div	Burlington	IA	52601
10630	Anillo Industries Incorporated	Orenge	CA	92667
11236	CTS of Berne Inc	Berne	IN	46711
15818	Teledyne Simiconductor	Mountain View	CA	94043
16299	Corning Glass Wks Component Div	Raleigh	NC	27604
18324	Signetics Corporation	Synnyvale	CA	94086
19701	Mepco/Electra Corp	Mineral Wells	TX	76067
24546	Corning Glass Works (Bradford)	Bradford	PA	16701
27014	National Semiconductor Corp	Santa Clara	CA	95051
28480	Hewlett-Packard Co Corporate HQ	Palo Alto	CA	94304
3L585	RCA Corp Solid State Div	Somerville	NJ	08876
3L680	Beman Manufacturing Inc	Etters	PA	17319
32664	Optron Inc	Carrollton	TX	75006
32293	Intersil Inc	Cupertino	CA	95014
34335	Advanced Micro Devices Inc	Synnyvale	CA	94086
50088	Mostek Corp	Carrollton	TX	75006
56289	Sprague Electric Co	North Adams	MA	01247
75915	Littelfuse Inc	Des Plaines	IL	60016
84411	TRW Capacitor Div	Ogallala	NE	69153
91637	Dale Electronics Incorporated	Columbus	NE	68601
96291	Sealectro Corp	Mamaroneck	NY	10544

5308A CABINET REPLACEABLE PARTS

ITEM	QTY	DESCRIPTION	HP PART NO.
1	1	COVER, TOP (METRIC)	5062-3730
2	1	TRIM, TOP	5041-8803
3	4	SCREW, 6-32 x 0.468", POZI	3670-1171
4	4	RETAINER, RING 0.141"	3510-0043
5	2	COVER, SIDE (METRIC)	5062-3701
6	2	STRUT (METRIC)	5021-5836
7	2	SCREW-MACH 6-32 x .25" PAN HD POZI	3062-0007
8	1	BARS COMPRESSOR	05308-20201
9	1	BRACKET-PC BOARD SUPPORT	05308-00002
10	2	HINGE, PC BOARD SUPPORT	05308-80001
11	8	SCREW-MACH M4 0.7 x 6	2515-1231
12	1	COVER, BOTTOM (METRIC)	5062-3742
13	2	FOOT, NON-SKID	5041-8822
14	2	STAND, TILT	1450-1345
15	2	FOOT	5041-8801
16	2	SCREW-MACH 8-32 x 0.548" PAN-HD POZI	2510-0267
17	2	RETAINER, BAIL HANDLE	5040-7216
18	2	ADAPTER, BAIL HANDLE	5040-7215
19	1	BAIL HANDLE	5061-0087

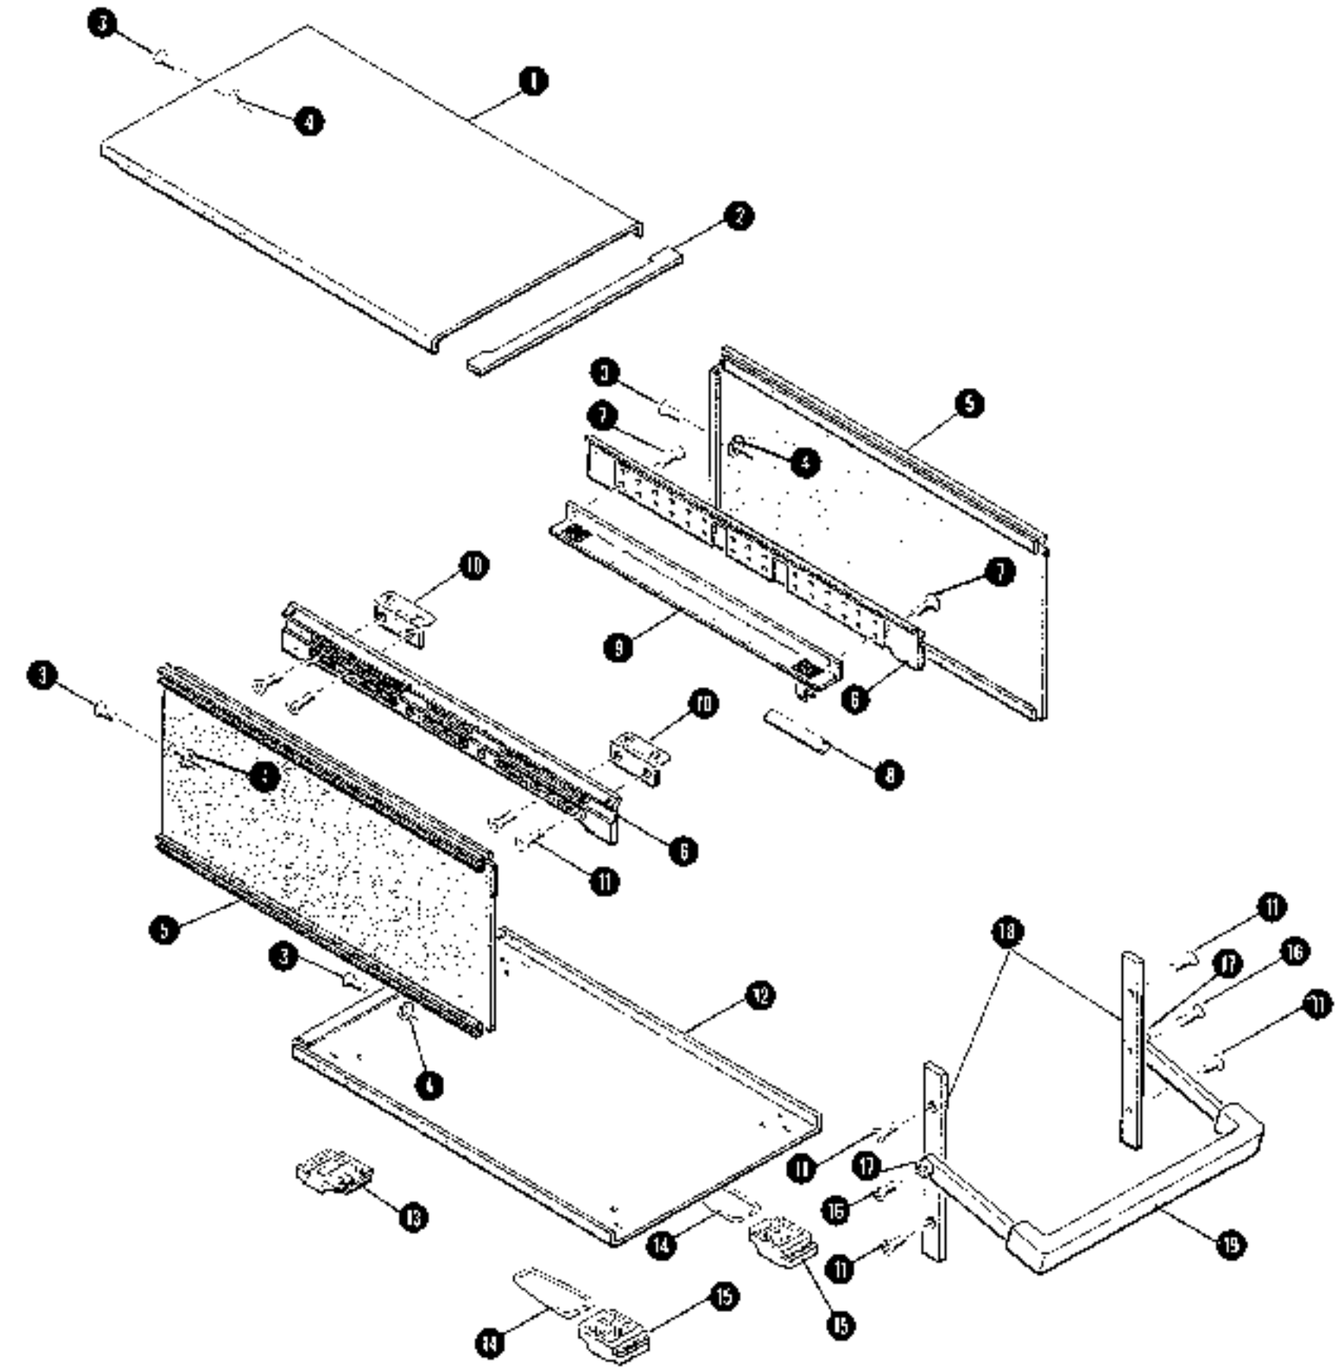


Figure 6-1. 5308A Cabinet Parts Exploded View

Figure 6-7
5508A CABINET PARTS EXPLODED VIEW

(See Page 6-23)

5508A RACK MOUNT REPLACEABLE PARTS

ITEM	QTY	DESCRIPTION	HP PART NO.
1	1	ADAPTER ASSEMBLY	5062-3927
2	1	RACK FLANGE	5021-8453
3	8	8-32 x 3/8 SCREW	2510-0193
	1	KIT, RACK, Option 908 (Not Shown)	5062-3960
	1	KIT, HANDLE (Not Shown)	5062-4003

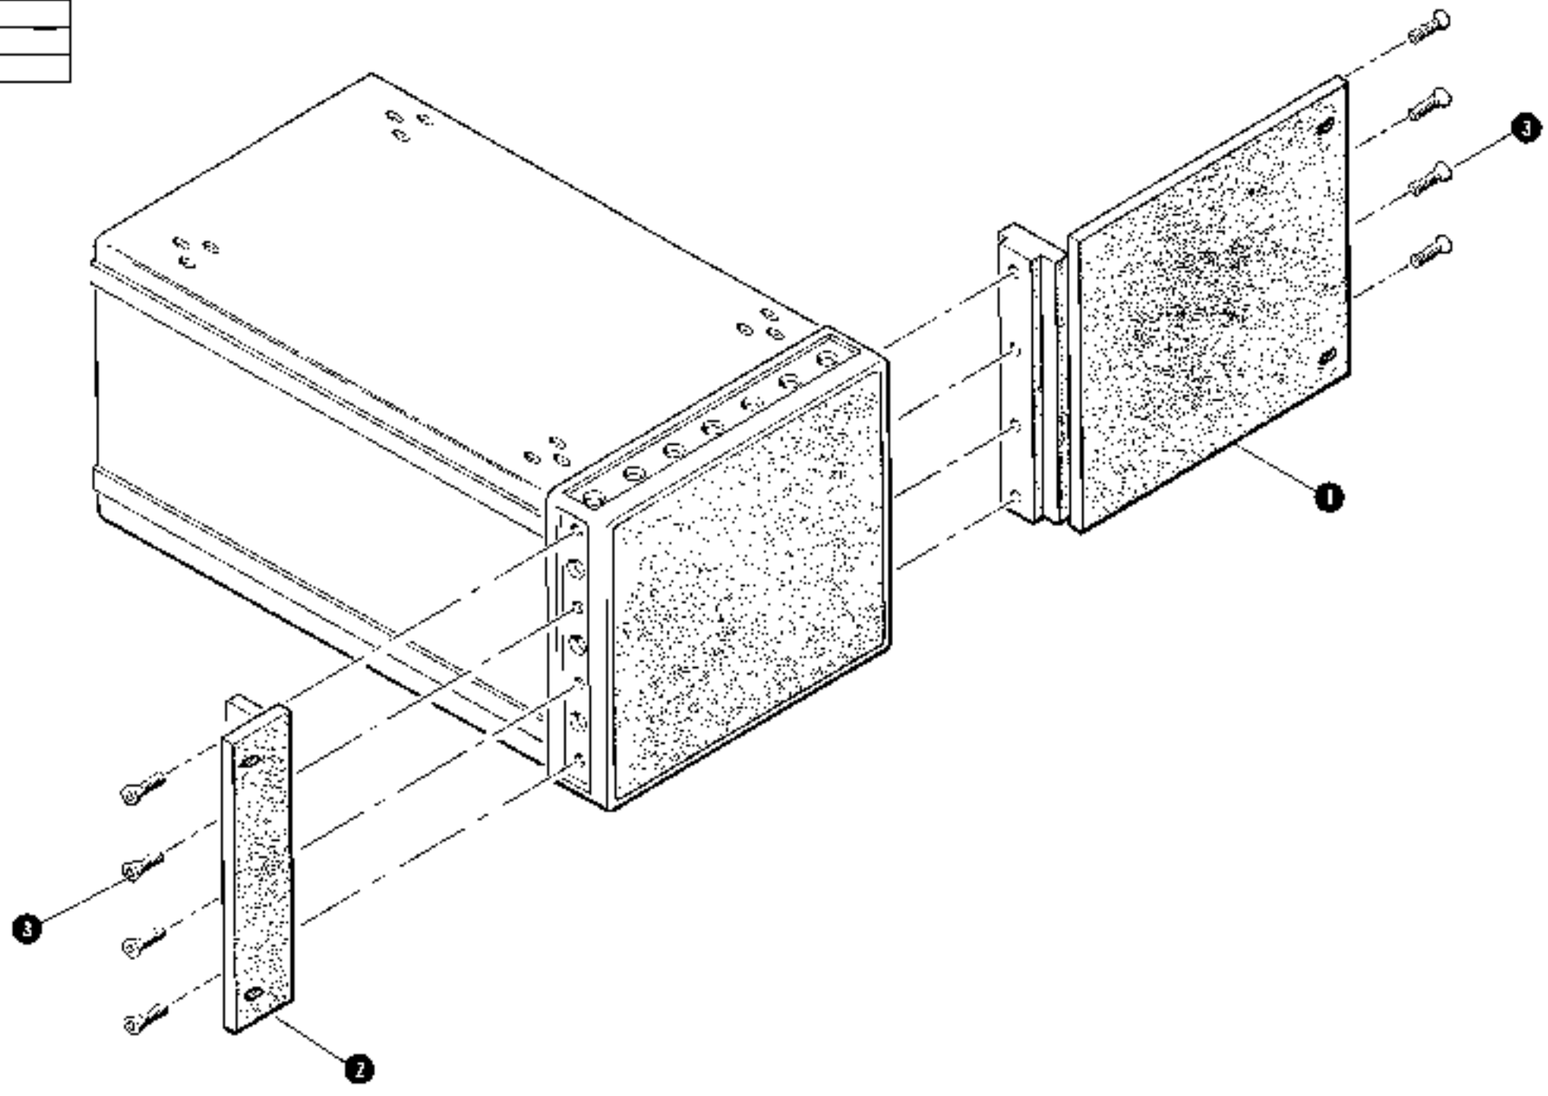


Figure 6-2. 5508A Rack Mount Kit

Figure 6-2
5508A RACK MOUNT KIT

|See Page 6-25|

5508A CHASSIS REPLACEABLE PARTS

ITEM	QTY	DESCRIPTION	HP PART NO.
1	1	COVER, HEAT SINK	05508-00008
2	1	BRACKET LEFT	05508-02026
3	1	BRACKET RIGHT	05508-02027
4	1	HEAT SINK	05508-20001
5	1	CHASSIS	05508-02003
6	1	BAR	05508-20003
7	1	BOARD ASSEMBLY, A5 POWER SUPPLY	05508-60005
8	1	TRANSFORMER, T1	05508-60205
9	2	STRUT	5021-5938
10	1	FAN ASSEMBLY, B1	05508-60206
11	3	GROMMET	0400-0262
12	4	SCREW, 10-32 x 3/8"	2680-0009
13	21	SCREW, 6-32 x 1/4"	2360-0113
14	4	SCREW, 4-40 x 5/16"	2200-0105
15	4	WASHER, LOCK	2190-0004
16	4	WASHER, #10	3050-0236
17	1	CABLE ASSEMBLY, REGULATOR	05508-60206
18	2	CLAMP	1400-0611
19		NOT ASSIGNED	
20	1	WASHER	3050-0105
21	1	CLAMP	1400-0017

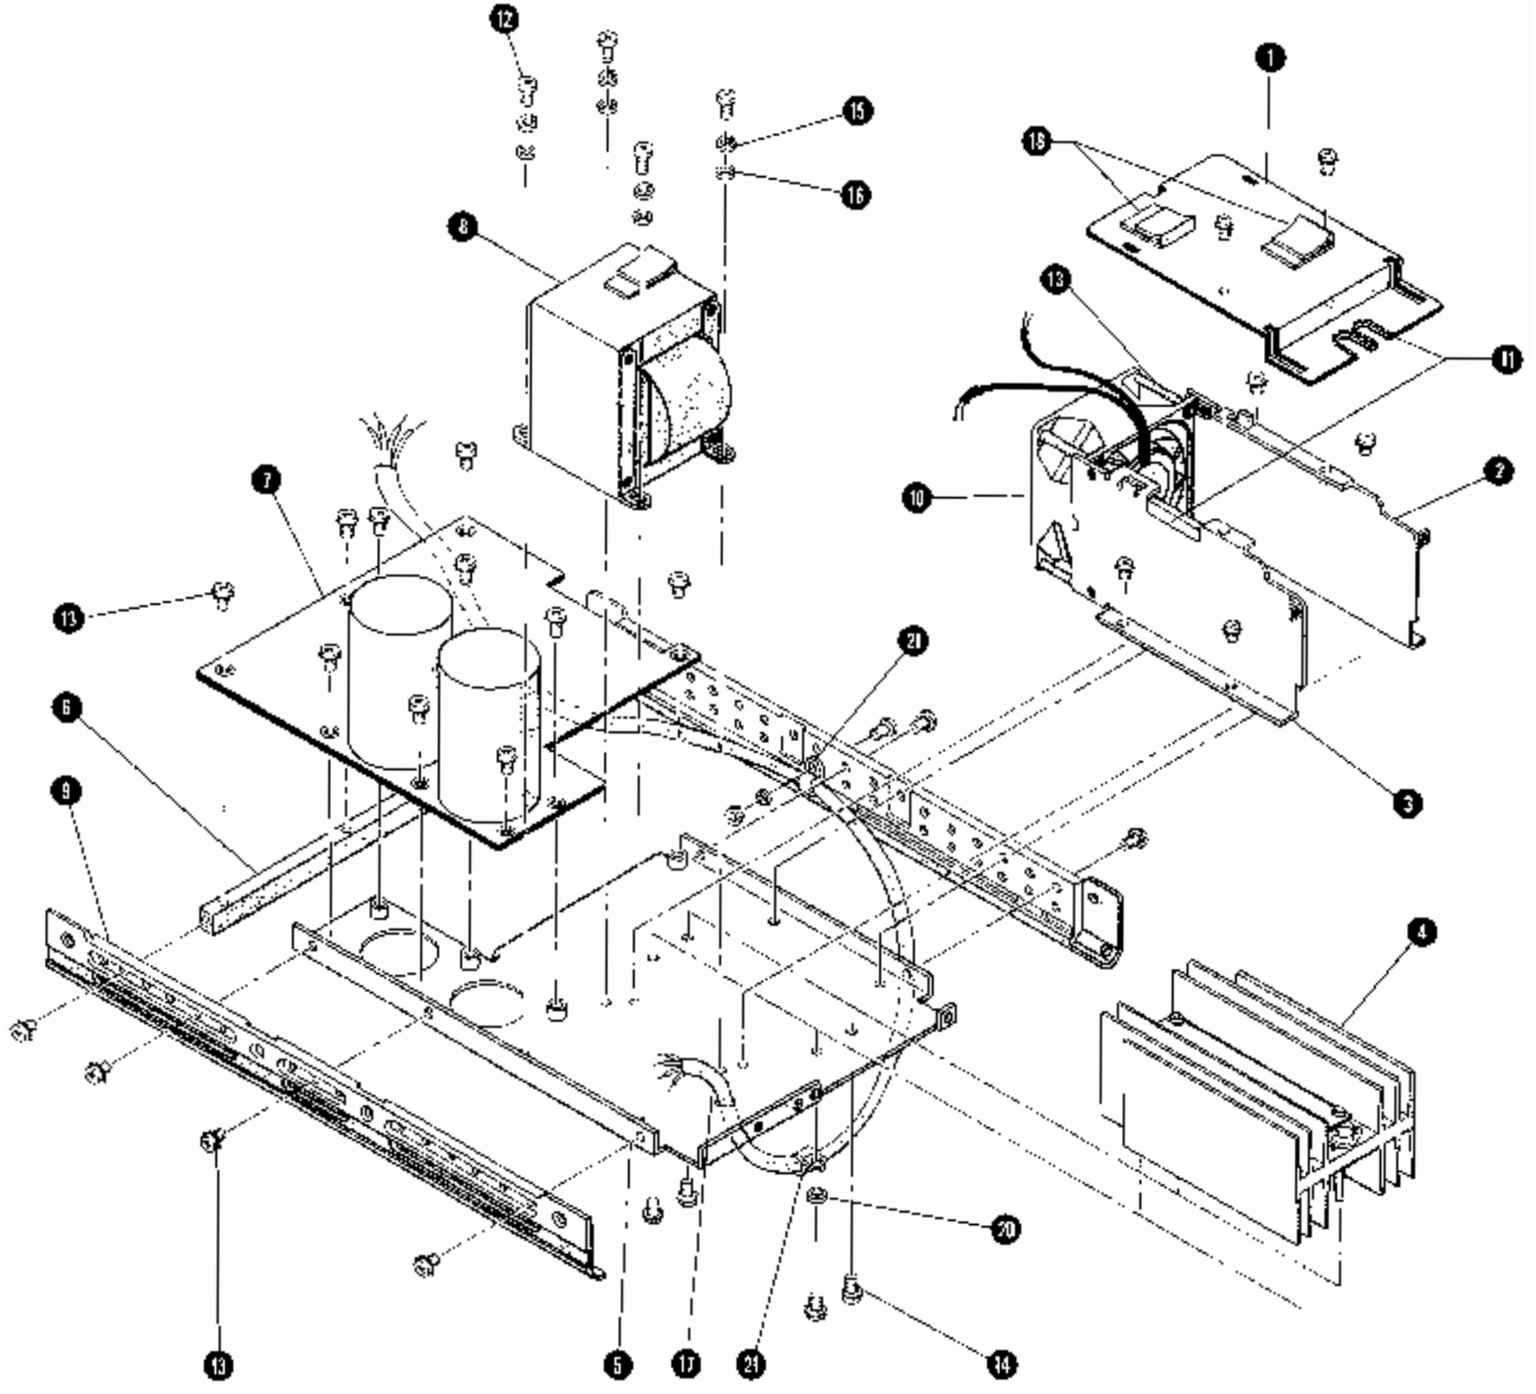


Figure 6-3. 5328A Exploded Chassis View

Figure 6-3
3508A EXPLODED CHASSIS VIEW

|See Page 6-27|

5508A HEAT SINK REPLACEABLE PARTS

ITEM	QTY	DESCRIPTION	HP PART NO.
1	1	HEAT SINK	05508-20001
2	6	BUSHING, INSULATOR	1200-0147
3	1	BOARD, PC	05508-20005
4	1	CONNECTOR, 15-PIN	1251-5939
5	8	SCREW, 4-40 x 5/8"	2200-0113
6	4	STANDOFF	0380-1251
7	1	THERMAL SWITCH	3103-0099
8	4	SCREW, 4-40 x 1/4"	2200-0139
9	6	WASHER,LOCK	2190-0003
10	2	INSULATOR	0340-0595
11	2	TRANSISTOR (Q1, Q2)	1854-0669
12	4	NUT, 4-40	2260-0001
13	2	INSULATOR	0340-0864
14	2	DIODE (CR1, CR2)	1906-0251
15	1	INSULATOR	0340-0864
16	-	THERMAL COMPOUND	--

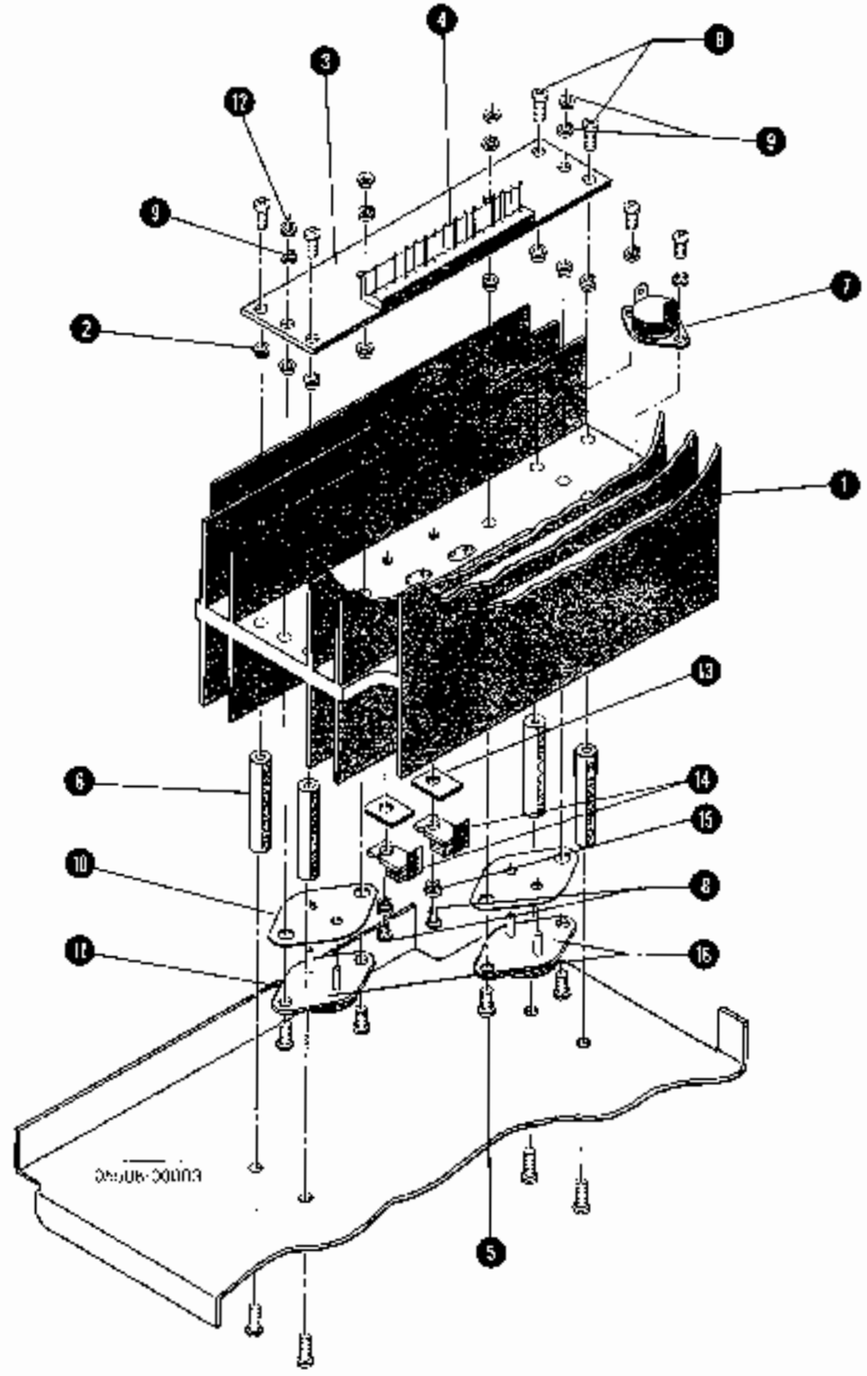


Figure 6-4. 5508A Heat Sink Exploded View

Figure 6-4
5308A HEAT SINK EXPLODED VIEW

(See Page 6-29)

5508A FRONT PANEL REPLACEABLE PARTS

ITEM	QTY	DESCRIPTION	HP PART NO.
1	4	SCREW, 6-32 x 1/4" FH 100°	2360-0333
2	1	FRAME (METRIC)	5021-9417
3		NOT ASSIGNED	
4	1	BOARD ASSY, A1 KEYBOARD DISPLAY	05508-60001
5	1	CABLE ASSY, POWER AC (Includes Rocker Switch) Cap is 5040-7946	05508-60204
6	2	SCREW, 4-40 x 1/4" FH 100°	2200-0542
7	2	FASTENER	05508-20305
8	1	PANEL, SUB	05508-00002
9	1	PANEL, FRONT	05508-00001
10	1	DIVIDER	5040-6927
11	1	METER M1	1120-1696
12	1	DISPLAY	05508-20302
13	1	LOGO	7124-0691
14	5	CLAMP	0510-1148
15	1	CLAMP, CABLE	1400-0017
16	1	WASHER, FLAT	3050-0367
17	1	CABLE ASSEMBLY, METER	05508-60209

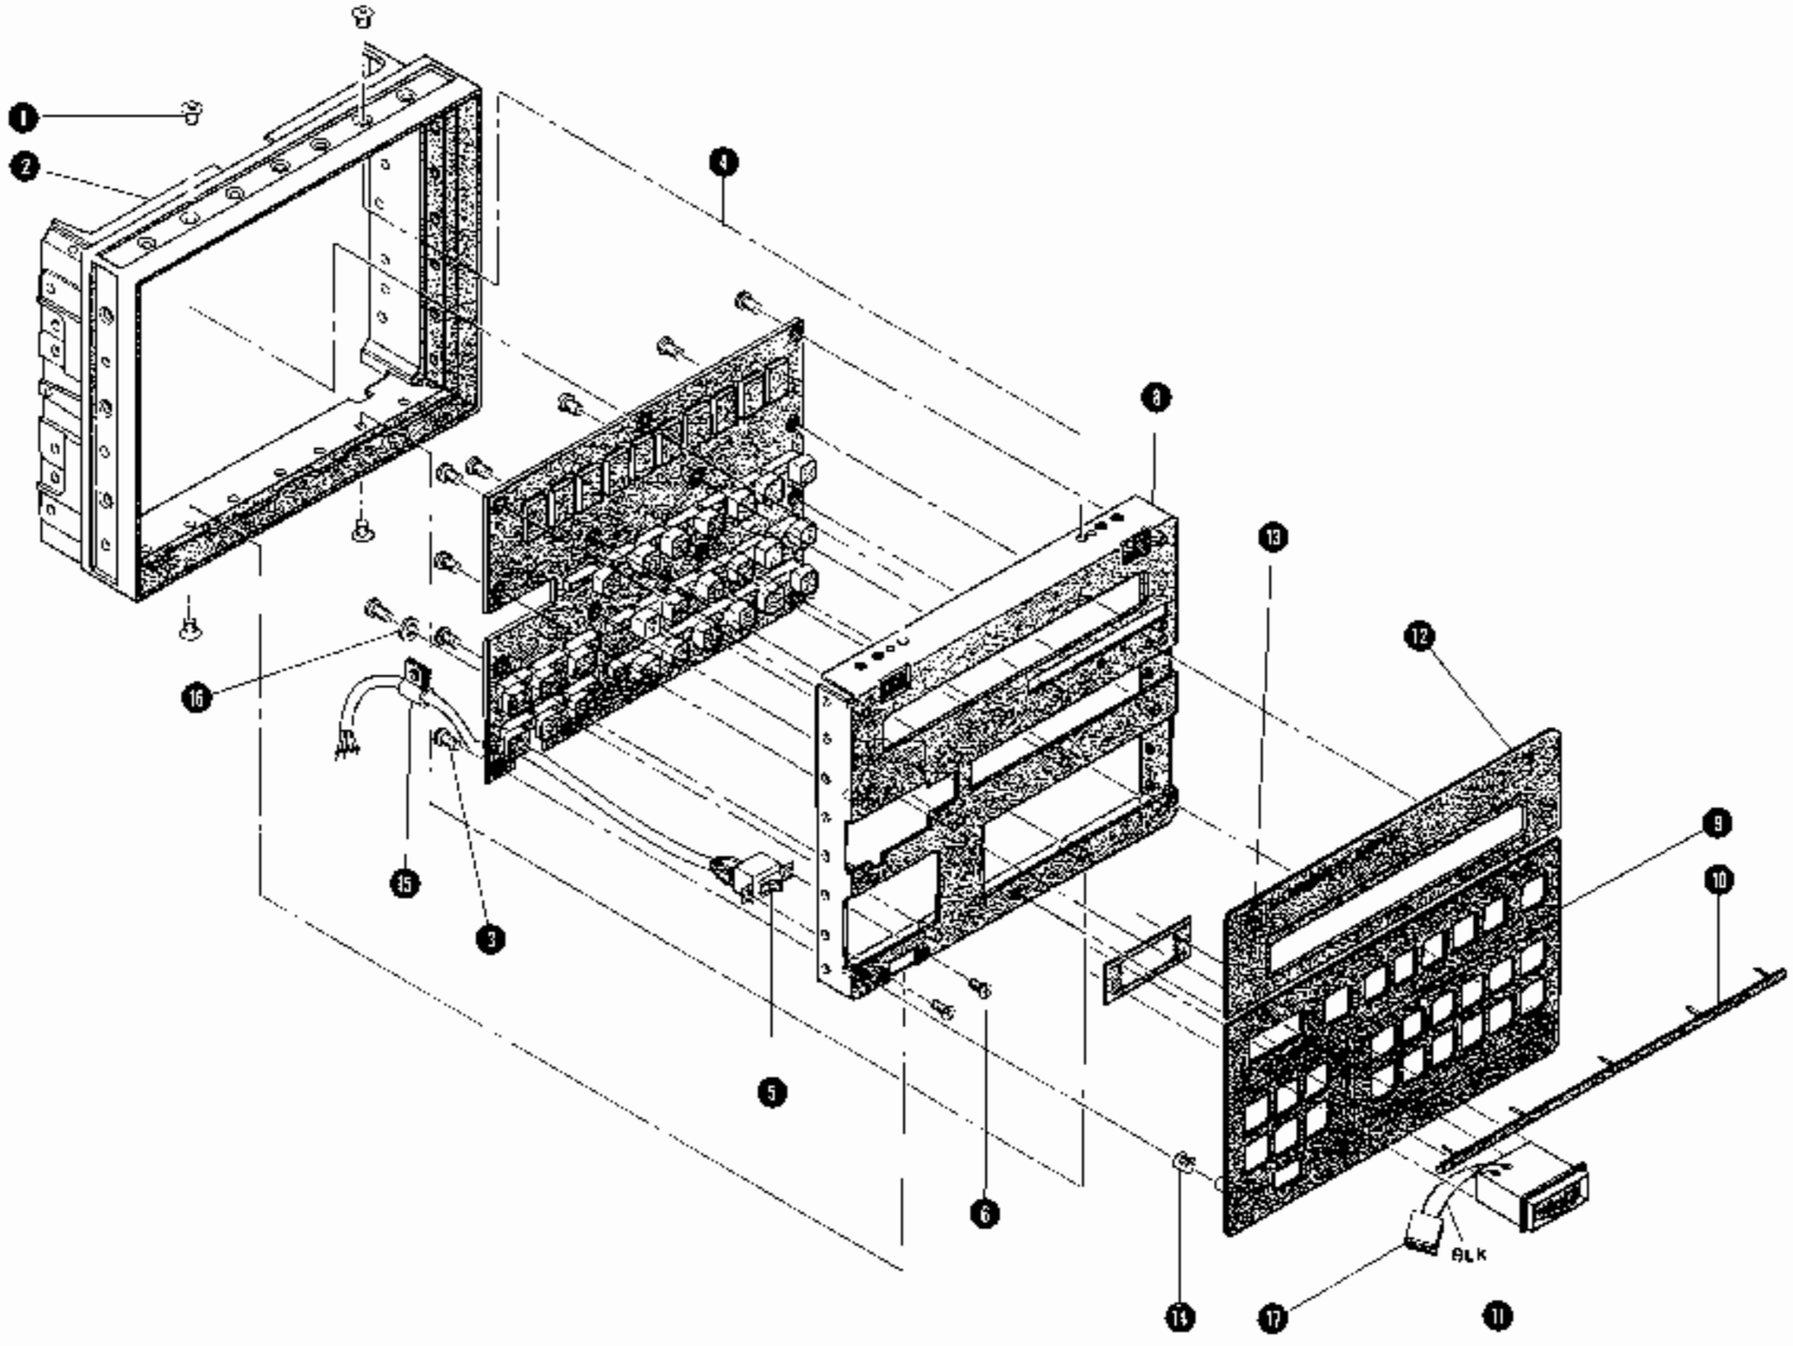


Figure 6-5. 5328A Front Panel Exploded View

Figure 6-3
5508A FRONT PANEL EXPLODED VIEW

(See Page 6-31)

5508A REAR PANEL REPLACEABLE PARTS

ITEM	QTY	DESCRIPTION	HP PART NO.
1	1	CABLE ASSY, HP-IB	05508-60203
2	2	FASTENER	1530-1099
3	1	PLENUM	05508-00011
4	2	LOCKWASHER	2190-0577
5	1	POWER MODULE	0950-0443
6	1	NUT, 1/4" x 40 HEX	2950-0052
7	1	BOARD ASSY, AA CONNECTOR	05508-60004
8	2	SCREW 4-40 x 5/16"	2200-0105
9	12	SCREW, 4-40 x 5/16"	2200-0575
10	2	STANDOFF	0380-0844
11	1	PANEL, REAR	05508-00004
12	1	FOAM, FILTER	4208-0348
13	1	FRAME, FILTER	05508-00013
14	1	COVER, REAR	05508-00005
15	1	SCREW, 6-32 x 5/16" FH	2360-0334
16	28	SCREW, 6-32 x 1/4" PH	2380-0115
17	1	WIRE, G/Y	8150-2167
18	2	SCREW, 4-40x 1/4" FH	2200-0542
19	1	FRAME, REAR (METRIC)	5002-5919
20	4	SCREW, 6-32 x 3/16"	2360-0330
21	1	LABEL	7121-0927
22	4	POWER CORD WRAP	5041-6813
23	4	SCREW-MACH 3.5 x .6 x 25	0515-1233
24	1	FUSE, FAST-BLO FOR 100-120V LINES, 2 AMP, 250V	2110-0002
24A	1	FUSE, FAST-BLO FOR 198-242V LINES, 1AMP, 250V	2110-0001
25	1	PC BOARD, LINE SELECTOR	ORDER BY DESCRIPTION

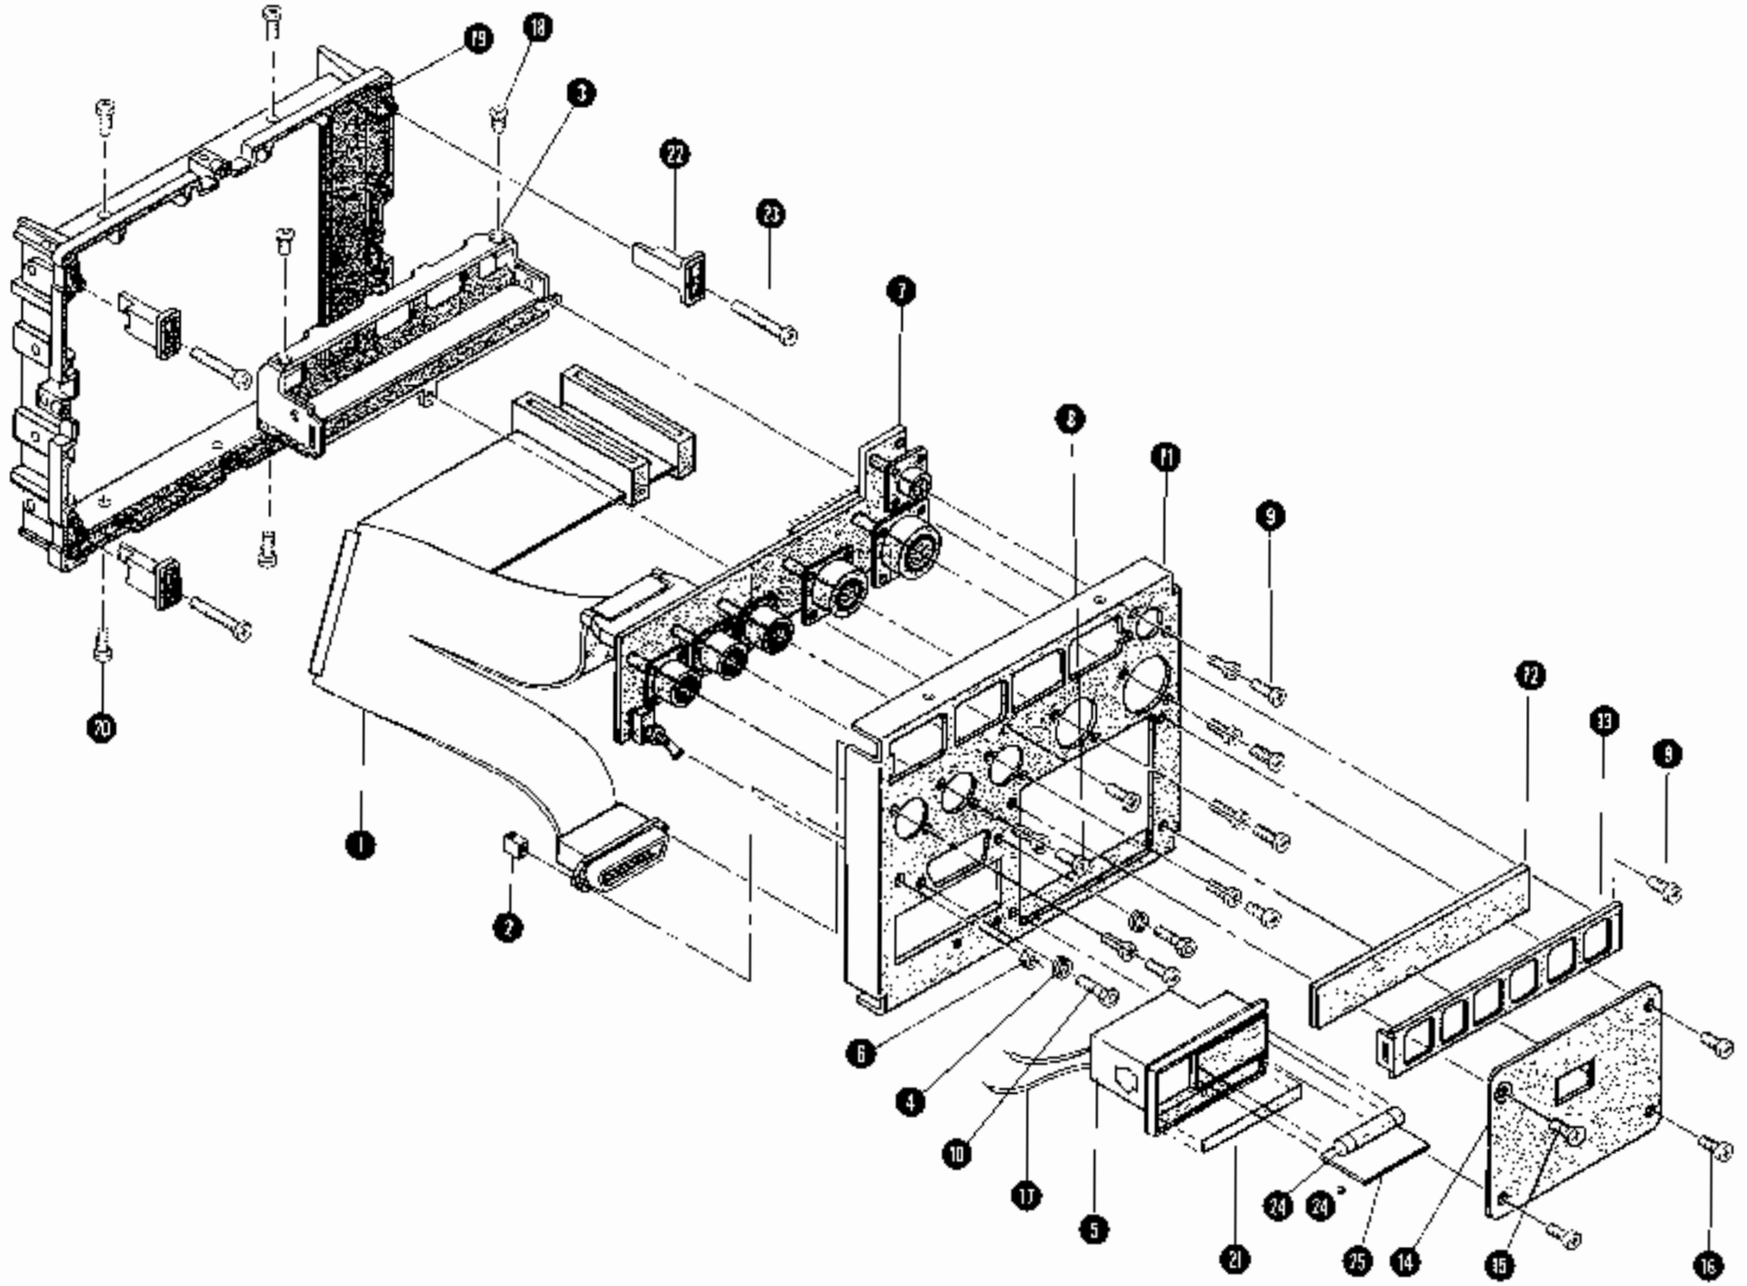


Figure 6-6. 5528A Rear Panel Exploded View



Figure 6-6
5508A REAR PANEL EXPLODED VIEW

(See Page 6-33)

5508A CABLE ASSEMBLY REPLACEABLE PARTS

ITEM	QTY	DESCRIPTION	HP PART NO.
1	1	CABLE ASSEMBLY, LASER, W5	05508-60203
2	1	CABLE ASSEMBLY, REGULATOR, W5	05508-60206
3	1	PART OF TRANSFORMER, W6	05508-60206
4	1	CABLE ASSEMBLY, CONTROL, W1	05508-60201
5	1	CABLE ASSEMBLY, PID ANALOG, A5	05508-60202
6	1	BOARD ASSEMBLY POWER SUPPLY A5	05508-60005
7	1	BOARD ASSEMBLY PROCESSOR, A2	05508-60002
8	1	BOARD ASSEMBLY COUNTER, A3	05508-60003
9	1	BOARD ASSEMBLY, CONNECTOR, A4	05508-60004

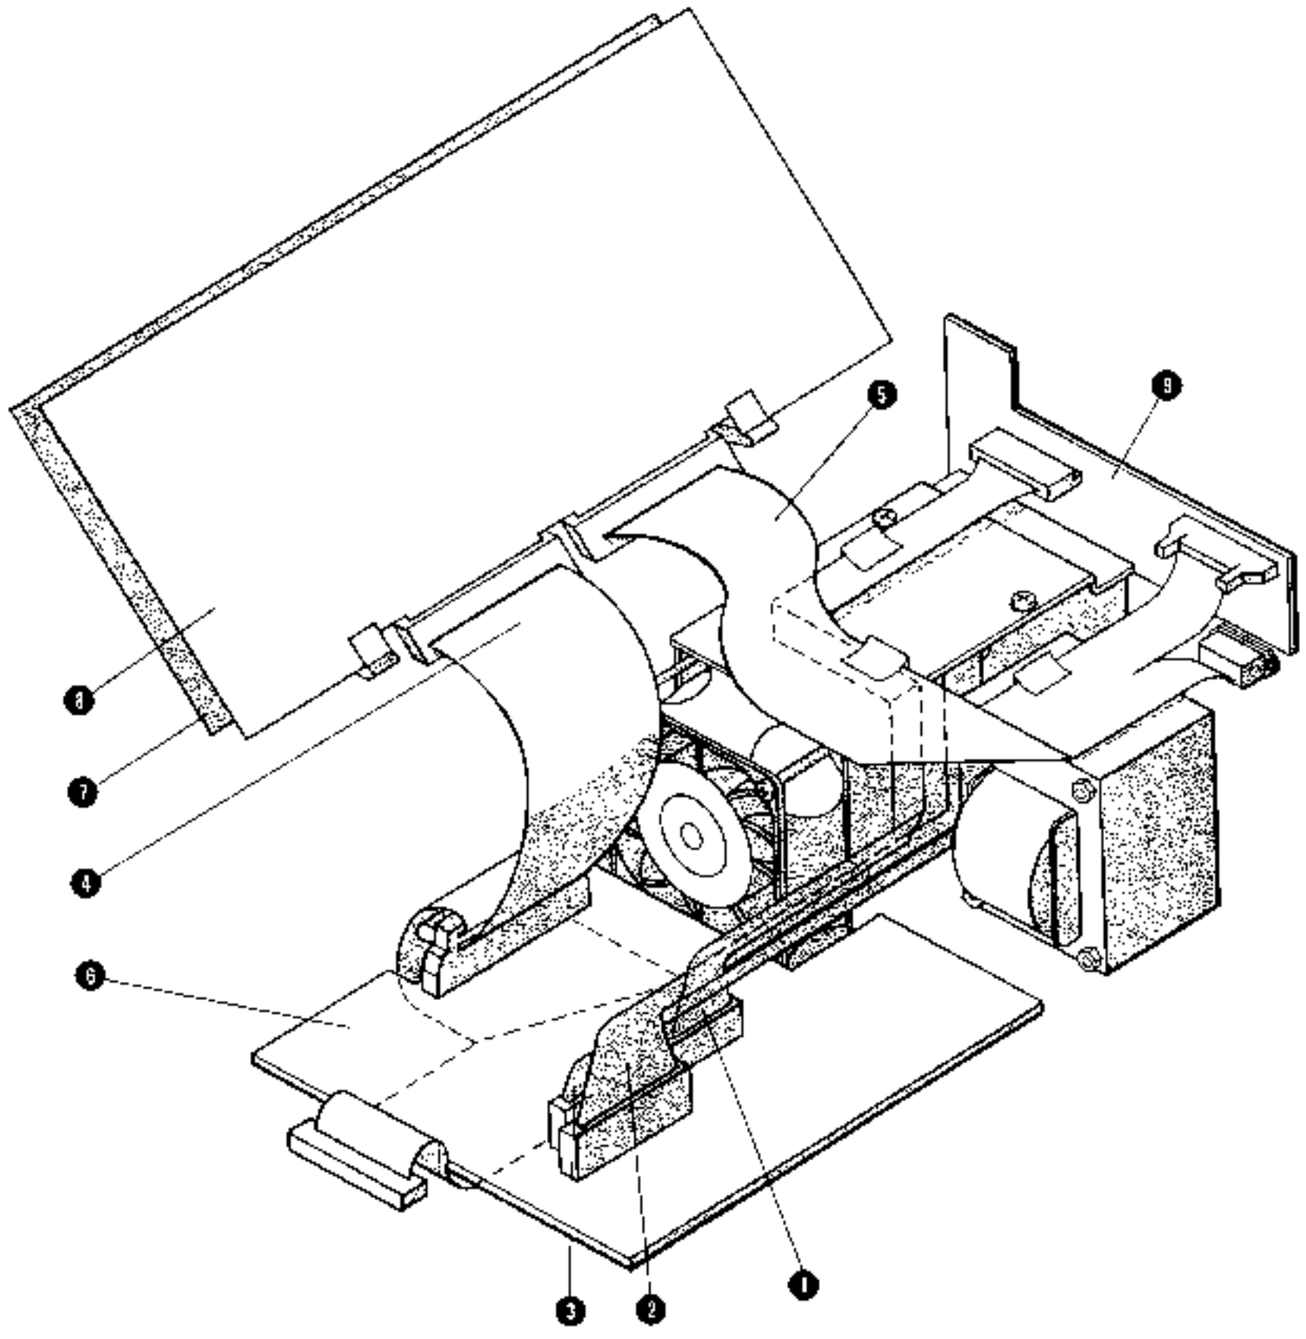


Figure 6-7. 5508A Cable Assembly Exploded View

Figure 6-7
5308A CABLE ASSEMBLY EXPLODED VIEW

(See Page 6-35

REMOTE CONTROL REPLACEABLE PARTS

ITEM	QTY	DESCRIPTION	HP PART NO
1	1	COVER	05508-40301
2	1	BASE	05508-40302
3	1	PC BOARD	05508-60326
4	1	METER	1120-1586
5	1	CABLE (4-cir circular Connector on Display end is 1251-3447; mates with 1251-3448.)	8120-3490
6	1	LABEL LOWER	7121-2059
7	1	LABEL UPPER	7121-2058
8	4	RUBBER FOOT	0403-0267
9	1	CLIP	1600-1305
10	2	FOAM RUBBER PADS (0.5MM x 4.6MM)	05508-00016
11	1	SCREW, PAN HEAD M3 x 6	0515-0907
12	1	SCREW, FLAT-HEAD M3 x .5 FMS x 6	0515-0219

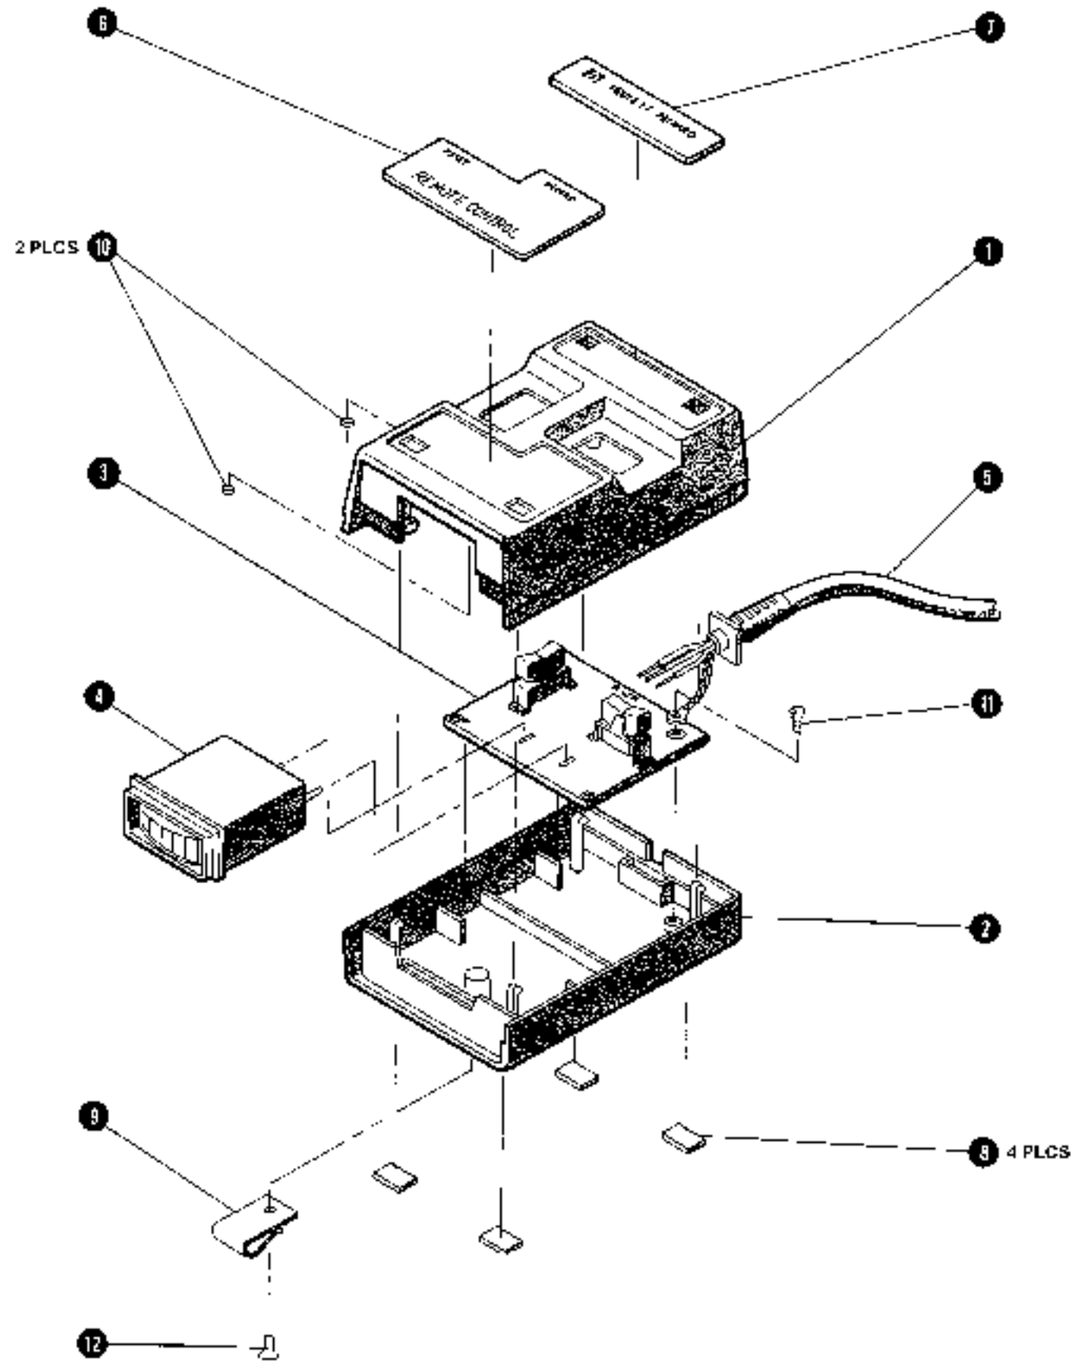


Figure 6-6. Remote Control Unit Exploded View


Figure 6-8
REMOTE CONTROL UNIT EXPLODED VIEW


[See Page 6-37]

5518A LASER HEAD REPLACEABLE PARTS

ITEM	QTY	DESCRIPTION	HP PART NO.
1	2	SCREW, FLAT HEAD M3 x .5 FHMS x 6	0515-0329
2	2	SCREW, FLAT HEAD M3 x .5 FHMS x 40	0515-0252
3	*	SCREW, M2.5 x .45 PHMS	0515-0735
4	2	VINYL BAG (NOT SHOWN)	9220-0158
5	1	FILTER (NOT SHOWN)	1000-0518
6	2	SCREW, M2.5 x .45 x 12 LG PHMS	0515-1351
7	1	MOUNTING CLIP, TRANSISTOR	05518-00002
8	1	SHUTTER, BEAM	05518-00004
9	1	SHUTTER, RETURN BEAM	05518-00005
10	1	SPRING, TURRET	05518-00006
11	1	FACE, TURRET	05518-00007
12	1	COVER	05518-00012
13	1	BASE, MACHINED	05518-20321
14	1	DEMOD POLARIZER ASSEMBLY	05518-60312
15	A/R	EPOXY (FOR ITEM 14)	8530-0044
16	7	WASHER, FLAT	3160-0891
17	1	BASE, TURRET	05518-40005
18	1	BOARD ASSEMBLY, RECEIVER	05518-60002
19	1	BOARD ASSEMBLY, CONTROL/REFERENCE	05518-60003
20	1	BOARD ASSEMBLY, SAMPLER	05518-60004
21	1	BOARD ASSEMBLY, CONNECTOR	05518-60201
22	1	LASER ASSEMBLY	05517-60001*
23	1	POWER SUPPLY ASSEMBLY	0950-0470
24	*	SAMPLER ASSEMBLY	05518-60307
25	1	STRAIGHTNESS MOUNT	05518-60308
26	1	CABLE SWITCH ASSEMBLY	05518-60309
27	1	STANDOFF, HEX M3 x .5 x 12	0380-1382
28	1	LABEL, FRONT	7121-1570
29	1	LABEL, REAR	7121-1571
30	1	INSULATOR, TRANSISTOR	0340-0804
31	1	SCREW M3 x .5 x 6 PHMS	0515-0055
32	1	SCREW M3 x .5 x 12 PHMS	0515-0077
33	2	SCREW M3 x .5 x 8.0 PHMS	0515-0211
34	*	SCREW M3 x .5 x 10.0 PHMS	0515-0407
35	8	SCREW M6 x 1.0 x 16 SOC HD	0515-0931
36	4	SCREW MACH 3 x .5 x 10MM LG	0515-1125
36A	4	WASHER, BEVELED	3050-1390
37	2	SCREW M4 x .7 x 10 LG PHMS	0515-0414
38	2	SCREW M3 x .5 x 35 PHMS	0515-0990
39	1	LABEL, MANUFACTURE DATE	7121-1650
40	3	WASHER, STAR	2190-0644
41	*	RIVET, TUBULAR	3050-0062
42		NOT ASSIGNED	
43	*	NOT ASSIGNED	*
44	4	WASHER, FLAT	3050-0795
45	1	POLARIZER (NOT SHOWN)	1000-0518
46	*	NOT ASSIGNED	*
47	3	LOCKWASHER, SPLIT RING	2190-0592
48	1	LEVELING FOOT	05518-20316
49	1	LOCK NUT	05518-20317
50	3	CAP SCREWS M8 x 1.25	0515-0798
51	1	LIQUID CRYSTAL	1990-0760
52	2	ELASTOMERIC CONNECTOR	0160-0530
53	1	WASHER, FLAT	3050-0893

*Item 22 Laser Tube Assembly is available as an exchange replacement part — P/N 05517-60501

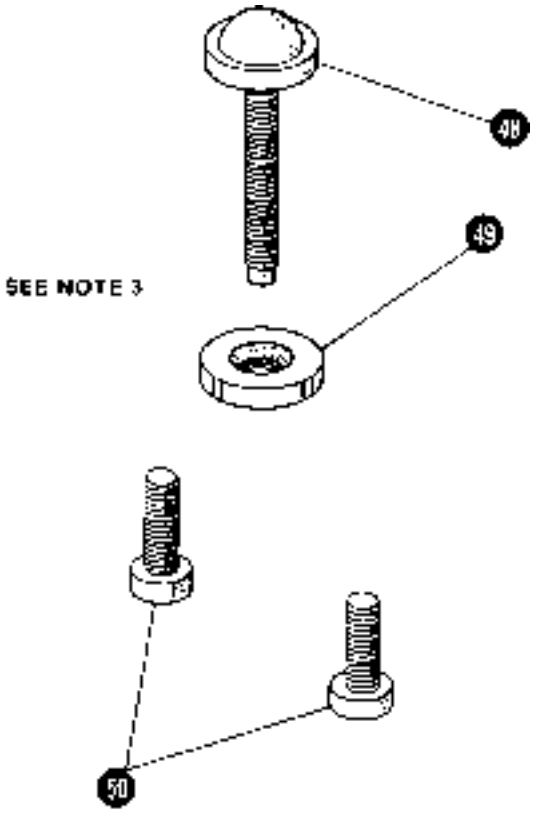
48
49
SEE NOTE 3
50

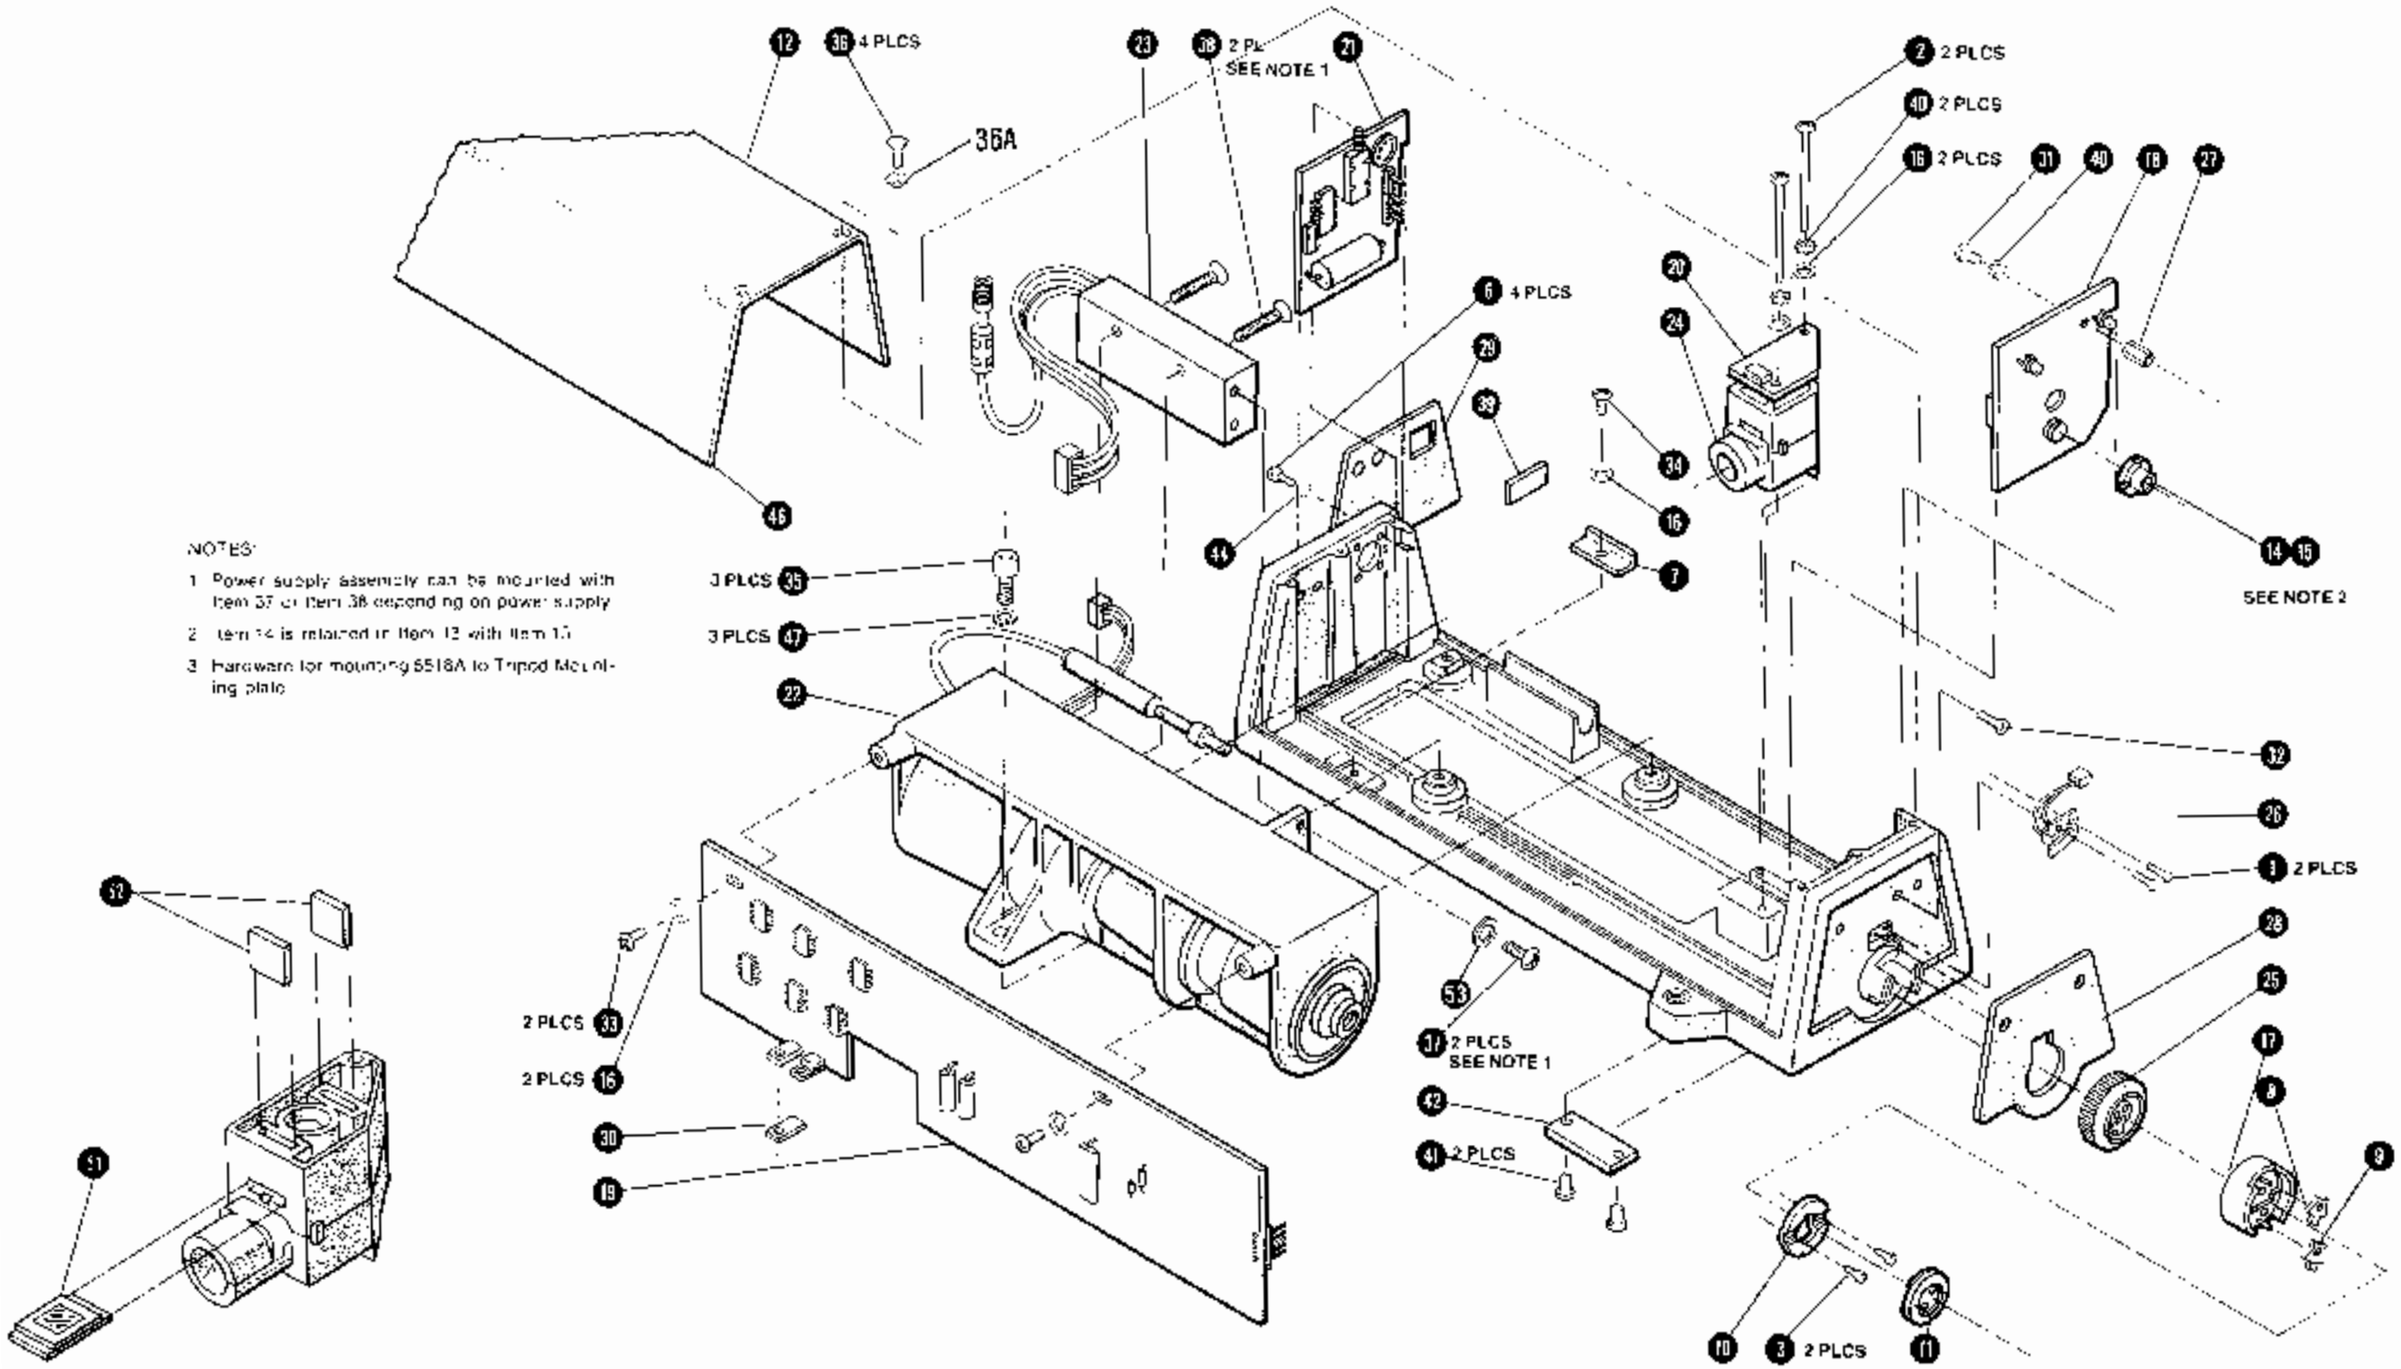

NOTES:

1. Power supply assembly can be mounted with item 37 or item 38 depending on power supply.
2. Item 14 is retained by item 13 with item 15.
3. Hardware for mounting 5518A to Tripod Mounting plate.

Figure 6-8. 5528A Laser Head Exploded View

10751A/B REPLACEABLE PARTS

ITEM	QTY	DESCRIPTION	HP PART NO.
1	1	HOUSING COVER	10751-40001
2	1	BOARD ASSEMBLY A1	10751-60001
3	1	BOARD ASSEMBLY, A2	10751-60002
4	1	CABLE AND HOUSING ASSEMBLY	(SEE TABLE 1)
5	3	SCREW 2-.45 x 8 PHMS	0515-0403
6	2	SCREW, M4 x .7 x 25	0515-0396
7	1	PLATE, SERIAL	5060-0096
8	1	LABEL, FRONT	10751-80002
9	1	PRESSURE TRANSDUCER ASSEMBLY	0960-0656
10	1	MAGNETIC BASE ASSEMBLY	9184-2194
11	1	LABEL, ORIENTATION	10751-80001
12	3	NUT, HEX M2.5	0535-0058
13	1	LABEL, CALIBRATION	7121-2719

TABLE 1

MODEL NUMBER	CABLE AND HOUSING ASSEMBLY	CABLE LENGTH
10751A	10751-60001	4M (16.4 ft)
10751B	10751-60002	15M (49.2 ft)

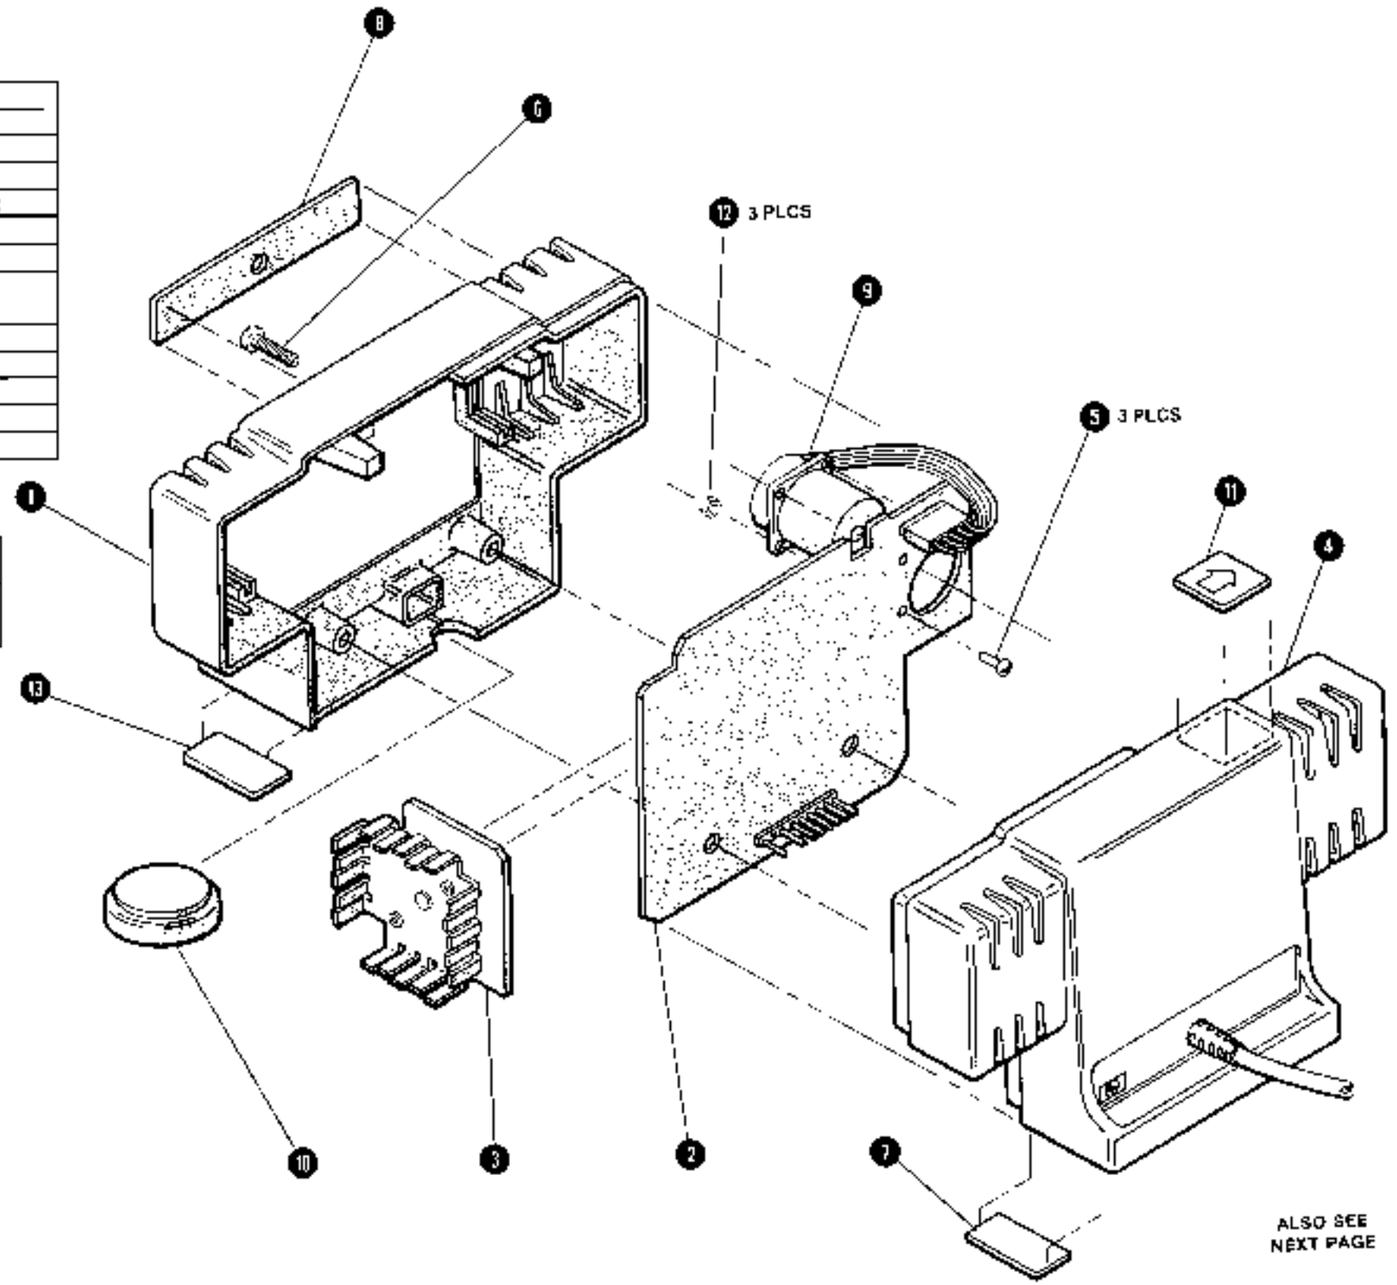


Figure 6-10. 10751A/B Exploded Views (Sheet 1 of 2)

Figure 6-2
10751A/B EXPLODED VIEWS (Sheet 1 of 2

(See Page 6-41

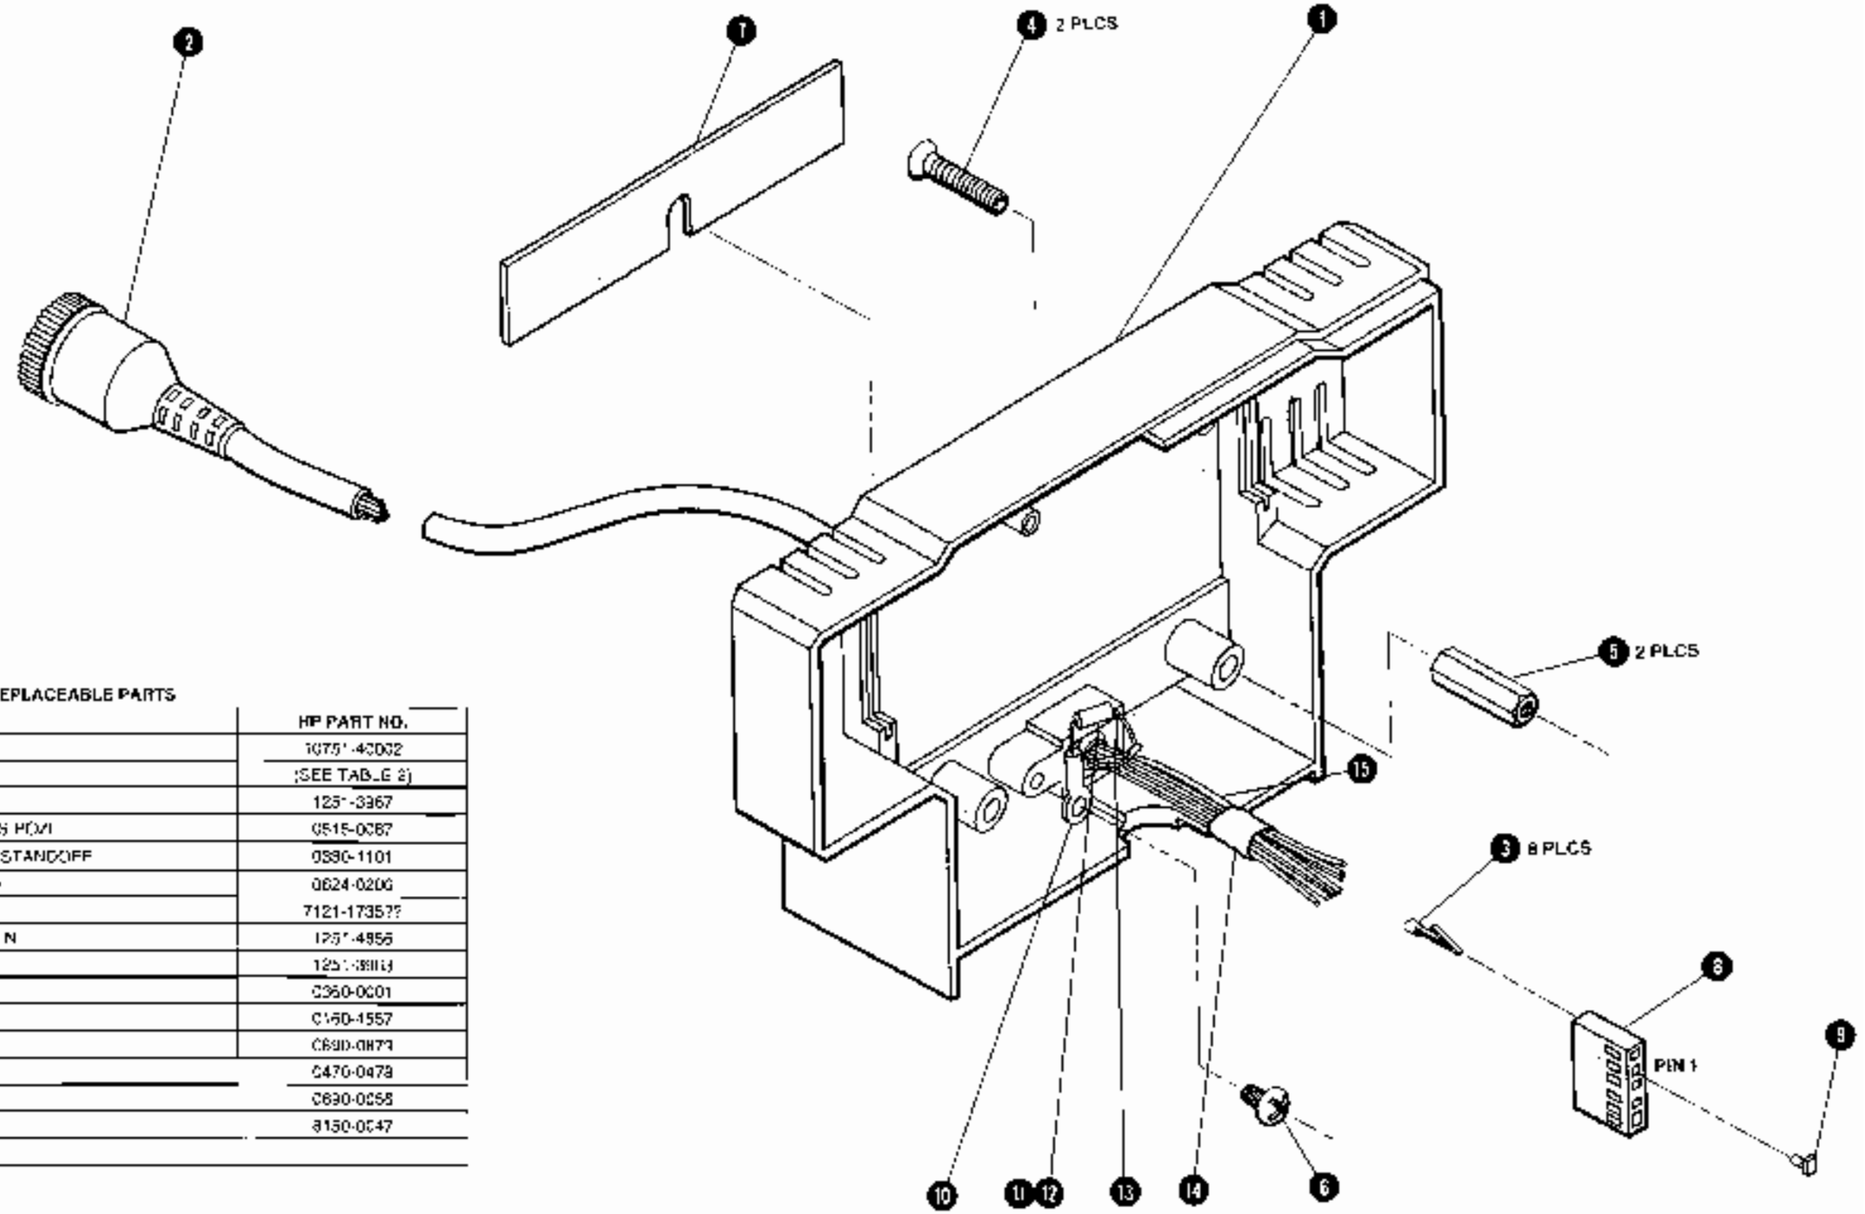


Figure 6-20. 10751A/B Exploded Views (Sheet 2 of 2)

REMOTE CONTROL REPLACEABLE PARTS

ITEM	QTY	DESCRIPTION	HP PART NO.
1	1	HOUSING COVER	10751-40002
2	1	CABLE ASSEMBLY	(SEE TABLE 2)
3	1	CONTACT	1251-3967
4	1	SCREW M4 x .7 x 25 PHMS POZI	0515-0067
5	2	SCREW M4 x .7 x 16 HEX STANDOFF	0390-1101
6	1	#6 TAPTITE POZI PAN HD	0624-0206
7	1	LABEL REAR	7121-17357
8	1	CONNECTOR BLOCK, 9 PIN	1251-4956
9	1	KEY	1251-3811
10	1	SOLDER LUG #6	0360-0001
11	1	CAPACITOR C1	0160-4557
12	A/R	SHRINK TUBING	0690-0879
13	A/R	EPOXY, 2-PART	0470-0479
14	A/R	SHRINK TUBING	0690-0058
15	2'	WIRE, 24-GAGE	8150-0047

TABLE 2

MODEL NUMBER	CABLE AND HOUSING ASSEMBLY	CABLE LENGTH
10751A	8120-3492	5 M (16.4 ft.)
10751B	8120-3663	15M (49.2 ft.)

Figure 6-10.
1075 tA/8 EXPLODED VIEWS (Sheet 2 of 2)

[See Page 6-63]

10751A/B REPLACEABLE PARTS

ITEM	QTY	DESCRIPTION	HP PART NO.
1	1	LABEL, SENSOR	7121-1610
2	1	MATERIAL SENSOR CABLE	(SEE TABLE 1)
3	1	BOARD ASSEMBLY, MATERIAL TEMPERATURE	10757-60201
4	1	POD, MATERIAL SENSOR	10757-40201
5	1	LABEL, IDENTIFICATION	(SEE TABLE 1)
6	1	CABLE ASSEMBLY	10757-60204
7	1	LABEL, IDENTIFICATION	10757-80204
8	4	SCREW, M3 x .5 x 12	0515-0426
9	1	RETAINER, PUSH-ON	0510-1149
10	2	SHIELD, ESD	10757-20203
11	2	JUMPER, D P SHUNT	1902-0520
12	1	JUMPER, REMOVABLE	1258-0141

TABLE 1

MODEL NUMBER	CABLE AND HOUSING ASSEMBLY	CABLE LENGTH
10757A	10757-60301	10757-60001
10757B	10757-60302	10757-60002
10757C	10757-60303	10757-60003


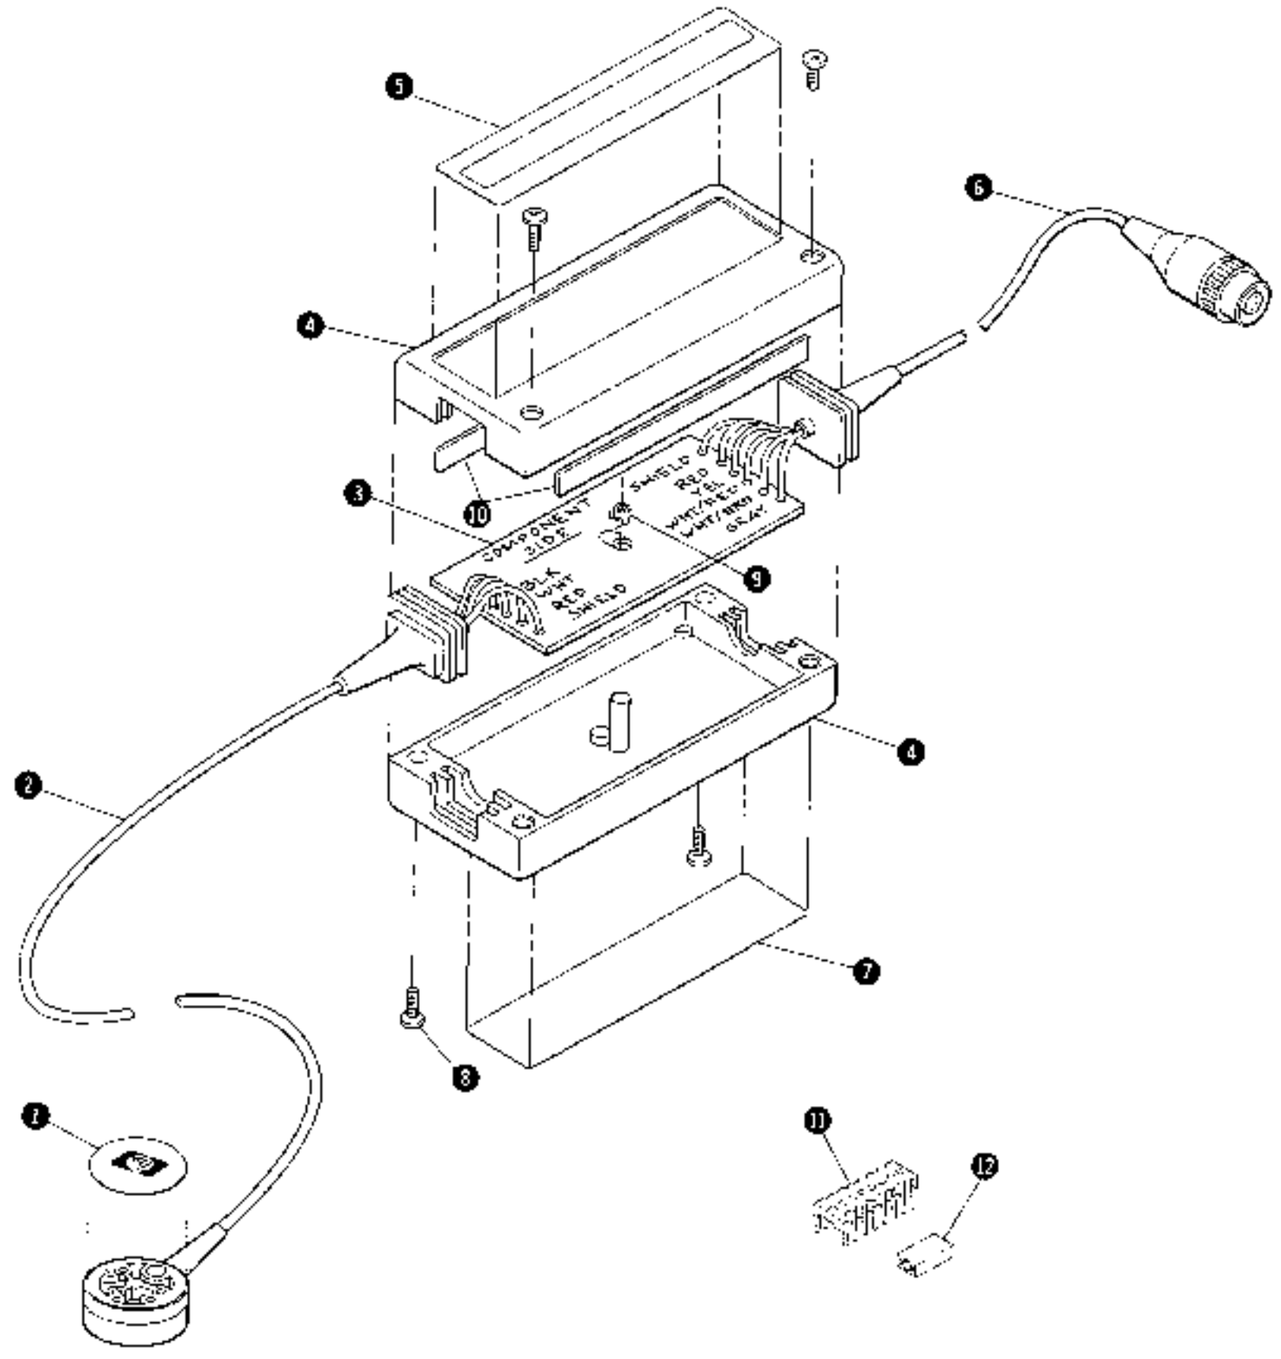


Figure 6-11. 10757A/B/C Exploded Views

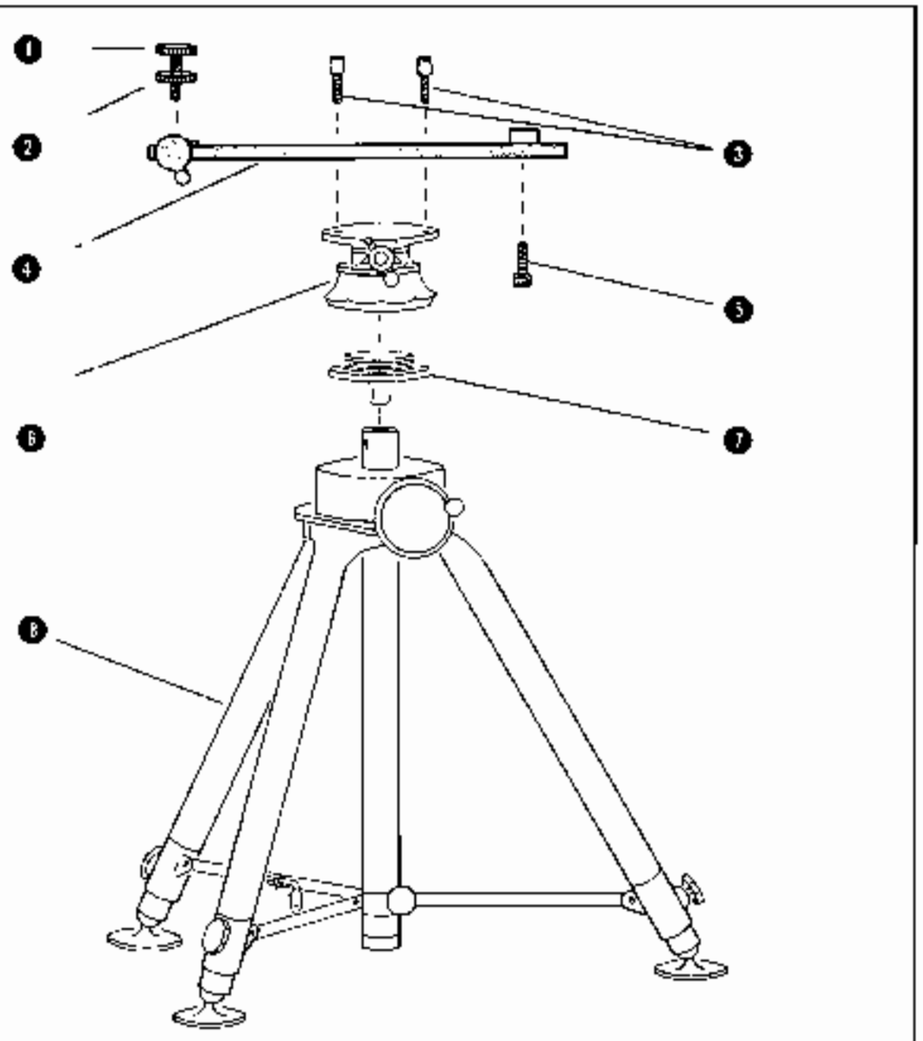

ITEM	QTY	DESCRIPTION	HP PART NUMBER
1	1	Leveling Foot	*05516-20316
2	1	Nut	*05516-20317
3	4	Cap Screws (1/4-20 X 3/4	3020-0004
4	1	Mounting Plate	10753-60001
5	2	Cap Screws (M8 X 1.25 -	*0515-0798
6	1	Cross Slide Assembler	1000-0367
7	1	Transit Adapter	1531-0052
8	1	Tripod	1530-2169

*Supplied with 5518A

Figure 6-13. 10753A Tripod, HF Replaceable Parts

Figure 6-11
10757A/B/C EXPLODED VIEW

(See Page 6-45)

10753A TRIPOD MANUFACTURER'S REPLACEABLE PARTS

ITEM	DESCRIPTION	PART NUMBER
1	KNOB	1-03518-7-QST
2	KNOB SHAFT	1-03500-5-QST
3	SET SCREW 1/4-28 x 1/4 SOC. CUP PT.	1-12081-8-QST
4	HANDWHEEL KNOB	1-03499-0-QST
5	SCREW 8/32 x 3/8 PHIL. TRUSS	1-12008-8-QST
6	WASHER 21/64 x 15/32 x .062 STL.	1-12320-7-QST
7	POP RIVET	1-12731-5-QST
8	SPRING WASHER	1-03569-0-QST
9	FOOT PLATE	1-03247-A-QST
10	FOOT PAD	1-03236-8-QST
11	PIVOT RETAINER	1-04589-X-QST
12	O RING	1-12721-6-QST
13	PIVOT RETAINING RING	1-03086-X-QST
14	PIVOT	1-03046-X-QST
15	PIVOT SEAT	1-03060-0-QST
16	LEG LOCK SCREW	1-03285-5-QST
17	LEG LOCK RING	1-04684-X-QST
18	LOWER LEG JOINT BEARING	1-04504-5-QST
19	SCREW 1/4-28 x 3/4 S.H.	1-12148-2-QST
20	LOCK NUT 1/4-28 HEX.	1-12209-2-QST
21	NUT 1/4-28 x 7/16 SQUARE	1-12207-6-QST
22	STRUT YOKE	1-11383-A-QST
23	STRUT YOKE BEARING	1-11633-4-QST
24	HOLD DOWN RING	1-03976-A-QST
25	3/16" ALLEN KEY MOUNT	1-14044-1-QST
26	RUBBER GROMMET	1-12691-1-QST
27	WRENCH MOUNT	1-03517-0-QST
28	O RING BUMPER	1-12720-8-QST
29	COLUMN ASSEMBLY	1-04374-4-QST
30	SCREW SEAT	1-03263-0-QST
31	ELEVATOR PLATE BEARING	1-03404-0-QST
32	COLUMN STOP RING	1-04398-3-QST
33	COLUMN BEARING	1-04392-6-QST
34	BOLT 3/8-24 x 5" HEX. HD.	1-12141-7-QST
35	LOCK NUT 3/8-24	1-12247-2-QST
36	COLUMN KEY	1-03401-6-QST
37	WASHER 9/64 x 7/16 x 1/16 STL.	1-12301-7-QST
38	HANDWHEEL 4-1/2"	1-03254-9-QST
39	DRIVE SHAFT	1-03246-5-QST
40	GROOVE PIN 1/8 x 1/2 TYPE E	1-12565-7-QST
41	WORM	1-11465-X-QST
42	THRUST BEARING	1-12606-9-QST
43	RETAINING RING	1-12509-5-QST
44	WORM GEAR	1-11466-9-QST
45	KEY 1/8 x 1/8 x 9/16 STL.	1-03600-3-QST

10753A TRIPOD MANUFACTURER'S REPLACEABLE PARTS (Continued)

ITEM	DESCRIPTION	PART NO.
46	PINION SHAFT	1-03255-5-QST
47	PINION	1-03251-5-QST
48	BRAKE KNOB	1-04385-2-QST
49	LEG COLLAR	1-04632-5-QST
50	STRUT YOKE SCREW	1-04626-7-QST
51	WASHER 33/64 x 21/32 x .005 BR.	1-12379-3-QST
52	WASHER 1/2 x 11/16 x 1/16 STL.	1-12370-2-QST
53	COLUMN BRAKE SCREW	1-03724-X-QST
54	CLAMP	1-03944-5-QST
55	WASHER 1/2 x 11/16 x 1/32	1-12371-0-QST
56	STRUT	1-04602-8-QST
57	STRUT FOR WRENCH MOUNT	1-04603-6-QST
58	LOWER LEG	1-11198-8-QST
59	STRUT TUBE	1-04601-0-QST
60	SCREW #10-32 x 3/8 PHIL. TRUSS	1-12152-4-QST
61	WASHER 21/64 x 31/64 x 1/32 STL.	1-12318-9-QST
62	WASHER SHIM 3/8 x 5/8 x .005 STL.	1-12378-1-QST
63	PLATE & COVER ASSEMBLY	1-14392-A-QST
64	3/4 UPPER LEG ASSEMBLY	1-14011-A-QST

Part of Figure 6-12. 10753A Tripod, HP Replaceable Parts

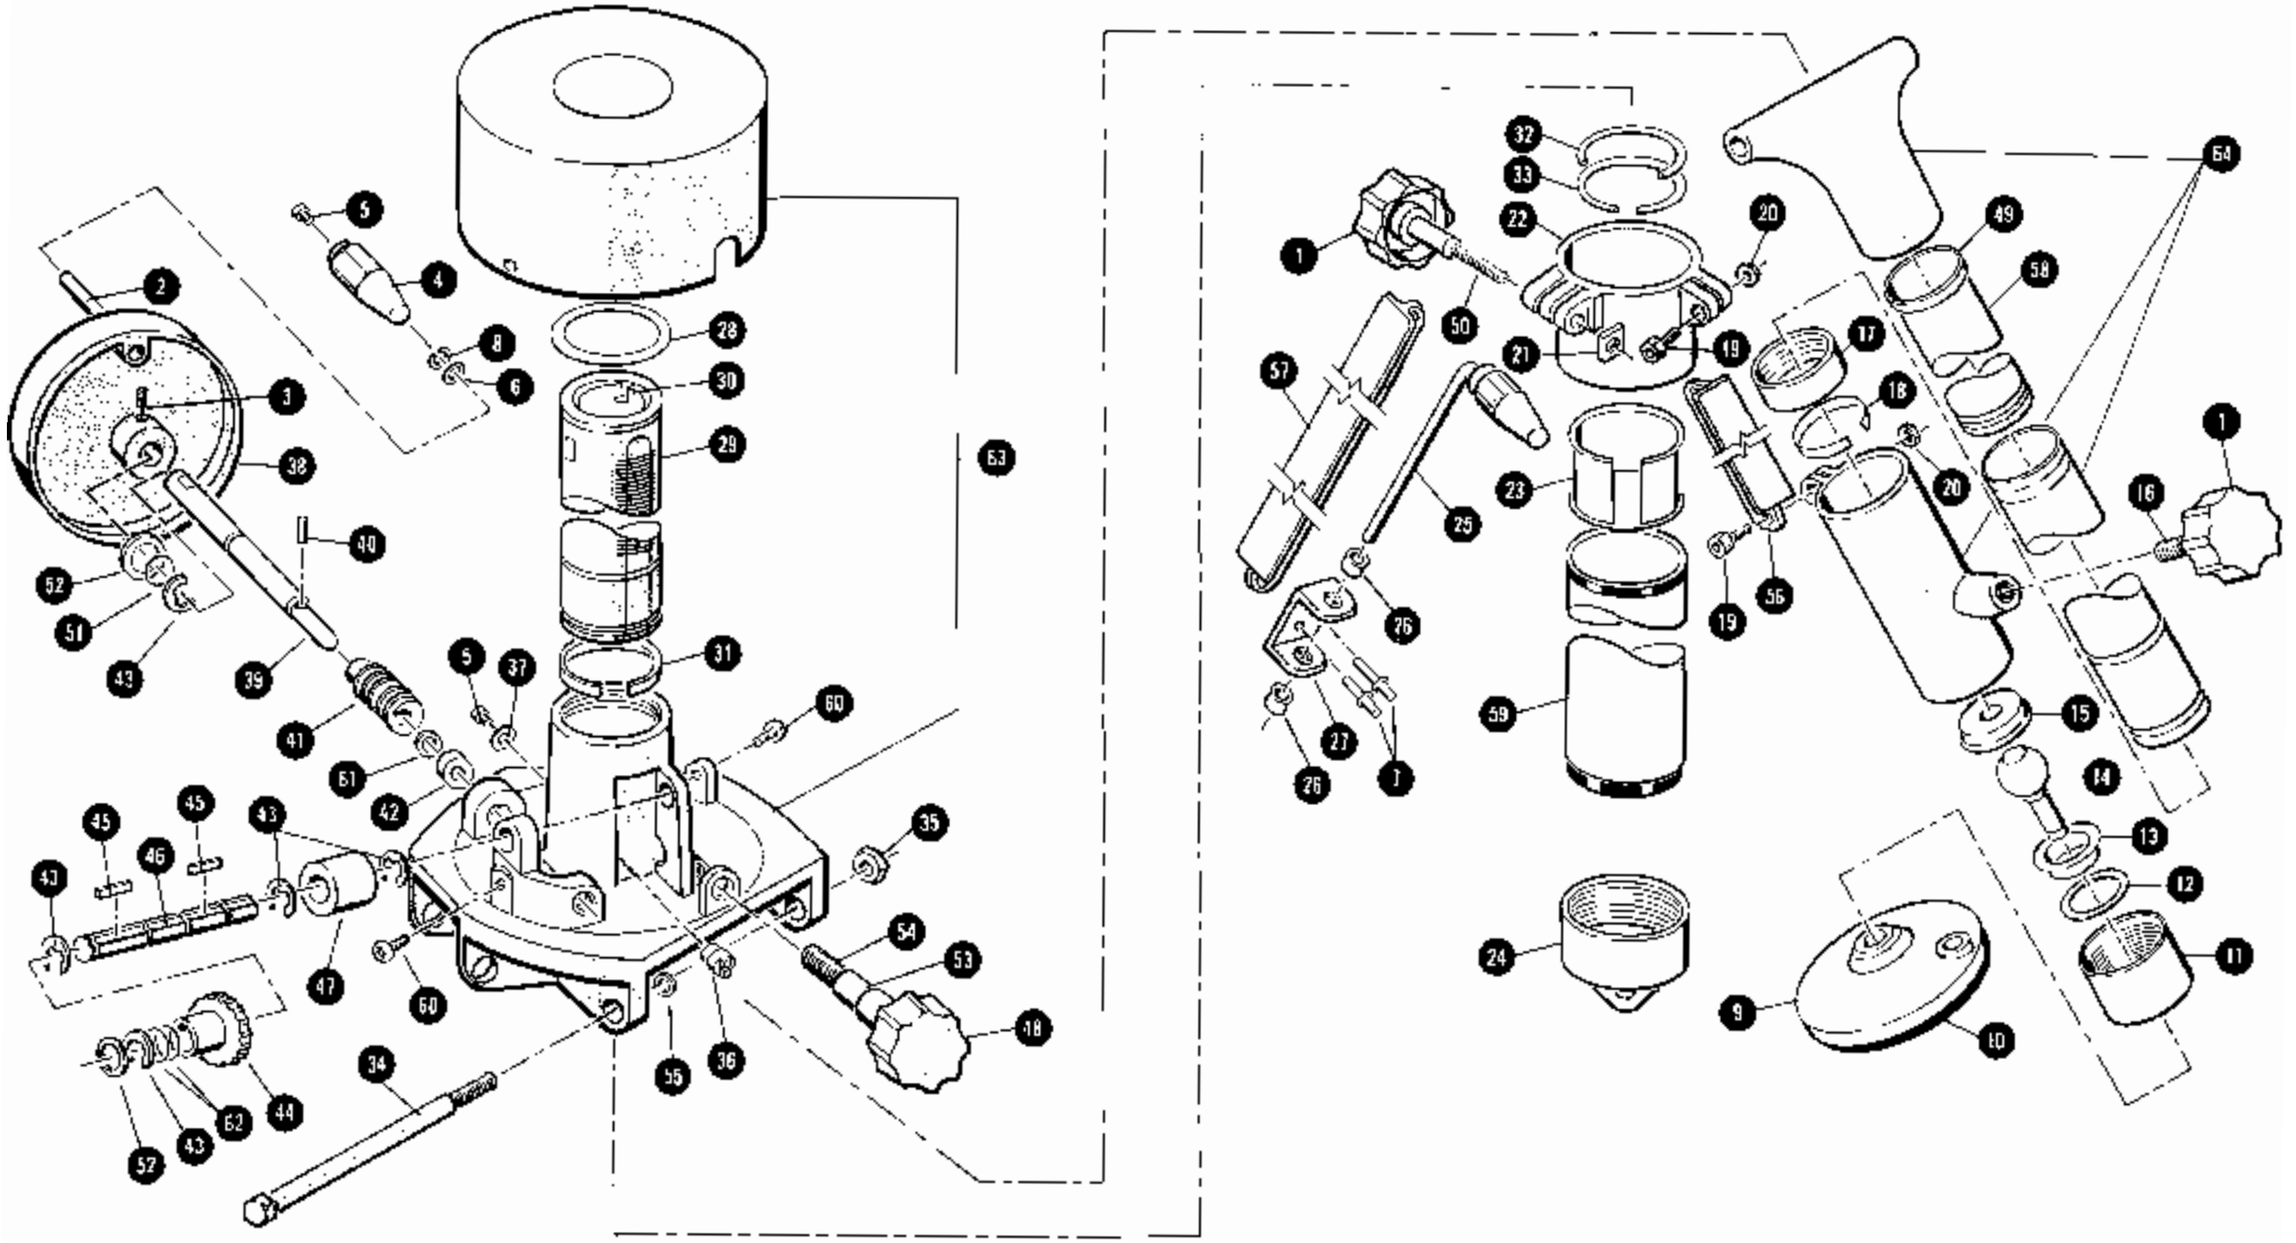


Figure 6-12. 10753A Tripod Replaceable Parts

Figure 6-12
10753A TRIPOD REPLACEABLE PARTS

[See Page 6-47]

SECTION VII
MANUAL CHANGES

Page

Introduction 7-1
Newer Instruments 7-1
Older Instruments 7-1
5508A Manual Backdating 7-1
5518A Manual Backdating 7-14
10751A/B/ Manual Backdating 7-25
10757A/B/C Manual Backdating 7-26

SECTION VII
MANUAL CHANGES

7-1. INTRODUCTION

7-2. This section contains information required to update this manual to cover newer or older instruments with serial prefixes different than those shown on the title page

7-3. Newer Instruments

7-4 Newer instruments may have higher serial number prefixes than those listed in Table 1-1, The manual shipped with a 5528A Laser Measurement System will include a "Manual Updating Changes" sheet that describes all required changes to update the manual. If any of the instruments shipped with the system have a higher serial number than those listed on the title page and the "Manual Updating Changes" sheet does not cover the prefix, contact your local HP Sales and Support Office for information.

7-5. Older Instruments

7-6 Older instruments may have lower serial number prefixes than those listed in Table 1-1. The following tables list the serial number prefixes of older instruments that differ from the instruments documented in this manual. Table 7-1 covers 5508A backdating, Table 7-2 covers 5518A backdating, Table 7-3 covers 10751A/B backdating, and Table 7-4 covers 10757A/B/C backdating. Find the prefix in the tables that corresponds to your instrument and make the backdating changes specified.

Table 7-1. 5508A Manual Backdating

If your Instrument Has Serial Prefix or Serial Number	Make Backdating Change
A3 (05508-60003) below Date Code 91195	1
A1 (05508-60001) below Date Code 91212	1,2
A2 (05508-60002) below Date Code 90411	1,2,3
A2 (05508-60002) below Series 3040	1 through 4
5508A, 2948A to Series 2732A	1 through 5
5508A from Series 2732A to 2704A	1 through 6
5508A from Series 2704A to 2648A	1 through 7
5508A from 2648A to 2532A02139	1 through 8
2516A	1 through 9
2512A	1 through 10
2312A	1 through 11
2230A	1 through 12
2220A	1 through 13
2216A,2126A	1 through 14

CHANGE 1 (05508-60003 Date Code 91212)

To backdate the 05508-60003 board from Date Code 91195 to Date Code 91212, make the following changes:

Table 6-3. A3 Counter Board Assembly Replaceable Parts:
Change A3 C14 and C53 from 0160-3874 (10pf) to 0160-4385, CAPACITOR 15PF ±5% 200VDC CER 0±30.
Change A3R2 and R31 from 0757-0280 (31.6 ohms) to 0698-3442, RESISTOR 237 1% .12W F

Figure 8-B-21. 5508A Counter Board (05508-60003) Schematic Diagram:
Change A3 C14 & C53 values from 10 pf to 15 pf
Change A3R2 & R31 values from 31.6 ohms to 237 ohms.

CHANGE 2 (05508-60001 Date Code 90411)

To backdate A1 (05508-60001) from Series 3124A(02797) (Date Code 91212) to Date Code 90411, make the following changes.

Table 1-1 Change 5508A SERIES from 3124A to 90411.
Table 6-3. 5508A A1 Keyboard/Display Board Replaceable Parts:
Change A1U1 and U8 from 1820-4688 to 1820-2132.
Figure 8-B-5. A1 Keyboard/Display Board Schematic Diagram:
Change A1U1, U8 from 1820-4688 to 1820-2132, ICM7218A, in Table of Active Elements .

CHANGE 3

To backdate the 05508-60002 from Date Code 90411 to Series 3040, make the following changes.

Table 6-3. A2 Processor Board Assembly Replaceable Parts:
Delete A2C6, C7, .01UF CAPACITOR.

Page 8-B-19. Processor Board Test Switch, Troubleshooting Procedures:
Change step b to read.
Perform Test 2 in Paragraph 8-B-83. If OK go to h, else c
Add steps c thru g.

c. Are U10 pins 7-11 signatures OK? If not go to h, else d.

d. Perform Test 7 in Paragraph 8-B-91a. If bad, replace U9, else e.

e. Perform Test 8 in Paragraph 8-B-91c. If bad, go to step g, else f

f. Perform Test 9 in Paragraph 8-B-91e. If bad, replace U5, else replace U8.

g. Perform Test 9 in Paragraph 8-B-91e. If bad, replace U6 else replace U7.

Page 8-B-20. Processor Board Test Switch, Troubleshooting Procedures:
Add Tests 7 thru 9 in Table 8-B-2.

Table 8-B-2. Summary of 5508A Processor Board A2 Signature Analysis Tests

Test #	Test Switch A2S3 Switch Position	Circuitry Under Test
7	00000101	F800 ROM: U9
8	00000110	E000 & E800 ROMS: U6, U7
9	00000111	E000 & C000 ROMS: U6, U5

CHANGE 3 (Continued)

Change the following Kernal Signatures to read as indicated:

U13 Pin No.	
29	UP74
30:	A18H
30	ACF0

Add the following to the end of paragraph 8-B-81, "If signatures are still incorrect, move A2 JMP1 to TEST. Correct signatures indicate faulty U10 or its inputs."

Page 8-B-22 TEST 2. All ROMS Test

Change paragraph 8-B-84 to read as follows:

8-B-84. This test verifies operation of U5, U6, U7, U8, and U9 assuming that the kernel is functioning properly. All ROM locations are read and data bus signatures are checked to confirm ROM contents. ROM memory is divided into parts by test 7, 8, and 9. These should be used only if incorrect signatures are observed on the data bus during this test.

Add "JMP1:NORM" under test switch diagram.

Add kernal signature column for U10.

U10 Pin No.	
7:	91C4
9:	774F
10:	F0HH
11:	664H

Change "4068" to "4068" under U11 Pin No.

Page 8-B-23 5508A Measurement Display:

Add "JMP1:NORM" under test switch diagram.

Add signature kernel column for U10.

U10 Pin No.	
7:	67F5
9	8HH5
10	U831
11	PH66

Change "P268" to "1H2U" under U11 Pin No

Page 8-B-24. 5508A Measurement Display:

Add "JMP1:NORM" under test switch diagram.

Page 8-B-25. 5508A Measurement Display:

Change U4 input 14 to read as follows: 14- F599 (2163 with VELOCITY key)

Page 8-B-26. Test 6. Interrupt Encoder Test:

Add "JMP1:NORM" under test switch diagram.

Page 8-B-27 Tests 7, 8, and 9. ROM Tests:


Add paragraphs 8-B-91, Tests 7, 8, and 9. ROM Tests

CHANGE 3 (Continued)

8-B-91. Tests 7, 8, and 9, ROM Tests

8-B-92. Use these tests when Test 2 indicates a possible ROM failure. The tests are designed to isolate trouble to U5, U6, U7, U8, or U9.

a. For test 7, set Processor Board A2 switches and jumpers as follows:

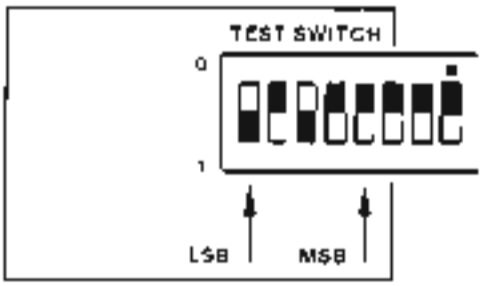

JMP1: NORM
JMP2: Installed


b Toggle MASTER PRESET switch and measure signatures at the following nodes:

+5 V Test Signature. H8U4

U13 Pin No.
30: 139U
31: 36F4
32: 2595
33: 4PUC
34: U-2U0
35: CHFH
36: 4U36
37: P12U

If test 7 yields incorrect signatures, replace U9 and verify all ROM tests.

c. For test 8, set the TEST SWITCH A2S3 as shown below.

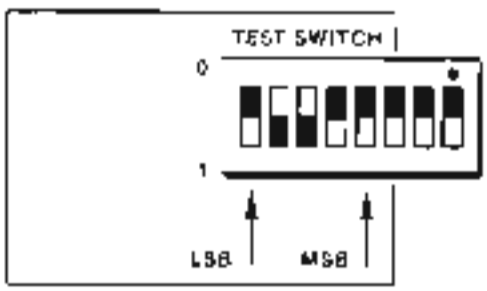


CHANGE 3 (Continued)

d. Toggle MASTER RESET switch and measure signatures at the following nodes:

+5V Test Signature: 4OUO

U13 Pin No.	
30:	2P60
31:	0553
32:	OCH3
33:	84C9
34:	3H24
35	3033
36:	9372
37:	697C

e. For test 9, set TEST SWITCH A2S3 as shown below:

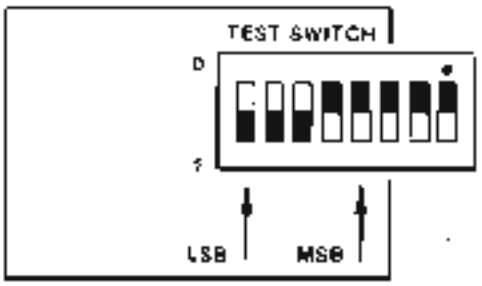

f. Toggle MASTER RESET switch and measure signatures at the following nodes:

+5V Test Signature: 237C

U13 Pin No.	
30:	2A7L
31:	AP7F
32:	81U2
33:	PA4F
34.	20F7
35:	41CC
36:	C8P2
37:	H536

If test 9 is OK, but test indicates a failure, replace U7. If test 9 gives the indication of failure, replace U5. If both tests indicate a failure, replace U6. If tests 7, 8, and 9 give correct signatures and test 2 indicates a failure, then replace U8.

CHANGE 3 (Continued)

Page 8-B-30 5508A Measurement Display
Change U13 signatures to read as indicated:

U13 Pin No.	
30:	PU68
31:	2A54
32:	8A1U
33:	U2CU
34:	796C
35:	UFU6
36:	2183
37:	102C

CHANGE 4 (05508-60002 Series 2732A)

To back date from Series 3040A to 2732A, make the following changes:

Page 1-3, General Information
Change 5508A SERIES to 2732A in Table 1-1.

Figure. 8-B-18 5508A A2 Processor Board Component Locator/Schematic Diagram.
Replace A2 (05508-60002) component locator/schematic diagram with Figure 7-1 supplied in these manual changes.


CHANGE 5 (5508A SERIAL PREFIX 2732A)

To backdate from Series 2948A to Series 2732A, make the following changes:

Page 6-23, 5508A Cabinet Replaceable Parts:
Change MP1 Top Cover P/N from 5062-3730 to 5061-9430.
Change MP2 Top Trim P/N from 5041-8803 to 5040-7203.
Change MP5 Side Cover P/N from 5062-3761 to 5061-9461.
Change MP12 Bottom Cover P/N from 5062-3742 to 5061-9442.
Change MP13 Foot Non-Skid P/N from 5041-8822 to 5040-7222.
Change MP15 Foot P/N from 5041-8801 to 5040-7201.


Page 6-31, 5508A Front Panel Replaceable Parts:
Change MP2 Frame-Front P/N from 5021-8417 to 5020-5817.

Page 6-33, 5508A Rear Panel Replaceable Parts:
Change MP22 Rear Power Cord Wrap P/N from 5041-8813 to 5040-7213.

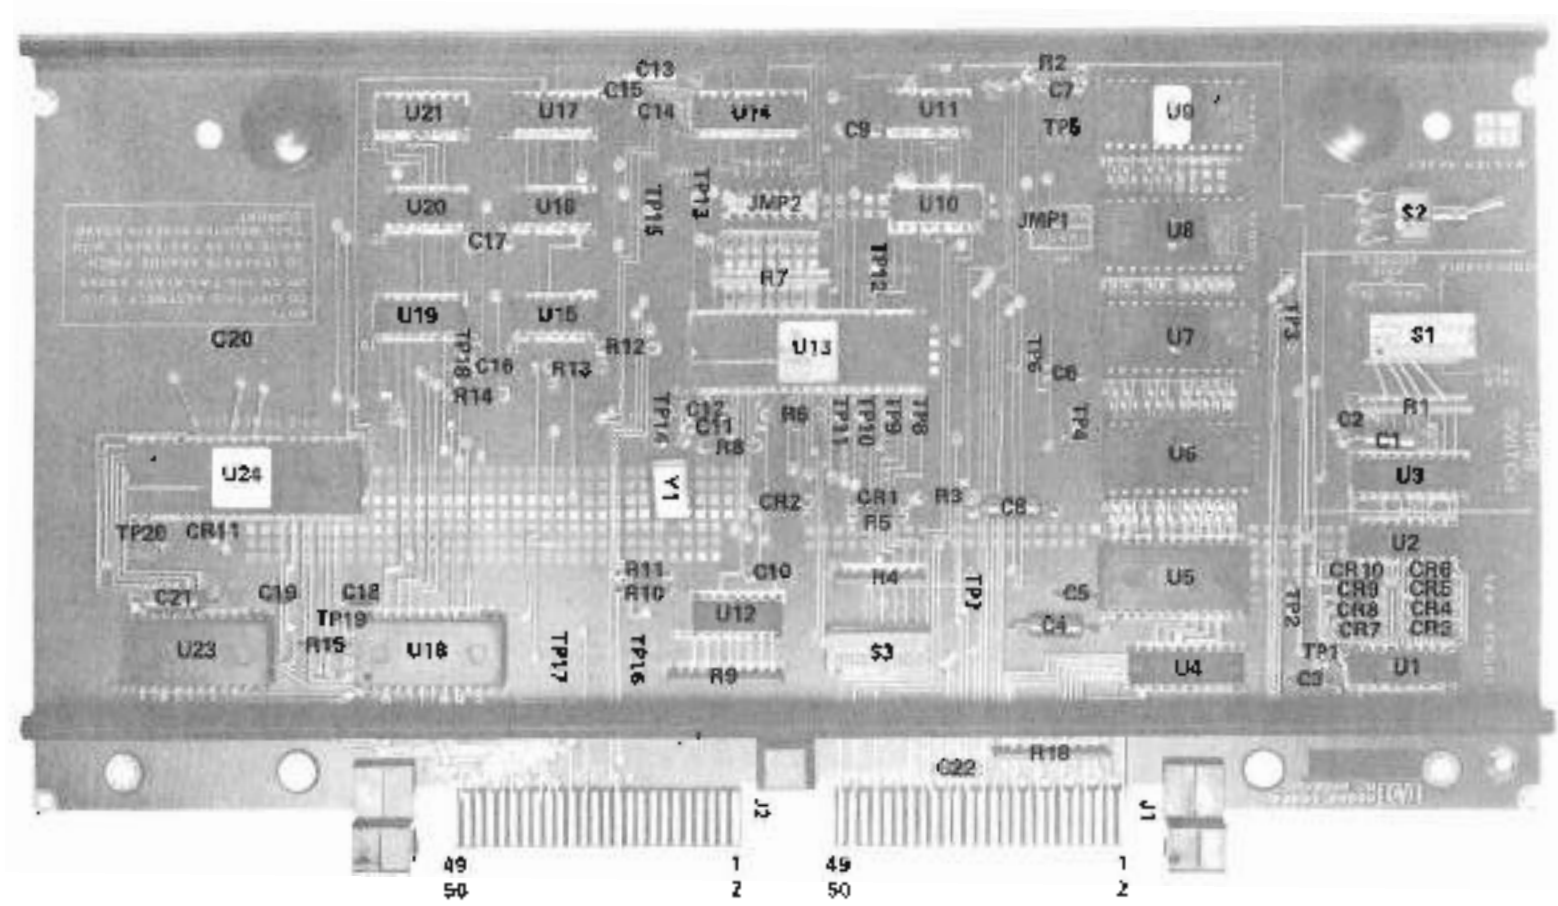
C13
C15
C14
R2
C7
TP5
U21
U17
U14
U11
U9
C9
U20
U16
TP15
TP13
JMP2
U10
JMP1
U8
S2
C17
TP12
R7
U19
U15
TP3
S1
C20
TP18
C16
R13
R12
U13
TP5
C6
U7
R14
TP14
C12
C11
R6
TP11
TP10
TP9
TP8
TP4
C2
R1
C1
R8
U6
U24
Y1
U3
CR2
CR1
R3
C8
R5
TP20
CR11
U2
R11
C10
R4
TP7
U5
CR10
CR6
C21
C19
C18
R10
C5
CR9
CR5
TP19
U12
TP2
CR8
CR4
U23
R15
U18
TP17
TP16
S3
C4
CR7
CR3
TP1
U4
C3
U1
R9
C22
R18
J2
J1
49
50
1
2
49
50
1
2

PIN	SIGNAL	DESCRIPTION	FUNCTION & LOCATION
1	+5V	TO +5V	
2	+5V	FROM +5V	
3	GND	TO GND	
4	+5V	FROM +5V	
5	GND	TO GND	
6	+5V	FROM +5V	
7	D7	TO/FROM DATA BUS D7	
8	+5V	FROM +5V	
9	D6	TO/FROM DATA BUS D6	
10	+5V	FROM +5V	
11	D5	TO/FROM DATA BUS D5	
12	+5V	FROM +5V	
13	D4	TO/FROM DATA BUS D4	
14	+5V	FROM +5V	
15	D3	TO/FROM DATA BUS D3	
16	+5V	FROM +5V	
17	D2	TO/FROM DATA BUS D2	
18	+5V	FROM +5V	
19	D1	TO/FROM DATA BUS D1	
20	+5V	FROM +5V	
21	D0	TO/FROM DATA BUS D0	
22	NC	—	
23	TE1	TO A23-23	
24	NC	—	
25	TE2	TO A23-25	
26	+5V (SWITCHED BY SW2)	FROM +5V	
27	NC	TO A23-27	
28	TRE	FROM A5U1-29	
29	GND	TO A23-29	
30	GND	FROM A5U1-30	
31	TRE	TO A23-31	
32	GND	FROM A5U1-32	
33	TRE	TO A23-33	
34	GND	FROM A5U1-34	
35	GND	FROM A5U1-35	
36	GND	FROM A5U1-36	
37	TRE	FROM A5U1-37	
38	GND	FROM A5U1-38	
39	GND	FROM A5U1-39	
40	GND	FROM A5U1-40	
41	NC	—	
42	GND	FROM A5U1-42	
43	D0	TO A23-43	
44	GND	FROM A5U1-44	
45	D1	TO/FROM A5U1-45	
46	GND	FROM A5U1-46	
47	D2	TO A23-47 & A5U1-47	
48	GND	FROM A5U1-48	
49	RESET	TO A23-49	
50	GND	FROM A5U1-50	

PIN	SIGNAL	DESCRIPTION	FUNCTION & LOCATION
1	NC		
2	NC		
3	NC		
4	NC		
5	NC		
6	NC		
7	NC		
8	NC		
9	NC		
10	NC		
11	NC		
12	NC		
13	NC		
14	NC		
15	NC		
16	NC		
17	NC		
18	NC		
19	NC		
20	KBD-RET GND	TO A4-A23	
21	KBD-RET SW	FROM A4U1-21	
22	METRIC SW	FROM A4U1-22	
23	NC		
24	NC		
25	NC		
26	NC		
27	D7	TO/FROM J2-1	
28	D6	TO/FROM J2-03	
29	D5	TO/FROM J2-2	
30	D4	TO/FROM J2-10	
31	D3	TO/FROM J2-3	
32	D2	TO/FROM J2-11	
33	D1	TO/FROM J2-4	
34	D0	TO/FROM J2-12	
35	IRQ	TO/FROM J2-5	
36	RES	TO FROM J2-13	
37	Den	TO/FROM J2-6	
38	BUS GND	FROM J2-14	
39	+5V	TO/FROM J2-7	
40	+5V0 GND	FROM J2-15	
41	R/W	TO/FROM J2-8	
42	+5V	FROM J2-16	
43	AS	TO/FROM J2-9	
44	+5V GND	FROM J2-1	
45	STB	TO/FROM J2-10	
46	BUS GND	FROM J2-21	
47	ATN	TO/FROM J2-11	
48	ATN GND	FROM J2-22	
49	SHIELD	FROM J2-12	
50	SIGNAL GND	FROM J2-24	

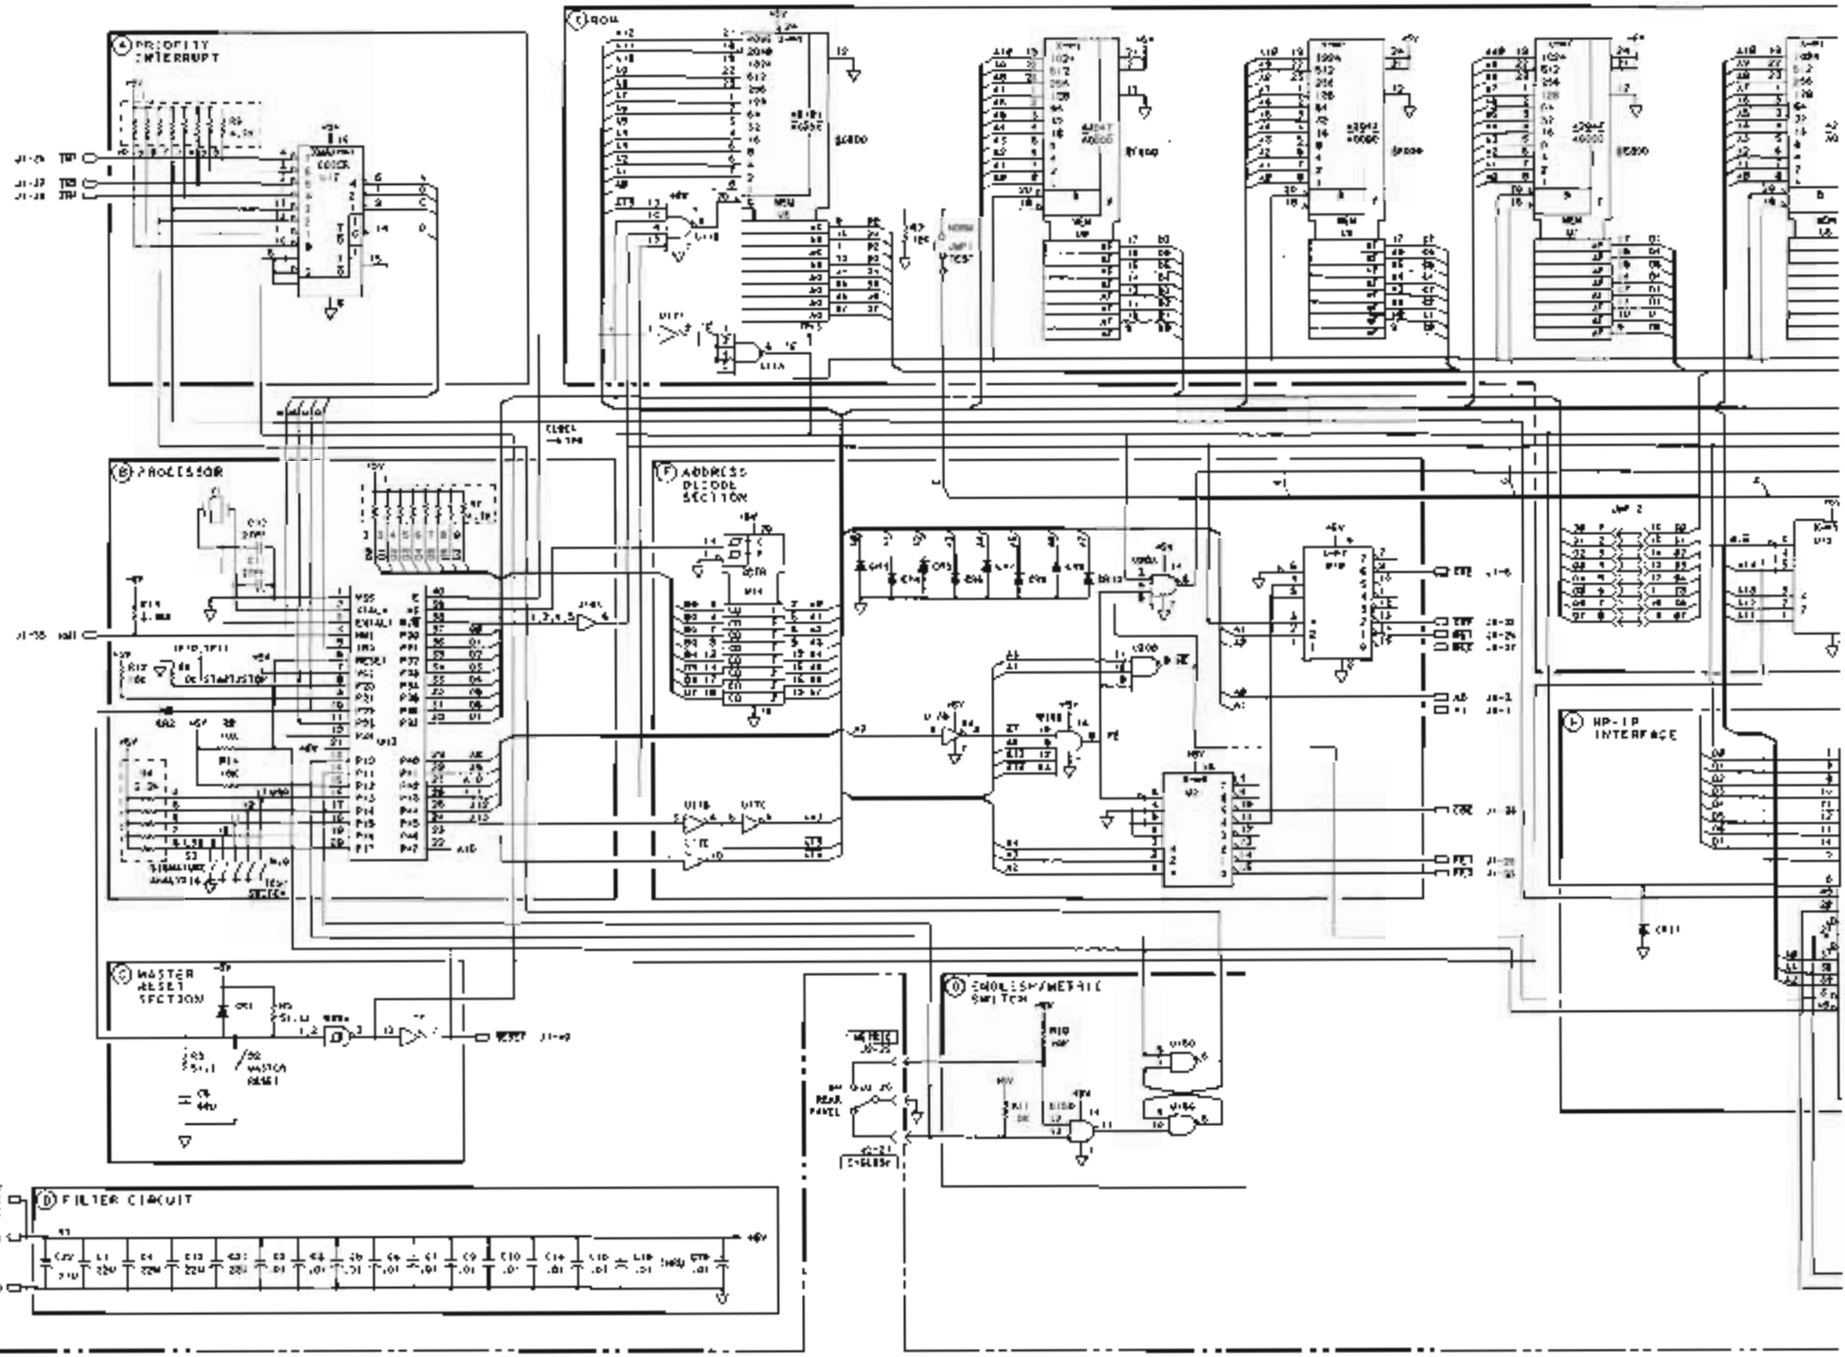

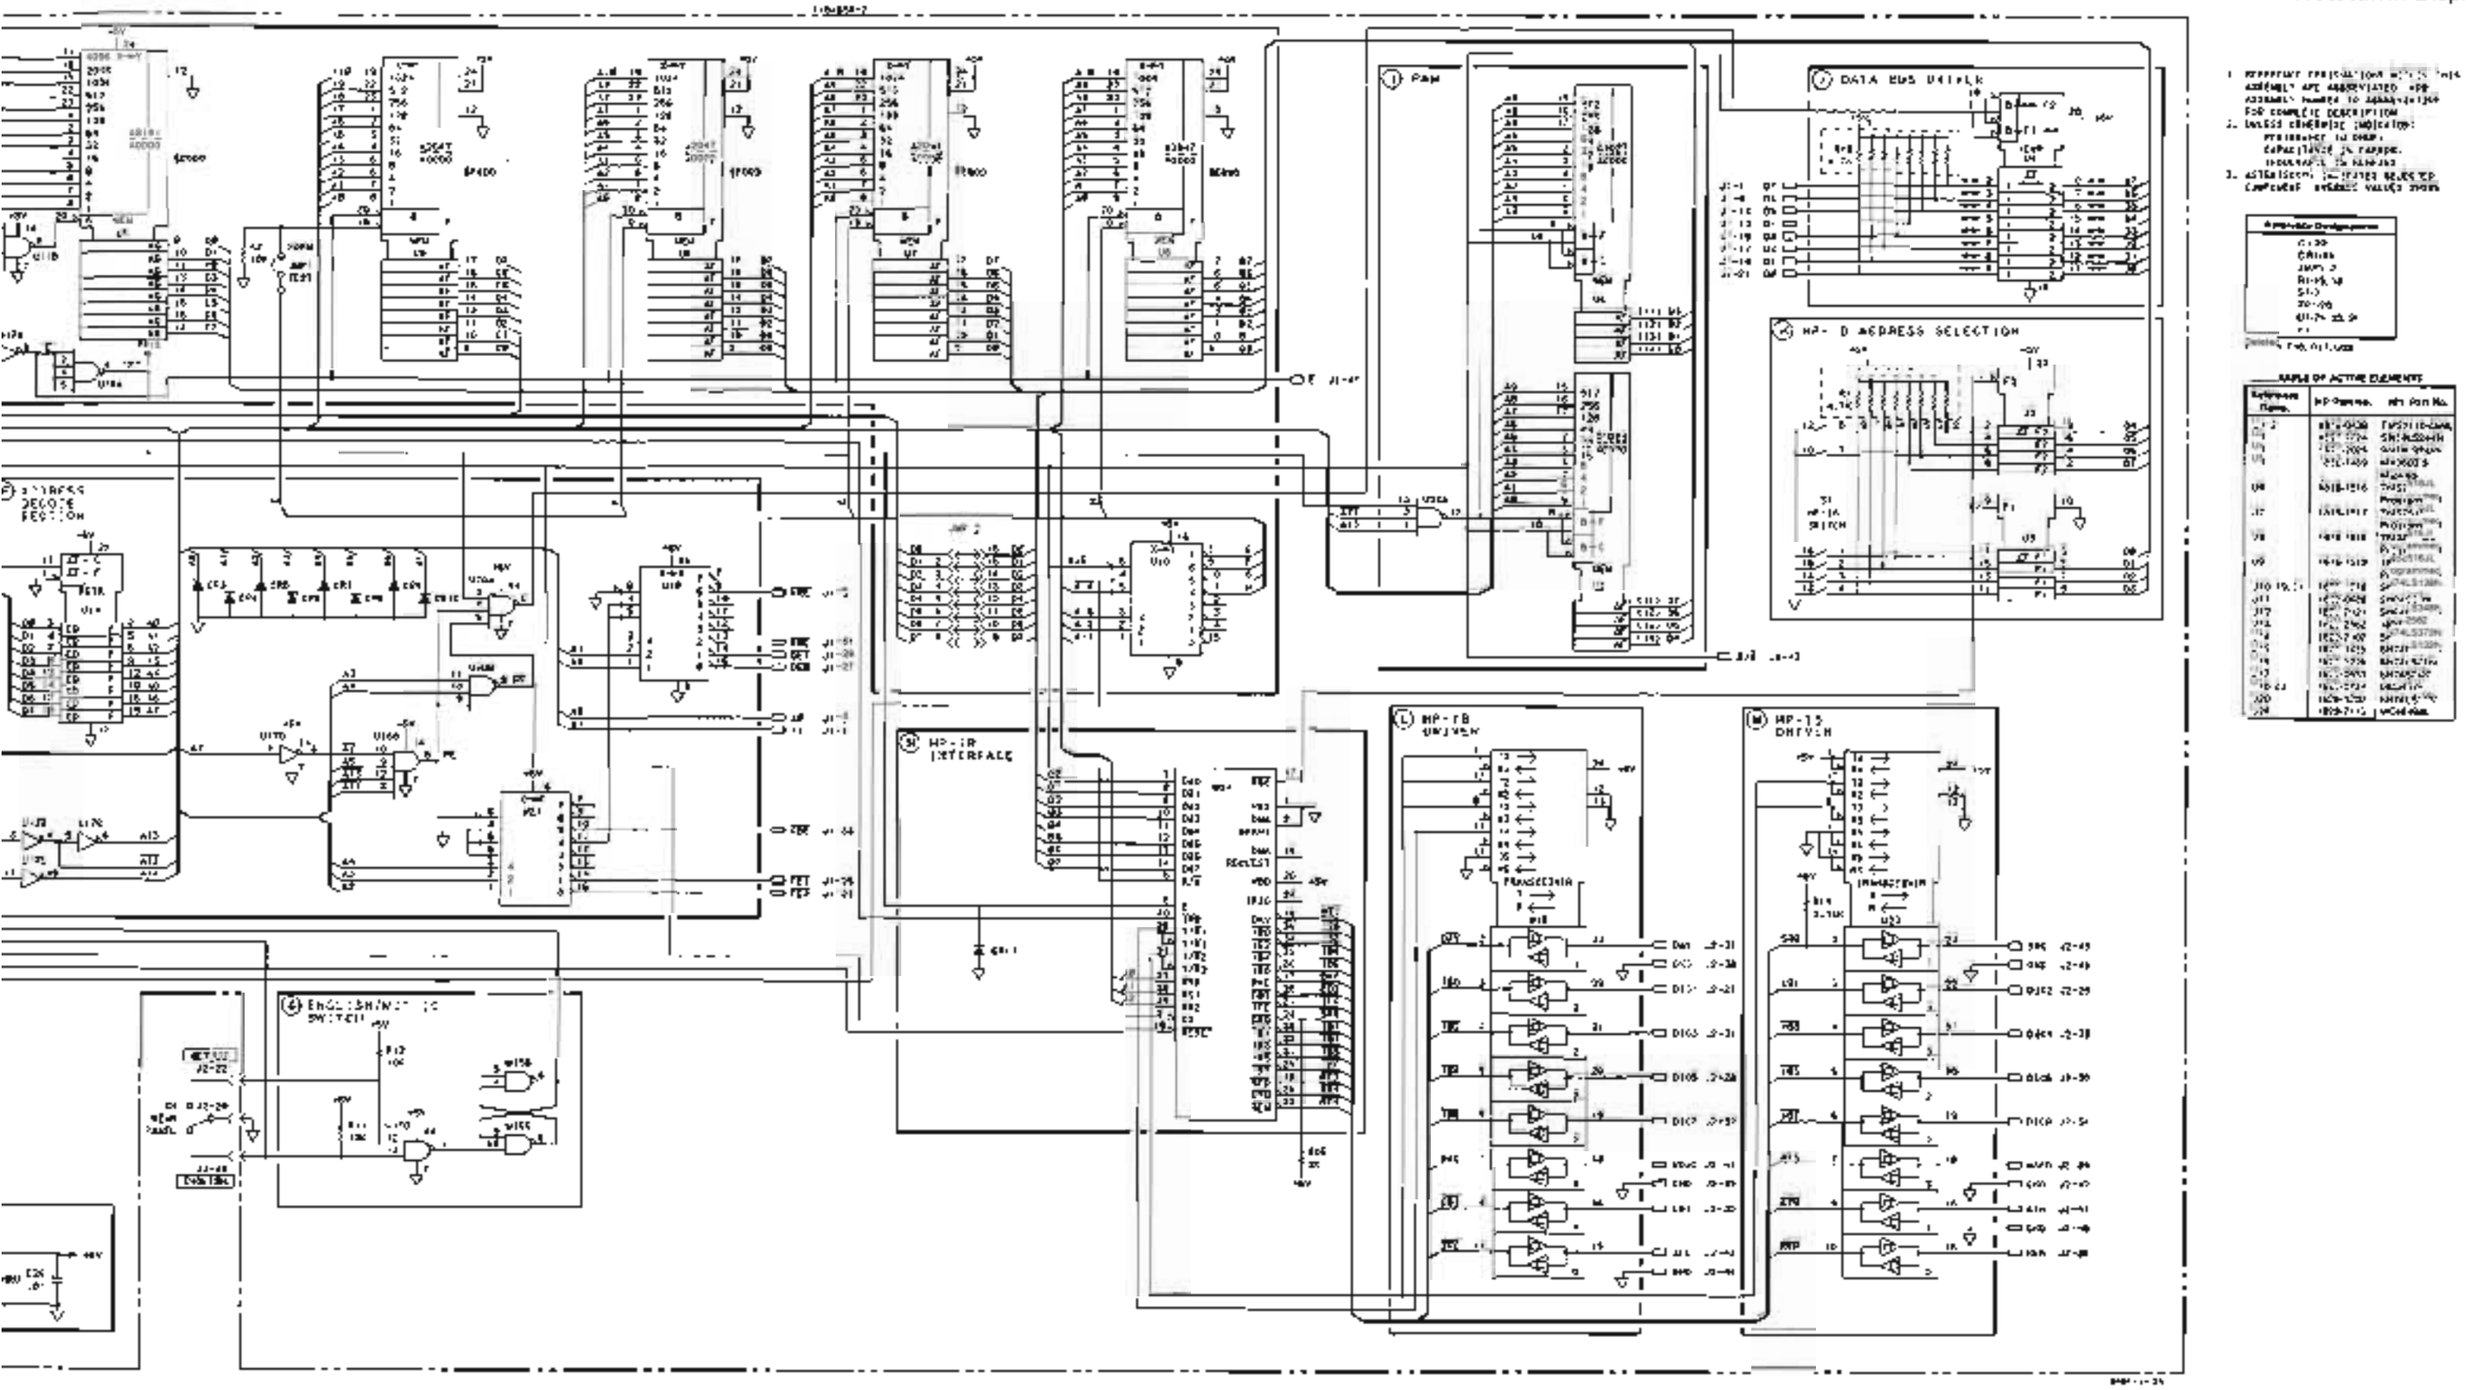


Figure 7-1. 5508A A2 Processor Board (05508-60002)

Figure 7-1
5508A A2 PROCESSOR BOARD (05508-60002)

(See Page 7-7)

CHANGE 6 (5508A Series 2704A)

To backdate the 5508A from Series 2732A to 2704A, make the following changes:

Page 1-3, General Information
Change 5508A SERIES from 2732 to 2704A in Table 1-1

Pages 6-5/6-6, Table 6-3 A2 Processor Board Assembly Replaceable Parts:
Change A2 (05508-60002) SERIES from 2732 to 2704.
Change A2U5 from 05508-80005 to 1818-1469.
Change A2U6 from 05508-80006 to 1818-1516.
Change A2U7 from 05508-80007 to 1818-1517.
Change A2U8 from 05508-80008 to 1818-1518.
Change A2U9 from 05508-80009 to 1818-1519.

Page 8-B-21, 5508A measurement display:
Change the following Kernel Signatures to read as indicated; all others remain the same.

U13 Pin No.	U14 Pin No.
28: UP72	6: 7A81
31: 228P	9: 07U2
33: 0095	12: 024C
34: ACF0	15: U24H
	16: 024C
	19: 024C

Page 8-B-22, Test 2, All Roms Test:
Change the following "A11 ROM Test" signatures to read as indicated. All others remain the same.

U13 Pin No.	U14 Pin No.
29: 2170	6: 44A1
30: U817	9: 1HAC
31: 0418	12: PP06
32: 80CC	15: 75F0
33: 1F7U	16: 476F
34: 6202	
35: H725	
36: 32A9	
37: 1FH7	

Page 8-B-23, 5508A Measurement Display.
Change the following "Decode Test" signatures to read as indicated. All others remain the same.

U14 Pin No.	U13 Pin No.	U17 Pin No.
6: T9CP	28: 77U3	8: 7A1F
9: 6281		
12: 6507		
15: A264		
16: 8499		
19: 4380		

Page 8-B-24, 5508A Measurement Display:
Change the following "A11 RAM Test" signatures to read as indicated. All others remain the same.

U13 Pin No.
31: 939C
33: 4C60
34: 8C81

CHANGE 6 (Continued)

Page 8-B-25. 5508A Measurement Display:
Change only the following "U4 INPUTS" signatures to read as indicted. All others remain the same.

14: F599 (2163 with velocity key)
15: 9HFH (7937 with angle key)
17: 902C (74H: with short key)

Page 8-B-28. 5508A Measurement Display:
Change the following signatures to read as indicated.

(Para b.)	(Para d.)
U13 Pin No.	**U13 Pin No.**
30: 139C	30: 2P60
31: 38F4	31: 0555
32: 2595	32: 0CH3

Page 8-B-29. 5508A Measurement Display:
Change the following signatures to read as indicated:

U13 Pin No.
30: PCJP
31: 9UU0
32: H145
33: 2CP5
34: H68F
35: C105
36: H120
37: 2029

Page 8-B-30. 5508A Measurement Display:
Change the following signatures to read as indicated. All others remain the same:

U3 Pin No.
31: 2A54
33: U2CU
34: 796U

Page 8-B-45, Fig. 8-B-16. 5506A A2 Processor Board Component Locator/Schematic Diagram.
Change "Table of Active Elements" to reflect the ROM changes for A2U5 thru A2U9.

CHANGE 7 (5508A Series 2648A)

To backdate the 5508A from Series 2704A to 2648A

Page 1-13. General Information.
Change paragraph 1-29 to read:
1-29. The 5508A Measurement Display (Figure 1-2) is supplied with Interconnect Cable 8120-3491 and Remote Control Unit 05508-60021.

Page 2-5. Installation:
2-12. 5518A to 5508A Interconnecting Cable
Change HP Cable Part Number from 10793A/B/C to 8120-3491.

Page 4-2. Performance Tests And Calibration:
4-18. Procedure:
Change HP Cable Part Number from 10793A/B/C to 8120-3491.

CHANGE 8 (5508A Series 2532A)

To backdate the 5508A from 2648A to 2532A02139

Change 5508A SERIES to 2532A in Table 1-1.

Page 1-9, Table 1-2. Specifications And Supplemental Characteristics (Cont'd):

Add the following to ANGLE MEASUREMENTS, Angle Measurement Accuracy:

This assumes that all angles, greater than ±3600 arc-sec have been corrected, the Reflector is aligned within 10 arc-min using autoreflection techniques, roll alignment by the operator is within 1 degree relative to the measurement plane, and the temperature of all optical components is stabilized in the range 15-25°c.

Angle Measurement Range:

Change ±36000 to ±3600.

Add the following:

±36000 arc-sec with angle correction: corrected angle - arcsin (displayed angle).

Page 8-B-45, Fig. 8-B-18. 5508A A2 Processor Board Component Locator/Schematic Diagram:

Change A2 (05508-60002) SERIES to 2532.

CHANGE 9 (5508A SERIAL PREFIX 2516A)

5508A Measurement Displays with Serial Prefix 2516A differ from later versions as follows:

Block D of Figure 8-B-32 had two capacitors (A5C1 and A5C16) voltage ratings upgraded.

To backdate this manual to be applicable to 5508A instruments with Serial Prefix 2516A, make the following changes:

Page 1-3, Table 1-1. 5528A Equipment and Manual Serial Prefix Effectivity.

Change 5508A Measurement Display serial prefix from 2628A to 2516A.

Page 6-12, Table 6-3. 5508A P.C. Board Assemblies Replaceable Parts:

Change A5C1 part number from 0180-3579 to 0180-0533. CAPACITOR-FXD 50UF+75-10% 40 VDC AL. Mfr Code 28480, Mfr Part Number 0180-0533. Note: The capacitor with part number 0180-0533 has a lower voltage rating than capacitor 0180-3579.

Change A5C16 part number from 0180-3419 to 0180-2800. CAPACITOR-FXD .01F+75 VDC AL., Mfr Code 28480, Mfr Part Number 0180-2800 Note: The capacitor with part number 0180-2800 has a lower voltage rating than capacitor 0180-3419.

Page 8-B-115, Figure 8-B-32. 5508A A5 Power Supply Board Schematic Diagram:

Change board series number, located at the upper left-hand corner of the schematic, from 2628 to 2228.

CHANGE 10 (5508A SERIAL PREFIX 2512A)

5508A Measurement Displays with Serial Prefix 2512A differ from later versions as follows:

a. Block P of Figure 8-B-21 (sheet 2 of 5) has had several resistor value changes (R30, R31, and R32).
b. Block K of Figure 8-B-21 (sheet 3 of 5) has had several resistor value changes (R1, R2, and R3).

To backdate this manual to be applicable to 5508A instruments with Serial Prefix 2512A, make the following changes.

Page 1-3, Table 1-1. 5528A Equipment and Manual Serial Prefix Effectivity:
Change 5508A Measurement Display serial prefix from 2516A to 2512A.

Page 6-9, Table 6-3, 5508A P.C. Board Assemblies Replaceable Parts:
Change A3R1, A3R3, A3R30, and A3R32 from 0698-4002 to 0757-0449, RESISTOR 20K 1% .125W F TC=0±100, 24546, C4-1/8-TO-2002-F.
Change A3R2 and A3R31 from 0698-3442 to 0698-3445, RESISTOR 348 1% .125W F TC=0±100, 24546, C4-1/8-TO-348R-F.

Page 8-B-73, Figure 8-B-21, 5508A A3 Counter Board 05508-60003:
Change A3R30 and A3R32 (of Block P) from 5K to 20K.
Change A3R31 (of Block P) from 237 to 348 Ohms.

Page 8-B-75, Figure 8-B-21, 5508A A3 Counter Board 05508-60003:
Change A3R1 and A3R3 (of Block K) from 5K to 20K.
Change A3R2 (of Block K) from 237 to 348 Ohms.

Page 8-B-71, Figure 8-B-21, 5508A A3 Counter Board 05508-60003:
Change board series number located in upper left corner of schematic to 2108.

CHANGE 11 (5508A SERIAL PREFIX 2312A)

5508A Measurement Displays with Serial Prefix 2312A differ from later versions as follows:

The cabinet hardware in later versions of the 5508A has been changed from "Inch" to "Metric".

To backdate this manual to be applicable to 5508A instruments with Serial Prefix 2312A, make the following changes:

Page 1-3, Table 1-1. 5528A Equipment and Manual Serial Prefix Effectivity:
Change 5508A Measurement Display serial prefix from 2512A to 2312A.

Page 6-23, Figure 6-1, 5508A Cabinet Parts Exploded View:
Change Item 1 HP Part Number from 5061-9430 to 5060-9830. Delete "Metric" reference in part description.
Change Item 5 HP Part Number from 5061-9461 to 5060-9861. Delete "Metric" reference in part description.
Change Item 6 HP Part Number from 5061-3536 to 5020-8836. Delete "Metric" reference in part description.
Change Item 11 HP Part Number from 0515-1331 to 2510-0192. Modify part description to read SCREW, MACH, 8-32 X 0.25", 1000.
Change Item 12 HP Part Number from 5061-9442 to 5060-9842. Delete "Metric" reference in part description.

Page 6-31, Figure 6-5, 5508A Front Panel Exploded View:
Change Item 2 HP Part Number from 5020-5817 to 5020-8817. Delete "Metric" reference in part description.
Change Item 3 HP Part Number from 2360-0119 to 2360-0115. Modify part description to read SCREW-MACH 6-32 - 5/16 PH.

CHANGE 11 (Continued) (5508A SERIAL PREFIX 2312A)

Page 6-33, Figure 6-6, 5508A Rear Panel Exploded View:

Change Item 19 HP Part Number from 5021-5818 to 5020-8818. Delete Metric reference in part description.

Change Item 23 HP Part Number from 0515-1233 to 2360-0321. Modify part description to read SCREW-MACH 6-32 X 1 PH.

Change Item 11 HP Part Number from 0515-1331 to 2510-0192. Modify part description to read SCREW, MACH, 8-32 X 0.25", 1000.

NOTE

Some 5508A instruments with serial number prefix of 2312A and all later serial prefixed instruments have been upgraded as follows:

A3U63 part number has changed from 1826-0746 to 1826-1053. The later part is preferred due to its improved environmental performance. At the same time, two washers (3050-0016) were added between the screw head and the A3 printed circuit board on the two nylon latches. This change did not affect the instrument's serial prefix.

CHANGE 12 (SERIAL PREFIX 2230A)

5508A Measurement Displays with Serial Prefix 2230A differ from later versions as follows:

Had part number 1251-3448 for J7. Later versions use part number 1251-8247.

To backdate this manual to be applicable to 5508A instruments with Serial Prefix 2230A, make the following changes:

Page 6-11, Table 6-3, Replaceable Parts.

Change part number of A4J7 to 1251-3448. Description is the same.

CHANGE 13 (5508A SERIAL PREFIX 2220A)

5508A Measurement Displays with instrument Serial Prefix 2220A differ from later versions as follows.

A5R35 and A5CR17 are not installed on the 05508-60005 Power Supply Board.

To backdate this manual to be applicable to 5508A instruments with Serial Prefix 2220A, make the following changes:

Pages 6-12 and 6-13, Table 6-3, 5508A P.C. Board Replaceable Parts:

Delete A5CR17 and A5R35.

Page 8-B-115, Figure 8-B-32, 5508A Power Supply Board 05506-60005, Schematic Diagram: In Block F, near U1, delete A5R35 and replace with a straight-through connection.

Delete A5CR17. Change the board series number to 2220.

CHANGE 14 (5508A SERIAL PREFIX 2126A AND 2216A)

5508A Measurement Displays with instrument Serial Prefix 2126A and 2216A differ from later versions as follows:

a. Has a Series 2108 Power Supply Board for A5 05508-60005. This board has diode pack A5CR4 instead of the two discrete diodes A5CR15 and A5CR16 that are used in later versions. Series 2108 Power Supply boards also have a 17,000µF capacitor for A5C11 instead of the 25,000µF value used in later versions.

b. Has a Series 2108 Controller Board for A3 05508-60009. This board uses 1K resistors for A3R14, A3R19, and A3R34 instead of 2k resistors used in later versions.

To backdate this manual to be applicable to 5508A instruments with Serial Prefix 2126A, make the following changes:

Page 6-12, Table 6-3, Replaceable Parts:
Change A5C11 to 0180-2799, CP 17,000UF -75%-10% 20VDC AL, Mfr Code 28480, Mfr Part Number 0180-2799.
Delete A5CR15 and A5CR16. Add A5CR4 1904-0214 DIODE, DUAL CT-RECTIFIER Mfr Code 01295, Mfr Part Number TIR201B.

Page 6-9, Table 6-3, Replaceable Parts:
Change A3R14, A3R19, and A3R34 to 0757-0280, RF 1K 1% 0.125W, Mfr Code 24546, Mfr Part Number C4-1/8-TO-1001-F.

Page 8-B-115, Figure 8-B-32, 5508A A5 Power Supply Schematic Diagram:
In Block D, the 15 Volt Rectifier, replace A5CR15 and A5CR16 with A5CR4 shown in the partial diagram in Figure 7-1. In Block I, the +5 Volt Filter, change A5C11 to 17,000 UF. In the upper left corner of the schematic, change the series number of the board to 2108.

Page 8-B-13, Figure 8-B-21, Sheet 1, 5508A A3 Counter Board:
Change A3R14, A3R19, and A3R34 to 1K. In the upper left corner of the schematic, change series to 2108.

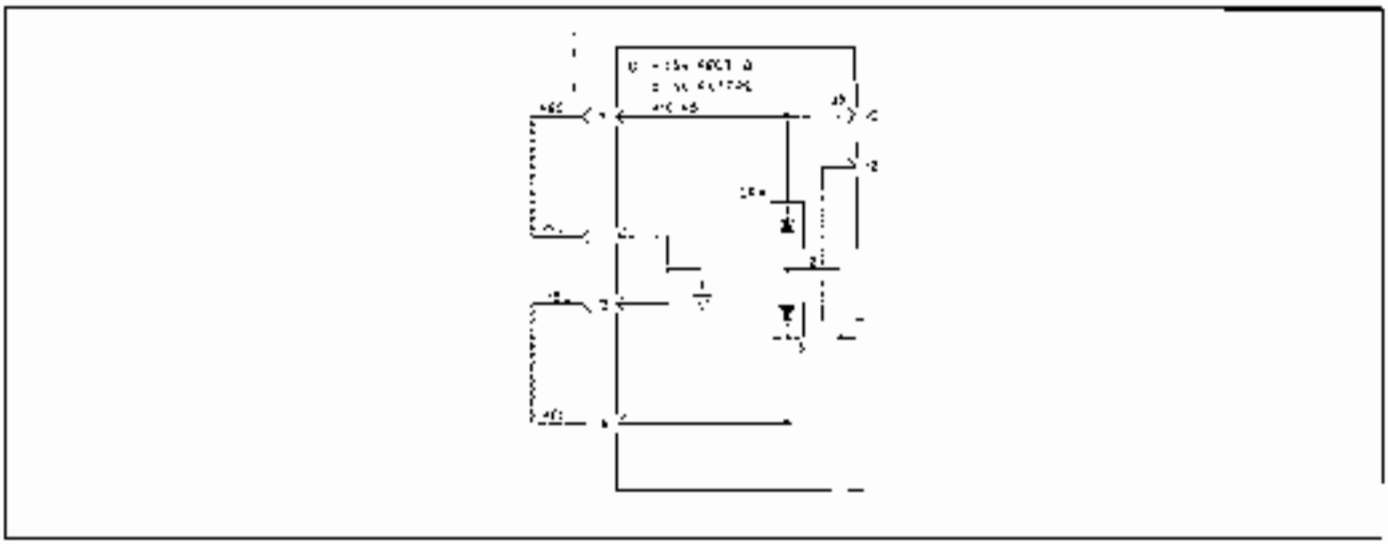


Figure 7-2. 5508A Power Supply Changes, Instrument Serial Prefix 2216A, A5 Power Supply Board Series 2108

Table 7-2. 5518A Manual Backdating

If Your Instrument Has Serial Prefix or Serial Number	Make Backdating Change
A3 (05518-60003) below Date Code 91013	1
A1(05518-60001) below Date Code 90232	1, 2
5518A Laser Heads. Serial Number 3020A03374 & above	1,2, 3
5508A SERIES from 3020A to 2948A	1 through 4
5518A below 2532A02139	1 through 5
2520A	1 through 6
2502A	1 through 7
2406A	1 through 8
2332A	1 through 9
2326A	1 through 10
2308A	1 through 11
2236A	1 through 12
2220A	1 through 13

CHANGE 1 (05518-60003 Series 2332)

To backdate the 05518-60003 from Date Code 91013 to Series 2332.

Table 6-4 A3 Controller/Reference Board Replaceable Parts:
Change A3Q3 from 1853-0347 to 1853-0332, TRANSISTOR PWRDAR 1091.

Figure 8-C-14. 5518A A3 Controller/Reference Board (05518-60003)
Table of Active Elements:
Change A3 from 1853-0347, MJE700, to 1853-0332, MJE71091.

CHANGE 2 (05518-60001, Series 2216)

To backdate from 05518-60001 Date Code 90232 to Series 2216, make the following changes:

Page 5-1, Adjustments:
Add the following Note under Warning:

NOTE

The High Voltage Power Supply, A5, is defeated automatically by A1S2, when the 5518A cover is removed. For Adjustments and Servicing purposes, the High Voltage Supply can be re-enabled by setting the TEST-NORM switch, A1S1, to TEST after the 5518A cover is remove.

Page 5-2, 5518A Receiver Adjustments:
Add the following after step c in paragraph 5-14:
At the rear of the Laser Head, or Connector Board A1, set the NORM-TEST switch to TEST. See Figure 7-3.

CHANGE 2 (Continued)

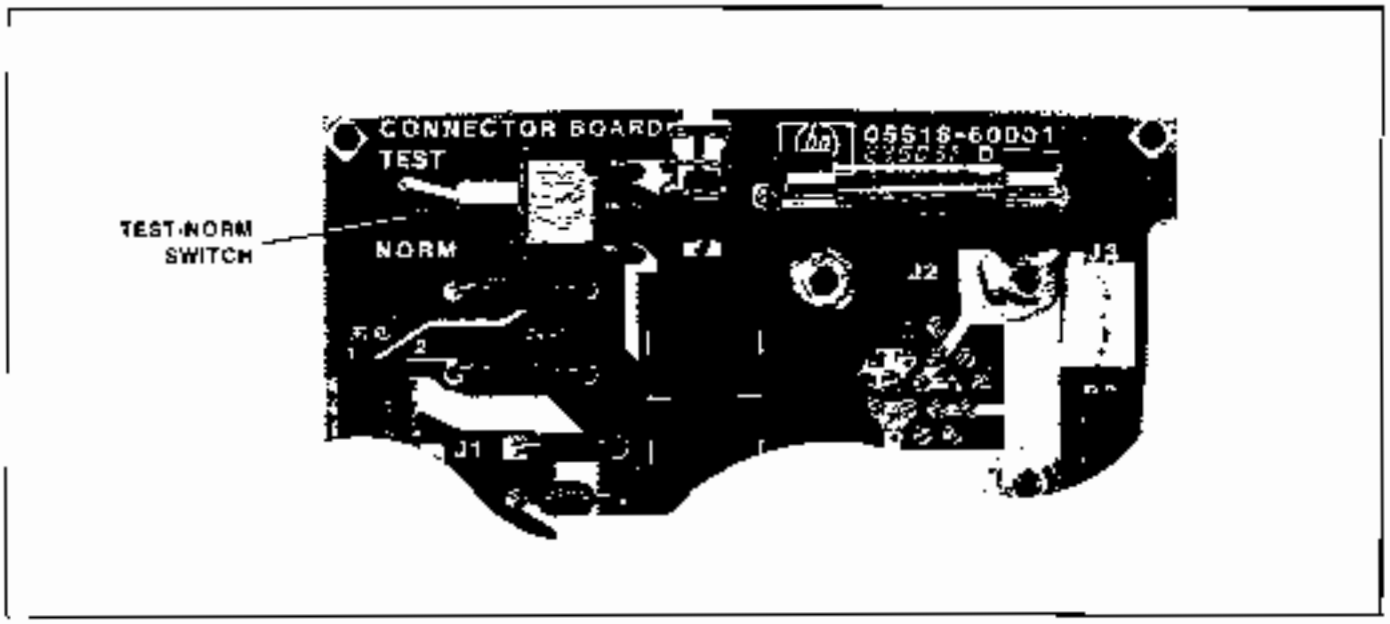


Figure 7-3. A1 Connector Board NORM/TEST Switch Location

Page 5-3, 5518A Receiver Adjustments:
Replace step g with the following:
g. Set the NORM-TEST switch to NORM and replace the Laser Head top cover.

Page 5-4, 5518A Reference Temperature Adjustments:
Add the following after 5-20, step b:
At the rear of the Laser Head, on Connector Board A1, check that the NORM-TEST switch is set to NORM. See Figure 7-3.

Page 5-5. 5518A Laser Tube Current Adjustment:
Add the following after step c:
On the A1 Connector Board, set TEST-NORM switch to TEST. See Figure 7-3.

Page 5-6. 5518A Laser Tube Current Adjustment:
Change step k to read as follows:
k. Set the 5500A LINE switch to OFF, disconnect the probe, set the TEST-NORM switch to NORM and reinstall the Laser Head Cover.

Page 6-14, Table 6-4. A1 Connector Board Assembly Replaceable Parts:
Add A1S1, part number 3101-2413, Qty 1, SWITCH-PUSHBUTTON DPDT MOM 4A 250VAC.
Add A1S2, part number 3101-1955, Qty 1, SWITCH-TOGGLE SUBMIN SPDT .02A 20VAC/DC PC.

Page 8-4. Safety Considerations:
Add NOTE,

> The High Voltage Power Supply, A5, is defeated automatically by A1S2, when the 5518A cover is removed. For adjustments and Servicing purposes, the High Voltage Supply can be re-enabled by setting the TEST-NORM switch, A1S1, to TEST after the 5518A cover is removed.

CHANGE 2 (Continued)

Page 8-C-13:

Change steps d through h to d through i.

Add step d to paragraph 8-C-39:

"d. Enable the laser high voltage section by setting the TEST-NORMAL switch on Connector board A1 to TEST.

Change step i to read as follows:

i. Disconnect the test equipment set set HEATER jumper JM17 to NORM. Set TEST-NORM switch to NORM and replace the 5518A cover.

Page 8-C-15, 5518A Laser Head:

Add WARNING and NOTE following paragraph 8-C-43:

WARNING

WITH THE 5518A COVER REMOVED AND A1S2 SET TO THE TEST POSITION, UP TO 12 KILOVOLTS WILL BE PRESENT AT THE OUTPUT OF THE HIGH VOLTAGE POWER SUPPLY ASSEMBLY A6.

NOTE

After servicing the 5518A, be sure to set A1S2 to the NORM position, otherwise power will be disconnected. See Figure 7-3.

Page 8-C-16

Change paragraph 8-C-46 step b to read:

b Remove the cover of the 5518A. Set A1S2 to TEST and verify all boards are seated correctly and all test jumpers on A3 board are to the left (NORM). Turn 5508A power on. Check the following voltages. If any are incorrect see power supply servicing in A3 servicing procedures (Paragraph 8-C-129):

Add warning under step b:

WARNING

WITH A1S2 IN THE TEST POSITION THE 5518A HIGH VOLTAGE POWER SUPPLY A5 IS ENABLED.

Page 8-C-19. 5518A Laser High Voltage Section Circuit Theory:

Paragraph 8-C-51:

Add "Switch S1 is a safety interlock which removes power from the laser power supply when the 5518A cover is removed. Switch S2 defeats the interlock so the laser can be serviced. S1 and S2 are wired in such a way that the interlock must be enabled before replacing the cover."

Paragraph 8-C-53.

Add "Check switches S1 and S2" in last line.

Figure 8-C-11. Laser Assembly Wiring:

Add Switches S1 and S2.

Page 8-C-20. High Voltage Power Supply Troubleshooting:

Add the following after "NO LASER LIGHT is emitted." in paragraph 8-C-58, step a: "First check that A1S2 is set to 'NORM'" when the cover is on or "TEST" when the cover is off.

Page 8-C-28, Digital Troubleshooting:

Add "Defeat high voltage interlock by setting A1S2 to 'TEST'" to beginning of paragraph 8-C-119(a).

CHANGE 2 (Continued)

Page 8-C-31, Photodiode & Amplifier Troubleshooting/ Liquid Crystal Troubleshooting:
Add "Defeat high voltage interlock by setting A1S2 to TEST" to beginning of paragraph 8-C-120(a)
Add "Set A1S2 to TEST" to the beginning of paragraph 8-C-123(a).

Page 8-C-37, Fig 8-C-12. 5518A A1 Connector Board 05518-60001 Schematic Diagram:
Add S1 (pushbutton) to the left of F1 on component locator.
Add S2 (toggle switch) above R1 on component locator.
Add S1 and S2 to schematic diagram as shown in Figure 7-4.

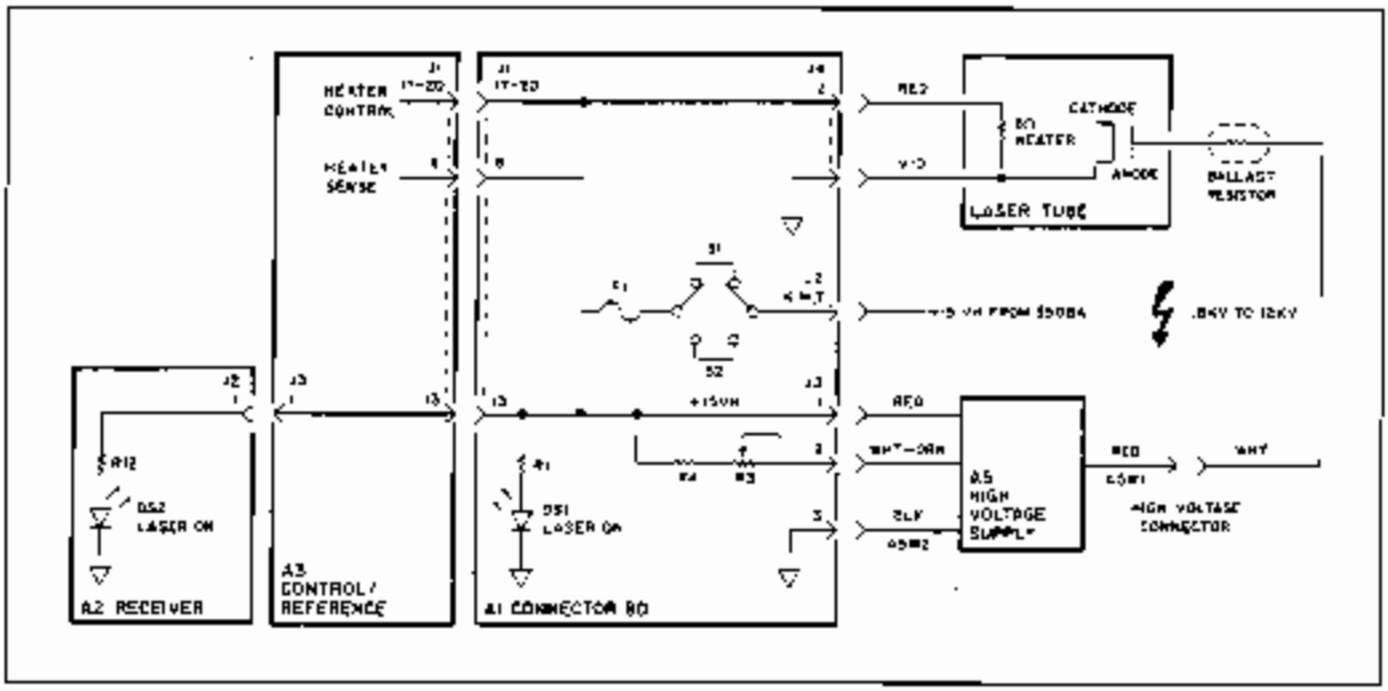


Figure 7-4 Laser Assembly Wiring

CHANGE 3 (5518A Serial Numbers above 3020A03374)

Page 6-39, Figure 6-9. 5518A Laser Head Exploded View.

NOTE

5518A Laser Heads with Serial Number 3020A03374 & above may contain two spacers (part number 0380-0019) between MP17 Turret Base and MP25 Straightness mount.

CHANGE 4 (5518A Series 2948A)

To backdate from Series 3020A to Series 2948A, make the following changes:

Page 1-3. General Information
Change 5518A SERIES from 3020A to 2948A in Table 1-1.

Page 6-39, Figure 6-9. 5518A Laser Head Exploded View:
Change MP12 COVER from 05518-00012 to 05518-00011.
Change MP13 BASE-MACHINED from 05518-20321 to 05518-20302.

CHANGE 5 (5518A Series 2520A)

To backdate the 5518A from 2532A02139 to Series 2520A, make the following changes:

Page 1-4, Table 1-2 Specifications And Supplemental Characteristics:
Delete the following specification for the HP 5518A Laser Head:
Split Frequency: 1.7 - 2.4 MHz.

Page 1-9, Table 1-2. Specifications And Supplemental Characteristics (Cont'd):
Linear Distance and Velocity Measurements:
Change Maximum Velocity to read as follows: ±18000 mm/min (±720 in/min)

CHANGE 6 (5518A SERIAL PREFIX 2520A)

5518A Laser Heads with Serial Prefix 2520A differ from later versions as follows:

The radiator fins on top of the laser assembly (Item 22, Figure 6-9) and the hole in the cover (Item 12, Figure 6-9) have been removed from later instruments.

To backdate this manual to be applicable to 5518A instruments with Serial Prefix 2520A, make the following changes:

Page 1-3, Table 1-1. 5528A Equipment and Manual Serial Prefix Effectivity:
Change 5518A Laser Head serial prefix from 2532A to 2520A.

Page 6-39, Figure 6-9, 5518A Laser Head Exploded View:
Change Item 12 HP Part Number (Cover) from 05518-00011 to 05518-00008. The older laser head cover (i.e., 05518-00005) has a rectangular hole to accommodate the laser tube fins found on the older laser tubes.

Add the following to table found on page 6-39.
Item 46, Qty 1, GASKET (EMI), HP Part Number 8160-0398.

Page 8-C-18, Figure 8-C-10. 5518A Assembly Designations:
Replace Figure 8-C-10 with Figure 7-5.

CHANGE 7 (5518A SERIAL PREFIX 2502A)

5518A Laser Heads with Serial Prefix 2502A differ from later versions as follows:

In later versions, four screws (Item 36, Figure 6-9) have been replaced and four washers added (Item 36a, Figure 6-9).

To backdate this manual to be applicable to 5518A instruments with Serial Prefix 2502A, make the following changes:

Page 1-3, Table 1-1. 5528A Equipment and Manual Serial Prefix Effectivity:
Change 5518A Laser Head serial prefix from 2520A to 2502A.

Page 6-39, Figure 6-9, 5518A Laser Head Exploded View:
Change Item 36 HP Part Number from 0515-0426 to 0515-0332. Modify part description to read "M3 X 0.5 X 6.0 FLMS BK".
Delete Item 36a.

Reference Designator	Description
A1	Connector Board
A2	Receiver Board
A3	Controller Reference Board
A4	Sampler Board
A5	High Voltage Power Supply
A6	Laser Assembly
A7	Sampler Assembly
A8	Straightness Mount

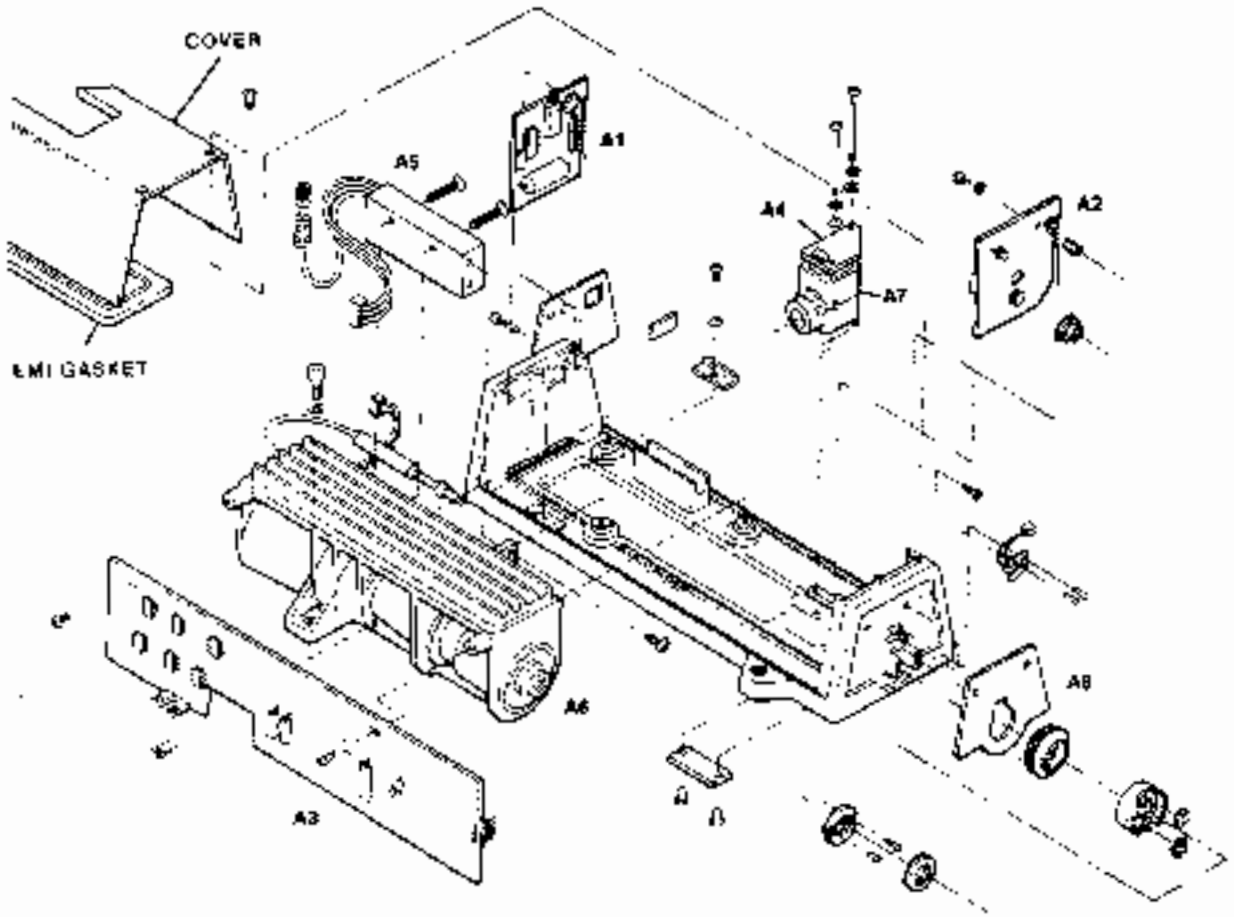


Figure 7-5. 5518A Assembly Designations

CHANGE 8 (5518A SERIAL PREFIX 2408A)

5518A Laser Heads with Serial Prefix 2408A differ from later versions as follows:

Later versions of the 5518A laser assembly (Item 22, Figure 6-9) have the part number 05517-60801.

To backdate this manual to be applicable to 5518A instruments with Serial Prefix 2408A, make the following changes:

Page 1-3, Table 1-1. 5528A Equipment and Manual Serial Prefix Effectivity:
Change 5518A Laser Head serial prefix from 2502A to 2408A.

Page 6-39, Figure 6-9, 5518A Laser Head Exploded View:
Change Item 22 HP Part Number from 05517-60801 to 05518-60501.

CHANGE 9 (5518A SERIAL PREFIX 2332A)

5518A Laser Heads with Serial Prefix 2332A differ from later versions as follows:

a. Ferrite beads A3L5 and A3L6 are not installed in later versions.*

b. Resistor A3R44 value has been changed in later versions.

c. Resistor A3R52 has been added to later versions

d Item 22 laser assembly part number is 05518-60801 in later versions.

e. Flat washer (Item 53, Figure 6-9) has been added to later versions. *Components A3L5, A3L6, A3R44, and A3R42 are located in Block L of Figure 8-C-14.

To backdate this manual to be applicable to 5518A instruments with Serial Prefix 2332A, make the following changes:

Page 1-3, Table 1-1. 5528A Equipment and Manual Serial Prefix Effectivity:
Change 5518A Laser Head serial prefix from 2409A to 2332A

Pages 6-15 and 6-16, Table 6-4. 5518A P.C. Board Assemblies Replaceable Parts:
Delete A3C31 and A3R52.
Add A3L5 and A3L6, HP Part Number 9170 0029, CD 3, Qty 2, CORE-SHIELDING BEAD, Mfr Code 28480, Mfr Part Number 9170 0029.
Change A3R44 HP Part Number from 0757-0438 to 0698-3154, CD 0, Qty 1, RESISTOR 4.22K 1%.125W F TC=0±100, Mfr Code 24546, Mfr Part Number C4-1/8-TO-4221-F.

Page 6-39, Figure 6-9. 5518A Laser Head Exploded View:
Delete Item 53
Change Item 22 HP Part Number from "05518-60801" to 05518-60301.
Delete footnote.

Page 8-C-41, Figure 8-C-14, A3 5518A Controller/Reference Board 05518-60003 and A4 Sample Board 05518-60004.

Replace Block L with Figure 7-3.
Change A3 board series number located at upper left corner of the schematic, from 2408 to 2328.
Delete capacitor A3C31 and resistor A3R52 from component locator
Change "Reference Designations" table as follows:
C1-31 to C1-30
R48-R52 to R48-R51

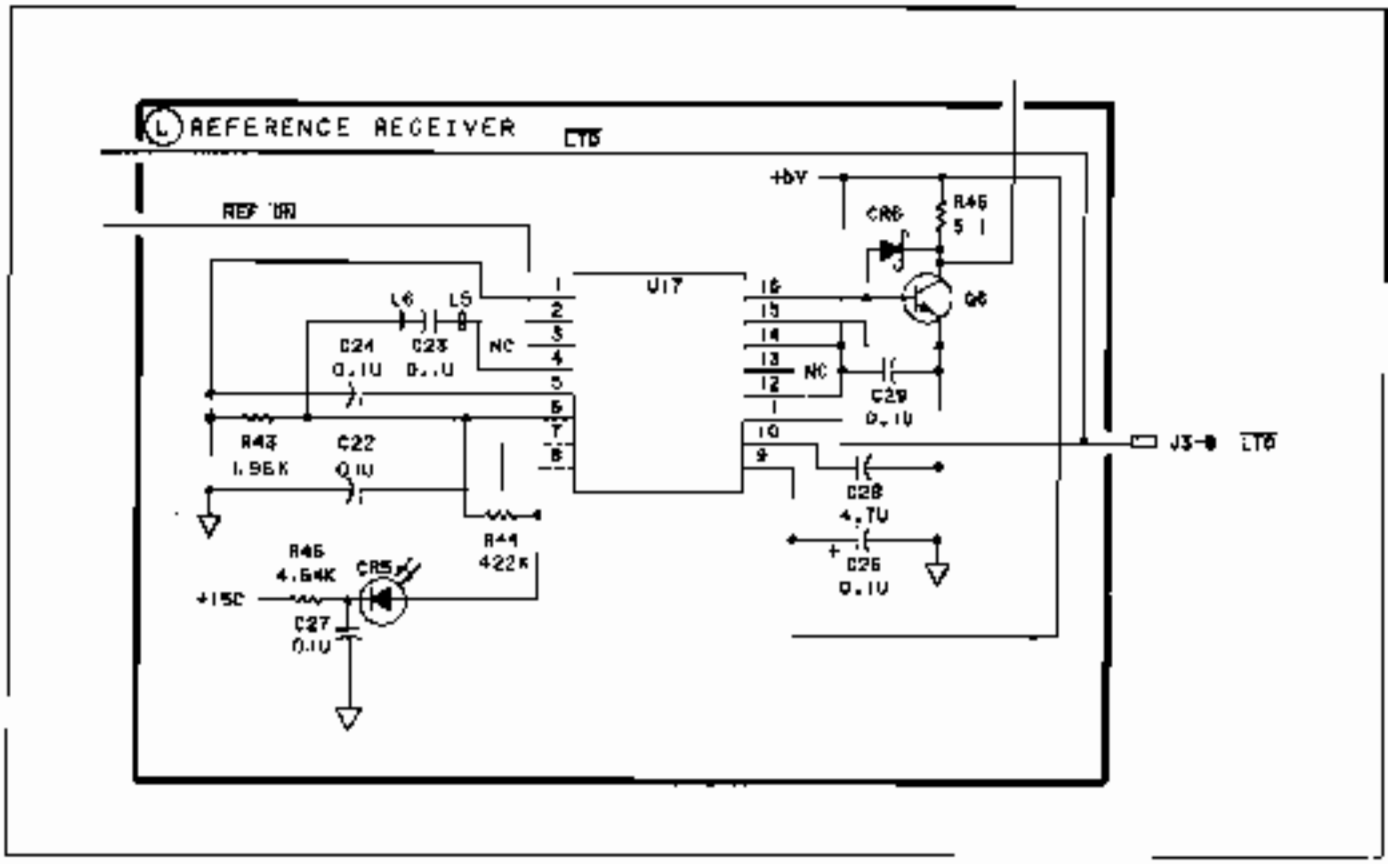


Figure 7-6. Reference Receiver [Block L (Part of Figure 8-C-14)]

CHANGE 10 (5518A SERIAL PREFIX 2328A)

5518A Laser Heads with Serial Prefix 2328A differ from later versions as follows:

The part numbers for the leveling foot and lock nut were changed. For Series 2328A and below, these had 10753- part numbers and were shipped with the tripod mounting plate. After 2328A, the leveling foot and lock nut have 05518- part numbers and are shipped with the 5518A.

To backdate this manual to be applicable to 5518A instruments with Serial Prefix 2328A and below, make the following changes:

Page 6-46, Part of Figure 6-12, 10753A Tripod, HP Replaceable Parts:
Change Item 1 to HP Part Number 10753-20010 (P/O Part No. 10753-60003).
Change Item 2 to HP Part Number 10753-20011 (P/O Part No. 10753-60011).

CHANGE 11 (SERIAL PREFIX 2308A)

5518A Laser Heads with Serial Prefix 2308A differ from later versions as follows.

a. A3L5 and A3L6 were not installed.
b. A3R6 was 4.64M.
c. A3R17 was 681k.

To backdate this manual to be applicable to 5518A instruments with Serial Prefix 2308A, make the following changes:

Pages 6-15 and 6-16, Table 6-4:
Delete A3L5 and A3L6.
Change A3R6 to 0699-0071, QTY 4, RESISTOR 4.64M 1%.125W F TC=0±100, Mfr Code 28480, Mfr Part Number 0699-0071.
Change A3R17 to 0698-8825, QTY 1, RESISTOR 681K 1%.125W F TC=0±100, Mfr Code 28480, Mfr Part Number 0698-8825.

Page 8-C-41, Figure 8-C-14:
Delete A3L5 and A3L6.
Change A4R6 to 4.64M
Change A3R17 to 681k.

CHANGE 12 (5518 SERIAL PREFIX 2236A)

5518 Laser Heads with instrument Serial Prefix 2236A differ from later versions as follows.

Blocks K and L of Figure 8-C-14 had several resistor and capacitor changes.

To backdate this manual to be applicable to 5518A instruments with Serial Prefix 2236A, make the following changes:

Page 6-15, Table 6-4, 5518A PC Board Assemblies Replaceable Parts:
Add A3C25,0160-4554, CAPACITOR-FXD 0.01 UF +20% 50 VDC CER, Mfr Code 28480, Mfr Part Number 0160-4554.
Change A3C22, A3C26, and A3C27 to 0160-4554, CAPACITOR-FXD 0.01 UF+20%50 VDCCER, Mfr Code 28480, Mfr Part Number 0160-4554.

Page 6-16, Table 6-4, PC Board Assemblies Replaceable Parts:
Add A3R42, 0757-0416, RESISTOR 511 1% 0.125W F TC=0+100, Mfr Code 24546, Mfr Part Number C4-1/8-TO-511R-F.
Change A3R43 to 0757-1094, RESISTOR 1.47K 1% 0.125W F TC=0±100, Mfr Code 24546, Mfr Part Number C4-1/8-TO-1471-F.
Change A3R44 to 0757-0442, RESISTOR 10K 1% 0.125W TC=0±100, Mfr Code 24546, Mfr Part Number C4-1/8-TO-1002-F
Add A3R47, 0757-0461, RESISTOR 68.1K 1% 0.125W F TC=0+100, Mfr Code 24546, Mfr Part Number C4-1/8-TO-6812-F.

Page 8-C-41, Figure 8-C-14, 5518A A3 Schematic Diagram:
Replace Blocks K and L with Figure 7-7
Change series number of A3 to 2236

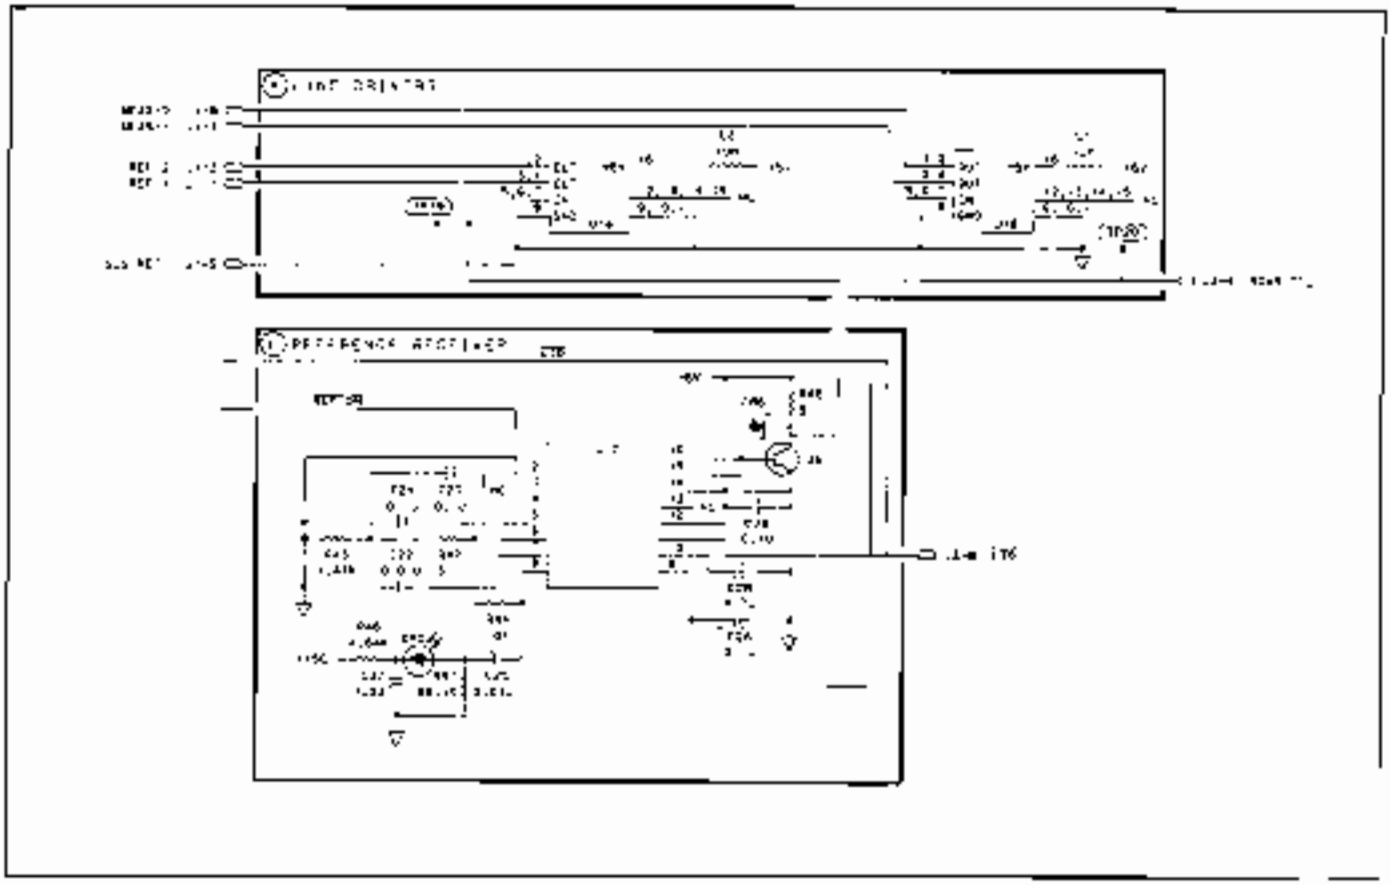


Figure 7-7. 5518A A3 Schematic (Series 2235)

CHANGE 13 (5518A SERIAL PREFIX 2220A)

5518A Laser Heads with instrument Serial Prefix 2220A differ from later versions as follows:

a. Had a mini-key cap installed on switch S1 located on the A1 Connector Board 05518-60001

b. Used 2/64" RFI tabs on both ends of the cover.

c. Used longer screws and spacers for securing transistors to the A3 Controller/Reference Board 05518-

d. A3R47 was not used.

e. A3C25 was not used and a jumper was installed in its place.

To backdate this manual to be applicable to 5518A instruments with Serial Prefix 2220A, make the following changes:

Page 6-39, Figure 6-9:

Add Item 48, Qty 1, Mini-key Cap, 0370-0604 to the exploded view. On Item 21, indicate Item 48 is installed on the interlock switch at the top center of the board.

Change the part number of Item 34 to 0515-0408. Change screw length to 12.0".

Page 6-15, Table 6-4:

Delete A3C25 and listing.

CHANGE 13 (5518A SERIAL PREFIX 2220A) (Continued)

Page 6-17, Table 6-4:
Under "Miscellaneous A3 Parts", add jumper Wire, HP Part Number 8159-0005. This is the jumper wire replacing C25. Delete A3R47 and listing
Under Miscellaneous A3 Parts, add Spacer, 10 × 12 mm, 18 Gauge, Qty 2.

Page 6-39, Figure 6-9.
On Exploded View, indicate the spacers are installed under Item 30 and under the right-most transistor at the bottom of the board.

Page 8-C-11, Figure 8-C-14, A3 Board:
At top left of board, change the A3 series number to 2216. Add Series 2216 for A4.
At lower right of schematic in Block L, replace A3C25 with a straight jumper. Delete A3R47.

Page 8-C-15, Figure 8-C-9, A1 Board (Photo):
Change series number to 2216.

Page 8-C-37, Figure 8-C-12, A1 Board Schematic:
Change series numbers to 2216.

Table 7-3. 10751A/B Manual Backdating

If Your Instrument Has Serial Prefix or Serial Number	Make Backdating Change
2308A	1
2220A, 2216A	1,2

CHANGE 1 (10751A/B SERIAL PREFIX 2308A)

10751A/B Air Sensors with Serial Prefix 2308A differ from later versions as follows:

To backdate this manual to be applicable to 10751 instruments with Serial Prefix 2308A, make the following changes:

Page 1-3, Table 1-1 5528A Equipment and Manual Serial Prefix Effectivity:
Change 10751A/B Air Sensor serial prefix from 2452A to 2308A.

Page 6-18, Table 6-5, 10751-60001 P.C. Board Assembly Replaceable Parts:
Change A1C6 and A1C7 from 0180-3573 to 0180-0374, CD 3, Qty 2, CAPACITOR 20UF±10% 20VDC TA, Mfr Code 56289, Mfr Part Number 150D106X9020B2. Due to its 20VDC rating, it is not recommended for use.
Change A1 board series from 2452 to 2308.

Page 8-D-9, Figure 8-D-4, 10751A/B Air Sensor:
Change A1 board series prefix, located at the upper left hand of schematic diagram, from 2452 to 2308.

CHANGE 2 (10751A/B SERIAL PREFIX 2220A AND 2216A)

10751A/B Air Sensors with instrument Serial Prefix 2220A or 2216A differ from later versions as follows:

Capacitor A1C24 was not installed on the 10751-60001 board

To backdate this manual to be applicable to 10751A/B instruments with Serial Prefix 2220A or 2216A, make the following changes:

Page 6-18, Table 6-5, 10751 60001 Replaceable Parts:
Delete A1C24.

Page 8-D-9, Figure 8-D-4, 10751A/B Air Sensor Schematic Diagram:
Delete A1C24.

Table 7-4. 10757A/B/C Manual Backdating

If Your Instrument Has Serial Prefix or Serial Number	Make Backdating Change
2416A	NO CHANGES REQUIRED (see explanation below)

The current serial prefix for the 10757A/B/C is either 2416A, or the serial prefix specified in the "Manual Updating Changes" sheets that will accompany a manual if changes to the product have occurred (see paragraph 7-4, this manual). Since the 10757A/B/C's introduction, no changes have been instituted. The product that the 10757A/B/C replaced, the 10752A/B/C, had a serial prefix of 2220A when obsoleted. The following changes will therefore backdate this manual to reflect a system equipped with 10752A/B/C instead of a 10757A/B/C.

All Pages:

Throughout this manual, indicate that the 10752A/B/C is used in place of the 10757A/B/C. Please note that the 10757A/B/C provides improved accuracy for temperature compensation.

Page 1-5, Table 1-2, Specifications and Supplemental Characteristics:
Replace "HP 10757A/B/C MATERIAL TEMPERATURE SENSOR" with the following:

HP 10752A/B/C MATERIAL TEMPERATURE SENSOR

Description: The 10752A/B/C contains an integrated circuit-type temperature sensor mounted in a remote oil immersible "button" with a magnetic base. A cable is attached to the button for connection to the HP 5508A Measurement Display. Up to three Material Temperature Sensors can be used in the system.

Cable Lengths:
10752A: 5 m (16 feet)
10752B: 15 m (45 feet)
10752C: 25 m (82 feet)

Maximum Sensor Error:
(With 12 month calibration interval)

Over Temperature Range 15-25°C: ±0.35°C
Over Temperature Range 0-40°C: ±0.80°C

Dimensions: (Excluding cable) 32 mm diameter x 15 mm height

Weight:
10752A: 180 grams
10752B: 310 grams
10752C: 450 grams

Page 3-15, Paragraph 3-20:
Replace paragraph 3-20 with the following:

3-20. The RANGE of the 10752A/B/C is 0 to 50° C(32 to 122° F).When sensors reach temperatures outside of this range, appropriate error messages are displayed by the 5508A. See paragraph 3-8 (ERROR MESSAGES) for explanation of these messages. The same error messages are used when temperature signal errors occur due to hardware failures.

Pages 4-15 through 4-19, Paragraphs 4-45 through 4-51:
Replace procedures found in paragraphs 4-45 through 4-51 with "10752A/B/C CALIBRATION PROCEDURES" found in Table 7-6.

Page 6-21, Table 6-7. 10757A/B/C Replaceable Parts:
Replace Table 6-7 with Table 7-5.

Table 7-5 10752A/B/C Replaceable Parts

Reference Designation	HP Part Number	C D	Qt y	Description	Mfr Code	Mfr Part Number
	10752-60001	3	1	AMPLIFIER ASSEMBLY	28480	10752-60001
C1	0160-4554	7		CAPACITOR-FXD .01UF ±20% 50VDC CER	28480	0160-4554
C2	0160-3829	7	1	CAPACITOR-FXD .47UF ±10% 50VDC	28480	0160-3829
C3	0160-4557	0		CAPACITOR-FXD 1UF ±20% 50VDC CER	16299	C062x47P105M050A
C4	0160-4557	0		CAPACITOR-FXD 1UF ±20% 50VDC CER	16299	C062x07R 04M050A
R1	2100-3154	7	1	RES STOR-TRMR 1K 10% C SIDE-ADJ 17-TRN	02111	43P102
R2	0699-0811	2		RES STOR 33K .1% .125W F TC=0±5	28480	0699-0811
R3	0698-3154	4		RES STOR 29.74K 1% .125W F TC 0±100	24546	C4-1/8 TC-2972 F
U1	1826-0543	9		IC OP AMP LOW-DRIFT TO-99 PKG	06665	OP-07CJ
				FOR 10757 MISCELLANEOUS AND CHASSIS PARTS SEE EXHIBIT 7-6		

Page 6-45, Figure 6-11, 10752A/B/C Exploded View:
Replace Figure 6-11 with Figure 7-8.

Page 8-A-18, Paragraph 8-A-90:
Change "10757A/B/C" to read "10752A/B/C",and ±15V current requirements from 20 to 10 mA.

Page 8-E-1, Section VIII-E, 10757A/B/C Material Temperature Sensor:
Replace Section VIII-E with the contents of Table 7-8.

Page 8-E-5, Figure 8-E-2, 10757A/B/C Material Temperature Sensor Schematic Diagram:
Replace Figure 8-E-2 with Figure 7-9

10752A/B/C CALIBRATION PROCEDURES

Due to the complexity of the calibration procedures and test equipment required, it is recommended that the 10752A/B/C be returned to Hewlett-Packard for periodic calibration.

The 10752A/B/C temperature circuitry requires a 12 month calibration cycle. Also, calibration should be performed after repair is made to any of the 10752A/B/C circuits.

Equipment Required. Refer to Table 1-4 in Section I for a list of test equipment required for the 10752A, B/C calibration procedure. In addition, the procedures require the 5508A Measurement Display and an HP 3456A Digital Voltmeter.

WARNING

MAINTENANCE DESCRIBED HEREIN IS PERFORMED WITH POWER SUPPLIED TO THE INSTRUMENT, AND PROTECTIVE COVERS REMOVED. 100 VOLTS TO 240 VOLTS AC MAY BE PRESENT IN THE 5508A EVEN WHEN THE FRONT PANEL POWER SWITCH IS SET TO OFF. MAINTENANCE SHOULD BE PERFORMED ONLY BY SERVICE-TRAINED PERSONNEL WHO ARE AWARE OF THE HAZARDS INVOLVED (FOR EXAMPLE, FIRE AND ELECTRIC SHOCK). WHERE MAINTENANCE CAN BE PERFORMED WITHOUT POWER APPLIED, THE POWER CORD SHOULD BE REMOVED.

CAUTION

The 10752A/B/C circuitry is susceptible to damage from electrostatic discharge, therefore use an anti-static work station and ground straps when handling printed circuit assemblies during assembly or disassembly.

10752A/B/C calibration is performed and the temperature transducer immersed in a temperature controlled bath at 20°C±1°C.

NOTE

The 10752A/B/C temperature sensor should be immersed ONLY in dielectric liquid, Fluorinet FC-40 or equivalent

The equipment in Table 1-4 should be configured to form the system depicted in Figure 4-1.

a. On the side of the 10752A/B/C, using a small flat-bladed screwdriver, press in on the tabs to remove the 10752A/B/C case

b. Remove the 10752A/B/C cover noting how the printed circuit board is mounted

c. Inspect cable and connectors for damage.

d. Secure 10752-60001 printed circuit board such that power can be applied and potentiometer A1R1 can be adjusted.

e. Immerse the sensor head into the bath in close proximity to the quartz thermometer probe without resting either on the inside of the bath housing.

f. Connect 10752A/B/C cable assembly to 5508A rear panel connector marked MATERIAL TEMPERATURE 1.

g. On the 5508A rear panel, set ENGLISH/METRIC switch to METRIC.

h. Plug 5508A into AC outlet and set the LINE switch to ON.

i. Wait for 10 minutes until 5508A goes through its warm-up countdown sequence and the display flashes LASr FAIL. If the 5508A fails its self test or the warm-up countdown does not end with LASr FAIL, check setup and see 5528A Block Diagram and System Troubleshooting found in Section VIII.

j. Connect the positive lead of the DVM to test point A3TP40, marked +10VR, and the negative lead to test point A3TP38, marked AG (for Analog Ground), on the 5508A A3 board.

Table 7-8. 10752A/B/C Calibration Procedures (Continued)

k. The measured value should be −10V±10 millivolts. If not, check setup and see −10 Vref Troubleshooting in Section VIII. Write down the value of −10 Vref for use in step n.

l. Monitor the quartz thermometer to be sure that the bath temperature is stable at 20°C±1°C to within 0.03°C for a 1 minute period.

m. Connect floating negative terminal of DVM to test point TP39 (AG [Analog Ground] on 5500A A3 board) and positive terminal of DVM to pin 2 of A3R56.

n. Note the reading of the quartz thermometer (in °C) and calculate the adjustment voltage, V, as follows:

$$V = 0.04956 \quad [0.0033 \times T] - dV$$

where T is the reading of the quartz thermometer and dV = −10 Vref −10.


o. Adjust 10752A/B/C A1R1 such that the DVM reading equals V±250 microvolts.

p. The accuracy of the 10752A/B/C temperature measurement can be checked using the quartz thermometer and bath temperature within the operating range of the 10752A/B/C (0 to 40°C).

Procedure:

1. Perform the 5500A Calibration Procedures, paragraphs 4-27 through 4-35.

2. Set 5500A Test Switches A2S3 to 0001 0000 and toggle the Master Reset switch A2S2.

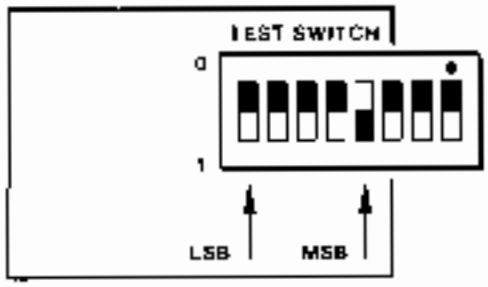

The 5500A display should read 0.0000 mm. If not, check A2S3 setting and see 5520A Block Diagram and System Troubleshooting.

3. On 5500A, press MATL TEMP twice on 5500A front panel to display:

XX.XXC

where XX.XX is the temperature measured by the 10752A/B/C.

4. The bath temperature can now be adjusted to various temperatures within the range of 0 to 40°C in order to verify temperature measurement specifications of the 10752A/B/C. The reading of the quartz thermometer should be allowed to stabilize at each selected temperature to within ±0.03°C for 1 minute before comparing the reading to that on the 5500A display.

If any reading within the operating range indicates measurement error outside the accuracy specifications of the 10752A/B/C, the Temperature Sensor Assembly should be replaced and the calibration procedure repeated.

q. Turn 5500A AC power OFF.

r. Remove 10752A/B/C temperature sensor from the bath and allow to dry.

s. Reassemble 10752A/B/C.

Table 7-6 10752A/B/C Calibration Procedures (Continued)

Table 7-7 Test Record

Test or Calibration	Date/Entry	Date/Entry
1. 5518A Laser Power Output Test	_____/_____	_____/_____
2. 5518A Receiver Gain Test	_____/_____	_____/_____
3. 5505A -10 Vref	_____/_____	_____/_____
4. CAL A +decimal	/	/
5. 5505A +0.5 Vref	_____/_____	_____/_____
6. CAL B +decimal	_____/_____	_____/_____
7. 10751A/B Calibration	/	/
8. 10752A/B/C Calibration	_____/_____	_____/_____

Table 7-8. 10752A/B/C Material Temperature Sensor Circuit Theory and Troubleshooting

10752A/B/C MATERIAL TEMPERATURE SENSOR CIRCUIT THEORY

The following paragraphs contain circuit theory and troubleshooting information for the 10752A/B/C.

The schematic diagram for the 10752A/B/C is shown in Figure 7-7. The material temperature measurement is identical to the temperature measurement of the 10751A, B Air Sensor, with exception that the IC transducer is encapsulated in a magnetic mount.

The transducer is an absolute temperature sensor which outputs 1 microampere per degree Kelvin. Operational amplifier U1 provides current to voltage conversion with a transresistance of 33.5k Ohm (33.5k Ohm is approximately R1 minus R2). The input range of the A/D converter in the 5500A Measurement Display is -1V<=Vin<=+10V. +10 Vref is applied to the positive input of U1 to provide the necessary offset. At 25 degrees Centigrade the op-amp, MT, equals 0 Volts and has a slope of 33.5 mV/degree C. Resistor R3 is a bias current compensation resistor. C1 eliminates noise from the temperature signal (MT) which is essentially DC.

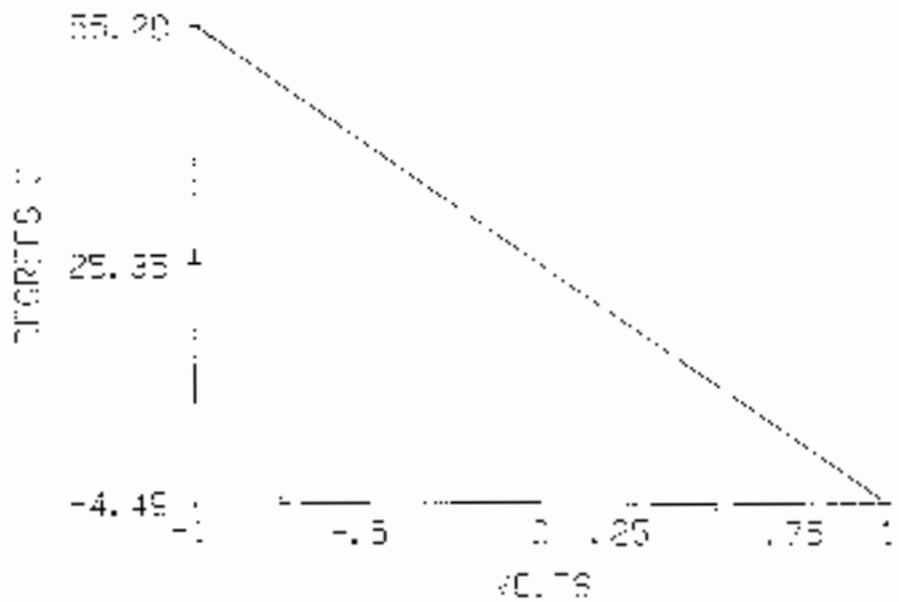


Figure 7-6. Material Temperature Sensor Characteristics

10752A/B/C MATERIAL TEMPERATURE SENSOR TROUBLESHOOTING

The following paragraphs provides a brief troubleshooting procedure for the 10752A/B/C.

a. Verify that +15 V, -15 V and +10 Vref are within tolerances given in Table 8-A-10.

b. Verify +10 Vref on both sides of R3. A voltage drop greater than 1 mV across R3 may indicate a failure of U1. Replace board.

c. Measure voltage on pin 2 of U1. If it is within 1 mV of +10 Vref, verify feedback resistor values before replacing MT1. If pin 2 is outside this 1 mV range, disconnect the temperature sensor board from the main board. If pin 2 is now within 1 mV of +10 Vref, replace the temperature sensor. Otherwise, replace board 10752-80001. U2 output should rise to 10V with the temperature sensor disconnected.

ITEM	QTY	DESCRIPTION	HP PART NUMBER
1	1	LABEL, CALIBRATION	7121-1606
2	1	MTL SENSOR ASSY	(SEE TABLE 1)
3	1	LABEL, SENSOR	7121-1610
4	1	BOARD AY, MTL SENSOR	10752-60001
5	1	CONNECTOR CBL ASSY	8120-3592
6	2	COVER POD	05005-40001
7	1	LABEL, SERIAL	(SEE TABLE 1)

MODEL NO.	MTL SENSOR ASSY PART NO.	SERIAL LABEL PART NO.
10752 A	10752-60301	7121-1607
10752 B	10752-60302	7121-1608
10752 C	10752-60303	7121-1609





BOARD CONNECTIONS

Figure 7-8. 10752A/B/C Exploded View

Figure 7-8
10752A/B/C EXPLODED VIEW

(See Page 7-33)

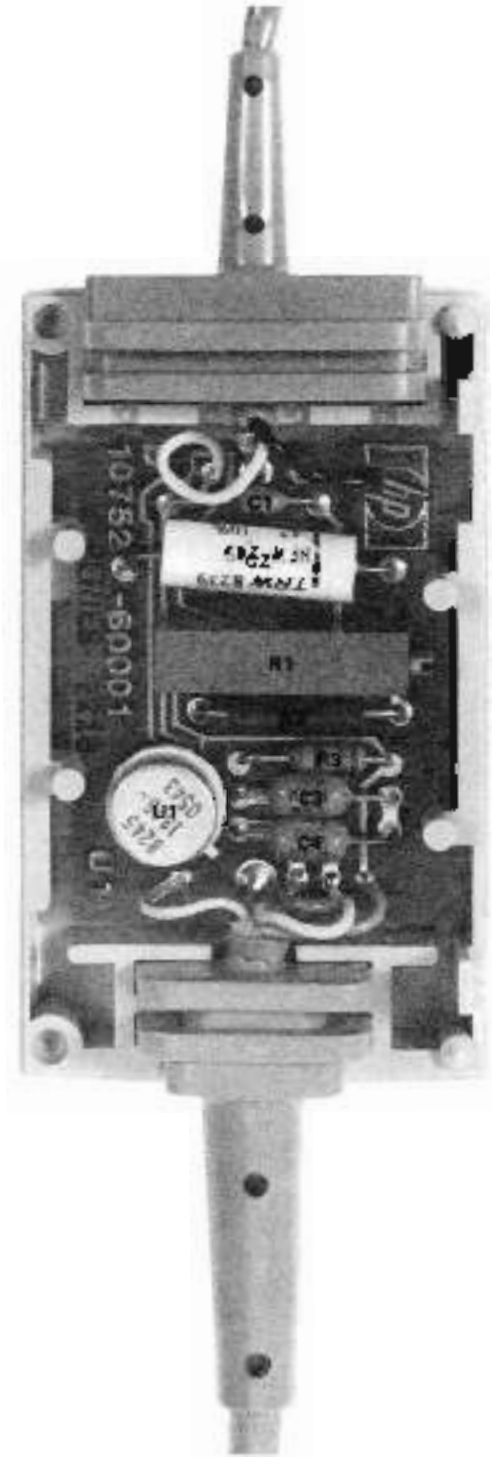
C1
R1
R2
R3
C3
C4
U1

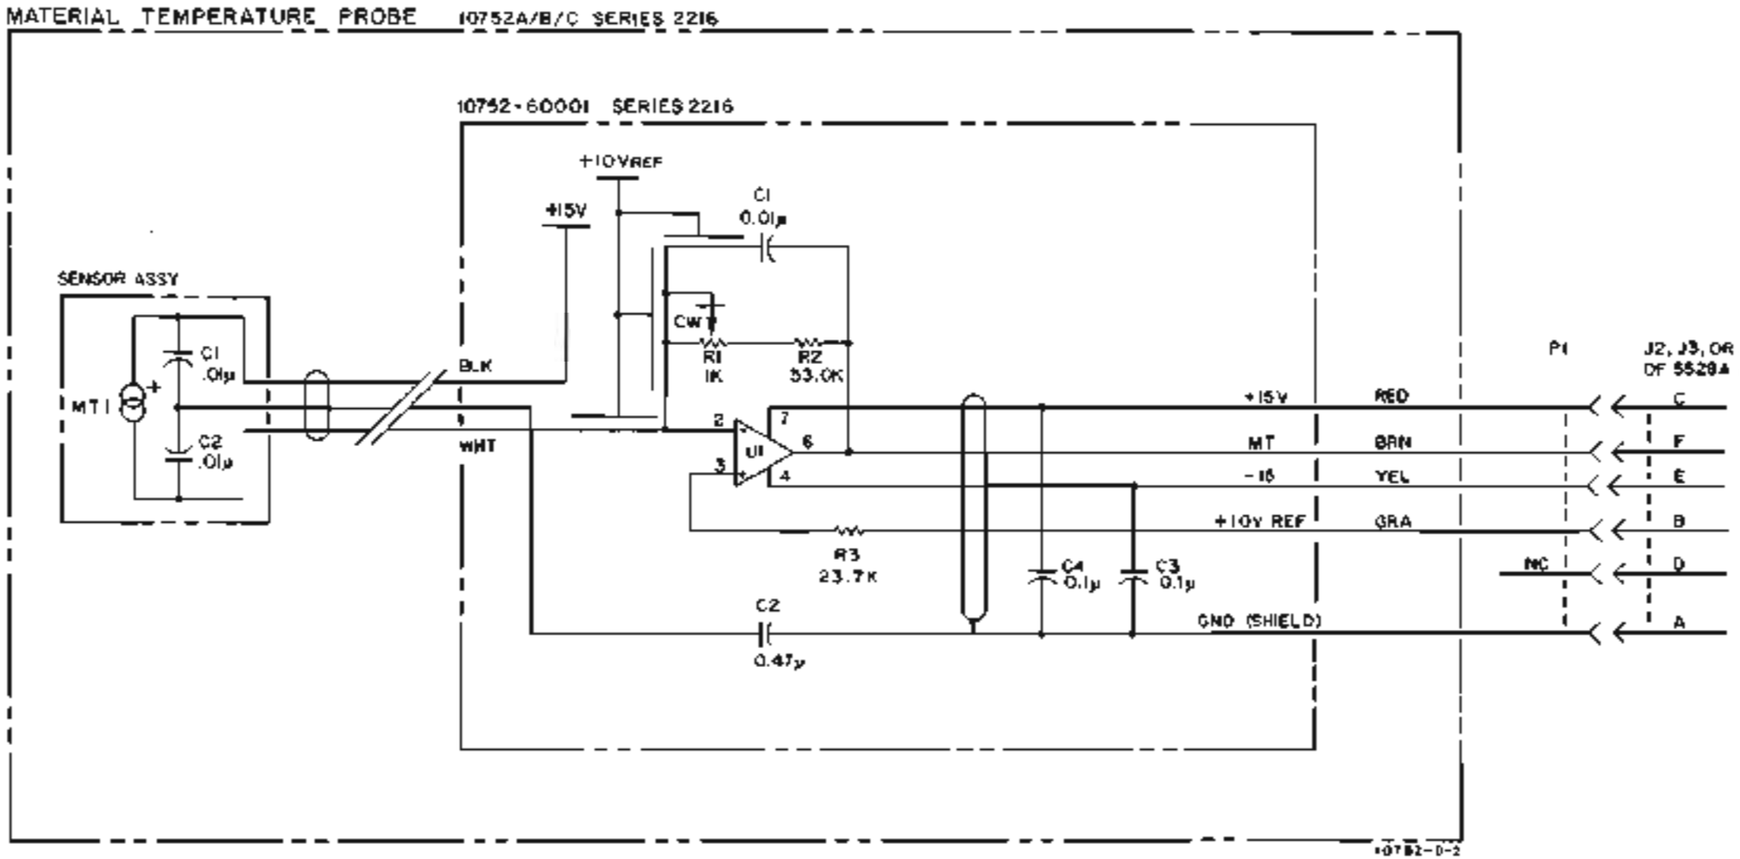

NOTES:

1. REFERENCE DESIGNATIONS WITHIN THIS ASSEMBLY ARE ABBREVIATED. ADD ASSEMBLY NUMBER TO ABBREVIATION FOR COMPLETE DESCRIPTION.
2. UNLESS OTHERWISE INDICATED:
   RESISTANCE IN OHMS;
   CAPACITANCE IN FARADS;
   INDUCTANCE IN HENRIES
3. ASTERISK (*) INDICATES FACTORY SELECTED COMPONENT, AVERAGE VALUE SHOWN.

Reference Designations
A1
C1-4
R1-3
U1

TABLE OF ACTIVE ELEMENTS

Reference Desig.	HP Part No.	Mfr. Part No.
U1	1826-0543	OP-07CJ

Figure 7-9. 10752A/B/C A1 Material Temperature Sensor

Figure 7-9
10752A/B/C MATERIAL TEMPERATURE SENSOR

(See Page 7-35)

SECTION VIII
SERVICE

	Page
Introduction	8-1
Section Organization	8-1
Theory of Operation	8-1
Troubleshooting and Repair	8-2
Recommended Test Equipment	8-2
Service Aids	8-2
Schematic Diagram Symbols and Reference Designators	8-2
Schematic Diagram Notes	8-3
Safety Considerations	8-4
Safety Symbols	8-5
Before and After Service Product Safety Checks	8-6
Logic Symbols	8-6
Logic Concepts	8-6
Negation	8-7
Logic Implementation and Polarity Indication	8-7
Other Symbols	8-9
Dependency Notation	8-10
Control Blocks	8-11
Complex Logic Devices	8-12

SECTION VIII
SERVICE

8-1. INTRODUCTION

8-2. This section contains service information for the 5528A Laser Measurement System including safety considerations, theory, block diagrams, schematic diagrams, component locators, and troubleshooting and repair procedures. Useful service information is provided in other sections of the manual, including: operator checks and maintenance in Section II, calibration procedures and performance tests in Section IV, adjustments in Section V, and exploded view illustrations parts lists in Section VI.

8-3. SECTION ORGANIZATION

8-4. Information in this section is organized using dividers with tabs shown in Table 8-1.

Table 8-1. Service Section Organization

Divider	Coverage
VIIIA 5528A	5528A Laser Measurement System System level block diagram and theory, system level troubleshooting
VIIIB 5508A	5508A Measurement Display 5508A overall block diagram and theory, board level theory, schematics, component locators and troubleshooting and repair procedures
VIIIC 5518A	5518A Laser Head 5518A overall block diagram and theory, board level theory, schematics, component locators and troubleshooting and repair procedures
VIIID 10751A/B	10751A/B Air Sensor Board level theory, schematics, component locators, and troubleshooting and repair procedures
VIIIE 10757A/B/C	10757A/B/C Material Temperature Sensor Board level theory, schematics, component locators, and troubleshooting and repair procedures
VIIIF Optics	5528A Optics Theory of operation: • Straightness optics • Angular optics Outline drawings, mounting hole dimensions and locations

8-5. THEORY OF OPERATION

8-6. As shown in Table 8-1, the theory of operation is presented at three levels:

a. overall system block diagram theory.

b. instrument block diagram theory, provided for the 5508A and 5518A.

c. board level theory of operation, provided for the 5508A, 5518A, 10751A/B, and 10757A/B/C. Board level theory is arranged in assembly number order (i.e., A1, A2 etc.).

8-7. TROUBLESHOOTING AND REPAIR

8-8. Troubleshooting information should be used as follows:

a. System troubleshooting procedures located in Section 8-A are designed to narrow trouble down to the instrument level. The 5528A Block Diagram description is located in the front of the section to provide the necessary background for effective troubleshooting.

b. Instrument troubleshooting procedures located in Section 8-B through 8-E are intended to isolate trouble to an assembly (pc board) of the respective instrument. Block diagram descriptions are also provided for the 5508A and 5518A. These descriptions provide instrument operation details beyond the 5528A block diagram description.

c. Component level troubleshooting information is provided for all the instruments in Sections 8-B through 8-E. These serve to pinpoint trouble to the stage or component level.

8-9. RECOMMENDED TEST EQUIPMENT

8-10. Table 1-4 in Section I lists the test equipment required for service. Any equipment that satisfies the critical specifications given in the table may be substituted for the recommended model(s).

8-11. SERVICE AIDS

8-12. This system uses both metric and english hardware. Figures 8-1 through 8-9 should be used to determine the correct hardware descriptions, part numbers and the proper tools to employ for assembly and disassembly.

8-13. SCHEMATIC DIAGRAM SYMBOLS AND REFERENCE DESIGNATORS

8-14. The logic symbology used on the schematic diagrams conform to ANSI Y32.14-1973 (IEEE Std 91-1973). This standard supersedes MIL STD 806B. Definitions and explanations of the logic symbology used in this manual are contained in Paragraph 8-26 through 8-48.

8-15. Figure 8-1 shows some of the symbols used on the schematic diagrams. In the center of this figure, the scheme for printed circuit board identification is presented. Also shown at the bottom of Figure 8-1 is the system for reference designators, assemblies, and subassemblies.

SYMBOLS

FRONT PANEL LABEL

REAR PANEL LABEL

INTERIOR AND PC BOARDS LABEL

CW — WIPER MOVES TOWARD "CW" WHEN CONTROL IS ROTATED CLOCKWISE

OR — PROTECTIVE CONDUCTOR TERMINAL

CIRCUIT COMMON

IDENTIFIED COMMON

OR — CHASSIS TERMINAL

KNOB CONTROL

SCREWDRIVER ADJUST

MAIN SIGNAL PATH

FEEDBACK PATH

TEST POINT

PRINTED CIRCUIT BOARD IDENTIFICATION



REFERENCE DESIGNATIONS

REFERENCE DESIGNATIONS WITHIN ASSEMBLIES ARE ABBREVIATED. ADD ASSEMBLY NUMBER TO ABBREVIATION FOR COMPLETE DESCRIPTION. JACKS ARE THE STATIONARY CONNECTORS AND PLUGS ARE THE MORE MOVEABLE OF TWO CONNECTORS.

ASSEMBLY	ABBREVIATION	COMPLETE DESCRIPTION
A25	C1	A25C1
A25A1	CR1	A25A1CR1
NO PREFIX	J3	J3

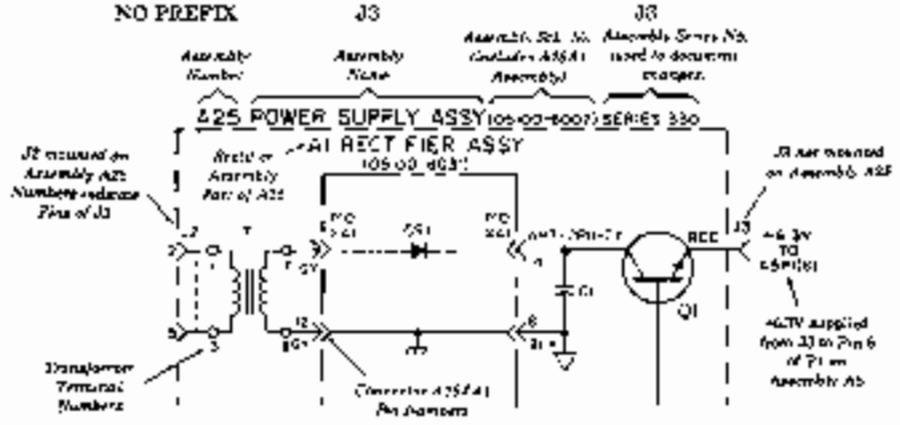


Figure 6-1. Schematic Diagram Notes

8-16. SAFETY CONSIDERATIONS

8-17. The following paragraphs contain warnings and cautions that must be followed for your protection and to avoid damage to the equipment

WARNING

MAINTENANCE DESCRIBED HEREIN IS PERFORMED WITH POWER SUPPLIED TO THE EQUIPMENT AND WITH PROTECTIVE COVERS REMOVED. SUCH MAINTENANCE SHOULD BE PERFORMED ONLY BY SERVICE-TRAINED PERSONNEL WHO ARE AWARE OF THE HAZARDS INVOLVED (FOR EXAMPLE, FIRE AND ELECTRIC SHOCK). WHERE MAINTENANCE CAN BE PERFORMED WITHOUT POWER APPLIED THE POWER CORD SHOULD BE REMOVED.

BEFORE ANY REPAIR IS COMPLETED, ENSURE THAT ALL SAFETY FEATURES ARE INTACT AND FUNCTIONING, AND THAT ALL NECESSARY PARTS ARE CONNECTED TO THEIR PROTECTIVE GROUNDING MEANS.

100/240 VOLTS MAY BE PRESENT IN THE 5508A. USE EXTREME CAUTION WHEN WORKING ON OR NEAR THE PRIMARY POWER WIRING. VOLTAGE WILL BE PRESENT IN SOME AREAS EVEN IF THE LINE SWITCH IS SET TO OFF.

WARNING

FROM 1.8 KILOVOLTS TO 12 KILOVOLTS DC IS PRESENT ON THE ANODE OF THE LASER TUBE IN THE 5518A. EXERCISE EXTREME CAUTION WHEN WORKING INSIDE THE INSTRUMENT. THE HIGH VOLTAGE COULD CAUSE SERIOUS PERSONAL INJURY IF CONTACTED.

8-18. Safety Symbols


8-19. The following safety symbols are used on the instrument or in this manual.



Instruction manual symbol. The product will be marked with this symbol when it is necessary for the user to refer to the instruction manual in order to protect against damage to the instrument.




Indicates dangerous voltage fed from internal or external sources exceeding 1000 volts.



Protective conductor terminal. For protection against electrical shock in case of a fault. Used with field wiring terminals to indicate the terminal which must be connected to ground before operating equipment.



Low-noise or noiseless, clean ground (earth) terminal. Used for a signal common, as well as providing protection against electrical shock in case of a fault. A terminal marked with the symbol must be connected to ground in the manner described in the installation (operating) manual, before operating the equipment.



Frame and chassis terminal. A connection to the frame (chassis) of the equipment which normally includes all exposed metal structures.



Alternating current.



Direct current.



Alternating or direct current.



The WARNING signal denotes a hazard. It calls attention to a procedure, practice, or the like, which, if not correctly performed or adhered to, could result in personal injury.



The CAUTION sign denotes a hazard. It calls attention to an operating procedure, practice, or the like, which if not correctly performed or adhered to, could result in damage to or destruction of part or all of the product.

8-20. Before and After Service Product Safety Checks

8-21. Visually inspect the interior of the serviced instrument for any signs of abnormal internally generated heat, such as discolored printed circuit boards or components, damaged insulation, or evidence of arcing. Determine and remedy the cause of any such condition.

8-22. Using a suitable ohmmeter check the resistance from the instrument enclosure to the ground pin on the power cord. The reading must be less than 0.5 ohm. Flex the power cord while making this measurement to determine whether intermittent discontinuities exist. The resistance check should also be performed from the laser head enclosure to the ground pin of the cord while flexing the interconnect cable.

8-23. Check any indicated front or rear panel ground terminals using the above procedures.

8-24. Check resistance from the instrument enclosure to line and neutral (tied together) with the power switch on and the power source disconnected. The minimum acceptable resistance is two megohms. Replace any component which results in a failure.

8-25. Check line fuse to verify that the correct value is installed.

8-26. LOGIC SYMBOLS


8-27. Logic symbols used in this manual conform to the American National Standard ANSI Y32.14-1973 (IEEE Std. 91-1973). This standard supersedes MIL-STD-806B. In the following paragraphs logic symbols are described. For further descriptions refer to HP Logic Symbology manual, part number 5951-0130.

8-28. Logic Concepts

8-29. The binary numbers 1 and 0 are used in pure logic where 1 represents true, yes, or active and 0 represents false, no, inactive. These terms should not be confused with the physical quantity (e.g., voltage) that may be used to implement the logic, nor should the term "active" be confused with a level that turns a device on or off. A truth table for a relationship in logic shows (implicitly or explicitly) all the combinations of true and false input conditions and the result (output). There are only two basic logic relationships, AND and OR. The following illustrations assume two inputs (A and B), but these can be generalized to apply to more than two inputs.


AND Y is true if and only if A is true and B is true (or more generally, if all inputs are true).
Y=1 if and only if A=1 and B=1
Y=A•B

OR Y is true if and only if A is true or B is true (or more generally, if one or more input(s) is (are) true).
Y=1 if and only if A=1 or B=1
Y=A+B

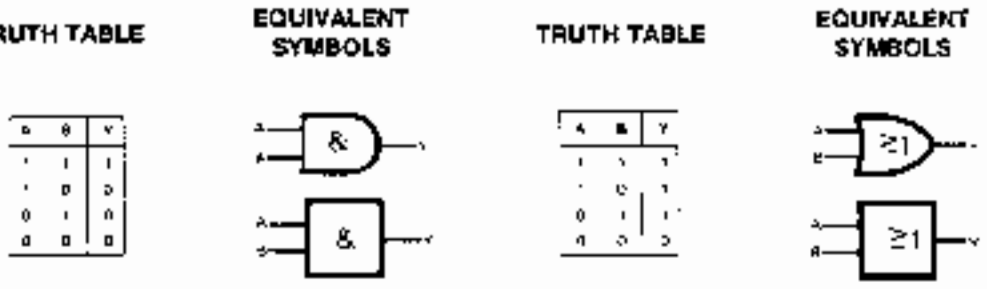

6-30. Negation

6-31. In logic symbology, the presence of the negation indication symbol ○ provides for the presentation of logic function inputs and outputs in terms independent of their physical values, the 0-state of the input or output being the 1-state of the symbol referred to the symbol description.

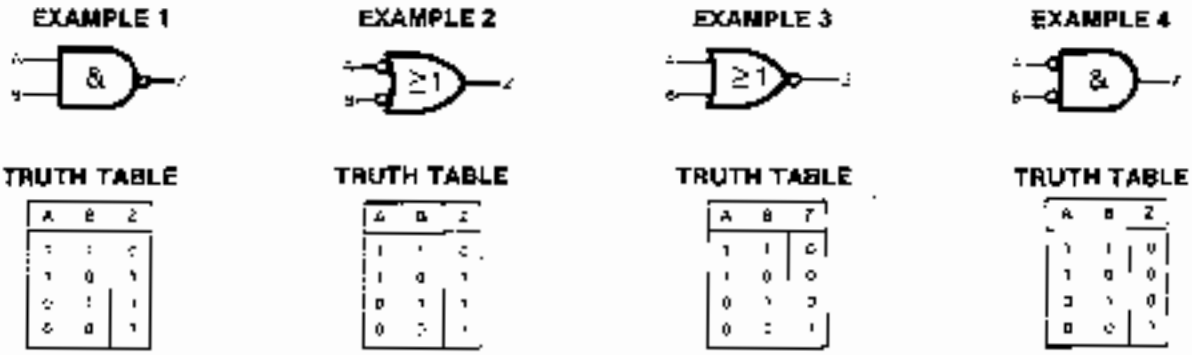

EXAMPLE 1 says that Z is not true if A is true and B is true or that Z is true if A and B are not both true. $\overline{Z}=AB$ or $Z=\overline{AB}$. This is frequently referred to as NAND (for NOT AND).

EXAMPLE 2 says that Z is true if A is not true or if B is not true. $Z=\overline{A}+\overline{B}$. Note that this truth table is identical to that of Example 1. The logic equation is merely a DeMorgan's transformation of the equations in Example 1. The symbols are equivalent.

EXAMPLE 3 $\overline{Z}=A+B$ or $Z=\overline{A}\cdot\overline{B}$ and.

EXAMPLE 4 $Z=\overline{A+B}$, also share common truth table and are equivalent transformations of each other. The NOT OR form (Example 3) is frequently referred to as NOR.

6-32. Logic Implementation and Polarity Indication

6-33. Devices that can perform the basic logic functions, AND or OR, are called gates. Any device that can perform one of these functions can also be used to perform the other if the relationship of the input and output voltage levels to the logic variables 1 and 0 is redefined suitably.

6-34. In describing the operation of electronic logic devices, the symbol H is used to represent a "high level", which is a voltage within the more-positive (less-negative) of the two ranges of voltages used to represent the binary variables. L is used to represent a "low level", which is a voltage within the less-positive (more-negative) range.

6-35. A function table for a device shows (implicitly or explicitly) all the combinations of input conditions and the resulting output conditions.

6-36. In graphic symbols, inputs or outputs that are active when at the high level are shown without polarity indication. The polarity indicator symbol ◺ denotes that the active (one) state of an input or output with respect to the symbol to which it is attached is the low level.

EXAMPLE 5 assume two devices having the following function tables.

DEVICE #1 FUNCTION TABLE

A	B	Y
H	H	H
H	L	L
L	H	L
L	L	L

DEVICE #2 FUNCTION TABLE

A	B	Y
H	H	H
H	L	H
L	H	H
L	L	L

POSITIVE LOGIC by assigning the relationship H=1, L=0 at both input and output. Device #1 can perform the AND function and Device #2 can perform the OR function. Such a consistent assignment is referred to as positive logic. The corresponding logic symbols would be:

DEVICE #1



DEVICE #2



NEGATIVE LOGIC alternatively, by assigning the relationship H=0, L=1 at both input and output, Device #1 can perform the OR function and Device #2 can perform the AND function. Such a consistent assignment is referred to as negative logic. The corresponding logic symbols would be:

DEVICE #1



DEVICE #2



5-37. MIXED LOGIC. The use of the polarity indicator symbol (| automatically invokes a mixed-logic convention. That is, positive logic is used at the inputs and outputs that do not have polarity indicators, negative logic is used at the inputs and outputs that have polarity indicators.

EXAMPLE 6 FUNCTION TABLE

A	B	Z
H	H	L
H	L	H
L	H	H
L	L	H

This may be shown either of two ways:




Note the equivalence of these symbols to examples 1 and 2 and the fact that the function table is a positive-logic translation (H=1, L=0) of the NAND truth table, and also note that the function table is the negative-logic translation (H=0, L=1) of the NOR truth table, given in Example 3.

EXAMPLE 7 FUNCTION TABLE

A	B	Z
H	H	L
H	L	L
L	H	L
L	L	H

This may be shown either of two ways:



Note the equivalence of these symbols to examples 3 and 4 and the fact that the function table is a positive-logic translation (H=1, L=0) of the NOR truth table, and also note that the function table is the negative-logic translation (H=0, L=1) of the NAND truth table, given in Example 1.

8-38. It should be noted that one can easily convert from the symbology of positive-logic merely by substituting a polarity indicator [◺] for each negative indicator [○] while leaving the distinctive shape alone. To convert from the symbology of negative-logic, a polarity indication [◺] is substituted for each negation indicator [○] and the OR shape is substituted for the AND shape or vice versa.

8-39. It was shown that any device that can perform OR logic can also perform AND logic and vice versa. DeMorgan's transformation is illustrated in Example 1 through 7. The rules of the transformation are:

1. At each input or output having a negation [○] or polarity [◺] indicator, delete the indicator.
2. At each input or output not having an indicator, add a negation [○] or polarity [◺] indicator.
3. Substitute the AND symbol  for the OR symbol  or vice versa.

   These steps do not alter the assumed convention: positive-logic stays positive, negative-logic stays negative, and mixed-logic stays mixed.

8-40. The choice of symbols may be influenced by these considerations: (1) The operation being performed may best be understood as AND or OR. (2) In a function more complex than a basic gate, the inputs will usually be considered as inherently active high or active low (e.g., the J and K inputs of a J-K flip-flop are active high and active low, respectively). (3) In a chain of logic, understanding and the writing of logic equations are often facilitated if active low or negated outputs feed into active low or negated inputs.

8-41. Other Symbols


8-42. Additional symbols are required to depict complex logic diagrams, as follows:




Dynamic input activated by transition from a low level to a high level. The opposite transition has no effect at the output.




Dynamic input activated by transition from a high level to a low level. The opposite transition has no effect at the output.

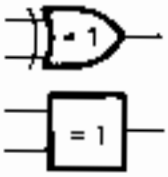

Exclusive OR function. The output will assume its indicated active level if and only if one and only one of the two inputs assumes its indicated active level.

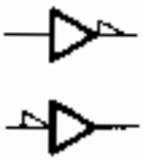

Inverting function. The output is low if the input is high and it is high if the input is low. The two symbols shown are equivalent.

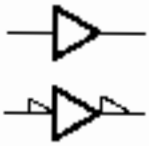


Noninverting function. The output is high if the input is high and it is low if the input is low. The two symbols shown are equivalent.



OUTPUT DELAY. The output signal is effective when the input signal returns to its opposite state.



EXTENDER. Indicates when a logic function increases (extends) the number of inputs to another logic function.



FLIP-FLOP. A binary sequential element with two stable states: a set (1) state and a reset (0) state. Outputs are shown in the 1 state when the flip-flop is set. In the reset state the outputs will be opposite to the set state.



RESET. A 1 input will reset the flip-flop. A return to 0 will cause no further effect.



SET. A 1 input will set the flip-flop. A return to 0 will cause no further action.



TOGGLE. A 1 input will cause the flip-flop to change state. A return to 0 will cause no further action.



J INPUT. Similar to the S input except if both J and K (see below) are at 1, the flip-flop changes state.



K INPUT. Similar to the R input (see above).



D INPUT (Data). Always dependent on another input (usually C). When the C and D inputs are at 1, the flip-flop will be set. When the Ct is 1 and the D is 0, the flip-flop will reset.




Address symbol has multiplexing relationship at inputs and demultiplexing relationship at outputs.

8-43. Dependency Notation "C" "G" "V" "F"

8-44. Dependency notation is a way to simplify symbols for complex IC elements by defining the existence of an AND relationship between inputs, or by the AND conditioning of an output by an input without actually showing all the elements and interconnections involved. The following examples use the letter "C" for control and "G" for gate. The dependent input is labeled with a number that is prefixed (e.g., 1X) or subscripted (e.g., X1). They both mean the same thing. The letter "V" is used to indicate an OR relationship between inputs or between inputs and outputs with this letter (V). The letter "F" indicates a connect-disconnect relationship. If the "F" (free dependency) inputs or outputs are active (1) the other usual normal conditions apply. If one or more of the "F" inputs are inactive (0), the related "F" output is disconnected from its normal output condition (it floats).




The input that controls or gates other inputs is labeled with a "C" or a "G", followed by an identifying number. The controlled or gated input or output is labeled with the same number. In this example, "1" is controlled by "G1".



When the controlled or gated input or output already has a functional label [X is used here], that label will be prefixed or subscripted by the identifying number.



If a particular device has only one gating, or control input then the identifying number may be eliminated and the relationship shown with a subscript.




If the input or output is affected by more than one gate or control input, then the identifying numbers of each gate or control input will appear in the prefix or subscript, separated by commas. In this example "X" is controlled by "G1" and "G2".

8-45. Control Blocks


8-46. A class of symbols for complex logic are called control blocks. Control blocks are used to show where common control signals are applied to a group of functionally separate units. Examples of types of control blocks follow.




Register control block. This symbol is used with an associated array of flip-flop symbols to provide a point of placement for common function lines, such as a common clear.

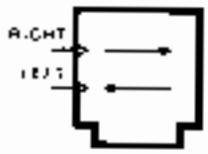


Shift register control block. These symbols are used with any array of flip-flop symbols to form a shift register. An active transition at the inputs causes left or right shifting as indicated.

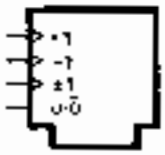

Counter control block. The symbol is used with an array of flip-flops or other circuits serving as a binary or decade counter. An active transition at the +1 or −1 input causes the counter to increment one count upward or downward, respectively. An active transition at the ±1 input causes the counter to increment one count upward or downward depending on the input at an up/down control.

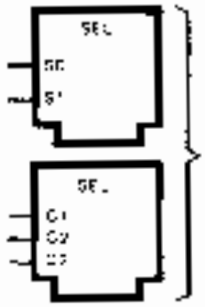

Selector control block. These symbols are used with an array of OR symbols to provide a point of placement for selection (S) or gating (G) lines. The selection lines enable the input designated 0, 1, ... n of each OR function by means of a binary code where S0 is the least significant digit. If the 1 level of these lines is low, polarity indicators (▷) will be used. The gating lines have an AND relation with the respective input of each OR function: G1 with the inputs numbered 1, G2 with the inputs numbered 2, and so forth. If the enabling levels of these lines is low, polarity indicators (▷) will be used.

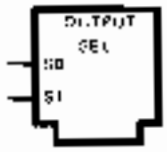

Output selector control block. This symbol is used with a block symbol having multiple outputs to form a decoder. The selection lines enable the output designated 0, 1, ... n of each block by means of a binary code where S0 is the least significant digit. If the 1 level of these lines is low, polarity indicators (▷) will be used.

8-47. Complex Logic Devices

8-48. Logic elements can be combined to produce complex devices that can perform more difficult functions. A control block symbol can be used to simplify understanding of many complex devices. Several examples of complex devices are given here. These examples are typical of the symbols used in schematic diagrams in this manual.

Reference Designation

5508A


A1U3, A3U22, A3U23,
A3U29, A3U30,
A3U54, A3U56

5519A

A3U3

Part Number

1820-1112
SN74LS74N

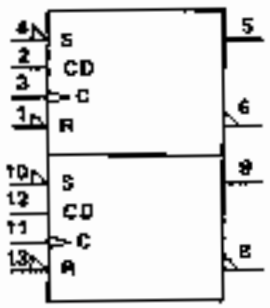

Description. The dual D-type flip-flop consists of two independent D-type flip-flops. The information present at the data (D) input is transferred to the active-high and active-low outputs on a low-to-high transition of the clock (C) input. The data input is then locked out and the outputs do not change again until the next low-to-high transition of the clock input. The set (S) and reset (R) inputs override all other input conditions: when (S) is low, the active-high output is forced high; when reset (R) is low, the active-high output is forced low. Although normally the active-low output is the complement of the active-high output, simultaneous low inputs at the set and reset will force both the active-low and active-high outputs to go high at the same time on some D-type flip-flops. This condition will exist only for the length of time that both set and reset inputs are held low. The flip-flop will return to some indeterminate state when both the set and reset inputs are returned to the high state.


Reference Designation

5508A

A2U10, A2U19, A2U21, A3U27, U5?

Part Number

1820-1216

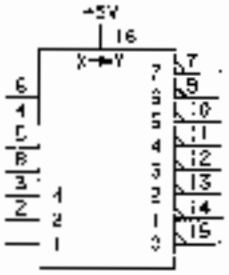

Description: The decoder/demultiplexer decodes one-of-eight lines dependent on the conditions at the three binary select inputs and the three enable inputs. The enable inputs consist of two active-low and one active-high. The function table is as follows:

FUNCTION TABLE

INPUTS (PINS)					OUTPUT (PINS)							
ENABLE		SELECT										
6	4,5	3	2	1	15	14	13	12	11	10	9	7
X	H	X	X	X	H	H	H	H	H	H	H	H
L	X	X	X	X	H	H	H	H	H	H	H	H
H	L	L	L	L	L	H	H	H	H	H	H	H
H	L	L	L	H	H	L	H	H	H	H	H	H
H	L	L	H	L	H	H	L	H	H	H	H	H
H	L	L	H	H	H	H	H	L	H	H	H	H
H	L	H	L	L	H	H	H	H	L	H	H	H
H	L	H	L	H	H	H	H	H	H	L	H	H
H	L	H	H	L	H	H	H	H	H	H	L	H
H	L	H	H	H	H	H	H	H	H	H	H	L

H = high level, L = low level, X = irrelevant

Reference Designation


5508A

A3U32

Part Number

1820-1423

74LS123

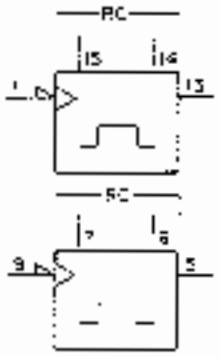

Description: This integrated circuit contains dual retriggerable monostable multivibrators. These are dc triggered multivibrators whose output pulse width can be controlled by three methods. The basic pulse time is programmed by selection of external R and C values. Once triggered, the basic pulse width may be extended by retriggering and gated low-level-active or high-level-active inputs, or be reduced by use of the overriding clear.


Reference Designation

5508A

A3U1, A3U2, A3U8,
A3U40, A3U45, A3U46

Part Number

1820-1430
SN74LS161

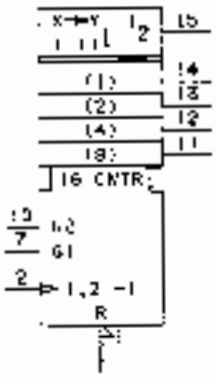

Description: This IC is a 4-bit binary synchronous counter with direct clear. Synchronous operation is provided by having all flip-flops clocked simultaneously so that the outputs change coincident with each other when so instructed by the count enable inputs and internal gating. A buffered clock input triggers the four flip-flops on the rising (positive-going) edge of the clock input waveform. The counters are fully programmable; that is, the outputs may be preset to either level. The clear function is asynchronous and a low level at the clear input sets all four f/f outputs low regardless of the other inputs.


Reference Designation

5508A

A3U7, A3U13, A3U33, A3U39

Part Number

1820-1997
74LS374

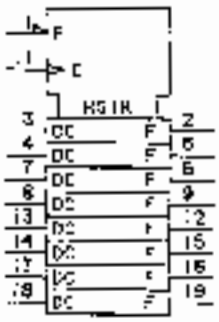

Description: This IC is an 8-bit D-type flip-flop. Information present at the DC inputs is transferred to the F outputs on the positive going edge of the clock (pin 11). A LOW at RESET (pin 1) will reset the flip-flops and all outputs (pins 2, 5, 6, 9, 12, 15, 16, 19) will be low.

Reference Designation


5518A

A3U4

Part Number

1820-2078

SN74LS490

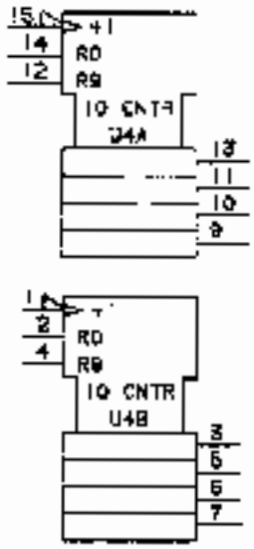

Description: This IC is a dual 4-bit decade counter consisting of eight master-slave flip-flops. Each counter has individual clock, clear, and set-to-nine inputs. A high to the clear input resets all four outputs low. A high input to set-to-nine sets QA and QD high, QB and QC low. The function tables are shown as follows:

BCD
COUNT SEQUENCE
(EACH COUNTER)

COUNT	OUTPUT (PINS)			
	7	6	5	3
0	L	L	L	L
1	L	L	L	H
2	L	L	H	L
3	L	L	H	H
4	L	H	L	L
5	L	H	L	H
6	L	H	H	L
7	L	H	H	H
8	H	L	L	L
9	H	L	L	H

CLEAR/SET-TO-9
FUNCTION TABLE
(EACH COUNTER)

INPUT (PINS)		OUTPUT (PINS)			
2	4	3	5	6	7
H	L	L	L	L	L
L	H	L	L	L	H
L	L	COUNT			


H = high level, L = low level

Reference Designation

5505A

A1U7, A2U74

Part Number
1820-2102
SN74LS373

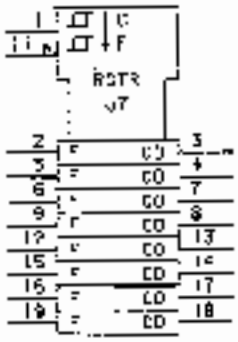

Description: This IC contains 8 D-Type latches and edge-triggered flip-flops. On the positive transition of the clock, the outputs will be set to the logic states that were setup at the inputs. The outputs are three state with the third state providing a high impedance output. The eight latches are transparent D-type latches meaning that while the enable (pin 11) is high, the outputs will follow the data inputs. When the enable is taken low, the output will be latched at the level of the data that was setup. The function table is as follows:

FUNCTION TABLE

OUTPUT CONTROL PIN 1	ENABLE G PIN 11	INPUT	OUTPUT
L	H	H	H
L	H	L	L
L	L	X	Q_0
H	X	X	Z

X = irrelevant

Q_0 = level of Q before the indicated steady-state input conditions were established.

Z = off (high-impedance) state of a 3-state output.

SECTION VIII-A
5528A LASER MEASUREMENT SYSTEM

	Page
5528A Block Diagram Description	8-A-1
5518A Laser Head	8-A-1
5508A Measurement Display	8-A-2
Compensation Number	8-A-2
Power-Up Self Test and Warm-Up Countdown	8-A-3
Beam Strength Signal	8-A-3
Basic Measurement Technique	8-A-3
Smoothing	8-A-4
System Troubleshooting	8-A-5
Signal Connection and Indicator Diagram	8-A-5
Troubleshooting Tables	8-A-5
Indicators	8-A-5
5508A Internal Indications	8-A-6
5508A External Indicator Conditions	8-A-6
5518A Indicator Conditions	8-A-7
Error Messages	8-A-8
10751A/B and 10757A/B/C Sensor Errors	8-A-13
10751A/B and 10757A/B/C Signal Characteristics	8-A-13
Temperature Measurements	8-A-13
Pressure Measurements	8-A-13
Humidity Switch	8-A-13
Unused 10757A/B/C and 10751A/B Connectors	8-A-13
5508A Keyboard and Front Panel Display	8-A-13
Power-Up Failures	8-A-14
No Laser Light	8-A-14
5508A Isolation	8-A-14
Beam Strength Meter Test	8-A-15
5518A Isolation	8-A-15
Straightness Measurements	8-A-15
Linear Measurements	8-A-15
Angular/Flatness Measurements	8-A-16
10751A/B Isolation	8-A-16
10757A/B/C Isolation	8-A-17
Power Supply Troubleshooting	8-A-17
5508A Primary Power	8-A-18
5518A Power	8-A-18
Instrument Current Requirements	8-A-18
Connectors and Cables	8-A-19
5508A Connectors	8-A-19
Remote Control Connectors Pinouts	8-A-19
Laser Source Connector Pinouts	8-A-20
Air Sensor Connector Pinouts	8-A-21
Material Temperature Connector Pinouts	8-A-21
Signal Connection and Indicator Diagram	8-A-23
5528A System Block Diagram	8-A-25

SECTION VIII-A
5528A LASER MEASUREMENT SYSTEM

8-A-1. 5528A BLOCK DIAGRAM DESCRIPTION

8-A-2. Introduction

8-A-3. Following is an overall block diagram description of the Laser Measurement System. This describes the instruments on an overall basis in order to provide an understanding of the major functions. Detailed block diagram descriptions for the 5508A Measurement Display and the 5518A Laser Head are provided in Sections 8-B and 8-C, respectively.

8-A-4. Figure 8-A-4, the 5528A Block Diagram, shows the overall block diagram of the system. The system consists of the 5508A Measurement Display, 5518A Laser Head, 10751A/B Air Sensor, 10757A/B/C Material Temperature Sensor, and Measurement Optics used for making various measurements. The Measurement Optics for distance measurement are shown in Figure 8-A-4. One 10765A Linear Interferometer and two 10707A Retroreflector are required for distance measurements.

8-A-5. 5518A Laser Head

8-A-6. The 5518A consists of a laser assembly, laser tuning control circuits, a beam sampler assembly, a high voltage power supply, the reference frequency receiver and the measurement frequency receiver. The Laser Assembly outputs two laser frequencies, F1 and F2, which differ in frequency by 1.5 to 2.0 MHz. Each frequency is output as polarized light. F1 and F2 are linearly polarized and their polarizations are perpendicular to each other as shown in Figure 8-A-4.

8-A-7. The Sampler Assembly samples some of the laser output in order to monitor laser tuning and to generate the Reference Frequency Signal. For laser tuning control, some of the sample is directed onto a photodiode in the tuning control circuitry. The photodiode response current is proportional to the power in each laser frequency depending on which frequency is passed by an optical switch. A liquid crystal and a polarizer in the sampler assembly form the switch. The switch has two states which are alternately enabled. Each state allows one of the frequencies to pass onto the photodiode. A subtractive sample and hold circuit generates an error signal that is proportional to any difference in optical power. The error signal is used to control the laser assembly such that the power in each laser frequency is equalized.

8-A-8. The Sampler Assembly also directs some of the laser beam onto another photodiode. This photodiode is part of the Reference Receiver. The reference receiver photodiode uses a polarizer that is oriented at 45 degrees to both laser beam polarizations. The optical power that is passed by this polarizer varies sinusoidally at the difference frequency between F2 and F1. The reference receiver converts this optical power and generates the Reference Frequency, a TTL squarewave of frequency, F2-F1.

8-A-9. The Measurement Receiver works like the reference receiver. The measurement receiver detects the difference frequency after the laser frequencies pass through the Measurement Optics and return to the 5518A.

8-A-10. Laser Warm-Up Period. A warm-up period is required to bring the laser assembly to an initial operating temperature. When power is first applied, the measurement and reference receivers are disabled and a glass rod within the laser assembly is heated. After the warm-up period, the tuning control circuitry begins the optical power measurements. At this point the 5518A rear panel indicator READY will be blinking. After the power difference between F2 and F1 has been maintained at zero, the READY indicator stops blinking and illuminates. At this point the measurement and reference receivers are enabled and a measurement can be performed.

8-A-11. 5508A Measurement Display

8-A-12. The 5508A consists of two frequency multipliers, two pulse converters, analog to digital converter circuitry, a processor, a front panel keyboard and display, and power supplies.

8-A-13. The frequency multipliers are phase-locked loop circuits that multiply the input frequencies by 16 in order to extend the resolution of the laser measurement. The measurement and reference pulse counters record any change in frequency between the measurement and reference frequency signals. Whenever the measurement frequency changes relative to the reference frequency, the pulse counters accumulate a difference in count. The measurement frequency changes whenever the measurement optics move relative to each other. The 5508A processor weights the pulse difference according to the measurement mode and units before displaying the measurement. For the weight (value) of each count in straightness or angular measurements, the 5508A uses constants stored in read only memory. For a distance measurement, however, the 5508A requires a constant and the compensation number.*

8-A-14. The Processor controls the sequence of operations according to the measurement mode selected. This includes transfer and routing of data, calculations, and display functions. The processor determines the difference count by subtracting the contents of the two pulse counters. When either counter is half full it interrupts the processor which then reads the value of each counter, resets them, and stores the difference count. Each successive pulse difference that is detected is added to previous difference counts in read/write memory.

8-A-15. The Keyboard-Display allows the operator to select measurement modes and parameter values. It also has provisions for reset and record functions. The display is an all numeric, LED readout consisting of nine and a half digits plus a sign indicator.

8-A-16. The HP-IB circuits allow the 5508A to be interfaced with an external controller or recording device. Data may be either input or output via the interface bus. The 5508A allows all front panel keyboard functions to be programmed via HP-IB.

8-A-17. The Remote Control Unit allows the display to be reset from a remote location. Provision is also made to remotely select the record function to output data to calculators, plotters, and displays.

8-A-18. Compensation Number

8-A-19. The compensation number has two factors. A factor that compensates for the speed of light in air and a factor that compensates for material expansion. Both factors can be determined automatically or manually. For manual velocity of light compensation, the operator can enter the V.O.L. compensation number using the [↔] key. For material expansion compensation, the operator can enter an expansion coefficient and an average material temperature value. For automatic compensation, the 10751A/B Air Sensor and up to three 10752A/B/C Material Temperature Sensors are used. The 5508A derives the compensation factors directly from the sensor measurements and the manually entered expansion coefficient.

8-A-20. The 10751A Air Sensor measures air temperature and pressure, and has provision for manually indicating 25%, 50% or 75% relative humidity. The Air Sensor outputs connect to an analog to digital converter in the 5508A where the measurement data is digitized for use by the processor.

*It is possible to use compensation in straightness measurements but this is not necessary.

8-A-21 Up to three 10757A/B/C Material Temperature Sensors can be used to sense the temperature of the workpiece. This information is also sent to the analog-to-digital converter to be alternately sampled with the air compensation data for use by the processor. The Material Temperature Sensor measurements are used by the 5508A only when an expansion coefficient other than zero is entered by the operator. Material expansion compensation is used to reference distance measurements to 20°C (68°F). When material expansion compensation is used, the distance measurement is displayed to show the true value as it would be if the material were at a constant 20°C. When more than one Material Temperature Sensor is used the 5508A calculates an average temperature — no consideration is made for thermal gradients. Therefore, extreme variations in temperature over the workpiece should be avoided.

8-A-22 If a distance measurement were performed on a material at 20°C in a perfect vacuum, the only weighting required would be to multiply the pulse difference by the appropriate fraction of the laser wavelength. Each pulse would be 1/32 of the wavelength in vacuum (the wavelength in vacuum is a known constant). However, the wavelength of light when it travels through air depends on its velocity in air. This in turn is dependent upon air temperature, pressure, and relative humidity. The 5508A calculates the V.O.L. compensation factor from the 10751A/B measurements in order to correct for true wavelength in air.

8-A-23. Power-Up Self Test and Warm-Up Countdown

8-A-24. The 5508A extensively tests internal circuitry during the Power-Up Self Test. After the 5508A executes the self test, it begins a ten minute countdown. The countdown is interrupted when the 5518A enables its output signals. If all three 5518A signals are present, the 5508A displays LASER UP. If Measurement Optics are not aligned, then only REFERENCE FREQUENCY will be present and PA Error will be displayed. The Power-Up Self Test is described in Section III and IV.

8-A-25. Beam Strength Signal

8-A-26. BEAM STRENGTH is a signal that is proportional to the strength of the Measurement Frequency Signal at the photodiode in the Measurement Receiver. When the 5518A is ready for use, BEAM STRENGTH, MEASUREMENT FREQUENCY and REFERENCE FREQUENCY are enabled.

8-A-27. Basic Measurement Technique

8-A-28. The theory of operation is described below in terms of distance measurements. Variations in the theory of operation for angular and straightness measurements is due to the difference in the function of the Measurement Optics. Angular and straightness optics theory is discussed in Section 8-E, Optics.

8-A-29. The configuration of the Measurement Optics for a distance measurement is shown in Figure 8-A-1, Distance Measurement Set-up.

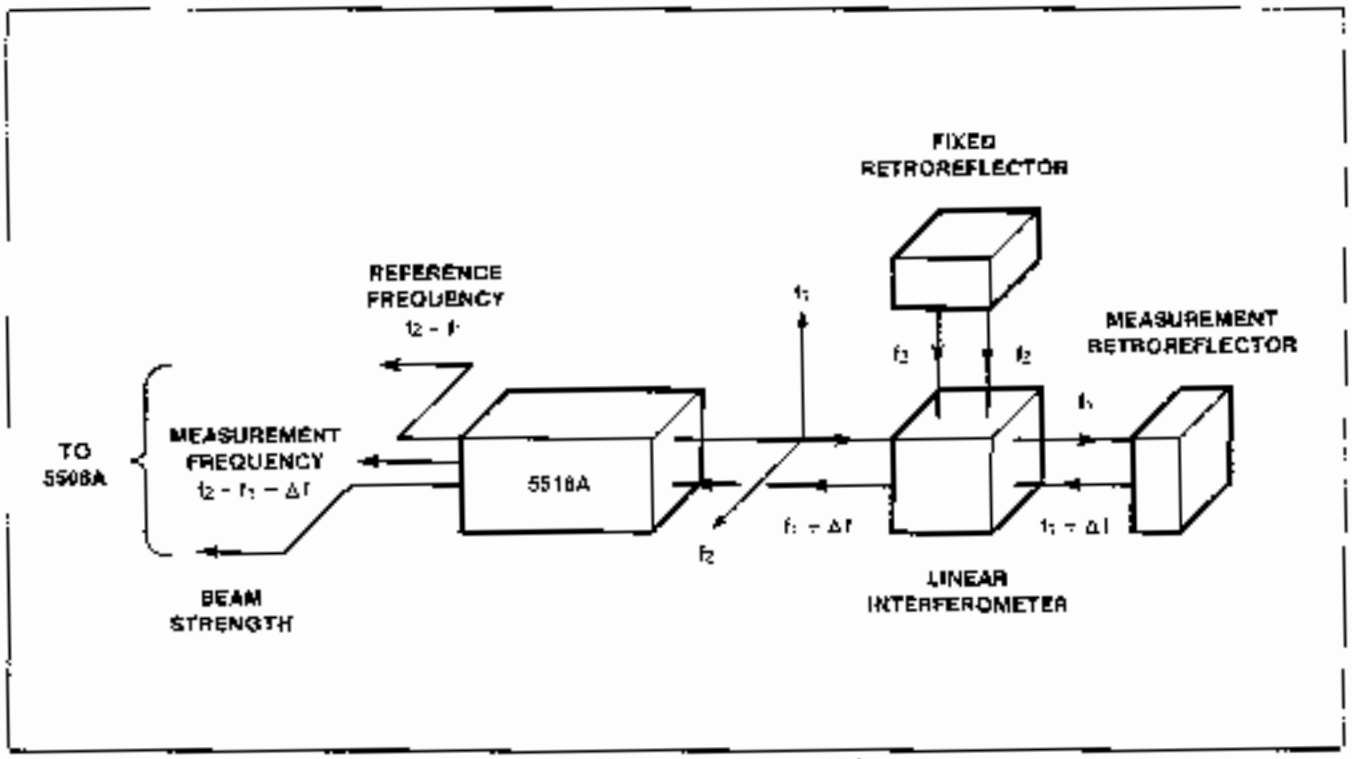


Figure 8-A-1. Distance Measurement Set-up

8-A-30. As shown in Figure 8-A-1 the Linear Interferometer is configured with a fixed Retroreflector and a moveable (measurement) Retroreflector. The Interferometer is a polarizing beamsplitter that reflects one polarization (frequency) and transmits the other. The beamsplitter is oriented such that the reflected and transmitted beams are at right angles to each other. If the Measurement Retroreflector is also fixed at a constant distance, the phase relationship of F2 and F1 where they recombine at the beam splitter varies sinusoidally at the difference frequency, F2-F1. Under this condition the pulse counters in the 5508A accumulate no difference count because the measurement frequency equals the reference frequency. When the Measurement Retroreflector moves with respect to the beam splitter the phase relationship between F2 and F1 will change. The measurement frequency will now have instantaneous frequency changes (delta F), caused by changes in phase of F1. Referring to Figure 8-A-1, the phase of F1 where it recombines at the beamsplitter depends on the wavelength of F1 and the number of wavelengths in the measurement path. Changes in the distance of the measurement path are therefore recorded as phase modulation of F1. Phase modulation causes the measurement pulse counter to lead or follow the reference pulse counter depending on the direction of movement. The 5508A accumulates a count difference between the two pulse counters whenever the measurement frequency is modulated. The difference is proportional to travel and is converted to distance units for display. The conversion factors are the compensation number and a units factor (inches or millimetres).

8-A-31. Smoothing

8-A-32. When smoothing is enabled, the 5508A display is not updated immediately after a pulse count difference is detected. Instead increments of the latest difference count are added to the total display value a fraction at a time. This smoothes out display jitter due to vibration. The smoothing function can be defeated using the [SMO] key. The 5508A accumulates a count difference between the two pulse counters whenever the measurement frequency is modulated. The difference is proportional to travel and is converted to distance units for display. The conversion factors are the compensation number and a units factor (inches or millimetres).

8-A-33. SYSTEM TROUBLESHOOTING

8-A-34. Introduction

8-A-35 Information is summarized in the following paragraphs to help identify system failures. Some failures will have several symptoms. Observation of these symptoms with knowledge of the system functions will frequently provide enough indication to begin troubleshooting a particular instrument. Block diagram descriptions provide the background necessary for effective troubleshooting. The 5508A and 5518A block diagram descriptions provide useful theory of operation details beyond the 5528A Block Diagram description.

8-A-36. The Instrument Isolation Procedures in this section are provided to help verify operation of individual instruments in the system. In general, the Isolation Procedures and other troubleshooting information in this section should be used before consulting the Instrument Troubleshooting and Repair Procedures in Section 8-B, 8-C, 8-D, and 8-E.

8-A-37. Signal Connection and Indicator Diagram

8-A-38 Figure 8-A-3 shows the electrical locations of the major circuit functions, LED indicators, switches and power supplies in the 5528A system. All P.C. board edge and pin connector designations for the major electrical signals are provided in the figure. This figure can be used when tracing signal paths during troubleshooting. Note that MEASUREMENT FREQUENCY, REFERENCE FREQUENCY and BEAM STRENGTH SIGNALS are enabled only when the laser tuning is stabilized following the warm-up period.

8-A-39. Troubleshooting Tables

8-A-40. Indicator conditions and error messages are tabulated and can be used to identify causes and locations of failures. Tables 8-A-2 and 8-A-3 list causes and possible failure locations for the described indicator conditions. Table 8-A-5, Error Messages lists causes and possible failure locations for the 5508A error messages. Comparison of simultaneous indications and error messages will help to rapidly narrow down trouble when possible failure locations are common to each tabulated indication and error message. The possible failure locations are listed beneath the cause entries in the tables. They are listed in descending order according to difficulty of troubleshooting required. Related troubleshooting procedures are listed adjacent to failure locations to which they apply. In general, the system power supplies and proper user operation should be verified when first troubleshooting any problem.

8-A-41. Indicators

8-A-42 External indicators are provided on the 5518A and 5508A to indicate normal operation and to help identify the nature of system failures. The Indicator Conditions Tables, Table 8-A-2 and Table 8-A-3, summarize indicator conditions for various failures. The tables should be used with knowledge of the indicator functions. In particular, the READY indicator has three states (off, blinking on and on) to indicate 5518A laser tuning status. Indicator functions are summarized at the end of the 5508A and 5518A Block Diagram Descriptions.

8-A-43 The 5508A also has internal indicators. These indicators can be accessed by removing the 5508A top cover. Loosen the pozidrive screw on the rear of the top cover and slide the cover rearward. Assemblies A1 and A2 are hinge-mounted to the chassis. The hinges allow inspection of the interior of the instrument. A1 and A2 can be separated according to instructions provided on A1. See Figure 8-B-2, 5508A Assembly and Cable Designations.

Table 8-A-1. 5508A Internal Indications

5508A Internal Indicator	Assembly/Schematic Location	Function
"MEAS LOL" LED	A3	When lighted, indicates Measurement Frequency Signal problem has occurred
"REF LOL" LED	A3	When lighted, indicates Reference Frequency Signal problem has occurred
"+5" LED	A5	Supply Indicator
"+15" LED	A5	Supply Indicator
"-15" LED	A5	Supply Indicator
"+15 HEAD" LED	A5	Supply Indicator

Table 8-A-2. 5508A External Indicator Conditions

Indicator Condition/Related Indicator	Cause: Possible Failure Location	Troubleshooting
BEAM STRENGTH: Meter reads zero/READY indicator is lighted, but SIGNAL indicator is extinguished	**Measurement receiver not receiving sufficient laser measurement signal:**	
	Laser beam attenuator	Check operating environment for air temperature gradients or smoke near the path of the laser beam.
	Turret not configured properly	5518A Isolation (Para 8-A-70)
	Measurement Optics, misalignment	5518A Isolation (Para 8-A-70)
	Measurement Optics, beam attenuation	Section III: Optics Cleaning
	Measurement Optics, broken	5518A Isolation (Para 8-A-70)
	Turret assembly not functioning properly	5518A Isolation
	Measurement Receiver failure	5518A Isolation (Para 8-A-70)
Meter reads zero/READY and SIGNAL indicators are lighted	Beam strength signal failure	5508A Isolation (Para 8-A-65)
LASER ON Extinguished	+5V Supply failure	Power Supply Troubleshooting Procedures (Para 8-A-33)

Table 8-A-3. 5518A Indicator Conditions

Indicator: Condition/Related Indicator	Cause: Possible Failure Location	Troubleshooting
LASER ON: Indicator extinguished	**+15V (Head) supply failure:**	
	5506A power supplies and fuses	Power Supplies Troubleshooting (Para 8-A-83)
	5516A power distribution or fuse	Power Supplies Troubleshooting (Para 8-A-83)
READY: Indicator extinguishes during a measurement and begins to blink	**Reference Frequency Signal dropout:**	
	5518A Reference Receiver failure	5518A Trouble Isolation Procedures (Para 8-C-43)
	5518A Laser Assembly tuning failure	5518A Trouble Isolation Procedures (Para 8-C-43)
	Electromagnetic interference in operating environment	5518A Isolation (Para 8-A-70)
		5518A Trouble Isolation Procedures (Para 8-C-43)
READY: Indicator blinks within 5 minutes after power-up, blinks for less than 3 minutes, goes off, then repeats cycle	**5518A failure:**	
	5518A Laser Assembly tuning failure	5518A Trouble Isolation Procedures (Para 8-C-43)
READY: Indicator takes longer than 5 minutes from power-up to start blinking	**5518A failure:**	
	5518A Laser Assembly tuning failure	5518A Trouble Isolation Procedures (Para 8-C-43)
SIGNAL: Indicator does not light when measurement optics are positioned/READY indicates normal operation.	**Measurement Receiver not receiving sufficient laser measurement signal:**	
	Laser beam attenuation	Check operating environment for air temperature gradients or smoke in the path of the laser beam
	Turret not configured properly	5518A Isolation (Para 8-A-70)
	Measurement Optics, misalignment	5518A Isolation (Para 8-A-70)
	Measurement Optics, beam attenuation	Section III: Optics Cleaning
	Measurement Optics, broken	5518A Isolation (Para 8-A-70)
	Turret assembly not functioning properly	5518A Isolation (Para 8-A-70
	Measurement Receiver failure	5518A Isolation (Para 8-A-70)

8-A-44. Error Messages

8-A-45. Error messages are displayed by the 5508A that identify measurement errors, operator errors, and certain hardware failures. The error messages are assigned priority by the 5508A. If error conditions occur simultaneously, only the highest priority error message will be displayed. If error conditions are temporary or intermittent, the error message can be cleared by pressing front panel keys. Hd Error, PA Error, and SL Error can only be cleared by the RESET key (pressing RESET also causes loss of laser measurement data). All other error messages can be cleared by pressing any front panel key. Error messages will reappear on the display if error conditions are not corrected. After the highest priority error message has been cleared, the 5508A will display lower priority error messages if conditions remain.

Table 8-A-4. 5508A Error Message Priority

Hd Error
PA Error
SL Error
Lr Error
Sr Error
P1 Error
P2 Error
P3 Error
AE Error
AP Error
A-H Error

8-A-46. The following error messages should only appear on the 5508A display in response to keyboard operation. Key descriptions and the Operator's Check are located in Section III.

Error Message	Associated Front Panel Key
A Error	
C Error	
Or Error	All SETUP keys
Ur Error	All SETUP keys

8-A-47. Error messages, causes and possible failure locations are listed in Table 8-A-5 Error Messages. Indicators whose condition may help verify failure locations are listed adjacent to the possible failure locations to which they apply.

Table 8-A-3. Error Messages

Error Message	Condition	Cause: Possible Fault Location	Troubleshooting
A Error	Material temperature average error	This error can be displayed only by pressing the MATL TEMP key	
		One of the material temperature signals has exceeded ±1V range of 5508A A to D converter subsystem	10757A Isolation (Para 8-A-81)
AE Error	Air Sensor temperature signal error	Air temperature signal has exceeded ±1V range of 5508A A to D converter subsystem	10751 Isolation (Para 8-A-79)
AH Error	Air Sensor humidity signal error	Humidity switch signal has exceeded ±1V range of 5508A A to D converter subsystem	10751 Isolation (Para 8-A-79)
AP Error	Air Sensor pressure signal error	Air pressure signal has exceeded ±1V range of 5508A A to D converter subsystem	10751 Isolation (Para 8-A-79)
C Error	Compensation error (due to an Air Sensor error)	This error can be displayed only by pressing V C L key	Section III: V.C.L. Key Description
		One of the three signals from the 10751 has exceeded ±1V range of 5508A A to D Converter Subsystem	10751 Isolation (Para 8-A-79)
FAIL 1	Failed part of 5508A power-up self test	Power-up self test failure:	
		Reference Frequency Channel failure (P/O 5508A A3)	5508A Isolation (Para 8-A-65)
			5508A Trouble Isolation Procedures (Para 8-B-14)
FAIL 2	Failed part of 5508A power-up self test	Power-up self test failure.	
		Measurement Frequency Channel failure (P/O 5508A A3)	5508A Isolation (Para 8-A-65)
			5508A Trouble Isolation Procedures (Para 8-B-14)
FAIL 3	Failed part of 5508A power-up self test	Power-up self test failure:	
		Measurement Frequency Pulse Counter or Counter Control Failure (P/O 5508 A3)	5508A Trouble Isolation Procedures (Para 8-B-14)

Table 8-A-5. Error Messages (Continued)

Error Message	Condition	Cause: Possible Fault Location	Troubleshooting
FAIL 4	Failed part of 5508A power-up self test	Power-up self test failure: A to D Converter Subsystem failure (P/O 5508A A3)	5508A Trouble Isolation Procedures (Para 8-B-14)
Hd Error	Laser Head error	Instability or dropout of the Reference Frequency Signal at 5508A A3 Counter Board:	
READY: Indicator extinguished or blinking		5518A Laser Assembly tuning failure	Power Supplies Troubleshooting (Para 8-A-83) 5518A Trouble Isolation Procedures (Para 8-C-43)
READY: Indicator stays on		5508A Reference Frequency Channel failure (P/O 5508A A3)	5508A Isolation (Para 8-A-65) 5508A Trouble Isolation Procedures (Para 8-B-14)
READY: Indicator stays on		5518A Reference Receiver picking up noise or electro-magnetic interference in operating environment	5518A Isolation (Para 8-A-70)
LASr FAIL	Flashes instead of LASer UP when 5518A is not yet ready for operation at the end of the warmup countdown	Reference Frequency signal not reaching 5508A Counter circuits	
5518A LASER ON: Indicator extinguished		5518A Power failure	Power Supply Troubleshooting (Para 8-A-83)
READY: Indicator lighted and SIGNAL: Indicator lights with optics aligned		5508A A3 Counter Board failure	5508A Isolation (Para 8-A-65)
READY: Indicator extinguished or blinking		5518A Laser Assembly tuning failure	5518A Trouble Isolation Procedures (Para 8-C-43)
READY: Indicator extinguished or blinking		5518A Reference Receiver failure	5518A Trouble Isolation Procedures (Para 8-C-43)

Table 8-A-3 Error Messages (Continued)

Error Message	Condition	Cause: Possible Fault Location	Troubleshooting
Lr Error	Listener too slow (HP-IB problem)	Improper user operation of HP-IB:	
		AUTORECORD key	Section III: Key Description and Operators Check
		RECORD Key	Section III: Key Description and Operators Check
		Slow HP-IB listener	Section III: Key Description and Operators Check
		5508A HP-IB subsystem failure	5508A Trouble Isolation Procedures (Para 8-B-14)
Or Error	Overrange error. Parameter value is larger than range permits.	Improper user operation of one of the ENTRY keys	Section III: Key Descriptions and Operators Check
P1 Error	Material Temperature Sensor No. 1 error	Material Temperature Sensor No. 1 signal has exceeded ±1V range of 5508A A to D converter subsystem	10757 Isolation (Para 8-A-81)
P2 Error	Material Temperature Sensor No. 2 error	Material Temperature Sensor No. 2 signal has exceeded ±1V range of 5508A A to D converter subsystem	10757 Isolation (Para 8-A-81)
P3 Error	Material Temperature Sensor No. 3 error	Material Temperature Sensor No. 3 signal has exceeded ±1V range of 5508A A to D converter subsystem	10757 Isolation (Para 8-A-81)
PA Error	Beam path error	Signal error detected at Measurement Frequency Pulse Counter (P/O 5508A A3):	
SIGNAL: Indicator extinguished		Laser Beam attenuation	Check operating environment for temperature gradients or smoke in the path of the laser beam.
SIGNAL: Indicator extinguished		Measurement Optics, misalignment	5518A Isolation (Para 8-A-70)
SIGNAL: Indicator extinguished		Measurement Optics, beam attenuation	Section III Optics Cleaning
SIGNAL: Indicator extinguished		Signal attenuation in laser measurement path	5518A Isolation (Para 8-A-70)
SIGNAL: Indicator extinguished		Measurement Optics, broken	5518A Isolation (Para 8-A-70)
SIGNAL: Indicator extinguished		Turret assembly not functioning properly	5518A Isolation (Para 8-A-70)

Table 8-A-5. Error Messages (Continued)

Error Message	Condition	Cause: Possible Fault Location	Troubleshooting
PA Error (Cont'd) SIGNAL: Indicator extinguished SIGNAL: Indicator lighted		5518A Measurement Receiver failure 5508A Measurement Frequency Channel failure	5518A Isolation (Para 8-A-70) 5508A Isolation (Para 8-A-65) 5508A Trouble Isolation Procedures (Para 8-B-14)
Pr Error	Programming error (check user software in HP-IB controller).	Improper instruction received over HP-IB; HP-IB controller software	Section III: HP-IB information
SL Error SIGNAL: Indicator lighted (may flicker) SIGNAL: Indicator extinguished SIGNAL: Indicator lighted	Signal loss error	Signal Error detected at Measurement Frequency Receiver: Excessive velocity or acceleration of measurement optics 5518 Measurement Receiver failure 5508A Measurement Frequency Channel (P/O A3) failure	5518A Isolation (Para 8-A-70) 5518A Isolation (Para 8-A-70) 5518 Trouble Isolation Procedures (Para 8-C-43) 5508A Isolation 5508A Troubleshooting and Repair Procedures (Para 8-B-14)
Sr Error	Sample rate too high	Output data is being requested at a rate that is too fast for the 5508A; HP-IB controller software	
SS Error	Failed part of 5508A power-up self test	Power-Up self test failure; 5508A ROM or READ/WRITE Memory Failure	5508A Isolation (Para 8-A-65) 5508A Trouble Isolation Procedures (Para 8-B-14)
Ur Error	Underrange error. Parameter value is smaller than range permits.	Improper use of one of the ENTRY keys	Section III: Key Descriptions and Operators Check

8-A-48. 10751A/B and 10757A/B/C Sensor Errors

8-A-49. The electrical failures that can cause measurement inaccuracies without causing error messages or other indications are certain failures in the Air Sensor and Material Temperature Sensors or the 5508A A to D converter subsystem. Otherwise, operator considerations as discussed in the 5528A User's Guide determine system accuracy. Proper air sensor operation can be verified using the V.O.L. key. Proper 10757A/B/C operation can be verified using the MATL TEMP key. See Section III, **SPECIFICATIONS** for temperature and pressure measurements can only be verified as outlined in the calibration procedures of Section IV. See the Isolation Procedures in this section for initial troubleshooting.

8-A-50. 10751A/B and 10757A/B/C Signal Characteristics

8-A-51. Temperature Measurements

8-A-52. The 10751A/B and the 10757A/B/C provide a voltage signal that decreases linearly with increasing temperature. The voltage signal is bipolar and centered (0 volts) at approximately 25°C (77°F). An error message is displayed by the 5508A if a temperature signal exceeds the ±1V range of the Analog-to-Digital converter. The temperature measurements require +15V and -15V supplies and −10 Vref from the 5508A to generate the temperature signals. Note that the temperature sensors are calibrated for 0 to 40°C operation which does not require the full ±1 Volt range of the A to D.

8-A-53. Pressure Measurement

8-A-54. The 10751A/B also measures air pressure. The air pressure signal is also a D.C. Voltage that decreases linearly with increasing air pressure. An error message is displayed by the 5508A if the air pressure signals exceed ±1 Volt. +10 Vref is not used for the air pressure measurement, the 10751A/B pressure measurement requires only the +15V and -15V power supplies.

8-A-55. Humidity Switch

8-A-56. The humidity switch is used to send 1 of 3 voltages to the 5508A:

Switch Setting	Voltage
75%	0.7V (approx)
50%	0.0V
25%	-0.7V (approx)

8-A-57. Unused 10757A/B/C and 10751A/B Connectors

8-A-58. Connectors are provided on the rear panel for the 10757A/B/C and 10751A/B. When connectors are not used, the corresponding A to D input channels pull themselves up to approximately 2.5 Volts. Any input channel voltage greater than 1.6 Volts is interpreted by the 5505A as unused. The 10751A/B uses 3 input channels and each 10757A/B/C uses one. If any of the 3 10751A/B input channels is interpreted as unused, the 10751A/B is ignored by the 5508A.

8-A-59. 5508A Keyboard and Front Panel Display

8-A-60. Normal operation of the front panel keyboard and display can be verified according to the Key Descriptions and Operator's Check in Section II. The 5508A can be operated independent of the rest of the system for front panel checkout. See Paragraph 8-A-65, 5508A Isolation. The display uses 10 numeric display indicators and 5 red LED indicators which are all socket mounted. Bad indicators can be isolated by removing the front panel display filter and interchanging them.

8-A-61. Power-Up Failures

8-A-62. If the 5508A does not turn on properly as indicated by self test completion and warm-up countdown, repeat turn on after switching A.C. power off and removing all instrument cables from the rear panel connectors. Initial check information is provided in Paragraph 8-A-83, Power Supplies Troubleshooting to verify the power supplies. Also, check that A2S3 is set for normal operation as shown below:




8-A-63. No Laser Light

8-A-64. If laser light is not emitted from the 5518A within one minute of turn on, check for proper positioning of the straightness mount and exit shutter. Check the +15VH power supply according to Paragraph 8-A-83, Power Supply Troubleshooting. If the +15VH supply checks OK, see the Laser/High Voltage Troubleshooting Procedure in Section VIII-C.

8-A-65. 5508A Isolation

8-A-66. The 5508A can simulate measurement and reference frequency input signals to allow the instrument to be run without the 5518A Laser Head attached. This simulation mode can be used to isolate Measurement or Reference Frequency Signal problems. Measurement frequency signal problems (error message is PA Error or SL Error) can be caused by the the 5508A, 5518A, or the Measurement Optics. Reference Frequency Signal problems (error message is LASr FAIL or HD Error) can be caused by the 5516A or 5506A. The simulation mode is also useful for checking out 10751A/B or 10757A/B/C operation without the Laser Head attached to the 5508A. To run the 5508A in the laser simulation mode, loosen the Pozidrive screw on the rear of the top cover and slide the top cover rearward. Configure A2S3, TEST SWITCH, as shown below:

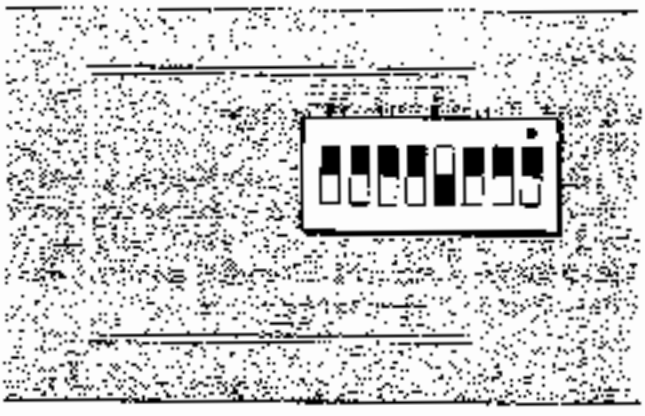

8-A-67 The 5508A reads the test switch value only at power-up. Alternatively, A2S2 (MASTER RESET), can be toggled to start the simulation mode after A2S3 has been set accordingly. In the laser simulation mode, the 5508A displays 0.0000 mm (or 0.00000 in), the BEAM STRENGTH meter reads zero and all front panel keys operate normally. To resume normal operation, reset the test switch to 00000000 and toggle MASTER RESET.

8-A-68. Beam Strength Meter Test

8-A-69 The beam strength meter and meter drive circuitry in the 5508A can also be tested in this mode. To perform the test connect a 5 k Ohm resistor between pin A (BEAM STRENGTH) of the LASER SOURCE connector, A4J8, and chassis ground. BEAM STRENGTH deflection should be approximately 50% when the resistor is connected. This test is an initial test for 5508A circuitry only. In order to verify the adjustment of the Beam Strength Signal the Laser Power Output Test and Receiver Gain Test in Section IV should be performed

8-A-70. 5518A Isolation

8-A-71. The 5518A Isolation Procedures are provided to help isolate problems encountered during a measurement. If the 5518A does not warm-up properly (error message is LASr FAIL) or a Reference Frequency Signal problem should occur (error message is Hd Error) the 5518A Troubleshooting and Repair Procedures in Section VIII-C will, generally be required.

8-A-72 Measurement errors (error message is PA Error or SL Error) can be caused by the 5518A, the 5508A, or the Measurement Optics. These errors can also be caused by improper use or application of the measurement system. The 5528A User's Guide should be used to verify proper operator procedures in cases of intermittent or occasional problems.

8-A-73. Straightness Measurements

8-A-74 To verify proper 5518A performance in STRAIGHTNESS mode, first check the turret assembly and the Measurement Optics:

a. Check that the 5518A Turret Assembly and Exit Shutter are configured properly for Straightness

b. Are the Measurement Optics properly aligned according to the 5528A User's Guide?

c. If the conditions in a. and b. are apparently satisfied and the Straightness Measurement cannot be performed, the 5518A can be isolated as follows:

   1. Perform the Laser Power Output Test in Section IV.

   2. Check the Measurement Receiver and Straightness Gain Switch with the following procedure. This procedure should be performed only after the Laser Power Output Test has been sucessfully completed.

      a. Set the 5518A Turret Assembly to STRAIGHTNESS. Position a 10775A Flatness Mirror at a maximum distance of 0 inches from the Turret Assembly. Align the return beam for maximum indication on the 5508A Beam Strength Meter.

      b Maximum indication should be approximately 90% full scale, if not, perform the Receiver Gain Test in Section IV in order to isolate between the Measurement Receiver and Straightness Gain Switch

8-A-75. Linear Measurements

8-A-76. The Laser Output Test and Receiver Gain Test in Section IV can be used to verify 5518A operation for linear measurements. The Laser Power Output Test should be performed before the Receiver Gain Test.

8-A-77. Angular/Flatness Measurements

8-A-78. 5518A operation can be verified for Angular/Flatness Measurements as described in paragraph 8-A-75, Linear Measurements. Also, proper system operation using Linear Measurement Optics, if available, can be used to isolate problems to the Angular Measurement Optics or their use.

8-A-79. 10751A/B Isolation

8-A-80. Air Sensor measurement failures can be isolated using the following procedure. Failures can be caused by either the 5508A or the 10751A/B. If the Air Sensor is attached to the 5508A and none of its measurements can be displayed using the V.O.L. key then one of the three signals (air temperature, air pressure, or relative humidity) has exceeded 1.7 Volts. Otherwise the faulty signal can be identified using the V.O.L. key. See the key description in Section III.

a. Disconnect the Air Sensor from the 5508A and verify the open connector resistances and voltages at the 5508A rear panel connectors according to Paragraph 8-A-91, Connectors and Cables.

b. If the connector checks out O.K., the failure is probably located in the 10751A/B.

c. For additional confidence in the 5508A Air Sensor connector and the three associated A to D converter input channels, perform the following. Note that this test does not verify the accuracy of the A to D converter to the level required by the system. It is only designed to isolate gross errors or failures. To verify A to D converter accuracy first calibrate the unit according to Section IV, then see the A to D accuracy test procedure in Section VIII if required.

   1. Ground pins A, G, and H of the Air Sensor connector on the 5508A rear panel.

   2. Set the English/Metric switch on the 5508A Rear Panel to Metric.

   3. Air Sensor data should be displayed by the 5508A in response to the V.O.L. key as follows:

Air Temperature	25.56°C ±0.4°C
Air Pressure	760.2 ±3.5 mm Hg
Relative Humidity	50%

NOTE

Good contact is required at the connector pins for this test. The connector pins are 0.04" in diameter and require a test probe of this size for the test. Alternatively the A to D converter input channels can be grounded at A3R56. See Figure 8-B-2, A3 Counter Board, Sheet 4.

8-A-81. 10757A/B/C Isolation

8-A-82. Material temperature measurement failures can be isolated using the following procedures. Failures can be caused by either the 5508A or the 10757A/B/C.

a. If a Material Temperature Sensor works on one but not all of the rear panel connectors, the failure is in the corresponding A to D converter input channel.

b. Disconnect the individual Material Temperature Sensors and verify the open connector resistances and voltages at the 5508A rear panel connector as described in Paragraph 8-A-91. Connectors and Cables.

c. If the connector pins check out and the sensor does not work properly on any of the Material Temperature Sensor connectors on the 5508A rear panel, the failure is probably located in the 10757A/B/C.

d. For additional confidence in the 5508A Material Temperature Sensor connectors and corresponding A to D converter input channels, perform the following test. Note that this test does not verify the accuracy of the A to D converter to the level required by the system. It is only designed to isolate gross errors or failures. To verify A to D converter accuracy first calibrate the unit according to Section IV, then see the A to D accuracy test procedure in Section VIII-B if required.

1. Ground pin F of the open connector in question. This simulates a temperature signal corresponding to approximately 25°C.

2. Set the English/Metric switch on the 5508A Rear Panel to Metric.

3. Press MATL TEMP to verify the A to D converter and input channel. The temperature displayed by the 5508A for the corresponding input channel should be 25.36°C ±0.4°C.

NOTE

Good contact is required at the connector pin for this test. The connector pins are 0.04" in diameter and require a test probe of this size for the test. Alternatively the A to D converter input channels can be grounded at A3R56. See Figure 8-B-21. A3 Counter Board, Sheet 4.

8-A-83. Power Supply Troubleshooting

8-A-84. Initial checks can be performed on system power supplies by disconnecting all instruments from the 5508A and making measurements on the rear panel connector pins. See Paragraph 8-A-91. Connectors and Cables. 5508A internal indicators (located on A5 Power Supply Board) provide visual indication of power supply status. See Paragraph 8-A-41 for indicator locations and information for 5508A internal access. The 5508A supplies operating power for all system instruments. Table 8-A-6, Power Supplies shows supplies used by each instrument. Note that certain supplies share fuses.

Table 8-A-8 Power Supplies

Supply	Where Used	Fuse
Line Voltage 110/115/220/240V	5508A	5508A F1 (Line Fuse)
+15VH	5518A	5508A F1, A5F2, 5518A F1
+15V	5508A 10751A/B 10757A/B/C	5508A F1
-15V	5518A 10751A/B 10757A/B/C	5508A F1
+5V	5508A	5508A F1 A5F1

8-A-85. 5508A Primary Power

8-A-86. The 5508A chassis (earth) ground can be checked according to Paragraph 8-20, Before and After Service Product Safety Checks. Primary power wiring is shown on Figure 8-B-12, A5 Power Supply. The 5508A must be configured for the available A.C. line voltage according to Paragraph 2-8 Line Voltage and Fuse Selection.

8-A-87. 5518A Power

8-A-88. The 5508A +15VH and -15V supplies are used by the 5518A. There is a +15VH fuse in the 5518A on A1. +15VH powers the Laser High Voltage Power Supply. The 5518A derives +5V from the +15VH for logic circuitry power. +15VH is also used with the -15V for bipolar supply requirements in the 5518A. To verify 5518A power supplies, turn power off and remove the 5518A cover. A1S1 disables the +15VH output to the High Voltage Power Supply when the cover is removed. To re-enable the High Voltage Supply, set A1S2 to TEST. See Warnings and Cautions on page 8-3. The output of the High Voltage Power Supply should only be checked according to the Laser/High Voltage Power Supply Troubleshooting in Section VIII-C.

8-A-89. Instrument Current Requirements

8-A-90. Nominal current requirements of the 5508A, 5528A, 10751A/B, and 10757A/B/C are listed below for each power supply. Note that the +5V and +15VH supplies use remote sensing. These nominal current values should be used for indication only.

Supply	5508A	5518A	10751A/B	10757A/B/C
+5V	3.5A	Not Used	Not Used	Not Used
+15V	30 mA	Not Used	70 mA	20 mA
-15V	25 mA	17 mA (max*) 11 mA (typ*)	70 mA	20 mA
+15VH	Not Used	2.5A (max*) 1.5A (typ*)	Not Used	Not Used

*Maximum value is value when laser heater is active, typical value is value with heater off.

8-A-91. Connectors and Cables

8-A-92. 5508A rear panel connector pin-outs are shown in Figure 8-A-2, 5508A Connectors. Pin designation letters on the figure correspond to those stenciled on the connector. Pin designation letters are also stenciled on the cables that attach to the rear panel connector. Connector pin function and open connector measurement values are provided for reference in Tables 8-A-7 through 8-A-10, Connector Pinouts. Open connector (no instrument connected) measurement values listed in the table can be used for initial tests. Good probe contact is required to verify resistance measurements that are given for some of the connector pins. The cable pins are 0.04 inch in diameter.

8-A-93. An HP 3456A Digital Voltmeter is required for resistance and voltage measurements. For resistance measurements, be sure to zero the instrument to eliminate test lead resistance. Figure 8-B-22, A4 Rear Panel Connector Board and Figure 8-A-3, Signal Flow and Indicator Diagram can be used when tracing signal paths with the 5518A, 10751A/B, or 10757A/B/C connected to the 5508A.

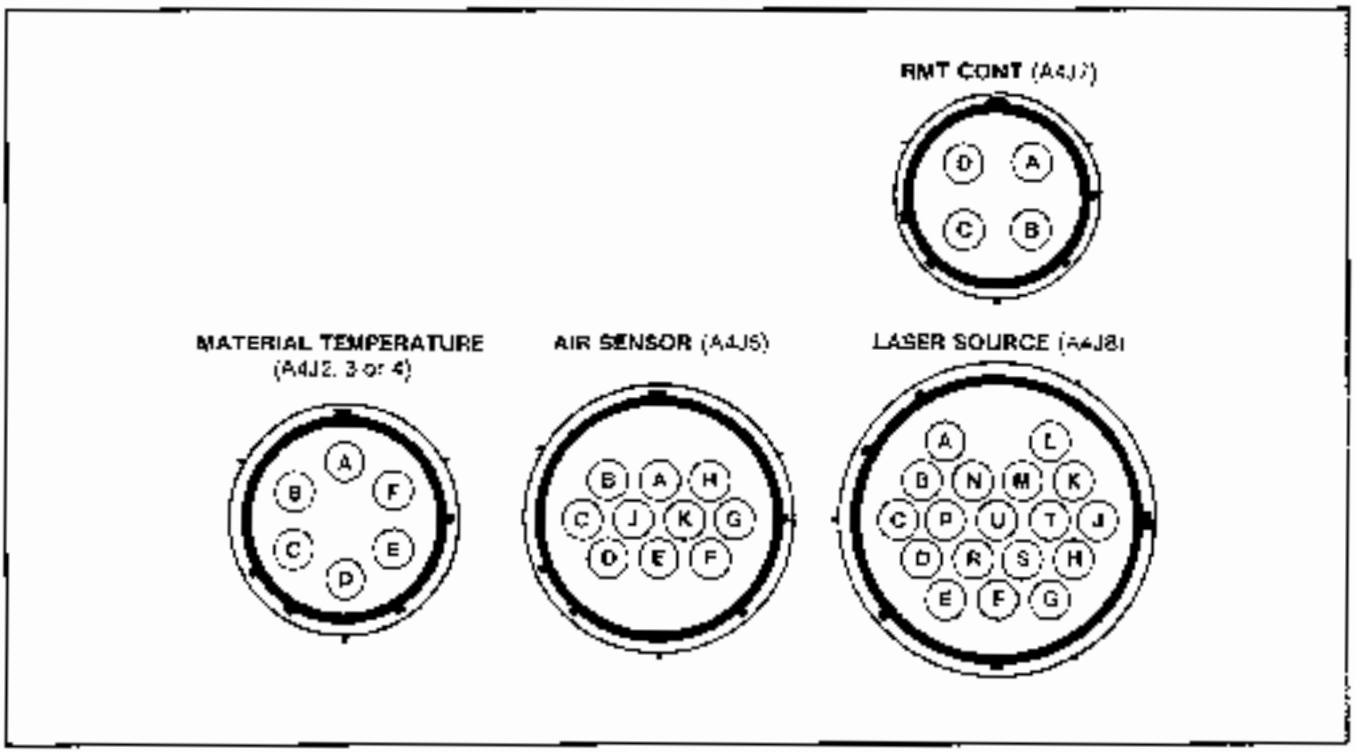


Figure 8-A-2. 5508A Connectors

Table 8-A-7. Remote Control Connector Pinouts

Connector	Pin	Function	Open Connector Measurement Values
Remote Control	A	Ground	0 to 1.5 mV
	B	External Reset	Approximately 5V (TTL Pullup)
	C	External Sample	Approximately 4V (TTL Pullup)
	D	Meter Drive	−100 to 100 mV (With 5518A disconnected)

Table 8-A-A. Laser Source Connector Pinouts

Connector	Pin	Function	Open Connector Measurement Values
Laser Source	A	Beam Strength	Approximately 5V
	B	Measurement Frequency Signal	80 to 90Ω (5508A Power Off)
	C	Measurement Frequency Signal	80 to 90Ω (5508A Power Off)
	D	Measurement Shield	0.02 to 0.2Ω
	E	Reference Frequency Signal	80 to 90Ω (5508A Power Off)
	F	Reference Frequency Signal	80 to 90Ω (5508A Power Off)
	G	Power Ground	0.02 to 0.2Ω (5508A Power Off)
	H	Power Ground	0.02 to 0.2Ω (5508A Power Off)
	J	+15V Head Remote Sense	14.5 to 15.5V
	K	+15V Head	14.5 to 16.0V
	L	-15V	-14.5 to -16V
	M	+15V Head	14.5 to 16.0V
	N	Ground-Cable Shield	0.02 to 0.2Ω (5508A Power Off)
	P	Ground-Cable Shield	0.02 to 0.2Ω (5508A Power Off)
	R	Reference Shield	0.02 to 0.2Ω (5508A Power Off)
	S	Power Ground	0.02 to 0.2Ω (5508A Power Off)
	T	+15V Head	14.5 to 16.0V
	U	Ground-Cable Shield	0.02 to 0.2Ω (5508A Power Off)


Table 8-A-9. Air Sensor Connector Pinouts

Connector	Pin	Function	Open Connector Measurement Values
Air	A	**Air Pressure Signal**	2 to 3V
	B	+10Vref	9.9 to 10.1V
	C	Cable Shield	0.02 to 0.2Ω (5508A Power Off)
	D	Analog Ground	0.02 to 0.3Ω (5508A Power Off)
	E	+15V	14.5 to 15.5V
	F	-15V	14.5 to -15.5V
	G	**Humidity Switch Signal**	2 to 3V
	H	**Air Temperature Signal**	2 to 3V
	J	Ground-Cable Shield	0.02 to 0.2Ω (5508A Power Off)
	K	Not Used	

Table 8-A-10. Material Temperature Connector Pinouts

Connector	Pin	Function	Open Connector Measurement Values
Material Temperature	A	Cable Shield	0.02 to 0.2Ω (5508A Power Off)
	B	+10Vref	9.9 to 10.1V
	C	-15V	14.5 to 15.5V
	D	Analog Ground (Not used by 10757)	0.02 to 0.3Ω (5508A Power Off)
	E	-15V	-14.5 to -15.5V
	F	MTX	2 to 3V

*Measurement values with respect to chassis (earth) ground. Typical values at tolerances indicated by HP 3456A Voltmeter.

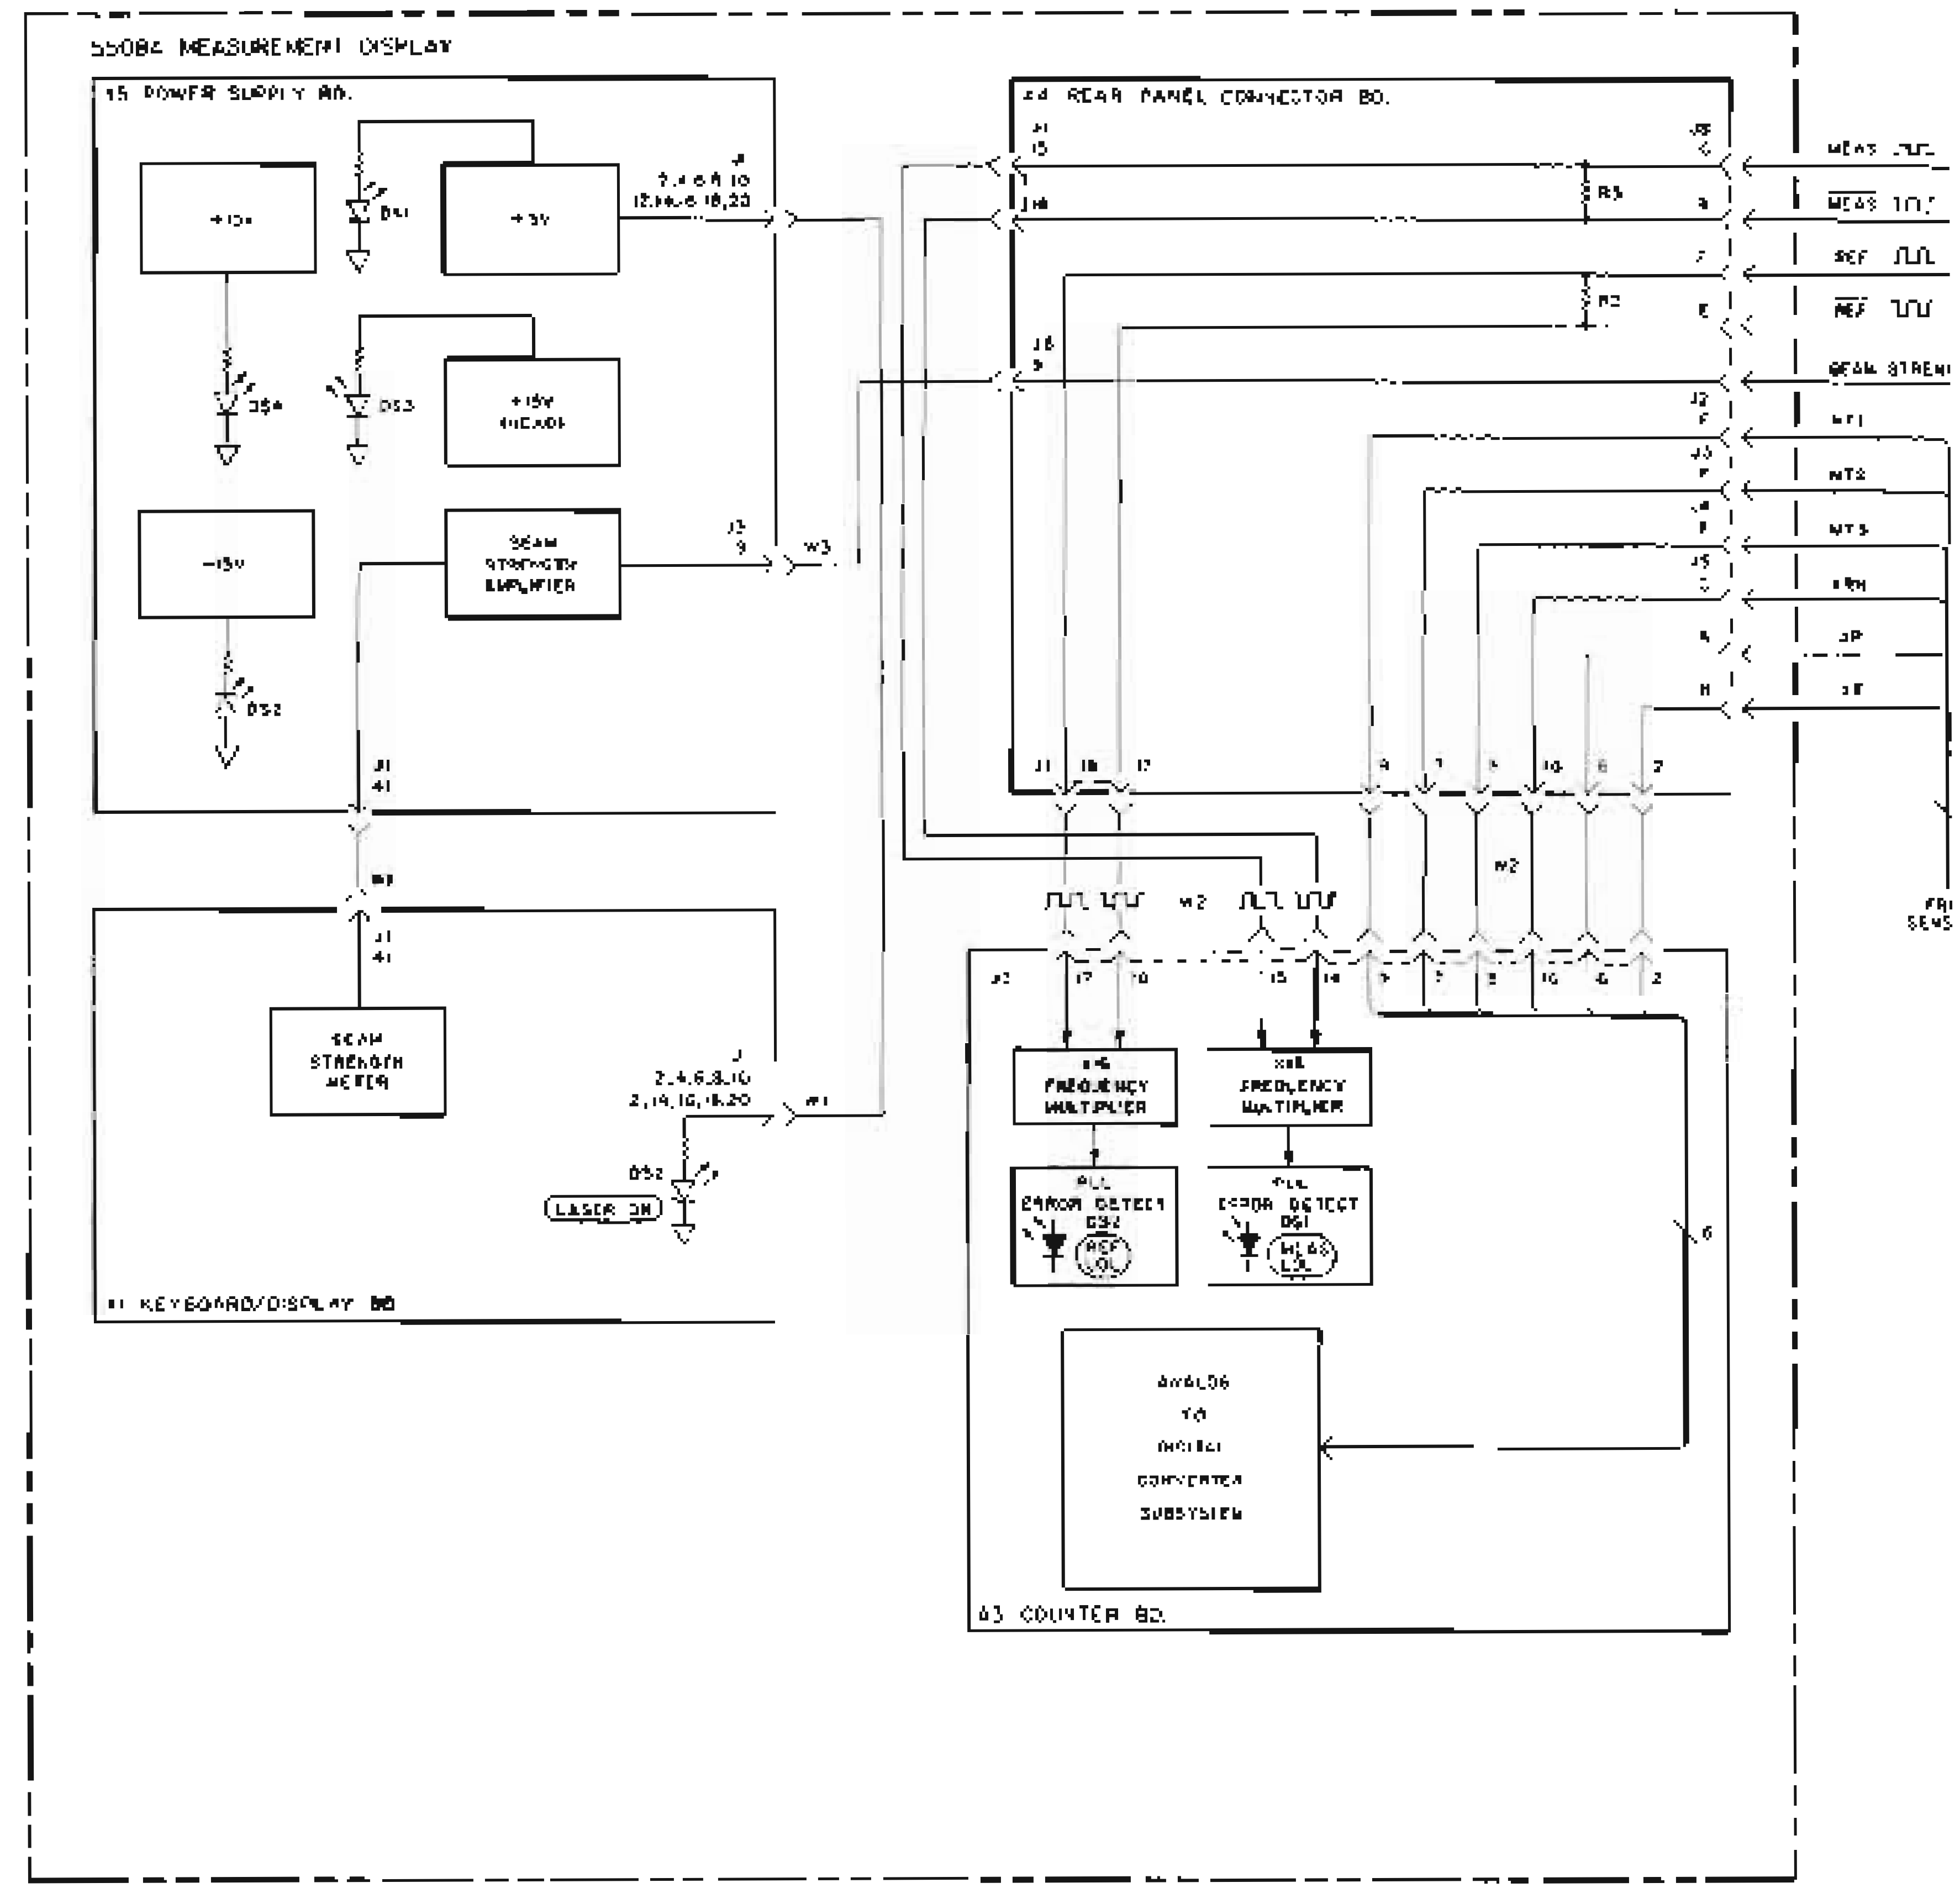
5508A MEASUREMENT DISPLAY
A5 POWER SUPPLY BD.
+15V
+5V
-15V
DS1
DS3
DS4
DS2
+15V (HEAD)
BEAM STRENGTH AMPLIFIER
W3
W1
W2
BEAM STRENGTH METER
LASER ON
A1 KEYBOARD/DISPLAY BD
A4 REAR PANEL CONNECTOR BD.
R1
R2
MEAS
REF
BEAM STRENGTH
×6 FREQUENCY MULTIPLIER
PLL ERROR DETECT DS2
REF UL
PLL ERROR DETECT DS1
MEAS UL
ANALOG TO DIGITAL CONVERTER SUBSYSTEM
A3 COUNTER BD.

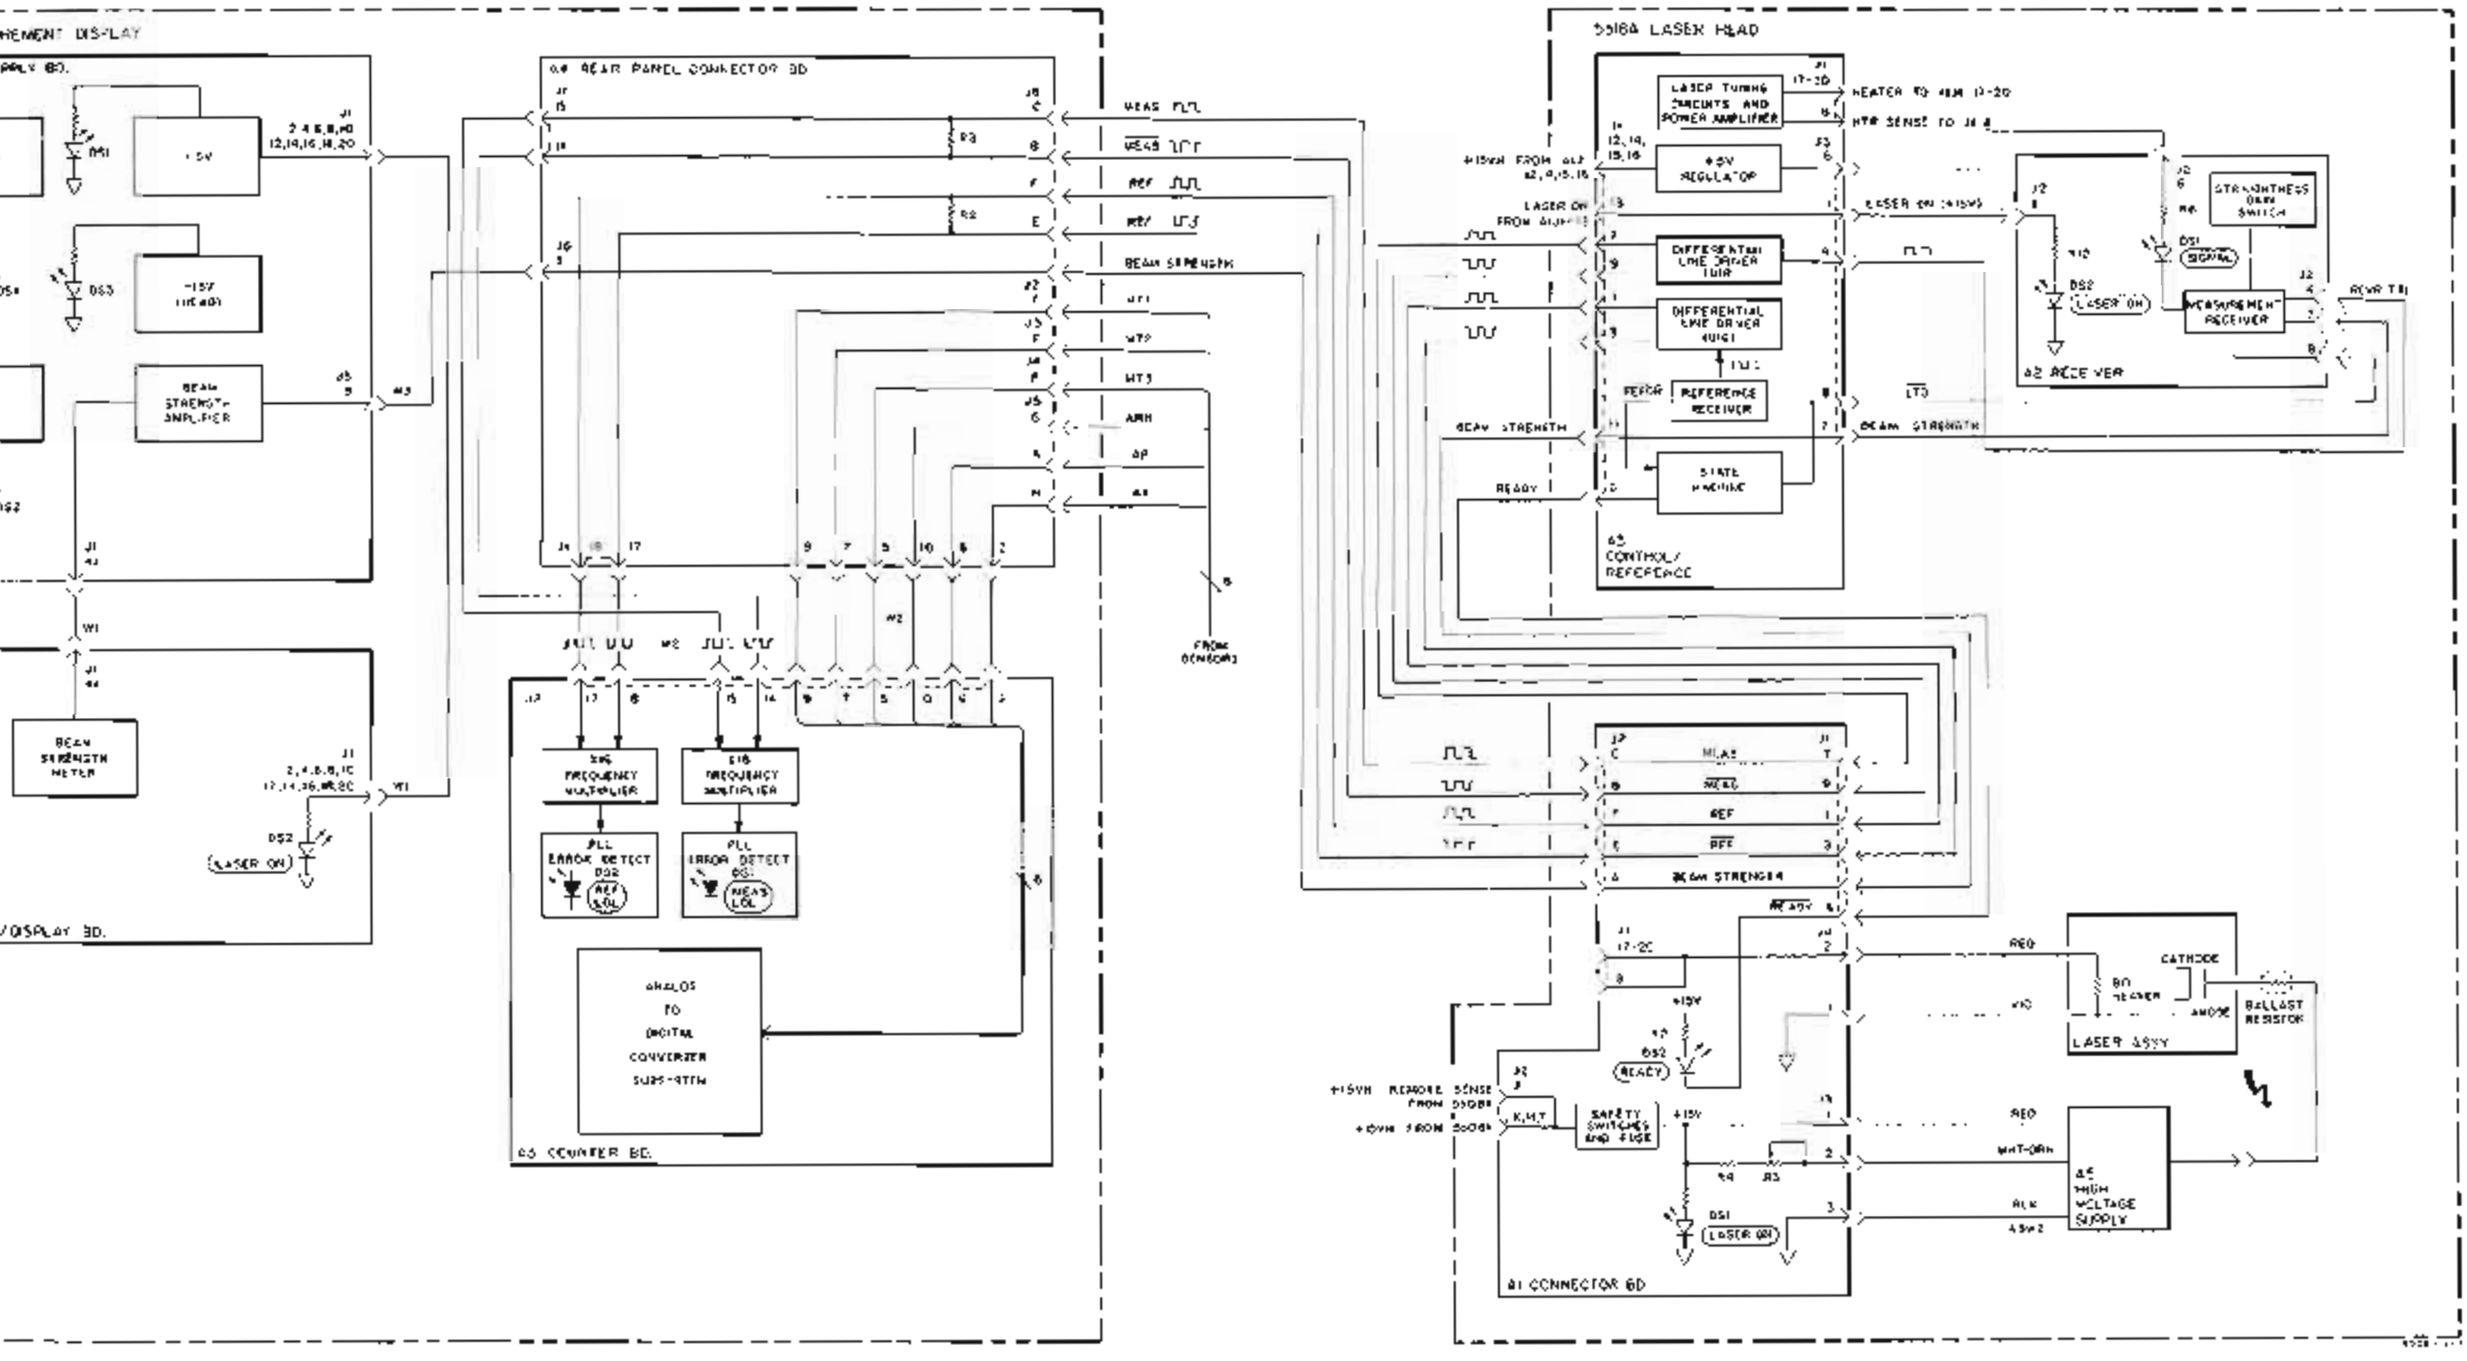


Figure 8-A-3. 5528A Signal Connection and Interface Diagram

Figure 8-A-1
5528A SIGNAL CONNECTION AND INDICATOR DIAGRAM

(See Page 8-A-23)

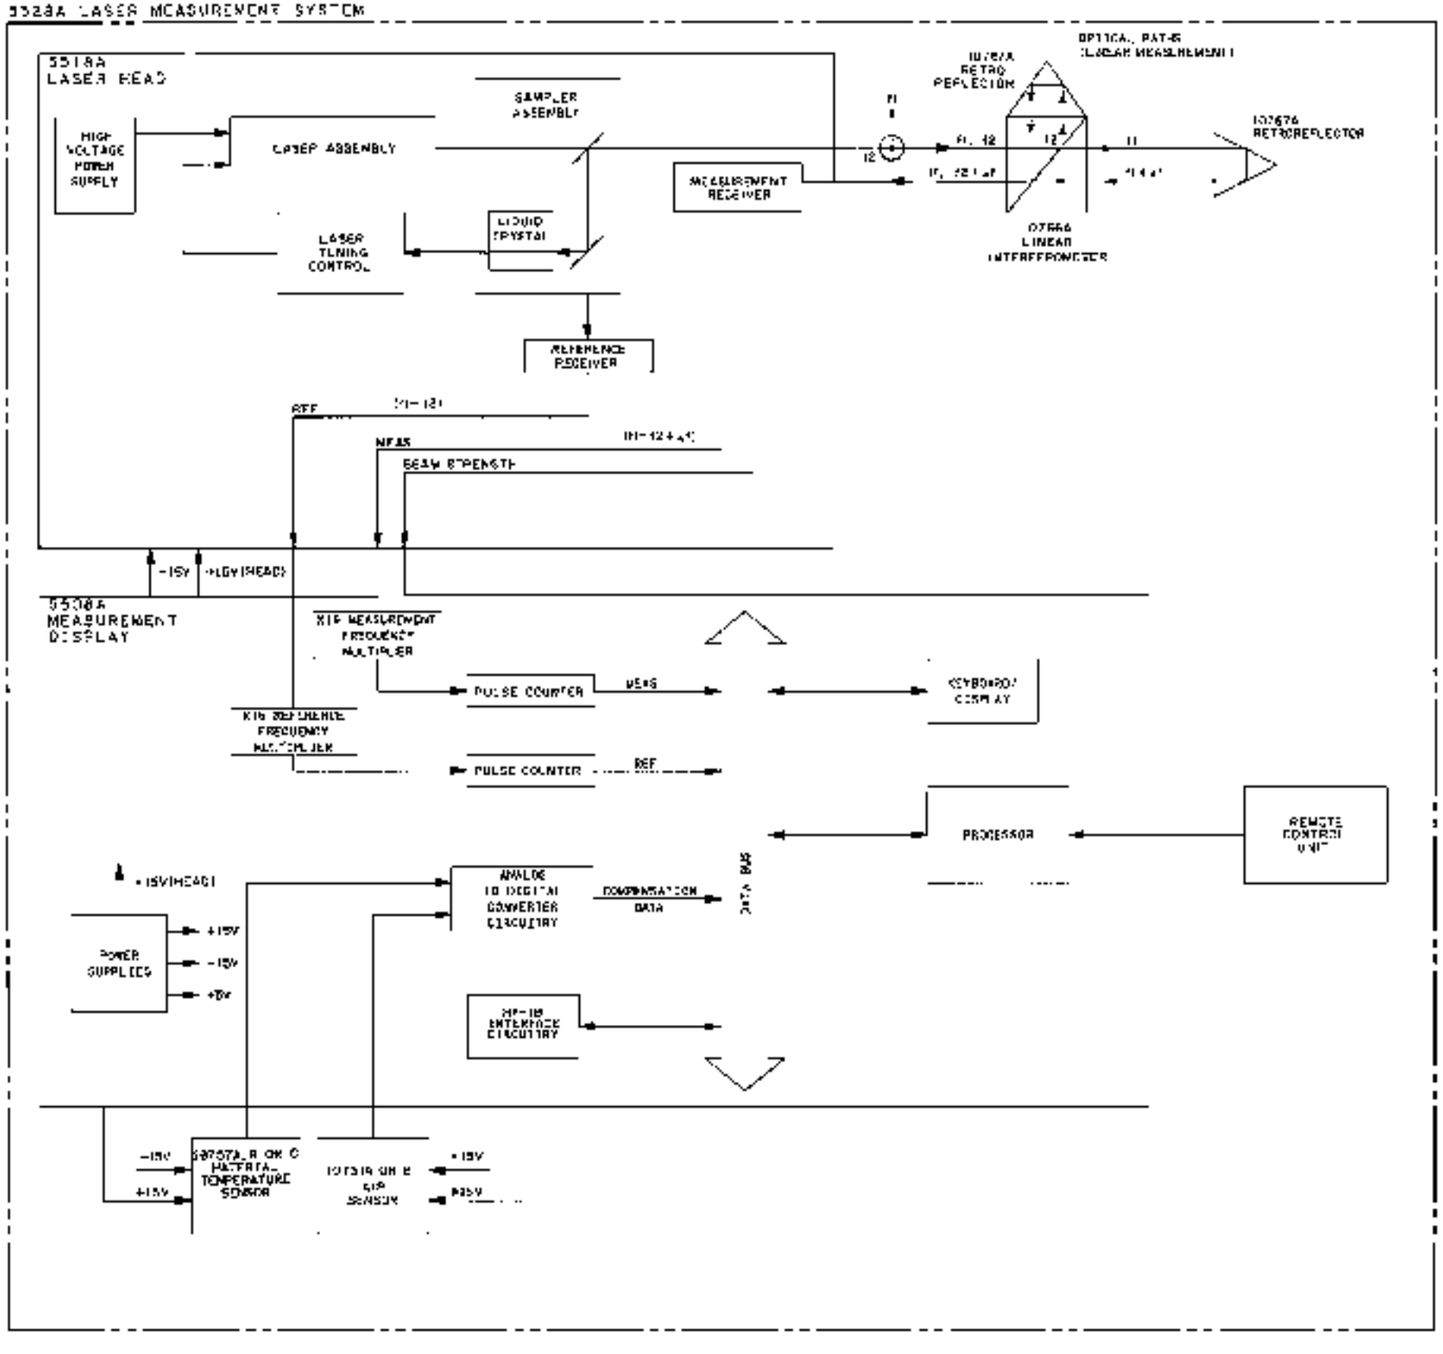


Figure 8-A-4 5528A System Block Diagram

Figure 8-A
5326A SYSTEM BLOCK DIAGRAM

(See Page 8-A-25

SECTION VIII-B
5508A MEASUREMENT DISPLAY

	Page
Block Diagram Description	8-B-1
Trouble Isolation	8-B-2
A1 Keyboard/Display Circuit Theory	8-B-10
A1 Keyboard/Display Troubleshooting	8-B-11
A1 Keyboard/Display Schematic Diagram	8-B-15
A2 Processor Board Circuit Theory	8-B-17
A2 Processor Board Troubleshooting	8-B-18
A2 Processor Board Schematic Diagram	8-B-45
A3 Counter Board Block Diagram Description	8-B-47
A3 Counter Control Circuit Theory	8-B-48
A3 Reference Frequency Channel and Measurement Frequency Channel Circuit Theory	8-B-50
A3 Counter Control, Reference Frequency Channel, Measurement Frequency Channel Troubleshooting	8-B-52
A3 PLL Troubleshooting Flow Chart	8-B-59
A3 Counter Control Circuits Schematic Diagram	8-B-71
A3 Reference Frequency Channel Schematic Diagram	8-B-73
A3 Measurement Frequency Channel Schematic Diagram	8-B-75
A3 Analog Subsystem Block Diagram Description	8-B-77
A3 Analog Subsystem Circuit Theory	8-B-78
A3 Analog Subsystem Troubleshooting	8-B-82
A3 Analog Subsystem Schematic Diagram	8-B-97
A3 Counter Board Component Locator	8-B-99
A4 Rear Panel Connector Board, Schematic Diagram	8-B-101
A5 Power Supply Board Circuit Theory	8-B-102
A5 Power Supply Board Troubleshooting	8-B-104
Remote Control Unit	8-B-117

SECTION VIII-B
5508A MEASUREMENT DISPLAY

8-B-1. 5508A MEASUREMENT DISPLAY BLOCK DIAGRAM DESCRIPTION

8-B-2. Paragraphs 8-B-3 through 8-B-13 contain the block diagram description for the 5508A Measurement Display. Paragraphs 8-B-14 through 8-B-30 cover the trouble isolation procedures which are designed to isolate problems to the board or functional area.

8-B-3. The block diagram for the 5508A Measurement Display is shown in Figure 8-B-3. The 5508A is a microprocessor based instrument composed of the following major circuit boards assemblies.

A1 Keyboard/Display Board 05508-60001

A2 Processor Board 05508-60002

A3 Counter Board 05508-60003

A4 Rear Panel Connector Board 05508-60004

A5 Power Supply Board 05508-60005

8-B-4. A2 Processor Board and A3 Counter Board

8-B-5. The microprocessor unit (MPU) is the heart of the system and functions as a controller for the pulse counters, the A/D converter, the HP-IB, and the keyboard/display assembly. The MPU controls the sequence of operations for the various modes and units selected, including transfer and routing of data, calculations, and display functions.

8-B-6. The laser head output signals, Reference and Measurement, connect to the 5508A via Rear Panel Connector Board A4 for routing to their respective channels on Counter board A3. In order to extend the resolution of the measurement, phase lock loops on A3 multiply the frequency of the Reference and Measurement signals by 16 before they are routed to pulse counters.

8-B-7. When either counter is half full, the MPU is interrupted to read the value in each counter. These two values are subtracted and stored, yielding a difference count which is proportional to the displacement in the optical measurement path. Each successive difference count adds to the previous one in RAM. The MPU then performs the necessary computations to give the displacement in either english or metric units.

8-B-8. Before displaying a measurement, the processor weights the difference of the pulse counters according to the measurement mode. For the weight (value) of each count in straightness or angular modes, the 5508A uses constants stored in ROM. For a distance measurement, however, the 5508A requires a constant and a compensation number.

8-B-9. If the Measurement Signal is interrupted, for example when the optical path is broken, the 5508A displays "PA ERROR". Similarly, "HEAD ERROR" appears on the display if the reference channel is interrupted.

8-B-10. If the frequency of the Measurement Signal exceeds the range of the phase locked loops (i.e., less than 500 kHz or greater than 4 MHz), a loss of lock error occurs. The display will show "SL ERROR" if the error occurred in the Measurement Channel and "HD ERROR" for Reference Channel errors.

8-B-11. The A/D converter receives six analog inputs including air pressure, air temperature, humidity, and the three material temperatures. Upon conversion of an analog input to digital form, the converter interrupts the MPU. Upon interrupt, the MPU responds by reading the digital values and using them for compensation calculations. Compensation is made for the speed of light in air and the thermal expansion of the material being measured.

8-B-12. A1 Keyboard/Display Board

8-B-13. When a front panel key is pressed, the keyboard interrupts the MPU which in turn scans the keyboard switch matrix to determine which key was pressed. The processor then executes the proper routine and outputs data to the display drivers whenever a new calculation has been made.

8-B-14. 5508A MEASUREMENT DISPLAY TROUBLE ISOLATION

8-B-15. The following paragraphs contain descriptions of the 5508A indicators that are useful for trouble isolation, preliminary checks, symptoms and probable causes, an internal switch summary, and assembly removal instructions.

8-B-16. 5508A Indicators

LASER ON Indicator. Monitors the 5508A −15 Volt power supply line. Designed to alert the operator that the 5516A Laser Head is activated and emitting a beam.

BEAM STRENGTH Meter. Indicates the relative strength of the laser beam measurement signal. The meter reading can be used to aid in optimizing the optical alignment of the laser and measurement optics. Beam strength indications within the green area of the meter are required for proper operation.

8-B-17. 5508A Self Test

8-B-18. Extensive self-tests are built into the 5508A and are exercised upon power-up. Immediately after power is applied, the 5508A performs a checkerboard RAM test, followed by a ROM checksum. The checksum routine is similar to a signature analysis algorithm, using a feedback register technique. This test is performed on the contents of the 16K program ROM. If the RAM or ROM tests fail, an SS Error is displayed by the 5508A. If the 5508A passes this test, the front panel is exercised followed by testing of the counter sections.

8-B-19. The first counter test begins by switching the Processor Board's 2 MHz clock into the reference channel phase-locked loops. The counter is cleared and a short time delay is generated in software. During this delay, an exact number of known counts should accumulate in the reference channel. Since the clock signal is the same signal that is used to generate the software time delay, the exact frequency of the clock is not critical; a delay equal to a particular number of system clock cycles should always produce the same number of pulses counted. A second time delay is generated, yielding another value in the counters; this one is the binary complement of the first. Thus both binary states in each bit of the reference channel are checked. If the 5508A passes this test, the message PASS 1 is displayed. A failure produces the message FAIL 1 and the 5508A can not be configured for a measurement until the problem is resolved.

8-B-20. The second counter test is similar to the first, except the measurement channel is verified, rather than the reference channel. Either PASS 2 or FAIL 2 is displayed.

8-B-21. The third self-test involves the counters in a free-running mode. Once again, the microprocessor system clock is used as the counter inputs, emulating the laser reference and measurement signals. The counters are allowed to run free for a longer delay, during which time they interrupt 150 times. Since both channels have the same input (the system clock), they should always have the same number of counts, plus or minus one for jitter. If interrupts do not occur 150 times in 0.5 second, or if there is a net number of counts (i.e., one channel is counting more than the other) the message FAIL 3 appears. FAIL messages must be resolved before a measurement can be taken.

8-B-22. The last self-test on power-up involves the Analog Subsystem. During this test, the 6.5V reference and analog ground are converted to digital form and read. Since the A to D Converter is a ratiometric device, the exact value of the 6.5 V reference doesn't matter. The test only checks the activity of the A to D Converter and the existence of the reference. If either of the two conversions fails to agree with predetermined values or if the A to D Converter doesn't generate an interrupt in the time allotted, then the unit displays FAIL 4. Otherwise PASS 4 is displayed and the test continues.

8-B-23. Next, the 5508A displays the values of the two digital calibration switches, one for the 10 V reference and the other for the 6.5 V reference. Finally, the HP-IB address switch value is displayed before the warm-up countdown starts.

8-B-24. Preliminary Checks

a. Check that the following cables are connected correctly. Remove the cable from the connectors and reset them firmly to remove any dirt or oxidation from the pins.


   1. Check Cable W1. It should connect from the processor board to the counter board, the power supply, and the keyboard.
   2. Check Cable W2. It should connect from the processor board to the counter board, and then split into two sections. One of the sections routes to the HP-IB connector, the other section goes to the rear panel board.
   3. Check Cable W3. It should go from the power supply board to the rear panel.

b. Check DIP switches and jumpers on the processor board and counter board as follows:

   A1 (05508-60001): None

   A2 (05508-60002):

   TEST SWITCH A2S3: all zeroes (toward "out") as shown below:

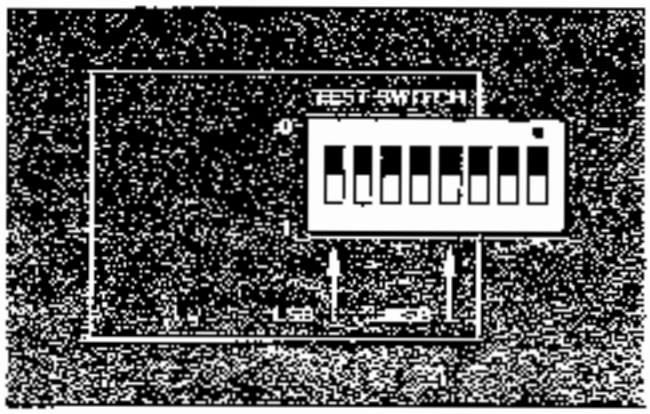

   Jumper JMP1 – NORM.
   Jumper JMP2 – installed.

   A3 (05508-60003):

   DIP switches - don't care - don't change
   Jumper JMP1-6 all NORM (all face to the center of board)

   A4 (05508-60004): None

   A5 (05508-60005): None

c. Check line fuse in line module. Also check fuses on power supply board.

8-B-25. Symptoms and Probable Causes

8-B-26. Table 8-B-1 lists symptoms to choose from in the event the 5508A appears to be failing. This list supplements the system level troubleshooting information in Section 8A. In general, the information and tests of Section 8A should be used to isolate failures to the instrument level. If the 5508A is suspected of causing a failure that is not covered in Section 8A or the symptoms listed below, proceed through the 5508A troubleshooting procedures in the following order:

a. A5 Power Supply board

b. A2 Processor board

c. A1 Keyboard

d. A2 Counter board, counter circuits

e. A3 Counter board, analog to digital converter circuits

Table 8-B-1. 5508A Troubleshooting

Symptoms	Probable Cause/Troubleshooting
Fan doesn't run. No display	Power Supply A5. Go to Power Supply Troubleshooting Procedures, Paragraph 8-B-962.
Fan runs. No display or uninterpretable display.	Processor not responding. Check power supply for −15V, −15V, +15VH, and +5V LED's. If OK, go to A2 Processor Board Troubleshooting Procedures, Paragraph 8-B-73. If processor checkout procedures are OK, go to A1 Keyboard Troubleshooting Procedures, Paragraph 8-B-42.
SS error displayed	Failed RAM or ROM tests. Go to A2 Processor Board Troubleshooting Procedures, Paragraph 8-B-73.
FAIL 1 displayed during self-test	Failed Counter board test. Perform A3 Counter Section Troubleshooting Procedures, starting with Test 1, with emphasis on the reference channel (towards the rear of the unit). See Paragraph 8-B-167.
FAIL 2 displayed during self-test	Failed Counter board test. Perform A3 Counter Section Troubleshooting Procedures, starting with Test 1, with emphasis on measurement channel (towards the front of the unit). See Paragraph 8-B-167.
FAIL 3 displayed during self-test	Indicates one of two possible failures: Counter interrupt test or Counter free run test. Go to A3 Counter Section Troubleshooting Procedures starting with Test 1. Emphasize Tests 5 and 7 if the problem is not determined before then. See Paragraph 8-B-167
FAIL 4 displayed during self-test	A to D Converter Failure; indicates A to D Converter Failure. Go to Analog Subsystem Troubleshooting.
Jumps out of PASS 2, during self-test and display reads 0.0000.	Processor is going into interrupt when there is none. Go to A2 Processor Board Troubleshooting Procedures, with emphasis on Test 6 (interrupt encoder test). See Paragraph 8-B-73 and 8-B-89.
Self-test runs out hangs up, displays "PASS 3"	Check Cable W2 connection at A4J2, A3J2 and A2J2.
5508A fails to respond to front panel key inputs.	Keyboard interrupt circuitry. Go to A1 Keyboard Troubleshooting Procedures, Paragraph 8-B-42, then to A2 Processor Board Test 6, Paragraph 8-B-73, and 8-B-89.

Table 8-B-1. 5508A Troubleshooting (Continued)

Symptoms	Probable Cause/Troubleshooting
5508A fails to respond to External Reset or Record	Use A3 Counter Board Troubleshooting Procedures, Paragraph 8-B-167.
Display digit stuck on or off, or segment stuck on or off or annunciator stuck on or off	LEDs or drivers. Go to A1 Keyboard Troubleshooting Procedures, Paragraph 8-B-42.
CAL A (when displayed at Power-Up) is the wrong number	Check A3U58. Use A3 Analog Subsystem Troubleshooting Procedures, Paragraph 8-B-267.
CAL B (when displayed at Power-Up) is the wrong number	Check A3U62. Use A3 Analog Subsystem Troubleshooting Procedures. See Paragraph 8-B-267.
ADDR is the wrong number when displayed at Power-Up	Check inputs to A2U3. Use A2 Processor Board Troubleshooting Procedures. See Paragraph 8-B-73.
NOTE: The compensation number is not updated when it is being read on the display.	

8-B-27. 5508A Internal Switch Summary

A2S1. Sets the HP-IB ADDRESS and the TALK-ONLY ADDRESSABLE function. When set to TALK ONLY, the 5508A can only output data to the HP-IB. In ADDRESSABLE, the 5508A functions as a Talker and Listener under the control of an HP-IB Controller.

Switch shown to set 5508A to Addressable and device address 03.


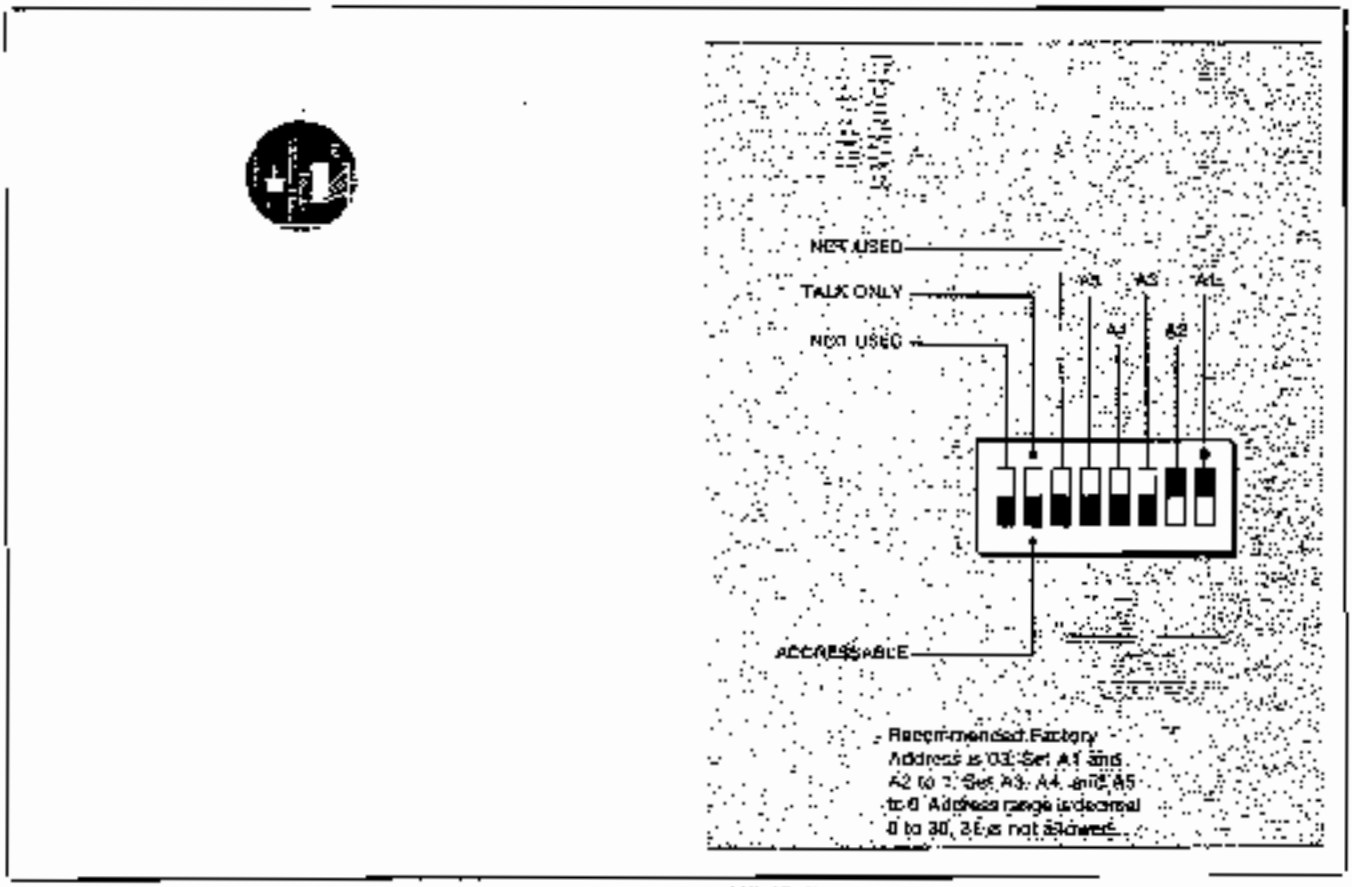



Figure 8-B-1. 5508A HP-IB Switch

A2S2 MASTER RESET. Resets the 5508A, giving the same results as turning AC power off then back on.

A2S3 TEST SWITCH. Enables various troubleshooting modes of the 5508A. Read by the MPU only at power-up or after MASTER RESET. To use, set to appropriate test and push MASTER RESET. Note that the least significant bit (LSB) of the switch is toward the front of the 5508A. For normal operation, set to all zeroes.

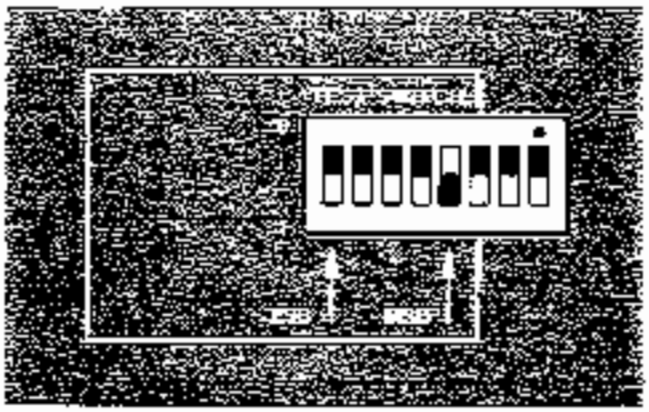


A3S1 CAL A. Change only during 5508A calibration or troubleshooting. Used to set the true value of the voltage reference, +10 Vref, for the MPU. Read by the MPU only at power-up or after MASTER RESET. See Section IV for calibration procedures.

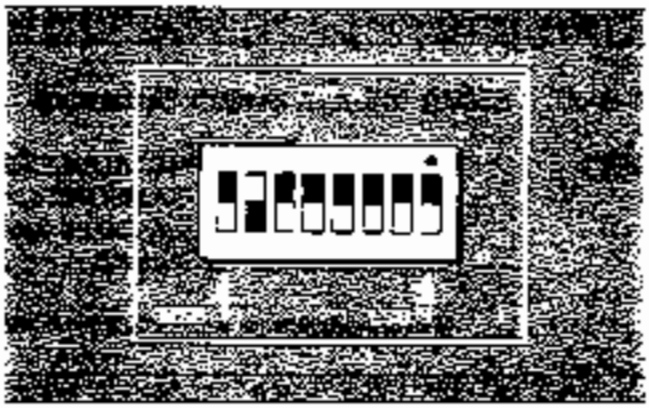


A3S2 CAL B. Change only during 5508A calibration or troubleshooting. Used to set the true value of the voltage reference, +0.5 Vref, for the MPU. Read by the MPU only at power-up or after MASTER RESET. See Section IV for calibration procedures.

Switch shown set to 1 (00001).

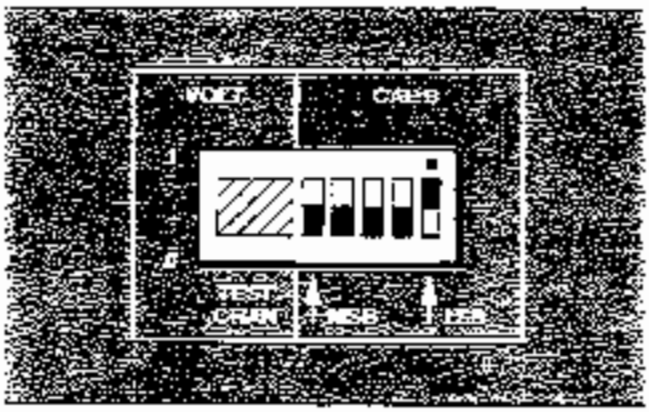

A3S2 Voltmeter Test Channel Select. 3-bits of A3S2 are used to select 1 of 8 input channels to the Analog to Digital Converter. Switch positions and corresponding input channels are as follows:


Test Switch	Channel
000	Analog Ground
001	Air Temperature
010	Air Pressure
011	Air Humidity
100	Material Temperature 1
101	Material Temperature 2
110	Material Temperature 3
111	+0.5 Vref

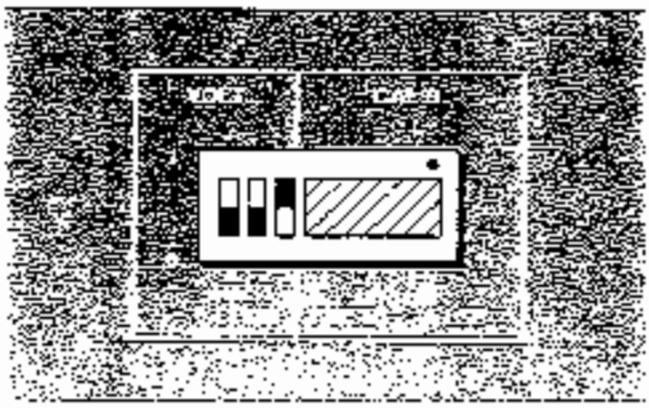

8-B-28. 5508A Assembly Removal Instructions

8-B-29. Figure 8-B-2 shows the 5508A assembly locations and cable designations.

8-B-30. The exploded view diagrams in Section VI provide access removal information as well as assembly part number references

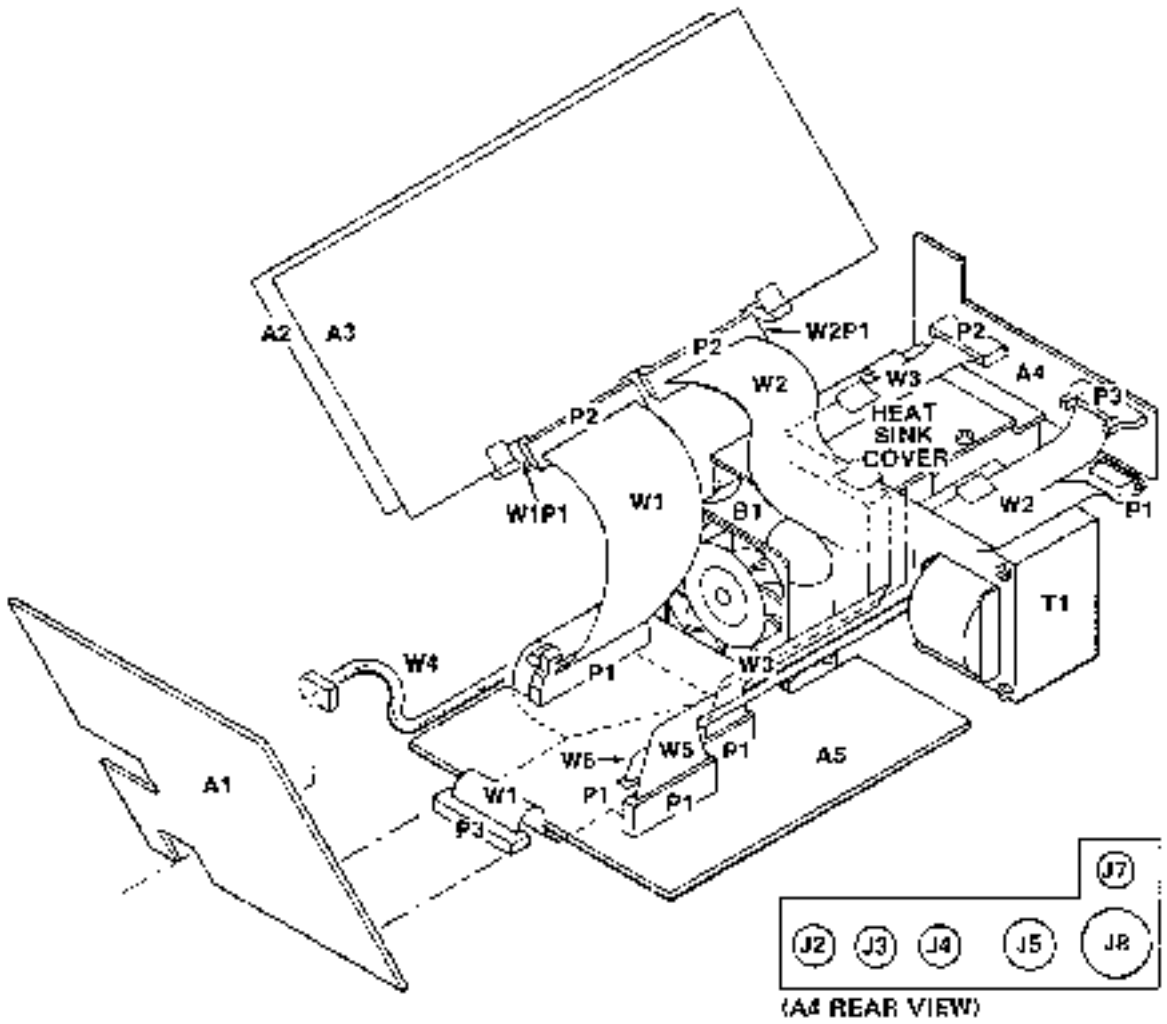

Reference Designator	Description
A1	Keyboard/Display Board Assembly
A2	Processor Board Assembly
A3	Counter Board Assembly
A4	Rear Panel Connector Board Assembly
A5	Power Supply Board Assembly
W1	Control Cable Assembly
W2	Analog/HF-IB Cable Assembly
W3	Laser Cable Assembly
W4	Power Switch Cable Assembly
W5	Heat Sink Cable Assembly
W6	P/O Transformer
T1	Transformer
B1	Fan

Figure 8-B-2. 5508A Assembly and Cable Designations

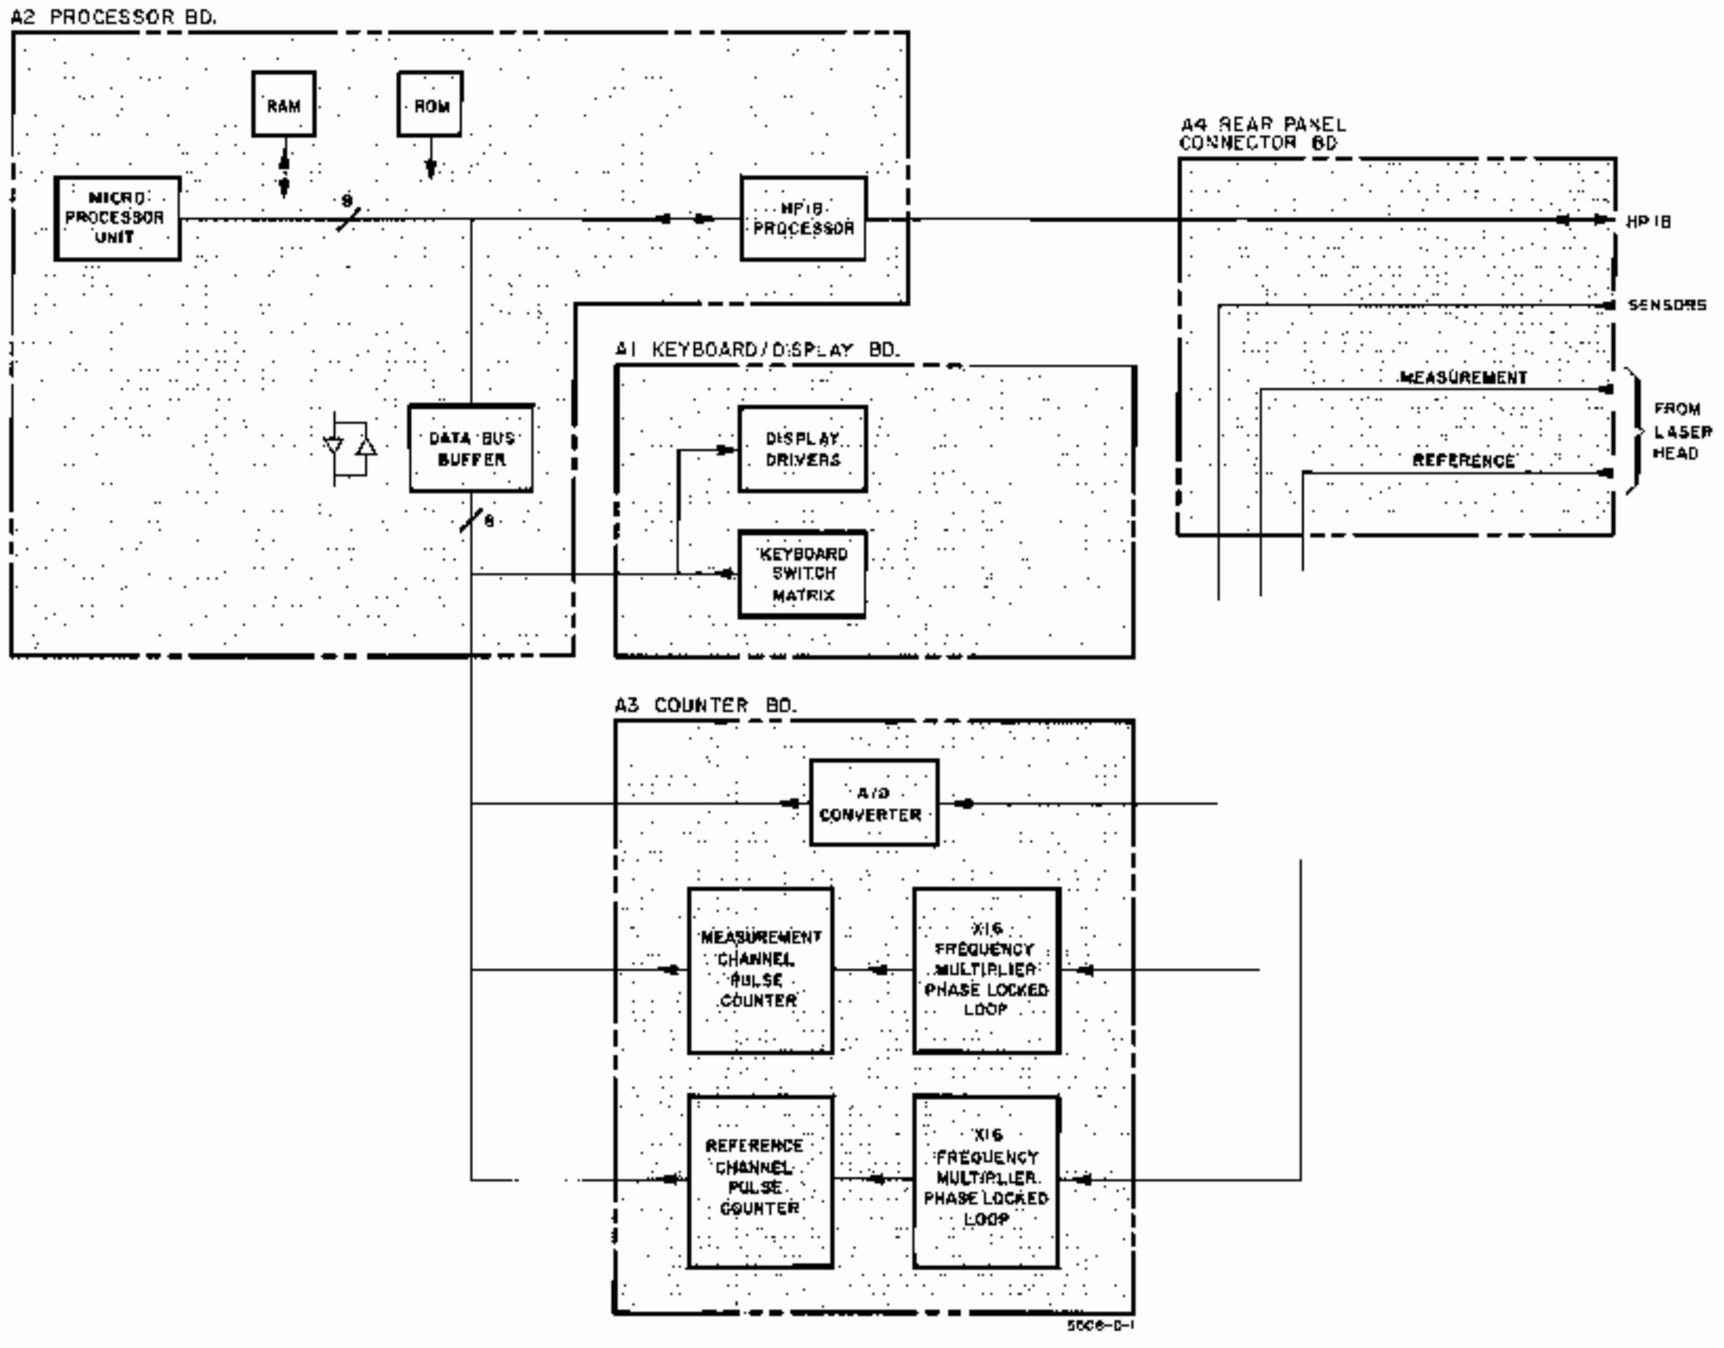


Figure 8-8-3 5508A Measurement Display Block Diagram

8-B-31. 5508A A1 KEYBOARD/DISPLAY CIRCUIT THEORY

8-B-32. Paragraphs 8-B-33 through 8-B-41 contain circuit theory for Keyboard/Display A1. Paragraphs 8-B-42 through 8-B-50 cover the troubleshooting and signature analysis information.

8-B-33. The schematic diagram for Keyboard/Display A1 is shown in Figure 8-B-5. The schematic has functional blocks that are labeled alphabetically with circled letters. These labels correspond to the circled letters in the text for the circuit theory.

8-B-34. Display Circuitry Ⓑ Ⓒ Ⓕ

8-B-35. The display section consists of control latches U5 and U6, display drivers U1 and U8, 10 LED seven-segment displays, and 10 annunciators.

8-B-36. Control latches U5 and U6 are used to write into the data display drivers U1 and U8. The MPU determines the mode of operation for U1 and U8 via U5 and the data is sent to the drivers via U6. Once the data is written into U1 and U8, further MPU control is not necessary since the data display drivers have their own internal clocks and multiplexers.

8-B-37. Each display driver is capable of driving eight 7-segment LED's (64 bits including decimal points). The drivers require that display data be loaded in a serial byte format, all eight bytes in a single operation. A timing diagram of the loading sequence is shown in Figure 8-B-4.

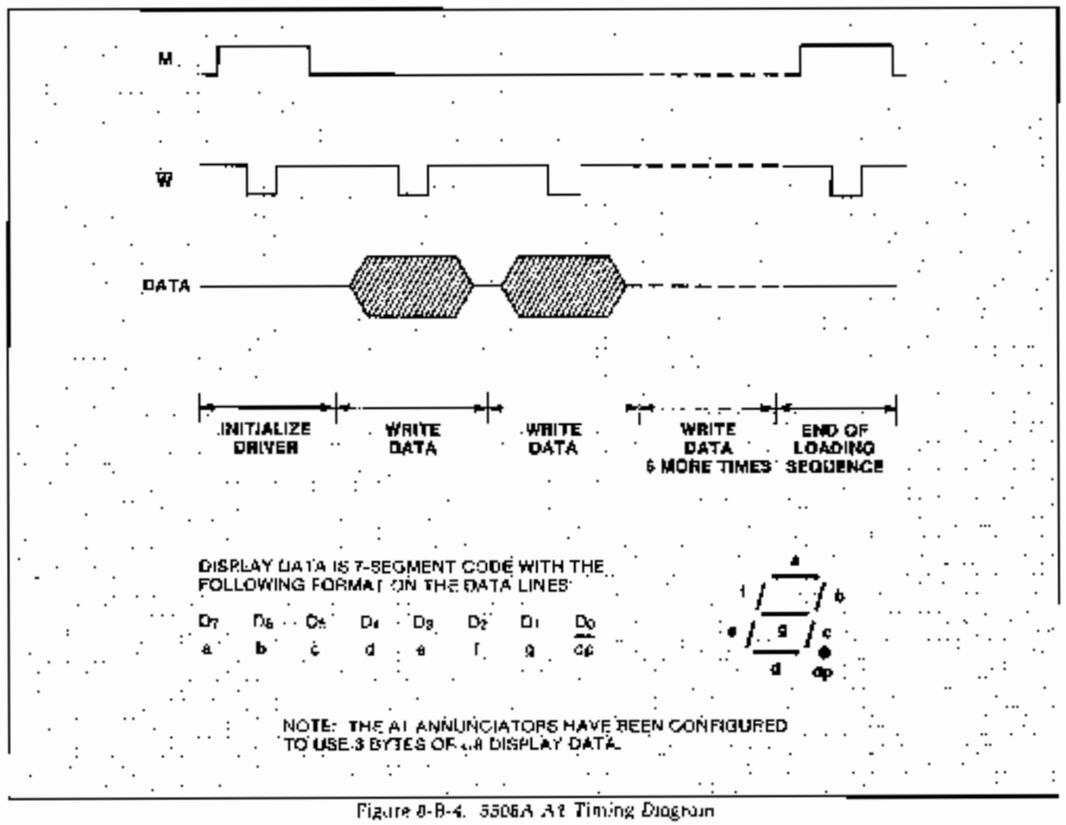


Figure 8-B-4. 5508A A1 Timing Diagram

Figure 8-B-3
5508A MEASUREMENT DISPLAY BLOCK DIAGRAM

(See Page 8-B-9)

8-B-38. Some annunciators are double driven to double the duty cycle and increase the intensity of the annunciators.

8-B-39. Keyboard Scanning and Interrupt Circuitry Ⓑ Ⓓ Ⓕ

8-B-40. During normal operation, a closure of any key on the keyboard switch matrix generates an MPU interrupt signal via $\overline{IN5}$. Prior to a key closure, U10 pins 2, 5, 12, and 15 are low. If any key is closed, causing a low on its column, the output of U9 goes high and $\overline{IN5}$ goes true via U3B. When responding to a keyboard interrupt, the MPU first clears U8. The column of the key closure is determined by latching and reading the inputs of U7. The rows are then enabled one at a time by cycling a low through the outputs of U10. U7 is synchronously latched and read to determine the row of the closure.

8-B-41. The MPU must be able to differentiate an "up-key" interrupt from a "down-key" interrupt. An up key interrupt does not cause a low to be latched by U7 as described above and therefore is easily determined. Up-key interrupts are used to complete keyboard input functions. For example, when manually loading the material temperature, the MATL TEMP key is pressed after the desired value has been entered. The MPU responds to the closure by displaying the entered value. When the MATL TEMP key is released, the MPU recognizes the key interrupt and begins operation in the selected measurement mode. U3A drives $\overline{IN5}$ low for up-key interrupts.

8-B-42. 5508A A1 KEYBOARD/DISPLAY TROUBLESHOOTING

8-B-43. The following troubleshooting procedures require the HP 5005A Signature Multimeter. All A1 components, except LED's and the LED Drivers, can be checked using the A1 signature analysis procedure. During execution of this procedure, the MPU exercises the keyboard control, bi-directional data, and the interrupt circuitry. Note that the display does not update during this test.

8-B-44. Initial Checks for A1 Problems

a. No response to a key closure

1. An MPU interrupt signal should result from a closure of any of the front panel keys regardless of the 5508A operating mode. Use a logic probe and check for a transition of the keyboard interrupt line at A2U12 pin 2 while pushing the suspected key.

2. If no interrupt signal is observed - perform A1 signature analysis procedure.

3. If an interrupt signal is observed - go to processor troubleshooting procedure in paragraph 8-B-73.

b. LED Problems

1. All 7 segment LED's and Annunciators DS10, DS16, DS19, and DS20 are mounted in sockets and can be checked easily by interchanging them.

8-B-45. Troubleshooting Tips

8-B-46. Before testing the signatures, verify that the 5 Volt test signature is proper to ensure that the desired program is running. Where appropriate, signal paths leading to a node that gives an incorrect signature should be traced back until a correct signature is found. The faulty node should then be apparent and if the bad component is not obvious, current tracing or other techniques will be required. The integrity of traces attached to a bad node should always be verified before any components are replaced. Whenever a correct signature is the last one given along a signal path, verify that all traces leading from that node are also OK.


8-B-47. IC's are identified by etched numbers corresponding to the schematic reference designators. These numbers appear on both sides of the board next to pin 1 of the IC. Pin 1 is also identified by the "H" shaped soldering pad visible from both sides of the board.

8-B-48. If the signature analysis procedure for A1 does not isolate a problem that affects the display portion of the board and all LED's are functional, then a bad LED driver may be indicated. Use the schematic to determine the faulty driver. Note that a failure of the drivers may not be identified by signature analysis since the procedure indicates a problem only if the failure is a short to Vcc or ground of a driver input or output.

8-B-49. Signature Analysis Procedure

8-B-50 To perform the procedure refer to the schematic diagram, Figure 8-B-5 and proceed as follows:

a. Set switches on processor board A2 as follows:

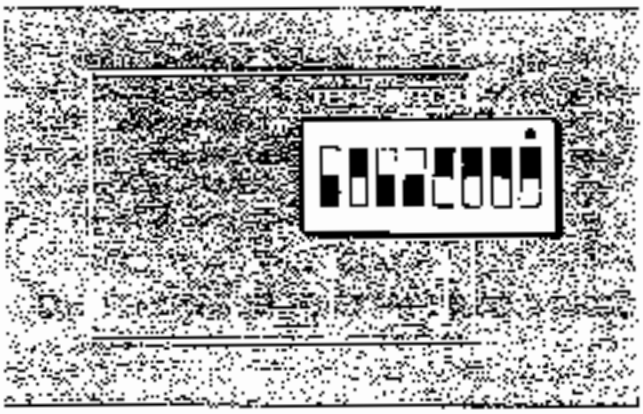

JMP 1: NORM
JMP 2: INSTALLED

b. Set Signature Analyzer controls and connect test leads as follows:

CLOCK: Clock lead to CLOCK test point on processor board

START: Start lead to START test point on processor board

STOP: Stop lead to STOP test point on processor board

c. To measure the signatures, toggle MASTER RESET switch and check the following nodes:

1. +5 V Test Signature = FU21
Ground Test Signature = 0000

2. Interrupt Signal Circuit

U4 pin 13: PP28 (if this signature is correct make sure that it is also present at A2U12 pin 2.

U3 pin 1: A1U93
pin 3: 77C8 **
pin 4: PP28
pin 5: 2109
pin 9: 2109
pin 10: PP28
pin 11: C849**

U9 pin 8: C899 **
U9 all inputs: FU21

** = with RESET key

3. Control Lines. If the control line signatures are incorrect, go to the processor board troubleshooting procedure (test 3). Verify that an incorrect control line signature is not caused by the A1 board. This can be checked by disconnecting Cable W1 and rechecking the control line signatures at A2J13.

   U5 pin 1: HFPU

   U4 pin 4: C7A8
   pin 5: 3089
   pin 8: U7A8

   U6 pin 1: PH58

   U2 pin 1: 0000
   pin 3: FU21
   pin 4: 0000

   U10 pin 1: GC6P

4. Data Bus Lines. Incorrect data bus signatures can be caused by drivers or receivers. A problem with the processor board bus driver, A2U4, can be isolated using test 5 of the processor board troubleshooting procedure. Data bus components on A1 require a current tracing procedure or component replacement if an incorrect signature occurs and the processor board bus driver checks OK.

   U7 pin 2: HH19
   pin 5: 2235
   pin 6: 4AOC
   pin 9: P378
   pin 12: 0918
   pin 15: 10U5
   pin 16: 26U5
   pin 19: 9PC6

5. Key Matrix Scan Lines. If the data bus signatures are correct, these signatures can be used to check U10 operation.

   U10 pin 2: 7P1A
   pin 5: 1200
   pin 7: 7056
   pin 10: A1J95
   pin 12: 77C8
   pin 15: HO10

6. Key Matrix Output Lines

   All Key Matrix Outputs (U7 Inputs): FU31

   The following signatures should be observed while pressing and holding the indicated key. These signatures are used to verify that the major keys make closures and U7 and U9 inputs are not stuck high


   U4 pin 1: 77C8 RESET KEY
   1206 DISTANCE KEY
   1206 VELOCITY KEY
   1306 ANGLE KEY
   1306 LONG STRAIGHTNESS KEY
   1206 SHORT STRAIGHTNESS KEY
   77C8 PRESET KEY
   77C8 RESOL KEY


7. LED Driver Control Lines

   U5 pin 2: 05C1
   pin 7: PP28
   pin 10: 5101
   pin 15: C692

8. LED Driver Data Lines

   U6 pin 2: U6H2
   pin 5: 9031
   pin 6: 7FAH
   pin 9: C466
   pin 12: 2FF8
   pin 15: F2C3
   pin 16: CHF5
   pin 17: 26U5

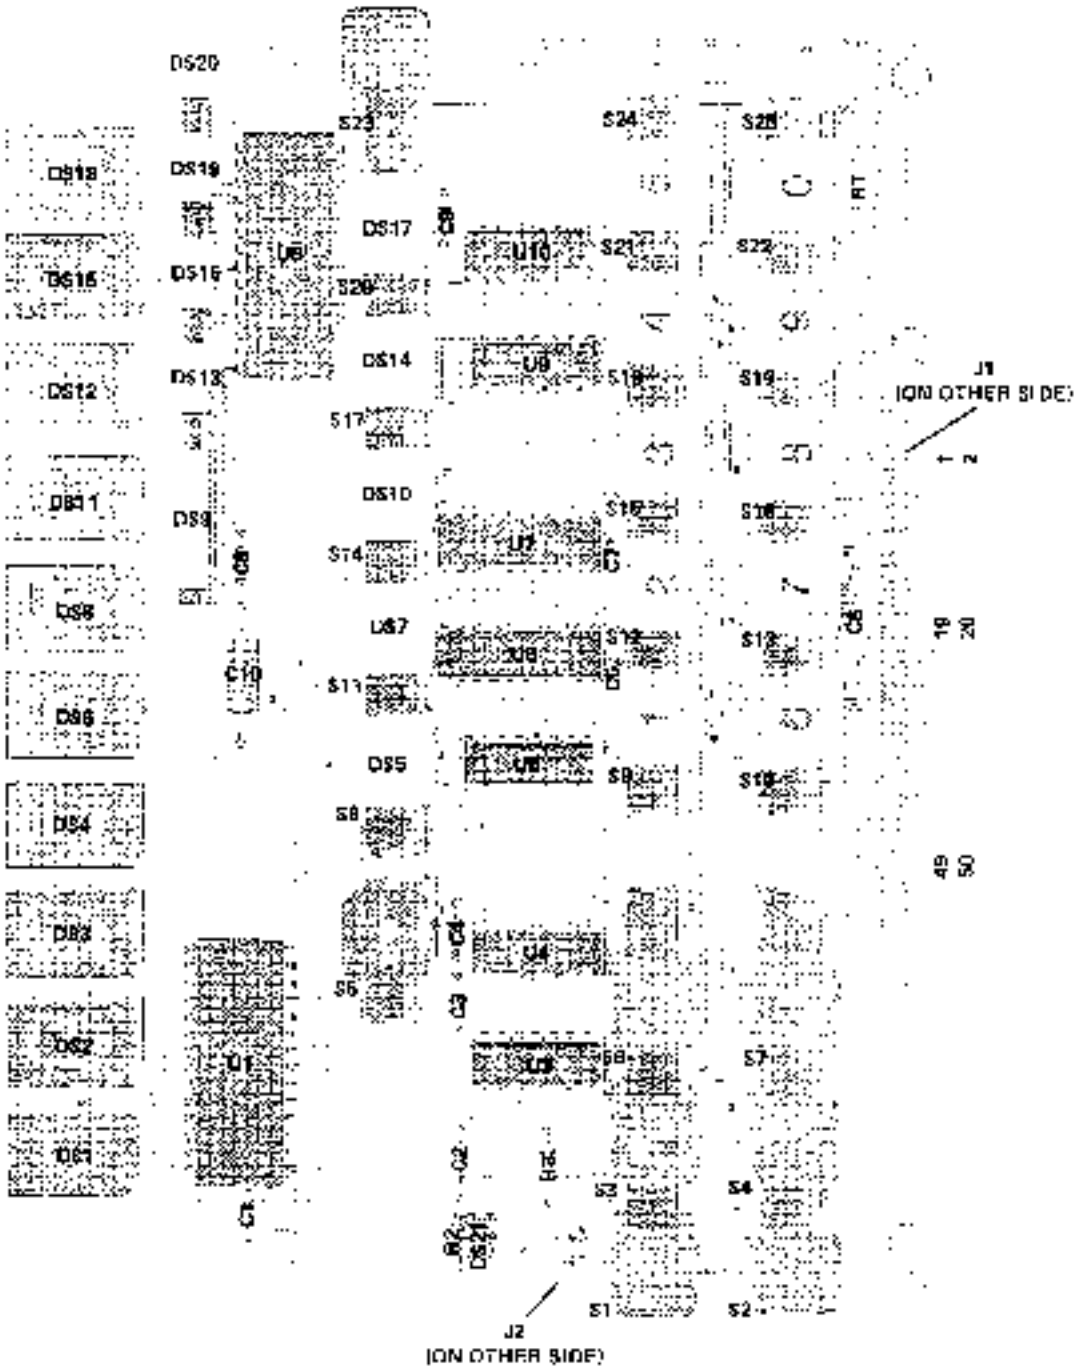
DS20
DS18
DS19
DS16
DS17
DS15
DS14
DS12
DS13
DS11
DS9
DS8
DS6
DS5
DS4
DS3
DS2
DS1
S23
S24
S25
S21
S22
S20
S19
S17
S18
S16
S14
S15
S12
S11
S9
S10
S8
S6
S7
S5
S3
S4
S1
S2
U10
U9
U7
U6
U5
U4
U3
U1
U8
C9
C8
C10
C6
C5
C4
C3
C2
C1
R4
R3
R2
R1
DS21
J1
(ON OTHER SIDE)
J2
(ON OTHER SIDE)
1
2
19
20
49
50

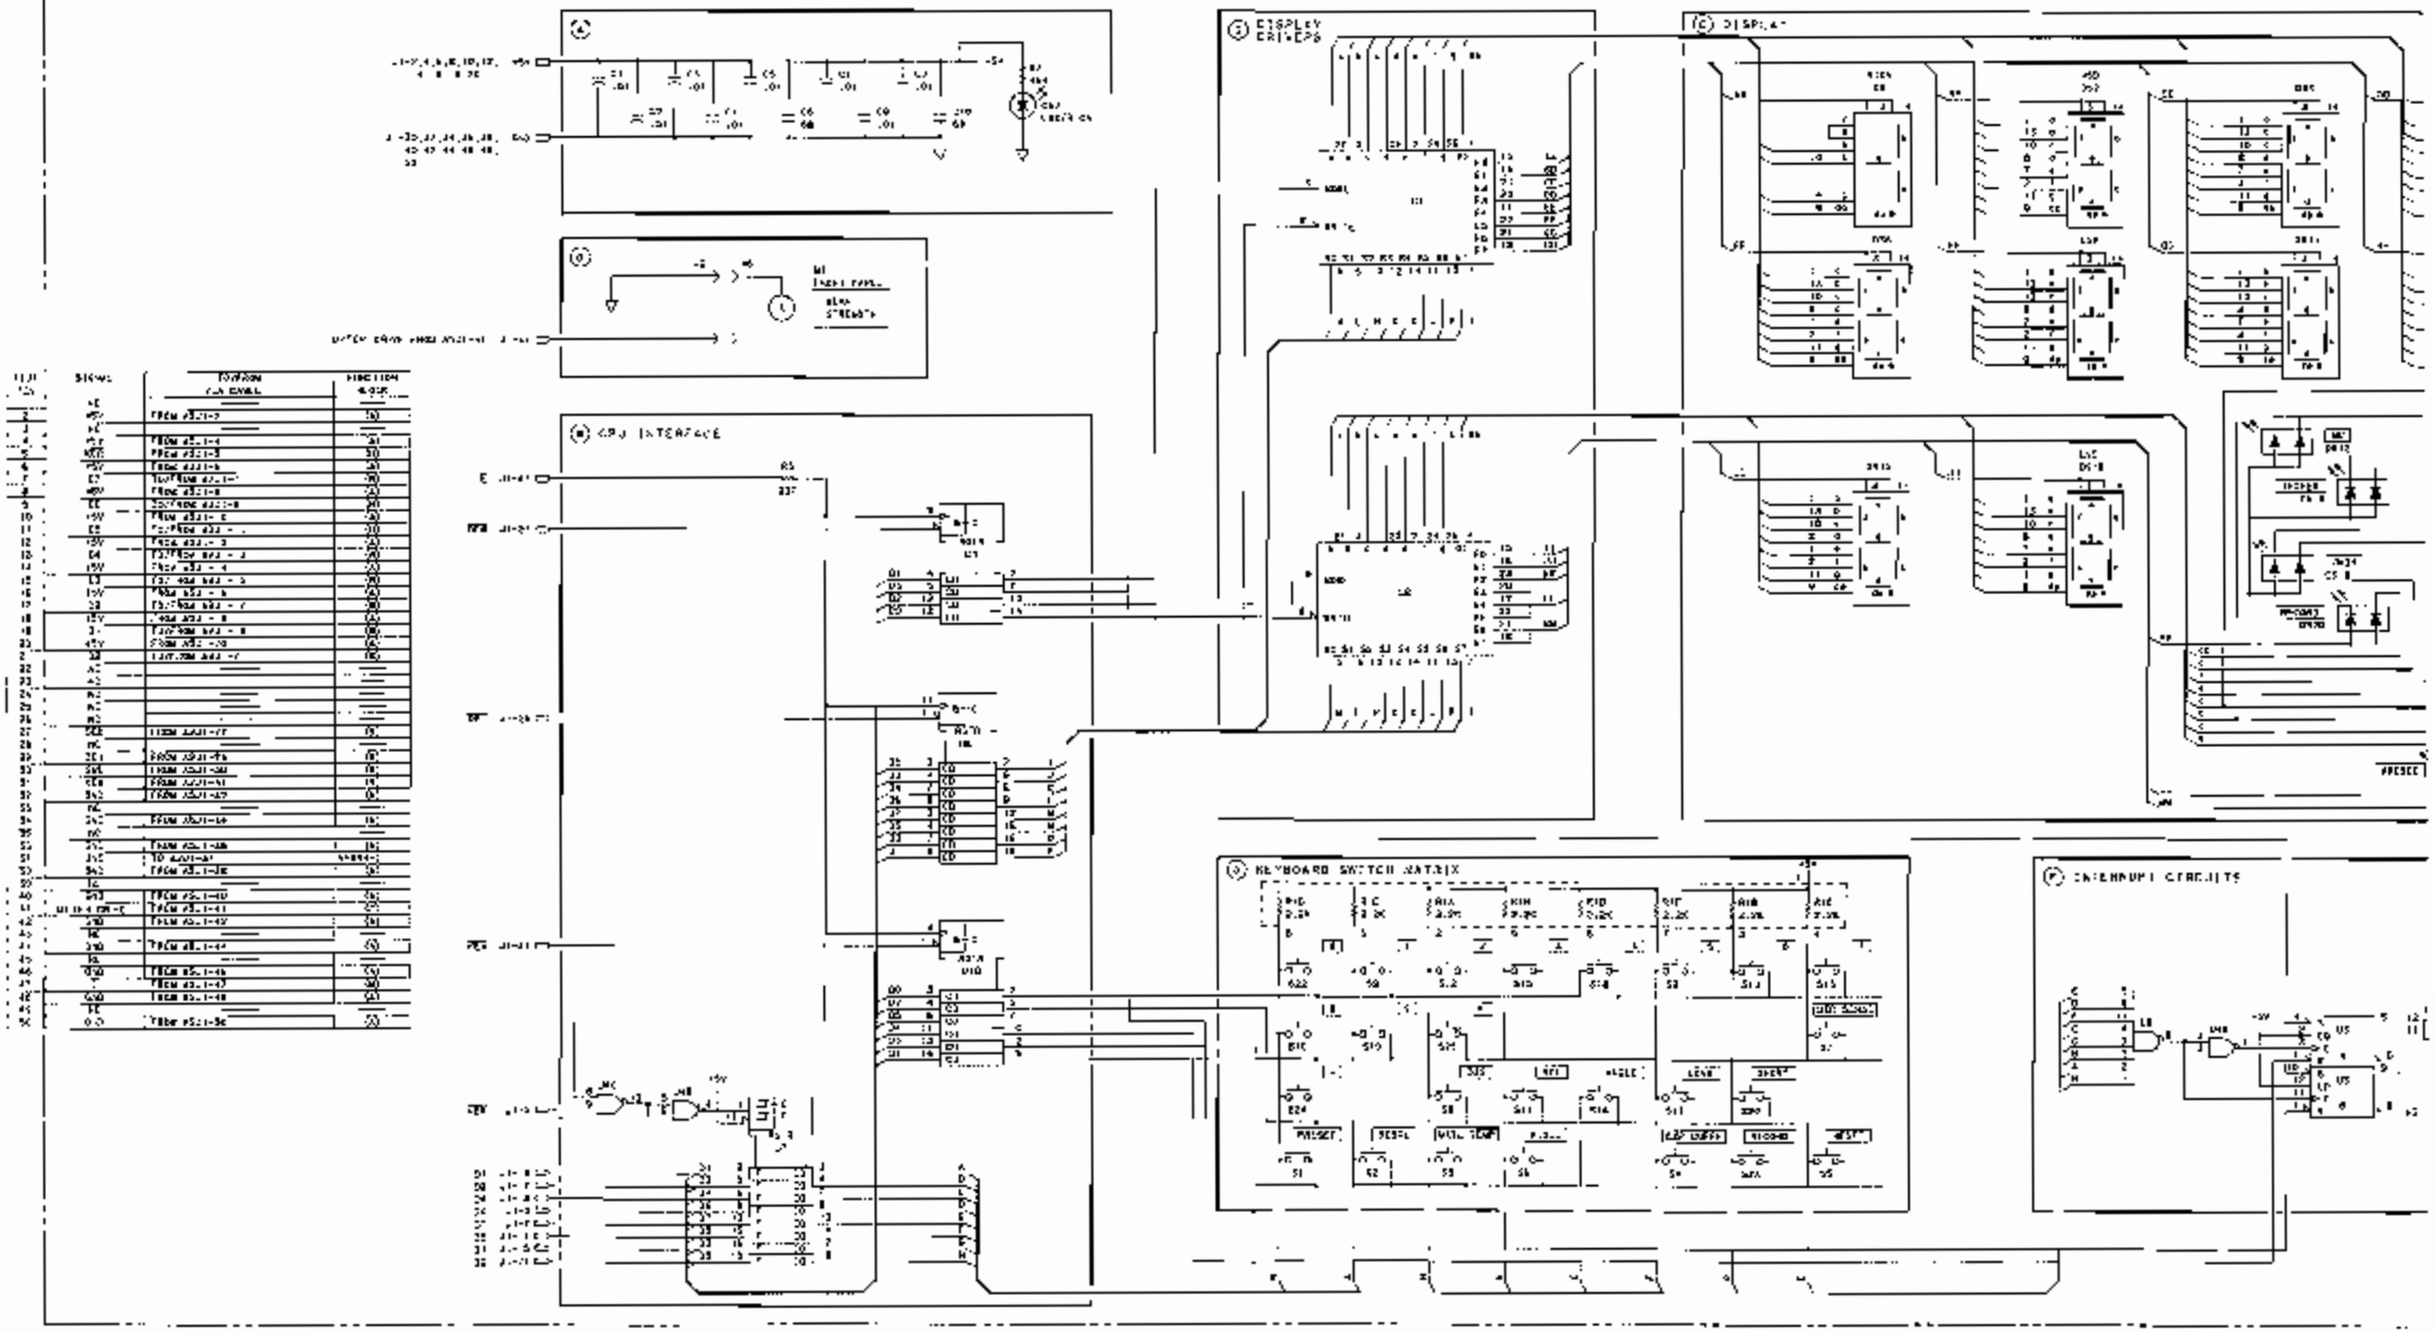
④
⑤
⑥ CPU INTERFACE
⑦ DISPLAY DRIVERS
⑧ DISPLAY
⑨ KEYBOARD SWITCH MATRIX
⑩ INTERRUPT CIRCUITS

Figur

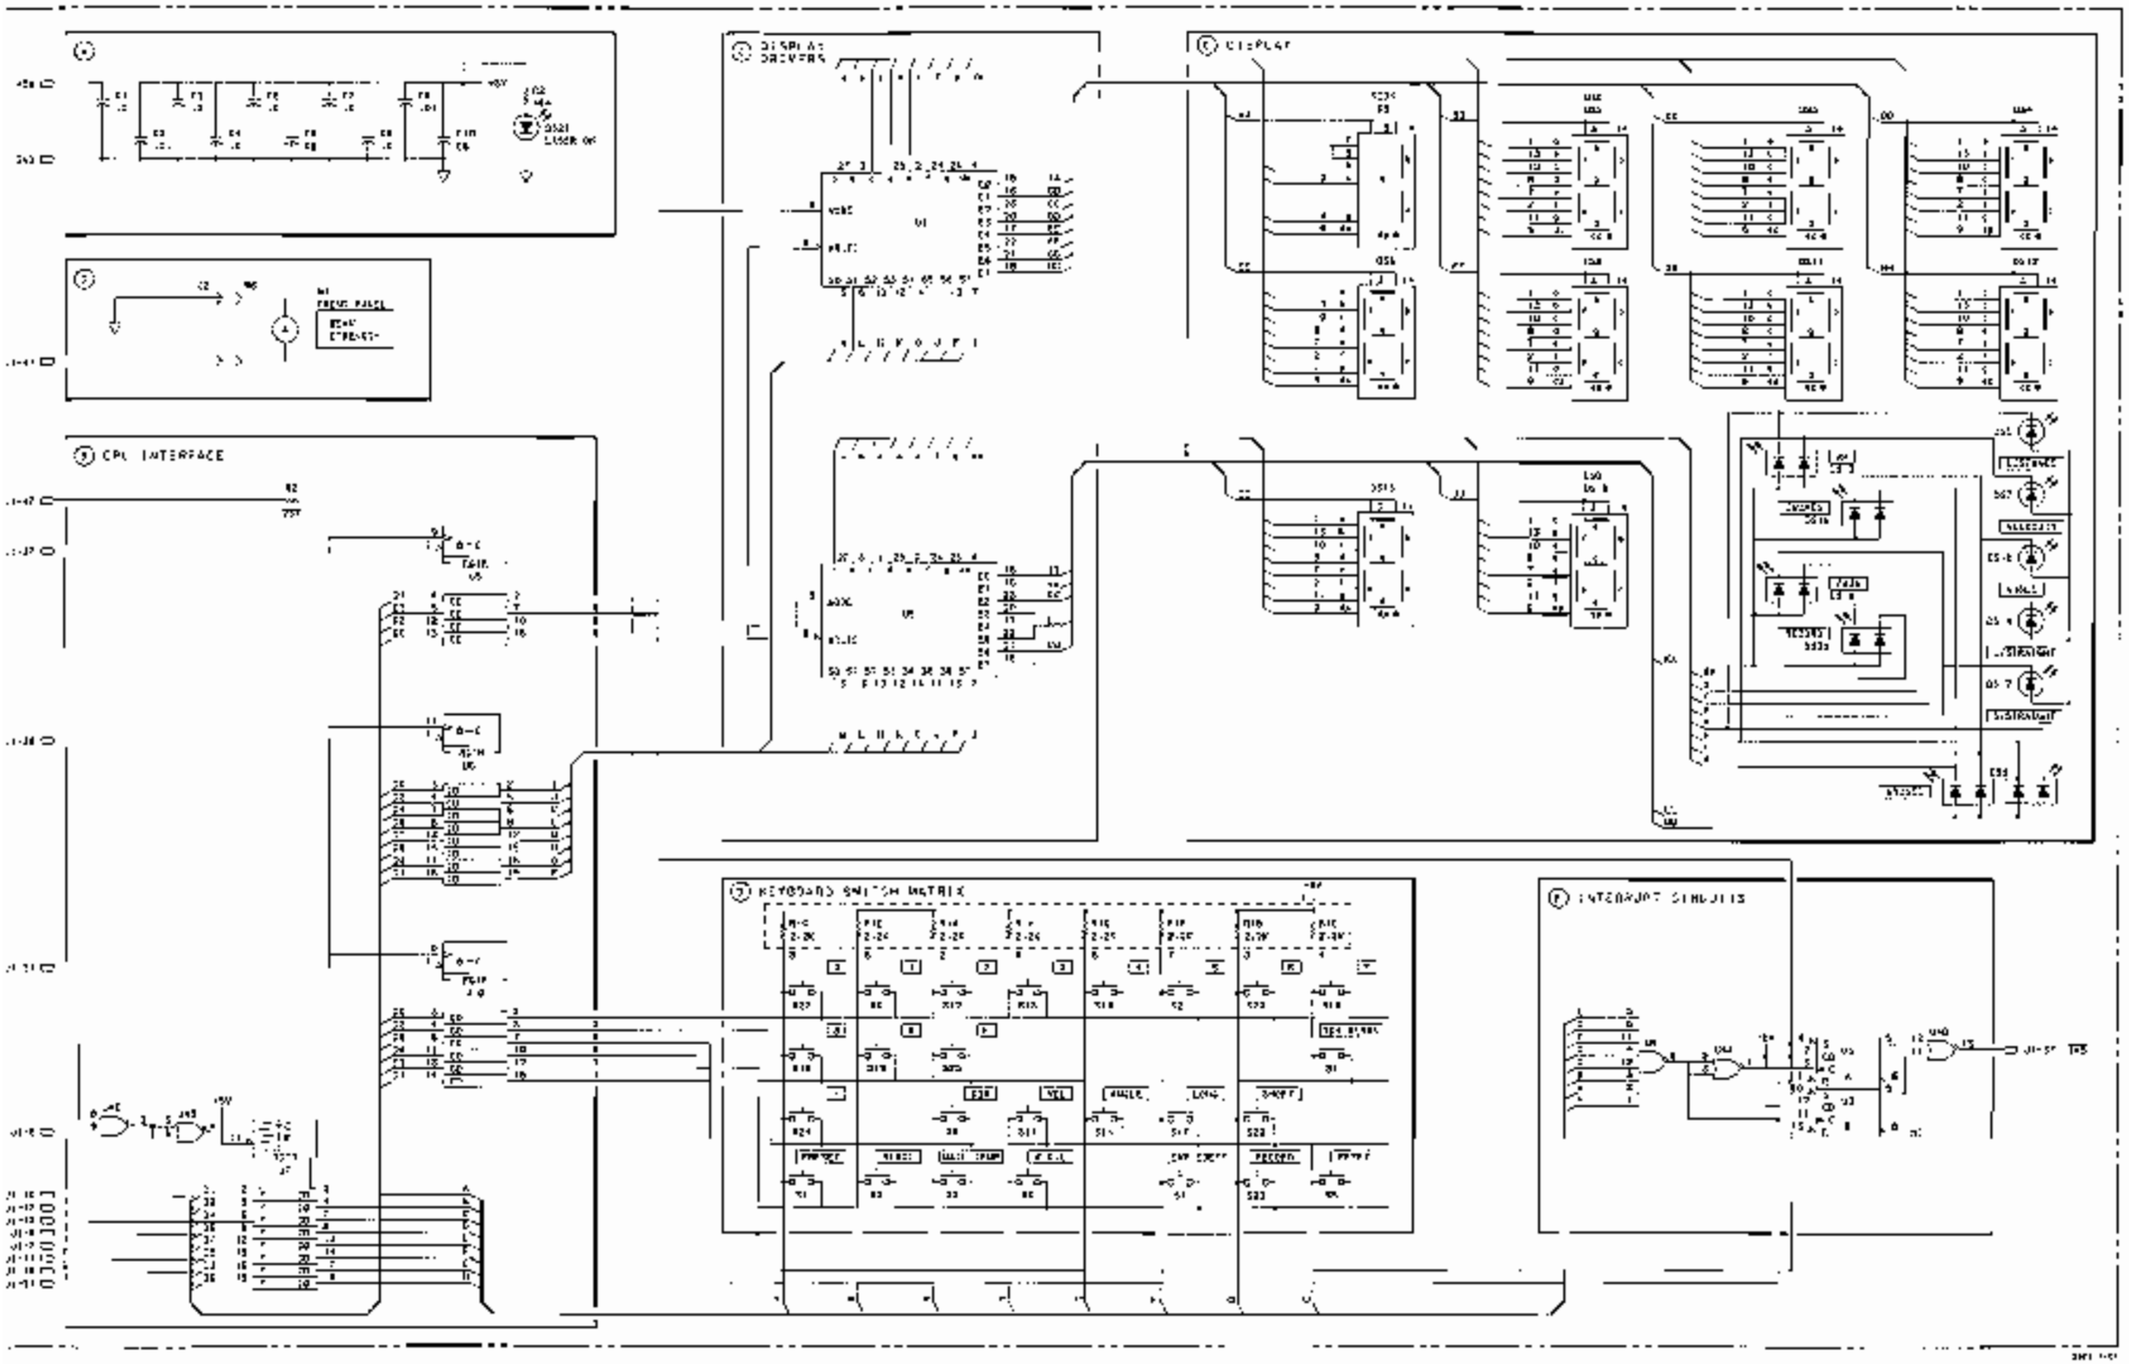


Figure 8-B-5. 5308A A1 Keyboard/Display Board 05528-60001

Figure 8-3
5508A A1 KEYBOARD/DISPLAY BOARD 5508A-8W003

(See Page 8-15)

8-B-51. 5508A A2 PROCESSOR BOARD CIRCUIT THEORY

8-B-52. Paragraphs 8-B-53 through 8-B-72 contain circuit theory for Processor Board A2. Paragraphs 8-B-73 through 8-B-109 cover the troubleshooting and signature analysis information.

8-B-53. The schematic diagram for Processor Board A2 is shown in Figure 8-B-16. The schematic has functional blocks that are labeled alphabetically with circled letters. These labels correspond to the circled letters in the text for the circuit theory.

8-B-54. Processor Ⓑ and English/Metric Switch Ⓖ

8-B-55. The heart of the Processor Board is U13, a type 6803 microprocessor unit (MPU). The MPU executes instructions stored in ROM based memory to control the counters, keyboard, displays, and analog to digital converter.

8-B-56. Crystal Y1 supplies 4 MHz to U13 pins 2 and 3. The MPU divides the 4 MHz by 4 to produce the system clock "E" at U13 pin 40. "E" is a 1 MHz square wave that synchronizes the timing throughout the 5508 except for the asynchronous counters.

8-B-57. Pins 13 thru 20 of the MPU are Input/Output port lines. In normal operation, pin 13 is set as an output, and the rest are all inputs. Pins 16 through 20 correspond to the TEST SWITCH positions and are only read at power up. Setting these switches to positions other than zeroes corresponds to different troubleshooting tests. Troubleshooting tests and corresponding switch positions are summarized in Table 8-B-2. Pin 14 of the MPU senses the position of the English/Metric switch, and Pin 13, as an output, initializes the English/Metric circuitry, U15.

8-B-58. Note that the MPU Input/Output port lines are programmed as either inputs or outputs during program execution and cannot be accessed. Consequently, if the MPU is not running properly, it is futile to check the logic polarity of the TEST SWITCH bits since a line expected to be a logic 1 input (5 volts) may be incorrectly programmed as a logic 0 output (0 volts). Rather, turn power off and use an ohmmeter to check the TEST SWITCH bits.

8-B-59. Master Reset Section Ⓒ

8-B-60. The Master Reset section generates $\overline{\text{RESET}}$ when the 5508A powers up or when the MASTER RESET switch on the front of the Processor Board is toggled. When $\overline{\text{RESET}}$ occurs, a low to high transition completely resets the MPU. Upon reset, U13 pins 8, 9, and 10 are at logic 0, 1, and 0 respectively to set the MPU to the initial start up configuration.

8-B-61. Priority Interrupt Ⓐ

8-B-62. Two types of interrupt signals are supplied to U13, an $\overline{\text{INTERRUPT REQUEST}}$, ($\overline{\text{IRQ}}$), and a $\overline{\text{NON MASKABLE}}$ interrupt ($\overline{\text{NMI}}$). $\overline{\text{NMI}}$ can be asserted (0 volts) by the Measurement or Reference Frequency Pulse Counters or the external Record button on the remote control box. $\overline{\text{IRQ}}$ originates from one of five sources:

a. HP-IB (U12 pin 13)

b. English/Metric switch (U12 pin 12)

c. Keyboard ($\overline{\text{IN5}}$)

d. Analog to Digital Converter ($\overline{\text{IN4}}$)

e. External Reset ($\overline{\text{IN7}}$)

8-B-63. When one of the five lines above goes low (0 volts), decoder U12 determines which of the 5 input lines was asserted. Note that three of the input lines to U12 are always tied high through pullup resistor pack R13. U12 outputs, pin 6, 7, and 8, provide a 3 bit number which the MPU reads to determine the source of an interrupt. The MPU reads this 3 bit result after $\overline{IRQ}$ goes low and proceeds to execute the proper interrupt service program.

8-B-64. ROM (E) and RAM (I)

8-B-65. The MPU outputs address information onto the address bus and either waits for data (a READ operation), or outputs data onto the data bus (a WRITE operation). The R/$\overline{W}$ line (U13 pin 28) is high for a read, and low for a write. ROMS U5, U6, U7, U8, and U9 contain the program memory, and the proper ROM is selected by U10 or U11B. U1 and U2 are RAM's (R/W memory) with U1 corresponding to the lower 4 bits of the data bus, and U2 the higher 4 bits. U20A selects these RAM's.

8-B-66. Data Bus Driver (J)

8-B-67. U4 acts as a bidirectional data bus buffer to drive Cable W1. U4 is selected when a read or write operation is required off the Processor Board. For example, when the processor reads data from the counters, U4 on the counter board is used to buffer data from the cable to the processor.

8-B-68. Address Decode Section (F)

8-B-69. U19, U21, and associated circuits generate the enable lines for circuitry located on other boards, i.e., lines that are required to enable registers (such as a counter or display). When one of these lines goes low, the processor either clocks data out to the peripheral, or waits for the peripheral to send data to the MPU.

8-B-70. U14 implements data bus/address bus multiplexing that is required by the MPU. MPU pins 30 through 37 are used by the MPU as data bits D0 - D7 and address bits A0 through A7. Pin 39 of the MPU clocks U14 when A0 through A7 goes valid (falling edge of signal at pin 39).

8-B-71. HP-IB Circuits (K) (H) (L) (M)

8-B-72. HP-IB DIP switch S1 selects the HP-IB address. When enable line $\overline{ASE}$ goes low, U3 buffers and places the HP-IB address on the data bus for the processor to read. This only occurs on power up. All of the HP-IB functions are implemented by the HP-IB processor U24. U18 and U23 act as buffers to drive HP-IB cables.

8-B-73. 5508A A2 PROCESSOR BOARD TROUBLESHOOTING

8-B-74. The Processor Board troubleshooting consists of signature analysis tests that require the HP 5005A Signature Multimeter. For all tests, connect the signature analyzer as follows:

CLOCK LEAD: To CLOCK test point on Processor Board

START LEAD: To START test point on Processor Board

STOP LEAD: To STOP test point on Processor Board

8-B-75. Before testing the signatures, check the 5 Volt test signature to ensure that the desired program is running. Where appropriate, signal paths leading to a node that gives an incorrect signature should be traced back until a correct signature is found. The faulty node should then be apparent and if the bad component is not obvious, current tracing or other techniques will be required. The integrity of traces attached to a bad node should always be verified before any components are replaced. Whenever a correct signature is the last one given along a signal path, verify that all traces leading from that node are also OK.

8-B-76. Processor Board TEST SWITCH

8-B-77. TEST SWITCH A2S3 selects test programs stored in ROM. After entering the correct number into A2S3, the MASTER RESET switch must be toggled. The MPU reads A2S3 after the master reset and runs the corresponding test program. The individual test procedures in this manual show the A2S3 positions as well as any other required switch or jumper positions.

8-B-78. Troubleshooting Procedures

a. Perform Test 1 in Paragraph 8-B-79.

b. Perform Test 2 in Paragraph 8-B-83. If OK go to h, else replace with U5.

NOTE: Steps c through g have been deleted.

h. Move A3 JMP 2 to TEST. Perform Test 3 in Paragraph 8-B-85. If bad, trace to back facing node, else i. Move A3 JMP 2 back to NORM.

i. Perform Test 4 in paragraph 8-B-87. If OK go to k, else j.

j. Remove A2 JMP 2. Perform Test 10 in Paragraph 8-B-93. If bad, replace U23, else replace U1 or U2, depending on which data line is bad.

k. Perform Test 5 in Paragraph 8-B-88. Are U4 pins 2 - 9 OK? If so n.

l. Remove Keyboard. Perform Test 5 in paragraph 8-B-88. Are U4 pins 2 through 9 OK? If so there is a key board data bus fault. Go to Data Bus Fault Location. Else m.

m. Remove Counterboard. Perform Test 5 in Paragraph 8-B-88. Are U4 pins 2 through 9 OK? If so there is a Counter board Data Bus problem. Else replace U4.

n. Perform Test 5 in Paragraph 8-B-88. Are U4 pins 11 - 18 OK? If not replace U4, else o.

o. Perform Test 5 in Paragraph 8-B-88 while pressing the keyboard keys. Are U4 pins 11 through 18 OK? If so q, if not p.

p. Perform Test 5 in Paragraph 8-B-88 while pressing the keyboard keys. Are U4 pins 2 through 9 OK? If so, replace U4. Else go to the keyboard procedures

q. Perform Test 6 in Paragraph 8-B-90 if the interrupt circuitry is suspect. If Test 6 fails replace U12. Else Processor board checks out OK.

Table 8-B-3. Summary of 5508A Processor Board A2 Signature Analysis Tests


Test #	Test Switch A2S3 Switch Position	Circuitry Under Test
1	00000001	Kernel : U13, U14, J9
2	00000010	All ROMS U5 - U9
3	00000011	Decode: U11*, J13, U14, U15*, J17*, U19 U20, U21
4	00000100	A1 RAM: U1, U2, U*3
5	00000110*	Data Bus Buffer: U4
6	00000001	Interrupt Encoder, U12
10	00000100	MPU Internal RAM, U13

*Not all of this IC is tested

8-B-79. Test 1, Kernel Test

8-B-80. This test uses the smallest part of the Processor Board circuitry necessary to verify operation of the MPU.

a. On Processor board A2, set switches and jumpers as follows

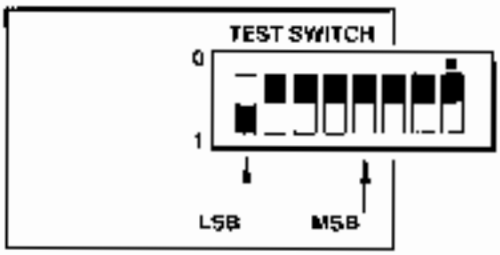

JMP2: INSTALLED

b. Toggle MASTER RESET switch and measure signatures at the following nodes:

1. +5 V Test Signature: UP73

2. Kernel Signatures:

U13 Pin No.		U14 Pin No.		U15 Pin No.		U17 Pin No.	
22:	UP72	2:	ACH3	1:	UP73	2:	0000
23:	UP72	5:	9COH	2:	UP73	4:	000F
24:	UP72	6:	86CP	3:	0020	6:	UP72
25:	UP72	9:	7L3P			10:	0001
26:	UP72	12:	UP72				
27:	024H	15:	U24H				
28:	024H	16:	UP72				
29:	UP72	19	UP72				
30:	A18H						
31:	20F9						
32:	07U4						
33:	02H8						
34:	A98H						
35:	0741						
36:	A64C (A64A if in TEST						
37:	02FC						

8-B-91. If any of the kernel signatures are incorrect and the fault cannot be isolated, remove the data bus jumper A2JMP2 and check the above signatures again. If the signatures are now correct, check data bus traces for shorts or opens using a current tracer and logic pulser. Also check ROM and RAM enable lines for shorts.

8-B-92. If the fault causing incorrect signatures can not be isolated, then the MPU or one of its inputs may be at fault. Check the following MPU inputs:

a. Verify +5 V and Ground

b. U13 pins 2 and 3 should be 4 Mhz sine waves

c. U13 pins 4, 6, 9 = +5 V


d. U13 pin 8 = 0 V

e. Check for a 1 mhz square wave at U13 pin 40.

8-B-83. Test 2. All ROMS Test

8-B-84. This test verifies operation of U5, assuming that the kernel is functioning properly. All ROM locations are read and data bus signatures are checked to confirm ROM contents.

a. On Processor Board A2, set switches and jumpers as follows:

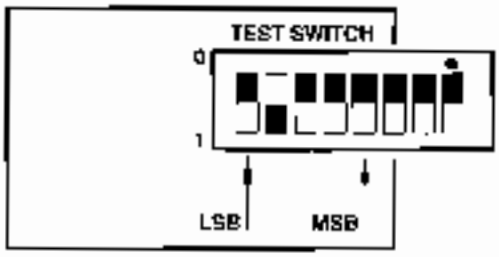

JMP2: INSTALLED

b Toggle MASTER RESET switch and measure signatures at the following nodes:


+5 V Test Signature – 3F94

U13 Pin No.	U14 Pin No.	U17 Pin No.	U11 Pin No.
22: 3F9H	2: FCF7	3: 4061	8: 0009
23: 3F9H	5: 24C9	4: 7FU5	
24: 4061	6: 3FA7	5: 7FU5	
25: 8FFP	9: CUUF	6: 4061	
26: 2975	12: F7P6	10: 0009	
27: U7C5	15: 2426	11: 3F911	
28: 6771	16: 476F	12: 3F94	
29: 5976	19: 055F	13: 0000	
30: 887F			
31: 70611			
32: C60P			
33: 3PCF			
34: CA5H			
35: 3A07			
36: F088			
37: F40U			

8-B-85 Test 3. Decode Test

8-B-86. During this test, the MPU enables all locations in memory to verify proper operation of all address decoder circuits. Tracing signatures back from known bad nodes should be sufficient for fault isolation.

a. On Processor Board A2, set switches and jumpers as follows:

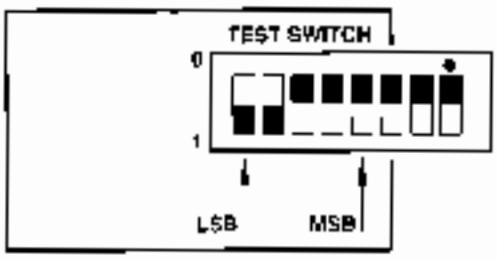

JMP2: INSTALLED

b. On A3, set JMP2 to TEST.

c. Toggle MASTER RESET switch and measure signatures at the following nodes:

+5 V Test Signature: 399F

U19 Pin No.	U21 Pin No.	U24 Pin No.	U20 Pin No.
9: HF2F	10: 9A28	4: HO58	12. 63C1
10: 47F7	11: 6500		6: H72A
14: U986	14: U152		8: PC15
15: 87H2	15: C591		


U18 Pin No.	U17 Pin No.	U11 Pin No.
8: JF3U	8: U16U	8. P268
6: 2H94	10: 790C	
	6: 0F46	
	4: A5HA	

U14 Pin No.	U13 Pin No.
2: 74A9	22: 3995
5: P65P	23: 4093
6: 62FH	24: 9F46
9: 7875	25: A8F6
12: 0377	26: FCUF
15. 312A	27: P82C
16. 0UPA	28: UF80
19: F8U3	29: 0F07
	38: 2H94
	40: 399F

8-B-87, Test 4. All RAM Test

8-B-87a. The Processor Board has 1152 bytes of RAM. The MPU has 128 bytes of internal RAM, RAMS U1 and U2 contain a totall of 1024 bytes. During this test, the MPU writes to and reads from RAM locations. Test 10 exercises the MPU internal RAM only and should be used for isolation it this test reveals any incorrect signatures. After using test 10 to verify proper internal RAM operation, fault isolation between U1 and U2 is possible because data lines D0 - D3 go to U1 and D4 - D7 go to U2.

a. On Processor Board A2, set switches and jumpers as follows:

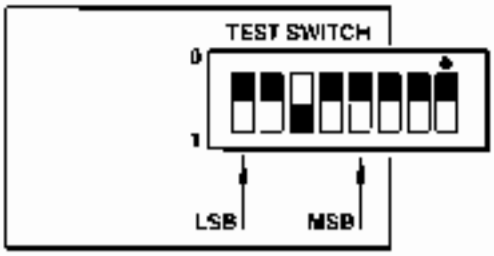

JMP 2: INSTALLED

b. Toggle MASTER RESET switch and measure signatures at the following nodes:


+5 V Test Signature = 4963

U13 Pin No.	
30:	1H86
31:	C0U2C
32:	78U1
33:	6810
34:	A8U1
35:	4529
36:	H36H
37:	A9U4

8-B-88 Test 5. Data Buffer

8-B-88a. This test verifies the operation of U4 and can also be used to check the data bus on A1 and A3. If off the board bus verification is required, the signatures in parentheses shown below should be observed with the indicated key held closed.

a. On Processor Board A2, set switches and jumpers as follows:

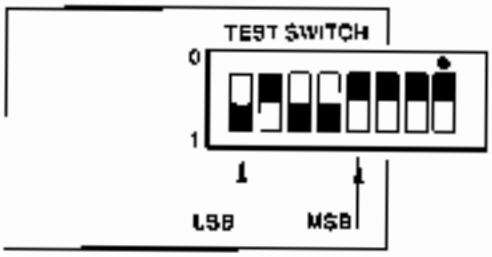

JMP2: INSTALLED

b. Toggle MASTER RESET switch and measure signatures at the following nodes:

+5 V Test Signature = F1F21

U4 INPUTS

U4 Pin No.

11: H2F7 (U0UF with PRESET key)
12: P3P0 (F1HC with RESOL key)
13: 4U4A (ACC0 with DISTANCE key)
14: 3887 (HF7H with VELOCITY key)
15: 60U3 (5429 with ANGLE key)
16: HCCF (3U46 with LONG key)
17: 6H35 (89FL with SHORT key)
18: U767 (H55F with RESET key)

U4 OUTPUTS

U4 Pin No.


9: 9PC6 (CF8H with PRESET key)
8: HH19 (UU22 with RESOL key)
7: 223F (F6F6 with DISTANCE key)
6: 26U5 (F20U with VELOCITY key)
5: 4AOC (APUt with ANGLE key)
4: 1OU5 (U4OU with LONG key)
3: P178 (0562 with SHORT key)
2: 0916 (2C23 with RESET key)

8-B-89. Test 6. Interrupt Encoder Test

8-B-90. The Processor Board receives interrupts from the following circuits: English/Metric switch, HP-IB circuits, A1 board, A3 board, and External Reset. A2U12 encodes these interrupts and sends a 3-bit code to the MPU. The MPU uses the 3-bit code to determine which interrupt caused $\overline{IRQ}$ to go low. Use Test 6 only when the MPU does not respond properly to the interrupts.

a Disconnect Cable W1 from A1 and A3.

b. On Processor Board A2, set switches and jumpers as follows:

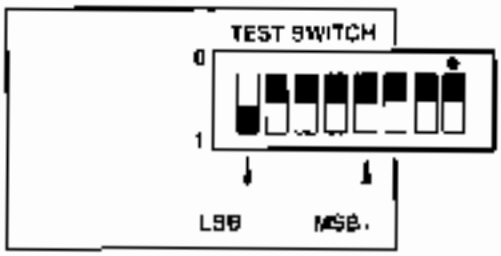

JMP2: Don't Care

c Verify the following:

U12 pins 1, 2, 3, 4, 10, 11, 12, and 13 are high

U12 pin 5 low

U12 pins 6, 7, and 9 are tri-state (Logic Probe dimly lit)


d. Connect an IC test clip to U12. Using a test lead with one end connected to a ground test point, ground the pins indicated in the truth table as low and check U12 output pins 6, 7, 9 and U13 pin 5. For example, in the first test, ground U12 pin 4 and probe U12 pins 6, 7, 9 and U13 pin 5 for low logic levels. Repeat for each line in the truth table.

NOTE

Toggle MASTER RESET after each line of the truth table is verified.

Inputs U12 Pins								Outputs U12 Pins			U13
10	11	12	13	1	2	3	4	6	7	9	Pin 5
H	H	H	H	H	H	H	L	L	L	L	L
H	H	H	H	H	H	L	H	L	L	H	L
H	H	H	H	H	L	H	H	L	H	L	L
H	H	H	H	L	H	H	H	L	H	H	L
H	H	H	L	H	H	H	H	H	L	L	L
H	H	L	H	H	H	H	H	H	L	H	L
H	L	H	H	H	H	H	H	H	H	L	L
L	H	H	H	H	H	H	H	H	H	H	L

e. Reset TEST SWITCH A2S3 as shown below (Test Mode). Toggle MASTER RESET. Check that the inputs and outputs of U12 and U13 pin 5 are not stuck low.

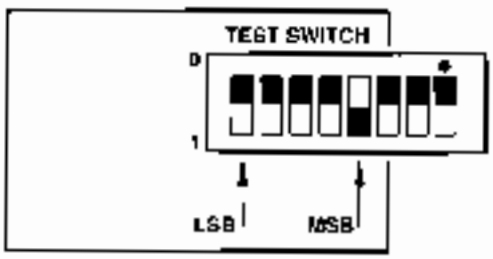


8-B-91. ***HEADING DELETED***

NOTE: Heading 8-B-91 and paragraph 8-B-92 have been deleted. Text continues with heading 8-B-93, below.

8-B-93. Test 10. Internal RAM Test

a. On Processor Board A2, set switches and jumpers as follows:

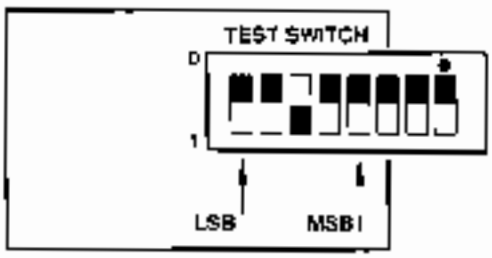

JMP2: REMOVE

b. Toggle MASTER RESET switch and measure signatures at the following nodes:

+5 V Test Signature: 4963

U13 Pin No.

30: 1186
31: C0VC
32: 70U1
33: 6810
34: A8U1
35: 4529
36: H36H
37: A9U4

8-B-94. HP-IB Troubleshooting


8-B-95 HP-IB processor U 24 receives inputs from the MPU and implements all of the HP-IB functions. U24 drives the HP-IB cable by means of buffers U18 and U23. If there is an HP-IB problem, it most likely exists in buffers U18 or U23, if not, check U24.

8-B-96. Start Troubleshooting by using signature analysis to verify that all inputs to U24 are OK. U24 pin 3 ($\overline{CS}$) and pin 4 (ASE) can be checked using Processor Board Test 3, the decode test.

8-B-97. If U 24 is receiving the proper inputs, the next step is to check the operation of buffers U18 and U23. This is accomplished using an oscilloscope or logic probe and an HP 59401 HP-IB Bus Exerciser. Use the Bus Exerciser to freeze action on the HP-IB and then probe points on U18 and U23 to determine if the buffers are working properly. Use a controller such as an HP 85 to initiate bus activity. If these checks are good then U24 must be the problem, since its inputs are OK and buffers U18 and U23 are OK.

8-B-98. HP-IB Verification

a. On Processor Board A2, set TEST SWITCH as shown below:

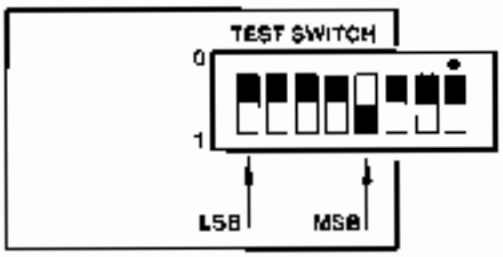

b. Set HP-IB Address switch to 03 and ADDRESSABLE.


c. Press MASTER RESET switch or set main POWER switch to ON. This places the 5508A in TEST mode.

d. Using an HP-IB Controller, write HP-IB commands to the 5508A and verify that the 5508A responds.

e. Set HP-IB Address switch to "TALK ONLY".

NOTE. Text continues with step "f" at the top of page 8-B-31.

e. For test 9, set TEST SWITCH A2S3 as shown below.

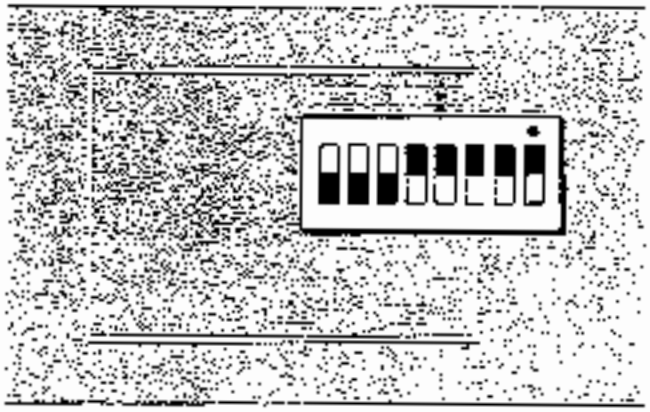

f. Toggle MASTER RESET switch and measure signatures at the following nodes:

+5 V Test Signature: 237C


U13 Pin No.

30: PC1P
31: 9U0U
32: H14S
33: 2CP3
34: H68F
35: C103
36: H12P
37: 202S

If test 9 is OK but test 8 indicates a failure, replace U7. If test 9 gives the first indication of failure, replace U5. If both tests indicate a failure, replace U6. If tests 7, 8, and 9 give correct signatures and test 2 indicates a failure, then replace U8.

8-8-83. Test 10, Internal RAM Test

a. On Processor Board A2, set switches and jumpers as follows:

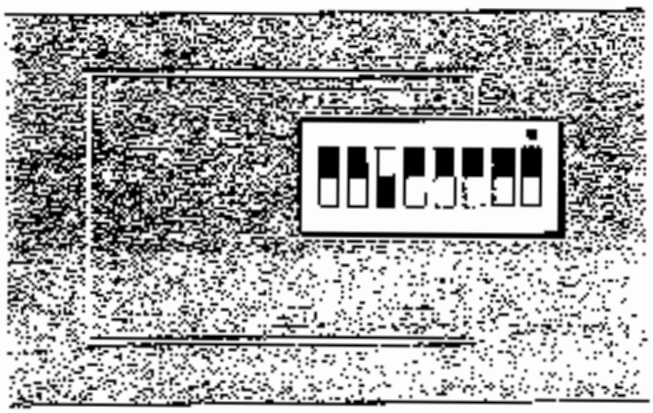

JMP1: NORM

JMP2: REMOVE

b. Toggle MASTER RESET switch and measure signatures at the following nodes:

+5 V Test Signature: 4963

U13 Pin No.

30: P168
31: 2A54
32: 2A1U
33: U2CU
34: 790U
35: UFU6
36: 2163
37: 102C

8-B-94. HP-IB Troubleshooting


8-B-95. HP-IB processor U24 receives inputs from the MPU and implements all of the HP-IB functions. U24 drives the HP-IB cable by means of buffers U18 and U23. If there is an HP-IB problem it most likely exists in buffers U18 or U23. If not, check U24.

8-B-96. Start troubleshooting by using signature analysis to verify that all inputs to U24 are O.K. U24 pin 3 ($\overline{CS}$) and pin 4 ($\overline{ASE}$) can be checked using Processor Board Test 2, the decode test.

8-B-97. If U24 is receiving the proper inputs, the next step is to check the operation of buffers U18 and U23. This is accomplished using an oscilloscope or logic probe and an HP 59401 HP-IB Bus Exerciser. Use the Bus Exerciser to freeze action on the HP-IB and then probe points on U18 and U23 to determine if the buffers are working properly. Use a controller such as an HP 85 to initiate bus activity. If these checks are good, then U24 must be the problem, since its inputs are OK and buffers U18 and U23 are OK.

8-B-98. HP-IB Verification

a. On Processor Board A2, set TEST SWITCH as shown below.

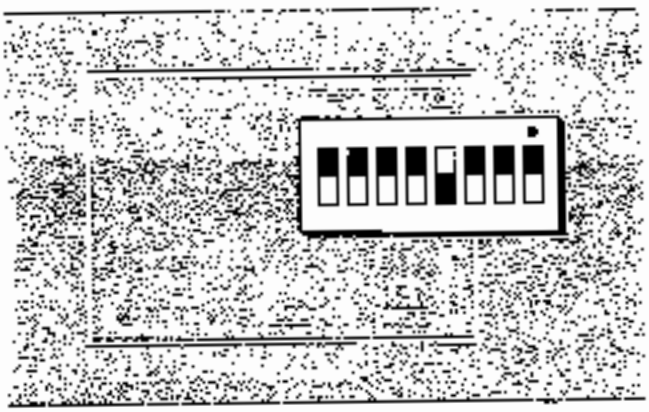

b. Set HP-IB Address switch to 03 and ADDRESSABLE.

c. Press MASTER RESET switch or set main POWER switch to ON. This places the 5508A in TEST mode.

d. Using an HP-IB Controller, write HP-IB commands to the 5508A and verify that the 5508A responds.

e. Set HP-IB Address switch to "TALK ONLY".

f. Press "MASTER RESET" switch.

g. Connect an HP-IB display box or printer as a listener and enter " 5 RECORD" on the 5508A.

h. The HP-IB listener should follow the 5508A display within about 1/2 second. Verify by pressing several keys on the 5508A and check that the external display tracks the display within 1/2 second.


8-B-99. Data Bus Fault Location

8-B-100. Use the following procedures if you suspect a data bus line is shorted to Vcc, ground or another signal trace. Open data line traces, open IC inputs, or open IC outputs can be located by the corresponding signature analysis test. In most cases, signature analysis testing should precede these procedures. Fault location requires that the data bus on Processor board A2 be isolated from the data bus for the rest of the instrument. The 5506A trouble isolation and processor board troubleshooting sections will help determine whether the fault is on the processor board or elsewhere.

8-B-101. The following items of test equipment are recommended for data bus fault location. If necessary, refer to the appropriate test equipment operating manuals.

HP 545A Logic Probe
HP 546A Logic Pulser
HP 547A Current Tracer

8-B-102. Isolate the processor board by setting the TEST SWITCH A2S3 as shown below (kernel test) and toggle MASTER RESET A2S2.

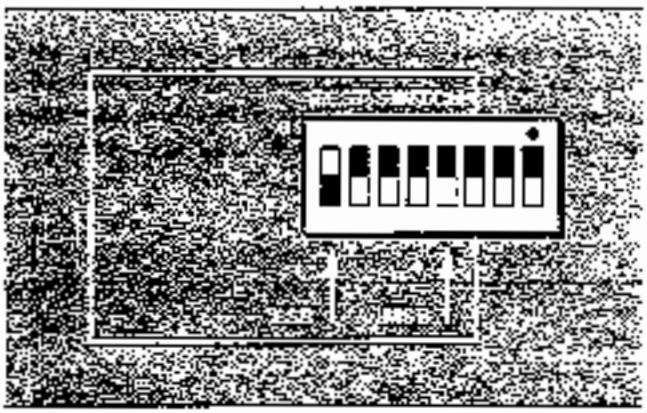

15 TEST SIGNATURE = UP70

8-B-103. The following Signature Analysis test should run throughout the remainder of the procedures. The kernal test disables the data bus driver A2U4 with a high level on pin 19 (verify +5 at pin 19). When disabled, all A2U4 input/output pins are in the high impedance state. Therefore, all data bus lines on the cable W1 side of A2U4 should be held high by pull up resistors A2R18. Without A2R18, the bus lines on cable W1 side of A2U4 would float (in the absence of shorts). Check for the high states on all cable W1 data lines.

8-B-104. If any of the data lines on cable W1 are either toggling or stuck low, isolate between A1 and A3 by alternately disconnecting them from cable W1. If disconnecting A1 and A3 does not change the problem, determine the direction of current flow from A2R18 before replacing A2U4. To determine current direction, use a current probe for toggling lines, use a current probe with a logic pulser when a line is stuck low.

8-B-105. After isolating the fault to A1 or A3, use the appropriate procedure below. If the fault is on the processor board go to the processor board troubleshooting section.

8-B-106. Bus Line Is Stuck Low

a. Using a logic pulser, apply a 100 Hz pulse train to the suspected data line.

b. Hold the current tracer probe against the logic tracer probe and adjust the current tracer for a dim glow.

c. Using the adjusted current probe, check for current at the IC pins shown in the appropriate trace maps. See Table 8-B-3. Any pin causing a short to ground will be indicated by the glow of the current probe.

d. If none of the pins on the trace maps cause the current probe to glow, locate the short by probing the traces. Starting from the pulser, follow each branch of the trace with the current probe until the probe light goes out. The trace maps show the true positions of the traces on the board. The current probe can detect current in the internal traces of multilayer boards.

8-B-107. Data Line is Toggling

a. Adjust current tracer so that it emits a dim glow when held against the faulty trace near A2R18.

b. Check all IC pins on the corresponding trace map for current flow. Any pin causing the current probe to glow should be removed from the circuit.


c. If none of the pins on the trace map cause the current probe to glow, locate the short by probing the traces starting from the data line input at Cable W1. Follow each branch of the trace with the current probe until the probe light goes out.

8-B-108. Bus Line Shorted to Vcc

8-B-209. If you suspect a data line is shorted to Vcc, a logic pulser and logic probe can be used to verify the short. The HP 546A logic pulser can usually drive any of these data lines low. If the pulser is unable to drive a data line low, a current tracer can be used with the pulser to first isolate the faulty board then to locate the trace short of IC pin causing the short. After isolating the faulty board, refer to the appropriate data line trace maps (see Table 8-B-3) to locate the short.

Table 8-B-3. 5508A Data Line Trace Maps

5508A Assembly	Data Line	Illustration
A3	D0 and D1	Figure 8-B-6
A3	D2 and D3	Figure 8-B-7
A3	D4 and D5	Figure 8-B-8
A3	D6 and D7	Figure 8-B-9
A1	D0 and D1	Figure 8-B-10
A1	D2 and D3	Figure 8-B-11
A1	D4 and D5	Figure 8-B-12
A1	D6 and D7	Figure 8-B-13
A2	D0 and D1	Figure 8-B-14
A2	D2 and D3	Figure 8-B-15
A2	D4 and D5	Figure 8-B-16
A2	D6 and D7	Figure 8-B-17

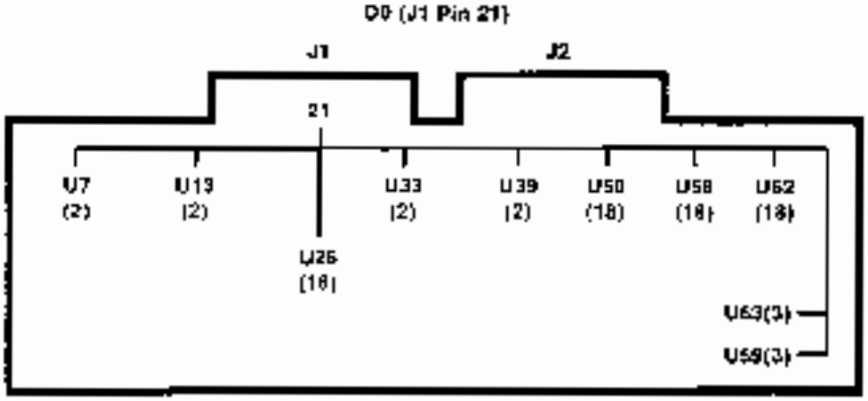

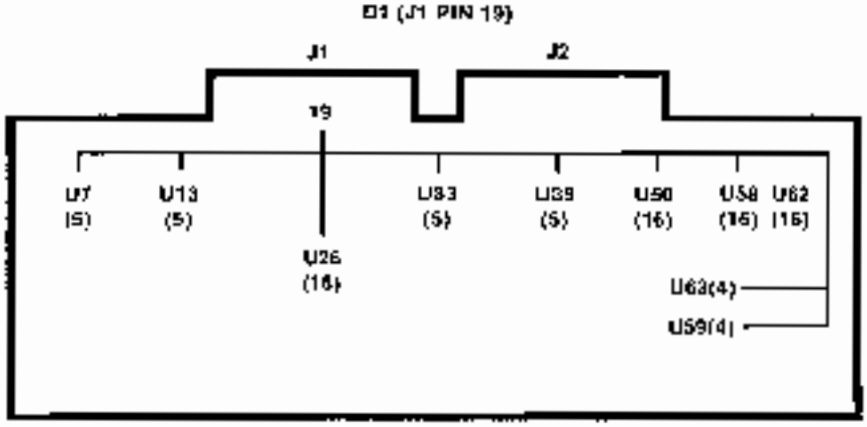
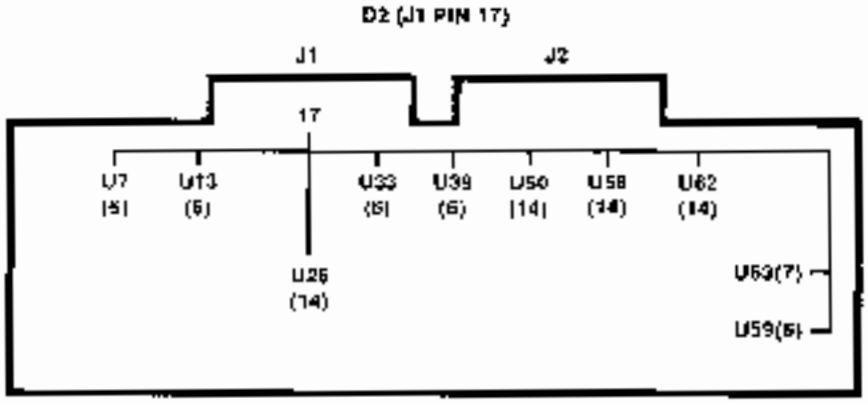


Figure 8-B-6. 5508A A9 Data Line Trace Maps, D0 and D1



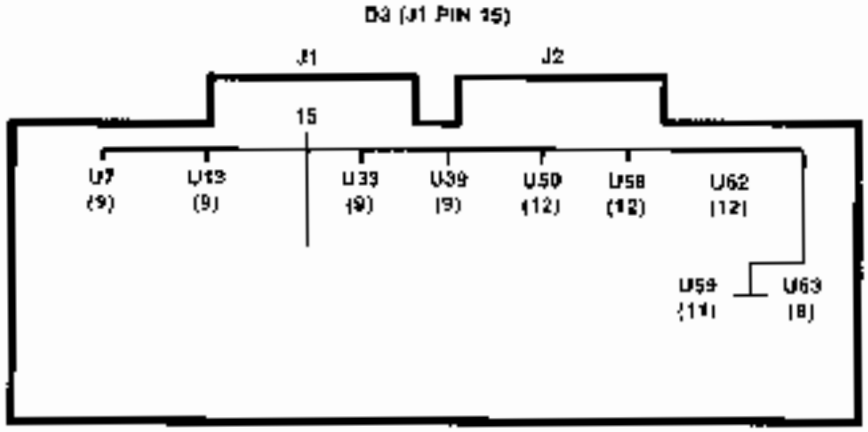
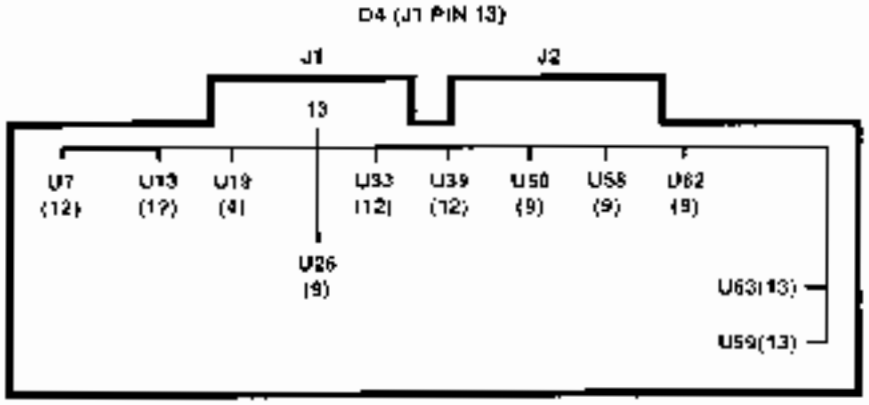


Figure 8-B-7. 5508A A3 Data Line Trace Maps D2 and D3



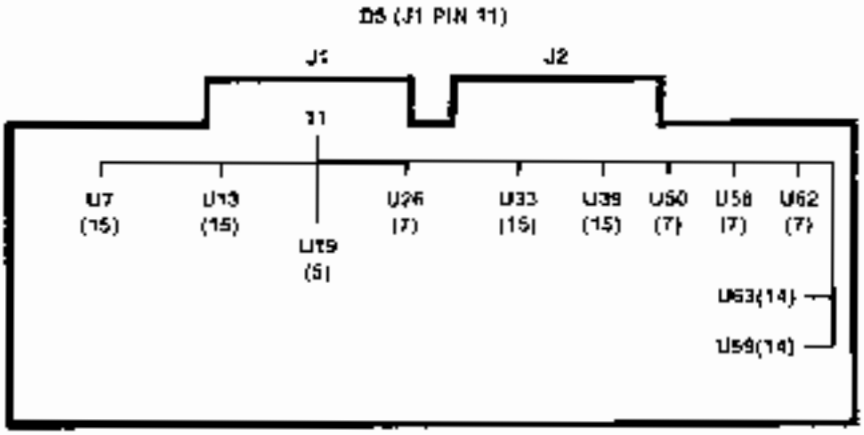
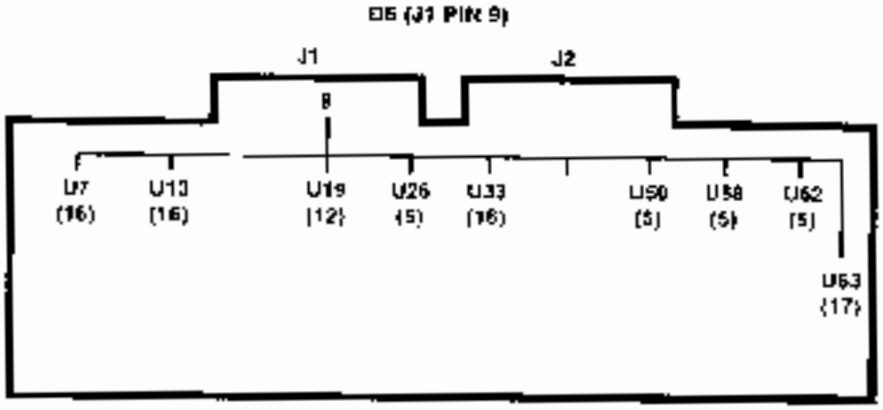


Figure 8-B-8. 5508A A3 Data Line Trace Maps, D4 and D5



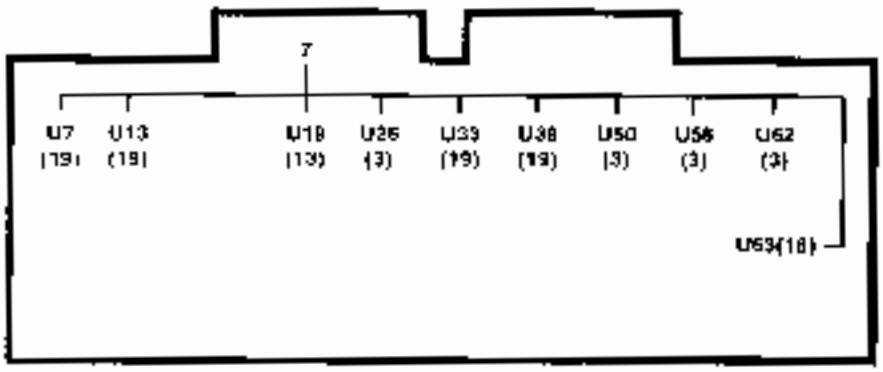
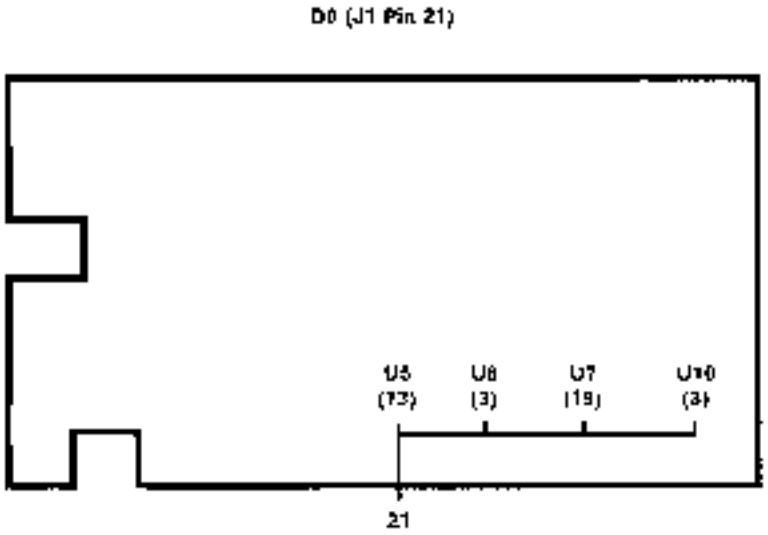


Figure 6-B-2. 5508A A3 Data Line Trace Maps, D5 and D7



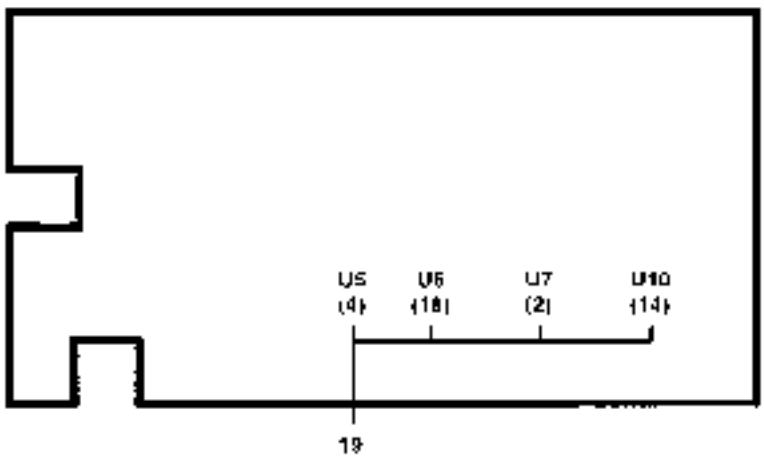


Figure 8-B-12. 5508A A1 Data Line Trace Maps, D0 and D1

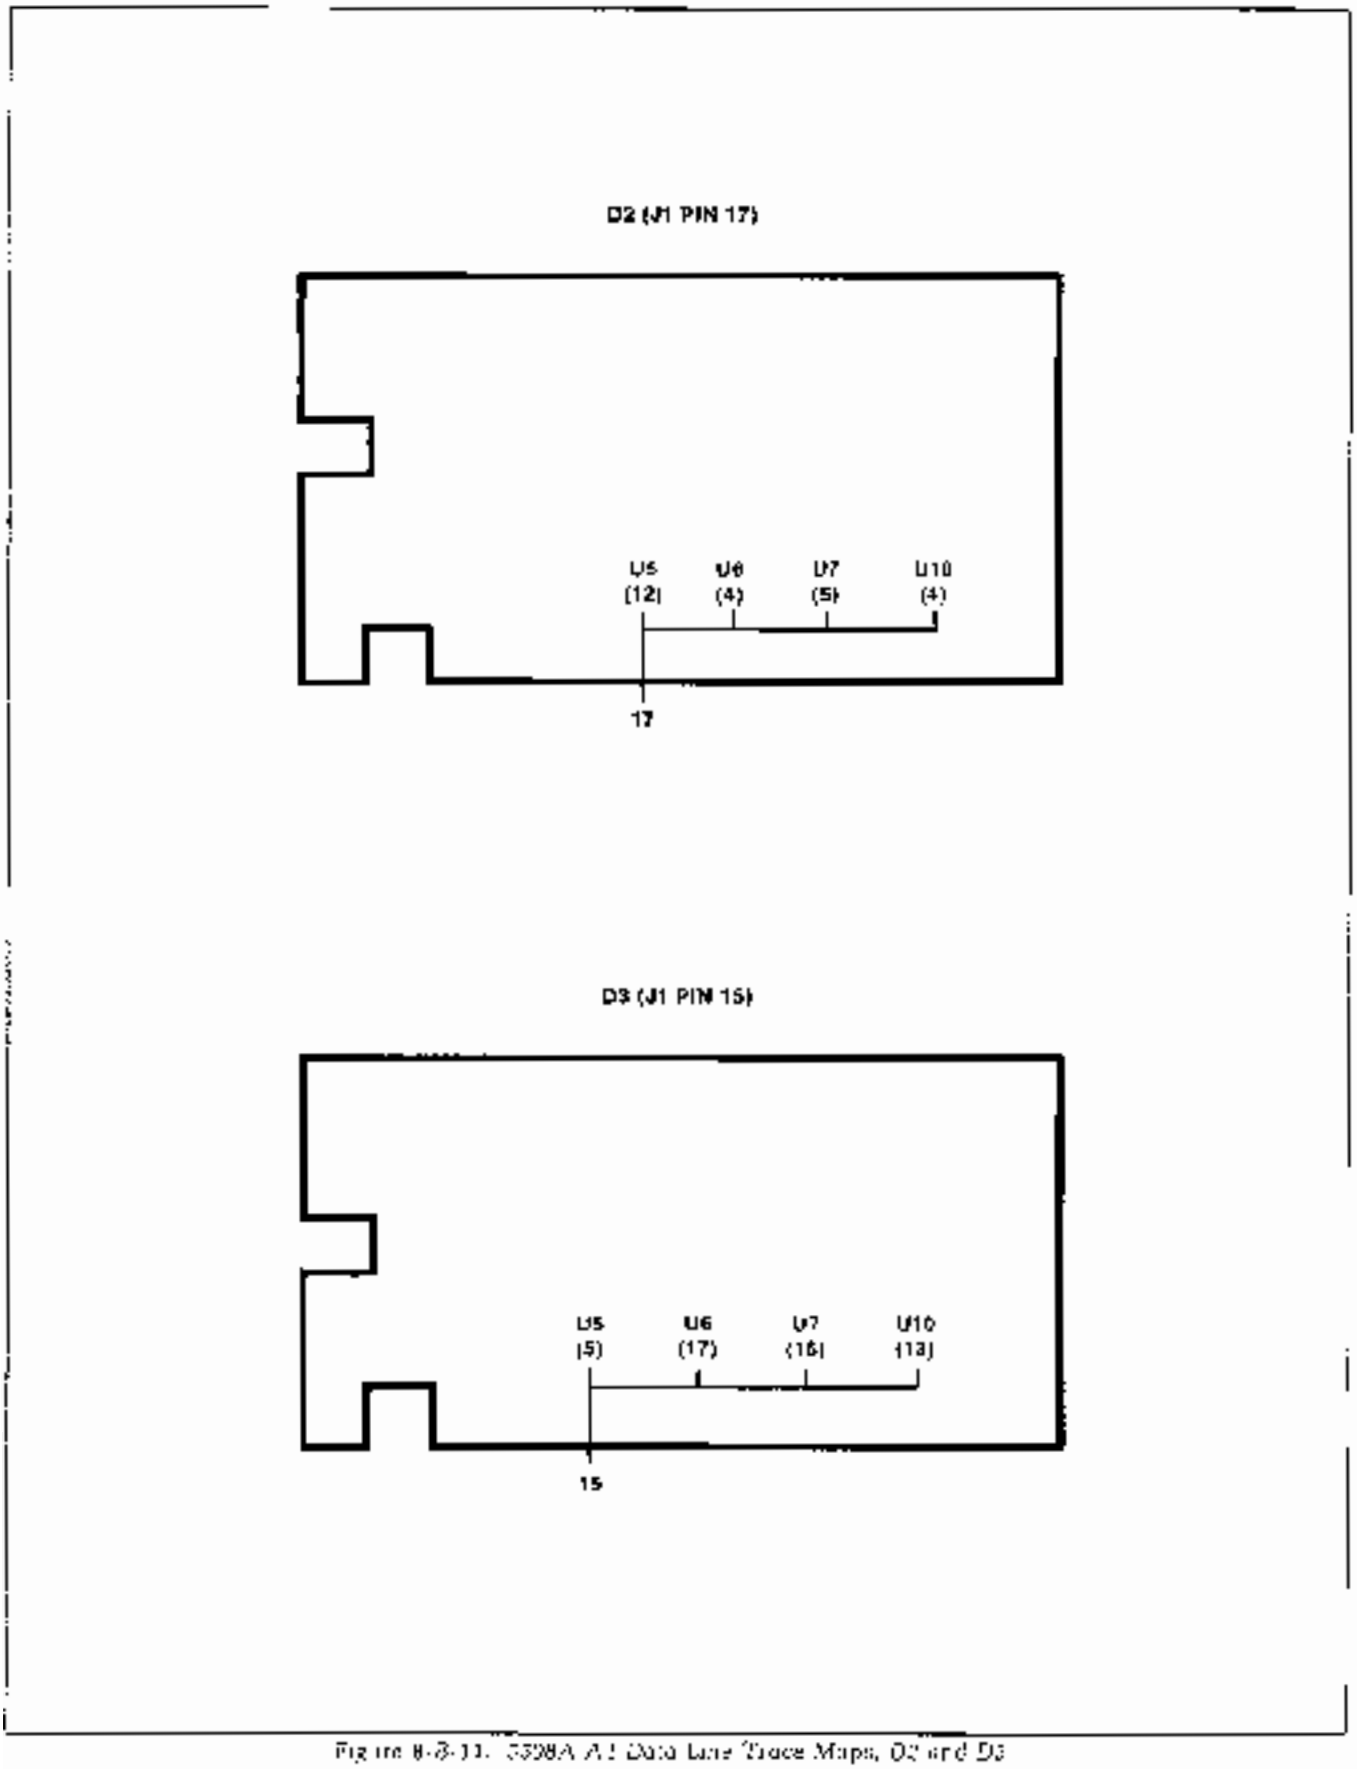
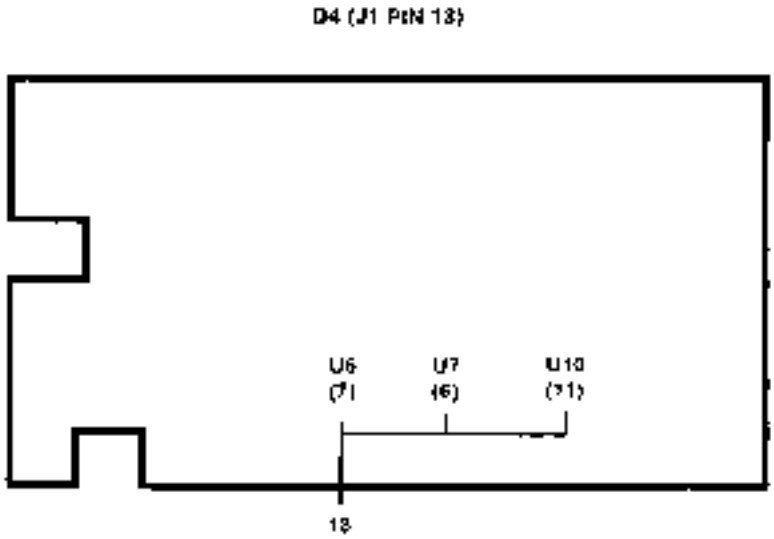


Figure 8-3-11. 5308A A1 Data Line Trace Maps, D2 and D3



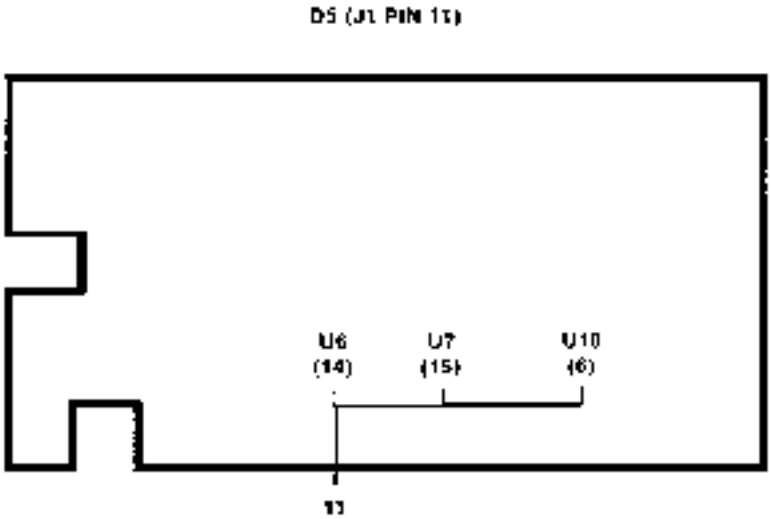


Figure 8 B-12. 5520A A1 Data Line Trace Maps, D4 and D5

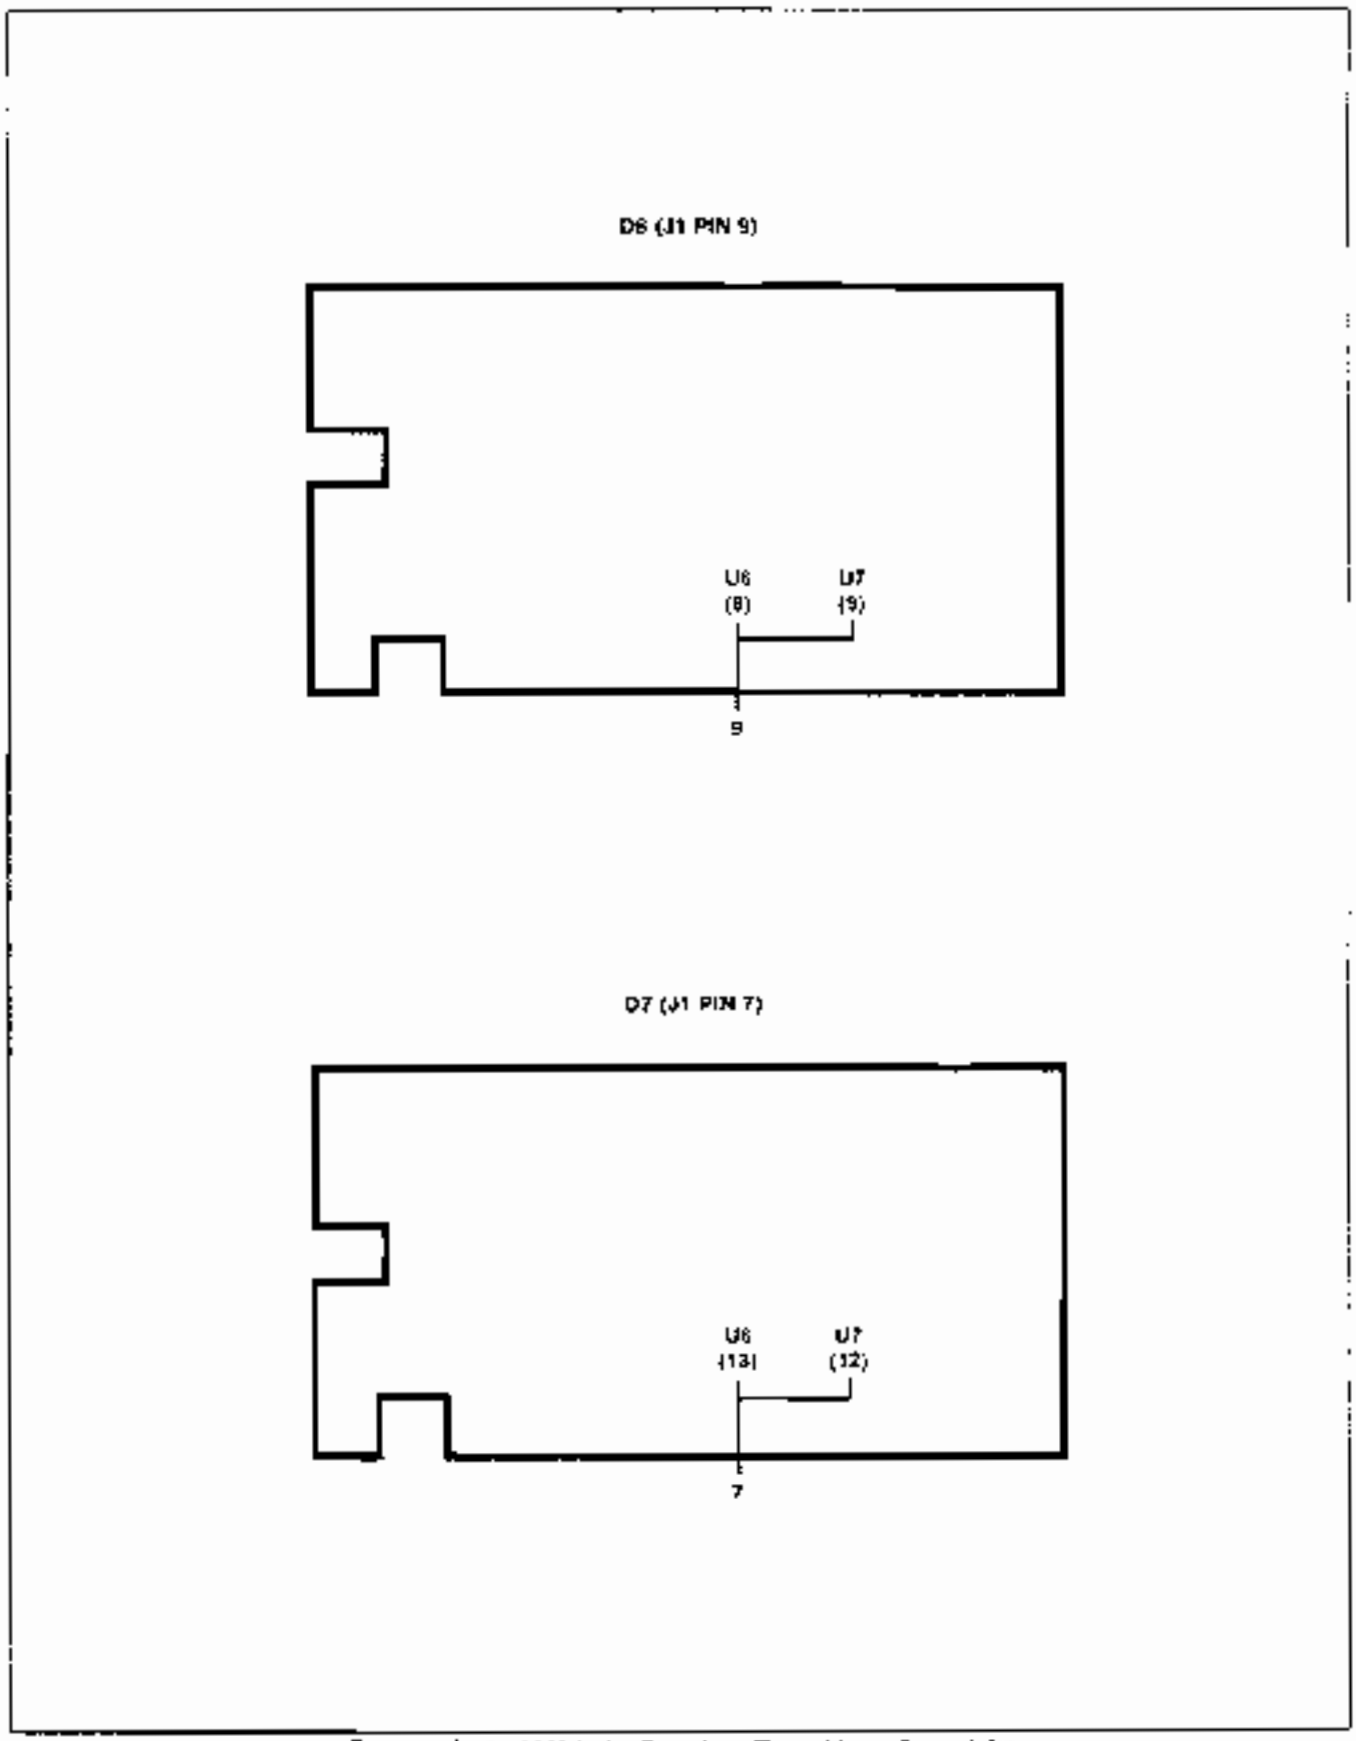


Figure 8-B-13. 5508A A1 Data Line Trace Maps, D6 and D7

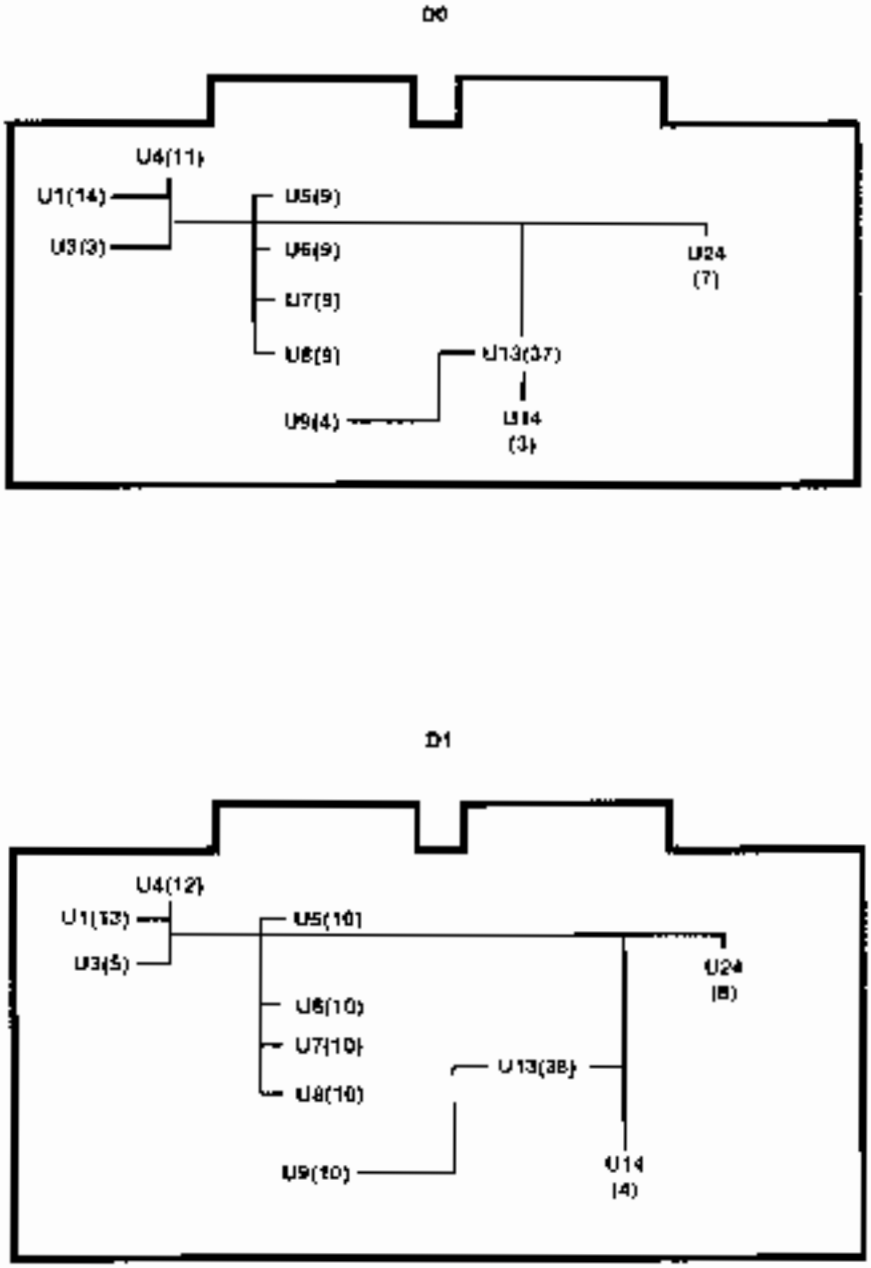
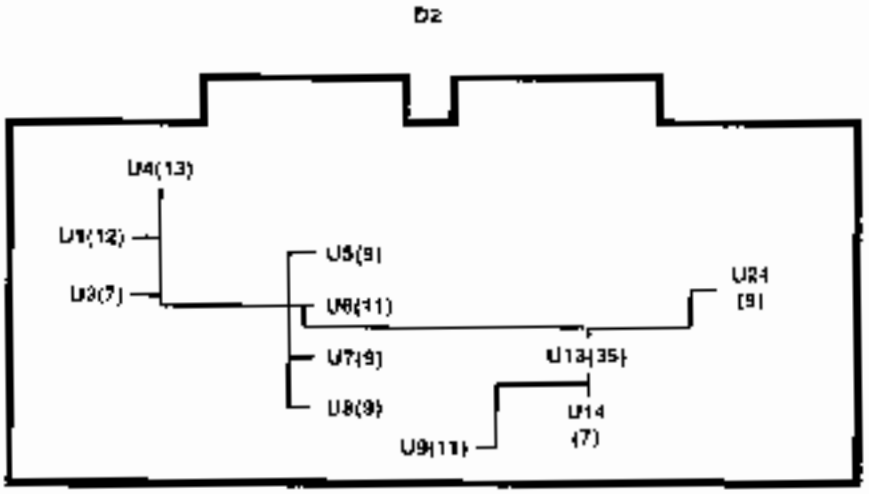


Figure 8-5-24. 5508A A2 Data Line Trace Maps, D0 and D1



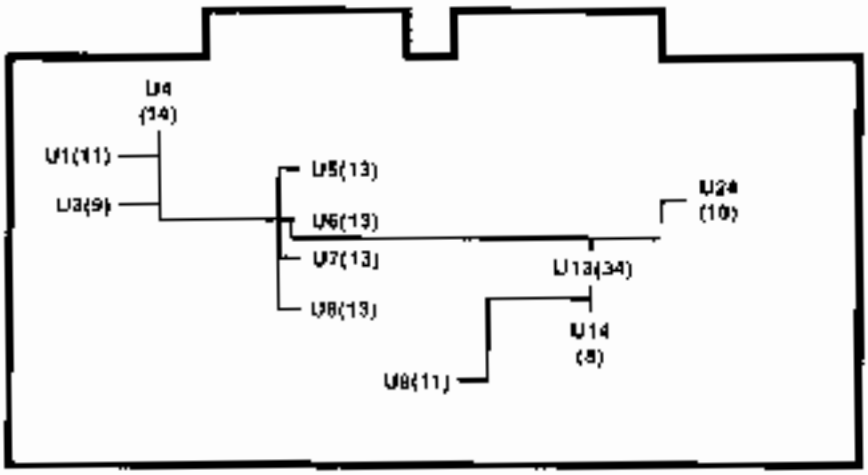
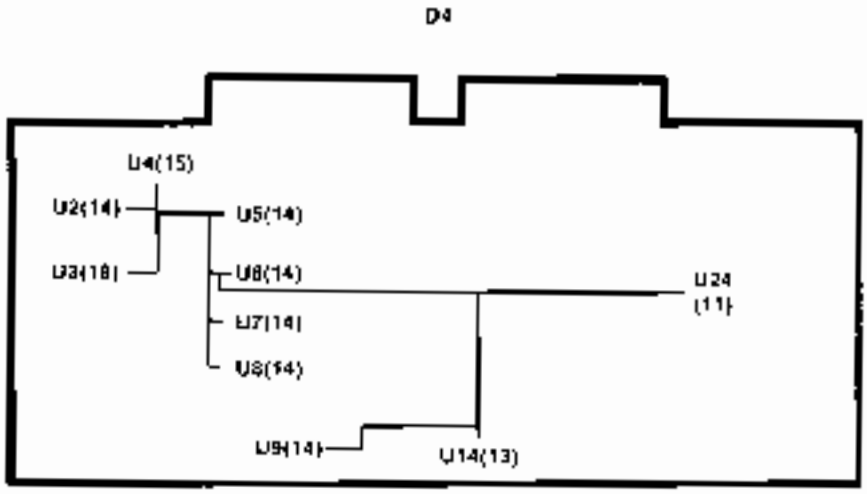


Figure 8-B-12. 5508A A2 Data Line Trace Maps D2 and D3



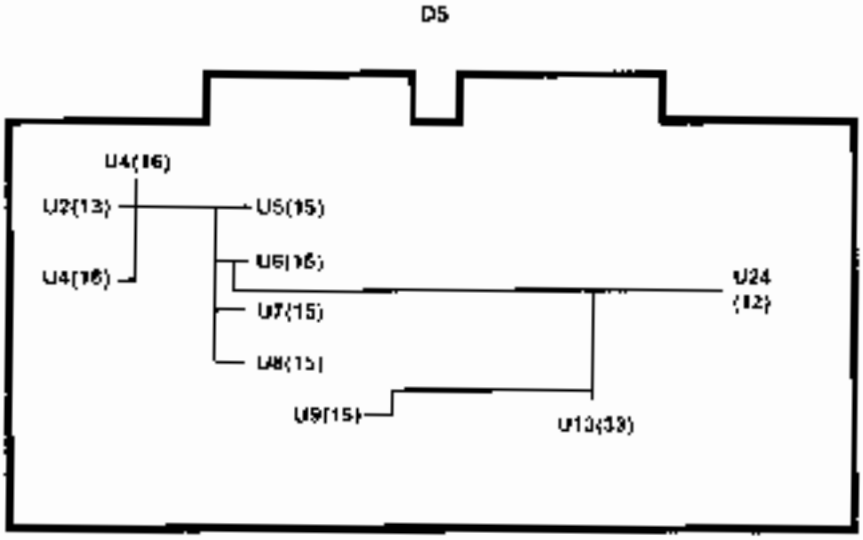


Figure 8-B-16. 5506A A2 Data Line Trace Maps, D4 and D5



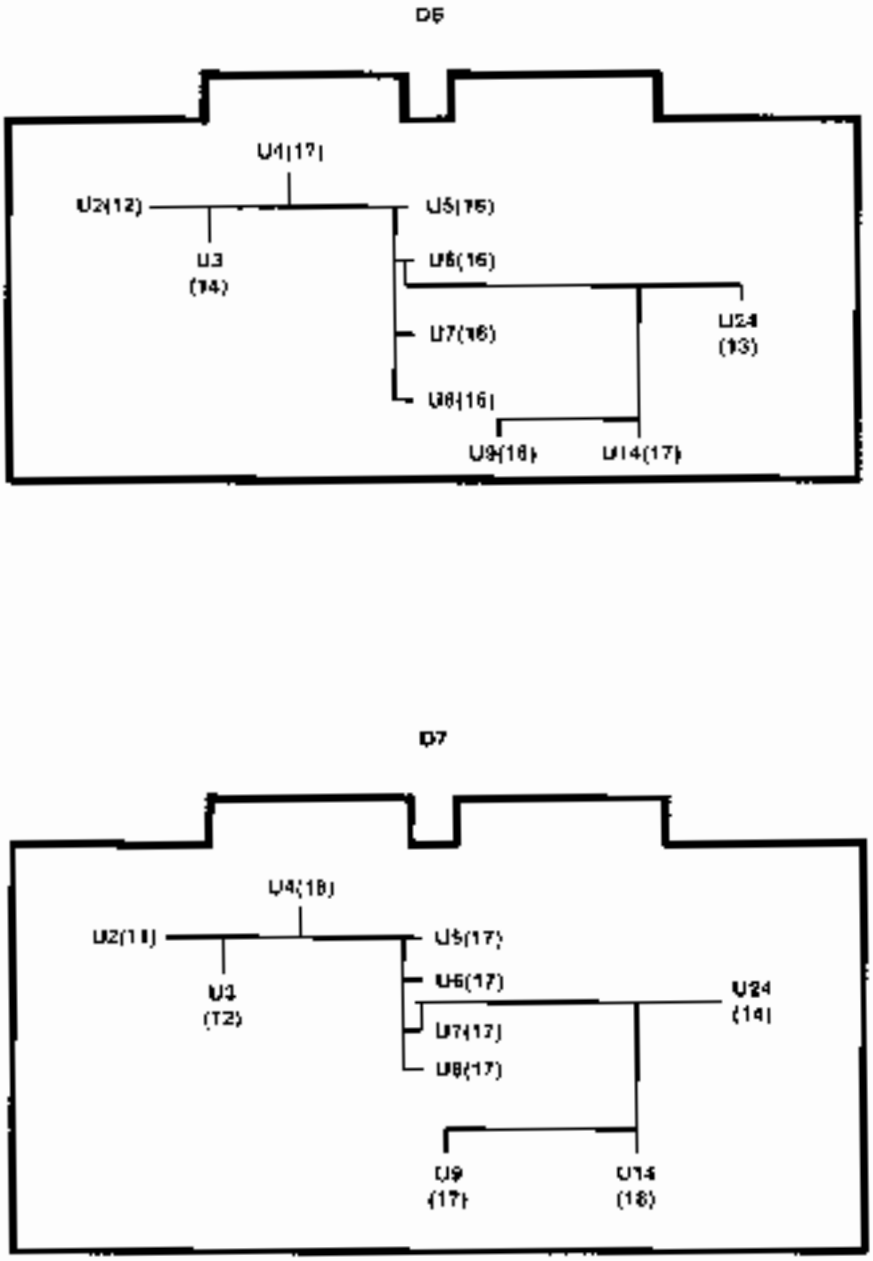


Figure 8-B-17. 5506A A7 Data Line Trace Maps, D6 and D7

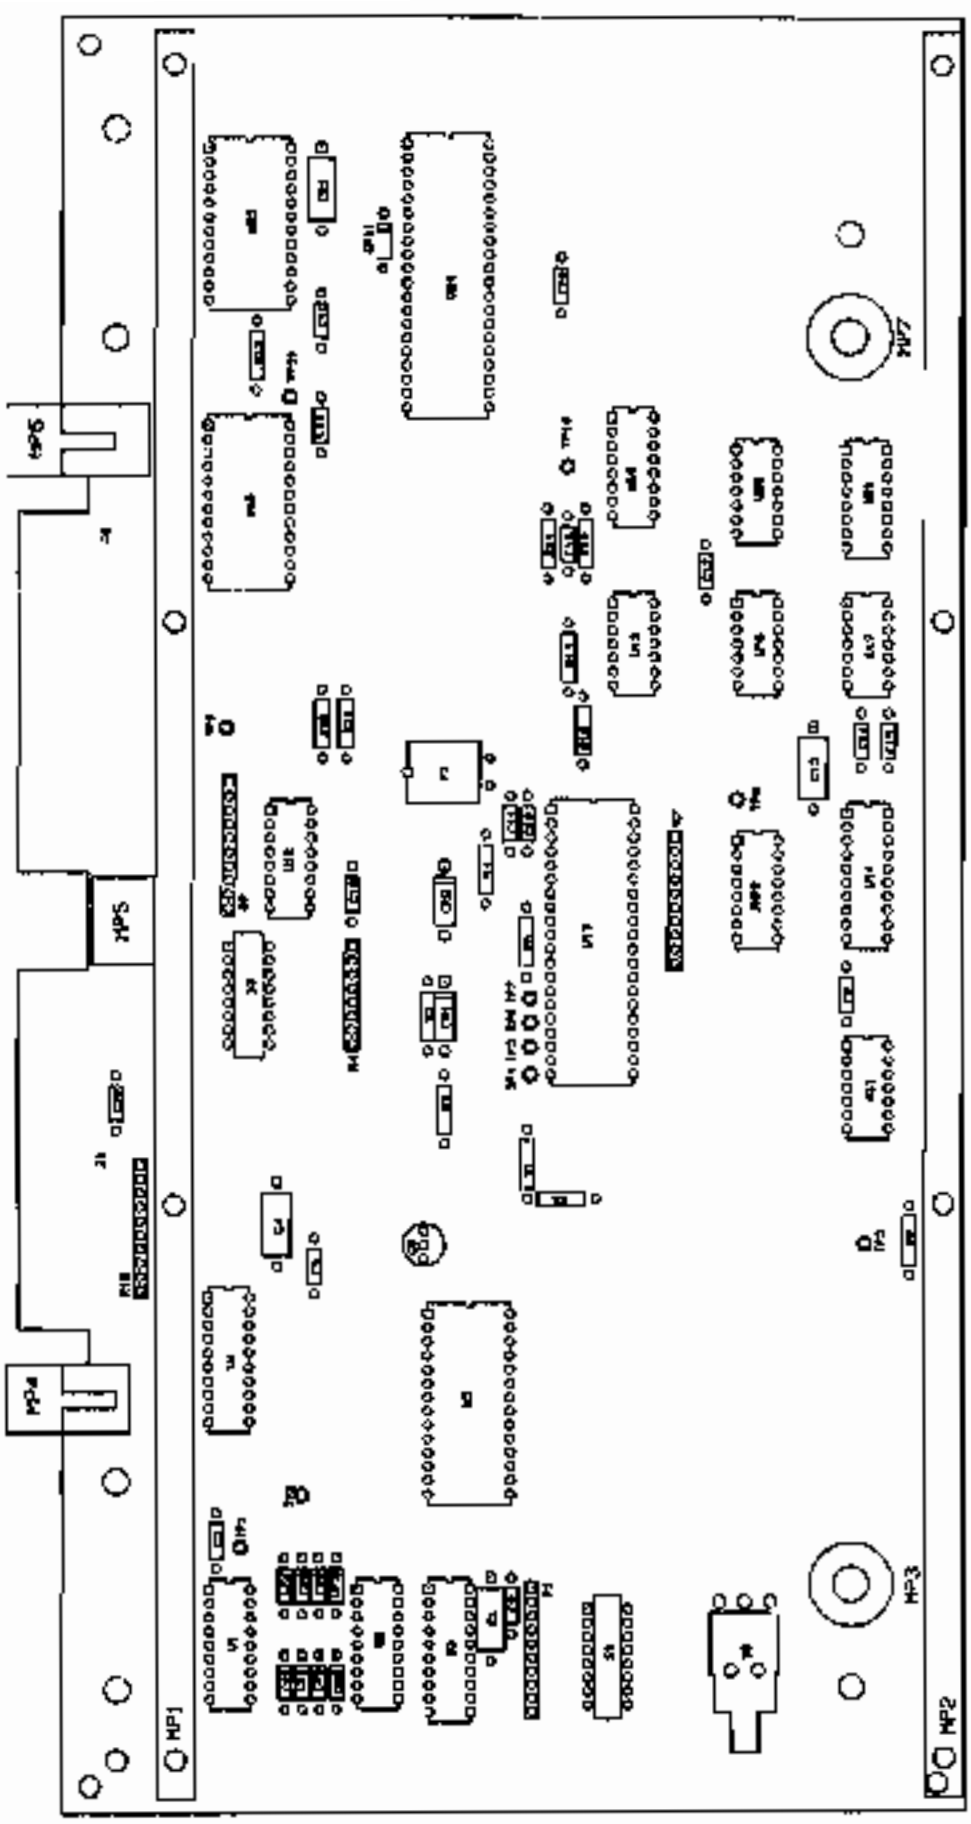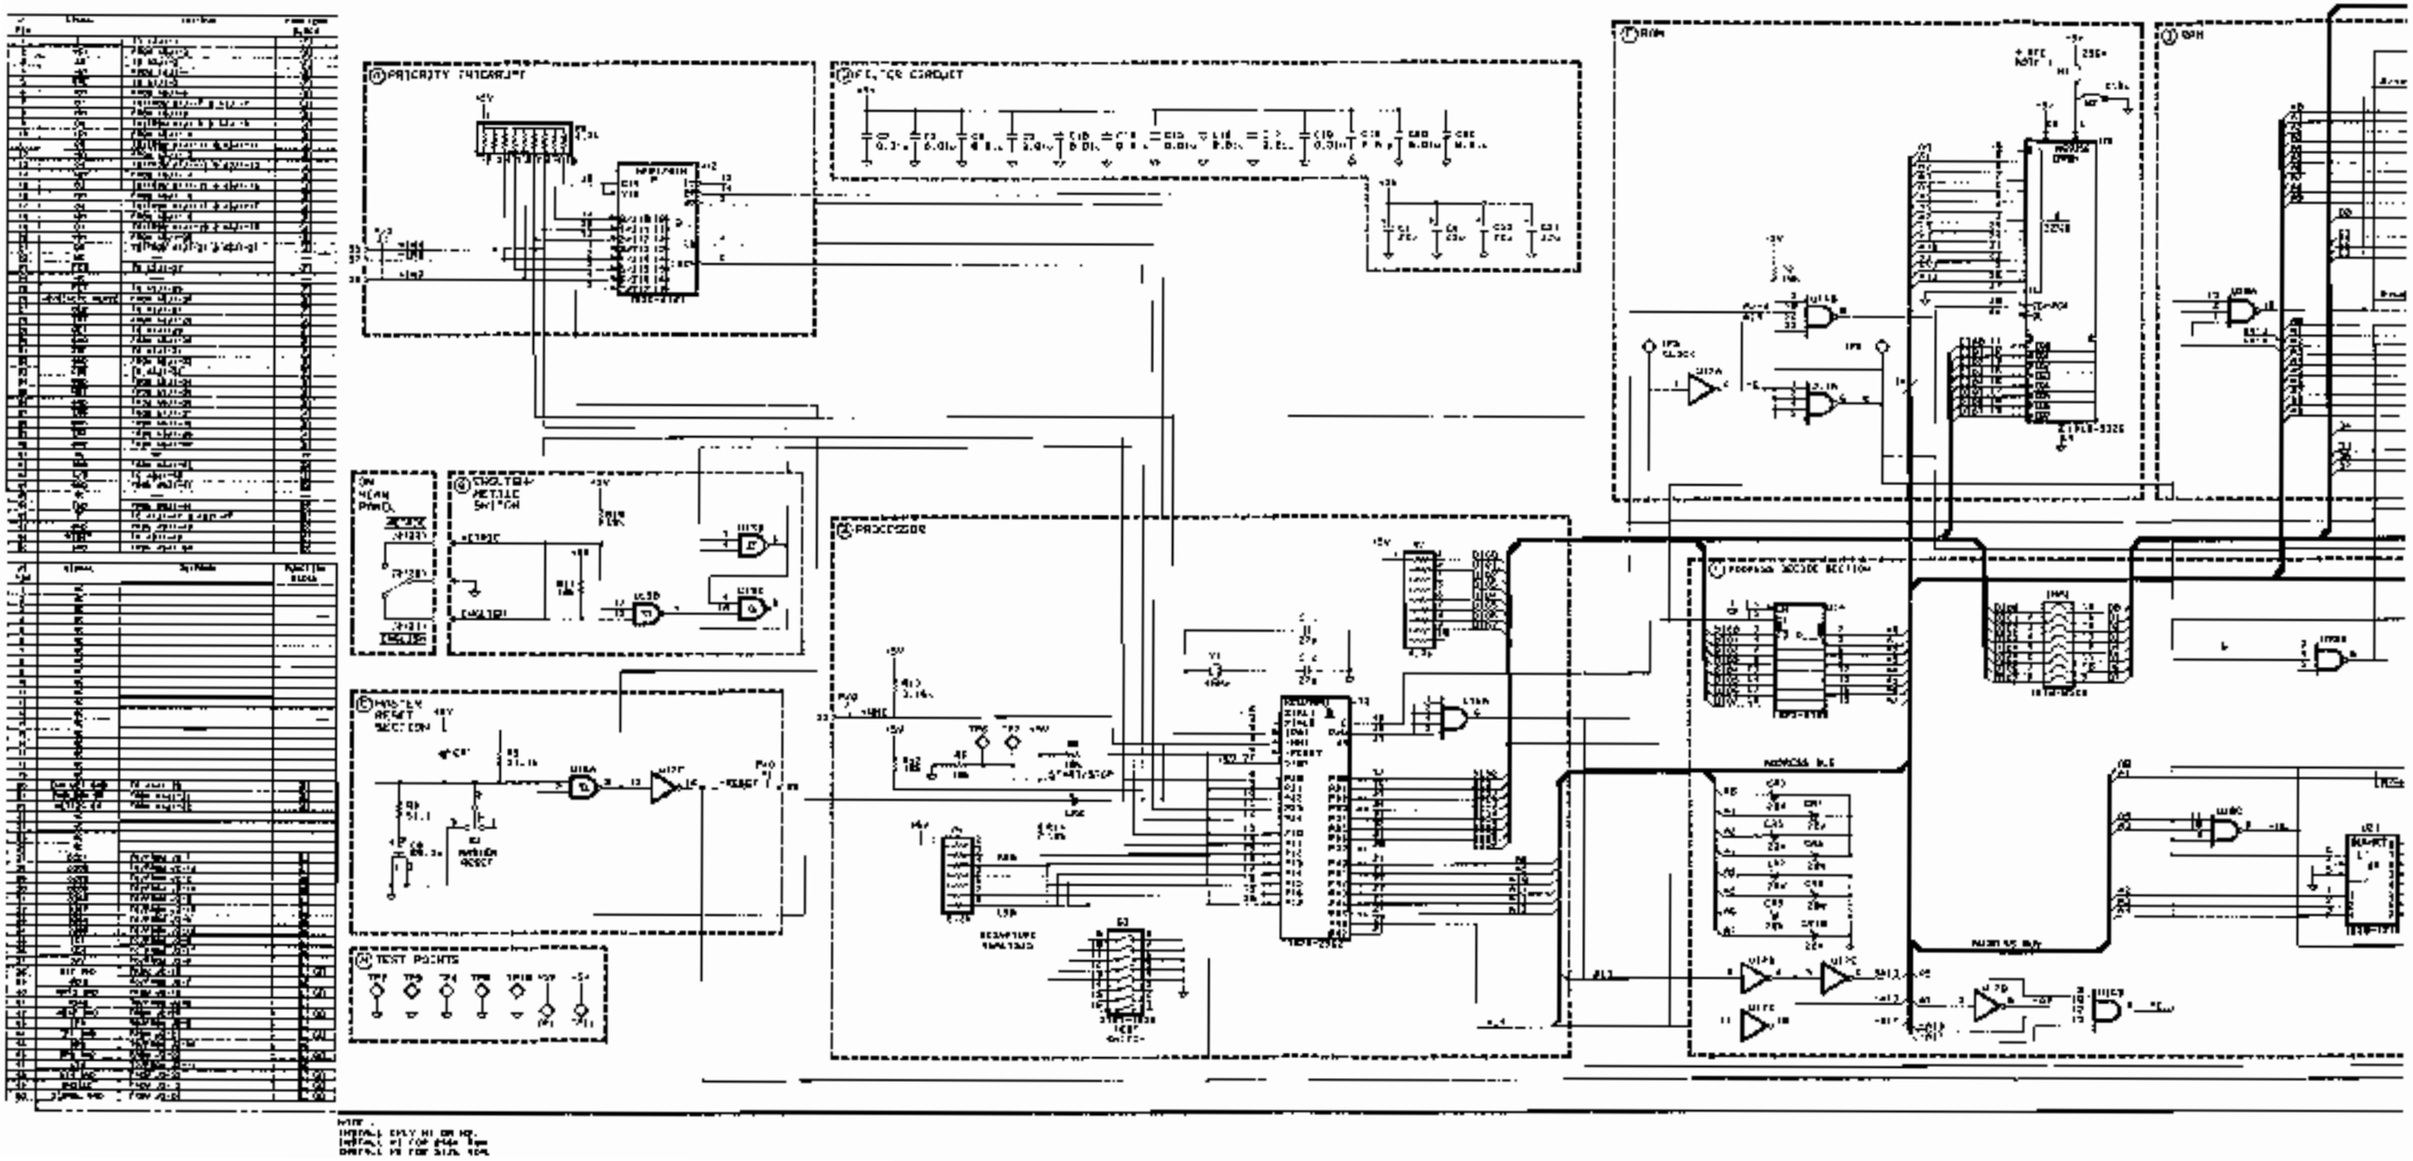

Part of Figure 8-8-18. 5508A A2 Processor Board
05508-60002, Date Code 90411 & above


PRIORITY ENCODER
PROCESSOR
MASTER RESET SECTION
TEST POINTS
ADDRESS BUS
DATA BUS

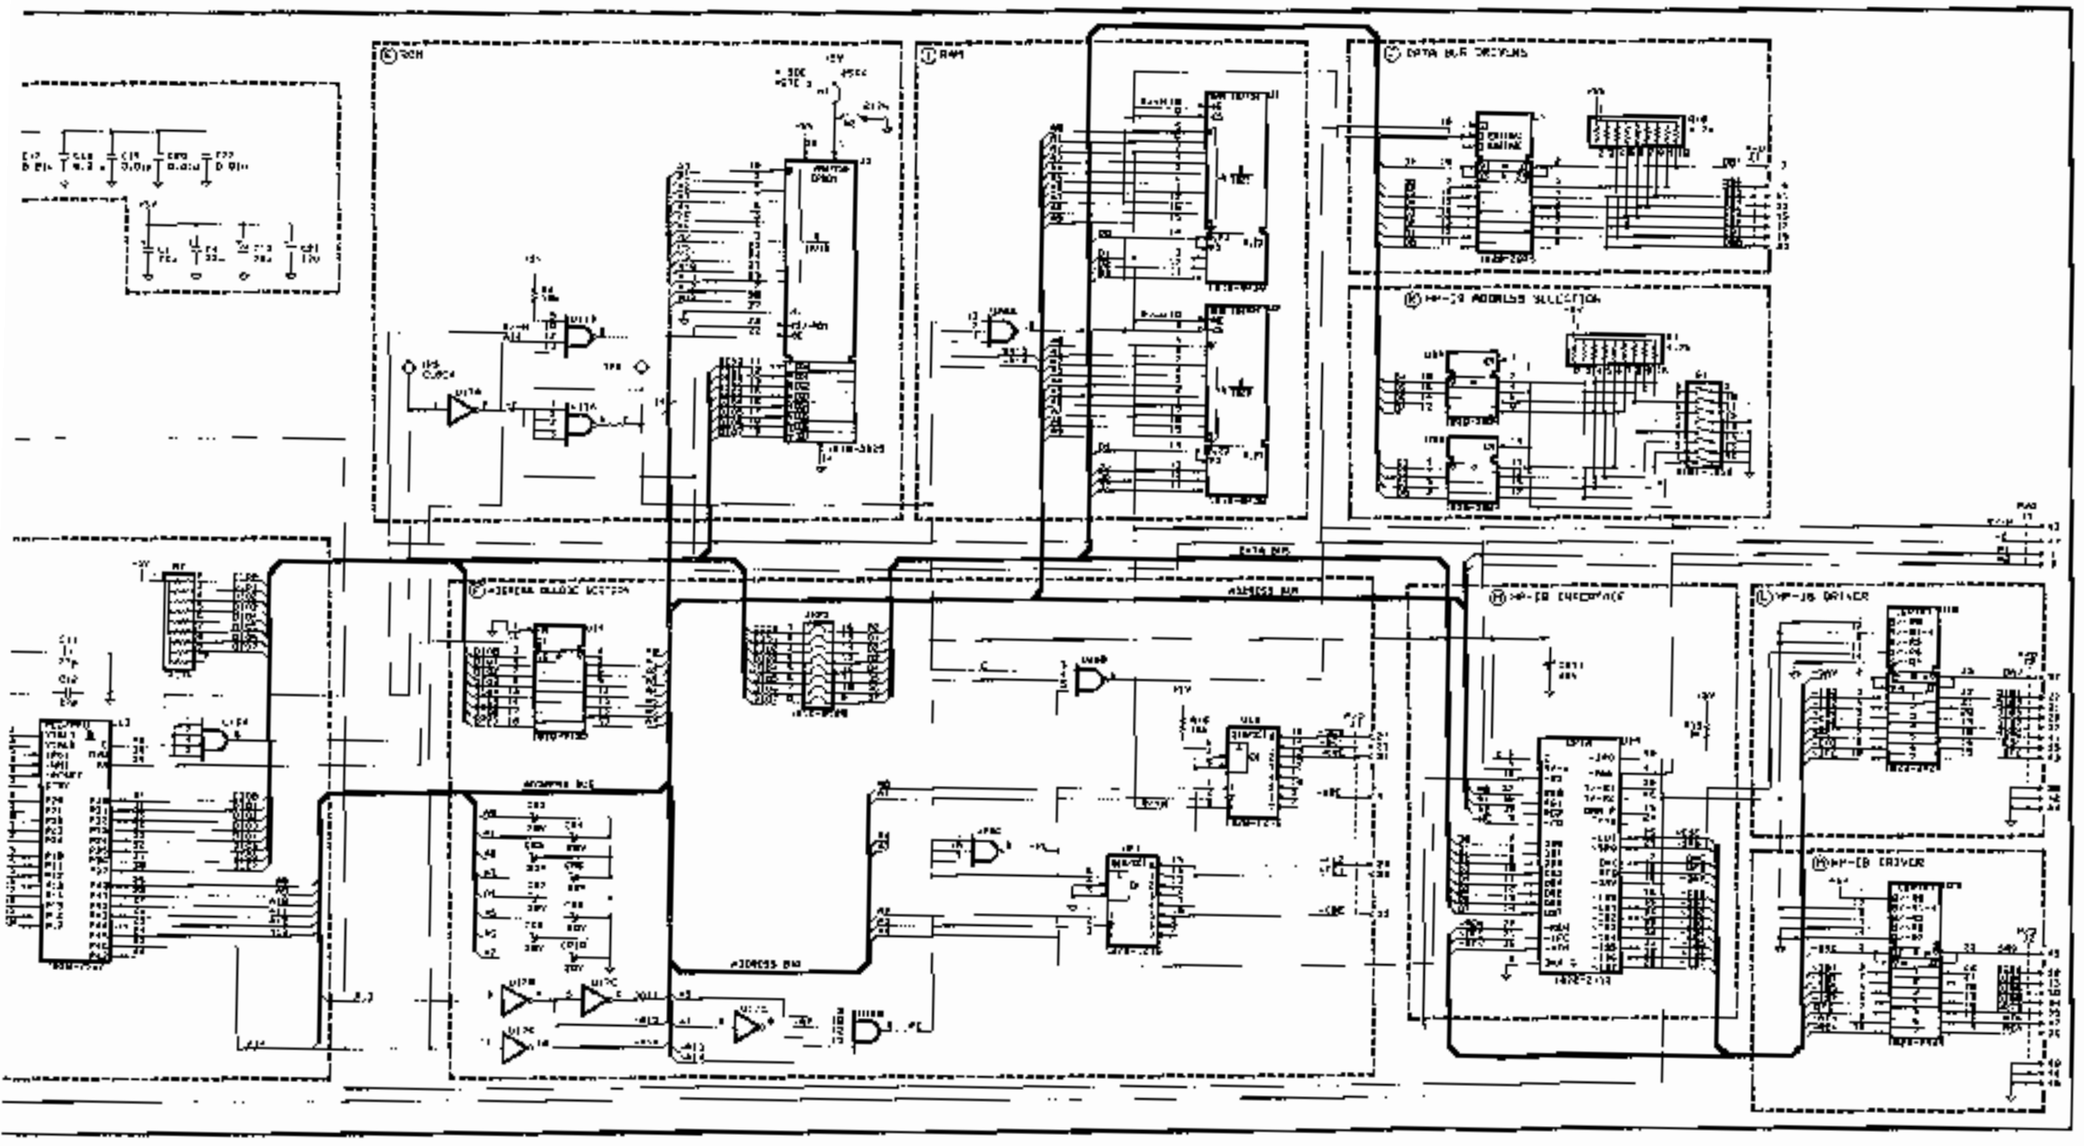


Figure 8-B-18. 5508A A2 Processor Board 05508-60002

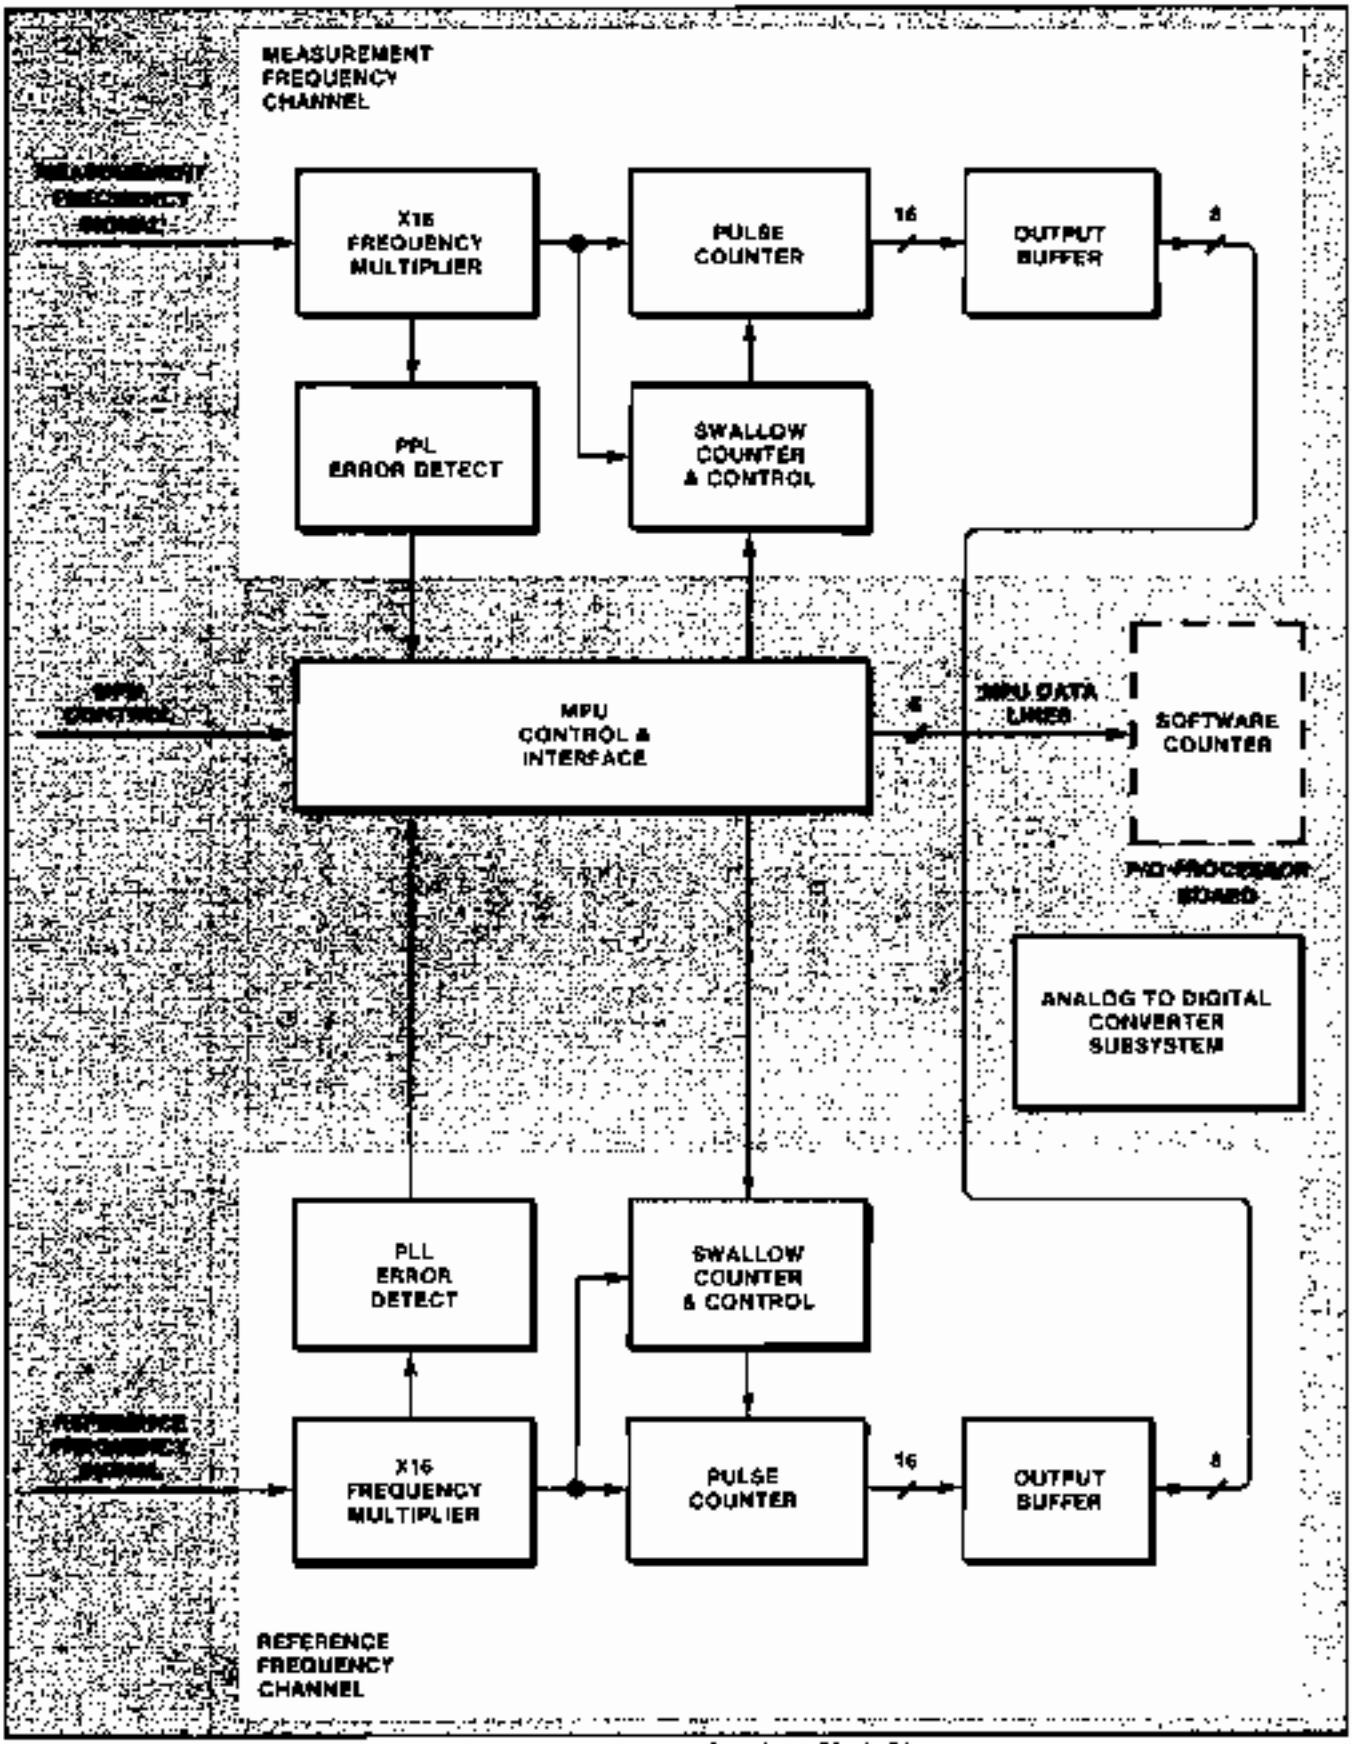


Figure 6-B-19. 5508A Counter Board A3 Block Diagram

Figure
550BA A2 PROCESSOR BOARD 05601

(See Page

8-B-110. 5508A A3 COUNTER BOARD

8-B-111. Service information for the Counter Board is organized as follows:

a. Block Diagram Description in Paragraphs 8-B-112 through 8-B-119.

b. Counter Control Circuit Theory in Paragraphs 8-B-120 through 8-B-145.

c. Reference Frequency Channel and Measurement Frequency Channel Circuit Theory in Paragraphs 8-B-146 through 8-B-166.

d. Troubleshooting Procedures for the Control Circuits, Reference Frequency Channel, and Measurement Frequency Channel in Paragraphs 8-B-167 through 8-B-227.

e. Analog Subsystem Circuit Theory in Paragraphs 8-B-228 through 8-B-266.

f. Analog Subsystem Troubleshooting in Paragraphs 8-B-267 through 8-B-276.

8-B-112. 5508A A3 COUNTER BOARD BLOCK DIAGRAM DESCRIPTION

8-B-113. Counter Board A3 contains a Counter section and an Analog Subsystem. The Analog Subsystem is an 8-channel Analog-to-Digital Converter. The Counter section consists of Counter Control circuitry and two identical Frequency Channels. The Counter Board Block Diagram is shown in Figure 8-B-19.

8-B-114. The Measurement and Reference Frequency Channels process the incoming signals in the same way. The input frequencies are first multiplied by 16 by phase-locked loop (PLL) circuits. Each PLL output serves as a clock signal to the Pulse Counter and Swallow Counter and Control blocks. The Output Buffers are used to transfer the Pulse Counter contents to the data bus.

8-B-115. The primary function of the Counter section is to detect the difference in the number of cycles of transition that occur between the measurement frequency signal and the reference frequency signal. Before the cycles are counted, phase locked loops multiply the input frequencies by 16 in order to extend the resolution of the laser measurement. Both channels have a pulse counter that records each cycle of the respective phase locked loop output by clocking on each low to high transition.

8-B-116. When the Measurement Optics are at rest, the measurement frequency equals the reference frequency. Under this condition, the difference in cycles of transition is zero and the pulse counters do not accumulate a difference in count. When the Measurement Optics move during a measurement, the measurement frequency increases or decreases depending on the direction of movement. This causes the counter contents to differ. When either pulse counter is half full, an interrupt signal is sent to the MPU. The MPU responds to the interrupt by reading the Counter contents and determining any difference by subtraction.

8-B-117. The PLL outputs are also sent to the Swallow Counter and Control circuits. The function of these circuits is to keep the two pulse counters synchronized during a data transfer (SAMPLE) to the Processor Board. Upon receipt of a sample command from the MPU Control and Interface block, these circuits issue control signals to their respective Pulse Counters. During the next 15 cycles of the Pulse Counter input, the control signals cause the Pulse Counters to halt and then transfer their accumulated counts to the Output Buffers, then reset to zero, and then resume counting until the next sample command is received.

8-B-118. The contents of the Output Buffers transfer over the MPU Data Bus to the Processor Board where the difference count is determined and added to a portion of the R/W memory called the Software Counter. This counter resets to zero whenever the RESET key on the 5508 front panel is pressed. At a given instant, the Software Counter contains the phase difference (in units of 1/16 of a cycle) between the measurement and reference frequency signal that has accumulated between the time of the most recent Sample Command and the time when the RESET key was last activated. This number forms the basis for all of the laser measurements.

8-B-119. In order to properly transfer the contents of the Pulse Counters to the Software Counter, both the Pulse Counters are halted for the same number of input cycles but not necessarily for the same amount of time. Consequently, the pulse counts accumulated during the sampling process need not be taken into account because they would be cancelled by subtraction anyway.

8-B-120. 5508A A3 COUNTER CONTROL CIRCUIT THEORY

8-B-121. Paragraphs 8-B-122 through 8-B-145 contain circuit theory for the counter control circuits on A3. Troubleshooting information is covered in Paragraphs 8-B-167 through 8-B-227.

8-B-122. The schematic diagram for the control circuits is shown in Figure 8-B-21 sheet 3. The schematic has functional blocks that are labeled alphabetically with circled letters. These labels correspond to the circled letters in the text for the circuit theory.

8-B-123. The counter control circuits consist of External Record circuits, External Reset circuits, Address Decode, Power Distribution, Test Latches, Test F/F, Error Latches, Identify Interrupt, Control Counter, and NMI Generator and ECL References. Overall, the counter control circuits provide an interface with the microprocessor to control the counters.

8-B-124. Input Address and Control Signals

8-B-125. The following Address and Control inputs from the Processor board comprise the inputs to ADDRESS DECODE Ⓒ and IDENTIFY INTERRUPT Ⓗ:

a. A0 and A1 at J1-3 and J1-1 respectively. These are the lowest two bits of the Address Bus.

b. $\overline{FE1}$ at J1-25 (Block H) which is decoded from certain bits of the address bus. $\overline{FE1}$ is true when the Processor addresses memory locations $0024, $0025, $0026 and $0027.

   $ indicates that the number following is hexadecimal.

c. $\overline{FE2}$ at J1-23 (Block C) which is decoded from certain bits of the address bus. $\overline{FE2}$ is true when the Processor addresses memory locations $0020, $0021, $0022, and $0023.

d. R/$\overline{W}$ at J1-43 (Block C). This is the Read/Write control signal from the Processor board.

e. E at J1-47 (Block C), the 1 MHz clock from the Processor Board.

f. RESET at J1-40 (Block E). This becomes active at power on or whenever the MASTER RESET switch, A2S2, is pressed.

8-B-126. Note that $\overline{E}$, R/$\overline{W}$, A0, and A1 also go to the Analog Subsystem shown on sheet 4 of the schematic. These signals and the supply voltages are the only signals shared by the counter portion and the Analog Subsystem portion of this board.

8-B-127. Address Decode Ⓒ

8-B-128. The address decoder consisting of U20 and U27 serves to decode the A0, A1, and R/$\overline{W}$ (read/write) inputs into one of eight outputs. The R/$\overline{W}$ input determines whether U27 is in the read or write mode. For counter data transfer (read) operations, the Processor sets R/$\overline{W}$ high. For counter control (write) operations, the processor sets R/$\overline{W}$ low.

8-B-129. U27 has two sets of output lines. One set for read and one set for write. Output pins 7, 9, 10, and 11 provide enable signals for the counter output buffers during read operations. The other output set, pins 12, 13, 14 and 15 provide control signals during write operations. A0 and A1 determine which line of a set is true.

8-B-130. When the Processor Board reads the measurement channel output buffers (see sheet 3, block O), U27-10 and U27-11 become active in sequence. Similarly, U27-7 and U27-9 become active when the reference channel output buffers are read (see sheet 2 block T). These buffers contain the most recent values of the Pulse Counters and allow for proper transfer to the Processor Board over the data bus.

8-B-131. When the Processor sends the SAMPLE command to the Counter Board, decoder output U27-15 goes low and drives inverter U28A. Resistor network R34, R38, and R39 converts the TTL level to ECL. SAMPLE connects to both the measurement channel and reference channel Swallow Counter and Control blocks on sheets 2 and 3 where it initiates the sampling of the Pulse Counters and starts the process to update the Software Counter. JMP3 facilitates testing.

8-B-132. Test F/F, Error Latches, Test Latches Ⓕ Ⓖ Ⓔ

8-B-133. During Self Test, the Processor sends a write command that causes U24 pins 9 and 8 to be set and reset respectively. The latch output is used to test both the Error Latches U29 and U22 and Test latches U23A and U30B. The output of U23 pin 9 is also converted to ECL and aids in troubleshooting the Swallow Counters. During normal operation, the output of the Test F/F is reset, i.e., U23-9 is low.

8-B-134. Control Counter Ⓘ

8-B-135. The Counter Control block is also configured by Processor write ($R/\overline{W}$) operations. When U27 pin 14 is true D4, D5, D6, and D7 of the data bus are clocked into register U19. The output bits of U19 have the following functions:

a. $\overline{\text{CLR LATCHES}}$ at U19-10 clears Error Latches U29 and U22 and the Test Latches U23A and U30B.

b. CLR LOL ERROR at U19-7 clears flip flops U5 and U49 (sheets 2 and 3). These flip flops detect loss-of-lock errors in the phase-locked loops. Resistor network R14 through R16 translates the output of U19 pin 7 to ECL.

c. TEST PLLS at U19-2 enables the 1MHz clock as an input to the phase-locked loops (sheets 2 and 3) during self test and troubleshooting. TEST PLLS is low during normal operation.

d. NMI MASK at U19-15 is discussed below in conjunction with INHIBIT NMI.

8-B-136. The counter board requires the attention of the Processor when the Pulse Counters approach overflow or when an error develops, or an external sample command (see block A) is received. This is accomplished via the Nonmaskable Interrupt (NMI) line of the Processor. There are times, however, such as during power-on or trouble shooting, when it is necessary to ignore these interrupt requests. This is done by hardware masking out the interrupt with INHIBIT NMI.

8-B-137. INHIBIT NMI appears at U28 pin 8 and becomes active from two independent sources. The first is under software control and is called "NMI MASK" which comes from the Control Register U19-15. The second is the latch output U30-8 which is set whenever RESET becomes active and is reset as soon as the first sample pulse is received.

8-B-138. NMI Generator and ECL References (J)

8-B-139. As mentioned under INHIBIT NMI above, whenever the Counter Board requires the attention of the Processor, the signal NMI becomes active. This occurs under the following conditions providing INHIBIT NMI is not active:

a. An overflow signal is received at U21-2 (Block J) from the Measurement Pulse Counter or at U21-3 from the Reference Pulse Counter.

b. One or more of the Phase-locked Loop Error Latches U29A or B or U22A or B is activated. See Block G.

c. An External Record signal activates latch U23A. See Block E.

8-B-140. Note that when the External Reset latch U30B (Block E) is activated it does not cause an $\overline{\text{NMI}}$ but instead activates the signal IN7 at U30B pin 8. IN7 connects to the interrupt decoder (Block A of Figure 8-B-16) of the Processor Board via J1-25.

8-B-141. Once the Processor has received either a Maskable or Nonmaskable Interrupt request it must identify the source or sources of these signals. For the Counter Board, this is accomplished by the Processor reading the memory location STAT = 0024. This causes the tristate buffer U26 (Block H) to transfer the signals present at its input onto the data bus.

8-B-142. The reference voltage VBB is generated at U25 and buffered by voltage followers U31A and B. The value of VBB, which lies halfway between the ECL high and low logic levels, serves as a reference for the comparators which translate ECL to TTL. The numerical value of VBB is referenced to the +5 V supply rather than ground and should be 1.29 V less than the actual value of this supply. For example, if the −5 V supply is actually −5.10 volts, then VBB with respect to ground is 3.81 V.

8-B-143. External Record and External Reset (A) (B)

8-B-144. When either the External Record or External Reset switch in the Remote Box is pressed, the signals enter the rear panel of the 5508A and connect to the Counter Board at pins J2 pin 23 (Block A) or J2 pin 24 (Block B). Each of these signals pass through a network of resistors, diodes, and capacitors which serves to improve noise immunity and protect the IC's from high voltage spikes.

8-B-145. The External Record signal activates one shot U6 whose output causes pin 6 of latch U23 to go low which in turn generates a Nonmaskable Interrupt. The External Reset signal passes through two buffer inverters U20E and U20D to set latch U30B which in turn generates a normal Processor interrupt via IN7.

8-B-146. 5508A A3 REFERENCE FREQUENCY CHANNEL AND MEASUREMENT FREQUENCY CHANNEL CIRCUIT THEORY

8-B-147. Paragraphs 8-B-148 through 8-B-166 contain circuit theory for the reference and measurement frequency channels on A3. Troubleshooting information is covered in Paragraphs 8-B-167 through 8-B-227.

8-B-148. The schematic diagrams for these circuits are shown in Figure 8-B-21 sheets 2 and 3. The schematics have functional blocks that are labeled alphabetically with circled letters. These labels correspond to the circled letters in the text for the circuit theory.

8-B-149. The circuitry associated with the measurement frequency channel is shown on sheet 3 of the schematic diagram, Figure 8-B-21. The circuitry for the reference frequency channel is shown on sheet 2. Since the processing for these two signals is identical, only the circuitry for the Measurement Channel is described here. However, when specific IC's and pins are mentioned, the corresponding point of the reference channel circuits will be included in parenthesis. When specifying a signal that exists in both channels, such as MLPYD FRQ, it will generally be left to context to determine which channel is appropriate.

8-B-150. X16 Frequency Multiplier (K) (F)

8-B-151. In order to extend the resolution of the basic measurement, phase-locked loops are used to multiply the frequencies of both the measurement and reference signals by 16. The loop feedback action is as follows. The output frequency of the loop, MLPYD FRQ appears in differential form at U12 (U44) pins 8 and 9 and is proportional to the differential voltage at U12 (U44) pins 3 and 2.

8-B-152. The loop output frequency connects to U11 (U43) pin 12, where after being divided by 16, it appears at U11 (U43) pin 2 (CTRLD FRQ) and U18 (U38) pin 9, the V input of the Phase Detector. The R input of the Phase Detector U18 (U38)-6 is driven by the input frequency to the loop, SEL FRQ, which appears in differential form at U12 (U44) pins 11 and 12. This signal is normally the MEAS (REF) frequency but in test mode becomes the 5 MHz CLK.

8-B-153. When the phase of the signal at the V input lags that of the signal at the R input, positive pulses are produced at the U output of U18 (U38) pin 4. The width of these pulses is proportional to the phase error. Similarly, positive pulses are produced at the D output of U18 (U38) pin 11 when the phase of the V input leads that of the R input.

8-B-154. These correction pulses are smoothed by a loop filter and fed back to U12 (U44) pins 3 and 2 to change the output frequency of U12 (U44) pins 8 and 9 in the direction necessary to remove the original phase error. The end result of the feedback loop is a stable output frequency that is 16 times that of the input. Finally, the output of the PLLs, MLPYD FRQ is buffered by U25 to form the signal MEAS (REF) CLK which becomes the input of the Pulse Counters and Swallow Counters.

8-B-155. The network of discrete components in front of U12 (U44) at pins 18 and 19 serves to terminate the MEAS (REF) signal cable and provide low-pass filtering for noise pulses.

8-B-156. PLL Error Detect (L) ((Q))

8-B-157. The circuitry in the PLL Error Detect block responds to two different error conditions in the PLL output signal MLPYD FRQ. The first condition occurs whenever the MEAS (REF) signal drops out for more than a few milliseconds. This might happen if an open circuit developed in the cable, or if the laser beam is blocked. This condition is detected by retriggerable one shot U32A (B). U32A (B) is normally in the high state as a result of the triggers received from the buffered version of the input signal at U12 (U44) pin 13. When the input signal drops out, the one shot returns to the low state within a few milliseconds and activates the Error Latches on sheet 3 of the schematic.

8-B-158. The second condition occurs when the PLL oscillator in U12 (U44) is unable to track the input signal due to excessively high or low frequencies or because of an excessive rate of frequency change. When this occurs, the normally narrow phase-correction pulses appearing at U18 (U38) pin 4 or 11 start to increase in width. When they reach half a cycle in width, U5 (U49) pin 10 or 2 latches in an ECL high state. U14 translates the LOL ERROR from ECL to TTL and connects to the Error Latches on sheet 1 of the schematic. LOL ERROR activates DS1. Note that signal conditions which activate a beam block error will also activate an LOL error but the converse is not necessarily true.

8-B-159. Pulse Counters (M) ((R))

8-B-160. The Pulse Counter, a 16-bit, binary up counter, counts the MEAS (REF) CLK between Sample Commands received by the Swallow Counter & Control. When a Sample Command is received, the Swallow Counter issues control pulses to U10 (U42) pins 9 and 7. This causes the Pulse Counter to stop and hold its contents during the period required to transfer the contents to the Output Buffers, then to reset to zero, and then to resume counting.

8-B-161. In order to process the high frequencies of the MEAS (REF) signal, ECL logic is used for the first 4 bits of the Phase Accumulator, U10 (U42). U25 (U35) translates the outputs of U10 to TTL levels. The most significant bit, TTL CLK at J16-8 (U33-10), drives the remaining three 4 bit TTL counters, U16 (U36) decodes the state which resets the ECL front end. After passing through ECL to TTL translator U24 (U34), the decoded output of U16 clears the 12 bits of TTL counters U1, 2 and 18 (U40, U45, U46).

8-B-162. Swallow Counter and Control (S) (N)

8-B-163. The Swallow Counter and Control block receives the MEAS (REF) CLK from the X16 Frequency Multiplier at J14-13 and the Sample Command at J19-6 from the MPU Control and Interface. This block supplies the S1 and S2 control lines to the Pulse Counter inputs at U10 pins 9 and 7 respectively. Also, TTL LOAD at J14 pin 5 is supplied to the Output Buffers.

8-B-164. Except for the period during the 16 clock cycles following the receipt of a Sample Command, all outputs and internal registers of the Swallow Counter remain in the low state except for U17 (U32) pin 14 which remains in the high state. During the 16 clock cycles following the receipt of a Sample Command, a sequence of pulses propagates down and around the flip-flop chain of the Swallow Counter. This results in the outputs having the following sequence of values:

a. S1, S2 remain low and high respectively during the first three clock cycles following the receipt of the Sample Command. This results in the Pulse Counter continuing to increment.

b. S1, S2 go to the high and high state respectively during the 4th through 8th clock cycles. This causes the Pulse Counter to halt and retain the value reached during the 3rd clock cycle.

c. S1, S2 go to the low and low state respectively during the 9th through 12th clock cycles. This clears the Pulse Counter.

d. S1, S2 go to the high and high state respectively during the 13th clock cycle causing the Pulse Counter to remain in the cleared state.

e. S1, S2 return to the low and high state respectively during the 14th and following clock cycles until another Sample Command is received and the entire cycle is repeated.

8-B-165. TTL LOAD, which is the other output of the Swallow Counter, goes high during the 7th clock cycle following the Sample Command and serves to clock the contents of the Pulse Counter into the Output Buffers. TTL LOAD returns to the low state at the beginning of the 16th clock cycle.

8-B-166. The TEST COUNTERS signal at J3-11 is always low during normal operation. It goes high during some test modes to inhibit feedback paths to facilitate troubleshooting. Also, MP1 (JMP4) is removed for the same reason during some test modes.

8-B-167. TROUBLESHOOTING PROCEDURES FOR A3 CONTROL CIRCUITS, REFERENCE FREQUENCY CHANNEL, AND MEASUREMENT CHANNEL

8-B-167a. TTL and ECL Logic Levels

8-B-167b. The Counter Board uses two families of logic, TTL and ECL. The family that a particular signal or IC belongs to is usually indicated on the schematic, or in this test procedure, or on the circuit board silkscreen. If not, you can usually determine the family type by the manufacturers' part number, a 7400 series is TTL, and a 10000 series is ECL.

8-B-167c. The TTL logic levels are conventional and the preset thresholds on the 5005A may be used when measuring a TTL signal. However, the ECL circuitry is operated between −5.1V and ground rather than between the more conventional ground and −5.2V. The resulting ECL logic levels are as follows (if the actual value of the +5V supply is 5.10 Volts):

ECL High = >4.0 Volts

ECL Low = <3.0 volts

8-B-167d. If the +5V supply is other than 5.10 volts, then these levels are shifted by the same amount that the −5V supply differs from 5.10 Volts.

CAUTION

DO NOT SHORT ECL SIGNALS TO GROUND. DAMAGE TO THE DRIVER MAY RESULT.

8-B-167e. Setting ECL Threshold on the 5005A

8-B-167f. Before using the 5005A in the following tests, set the ECL thresholds as follows:

a. Measure the −5V supply and note this value as V+MEAS.
Typically, V+MEAS = 5.1 Volts.

b. Set Data H Threshold to V+MEAS - 1.1 Volts.
Typically, Data H = 4.00 Volts.

c. Set Data L Threshold to V+MEAS - 1.5 Volts.
Typically, Data L = 3.60 Volts.

d. Set Clock Threshold to V−MEAS - 1.3 Volts.
Typically, Clock Threshold = 3.80 Volts.

e. Set ST-SP-QL Threshold to same value as Clock Threshold in 8-B-167d above.

8-B-168. Data Probe Grounds on the 5005A

8-B-169. Under most conditions the ground lead on the Timing Pod of the 5005A provides an adequate ground for the Data Probe. However, if difficulties are experienced obtaining stable signatures or precise frequency readings, try connecting the Data Probe ground lead to a ground test point near the data source. This will be particularly true for tests which do not require that the Timing Pod be connected.

8-B-170. Standard Troubleshooting Procedures

8-B-171. In the following tests, reference is frequently made to "localize the defective element by standard troubleshooting procedures". This consists of the following.

a. The test procedure places a group of IC's in a definite state and:

   1. provides the correct values of the input and output signals characteristics

      OR

   2. implies use of the schematic to determine the signal characteristics

      OR

   3. simply states a suspected component

b. When the test procedure specifies a suspected component, replace it and run the test again.

c. When signal characteristics are known, measure the signals until a component is found that has correct inputs but erroneous outputs. Most likely this component is defective. If not, check for:

   1. output loading such as a board short

   2. shorted input on a downstream circuit

   If inputs are incorrect, check for open traces and faulty outputs from previous stages.

d. If an erroneous signal comes from another board, perform the test procedure for the suspected board.

e. If a through d does not locate the problem, randomly replace parts in the isolated area until the problem is fixed.

8-B-172. Order of Tests

8-B-173. If the first symptoms observed are sufficient to isolate trouble to a board function, consult the Menu of Tests and Purpose of Test headings to decide on the first test to perform. Otherwise, perform the following tests in the order given. In either case, always perform Test 1.

8-B-174. Menu of Tests

Test 1. Preliminary Tests — Paragraph 8-B-175
Test 2. MPU Interface and Control — Paragraph 8-B-179
Test 3. X10 Frequency Multipliers — Paragraph 8-B-185
Test 4. Pulse Counters and Swallow Counters — Paragraph 8-B-193
Test 5. Error Detectors, External Record, and External Reset — 8-B-199
Test 6. Status Buffer (U26) — Paragraph 8-B-205
Test 7. Output Buffers — Paragraph 8-B-209
Test 8. Not Used
Test 9. Pulse Counters — Paragraph 8-B-214
Test 10. Swallow Counters — Paragraph 8-B-221

NOTE

During the following tests, when an item exists in both the MEAS and REF channels, the REF value is given in parenthesis. However, named signals such as MLPYD FRQ generally rely on context to determine whether the MEAS channel MLPYD FRQ or the REF channel MLPYD FRQ is under consideration. MEAS channel components and signals are on the left side of the board and the REF channel elements are to the right of center.

8-B-175. Test 1. Initial Checks and Preliminary Procedures


8-B-176. Purpose of Test

8-B-177 Test 1 determines basic or obvious problems and provides preliminary procedures for the other tests.

8-B-178. Procedure

a. Check that A3 jumpers [MP 1, 2, 3, and 4 are properly installed in the NORM positions.

b. Check that TEST SWITCH A2S3 is set as shown below.

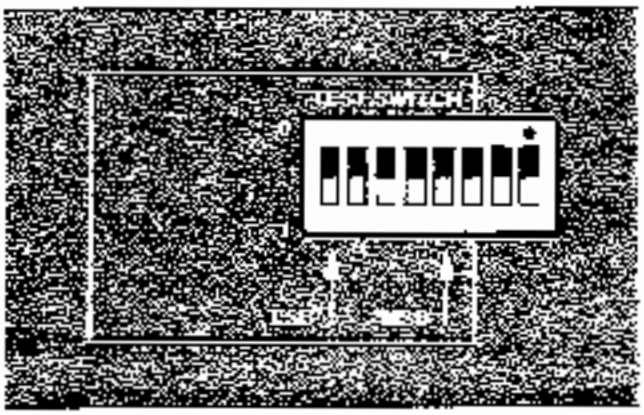

c. Visually inspect the board for broken traces, solder bridges, foreign bodies, mechanically damaged components, etc.

d. Check that the two edge connectors are secure.

e. Measure the +5 V line at TP21, TP38, or TP41, it should be between 5.0 V and 5.2 V, typically 5.1 V.

f. Measure U31-8 to confirm that the +15 V supply is between 14.6 V and 15.4 V.

g. Check U31-1 and 7 to confirm that VBB1 and VBB2 measure between 1.23 V and 1.35 V [at normal temperatures] below the measured value of the +5 V supply. [The Delta V mode of the 5005A is very convenient here.] If not, see sheet 1 of the schematic Figure 8-B-21 and localize the defective element by standard troubleshooting procedures. Note that U25-8 should also be in this same voltage range.

8-B-179. Test 2. MPU Interface and Control

8-B-180. Purpose of Test

8-B-181. This test provides performance verification and troubleshooting procedures for the MPU Interface & Control block shown on sheet 1 of the schematic except for the data paths associated with $\overline{\text{EXT RECORD}}$, $\overline{\text{EXT RESET}}$ and the Error Latches. Key signals verified include SAMPLE, $\overline{\text{LE1}}$, $\overline{\text{LE2}}$, $\overline{\text{LE3}}$, and $\overline{\text{LE4}}$.

8-B-182. Scheme of Test

8-B-183. The MPU exercises the inputs to this block and the output signatures are compared against their correct values.

8-B-184. Procedure

a. Remove Jumper JMP2. Leave other jumpers installed.


b. Connect Timing Pod of 5005A to test points on Processor Board A2 as follows

1. Black to ground
2. Yellow to CLOCK TP9
3. Red to STOP TP11
4. Green to START TP10

c. Set 5005A Function to NORM, and all thresholds to TTL

d. Set Clock and START polarities to negative and STOP polarity to positive.

e. Set TEST SWITCH A2S3 as shown below and push MASTER RESET switch S2.

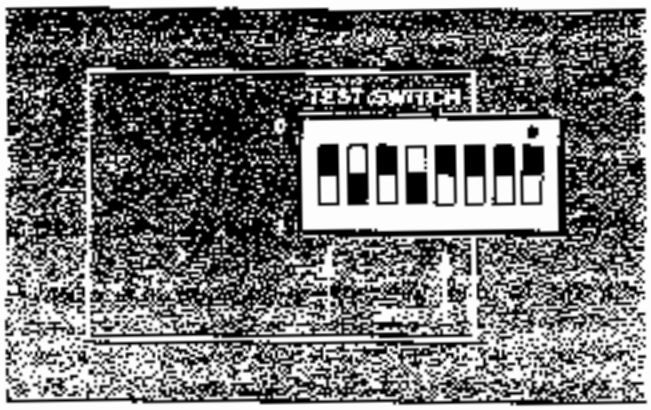

f. Check that the signature of the +5 V line is AFH2 (TP 21, 38, or 41). If not, suspect Processor board first.

g. Confirm the following signatures:

U19-2 ..... HFAF
U19-7 ..... HFAF
U19-10 ..... HFAF

U20-2 ..... AFH2

U23-6 ..... H7A0
U23-9 ..... 7C72

U27-7 ..... PF77
U27-9 ..... 8F80
U27-10 ..... 0U09
U27-11 ..... A9U8

U28-2 ..... 52A9
U28-8 ..... HFAF
U28-10 ..... AP7P

h. If one or more signatures are incorrect, localize the defective element via standard troubleshooting procedures (see Paragraph 8-B-170) utilizing the following valid signatures and sheet 1 of the schematic. Note that the signatures are listed by the driving terminal of a node:

J1-1 (or U20-10) 3834
J1-3 (or U20-5) 58UF
J1-25 (or U27-4) 1CC2
J1-26 (or U21-8) AP7P
J1-43 (or U27-3) UH41
J1-47 (or U20-1) 0000
J1-49 (or U30-4) AFH2

U19-15 ..... HFAF

U20-4 0000
U20-6 ..... U42P
U20-12 ..... 94P6

U21-10 ..... 32AF
U21-13 ..... 707P

U27-12 5527
U27-13 ..... 13PF
U27-14 ..... F926
U27-15 ..... UP7C

U30-5 0000

i. While pressing MASTER RESET Switch A2S2, confirm that U30-5 goes to a TTL HIGH and then returns to LOW after release. If not, see sheet 2 of the schematic diagram.

j. Replace JMP2 in the NORM position and go to next test if this test reveals no defective elements. Otherwise, remove 5005A Timing Pod and restore TEST SWITCH to 00000000.

8-B-185. Test 3. X16 Frequency Multipliers

8-B-186. Purpose of Test

8-B-187. This test provides performance verification and troubleshooting procedures for the X16 Frequency Multipliers including signals inputs to the PLL Error Detect blocks

8-B-188. Scheme of Test

8-B-189. The MPU activates the signal TEST PLLS which directs the 1.000 MHz Clock to the inputs of the phase-locked loops. In this condition, the output of the loops MEAS (REF) CLK should be 16 000 MHz. Since it is not practical to open the feedback loop and place the functional sub-blocks of the PLLs in definite states, the identification of defective components in a malfunctioning loop is more complex. For this reason a flow chart is provided as a guide to the procedure.

8-B-190. Limitations of the Test

8-B-191. This test does not verify the performance of the PLLs at the extreme operating frequencies. Also, the discrete component filter network and the line receiver portion of U12 (U44) are not exercised.

8-B-192. Procedure


NOTE

You may perform this test for both the MEAS and REF (items in parenthesis) channels simultaneously if desired.

a. On the 5005A Set ECL Data threshold.

b. Remove JMP2, leave other jumpers installed.

c. Set TEST SWITCH A2S3 as shown below.

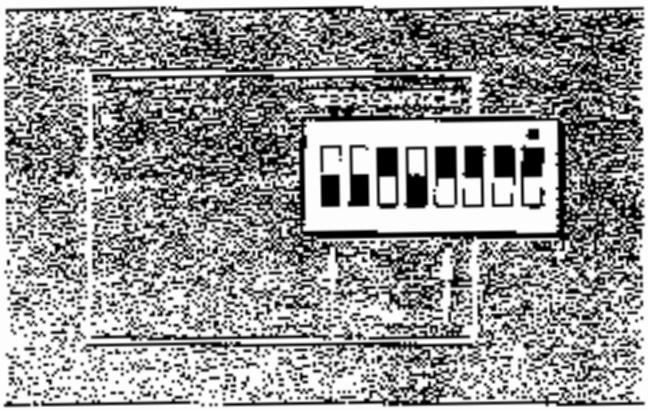

d. Press MASTER RESET switch A2S2.

e. Confirm that C12-17 (U44-17) is a TTL HIGH, and that a 1.000 MHz TTL signal is present at U12-15 (U44-15). If not, go to Test 2

f. Go to flowchart below. Read Paragraph 8-B-168 regarding Data Probe ground as it will aid in performing this test

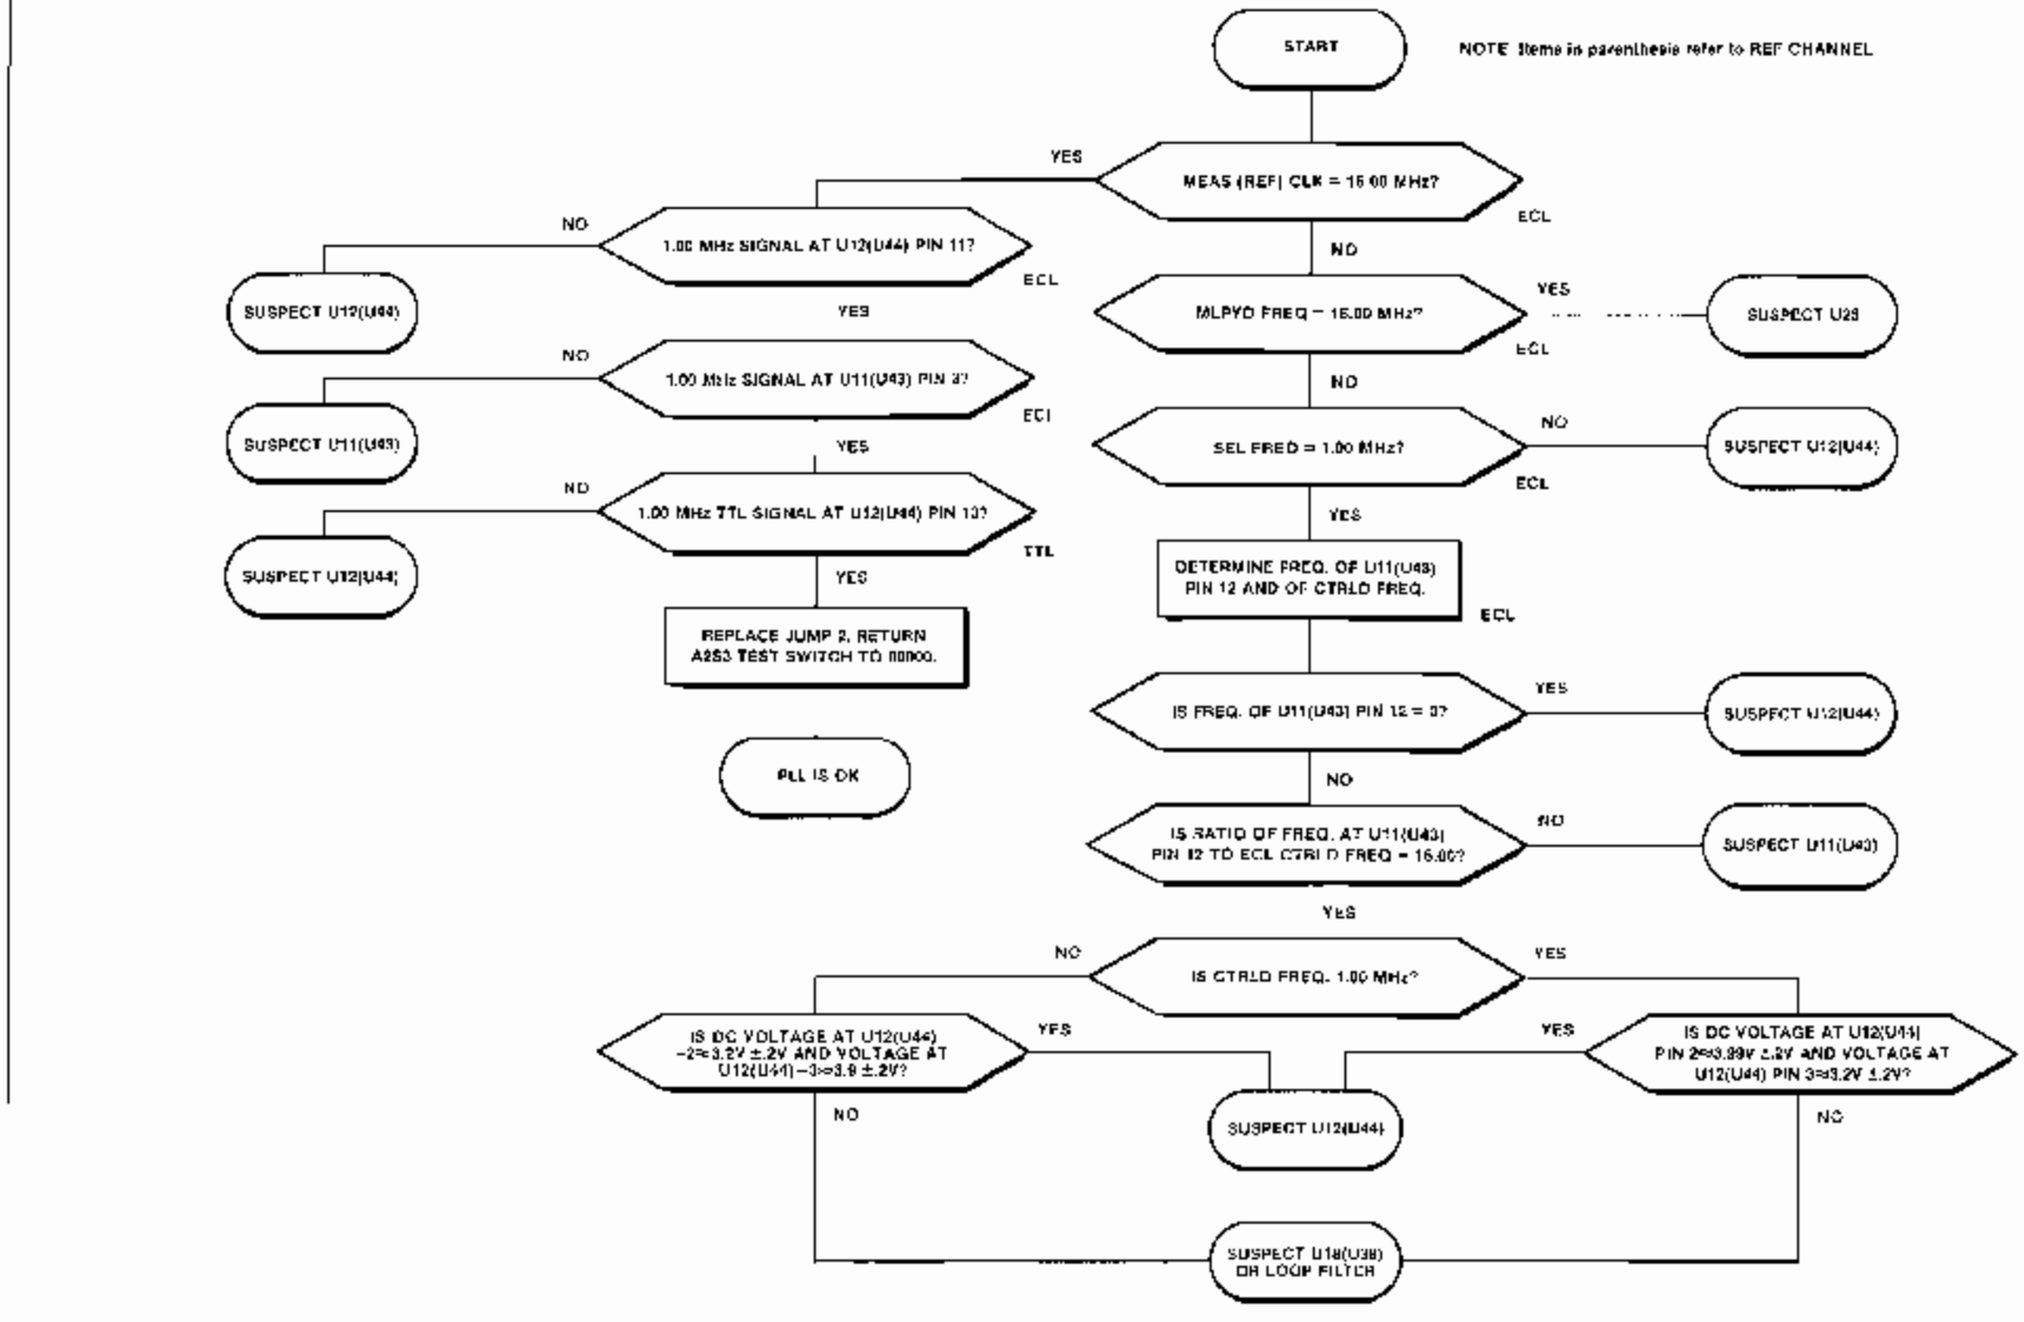


Figure 8-3-27. 5308A A3 PLL Troubleshooting Flow Chart

Figure 8-B-20
5500A A3 PLL TROUBLESHOOTING FLOW CHART

[See Page 8-B-59]

8-B-193. Test 4. Phase Accumulators and Swallow Counters

8-B-194. Purpose of Test

8-B-195. Test 4 provides performance verification of both the Pulse Counter and Swallow Counter and the Control blocks.

8-B-196. Scheme of Test


8-B-197. The most significant bit of the Pulse Counter is jumpered to the sample input of the Swallow Counter and Control block. When this bit goes active, the sampling process is initiated to place both blocks in a repetitive loop thereby allowing signature analysis to be performed.

8-B-198. Procedure

a. If present, remove the Laser Head cable.

b. Remove JMP2, 3. Leave other jumpers installed.

c. Set TEST SWITCH A2S3 as shown below.

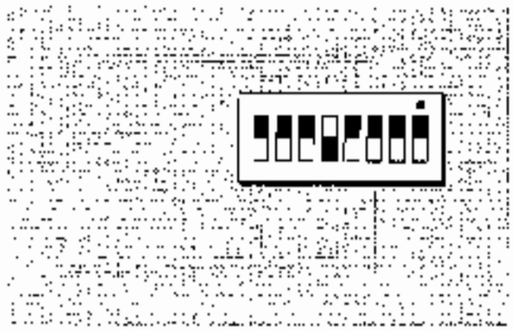

d. On 5005A, set all ECL thresholds.

e. On 5005A set Clock, Start, and Stop polarities to POSITIVE

NOTE

Steps f through l check the MEASUREMENT channel

f. Connect Timing Pod of 5005A as follows (use a DIP test clip):

1. Black to U17-8
2. Yellow to U17-9
3. Red to U17-5
4. Green to U17-2

g. Connect a short jumper from U30-9 to center terminal of JMP3.

h. Connect a short jumper from U1-11 to U19-5

8-B-193. Test 4. Phase Accumulators and Swallow Counters

8-B-194. Purpose of Test

8-B-195. Test 4 provides performance verification of both the Pulse Counter and Swallow Counter and the Control block.

8-B-196. Scheme of Test

8-B-197. The most significant bit of the Pulse Counter is jumpered to the sample input of the Swallow Counter and Control block. When this bit goes active, the sampling process is initiated to place both blocks in a repetitive loop thereby allowing signature analysis to be performed.

8-B-198. Procedure

a. If present, remove the Laser Head cable.

b. Remove JMP2, 3. Leave other jumpers installed.

c. Set TEST SWITCH A2S1 as shown below.



d. On 5005A, set all ECL thresholds.

e. On 5005A, set Clock, Start, and Stop polarities to POSITIVE.

NOTE

Steps f through l check the MEASUREMENT channel.

f. Connect Probing Pod of 5005A as follows: use a DIP test clip:

1. Black to U17-8
2. Yellow to U17-9
3. Red to U17-5
4. Green to U17-2

g. Connect a short jumper from U28-9 to center terminal of JMP3.

h. Connect a short jumper from U11-11 to U9-6.

i. Press MASTER RESET Switch A2S2.

j. Confirm that the frequency of MEAS CLK (ECL) is >50 kHz and <4 MHz. If not go to Test 3

k. Confirm that the total number of pulses (Totalize Function of 5005A) at MEAS CLK (ECL) is 32,782. and that the signature of +5 V is U9P4. If not go to Test 9.

l. Confirm the following TTL signatures. If a signature is not confirmed, fault is most likely in the IC driving the node. See sheet 2 of schematic to identify driver. If this is not the problem go to Test 9.

(MEAS) $\overline{\text{TTL CLR}}$ (TP5) C8A2
(MEAS) TTL CLK (TP8) UP95
(MEAS) TTL LOAD (TP9) 72C0

U7-3 7737
U7-4 ..... 577A
U7-7 ..... HH80
U7-8 ..... 80P1
U7-13 ..... AC99
U7-14 ..... PCF3
U7-17 1180
U7-18 ..... 521H

U13-3 ..... AP82
U13-4 ..... FC39
U13-7 ..... A374
U13-8 ..... UP96
U13-13 ..... C4C3
U13-14 ..... AA08
U13-17 7217
U13-18 ..... A3C1

NOTE

Steps m through s check the REFERENCE channel

m. Move DIP test clip, if used, from U17 to U37 or else make following connections of Timing Pod:

1. Black to U37-6
2. Yellow to U37-9
3. Red to U37-5
4. Green to U37-2

n. Connect a short jumper from U28-9 to center terminal of JMP3, if not already in place

o. Remove jumper from U1-11 to U9-6 and install jumper from U45-11 to center terminal of JMP3.

p. Press MASTER RESET switch A2S2.

q. Confirm that the frequency of REF CLK (ECL) is >50 kHz and <4 MHz. If not go to Test 3

r. Confirm that total number of pulses (Totalize Function of 5005A) at REF CLK (ECL) is 32,782; and that the signature of +5 V is U9P4. If not go to Test 9.

s. Confirm the following TTL signatures. If a signature is not confirmed, the fault is most likely the IC driving the node. See schematic. If this is not the problem go to Test 9.

(REF) $\overline{\text{TTL CLR}}$ (TP30)	C0A3
(REF) TTL CLK (TP32)	UP96
(REF) TTL LOAD (TP26)	72C0
U39-9	7707
U39-6	577A
U39-7	HH86
U39-8	89P2
U39-18	AC99
U39-19	PCF3
U39-17	1180
U39-16	521H
U33-3	AP82
U33-4	FCJ9
U33-7	A374
U33-8	UP96
U33-13	C4C3
U33-14	AA08
U33-17	7211
U33-18	A3C11

t. Remove all jumper wires and Timing Pod.

u. Reinstall JMP2, 3.

v. Restore TEST SWITCH A2S3 to 00000000.

w. Go to Test 5 if this test has revealed no defective components.

8-B-199. Test 5. Error Detectors, External Record, and External Reset

8-B-200. Purpose of Test

8-B-201. Test 5 provides performance verification and troubleshooting of the Beam Block and LOL (Loss-of-Lock) Error Detect circuits, and associated data paths to the Processor Board A2 for both the MEAS and REF channels. In addition, the External Record and External Reset circuitry, and the gates used to generate NMI are checked.

8-B-202. Scheme of Test

8-B-203. The Processor Board A2 activates control signals on the A3 Counter Board to switch the input to the Frequency Multipliers on and off. This condition activates the error detect circuits.


8-B-204. Procedure

a. If present, remove Laser Head Cable.

b. Connect Remote Control Unit 05508-60021 to the rear panel connector of the 5508A.

c. Remove JMP2, 3. Leave other jumpers installed.

d. Set TEST SWITCH A2S3 as shown below and push MASTER RESET switch A2S2.

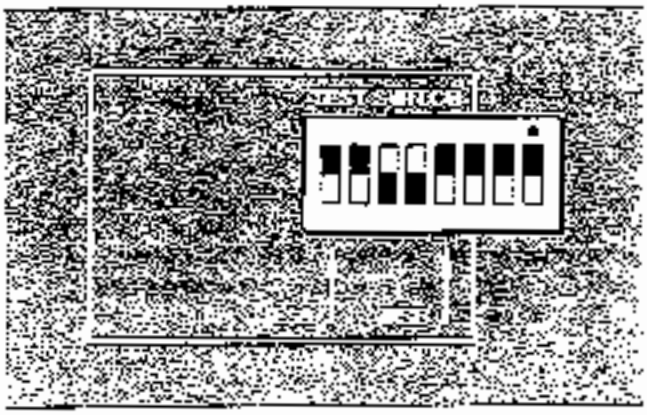

e. Make sure Timing Pod of 5005A is grounded. Set Function to NORM and use Data Probe as a logic probe for next step.

f. Verify that the TTL signal at U24-6 toggles at about a 1 Hz rate and likewise for the signals at U24-1,2,3 4. If not, the trouble may be localized by tracing the erroneous signal back through the Error Latches to its origin in the PLL Error Detect block. See sheet 2(8) of the schematic diagram Figure 8-B-21. Also, verify that the two red LEDs are flashing at about a 1 Hz rate.

NOTE

If one of the above signals is not toggling and Tests 2 and 3 have not been performed, then do so to ensure that the inputs to the circuitry tested here are correct.

NOTE

This test does not verify the ability of the LOL Detectors to respond to excessively high frequency MEAS and REF signals.

g. On the Remote Control Unit, press the RECORD switch and verify that U23-6 changes state. Press the RESET switch and verify that U30 8,9 change state. (The duration of the state change for the above three signals varies randomly but averages about one second.) If not, troubleshoot as indicated by sheet 1 of the schematic utilizing standard trouble shooting procedures. Note that the above signals originate in a straight-line fashion, from the Remote Control Unit. If trouble shooting is required, be sure that Test 2 passes in order to ensure that the inputs to the circuitry tested here are correct.

h. Verify that the TTL signals at U21-2,3 are toggling. If not perform Test 4.

i. Verify that 0 VINT alternates between toggling and a TTL low at about a 1 Hz rate. If not, suspect U21, U28.

j. Verify that U28-5 alternates between toggling and a TTL high at about a 1 Hz rate. If not, suspect U21. See sheet 1 of the schematic. Note that U28-5 is not checked by this procedure because it has no resistive pullup when JMP2 is removed. If NMI does not work when this point is reached (MPU fails to respond to Counter Board) suspect U28. See sheet 1 of the schematic.

k. Replace JMP2 and 3 and restore TEST SWITCH A2S3 to 00000000.

8-B-205. Test 6. Status Buffer (U26)

8-B-206. Purpose of Test

8-B-207. Test 6 verifies the performance of the Status Buffer U26. A U26 failure would most likely be indicated by:

a. Failure of 5508A to respond to External Reset or External Sample but Test 5 of this procedure passes; or

b. Failure of 5508A display to change in Distance Mode but change does occur in Velocity Mode when retroreflector is moved, but Tests 1, 2, and 4 of this procedure passes.

8-B-208. Procedure

a. Remove JMP2. Leave other jumpers installed.


b. Connect Timing Pod of 5005A to test points on the Processor Board A2 as follows:

1. Black to ground
2. Yellow to CLOCK TP9
3. Green to START TP10
4. Red to Counter Board U28-10 (use jumper if necessary)

c. On 5005A, set Function to QUAL, and all thresholds to TTL.

d. Set Clock, Start and Qual polarities to negative. Set Stop polarity to positive.

e. Set TEST SWITCH A2S3 as shown below and push MASTER RESET switch A2S2.

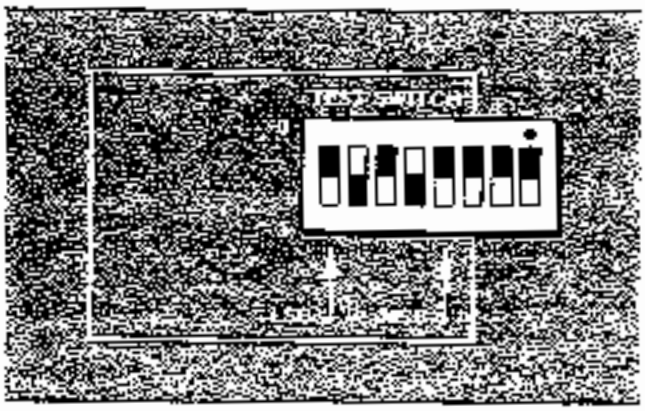

f. Confirm that Signature of +5 V is 0003. If not, suspect Processor Board A2.

g. Confirm the following signatures:

U26-1 0000
U26-2 0001
U26-4 0001
U26-6 0001
U26-8 0001
U26-11 0001
U26-15 0001
U26-17 0002
U26-19 0000

If one or more of the above signatures is incorrect, perform Test 2, and then Test 5 if needed.

h. Confirm the following Signatures:

U26-3 0002
U26-5 0003
U26-9 0001
U26-12 0001
U26-14 0001
U26-16 0001
U26-18 0001

Also confirm that the signature at U26-13 is the same as that at U26-7.

If one or more of the measured signatures above is incorrect, suspect U26.

i. Remove 5005A Timing Pod, replace JMP2, and restore TEST SWITCH A2S3 to 00010000.

8-B-209. Test 7, Output Buffers

8-B-210. Purpose of Test

8-B-211. Test 7 is not a true test since the Output Buffers, U7, U13, U33, U39 are very difficult to verify. If an output buffer is defective, the symptoms most likely to appear are as follows:

a. Self-test 1 fails, as indicated by "FAIL1" on the 5508A display, but Tests 1, 2, 3 and 4 of this procedure pass. Change U7 first and then U13.

b. Self-test 2 fails, as indicated by "FAIL2" on the 5508A display, but Tests 1, 2, 3, and 4 of this procedure pass. Change U30 first and then U33.

8-B-212. Test 8, Not Used

8-B-213 Test 8 requires special factory test equipment and cannot be performed in the field.

8-B-214. Test 9, Pulse Counters

8-B-215. Purpose of Test

8-B-216. Test 9 provides performance verification and troubleshooting procedures for the Pulse Counter portions of the Counter Board. Perform this test only if Test 4 fails.

8-B-217. Scheme of Test


8-B-218 The Pulse Counters are placed in a mode to continually divide the X16 multiplied 1 MHz CLK and the outputs of the counter are checked for the correct frequencies.

8-B-219. Procedure

8-B-220. If either the MEAS or REF channel failed Test 4 perform this test for the failed channel. If both channels failed, perform this test for both simultaneously.

a. Remove JMP2 and 3. Leave all other jumpers installed.

b. Place TEST SWITCH A2S3 as shown below.

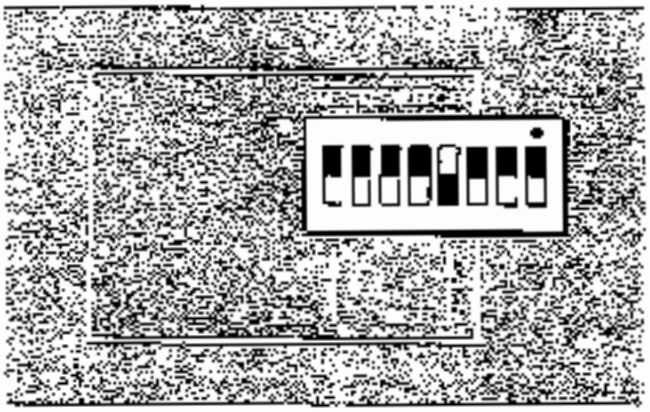

c. Press MASTER RESET Switch A2S2.

d. Make sure ground lead on Timing Pod of 5005A is grounded. Set ECL thresholds on 5005A.

e. Confirm that MEAS (REF) CLK is a 10.000 MHz ECL signal. If not, perform Test 3.

f. Confirm that U10(U42)-7 is an ECL high and that U10(U42)-9 is an ECL low. If not, perform Test 10.

g. Confirm that MEAS (REF) TTL CLK is a TTL high. If not, suspect U16, U14 (U36, U34). See Pulse Counter portion of schematic for troubleshooting.

h. Confirm the following TTL frequencies:

U13 (U33)-3 .... 8.00 MHz
U13 (U33)-4 ..... 4.00 MHz
U13 (U33)-7 ..... 2.00 MHz
U13 (U33)-6 ..... 1.00 MHz

If the above are not present then confirm the following ECL frequencies:

U10 (U42)-11 ..... 8.00 MHz
U10 (U42)-15 ..... 4.00 MHz
U10 (U42)-2 ..... 2.00 MHz
U10 (U42)-3 .. .. 1.00 MHz

If these are not present suspect U10 (U42). If these are present make sure VBB (see step 8 of Test 1) is present at U15 (U35)-2,6,10,14 then suspect U15 (U35).

i. Confirm the following TTL frequencies:

U13 (U33)-13 ..... 500 KHz
U13 (U33)-14 ..... 250 KHz
U13 (U33)-17 ..... 125 KHz
U13 (U33)-18 ..... 62.5 KHz

If these are not present suspect U8 (U40)

j. Confirm the following TTL frequencies:

U7 (U39)-3 ..... 31.25 KHz
U7 (U39)-4 ..... 15.63 KHz
U7 (U39)-7 ..... 7.81 KHz
U7 (U39)-8 ..... 3.91 KHz

If these are not present suspect U2 (U46)

k. Confirm the following TTL frequencies:

U7 (U39)-13 ..... 1.95 KHz
U7 (U39)-14 ..... 0.98 KHz
U7 (U39)-17 ..... 0.49 KHz
U7 (U39)-18 ..... 0.24 KHz

If these are not present suspect U1 (U45)

l. Replace IMP2 9

m. Return TEST SWITCH A2S3 to 00000000.

n. If a defective component has not been found in Test 9 then perform Test 10.

8-B-221. Test 10. Swallow Counters

8-B-222. Purpose of Test

8-B-223. Test 10 provides performance verification and troubleshooting of the Swallow Counter & Control portions of the Counter Board. Perform this test when Test 9 has failed.

8-B-224. Scheme of Test


8-B-225. The X16 multiplied 1 MHz CLK drives the Sample input of the Swallow Counters while the internal feedback paths are disabled. This results in the input signal being divided and shifted about the circuitry. The output frequencies are then measured and compared against known good values.

8-B-226. Procedure (Items in parenthesis refer to REF channel)

8-B-227. If either MEAS or REF channel fails Test 4 perform this test for the failed channel. If both channels failed, do not perform this test for both simultaneously but rather check each sequentially.

a. Remove IMP1, 2, 3, 4.

b. Set TEST SWITCH A2S3 as shown below

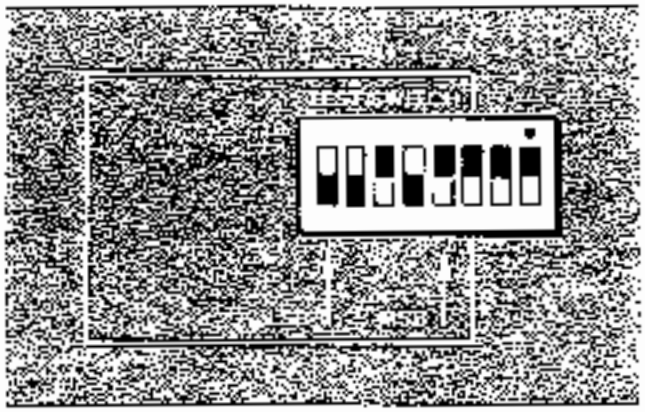

c. Set ECL thresholds on 5005A. Check that Timing Pod of 5005A is grounded

d. Push MASTER RESET Switch A2S2

e. Connect a short jumper from U9-6 to U9-11 (U41-6 to U41-11). A DIP Clip is convenient here

f. Confirm that a 16.000 MHz ECL signal is present at MEAS (REF) CLK. If not, perform Test 8.

g. Confirm that U4-9 (U48-9) is a steady ECL high. If not, perform Test 2.

h. Confirm the following ECL frequencies:

U4-7 (U48-7) ..... 8.000 MHz
U9-12 (U47-12) ..... 8.000 MHz

If these are not correct, refer to the Swallow Counter & Control portion of sheet 2 (sheet 3) of the schematic and trace the erroneous signal to the defective element utilizing standard troubleshooting procedures and the following correct ECL frequencies:

U9-6 (U41-6) ..... 16.000 MHz
U9-2 (U41-2) ..... 8.000 MHz
U17-2 (U37-2) ..... 8.000 MHz
U17-3 (U37-3) ..... 8.000 MHz
U9-15 (U41-15) ..... 8.000 MHz

i. Confirm the following ECL frequencies:

U17-15 (U37-13) ..... 4.000 MHz
U17-14 (U37-14) ..... 1.000 MHz
U17-4 (U37-4) ..... 500 KHz

Similarly, if these are not correct, refer to the same portion of the schematic utilizing the following correct ECL frequencies and standard troubleshooting procedures.

U4-15 (U48-15) ..... 2.000 MHz
U4-2 (U48-2) ..... 1.000 MHz
U4-3 (U48-3) ..... 500 KHz
U17-12 (U37-10) ..... 4.000 MHz
U17-11 (U37-11) ..... 1.000 MHz
U17-7 (U37-7) ..... 500 KHz

j. Confirm that the frequency of MEAS (REF) TTL LOAD is 500kHz. If not, suspect U14 (U34) after checking that VBB is present at U14 (U34)-7.

NOTE


If Test 4 fails and this point is reached without identifying a defective component then try replacing ICs in the following order.


U3 (U47), U17 (U37), U4 (U48), U10 (U42), U8 (U40) and associated components.

k. Confirm that the frequency of MEAS (REF) TTL CLR is 1.00MHz. If not, refer to the Pulse Counter portion of sheet 2 (sheet 3) of the schematic and use the following correct ECL frequency to localize the problem.


U14 (U34)-1.2 ..... 1.00 MHz

l. Repeat for other channel if necessary, otherwise remove wire jumpers, replace [MP1, 2, 3, 4; restore TEST SW1[C1] A2S3 to 00000000.

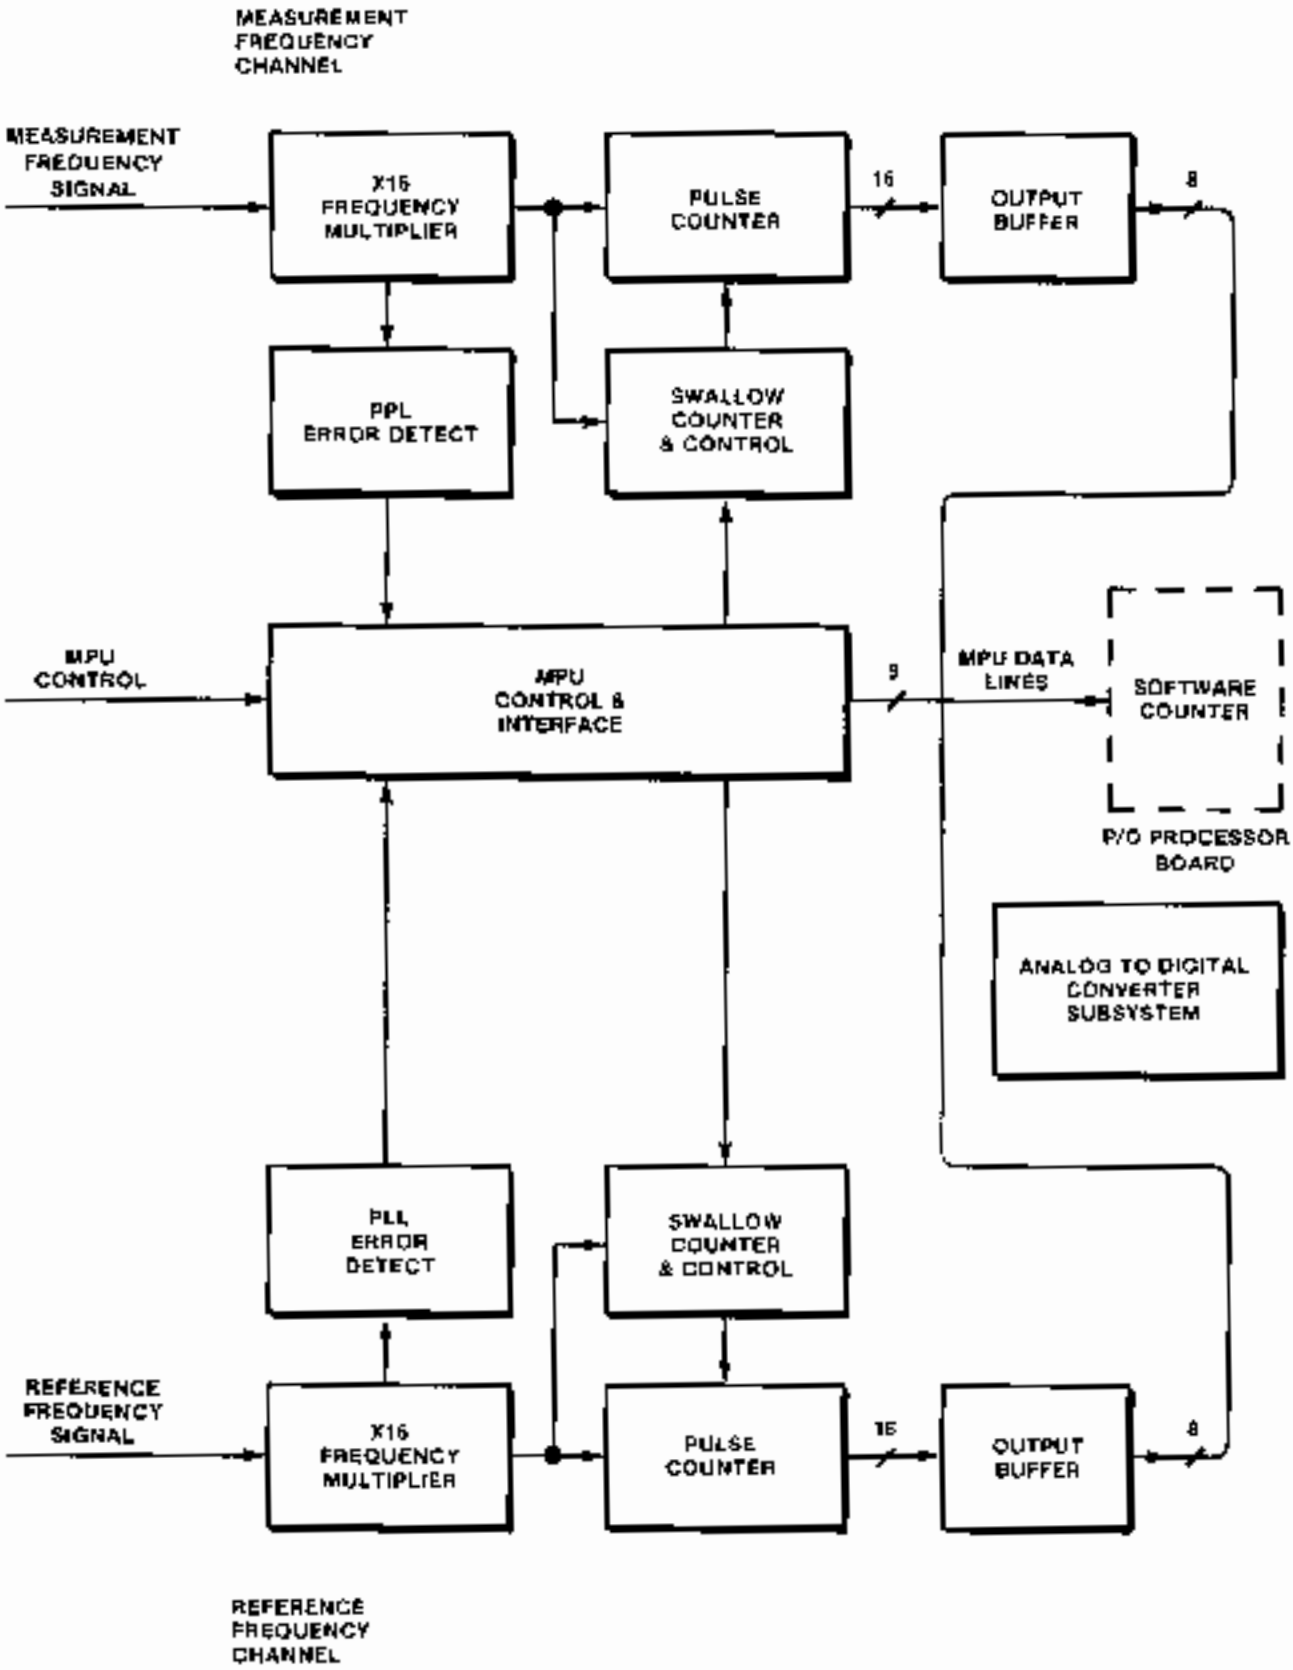
MEASUREMENT FREQUENCY CHANNEL
MEASUREMENT FREQUENCY SIGNAL
X16 FREQUENCY MULTIPLIER
PULSE COUNTER
16
OUTPUT BUFFER
8
PPL ERROR DETECT
SWALLOW COUNTER & CONTROL
MPU CONTROL
MPU CONTROL & INTERFACE
9
MPU DATA LINES
SOFTWARE COUNTER
P/O PROCESSOR BOARD
ANALOG TO DIGITAL CONVERTER SUBSYSTEM
PLL ERROR DETECT
SWALLOW COUNTER & CONTROL
REFERENCE FREQUENCY SIGNAL
X16 FREQUENCY MULTIPLIER
PULSE COUNTER
16
OUTPUT BUFFER
8
REFERENCE FREQUENCY CHANNEL

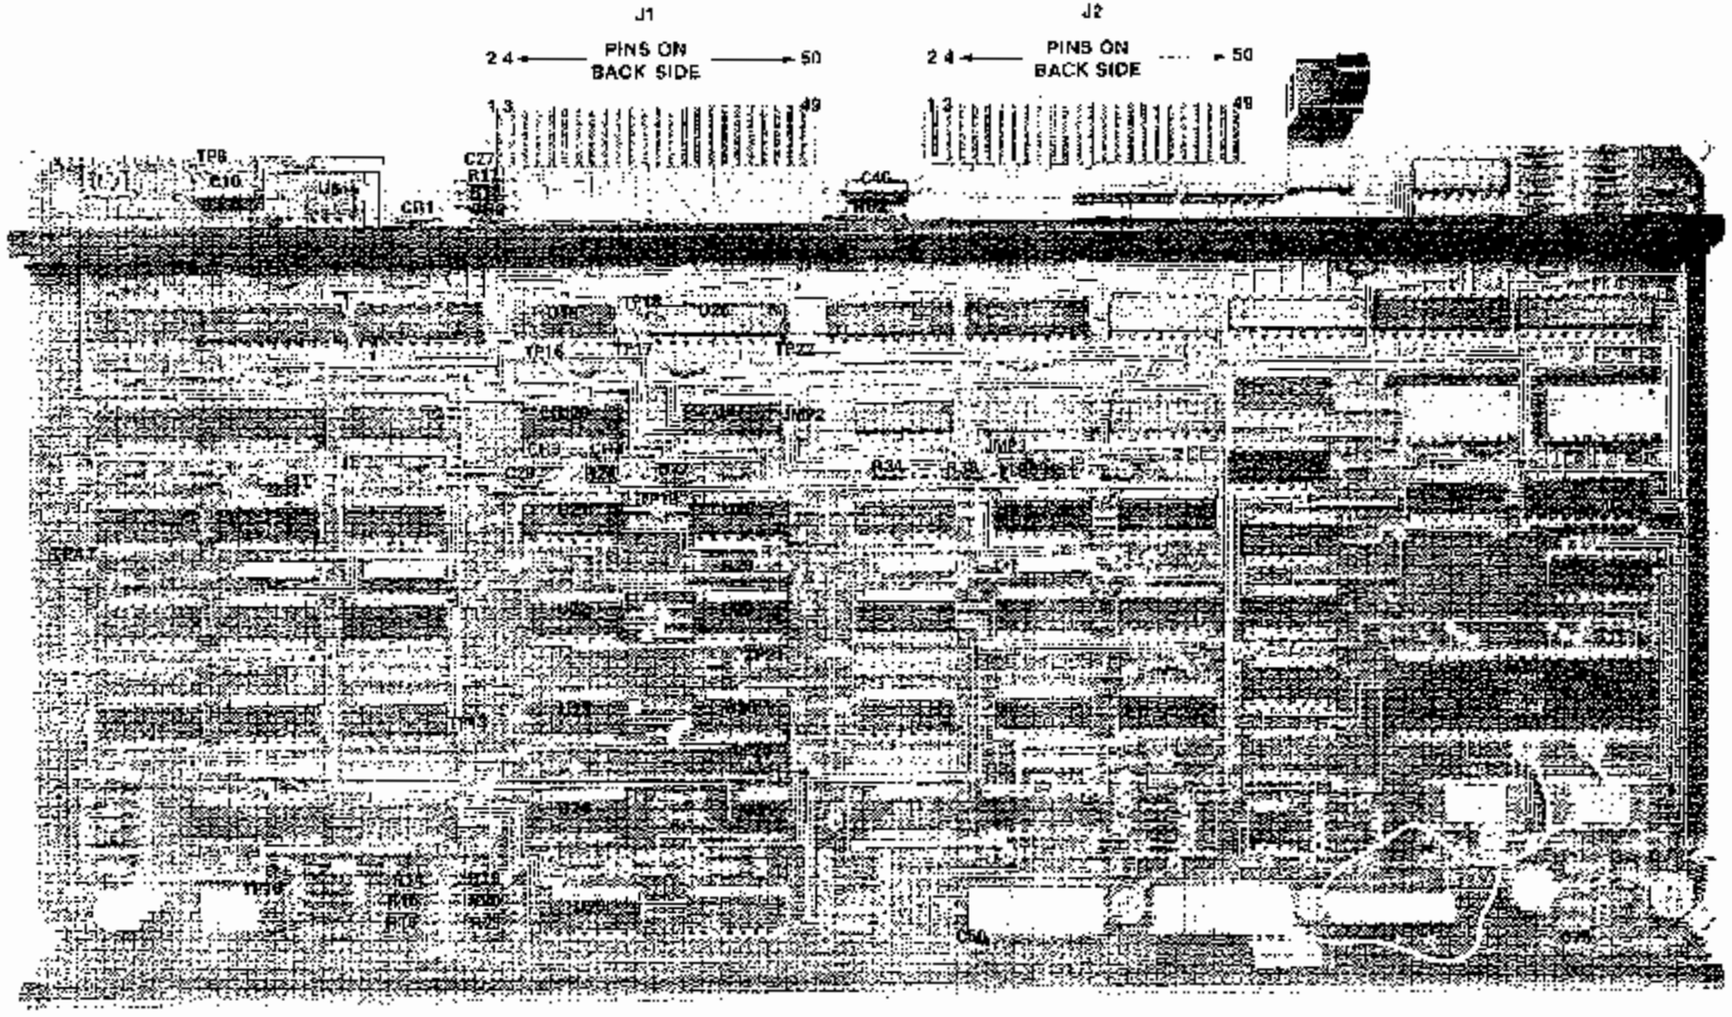

THE COMPLETE COMPONENT LOCATOR
FOR A3 I9 SHOWN ON SHEET 5

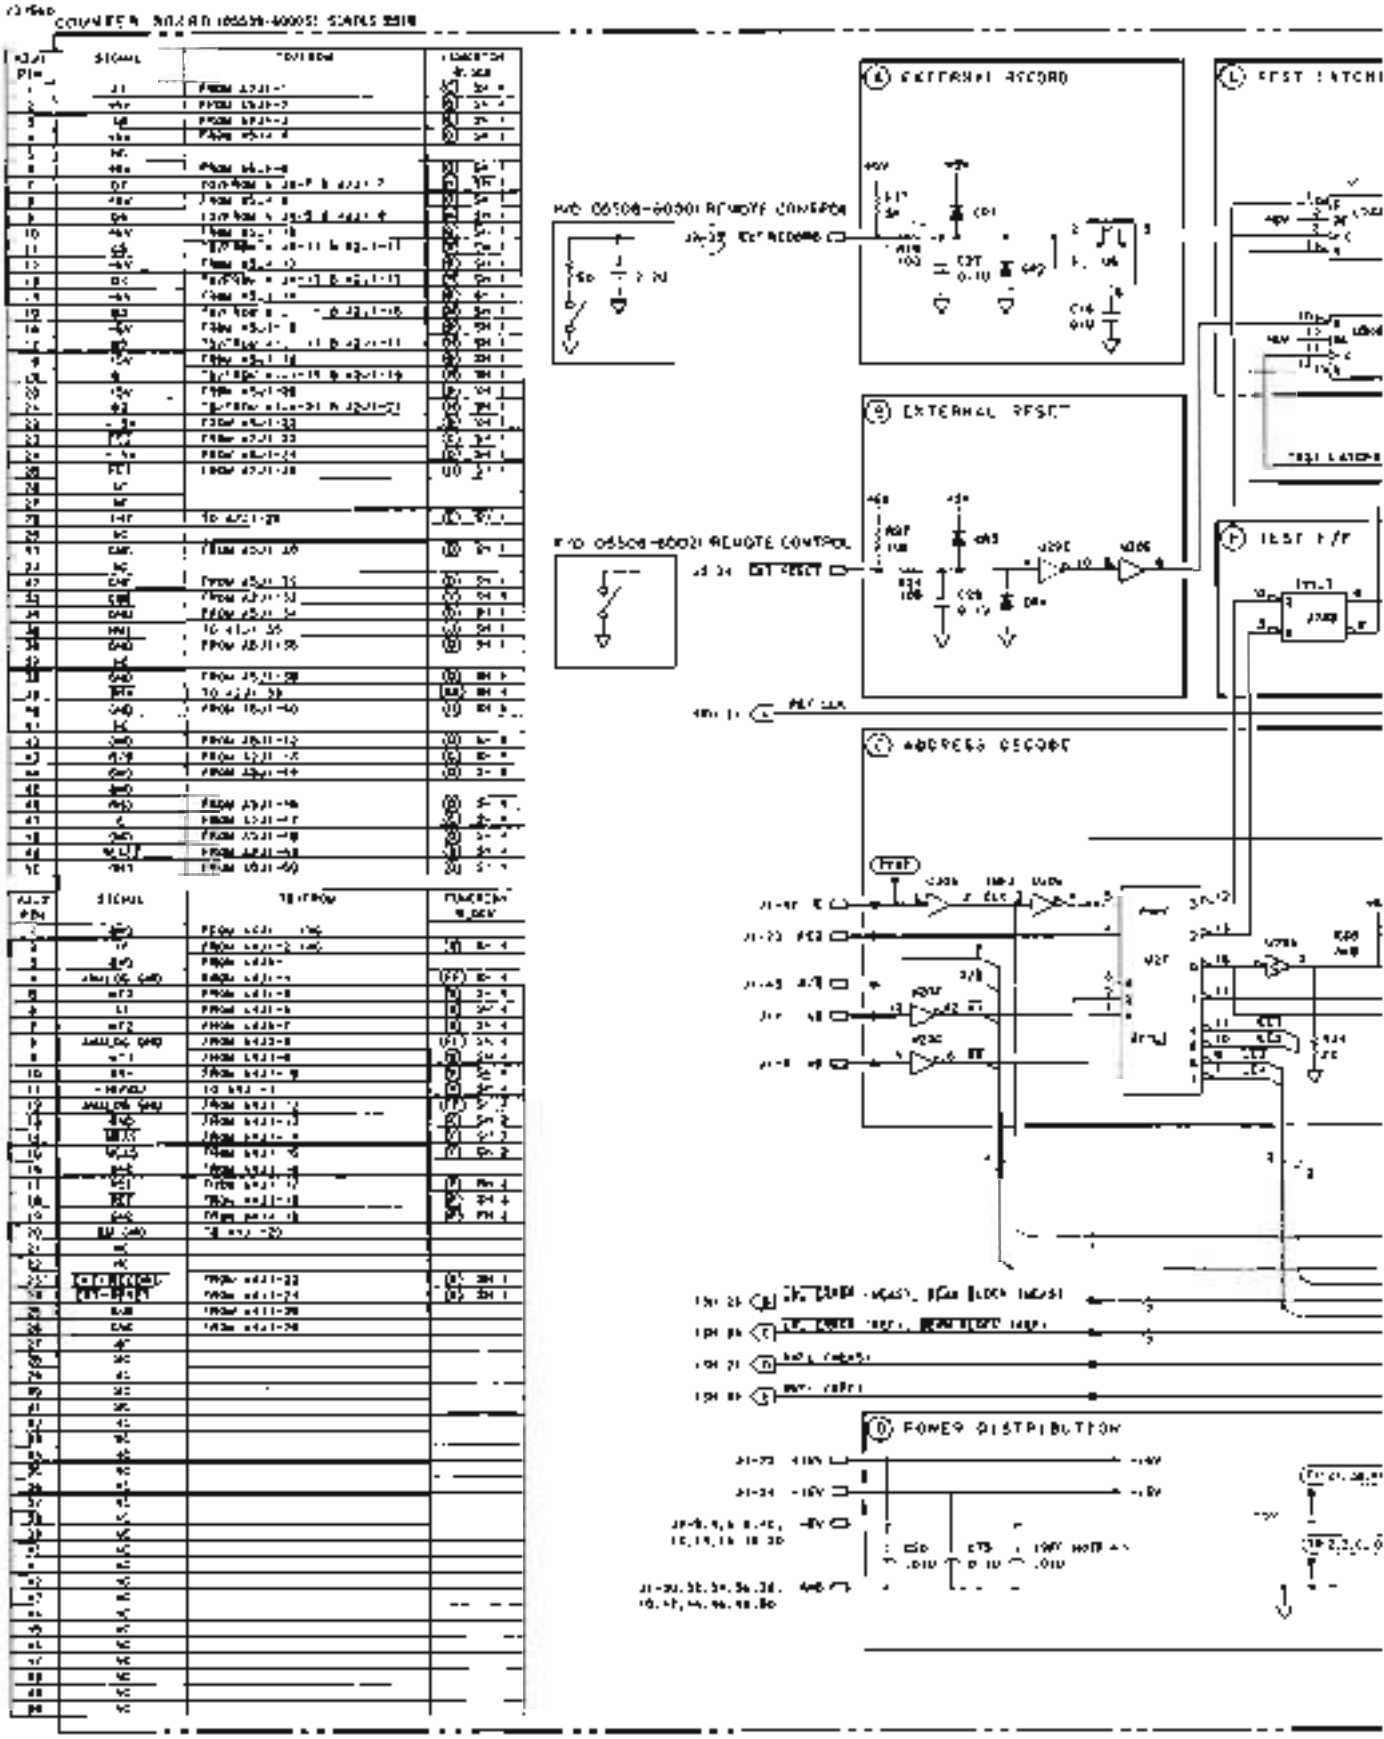
COUNTER BOARD (05508-60005) SIGNALS USED
EXTERNAL RECORD
EXTERNAL RESET
ADDRESS DECODE
POWER DISTRIBUTION
REMOTE CONTROL
REMOTE CONTROL

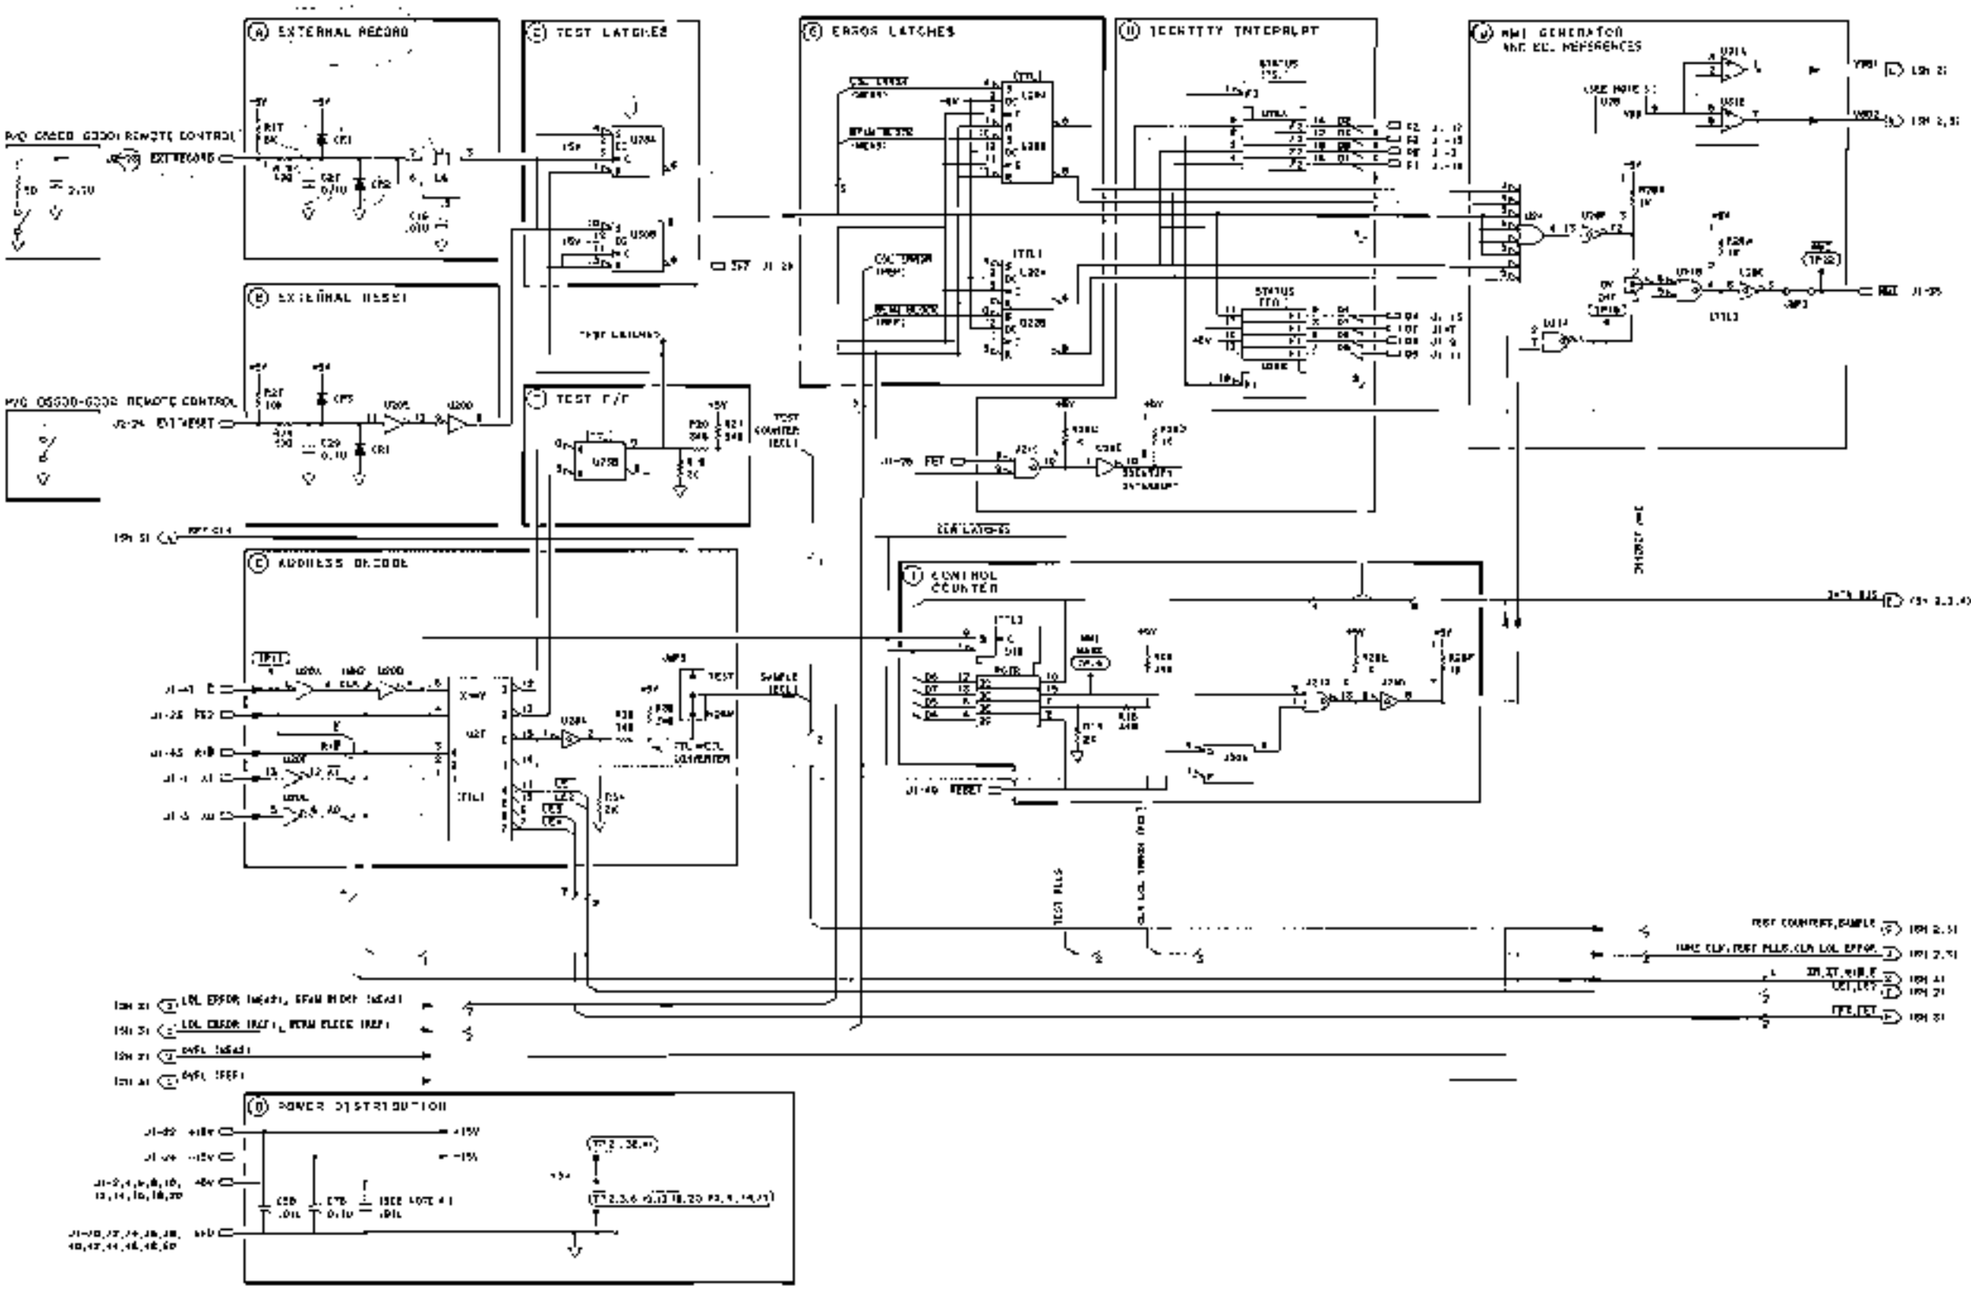


Figure 8-B-21 5506A AD Counter Board 05508-60003, Counter Control Circuits (Sheet 1 of 3)


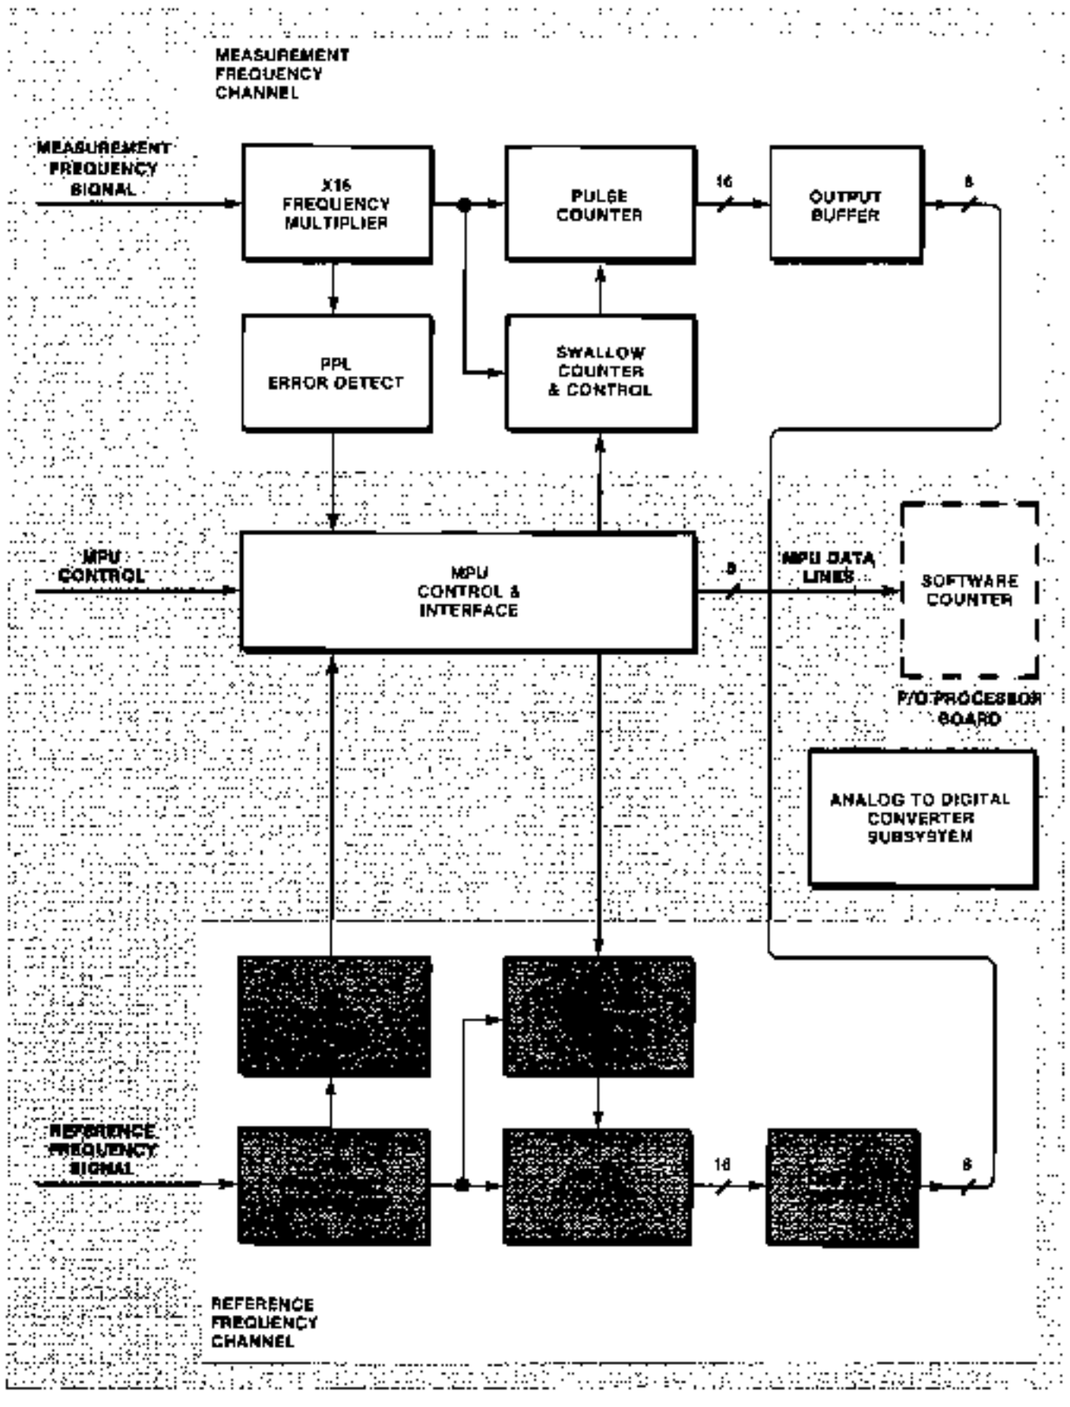


Figure 8-B-22
5508A A3 COUNTER BOARD 05508-60003, COUNTER CONTROL CIRCUITS (Sheet 1 of 5)

(See Page 8-B-71)

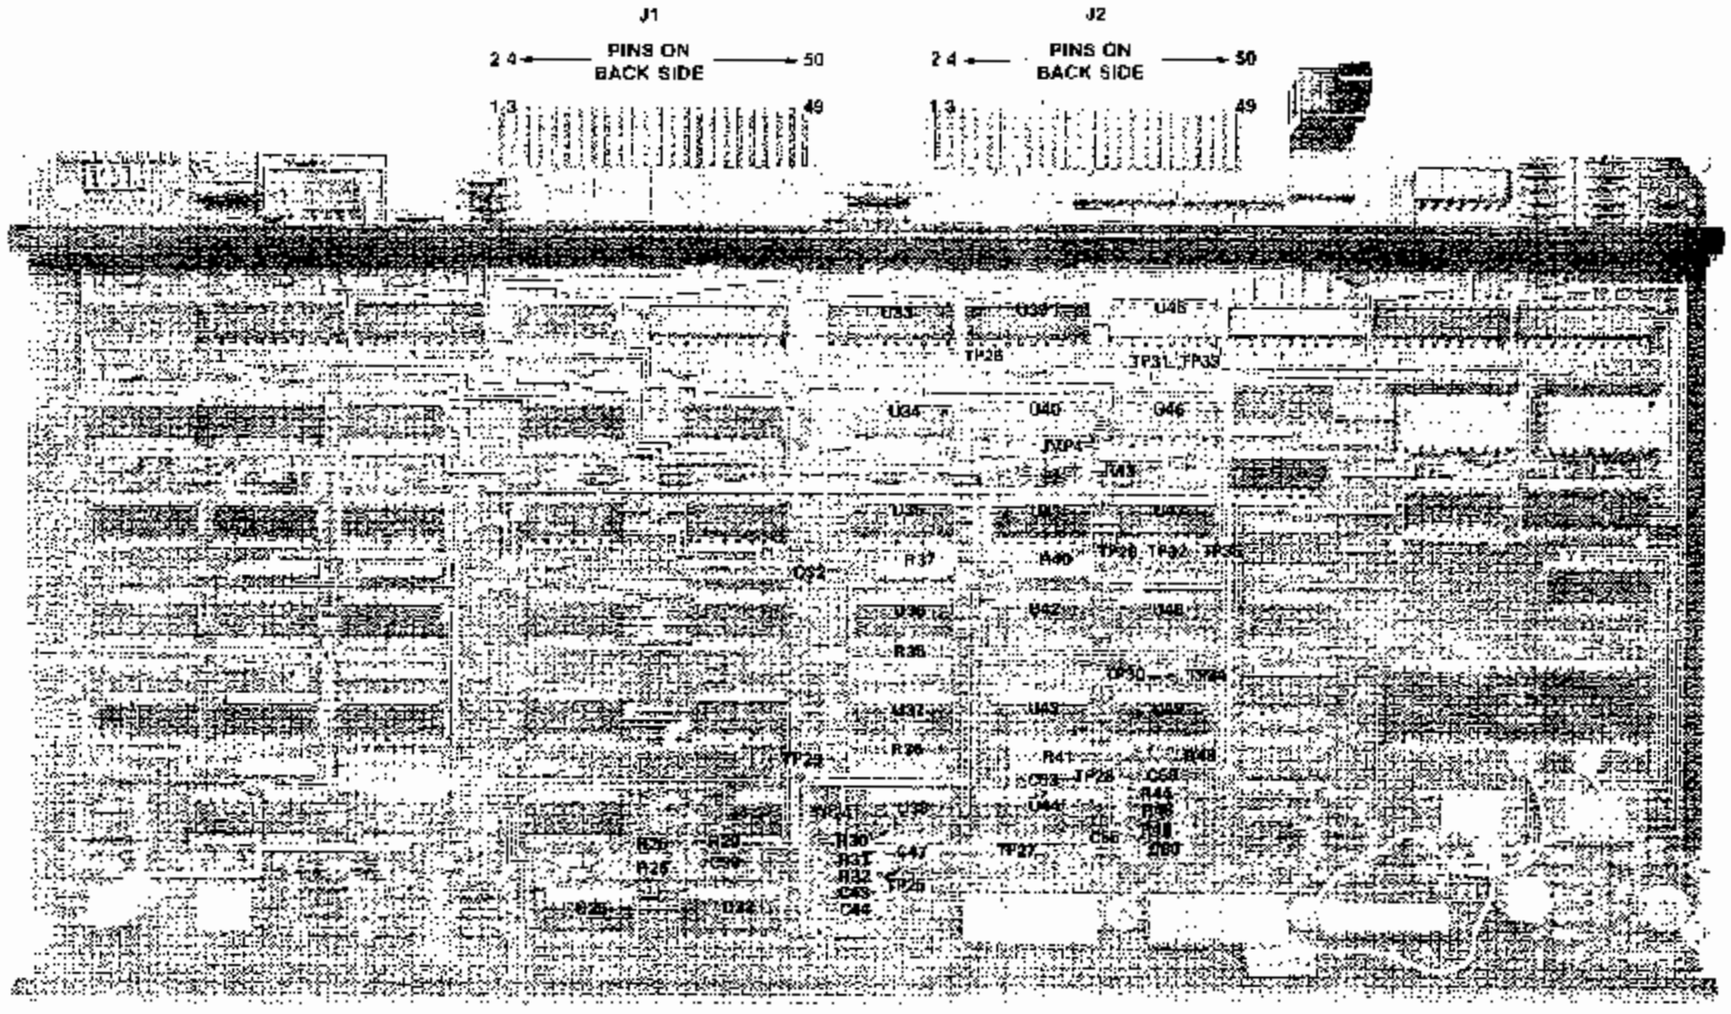

THE COMPLETE COMPONENT LOCATOR
FOR A3 IS SHOWN ON SHEET 5

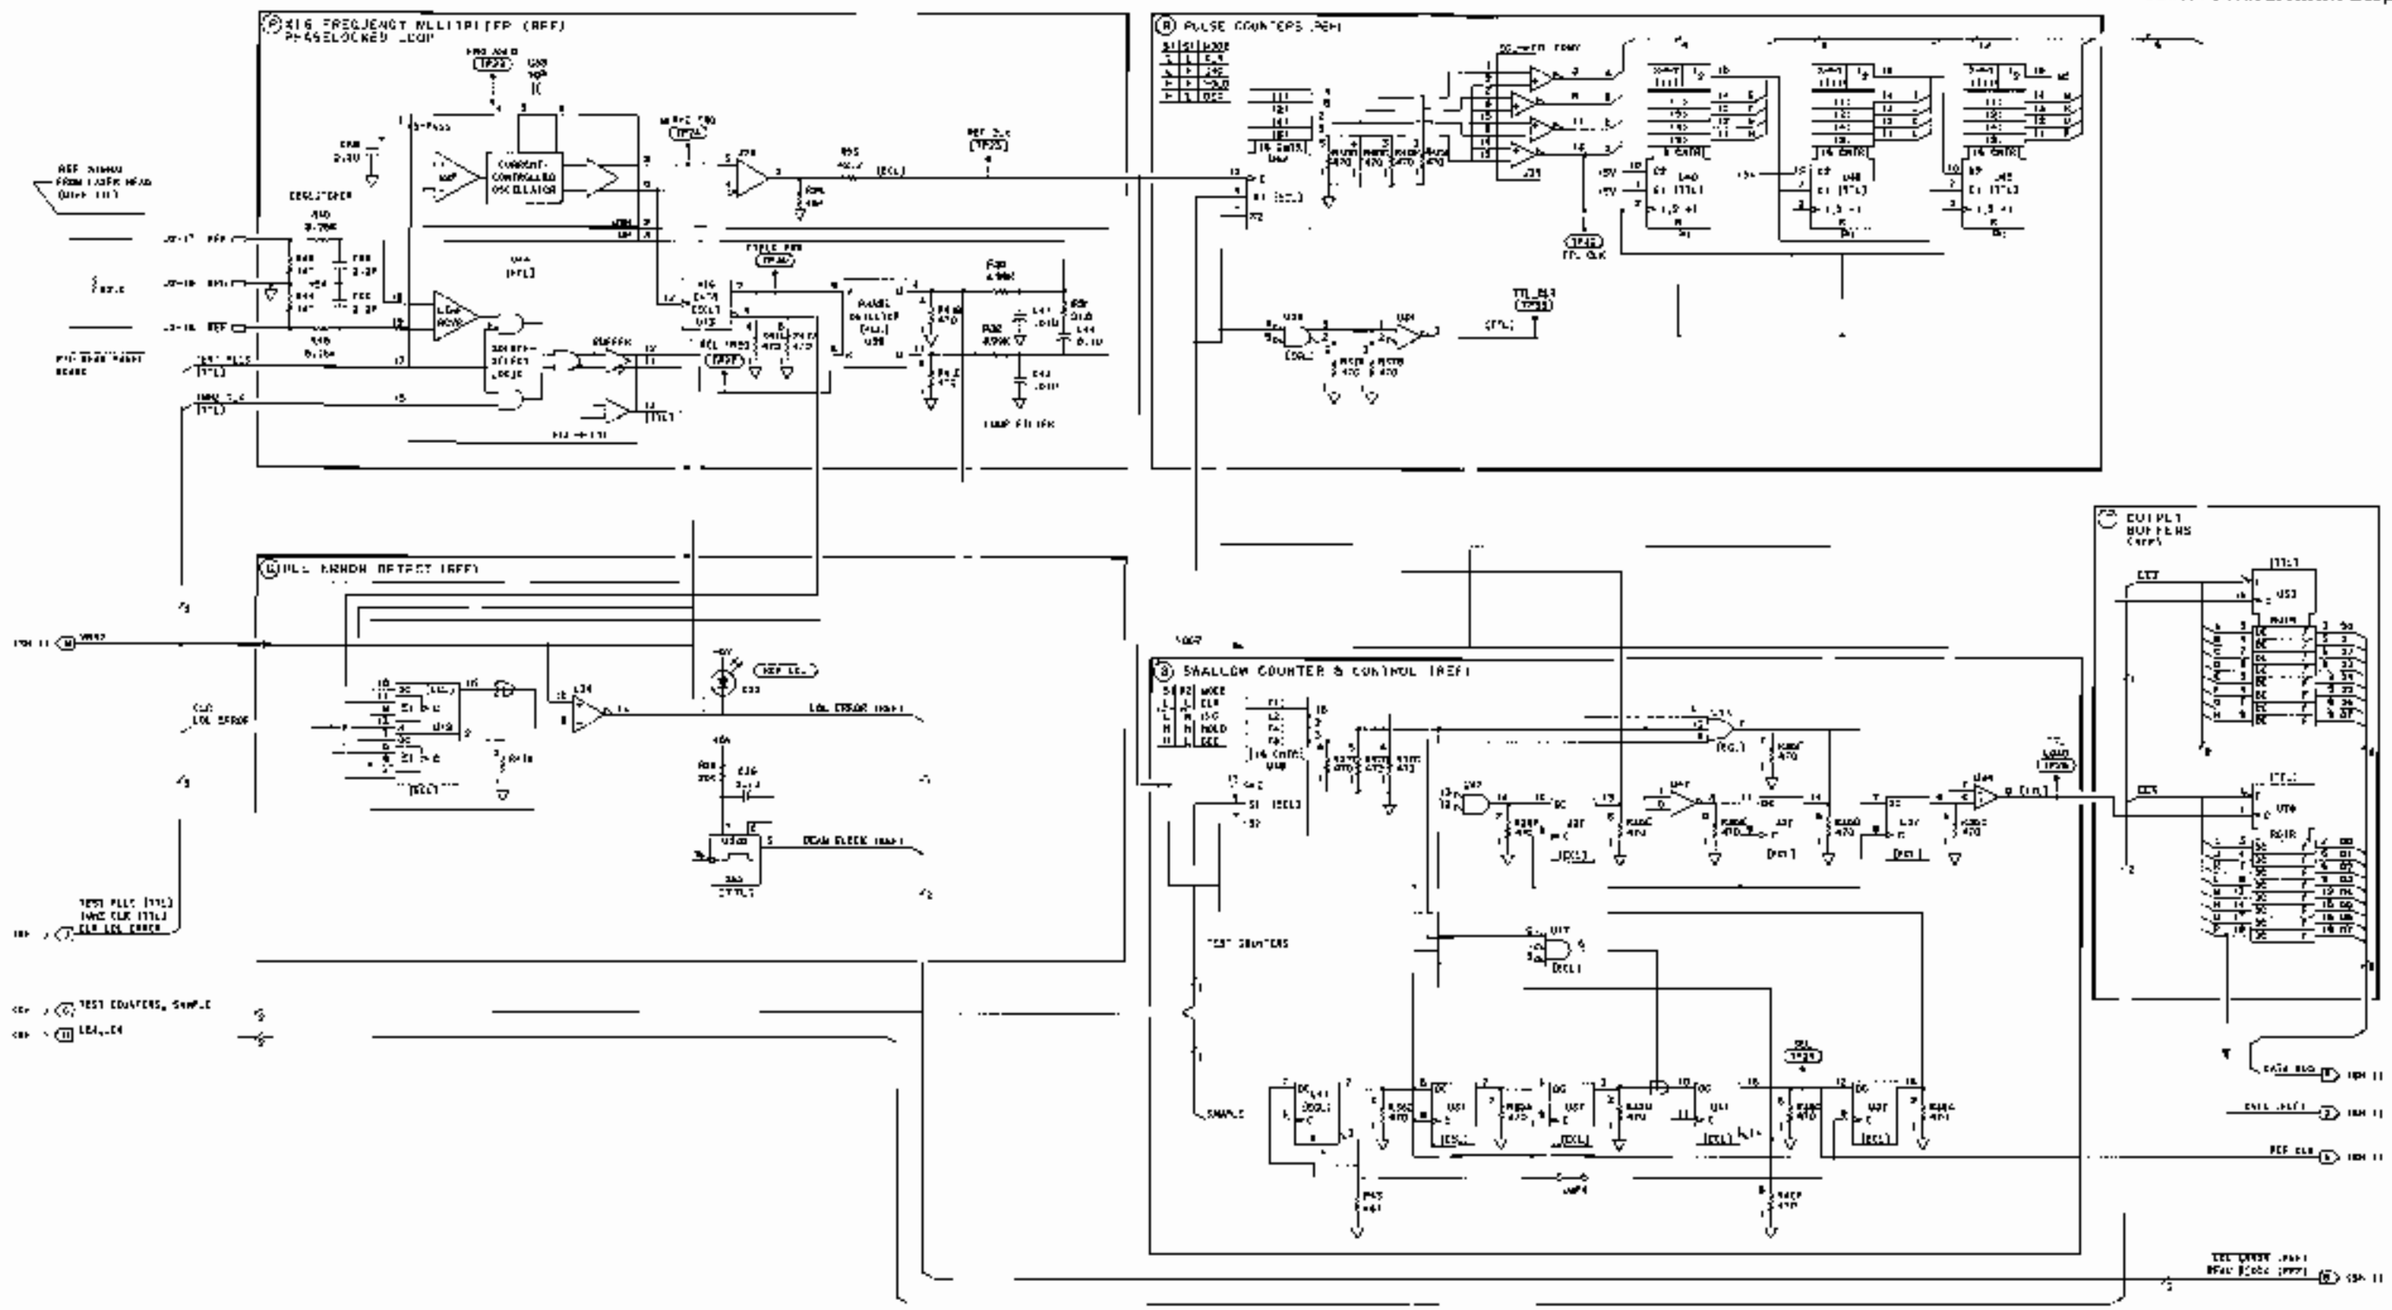


Figure 6-B-23. 5506A A3 Counter Board 05508-60003, Reference Frequency Channel (Sheet 2 of 5)


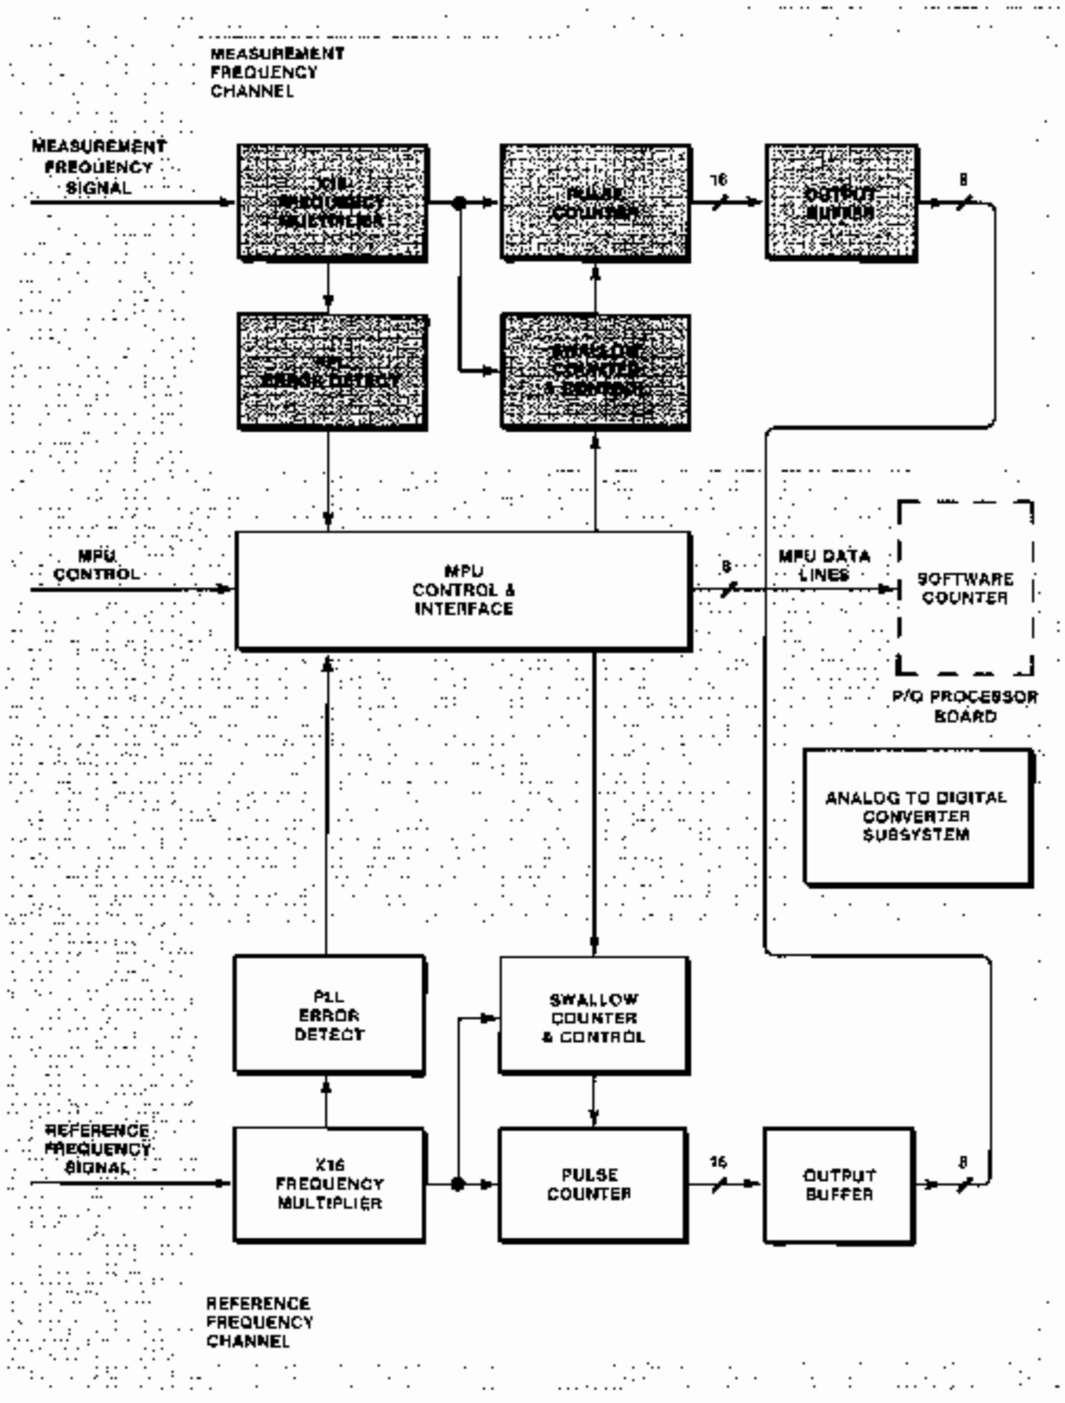


Figure 8-B-21
5508A A3 COUNTER BOARD 05508-60003,
REFERENCE FREQUENCY CHANNEL (Sheet 2 of 5)

(See Page 8-B-73)

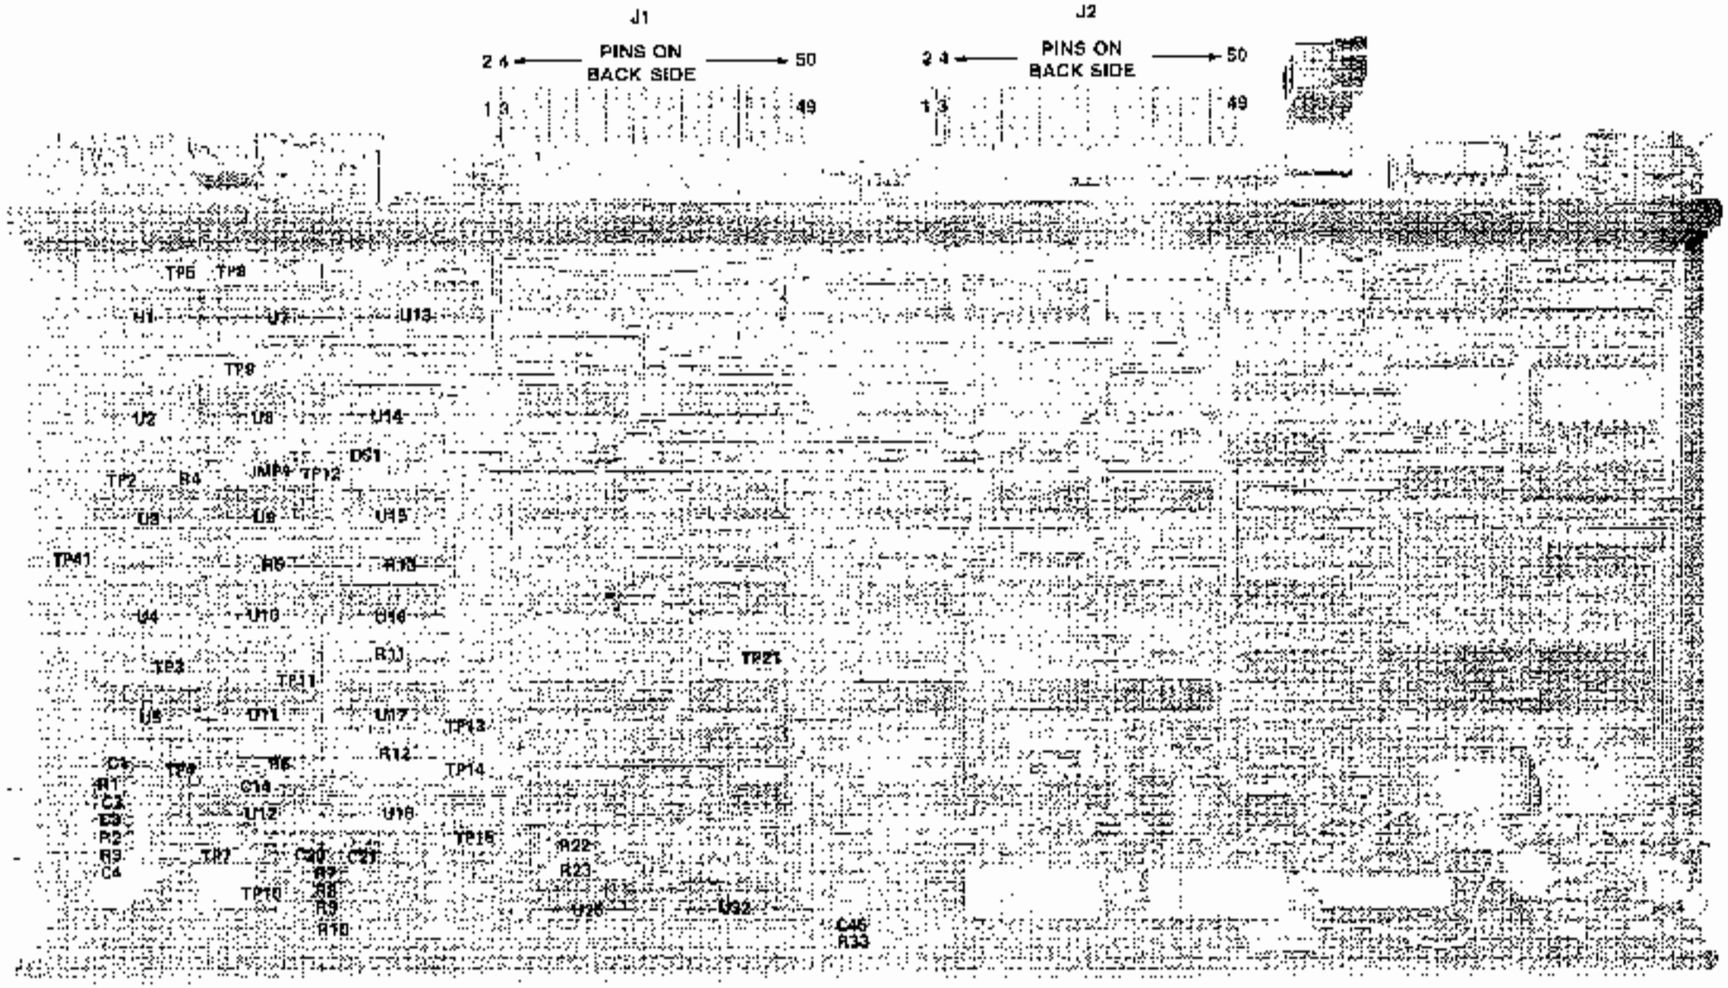

THE COMPLETE COMPONENT LOCATOR
FOR A3 IS SHOWN ON SHEET 6

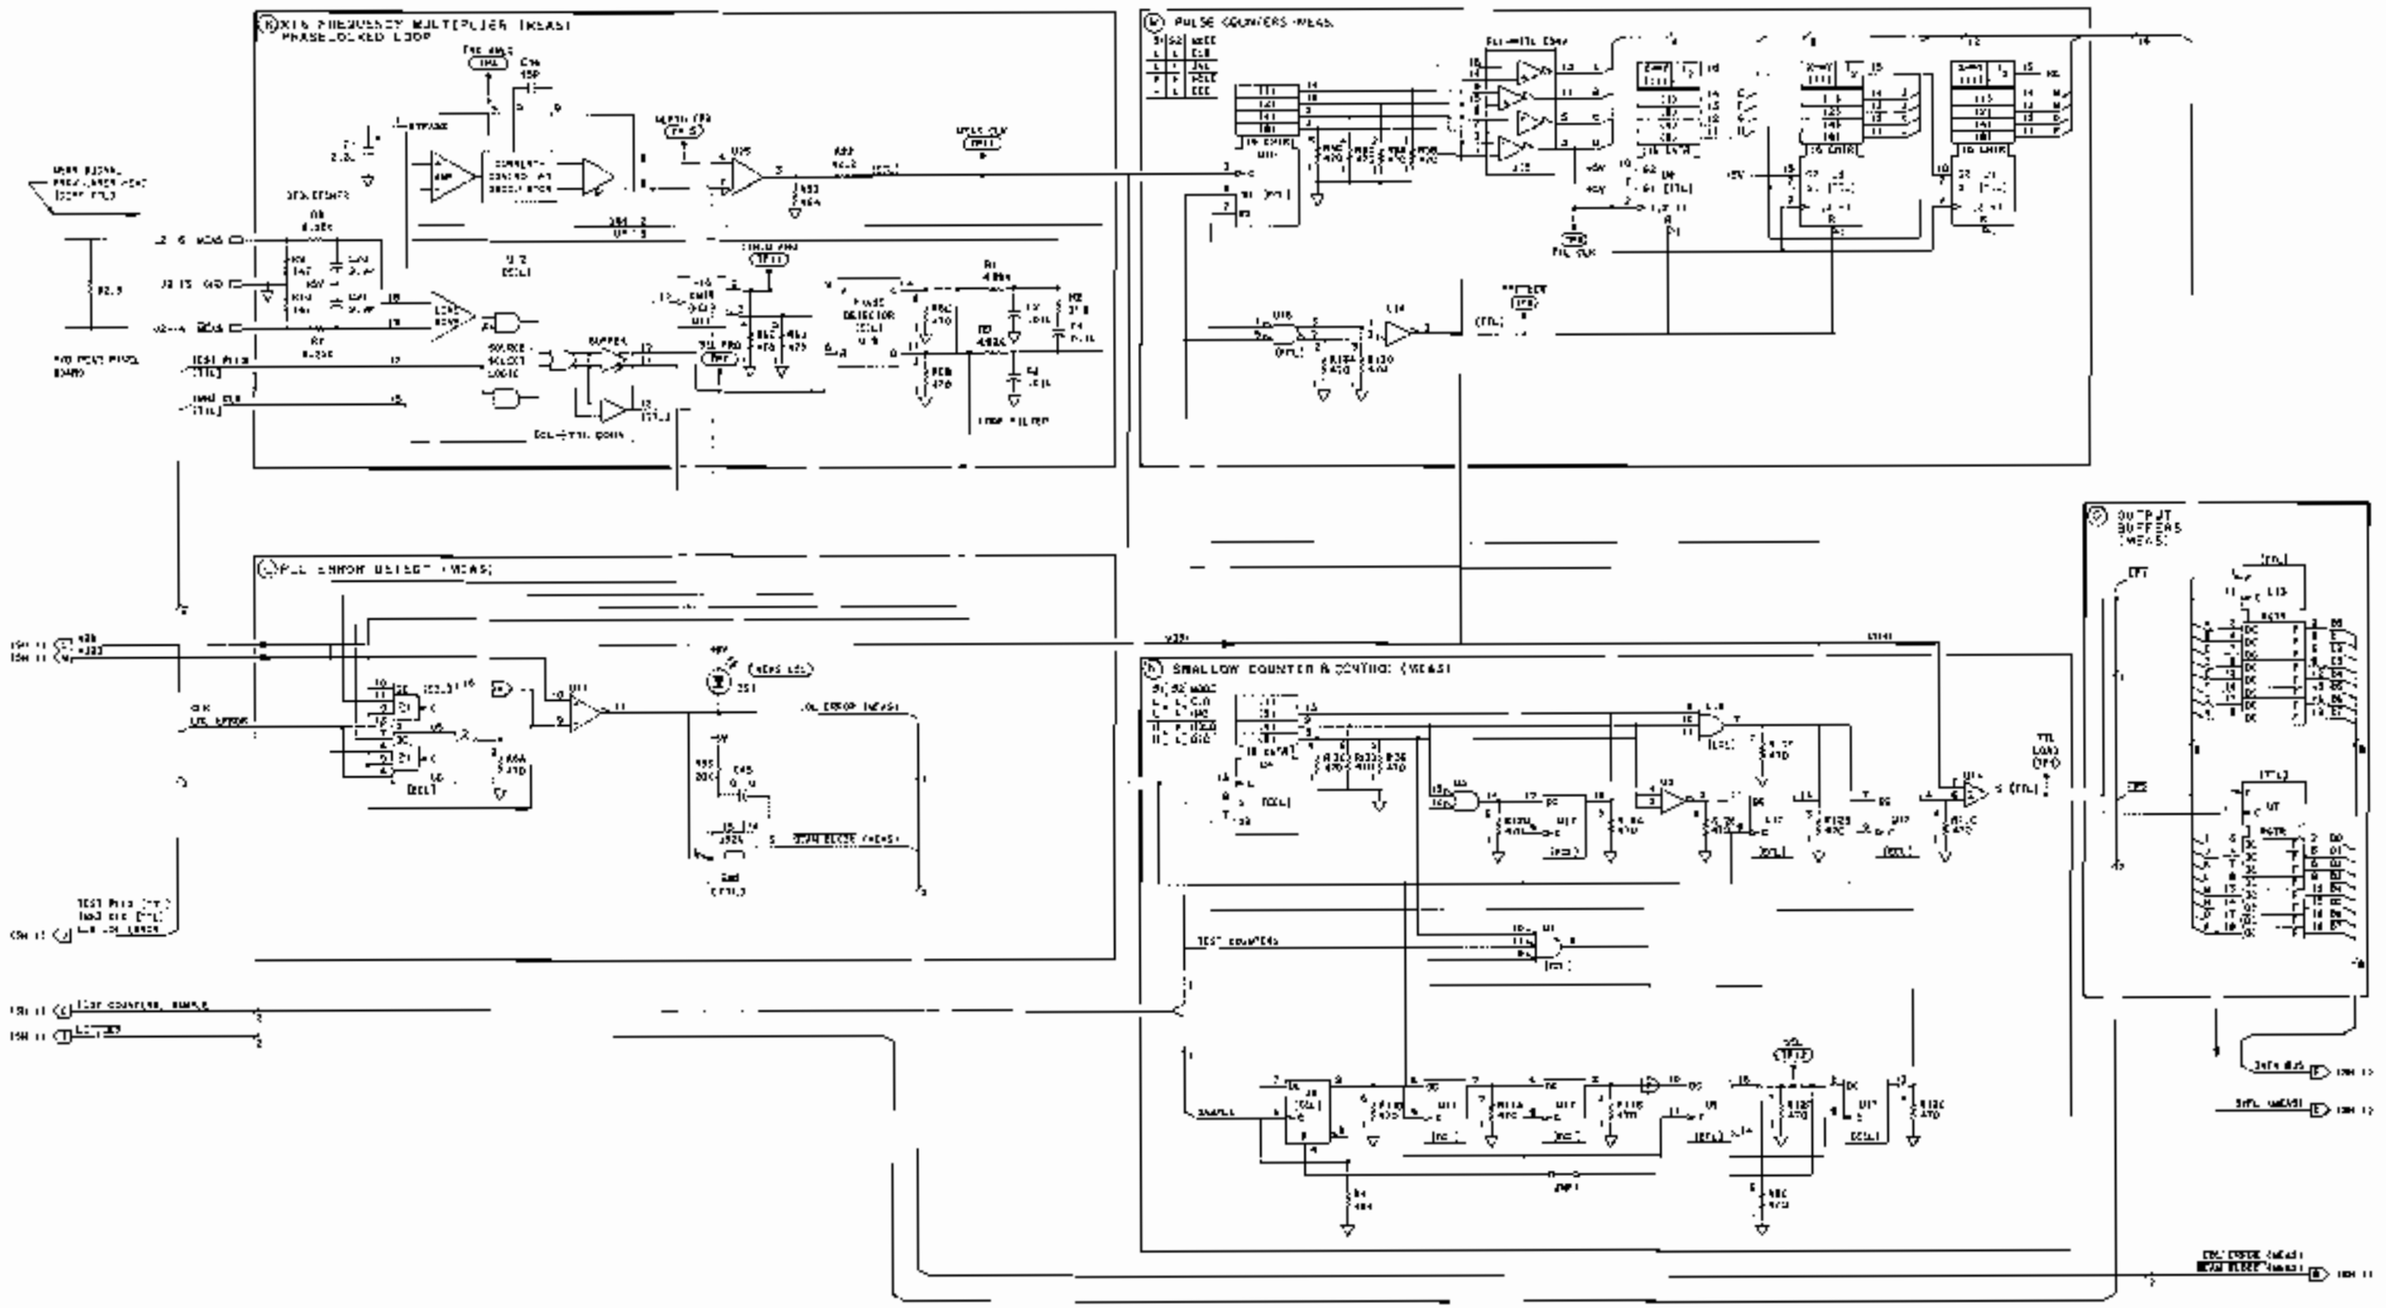


Figure 8-B-21. 5308A A3 Counter Board 05308-60003, Measurement Frequency Channel (Sheet 3 of 5)

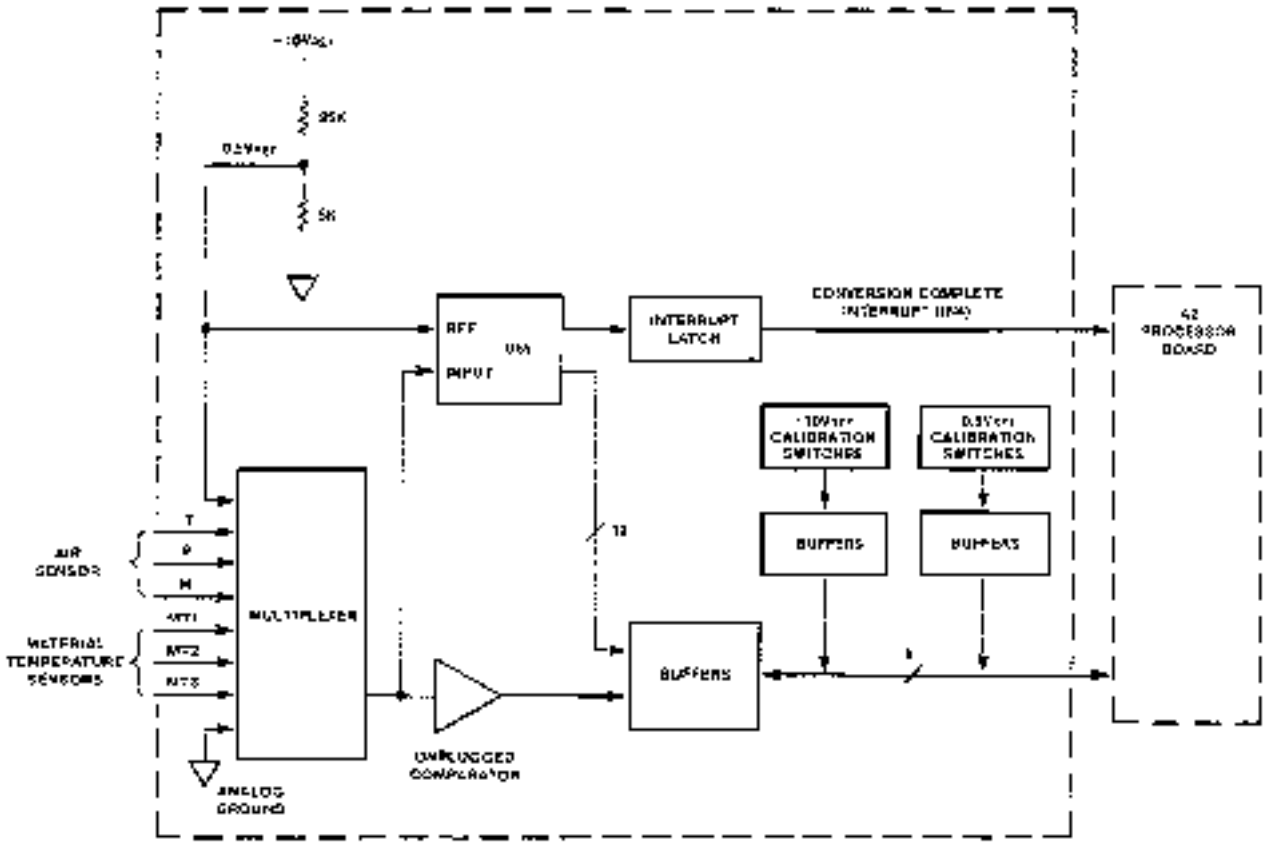


Figure 8-B-27
5508A A3 COUNTER BOARD 05508-60095,
MEASUREMENT FREQUENCY CHANNEL (Sheet 3 of 5)

[See Page 8-B-25]

8-B-228. 5508A A3 ANALOG SUBSYSTEM BLOCK DIAGRAM DESCRIPTION

8-B-229. The Analog Subsystem uses a 12 bit, analog-to-digital converter, A3U65, and an eight-channel multiplexer to convert sensor voltages to digital signals for use by the Processor. Three of the multiplexer channels are for the Air Sensor, three are allotted for up to three Material Temperature Sensors; and the remaining two channels are used for power-up self-test. The Analog Subsystem Block Diagram is shown below.



8-B-230. 5508A A3 ANALOG SUBSYSTEM CIRCUIT THEORY

8-B-231. Paragraphs 8-B-232 through 8-B-266 contain circuit theory for the Analog Subsystem on A3. Paragraphs 8-B-267 through 8-B-326 cover the troubleshooting information

8-B-232 The schematic diagram for the Analog Subsystem is shown in Figure 8-B 21 sheet 4. The schematic has functional blocks that are labeled alphabetically with circled letters. These labels correspond to the circled letters in the text for the circuit theory.

8-B-233. Analog-To-Digital Converter Ⓥ

8-B-234. A to D converter U65 is a CMOS integrated circuit with an input range of ±1 V. Power supply requirements for U65 are plus and minus 5 Volts where the plus 5 Volts is filtered from the logic supply by A3R62, A3C46 and A3C79. The minus 5 Volts is derived by U61.

8-B-235. U65 also requires a precision +0.5 Volt reference. This is obtained from voltage divider R50 which is driven by U67, a precision 10 Volt source, see Block U. The 10 V reference (10 Vref) is used by the Material Temperature Sensors and the Air Sensor as an offset for temperature measurement signals.

8-B-236. U65 is a quad slope, or auto-zero, analog-to-digital converter. It has a fixed-length integration period of 100 milliseconds. The converter is ratiometric, i.e., the digital output is proportional to Vin/+0.5 Vref. Following are some representative outputs (note that the most significant bit: [13] indicates polarity):

Table 8-B-4. A to D Converter Example Outputs

Digital Output	Analog Input
1 111 111 111 111	Vin = 2 × Vref
	where Vref is 0.5 Vref
1 000 000 000 000	Vin = Vref
1 000 000 000 000	Vin = +0
0 000 000 000 000	Vin = −0
0 000 000 000 000	Vin = −Vref
0 111 111 111 111	Vin = −2 × Vref

8-B-237. Voltage Reference Ⓤ and Digital Calibration Switches Ⓠ

8-B-238 +10 Vref is digitally calibrated and provides the most accurate voltage reference in the 5528A system. Digital calibration eliminates the error factors that are normally associated with potentiometer adjustments such as thermal coefficient and long term drift.

8-B-239 During calibration, a binary number representing the true value of +10 Vref is set into switch CAL A. The true value can be ±10.24 mV from 10.0000 Volts without exceeding the calibration range of the CAL A switches. The CAL A switches A3S1, are described in Paragraph 8-B-27. Inaccurate calibration of +10 Vref or failure of the CAL A switch circuitry results in an offset error in temperature measurements. Note that pressure measurements do not use +10 Vref and consequently are not affected by inaccuracies of this supply.

8-B-240. The setting of the CAL A switch establishes a correction factor for the temperature measurements and corresponding corrections are made in the 5508A software. The correction factor is computed and stored at 5508A power-up or when the MASTER RESET switch A2S2 is pressed. These are the only times that CAL A is read. The settings of CAL A should not be changed except during calibration or troubleshooting.

8-B-241. +0.5 Vref is derived from −10 Vref by R50. Digital calibration for +0.5 Vref is implemented by five bits of CAL B switch A3S2. See Figure 8-B-21 sheet 4. To obtain the required A to D conversion accuracy, the MPU multiplies the ratiometric output of the A to D by a correction factor determined from the CAL B settings. The use of CAL A for −10 Vref is somewhat different. +10 Vref is used as an offset, therefore the correction factor derived from the settings of CAL A is an additive correction factor. CAL B is read only at 5508A power-up or after a hardware reset. Inaccurate calibration of CAL B or failure of the CAL B switch circuitry will affect all sensor measurement signals because the A to D output will not be corrected to the true value of +0.5 Vref.

8-B-242. Analog Input Circuits (N)

8-B-243. The resistor networks R42 and R49 pulls any unplugged input channel to +2.5 V (normal range is ±1 V) such that an unplugged status can be detected by comparator U57 (Block E6). If a channel is unplugged, the A-to-D Converter skips that channel.

8-B-244. Diodes CR7-CR18 limit the inputs to ±5.0 volts, and series resistor network R56 limits the current through the diodes. The capacitors limit the rise time of input spikes while the protection diodes are turned on by decreasing dV/dt in the range of +5.6> Vin > -5.6. The capacitors also provide low-pass filtering of the inputs at a frequency compatible with the system frequency response and throughput rate. The protect diodes are mainly to protect the analog switches and to prevent the inputs from exceeding the A to D Converter's ±5 volt non-destructive input range.

8-B-245. Channel Multiplexer (M)

8-B-246. The channel select latch U63 latches in an 8-bit word from the MPU, where each bit represents a multiplexer channel. U63 is enabled by the bus address decoder, signal U. The truth table is as follows.

Table 8-B-5. *Channel Multiplexer Truth Table*

D7	D6	D5	D4	D3	D2	D1	D0	Input Channel
0	0	0	0	0	0	0	1	Analog GND = Self Test Input
0	0	0	0	0	0	1	0	Air Pressure
0	0	0	0	0	1	0	0	Air Temperature
0	0	0	0	1	0	0	0	Air Relative Humidity
0	0	0	1	0	0	0	0	Material Temperature 1
0	0	1	0	0	0	0	0	Material Temperature 2
0	1	0	0	0	0	0	0	Material Temperature 3
1	0	0	0	0	0	0	0	+0.5 Vref = Self Test Input

8-B-247. Analog Switches (E)

8-B-248. The channel select latch controls two quad-analog switches U60 and U66 which implement the multiplexing necessary for the 8-analog channels.

8-B-249. Analog Channel Scanning (Test Chip) (Z)

8-B-250. When the 5508A is performing a measurement, the MPU sequentially enables each of the six measurement channels and analog ground repetitively. If a channel has no input connected ($\overline{CPL}$ = 0V), it will be enabled for approximately 125 usecs. The conversion cycle is not initiated when the MPU recognizes $\overline{UPL}$. A channel with an input will be enabled for 100 ms or more depending on the magnitude of the input voltage.

8-B-251. The channel scan sequence can be observed by installing an HP 548A logic clip to test chip U64. For example, with only the Air Probe plugged in, the scan pattern would be CH0 - CH1 - CH0 - CH2 - CH0 - CH3 REPEAT. The processor enables analog ground between each of the measurement channel enables in order to remove residual charge from A3C96 at U65-12. Although all other measurement channels are also being enabled they are enabled for only 125 usec and cannot be observed. Unplugged channel enables within the above sequence can be observed using an HP 545A logic probe. During normal operation pins 10, 11, 14, 15, and 16 should always be high and pins 12 and 13 are low once per A to D conversion cycle.

8-B-252. Unplugged State Comparator Ⓒ

8-B-253. The "unplugged" comparator, U57, signals the microprocessor whenever a selected analog channel has no sensor attached. Detection of unplugged sensors is performed by an extra read of the A to D high order byte immediately after a multiplexer channel is selected, and before the A to D is enabled to convert that channel. If $\overline{UPL}$ = 0 (channel unplugged), the processor skips that channel and goes to the next channel. When the microprocessor reads the high order byte (B9 - POL) of the A to D, the $\overline{HBEN}$ input on the A to D is pulled low. With $\overline{HBEN}$ low, U57 is enabled and $\overline{UPL}$ goes true if the input channel voltage exceeds 1.5 Volts.

8-B-254. The output of U57 is wired-OR with B7 of the A to D output. With $\overline{HBEN}$ low, U65 bit 7 is in a high impedance state and the comparator output will be gated by U50 when signal Q enables the high order byte of the A to D onto the data bus.

8-B-255. Power-Up Self-Test Provisions

8-B-256. Two of the unused channels on the multiplexer connect to +.5 Vref and analog ground. These channels are converted as part of the 5508A power-up self-test. Note that the other six analog inputs are not checked during this test. Successful reads of +0.5 Vref and analog ground imply that the channel address, control latches, and interrupt hardware are operating, and that the bus address decoder and A to D bus drivers are operating.

8-B-257. The self-test will fail if hardware failures have occurred, or if excessive noise exists on +0.5 Vref or analog ground. These conditions cause a "FAIL 4" display. Since the self-test cannot detect incorrect settings on the digital calibration switches, the switch settings are displayed during the power-up sequence to allow comparison with the settings on the calibration sticker. See power-up test sequence in Paragraph 3-28.

8-B-258. System Clock and Bus Address Decoder Ⓧ Ⓨ

8-B-259. Although all six low order bits (D0 through D5) of the data bus are connected to control register U59, only bits D2 and D3 are used. The control register is enabled by address signal Y of the bus address decoder U51 and is clocked by the MPU system clock, $\overline{E}$.

8-B-260. Bit D2 connects to the run/hold input of the A to D (U65-25), via the bit C output of U59. Run/hold is held low by the microprocessor to inhibit a new conversion cycle during an A to D output read operation. This is necessary because each new A to D conversion destroys the result of the previous conversion stored in internal output latches.

8-B-261. In Block X, bit D3 becomes line D at the output of U59-10 and enables and disables an interrupt signal to the MPU by controlling the output of AND gate U53C in Block AA. After the A to D updates its output latches, the A to D status line (U65-2) goes low indicating a completed conversion. The status line serves as the clock signal to the interrupt latch U54B in Block AA. With D3 high, the interrupt latch causes a low on $\overline{IN4}$ whenever the status line goes low. In normal operation, the MPU disables this interrupt by pulling D3 low until it is ready to complete the interrupt service by clearing the interrupt latch and reading the A to D output. Examples of control register outputs are as follows:

Table 8-B-6. Control Register Example Outputs

A	(D0)	B	(D1)	C	(D2)	D	(D3)	E	(D4)	F	(D5)	Comments
	1		1		1		x		1		1	Run
	1		1		0		x		1		1	Hold
	1		1		x		1		1		1	Enable $\overline{IN4}$
	1		1		x		0		1		1	Disable $\overline{IN4}$

8-B-262. There are two other considerations concerning the addressing of the A to D Converter. First, because the A to D has a maximum output set-up time that is longer than the read window of the processor, the A to D output enables must be set one processor instruction cycle (minimum) before the processor tries to read the A to D outputs. This is accomplished by two special address signals S and R of the bus address decoder U51, which set FFs U56B or A, respectively (Block X). The FF's inverted outputs are $\overline{LBEN}$ and $\overline{HBEN}$, the A to D mnemonics for Low and High byte enables. The signal Q from U51-10 (Block Y) enables U50 (Block FF) to gate the A to D outputs to the bus. Note that the rising edge of Q clears $\overline{LBEN}$ (U56B) or $\overline{HBEN}$ (U56A) and that they cross-clear such that both cannot be enabled at the same time. Note also that aside from timing considerations, U50 is necessary for bus drive purposes, because U65 doesn't have the fanout necessary to drive the processor bus.

8-B-263. The second consideration is the difference between disabling and clearing the interrupt $\overline{IN4}$. Clearing of the interrupt is accomplished by signal T which connects from U51-13 (Block Y) to U54-10 (Block AA). This destroys previous data and is used only during the interrupt service routine when data is read from the A to D. Disabling the interrupt, via U39-10 but D, permits the processor to temporarily ignore the interrupt while it is still stored in the flip-flop. When the microprocessor re-enables the interrupt, the MPU proceeds to execute the A to D service routine.

8-B-264. The address decoder inputs are A0 and A1 from the address bus and the microprocessor R/$\overline{W}$ signal. $\overline{CBE}$ is the mnemonic for "Converter Block Enable" and provides a block address line, or enable, for all A to D converter operations.

Table 8-B-7. Address Decoder Truth Table

$\overline{CBE}$	R/$\overline{W}$	A1	A0	Action	Address Decoder Signal (Active Low)
0	0	1	1	Enable Control Register, U59	V
0	0	1	0	Write to Channel Address Latch U63	U
0	0	0	1	Clear Interrupt latch U54B	T
0	0	0	0	Enable low A to D byte via U56B	S
0	1	1	1	Enable high A to D byte via U56A	R
0	1	1	0	Clock A to D output byte into U60	Q
0	1	0	1	Read ÷10 Vref Calibration number via U58	P
0	1	0	0	Read ÷0.5 Volt reference calibration number via U62	O
1	x	x	x	Do nothing	

NOTE

The R/$\overline{W}$ signal is not used according to convention by the A to D Converter. It serves as one of four inputs to the bus address decoder and is decoded for operations which do not involve the data bus.

8-B-265. Clock Divider (66)

8-B-266. The Clock Divider, consisting of U55, U53A, and U54A, divides the 1 MHz input clock by 49. The resultant 20.408 kHz clock signal drives the A to D oscillator input U65-22 to determine the 100 millisecond integration period i.e. U65 allows 2048 clock transitions per integration period.

8-B-267. 5508A A3 ANALOG SUBSYSTEM TROUBLESHOOTING

8-B-268. General Measurements

8-B-269. All voltage measurements on the analog input channels including the reference voltages require high accuracy (typically within 100 μV). An HP 3456A Digital Voltmeter or equivalent is recommended for both voltage and resistance checks.

NOTE

When making measurements near the A to D Converter, U65, avoid touching the PC board and adjacent components. Board contamination can affect A to D accuracy.

8-B-270. Latch-Up Warning

8-B-271. When an analog subsystem failure is suspected, first verify that A to D converter U65 is not in SCR latch-up. If U65 is hot enough to burn your fingers, turn off the power immediately, unplug all sensors, and wait for U65 to cool. After cooling, turn on the power and check +5V, -5V, and analog ground with respect to the rear panel. The limits on +5V = ±250 mV, and the limits on AG = ±300 μV. If either of these supplies are pulled to ground (current limited) or if U65 heats up again, replace U65.

8-B-272. SCR latch up can occur if +5 V, -5 V, or -15 V is momentarily shorted to ground or to one another. Also momentary connection of any A to D digital pin to a voltage greater than ±5 V will result in an SCR latch up. Take care to avoid this condition. If a probe slip occurs, verify the +5 V and -5 V supplies. If either of these supplies is pulled to ground (current limited), then U65 is in SCR latchup. Latchup may also be indicated by abnormal states on the test chip (see paragraph 8-B-249, Analog Channel Scanning).

8-B-273. Preliminary Checks

a. Inspect A3 for broken traces, foreign material, damaged components, etc.

b. Check that the two edge connectors are seated properly.

c. Verify Analog Subsystem Troubleshooting Specifications in paragraph 8-B-274.

8-B-274. Analog Subsystem Troubleshooting Specifications

a. Measure the following voltages and resistances between the indicated test points and the 5508A rear panel.

TP39, Analog ground = 0V ±300 μV dc. Maximum noise = 200 μV

TP39, Analog ground: Resistance between TP39, AG, and Rear Panel = 300 mohm (max)

U65 pin 36, +0.5 Vref = −0.5 ±10 mV

TP40, −10 Vref = +10 V ±10 mV

U65 pin 40, 5 V = 5 V ±250 mV

U65 pin 28, −5 V = −5 V ±250 mV

+15 V = +300 mV

-15 V = ±300 mV

TP 30 = 20.408 kHz TTL level clock

b. Check that the value of CAL A displayed at power-up agrees with the CAL A setting on A3S1. See Table 4-1, for binary/decimal equivalents.

c. Check that the value of CAL B displayed at power-up agrees with CAL B setting on A3S2. See Table 4-2 for binary/decimal equivalents.

8-B-275. Sensor Data Errors

8-B-276. A to D conversion errors or faulty sensors will cause error messages to be displayed on the 5508A (see Paragraph 8-A-5. 5508A Error Messages). Probe data can be observed directly either in english or metric units by procedures given in the front panel key descriptions in Section III. Front panel symptoms and the isolation procedures and information in Section 8-A should be sufficient to identify causes of gross failures. The accuracy of the A/D Converter can be verified using Paragraph 8-B-313. the A to D Converter Accuracy Test. The accuracy of the Air and Material sensors however, can only be verified as outlined in the Calibration Procedures in Section IV.

8-B-277. 10751A/B and 10757A/B/C Signal Characteristics

8-B-278. Temperature Measurements

8-B-279. The 10751A/B and the 10757A/B/C generate dc signal voltages that decrease linearly with increasing temperature. The voltages are bipolar and centered (0 volts) at approximately 25°C (77°F). The 5508A displays an error message if the temperature signal exceeds the ±1V range of the Analog-to-Digital converter. The temperature measurements require +15V and -15V supplies and +10 Vref from the 5508A. Note that the temperature sensors are calibrated for 0°C to 40°C operation which does not require the full ±1 Volt range of the A to D.

8-B-280. Pressure Measurement

8-B-281. The 10751A/B generates a dc signal voltage that decreases linearly with increasing air pressure. If the air pressure signals exceed ±1 Volt, the 5508A displays an error message. The 10751A/B pressure measurements require +15 V and -15 V, +10 Vref is not used.

8-B-282. Humidity Switch

8-B-283. The humidity switch sends one of three voltages to the 5508A:

Humidity Switch Setting	Voltage
75%	0.7 V (approx)
50%	0.0 V
25%	-0.7 V (approx)

8-B-284. Unused 10757A/B/C and 10751A/B Connectors


8-B-285. Connectors are provided on the rear panel of the 5508A for interconnection with the Air Sensor and three Material Temperature Sensors. When the connectors are not used, the corresponding A to D input channels pull up to approximately 2.5 Volts. Input channel voltages greater than 1.6 Volts are interpreted by the 5508A as unused. The Air Sensor uses three input channels and each Material Temperature Sensor uses one. If any of the three Air Sensor input channels is intrepreted as unused, the 5508A ignores the Air Sensor

8-B-286. Voltmeter Mode

8-B-287. The Voltmeter mode displays Analog Subsystem measurements on the front panel and is very useful for troubleshooting the analog circuitry. During this mode, the voltage of the selected input channel is displayed to six decimal places. If the input exceeds the ±1 Volt range of the A to D Converter, the number "1" appears in the left most digit of the display. When this occurs, the six digit number is invalid. Always check the leftmost digit when using the Voltmeter mode.

8-B-288. Setup the Voltmeter mode as follows:

a. Set TEST SWITCH A2S3 as shown below:

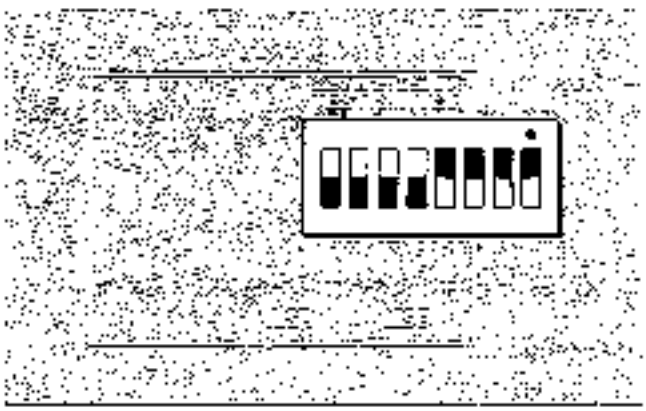

b. Turn POWER switch to ON (the 5508A only reads the TEST SWITCH on power up or after MASTER RESET switch A2S2 is pressed).

c. Select the input channel using the "VOLT TEST CHAN" switches (P/O A3S2).

d. Input channel selection can be verified by using a logic probe on TEST CHIP A3U64.

Table 8-B-8. A to D Channel Selection

Volt Test Channel	Enabled Channel
000	Analog Ground
001	Air Temperature
010	Air Pressure
011	Air Humidity
100	Material Temperature 1
101	Material Temperature 2
110	Material Temperature 3
111	−0.5 Vref
Input channel selection can be verified by using a logic probe on TEST CHIP A3U64.	

8-B-289. Troubleshooting Procedure for "FAIL 4" Error Message

8-B-290 Use the following procedures if the 5508A has at least displayed "PASS 1", "PASS 2", and "PASS 3" on power up.

8-B-291. Test 4 of the 5508A power up self test verifies operation of A to D Converter U65, the digital control circuitry associated with the analog subsystem and partially verifies analog ground. Test 4 will not detect errors in the digital calibration nor an out of tolerance condition of ±0.5 Vref.

8-B 292. First, the A to D Converter converts +0.5 Vref and the processor verifies that the A to D output is within 3 bits of full scale. Next, the analog ground channel is enabled and the processor verifies that the A to D output is within 3 bits of zero.

8-B-293. Procedure

a. Remove all instrument connections from the 5508A rear panel and restart the self test by pressing A2S2, MASTER RESET. If the Analog Subsystem Troubleshooting Specifications check out OK continue with the procedure. Otherwise, refer to the appropriate troubleshooting procedure for the measurements that are out of specification limits.

b. With the 5508A flashing FAIL 4, use a logic probe or logic signal TEST CHIP U54 to identify which A to D input channel is enabled. During the A to D portion of the self test, the A to D first converts +0.5 Vref, then converts Analog ground. The conversion which caused the self test failure can be identified by noting which channel remains enabled when FAIL 4 is displayed.

1. If U64 pin 8 is high, the failure occurred during the +0.5 Vref conversion.

2. If U64 pin 1 is high, the failure occurred during the Analog ground conversion.

3. Check pins 1 through 8 of U64. If a pin other than 1 or 8 is high or more than one pin is high or none is high, then the failure is due to the digital circuitry of the Analog Subsystem. In this case, see Paragraph 8-B-296 Analog Subsystem Digital Circuitry Troubleshooting.

c. −0.5 Vref Conversion Troubleshooting

1. Verify again that FAIL 4 is flashing and U64 pin 8 is high. U64 pin 1-7 are low.

2. Verify U60 pin 16 is high.

3. Verify JMP 5 is in the NORM position

4. Measure Voltage at U65 pin 35. If the channel multiplexer is working properly, the voltage measured should equal −0.5 Vref ±700 µV. If so proceed to step 5. Otherwise, use JMP 5 to isolate between the channel multiplexer, U65 and the unplugged comparator. U65 pin 35 should float with JMP 5 to TEST. Use Paragraph 8-B-308 Multiplexer Troubleshooting to test U60.

5. Use paragraph 8-B-301, Interrupt Latch Troubleshooting. A +0.5 Vref conversion failure on power up can occur if the Analog Subsystem Interrupt signal $\overline{IN4}$ is not working properly.

6. Run the 5508A in Voltmeter mode according to Paragraph 8-B-286. Set VOLT TEST CHAN switches 1:1 to enable the +0.5 Vref input channel. Press A2S2 MASTER RESET and note the displayed voltage. The 5508A should display the value of CAL B switches ±732 µV. Read the CAL B switches and find the expected display value in Table 8-B-11 ±0.5 Vref Calibration Table. If the display does not indicate the value of CAL B ±732 µV, first verify that the CAL B switches are being properly read by the 5508A according to Paragraph 8-B-294 Digital Calibration Switches Troubleshooting.

7. Use Paragraph 8-B-310 A to D Troubleshooting and Paragraph 8-B-313 A to D Converter Accuracy Test to find the problem which is probably a failure within Block FF.

d. Analog Ground Conversion Failure

1. If the Analog Ground Conversion causes FAILS 4 and the −5 Vref conversion passed, the Interrupt latch, power supplies and digital circuitry are probably OK.

2. Verify the Analog Ground Specifications.

3. If OK, first check U66 using Paragraph 8-B-308 Multiplexer Troubleshooting.

4. Next, use Paragraph 8-B-310 A to D Converter Troubleshooting and Paragraph 8-B-313 A to D Converter Accuracy Test to troubleshoot Block FF A/D Converter.

8-B-294. Digital Calibration Switches Troubleshooting

8-B-295. The digital calibration numbers (CAL A and CAL B) are displayed during the power up self test.

a. Verify that the numbers displayed agree with the numbers on the calibration sticker. Choose the next step from 1 through 3 below.

1. If not, check the settings of the CAL A and CAL B switches and use a logic probe to verify the settings electrically.

2. If the settings agree with the sticker but the displayed numbers do not, use the A to D Digital Circuitry Troubleshooting Procedures and check pins 1 and 19 on U58 and U62 to verify operation of the switch buffers.


3. If the signatures and switch settings are correct, the buffers, U58 and U62 or the switches may be defective. The switches and buffers can be completely checked using Paragraph 8-B-299 Calibration Number Buffer Verification located at the end of the Digital Circuitry Troubleshooting Procedures.

8-296. A to D Digital Circuitry Troubleshooting Procedure

8-297. The operation of the A0 digital circuits associated with the Analog Subsystem can be verified using signature analysis. Before testing the signatures, check the 5 Volt test signature to ensure that the desired program is running. Where appropriate, signal paths leading to a node that gives an incorrect signature should be traced back until a correct signature is found. The faulty node should then be apparent and if the bad component is not obvious, current tracing or other techniques will be required. The integrity of traces attached to a bad node should always be verified before any components are replaced. Whenever a correct signature is the last one given along a signal path, verify that all traces leading from that node are also OK.

8-298. Procedure

a. Set processor board A2 switches and jumpers as follows:

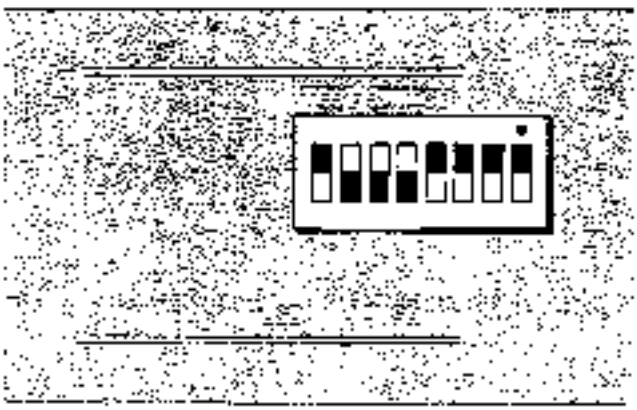

JMP 1: Norm
JMP 2: Installed

b Set all A5 jumpers to NORM.

c. Set 5005A Signature Multimeter controls as follows:

CLOCK: Negative edge
START: Negative edge
STOP: Positive edge

d Connect the 5005A Pod leads to the test points on A2:

GROUND: TP8
CLOCK: TP9
STOP: TP10
START: TP11

e. To measure signatures, toggle the MASTER RESET switch A2S2 and check the following nodes:

1. +5 V Test Signature = H9AC

2. The following is a list of signatures for the entire analog circuitry. Start off by taking the signatures marked with an (*). If they are all O.K., then this portion of the troubleshooting procedure passes. If any are bad, refer to the schematic diagram Figure 8-B-21 sheet 4, check back until the faulty IC is found using the signatures given below

U50 Pin No.	U51 Pin No.	U52 Pin No.	U53 Pin No.
1 U212*	1: 45P4	1: 0000	1: AC03
19: U212	2. U21(	2: H9AC	2: 2111
	3: 8701	3: H9AC	3 0000
	4: U1(1	4 0000*	4: U135
	5: 0000	5: ———	5: U8CA
	6: H9AC	6: ———	6: 0U35
	7: 2045	8. H69P	8: ———-
	9: 0696	9. 0U35	9: 1HH8*
	10: U212	10: U8CA	10. ———
	11: A298	11: 2111	
	12: UUU1	12: ———	
	13: 0532	15: ————	
	14. PC7H		
	15: 4U11		

U54 Pin No.	U55 Pin No.	U56 Pin No.	U58 Pin No.
1: H9AC	1: 0000	1: 4181	1: U69H*
2: 0000	2: AL91	2: 0000	15: 0696
3: 0000	6: AFHA	3: U212	
4: 5772	10: 2111	4: A238	
5: AL91*	11: AU03	6: FP67	
6: ———	12: AU91	8: 4181	
10: 0532*	13: AFHA	10: U0U1	
11: H9AC		11: U212	
12: 0000		12: 0000	
13: H9AC		13: FP67	

U59 Pin No.	U60 Pin No.	U62 Pin No.	U63 Pin No.
1: 4C15H*	1: 83CC*	1: 2045*	1: PC7H*
2: 5772	8: 969A	19: 2045	3: 4APP
5: QU35	9: 81P6		5: 81P6
7: C4H4	16: PP3F		6: 969A
9: 0000			9: 83CC
10: 1HH8			11: 0000
			12: 572L*
			15: HC87
			16: 6316
			19: PP3F

U65 Pin No.	U66 Pin No.
2: ———	1: HC87*
16: 4101*	8: 512U*
19: FP67*	9: 6316*
22: H69P*	15: 4APP*
26: C4H4*	

8-B-299. Calibration Number Buffer Verification

8-B-300. This procedure checks the operation of the calibration number buffers U56 and U62.

NOTE

It is only necessary to perform this verification if you suspect the calibration number buffers are bad. For example, if the "CAL A" or "CAL B" values displayed at power up are different than the values actually entered on the "CAL A" or "CAL B" dip switches, "FAIL 4" is not sufficient reason to suspect faulty calibration number buffers.

NOTE

Write down the CAL A and CAL B switch settings because the following procedures require changing their positions for troubleshooting. If recalibration is not necessary, return the switches to their original values.

a. Perform steps a through e of the Analog Subsystem Digital Circuitry Troubleshooting Procedure.

b. On A2, remove the Signature Analysis "STOP" line from the "STOP" pin. Place the HP5005 in the "QUAL" mode by pressing the "QUAL" key.

c. Set the "QUAL" to trigger on a logic low.

d. Jumper the red 5005 lead [QUAL] to U58 pin 1 or 19. Press MASTER RESET, and measure the following signatures, toggling each dip switch position in "CAL A" to both a "0" and a "1".

+5 V test = 826P

U58 Pin No.	Switch = 0	Switch = 1
3	0090	826P
5	0000	826P
7	0000	826P
9	0090	826P
12	0000	826P
14	0000	826P
16	0000	826P
18	0000	826P

If any of the signatures are incorrect, check the inputs of U58 while toggling each switch position to verify proper switch operation.

e. Remove the red "QUAL" lead from U58 and connect it to U62 pin 1 or 19. Press MASTER RESET and measure the following signatures, toggling each dip switch position in "CAL B" and "VOLT TEST CHAN" to both a "0" and a "1".

+5 V test = 826P

U62 Pin No.	Switch = 0	Switch = 0
3	0000	826P
5	0000	826P
7	0000	826P
9	0000	826P
12	0000	826P
14	0000	826P
16	0000	826P
18	0000	826P

If any of the signatures are incorrect, check the inputs of U62 while toggling each switch position to verify proper switch operation.

8-B-301. Interrupt Latch Troubleshooting

8-B-302. Use the following procedures to verify or troubleshoot the Interrupt Latch, Block AA. Interrupt latch failures will cause TEST 4 of the 5508A self test to fail (FAIL 4).

8-B-303. Procedure

a. Run the 5508A in the Voltmeter Mode according to Paragraph 8-B-286. Enable the Analog ground input channel [VOLT TEST CHAN = 000].

b. Press A2S2, MASTER RESET.

c. Verify A3U53 pin 9 is low. [In Voltmeter Mode, the 5508A sets pin 9 low to disable the Interrupt Latch circuitry].

d. Using a logic probe at TP 37 $\overline{\text{STATUS}}$, verify that the U65 STATUS output is toggling. If U65 pin 2, STATUS, is not toggling with a period of about 400 msec, then go to A to D Converter Troubleshooting, Paragraph 8-B-310.

e. Use a logic probe to verify U54 pin 8 is high.

f. Using an HP 540A Logic Pulser inject single pulses at U54 pin 10. U54 should clear (pin 8 goes low) each time pin 10 is pulsed. Note that pin 8 should be returned high quickly (reset) by the steadily toggling $\overline{\text{STATUS}}$ signal.

g. Verify that U53 pin 9 is still low following step f.

h. Move logic probe to U52 pin 6 and verify that it is still high (with U53 pin 9 set low by the processor $\overline{\text{IN4}}$ should not go true).

i. Move logic pulser to U53 pin 9 and apply a single pulse. $\overline{\text{IN4}}$ should drop low and stay low (indicating that the interrupt signal (U54 pin 8 high) was successfully passed by U53C and that the interrupt was received by the processor. The processor responds (in Voltmeter Mode) by pulling U53 pin 9 high without clearing U54B). If $\overline{\text{IN4}}$ pulses low and returns high then the processor is not receiving the interrupt signal. Check the Priority Interrupt circuitry on the A2 Processor Board.

8-B-304. Unplugged Comparator Troubleshooting

8-B-305. Should plugged-in probes read unplugged or unplugged probes read plugged-in, use the procedures in the front panel key descriptions in Section II to check for proper operation and correct sequences.

8-B-306. Preliminary Checks

a. Check for the proper power supply voltages:

1. −15 V: U60 and U66 pin 12
2. +15 V: U60 and U66 pin 5
3. Gnd: U60 and U66 pin 4

b. Check that DMP 5 is in the NORM position.

8-B-307. Procedure

a. Turn 5508A power off.

b. Lift anode lead of CR5 from PC board and ground it.

c. Configure the 5508A for Voltmeter Mode according to Paragraph 8-B-286. Install a variable DC source on the suspected input channel and set the source for 0 volts. Turn 5508A power on.

d. Measure voltage at U57 pin 2. It should be 2.1 V ±0.1 V.

e. Measure voltage at U57 pin 3. It should be the same as the input voltage ± 100 uV.

f. Adjust the input voltage from 0 V to 1.6 V while monitoring U57 output at pin 7. U57 output should drop to a TTL logic "0" (0.6 V max) at 1.5 V ±0.1 V.

8-B-308. Multiplexer Troubleshooting

8-B-309. If the Multiplexers are not working properly, the input voltages will not pass correctly to the input of the A to D Converter. Verify the Multiplexers operation using the following procedure.

a. Turn 5500A off.

b. Configure the 5500A for Voltmeter mode according to Paragraph 8-B-286.

c. Select the suspect input channel using the VOLT TEST CHAN switches and verify that the corresponding input voltage is passed to the A to D Converter input pin. The voltage at the input pin should be the input channel voltage ± 300 uV. If not, verify that the appropriate Multiplexer (U60 or U66) is properly enabled before replacing it.

8-B-310. A to D Converter Troubleshooting

8-B-311. Use the Voltmeter Mode, Paragraph 8-B-286, to troubleshoot the A to D Converter Block FF. Table 8-B-9 lists possible symptoms for hardware failures in the Voltmeter Mode. The table can also be used "backwards". For example, entry No. 1 of the table indicates that with the Integrator capacitor C48 shorted, the A to D Converter should read all input voltages as zero volts. Thus, the capacitor can be shorted with a test lead and if the display indicates 0 Volts for all input voltages then the remaining components of Block FF are probably functioning properly.

Table 8-B-9. A to D Converter Troubleshooting

Failure	Symptom
Integrator Capacitor C48 shorted or open	A to D Converter reads all input voltages as zero volts.
Auto Zero capacitor C61 shorted or leaky	Readings are offset approximately the same amount and direction for both positive and negative input voltages.
Auto Zero capacitor C61 open	A to D Converter reads all input voltages as over ranged
Integrator capacitor C48 leaky	A to D Converter reads all input voltages, both positive and negative at a lower magnitude

8-B-312. Check the internal timing signals of U65 as follows:

a. Run the 5500A in Voltmeter Mode with the VOLT TEST CHAN switches set to enable Analog ground (000).

b. Check the following:

1. Verify that the STATUS output pin is toggling with a period of approximately 400 msec.

2. Verify U52F by checking for $\overline{\text{STATUS}}$ at TP 37.

3. If the STATUS signal is not correct, verify that the 20.408 kHz clock input at U65 pin 22 is present. Also verify that U65 pin 26 is high and not being pulsed low.

4. If all three pins check out ok but the STATUS output is not a periodic square wave, then replace U65.

c. Check the internal timing of U65 as follows:

1. Press A2S2 MASTER RESET with the 5508A still set to VOLTMETER MODE
2. Configure the HP 5005A Signature Multimeter to totalize mode and connect as follows:

   START lead to A3TP37 $\overline{\text{STATUS}}$, set START polarity to positive

   STOP lead to A3TP37 $\overline{\text{STATUS}}$, set STOP polarity to negative.

   Data Probe to A3TP36, 20.408 kHz clock.

3. With data probe to A3TP36, totalize measurement should be 2046 counts.


8-B-313. A to D Converter Accuracy Test

8-B-314. This test checks the operation of the analog input circuits, multiplexers and the A to D converter. A known voltage (preferably ground but no greater than ±1 volt DC) is used to exercise the measurement inputs. (Consult Paragraph 8-A-286 Voltmeter Mode for references). If the test does not operate as described, first use the A to D Digital Circuitry Troubleshooting Procedure, Paragraph 8-A-296 to verify operation of the digital control circuits.

8-315. Procedure

a. Disconnect all sensors from the 5508A.

b. Set TEST SWITCH, A2S6 as shown below and toggle MASTER RESET A2S2.

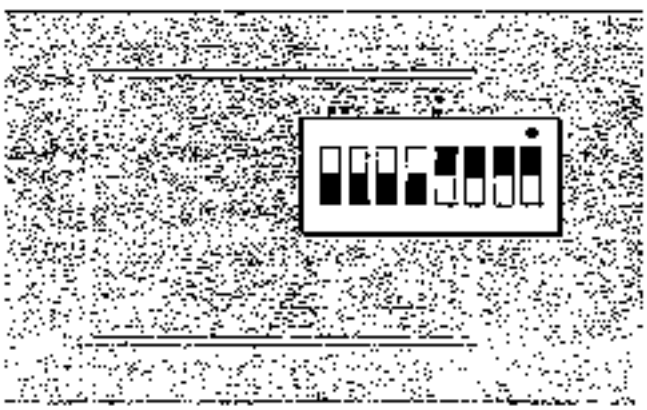

c. Set the "Volt Test Chan" switch (P/O A3S1) on A3 to select the desired analog channel using Table 8-B-8 A to D Channel Selection. Proper input channel selection should be verified using a logic probe on the TEST CHIP A3U64.

d. Apply known voltage (–1 to +1 Vdc) to the appropriate pin on the input side of resistor network A3R56. Use a variable DC source and monitor its output with an HP 3456A DVM for comparison to the 5508A display.

e. Read voltage from 5508A display and check against known value.*

f. If no gross failures exists but the A to D specifications as listed in Table 8-B-10 are not satisfied, the 5508A should be recalibrated according to Section IV. If the accuracy tests fail following recalibration, first verify the calibration switches (CAL A AND CAL B) according to Paragraph 8-B-294 Digital Calibration Switches Troubleshooting.

*If there is no input voltage on a selected channel or the input voltage exceeds 1 volt the 5508A display indicates over range with a "1" in the leftmost digit and an invalid six digit voltage.

8-B-316. Before troubleshooting the A to D Converter, Block FF, verify that the input channel and multiplexer are working properly. Verify that the Analog Subsystem Troubleshooting Specification, Paragraph 8-B-274 are satisfied.

Table 8-B-10. A to D Converter Accuracy Test Specifications

Selected Channel	5500A Display Value
Analog Ground	0 ± 244 µV
+0.5 VRef	*B ± 488 µV
-1 to +1 Volt Input Voltages (V)	= 732 µV

*Value of B taken from Table 8-B-11 +0.5 Vref Calibration Table


If the +0.5 Vref channel fails this test, the 5500A may be reading the CAL B switch improperly. See Paragraph 8-B-299, Calibration Number Buffer Verification.

Table 8-B-11. +0.5 Vref Calibration Table

CAL B	B	CAL B	B
0	0.498720	16	0.500000
1	0.498800	17	0.500080
2	0.498880	18	0.500160
3	0.498960	19	0.500240
4	0.499040	20	0.500320
5	0.499120	21	0.500400
6	0.499200	22	0.500480
7	0.499280	23	0.500560
8	0.499360	24	0.500640
9	0.499440	25	0.500720
10	0.499520	26	0.500800
11	0.499600	27	0.500880
12	0.499680	28	0.500960
13	0.499760	29	0.501040
14	0.499840	30	0.501120
15	0.499920	31	0.501200

8-B-317. Analog Ground Troubleshooting

8-B-318. Due to IR drops, not all grounds in the instrument are at the same potential. For example, because of the heavy current flow in the ground bus, the digital ground of A3 is typically 22 mV above rear panel ground. Since the analog subsystem must make highly accurate measurements of the sensor outputs, and because the sensors voltages are referenced to rear panel ground, a separate low current trace called "Analog Ground" is used. This line connects from the rear panel to the analog subsystem as shown below. Under normal conditions, little or no current flows through analog ground, consequently zero volts exists at both the analog subsystem and the sensors.

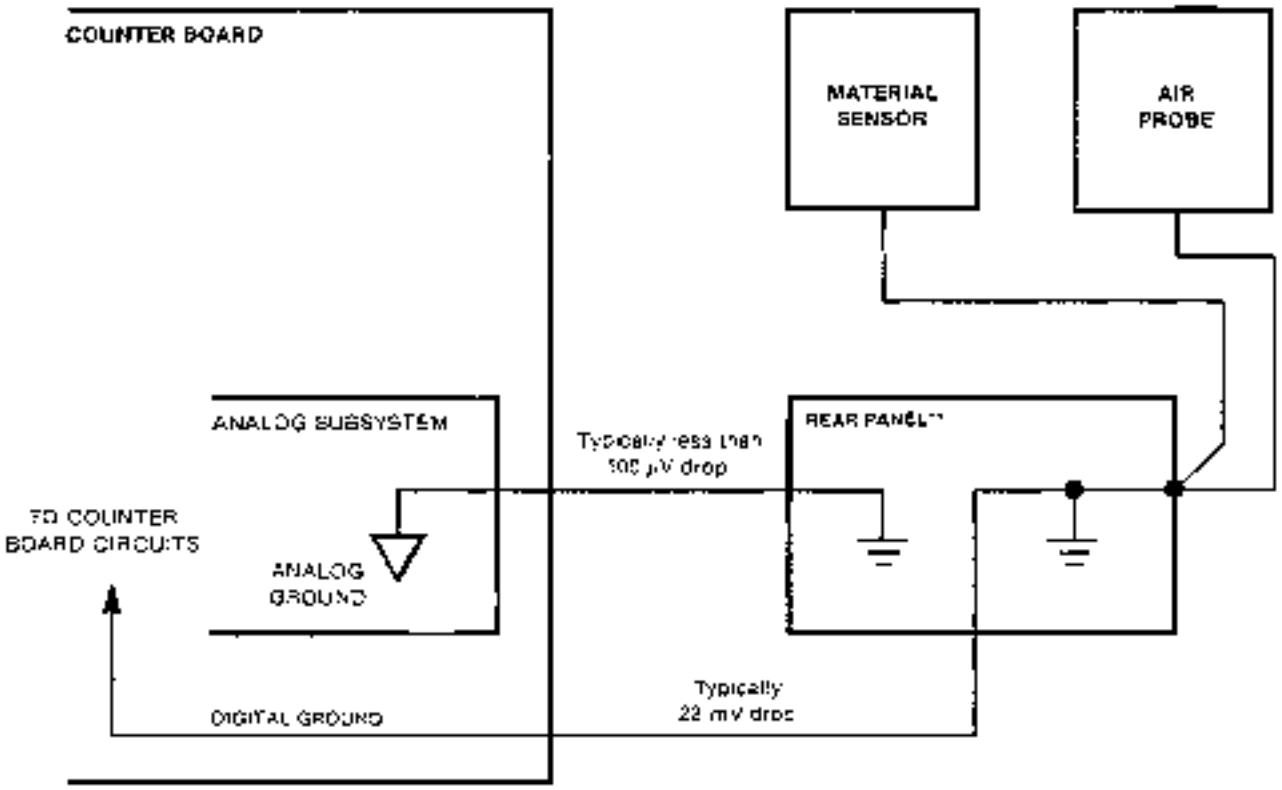

**For proper connections, all 12 Pozi Drive screws adjacent to the rear panel connectors must be installed and tightened. Ground connections are made through several of these points for different circuits including the head, power supply, and analog ground.

8-B-319. When making measurements, take care to keep the grounds separate. For example, if analog ground is shorted to digital ground, parallel paths will exist resulting in current sharing. Should this occur, the circuits referenced to analog ground will no longer be referenced to 0 Volts.

8-B-320. If a device injects excessive current into analog ground, a voltage drop will occur along the trace where the current flows. To detect IR drops, first measure at J2 and work inwards. If the voltage is higher after each measurement, excessive current is being injected on A3.

8-B-321. The point where current is injected into the trace will always be the highest voltage measured. Attempting to use a current probe and stimulate the trace with a square wave generator or pulser is not recommended as this may damage U65 or U67.

8-B-322. ÷10 Vref Troubleshooting

8-B-323. ÷10 Vref serves two important functions:

a. supplies an offset to the temperature signals from the Air Sensor and Material Temperature Sensors.

b. supplies the source for ÷0.5 Vref, the A to D Voltage Reference for U65.

8-B-324. If −10 Vref is out of specification as given in Paragraph 6-B-274 Analog Subsystem Troubleshooting Specifications, proceed as follows:

a. With 5508A power off, measure the resistance between TP40 (+10 Vref), and TP9 (Analog Ground). It should be approximately 10 k ohms

b. Check resistor pack A4R1 by measuring resistance between TP40 and the appropriate pins of the rear panel connectors. Readings should be approximately 20 k ohms.

c. Remove test leads and turn 5508A power on. Check +10 Vref and analog ground according to Paragraph 6-B-274 Analog Subsystem Troubleshooting Specifications.

d. If +10 Vref is out of spec, check the +15 V supply at pin 8 of U67. If the supply is OK, replace U67 and recheck the −10 Vref output specification (10 V ± 0.01 V).

e. Recalibrate +10Vref and −0.5Vref according to Section IV.

8-B-325. +0.5 Vref Troubleshooting

8-B-326. Before troubleshooting the +0.5 Vref supply, first verify that −10 Vref, U67 is in specification limits.


a. Measure +10 Vref at TP40. It should be 10 Volts ±0.01 V. If not go to −10 Vref troubleshooting procedure


b. Verify +10 Vref at pin 1 of R50

c. Lift the wire leading from R50 to U60 at the zerlon terminal at U60.

d. Measure +5 Vref again. If it is still out of spec, replace R50. Otherwise, check for a short or bridge on the circuitry that has been isolated by lifting the wire.


e. Recalibrate +0.5 Vref according to Section IV.

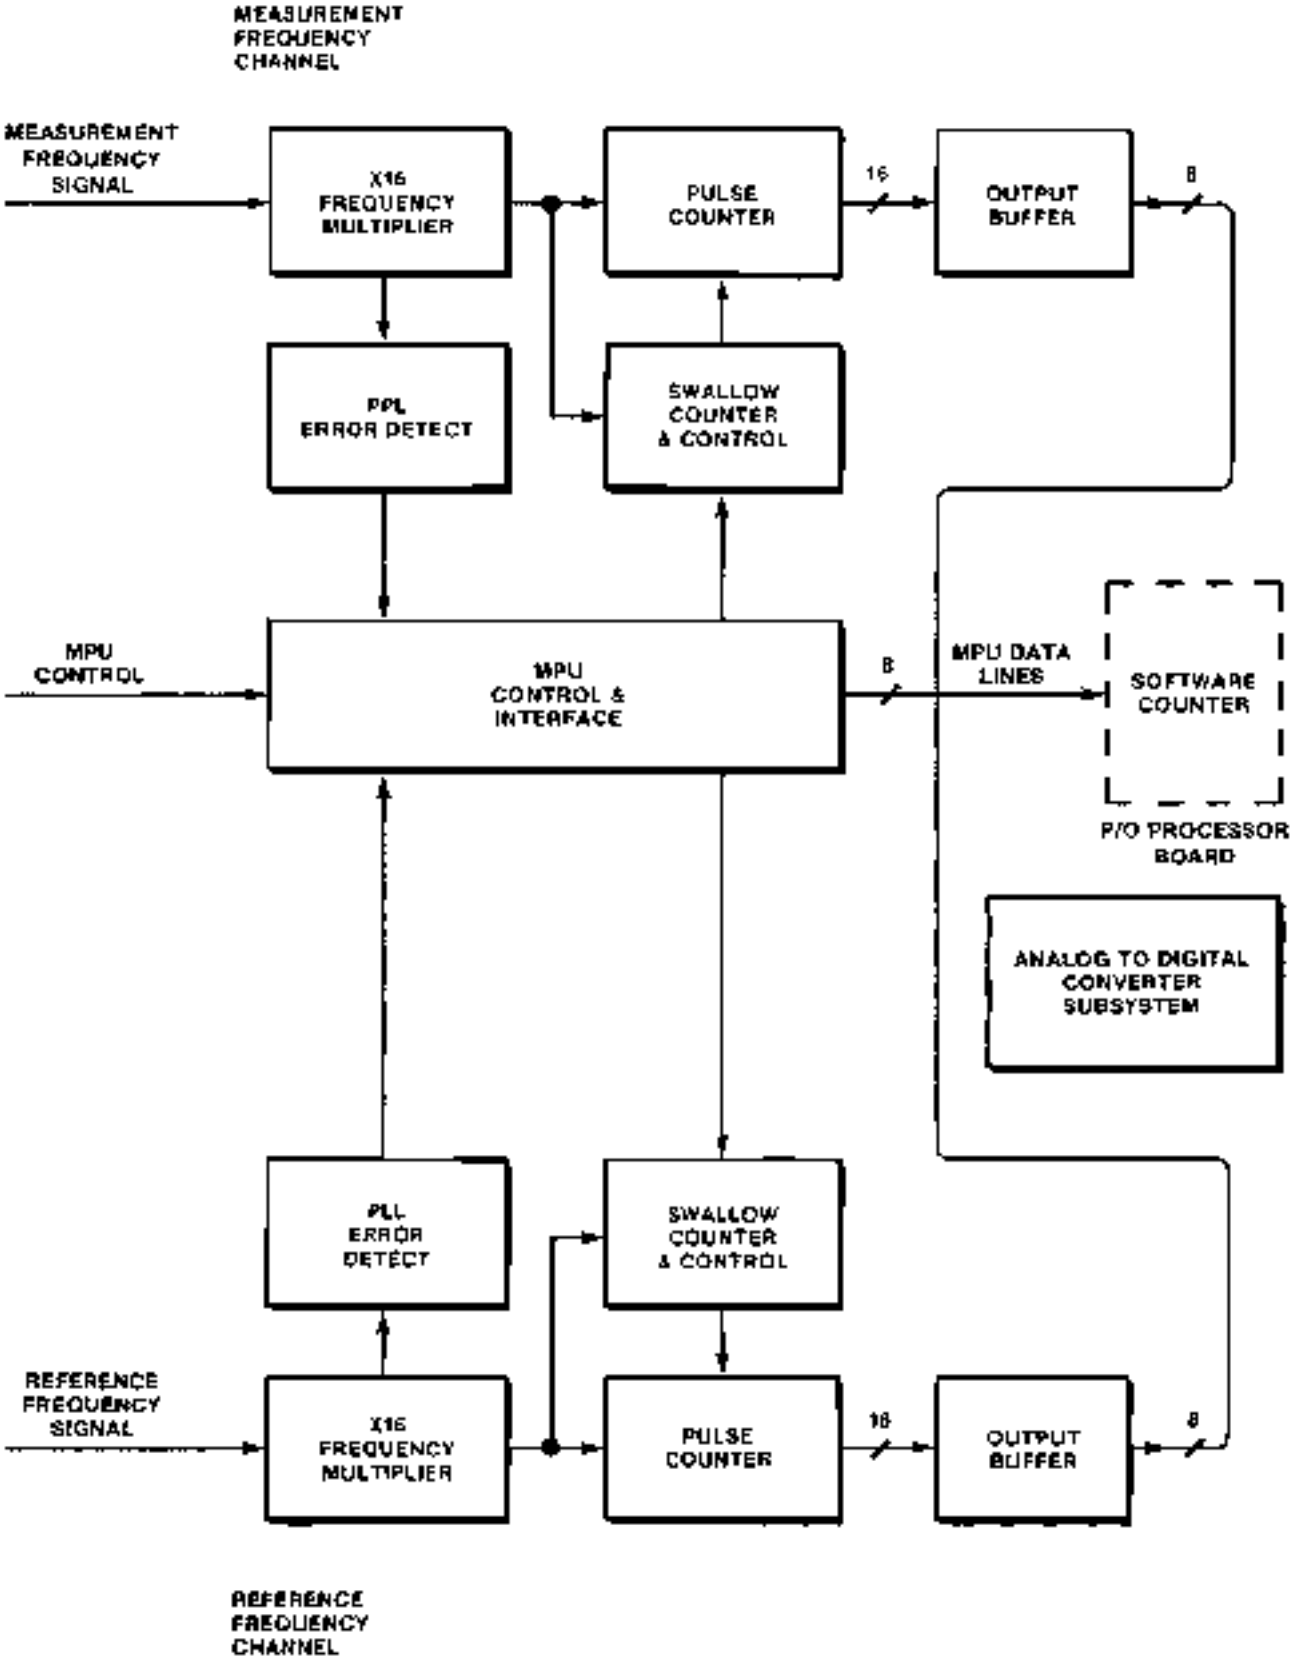

MEASUREMENT FREQUENCY CHANNEL
MEASUREMENT FREQUENCY SIGNAL
X16 FREQUENCY MULTIPLIER
PULSE COUNTER
16
OUTPUT BUFFER
8
PPL ERROR DETECT
SWALLOW COUNTER & CONTROL
MPU CONTROL
MPU CONTROL & INTERFACE
8
MPU DATA LINES
SOFTWARE COUNTER
P/O PROCESSOR BOARD
ANALOG TO DIGITAL CONVERTER SUBSYSTEM
PLL ERROR DETECT
SWALLOW COUNTER & CONTROL
REFERENCE FREQUENCY SIGNAL
X16 FREQUENCY MULTIPLIER
PULSE COUNTER
16
OUTPUT BUFFER
8
REFERENCE FREQUENCY CHANNEL

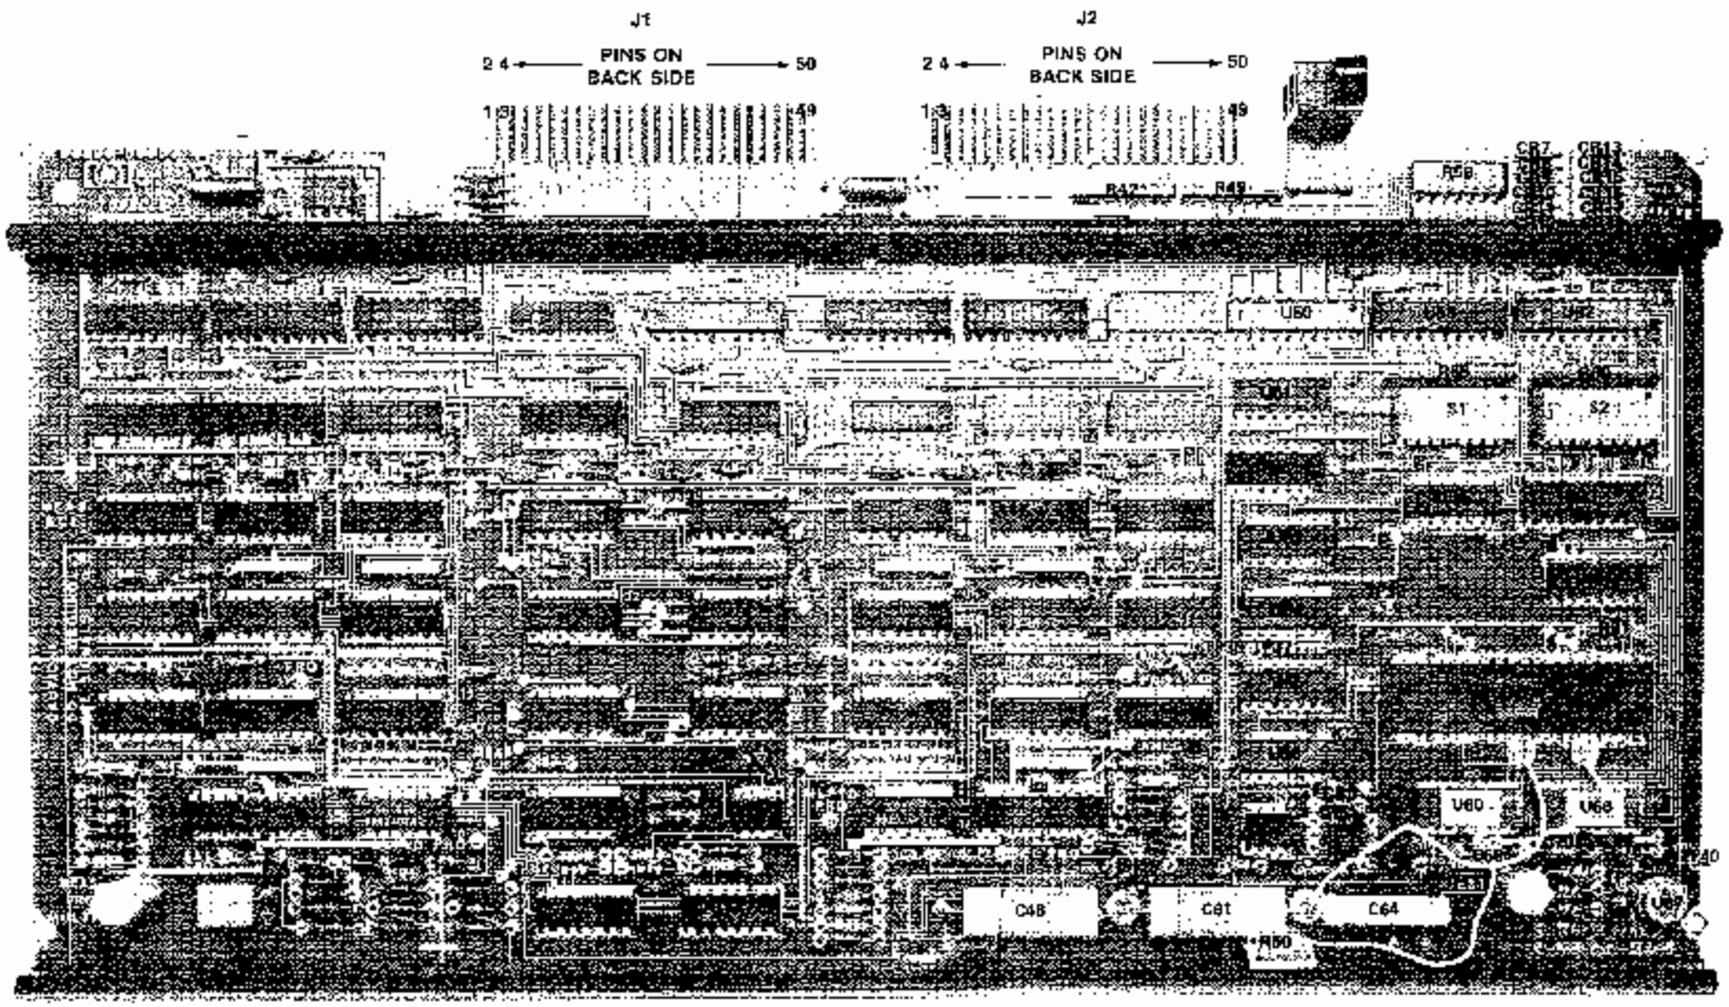



THE COMPLETE COMPONENT LOCATOR
FOR A3 IS SHOWN ON SHEET 5

COUNTER BOARD

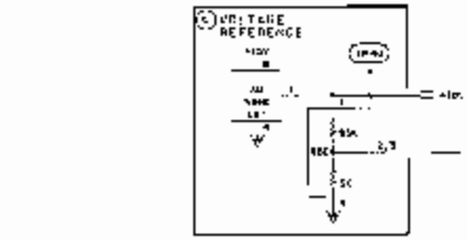


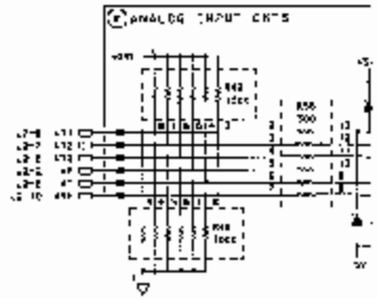

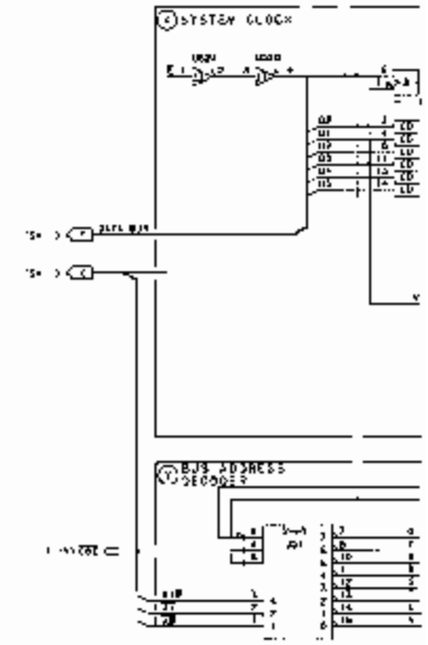

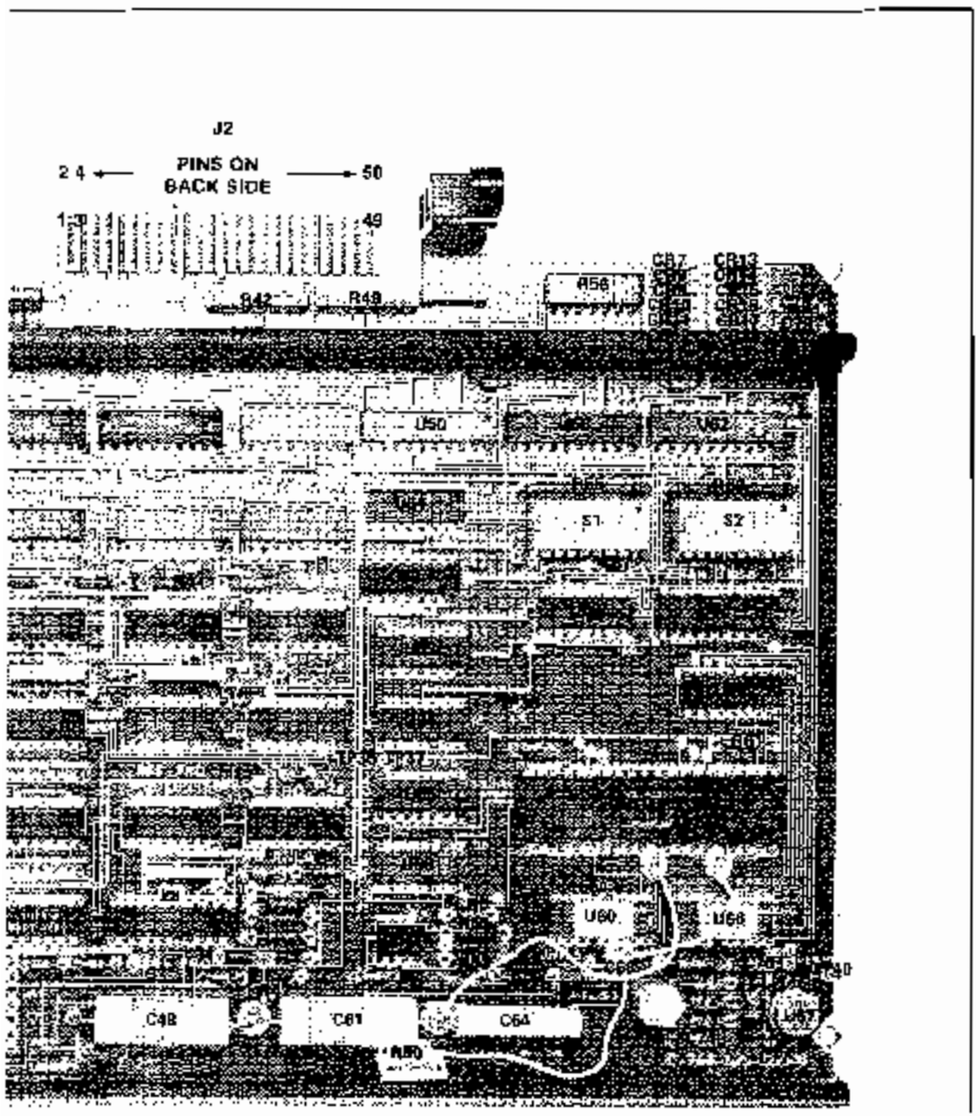

PONENT LOCATOR
N ON SHEET 5

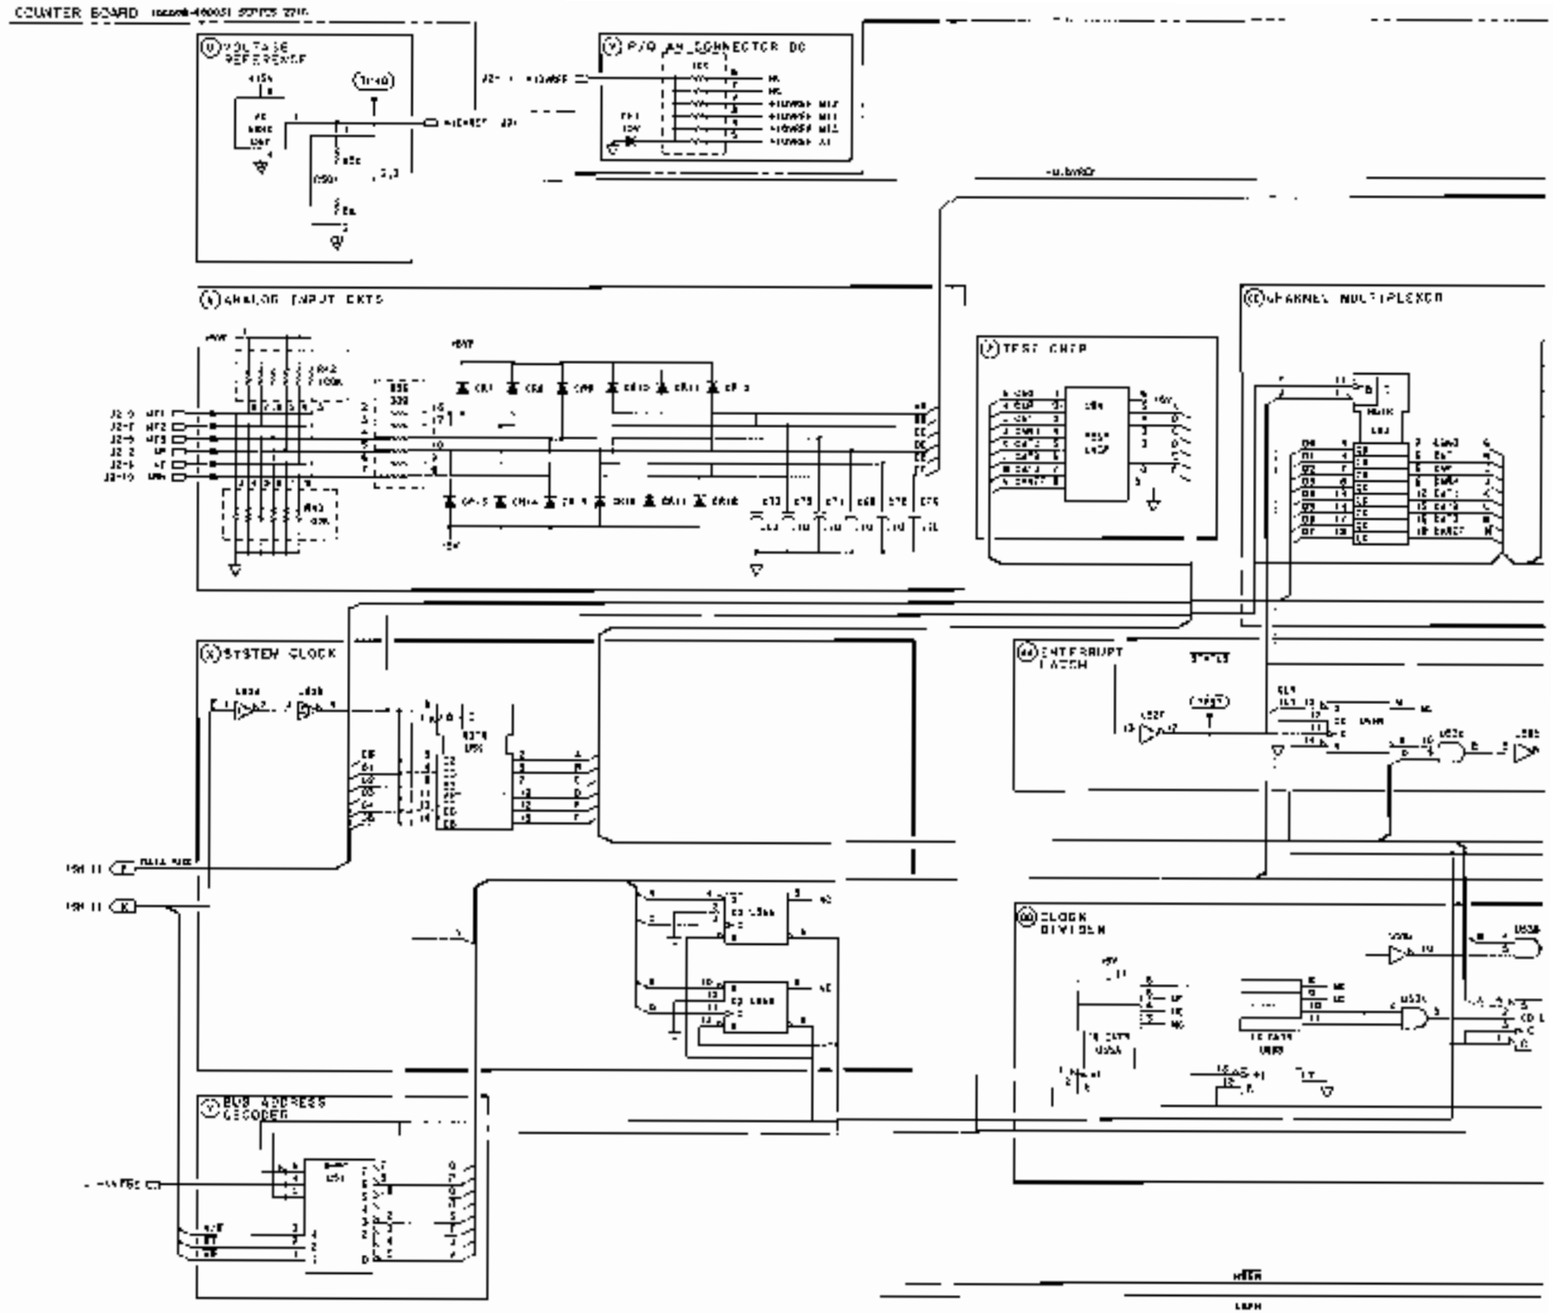

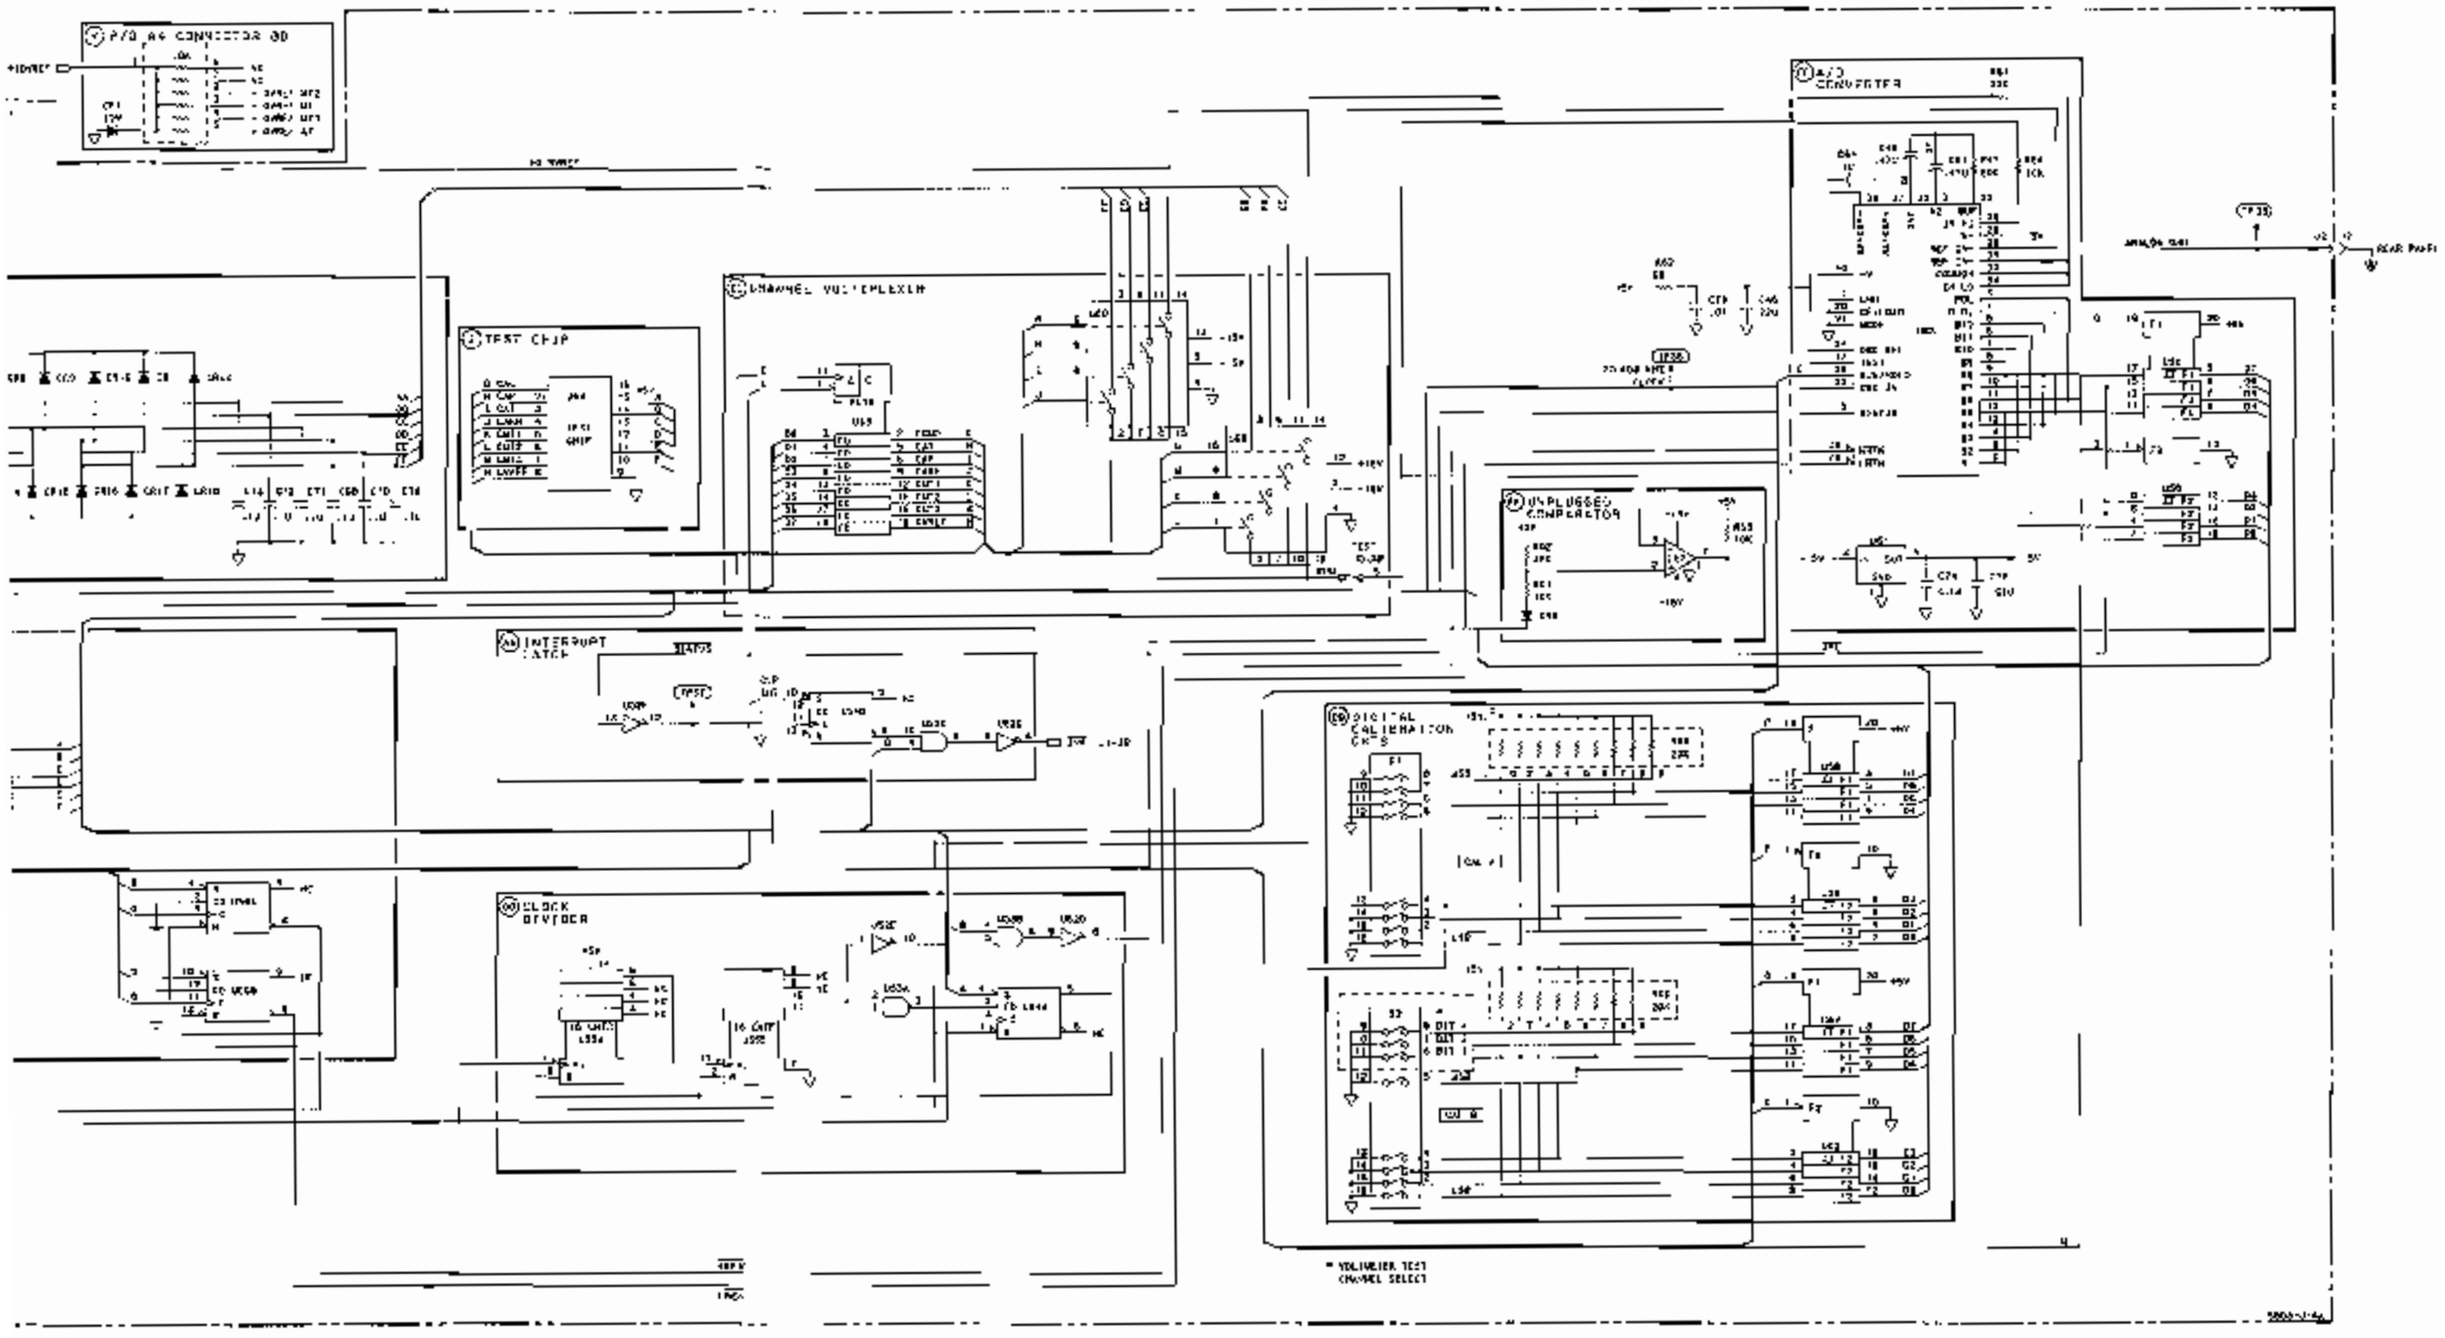


Figure 8-D-21. 5508A A3 Counter Board 05568-60003, Analog Subsystem (Sheet 4 of 5)



Figure 8-B-21
5508A A% COUNTER BOARD 05508-60003, ANALOG SUBSYSTEM (Sheet 4 of 5)

[See Page 8-B-97]

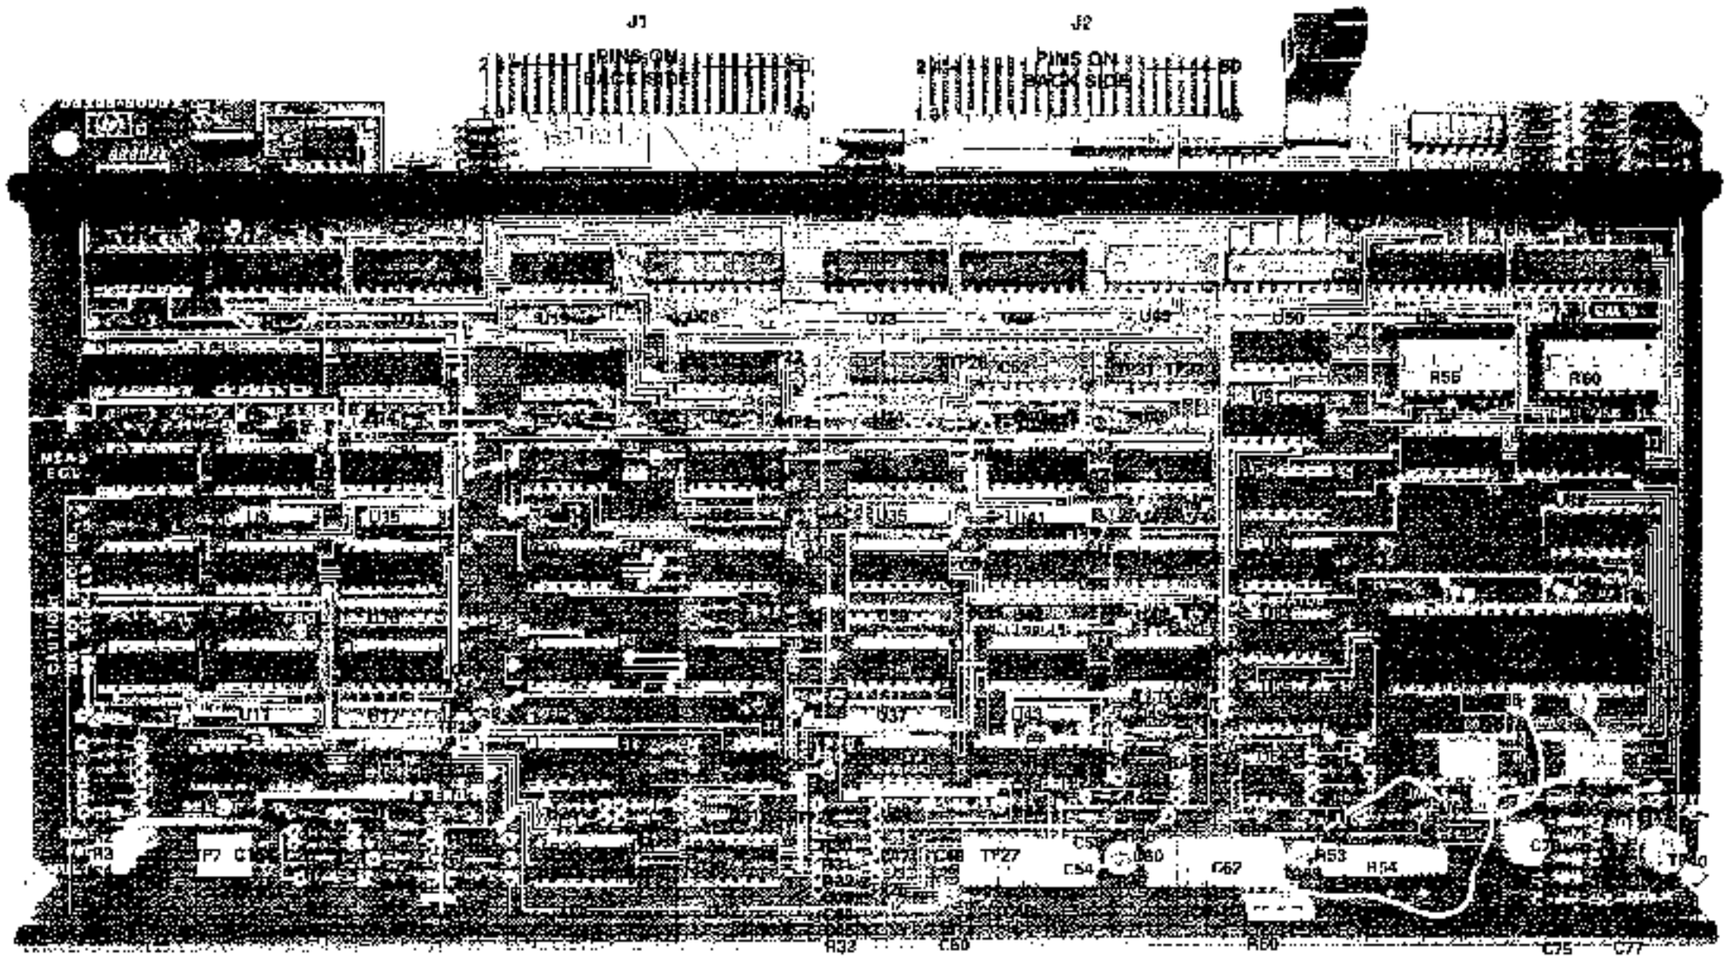


Figure 8-8-21. 5508A A3 Counter Board 05508-60093, Component Locator (Sheet 5 of 5)

8-B-327. 5508A A4 CONNECTOR BOARD CIRCUIT THEORY

8-B-328. The connector board (Figure 8-B-22) provides interfacing of the 5508A to the 5519A Laser Head, the 10751A/B Air Sensors, the Remote Control Unit, and up to three 10757A/B/C Material Temperature Sensors.

8-B-329. The board has two ground systems. Note that the inverted triangle with the A inside is used to denote "analog ground" on the schematic. The analog ground lines provide a means of replicating true ground (chassis) for U65, U67 and R5 on A3 and for the Air Sensors and Material Temperature Sensors without offset (IR drops). Thus these A/D conversions are referenced to the same ground level. Analog ground buffer U9, in the Air Sensor, provides an alternate path for ground current created in the Air Sensor in order to avoid IR drops on the analog ground within the Air Sensor cable. Other parts of the A4 are independently connected to chassis ground.


8-B-330. Several capacitors on A4 prevent emmission of EMI. R1 and CR1 protect the Voltage Reference. R2 and R3 terminate the twisted pairs that carry the Measurement and Reference signals from the Laser Head.

8-B-331. 5508A A4 CONNECTOR BOARD TROUBLESHOOTING

8-B-332. Use the schematic and an ohmmeter to check A4.

Figure 8-B-21
5508A A3 COUNTER BOARD 05508-60003, COMPONENT LOCATOR (Sheet 5 of 5)

(See Page 8-B-99)

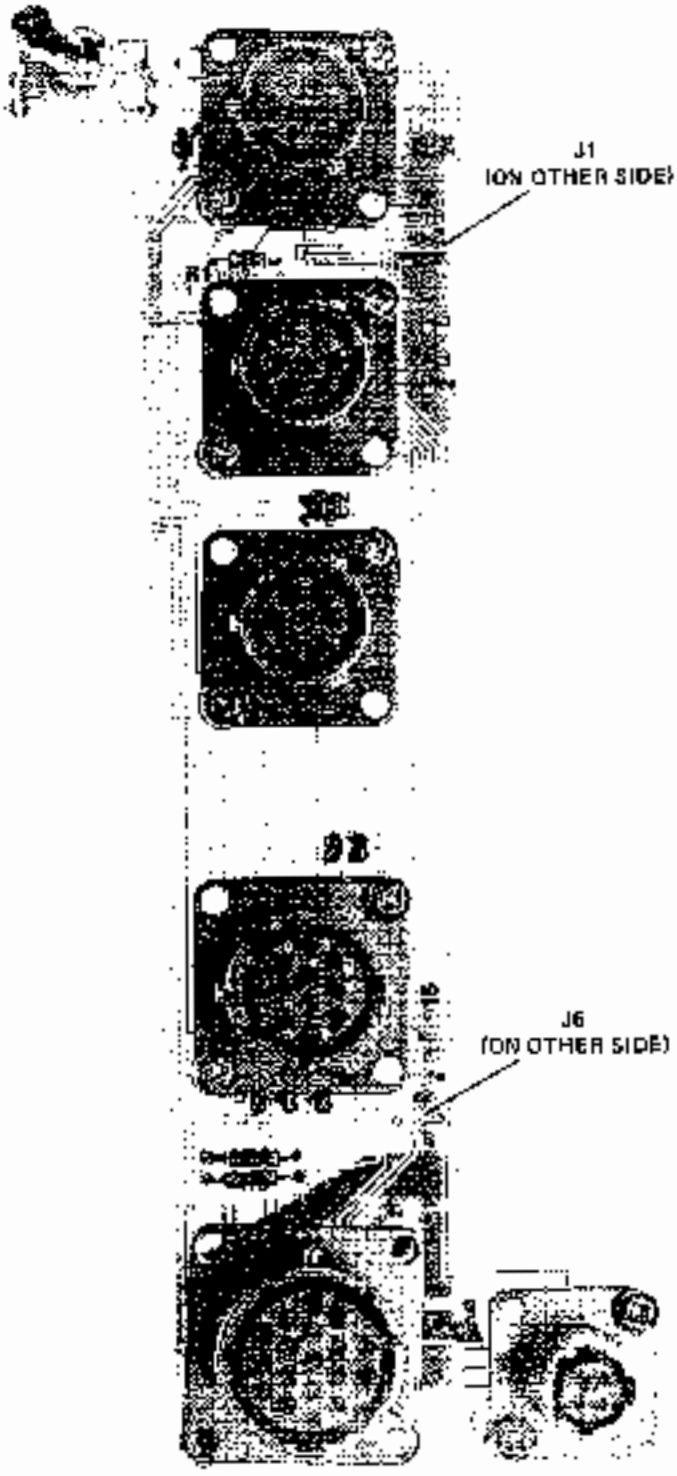
J1
(ON OTHER SIDE)
J6
(ON OTHER SIDE)

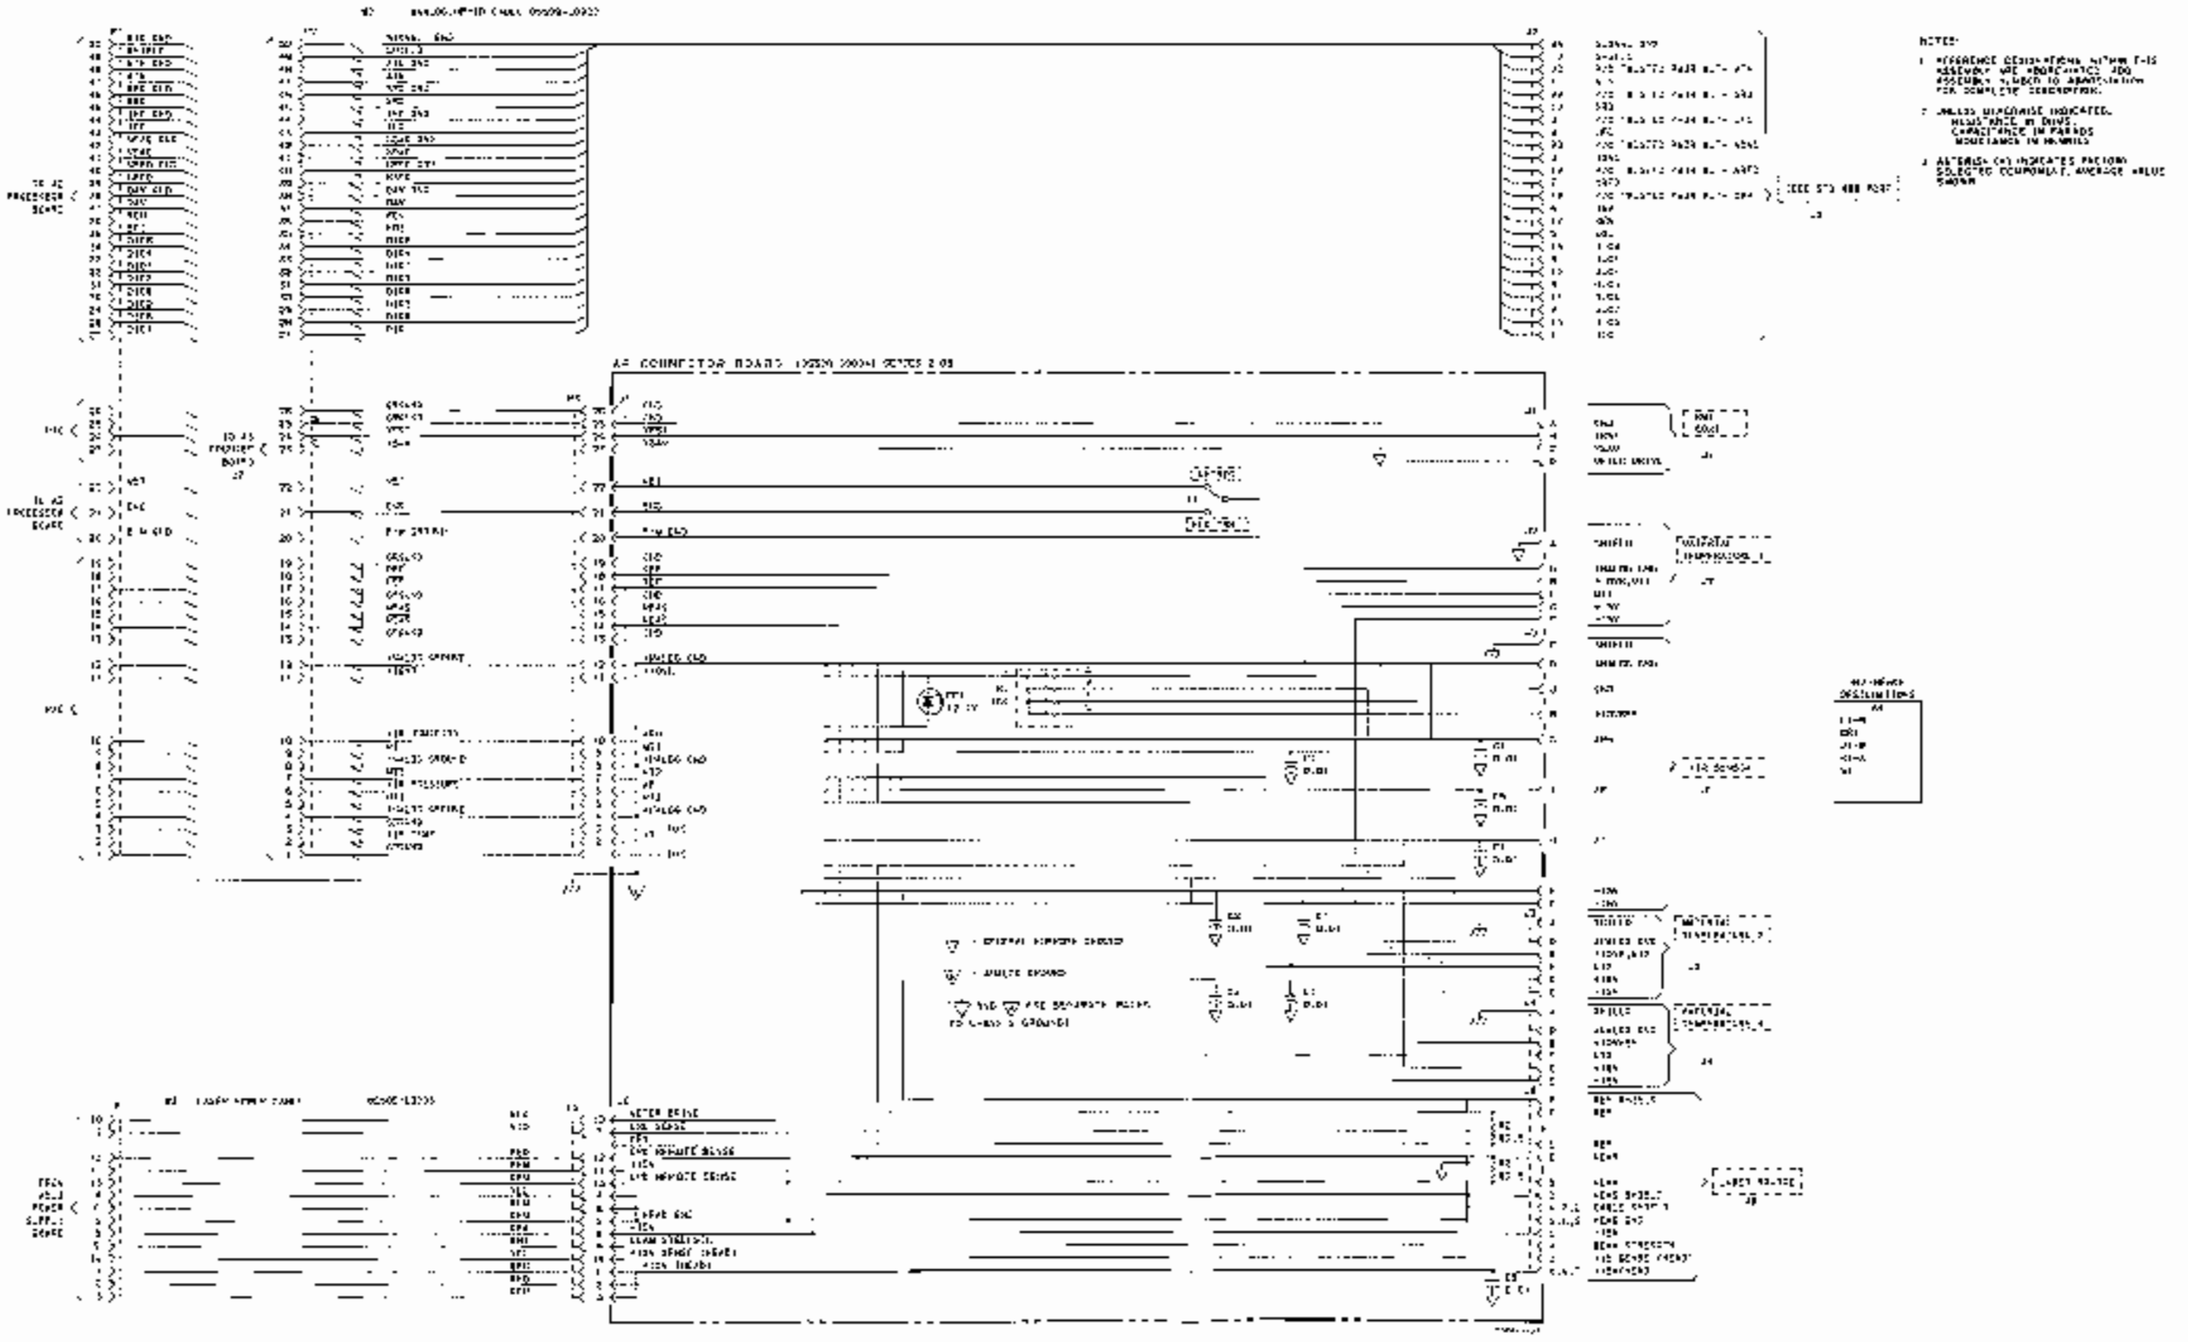


Figure 8-F-22. 5506A A4 Rear Panel Connector Board 05508-60004

Figure 8-B-32
5508A A4 REAR PANEL CONNECTOR BOARD 05508-60004

(See Page 8-B-101)

8-B-333. 5508A A5 POWER SUPPLY BOARD CIRCUIT THEORY

8-B-334. Paragraphs 8-B-336 through 8-B-301 contain circuit theory for Power Supply Board A5. Paragraphs 8-B-362 through 8-B-364 cover the troubleshooting information.

8-B-335. The schematic diagram for Power Supply Board A5 is shown in Figure 8-B-32. The schematic has functional blocks that are labeled alphabetically with circled letters. These labels correspond to the circled letters in the text for the circuit theory.

8-B-336. The power supply provides the following outputs:

a. +15 volts at 3.15 amperes for use by the 5518A Laser Head. On the schematic, this is referred to as +15 VH, see Block G.

b. +5 volts at 4 amperes for use by 5508A boards A1, A2, and A3. On the schematic, this is referred to as +5 V REG, see Block F.

c. +15 volts at 150 milliamperes for use by circuits other than the laser head. On the schematic, this is referred to as +15 V, see Block H.

d. -15 volts at 150 milliamperes for the 5518A, 5508A, and the 10751A. On the schematic, this is referred to as -15 V, See Block E.

8-B-337. In addition, A5 contains a beam strength amplifier (Block B) to drive the meters in the front panel and the Remote Control Unit 05508-60021.

8-B-338. Primary Power Circuits Ⓐ

8-B-339. The primary power circuits consist of a three prong line connector J1, a power line module, on-off switch S1, thermal switch S2, blower motor B1, and the primary windings of T1.

8-B-340. The power line module contains a low pass filter and a line voltage selector card. The low pass filter, consisting of two inductors and two capacitors, prevents noise spikes and transients from entering the power supply. The line voltage selector card allows the instrument to operate off of four different line voltages, 100 V, 120 V, 220 V, and 240 V, as shown in Figure 8-B-32. Note that B1 always receives 120 volts regardless of the applied line voltage.

8-B-341. Thermal switch S2 monitors the temperature of the heat sink and opens the primary power line when the temperature exceeds 75 degrees centigrade.

8-B-342. In the secondaries of T1, the blue-brown sections develop 10 volts rms open circuit (9 volts rms full load) for the −5 V rectifier. The red-yellow sections develop 30 volts rms open circuit (25 volts rms full load) for the 15 volt supplies

8-B-343. −5 Volt Power Supply Ⓘ and Ⓕ

8-B-344. The -5 volt supply consists of rectifier CR1 mounted on the heat sink, a 5 volt filter and fuse section, a 5 volt regulator, and a -5 volt series pass transistor.

8-B-345. The 5 volt regulator circuit consists of error amplifier A5U2 and series pass transistor Q1 mounted on the heat sink. Voltage reference A5U1 receives approximately +20 volts unregulated from block D and supplies a highly accurate and stable 10 volts to a voltage divider composed of A5R8 and A5R9. The divider develops 5.05 volts across A5R8 which is used as one input for error amplifier A5U2. The other input to A5U2 is fed back from the +5 volt remote sensing line. When A5U2 senses a change of output voltage, A5U2 drives series pass transistor Q1 to counteract the change and maintain the regulated voltage at the load.

8-B-346. Current limiting is performed by A5R5 and A5Q1. When the current through A5R5 approaches about 8 amperes, A5R5 drops 0.56 volt which is sufficient to turn on A5Q1. A5Q1 pulls the base voltage of Q1 toward the emitter voltage resulting in a reduction of the supply output voltage. In this manner, the output voltage decreases when necessary to prevent the load current from exceeding 8 amperes. Note, however, if the load current exceeds 5 amperes for more than 0.8 second, fuse F1 will blow. In other words, peak current is limited to 8 amperes while the load during a 0.8 second period is limited to 5 amperes.

8-B-347. Crowbar zener A5CR12 activates when the output voltage exceeds 6 volts and draws enough current to blow fuse F1. Typically, the zener will short when forced to blow the fuse.

8-B-348. A5DS1 indicates the presence of +5 volts. If +5 volt unreg fails (goes below 6.5 V), A5CR24 pulls A5U2 pin 3 low to prevent the +20 volt unreg from feeding through A5U1, A5U2, and Q1.

8-B-349. Remote sensing is accomplished by returning a line from the load back to J1-26. A5R2 feeds back the sensed load voltage (+5 V less line drop) to the minus input of A5U2. The regulator circuit attempts to keep the two inputs of A5U2 the same, thus compensating for IR drop across cable W1.

8-B-350. If there is no voltage on the remote sense line (cable W1 is unplugged), the output tries to rise to 10 volts. A5CR1 and A5C5 clamp A5U2 pin 2 at a minimum of one diode drop below the output at A5R5 resulting in a maximum output of 5.7 volts. This also determines the maximum line loss that the regulator can compensate for (0.7 V).

8-B-351. +15 Volt Head Power Supply Ⓖ

8-B-352. The +15 Volt Power Supply is similar to the +5 Volt supply so only the differences will be described. The reference input to the error amplifier A5U5 is the 10 volt reference supplied through A5R33. To achieve the required +15 volt output, the feedback voltage to the minus input of A5U5 is multiplied by 2/3 by voltage divider R30 and R33. Thus for 15 volts at the output, the voltage at the junction of A5R30 and A5R33 is 10 volts. A5U5 attempts to keep the voltage at A5U5 pin 2 at 10 volts, thereby maintaining the output at the required 15 volts.

8-B-353. A5R34 allows the output voltage to change up to 1 V to compensate for line loss in the head cable. Another change is A5R11 which serves the same function as CR14 in the +5 volt supply. If the +20 volt unreg fails, which would give a false "on" indication, A5R13 prevents any significant amount of current from flowing through A5Q2 into A5DS3.

8-B-354. Another difference is A5CR8 and A5R31. The zener diode adds 7.15 volts to the output of A5U15 to allow the output to rise sufficiently (19 V) to control Q2 (mounted on the heat sink). A5R31 provides current to keep the zener in conduction.

8-B-355. The remote sense line for the +15 volt supply connects to J3-14. If the head is disconnected, the output rises to 15.6 volts.

8-B-356. ±15 Volt Regulators Ⓗ and Ⓔ

8-B-357. The low current + and - 15 volt power supplies (Blocks H and E) have relatively clean outputs since they are independent of the large current variations induced by the laser head. Both supplies provide power to the Air Sensor, the Material Temperature Sensors, and circuits in the 5508A. The -15 volt supply also provides low level current to the 5518A Laser Head.

8-B-358. The regulators are three terminal devices. If the input is lost, A5CR3 and A5CR10 prevent the output filter capacitor from discharging through and destroying the regulators. A5CR2 and A5CR11 protect the regulators if the wrong polarity is applied at the output.

8-B-359. Beam Strength Amplifier (B)

8-B-360. In the laser head, receiver board A2 provides a current source whose output is proportional to the strength of the return measurement beam. With no return beam, the current source switches off. For maximum return beam, the current source output is (-) 2 milliamperes. The equivalent circuit is shown in Figure 8-B-23.

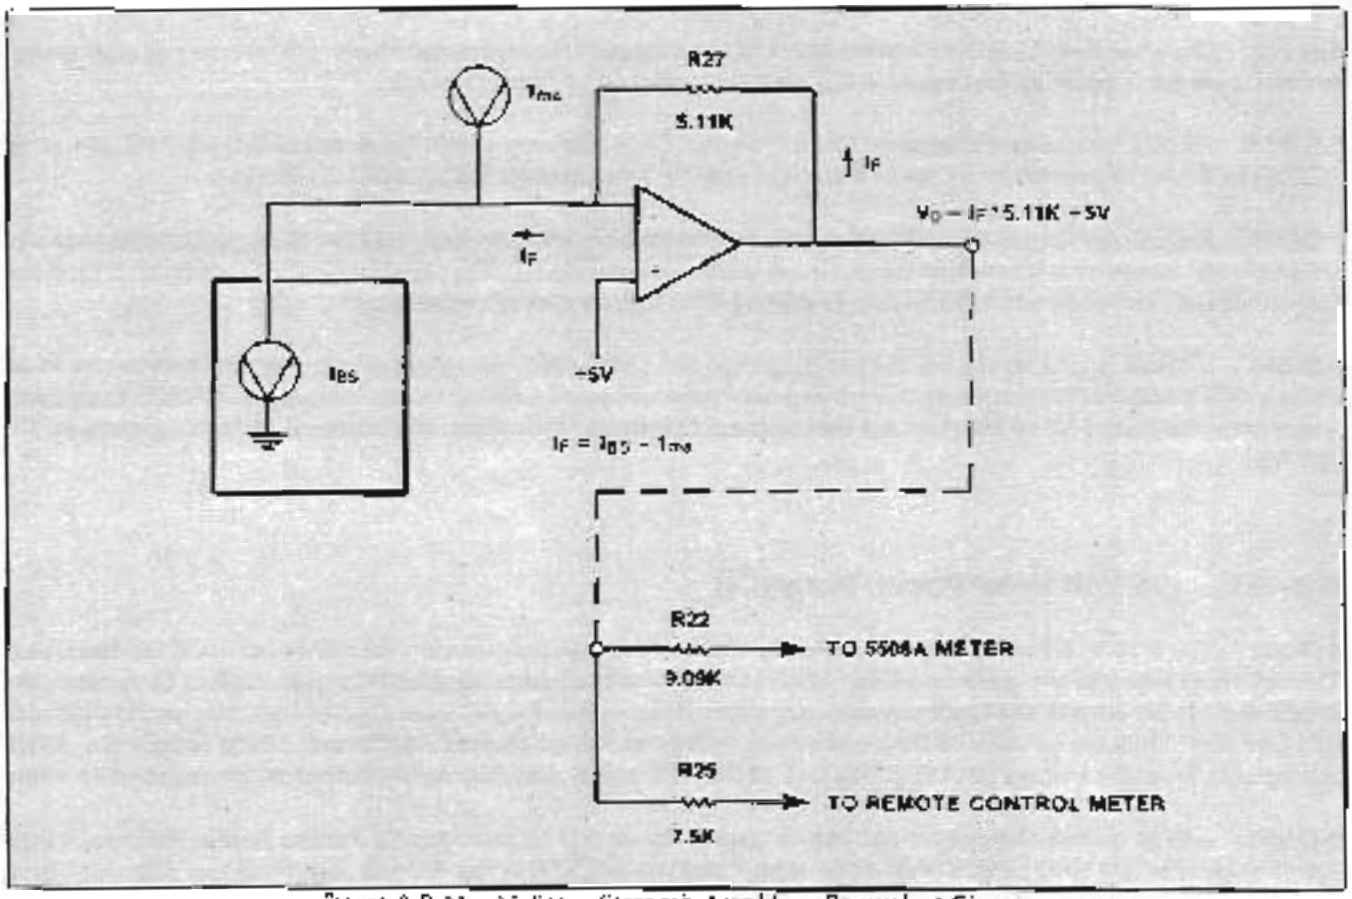


Figure 8-B-23. A5 Beam Strength Amplifier Equivalent Circuit

8-B-361. The 5508A beam strength meter, as well as the meter in the optional remote control unit, requires 1 milliampere for full scale deflection. Resistance is added in series with both meters to make a total resistance of 10k ohms in each path. This results in an output of 10 volts causing full scale deflection in one or both meters. Figure 8-B-23 illustrates the three functions of the beam strength amplifier: provide an offset current of 1 milliampere, current to voltage conversion, and capability to drive 2 meters simultaneously. In addition A5CR6 and A5CR7 provide over voltage protection and A5R24 and A5C12 provide high frequency rejection.

8-B-362. 5508A A5 POWER SUPPLY BOARD TROUBLESHOOTING

8-B-363. Before troubleshooting the power supplies, use the 5518A as a load by connecting it to the 5508A. Set the voltage selector card in the 5508A for 115/120 V operation. Measure the power supply voltages in Table 8-B-12 (-15 V, +15 V, +15 VH, and +5 V) and refer to the Power Supply Troubleshooting Table 8-B-13 to determine which procedure to follow. If more than one supply is faulty, the sections should be repaired in the following order:

-15 V

+15 V

+15 VH

+5 V

8-B-364. After repairing a supply, measure the power supply voltages again and use the new symptoms to identify the proper procedure to follow in the Power Supply Troubleshooting Table 8-B-13. A power supply voltage is considered incorrect if it does not meet specifications. Table 8-B-12 lists the voltage specifications for the power supplies.

Table 8-B-12. Power Supply Voltage Specifications

Supply Voltage	Acceptable Range
−15 V	−14.4 to −15.6 V
+15 V	+14.7 to +15.3 V
+15 VH	+14.7 to +15.3 V*
+5 V	+4.96 to +5.16 V*

*If the remote sense line is open or grounded, the output voltage will exceed the specification by 0.3 or −0.6 volt.

Table 8-B-13. Power Supply Troubleshooting

Symptom	Action
All output voltages incorrect	See Figure 8-B-24
−15 V output incorrect	See Figure 8-B-26
−15 V output incorrect but −15 V output OK	See Figure 8-B-27
+15 VH output incorrect but −15 V & +15 V OK	See Figure 8-B-28
+15 VH fuse (F2) blows	See Figure 8-B-29
+5 V output incorrect but all other voltages OK	See Figure 8-B-30
+5 V fuse (F1) blows	See Figure 8-B-31

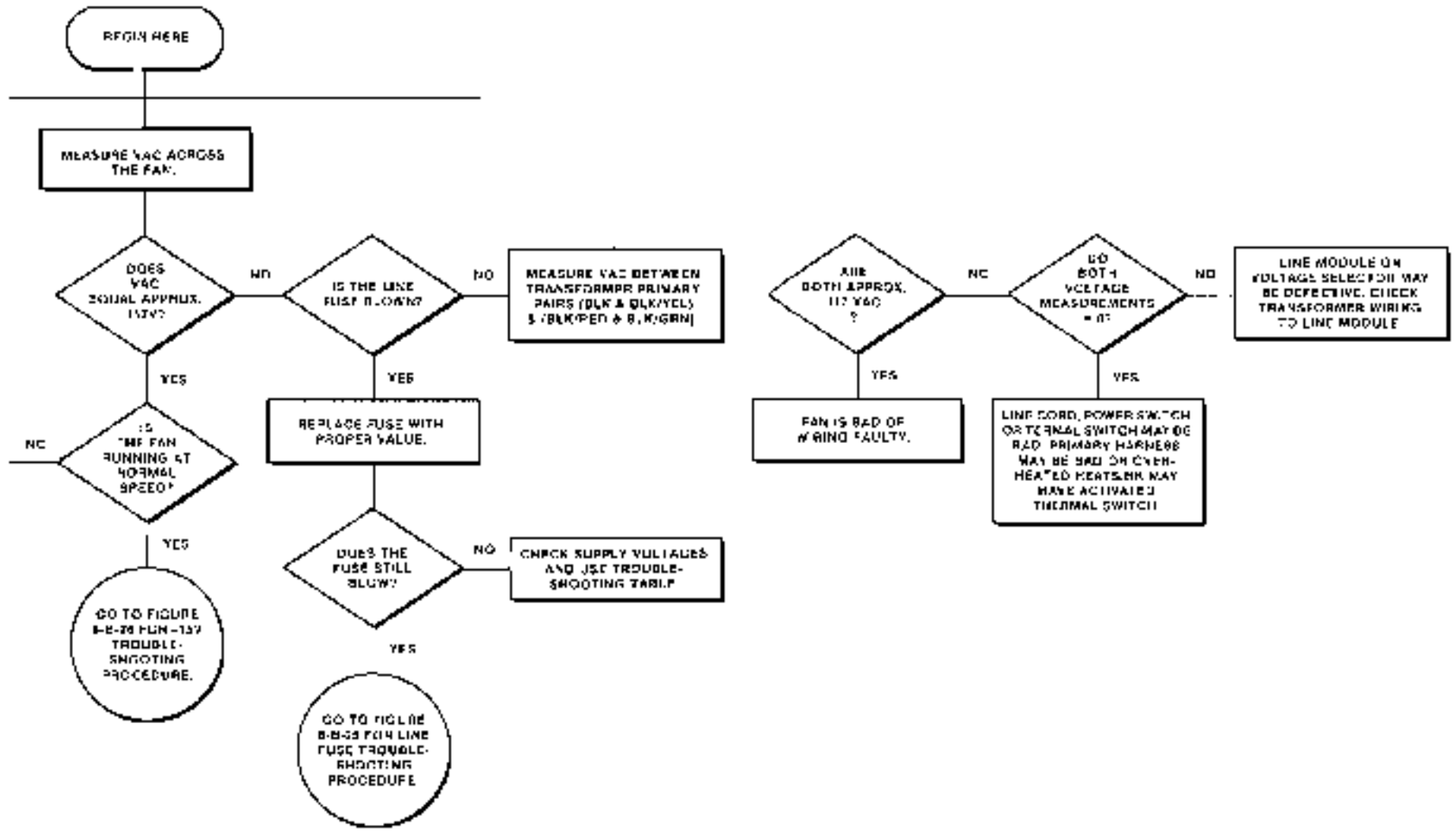


Figure 8-24. Troubleshooting Procedure for All Supply Voltages Incorrect

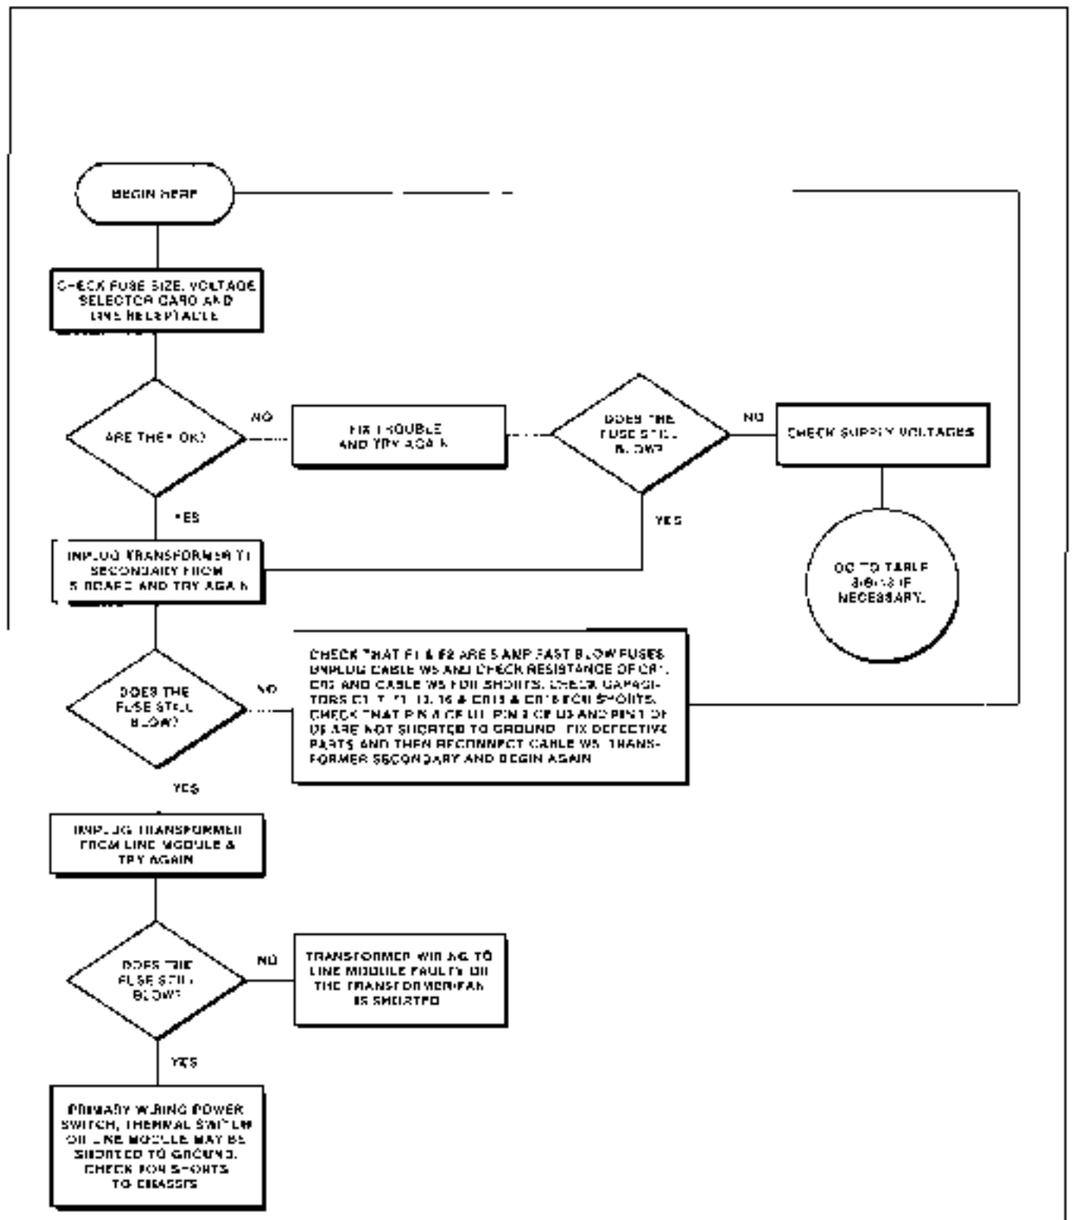


Figure 8-29. Troubleshooting Procedure for Blown Line Fuse

Figure 8-29
TROUBLESHOOTING PROCEDURE FOR ALL SUPPLY VOLTAGES INCORRECT

(See Page 8-B-107)

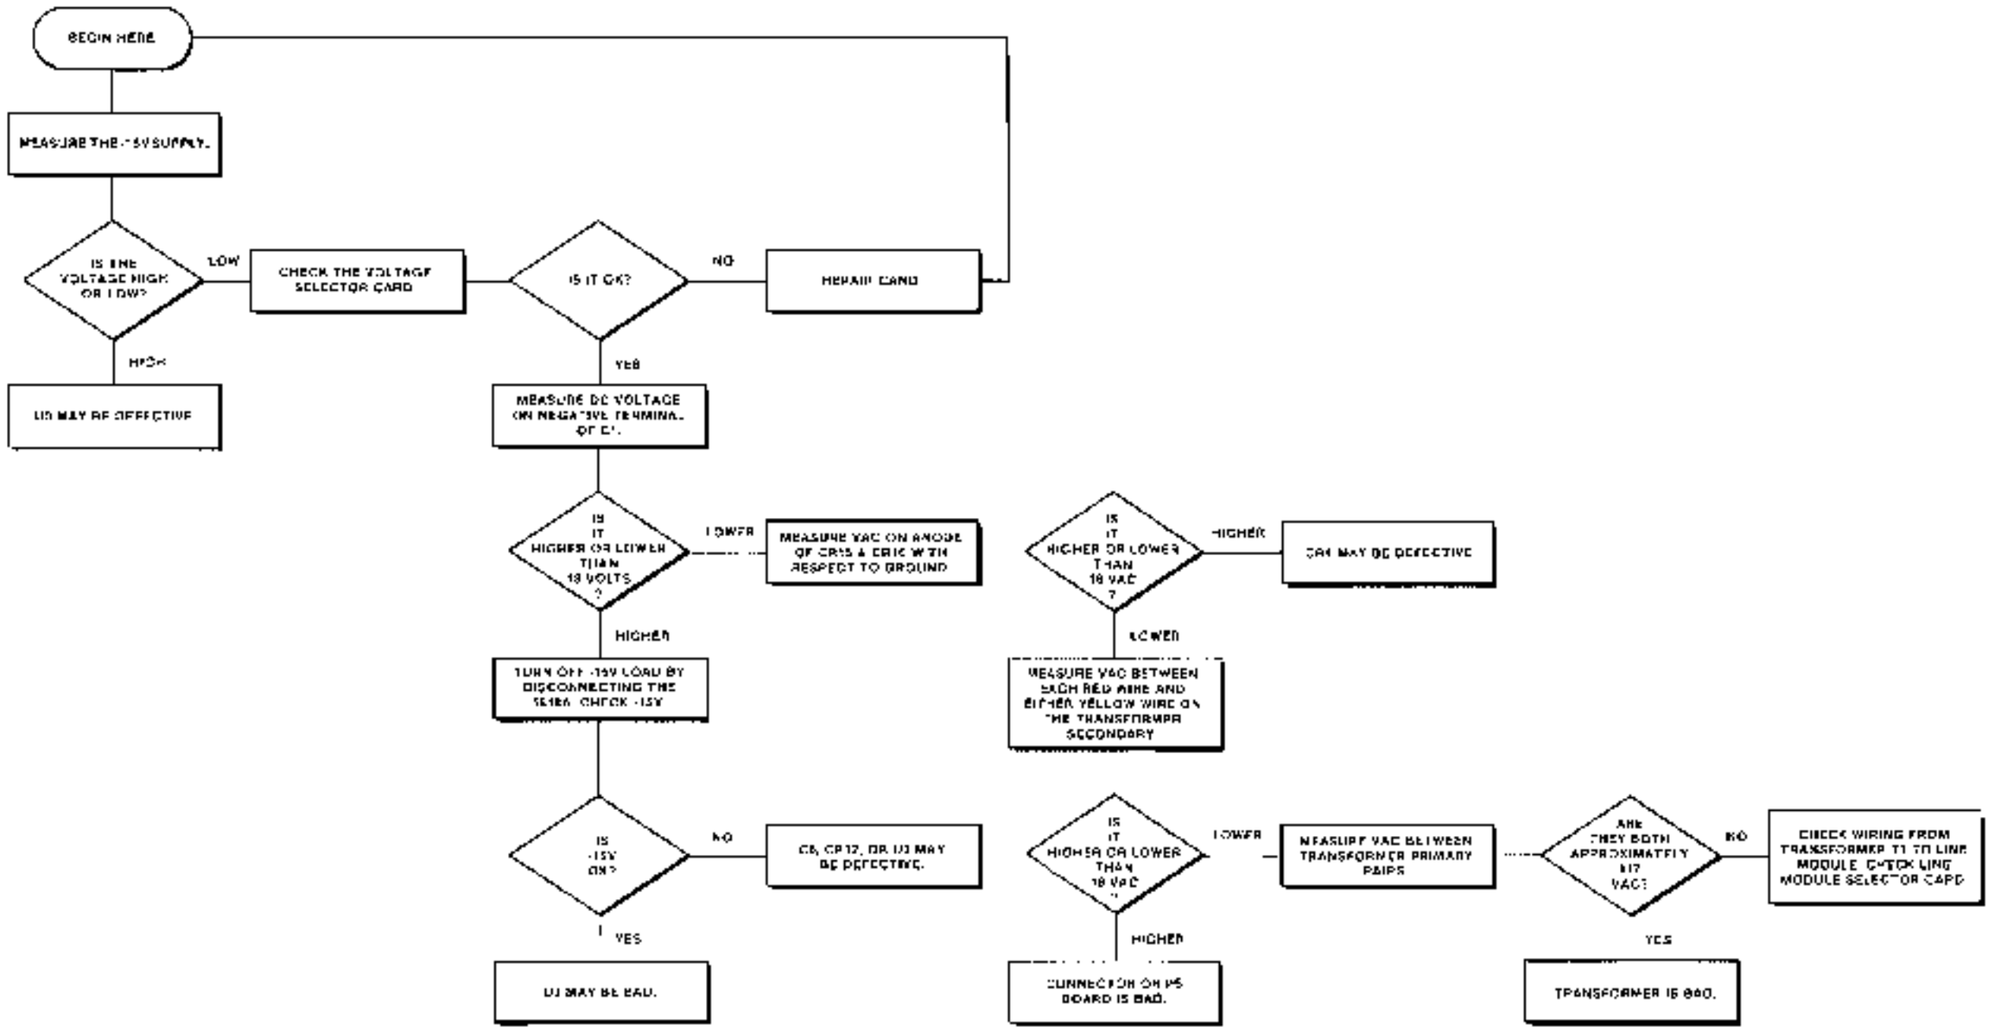


Figure 6-6-95. -15 V Power Supply Troubleshooting Procedure

NOTE

This procedure assumes that the +15V supply is functioning properly, thereby ensuring that the entire transformer primary and the red secondary are OK.


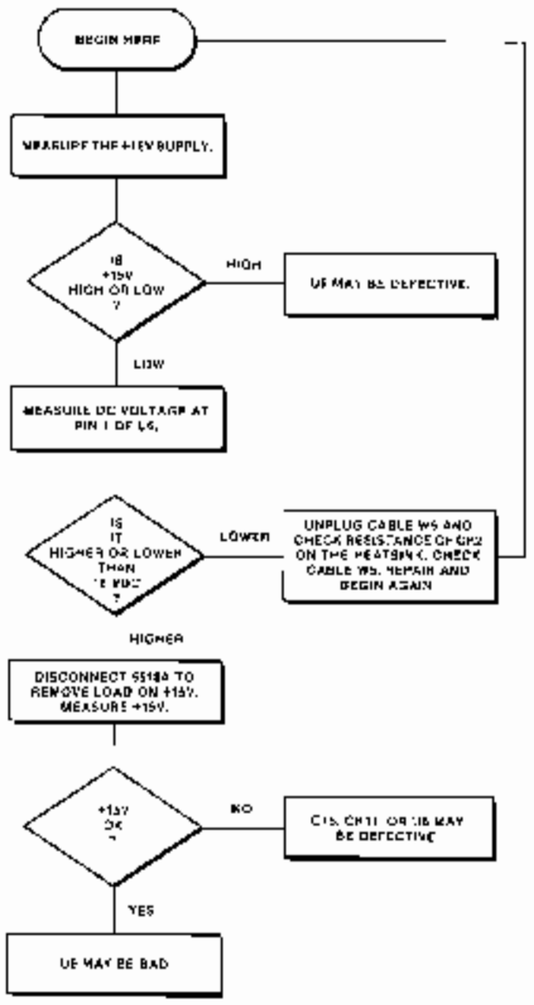


Figure 8-8-27 +15 V Power Supply Troubleshooting Procedure

Figure 8-8-25
-15V POWER SUPPLY TROUBLESHOOTING PROCEDURE

(See Page 8-B-1001

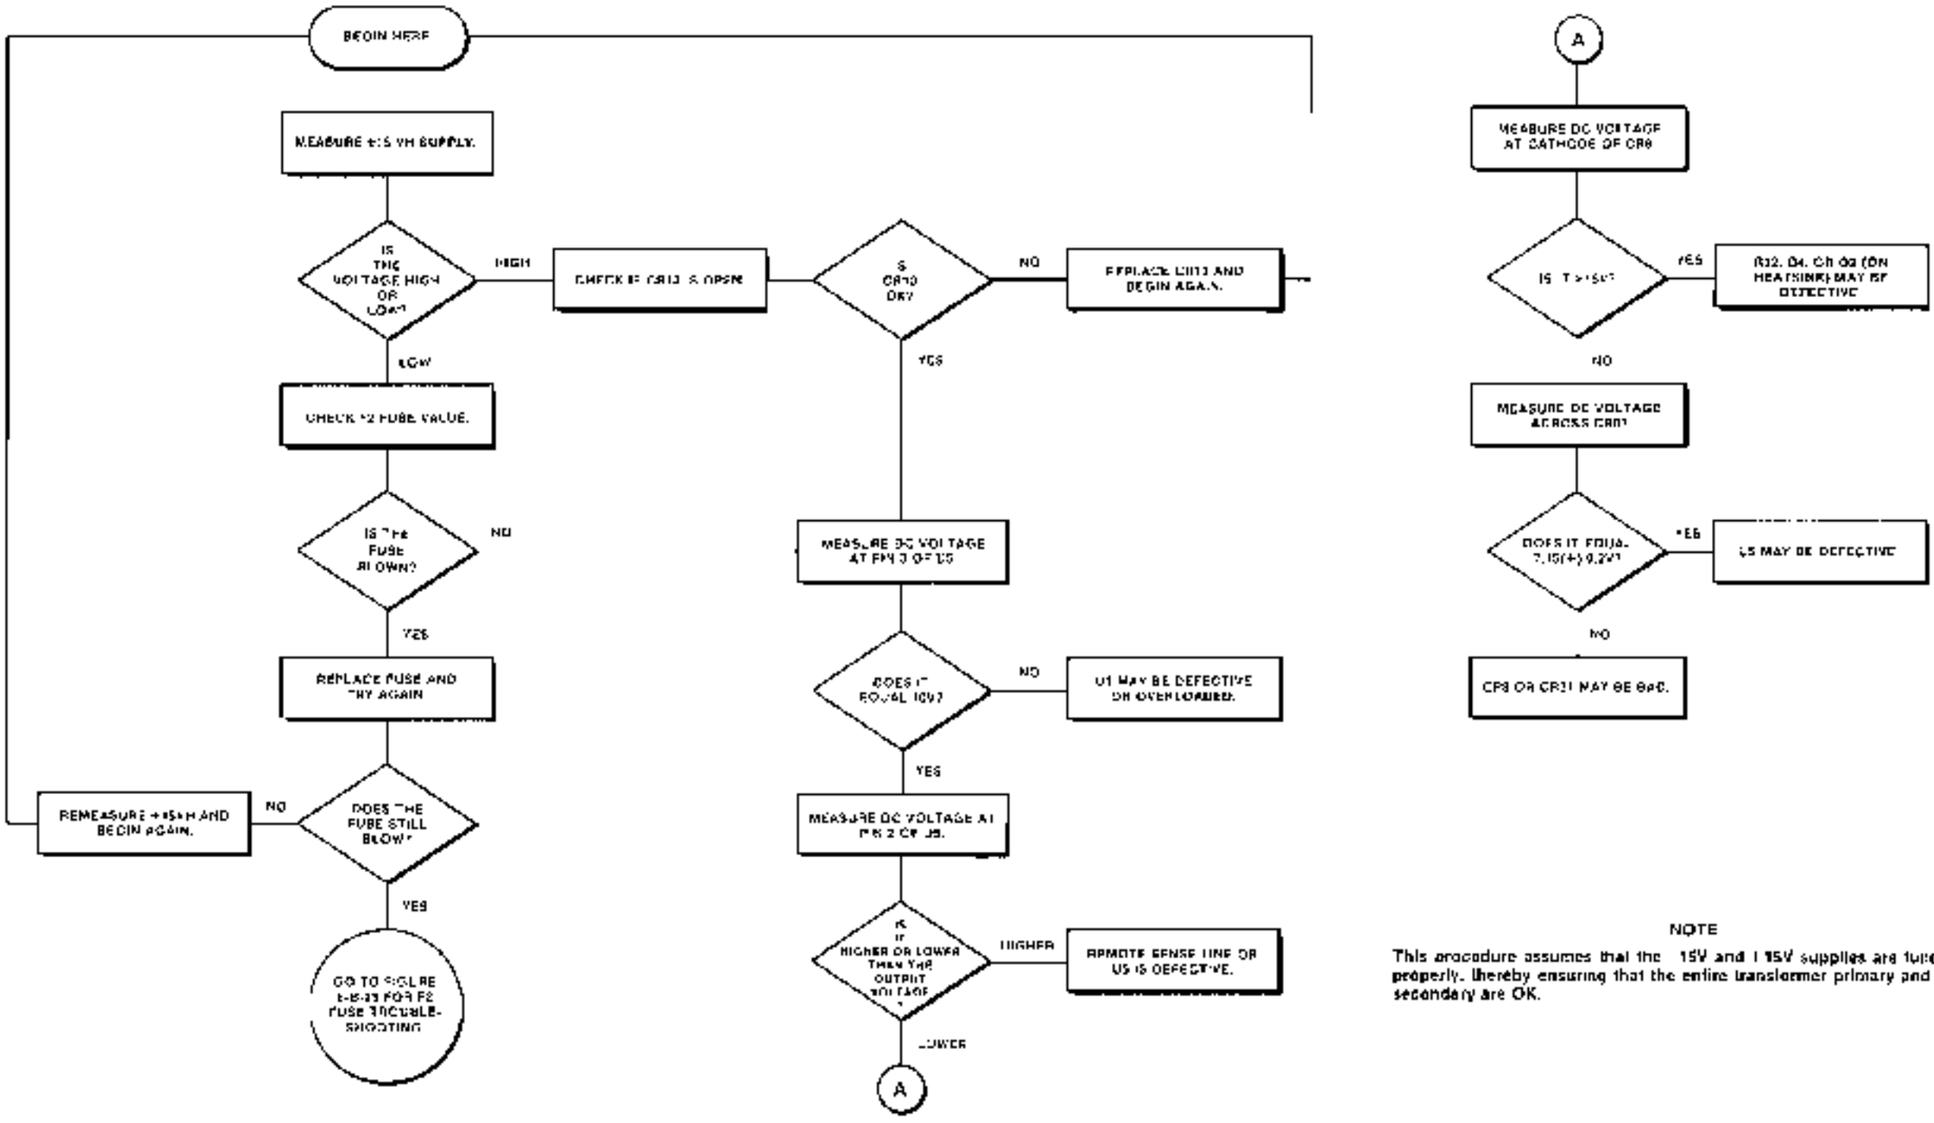

NOTE

This procedure assumes that the -15V and +15V supplies are functioning properly, thereby ensuring that the entire transformer primary and the red secondary are OK.

Figure 8-B-20. +15 VH Power Supply Troubleshooting Procedure

NOTE

This procedure assumes that both the -15V and +15V supplies are functioning properly, thereby ensuring that the entire transformer primary and the red secondary are OK.

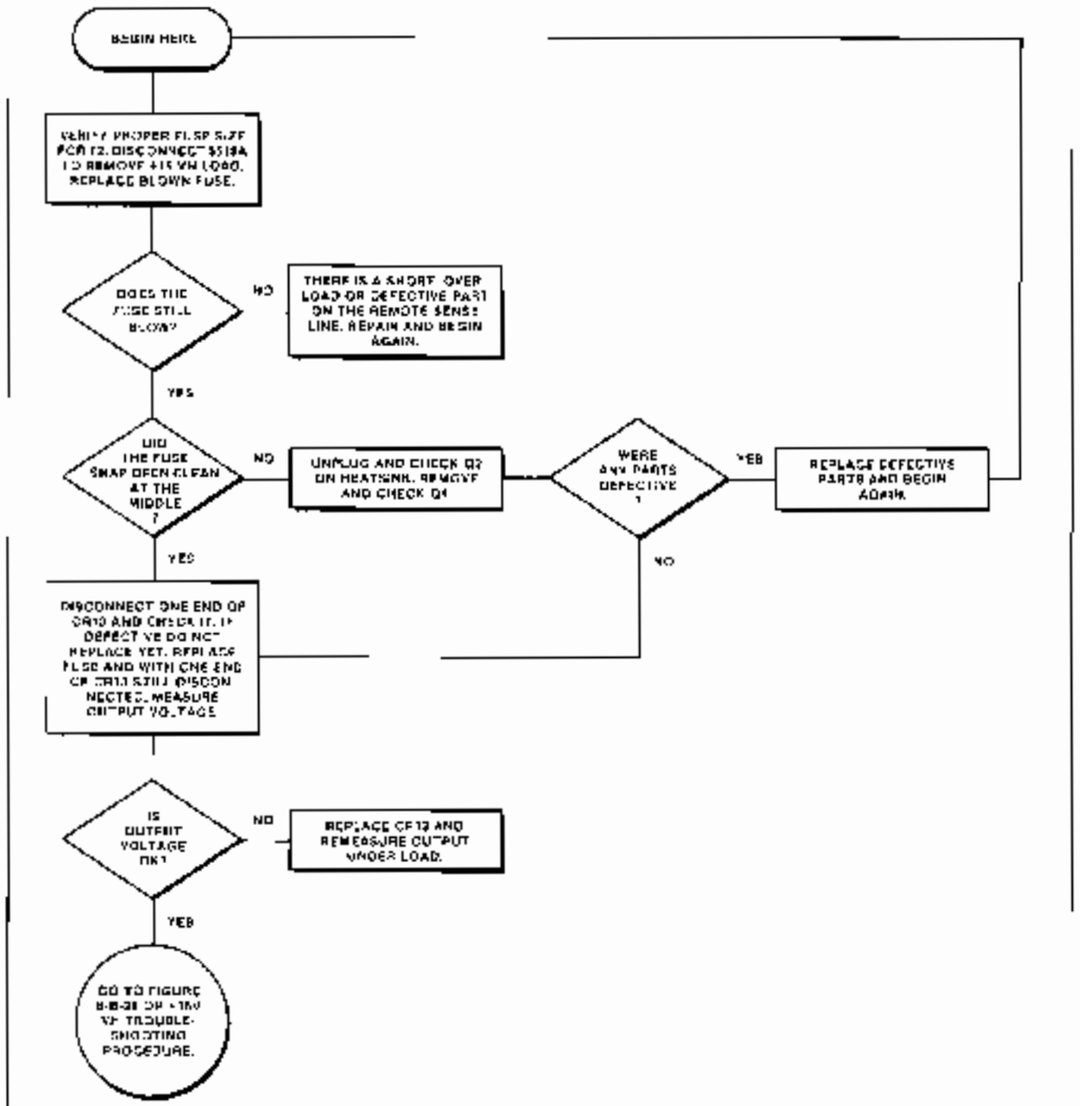


Figure 8-8-29. +15 VH Blown Fuse Troubleshooting Procedure

Figure 8-8-28
-15 VH POWER SUPPLY TROUBLESHOOTING PROCEDURE

(See Page 8-8-111)

NOTE

This procedure assumes that all supply voltages are functioning properly except the −15V, thereby ensuring that the ac line transformer primary and rod secondary are OK.

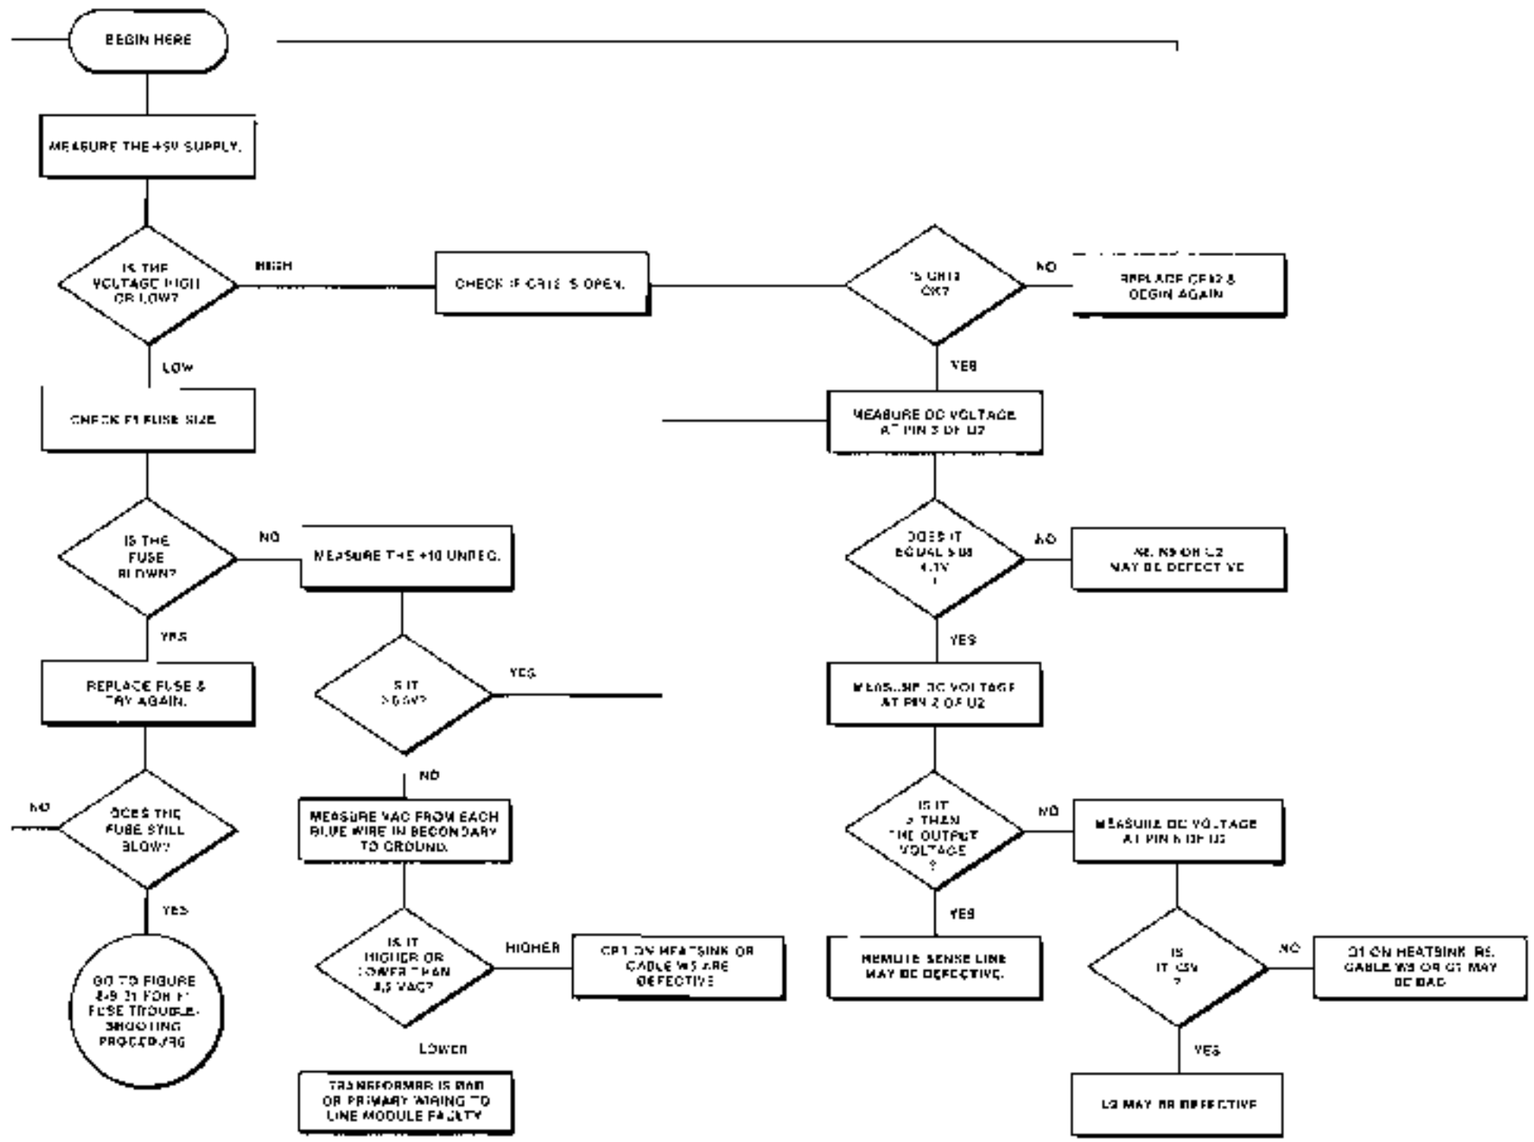


Figure 8-8-3E −5 V Power Supply Troubleshooting Procedure

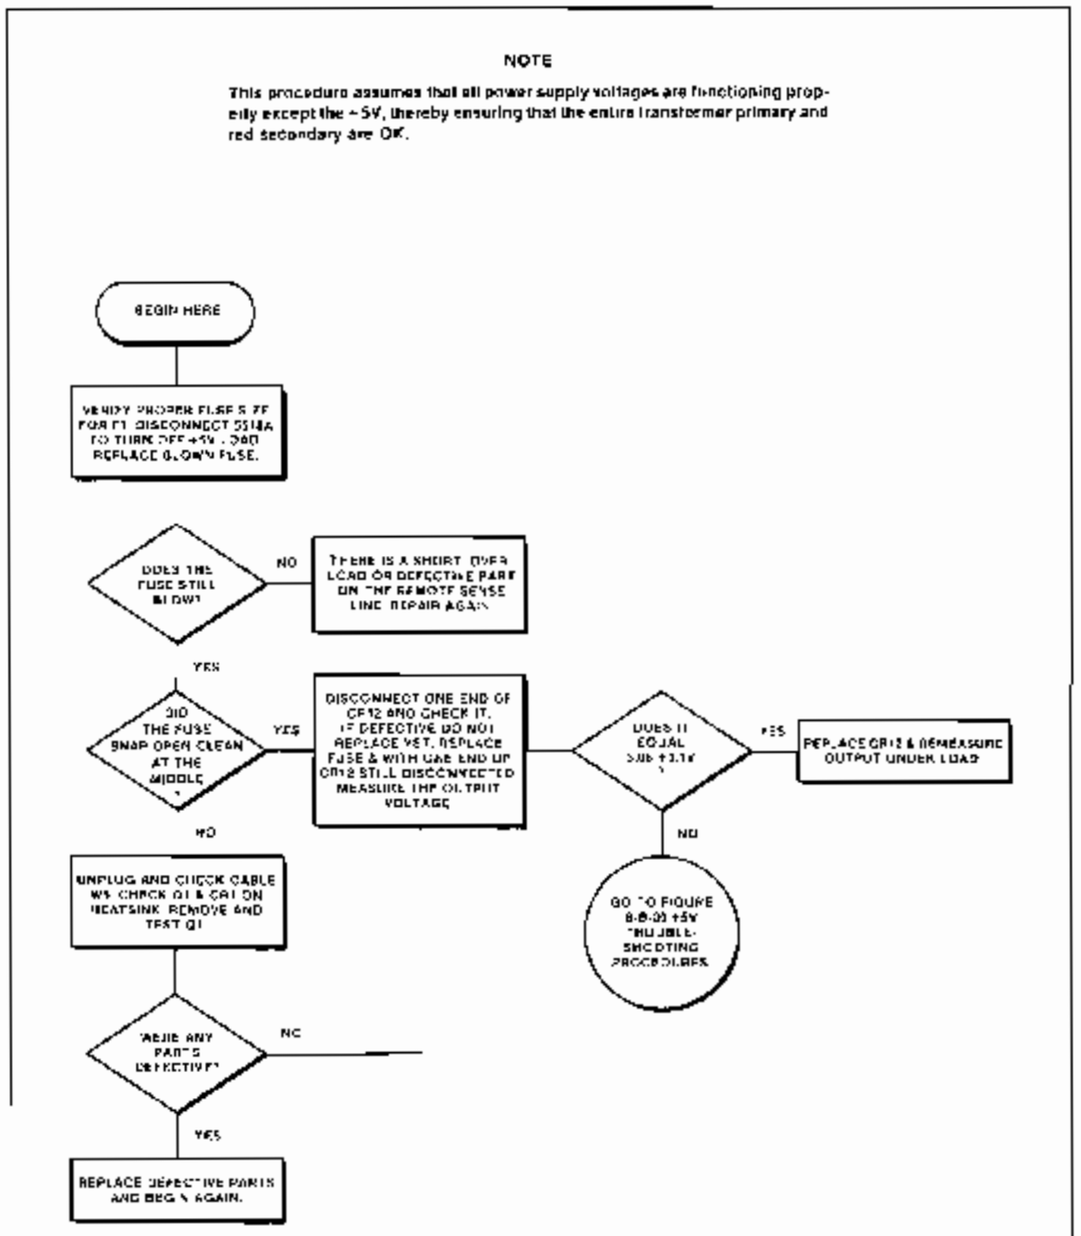



Figure 8-B-31. *Troubleshooting Procedure for F1 (+5 V) Fuse Blows*


Figure 8-B-30
+5V POWER SUPPLY TROUBLESHOOTING PROCEDURE


(See Page 8-B-113.



J1
TP5
C1
U3
U4
U5
C6
C7
DS2
R16
R18
CR2
CR3
TP1
TP2
CR12
C2
CR3
R4
CR15
CR16
C8
C9
R6
R18
J4
J5
C5
CR1
R2
R7
Q1
F2
U2
C4
R8
R9
F1
CR14
R12
R13
R14
CR17
R35
U1
C11
R22
CR6
C12
R23
R27
R28
R24
R26
CR7
DS4
C13
R29
TP4
C10
CR10
CR11
CR9
TP3
CR13
C10
R21
DS3
C14
R30
R31
R32
R33
R34
Q2
CR6
C8
R19
J3
C16


A8 POWER SUPPLY DC 8550 SERIES 2024

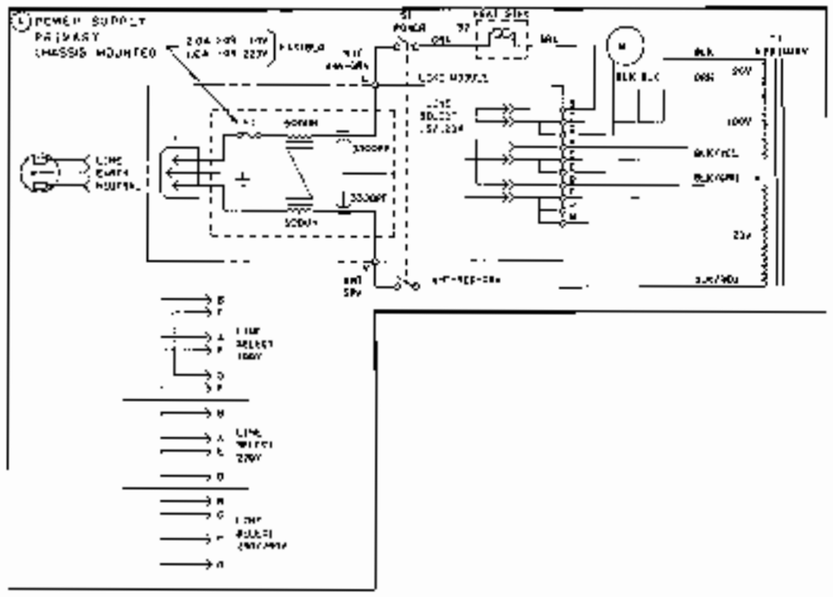


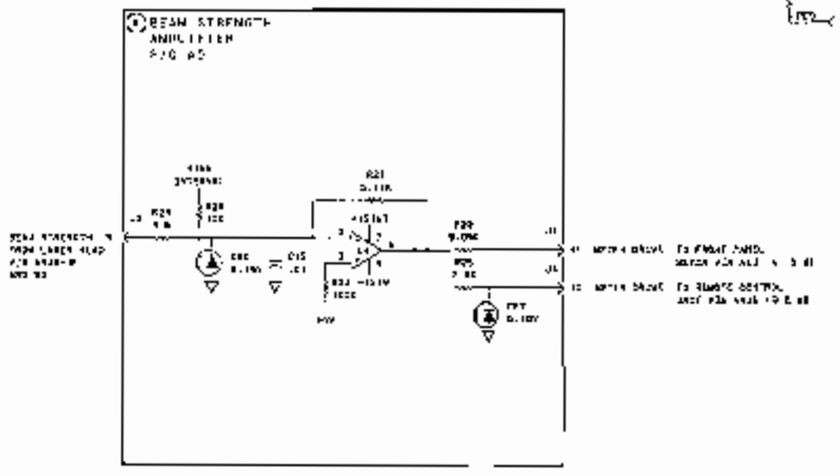


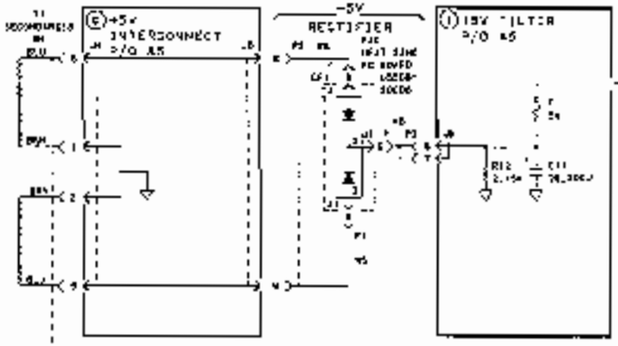


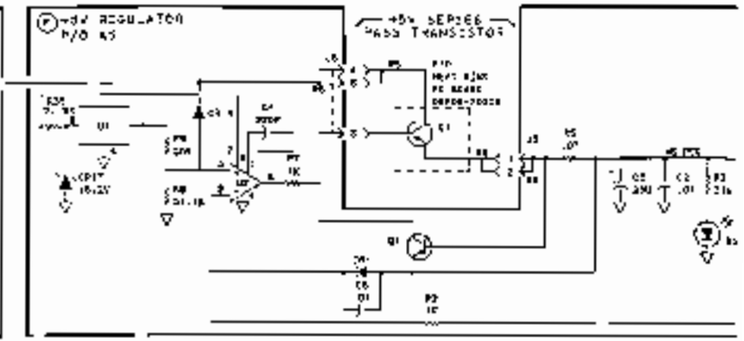


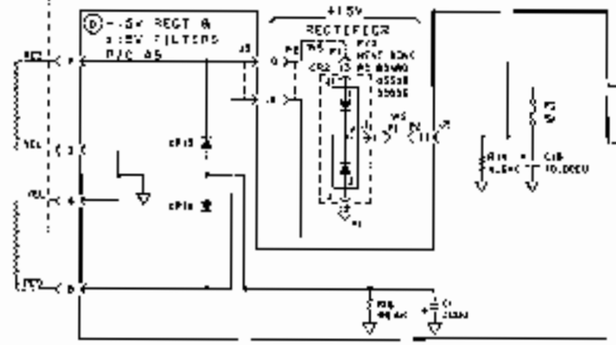

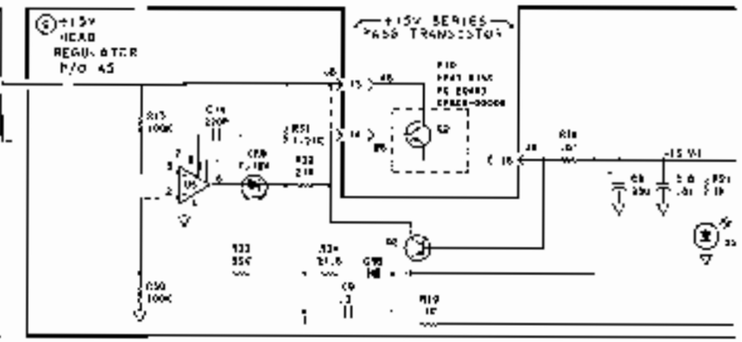

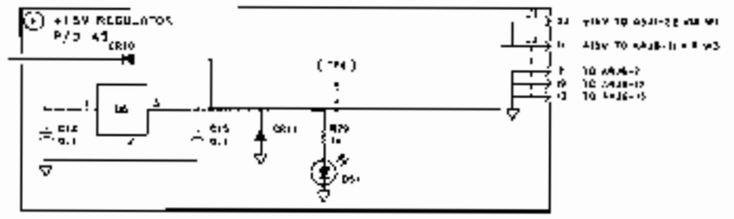

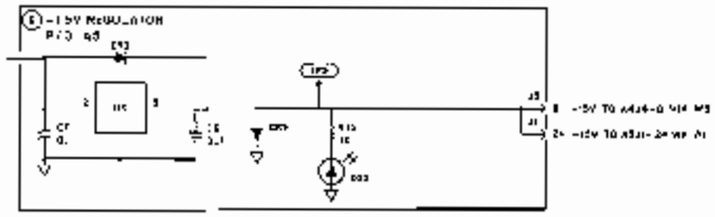

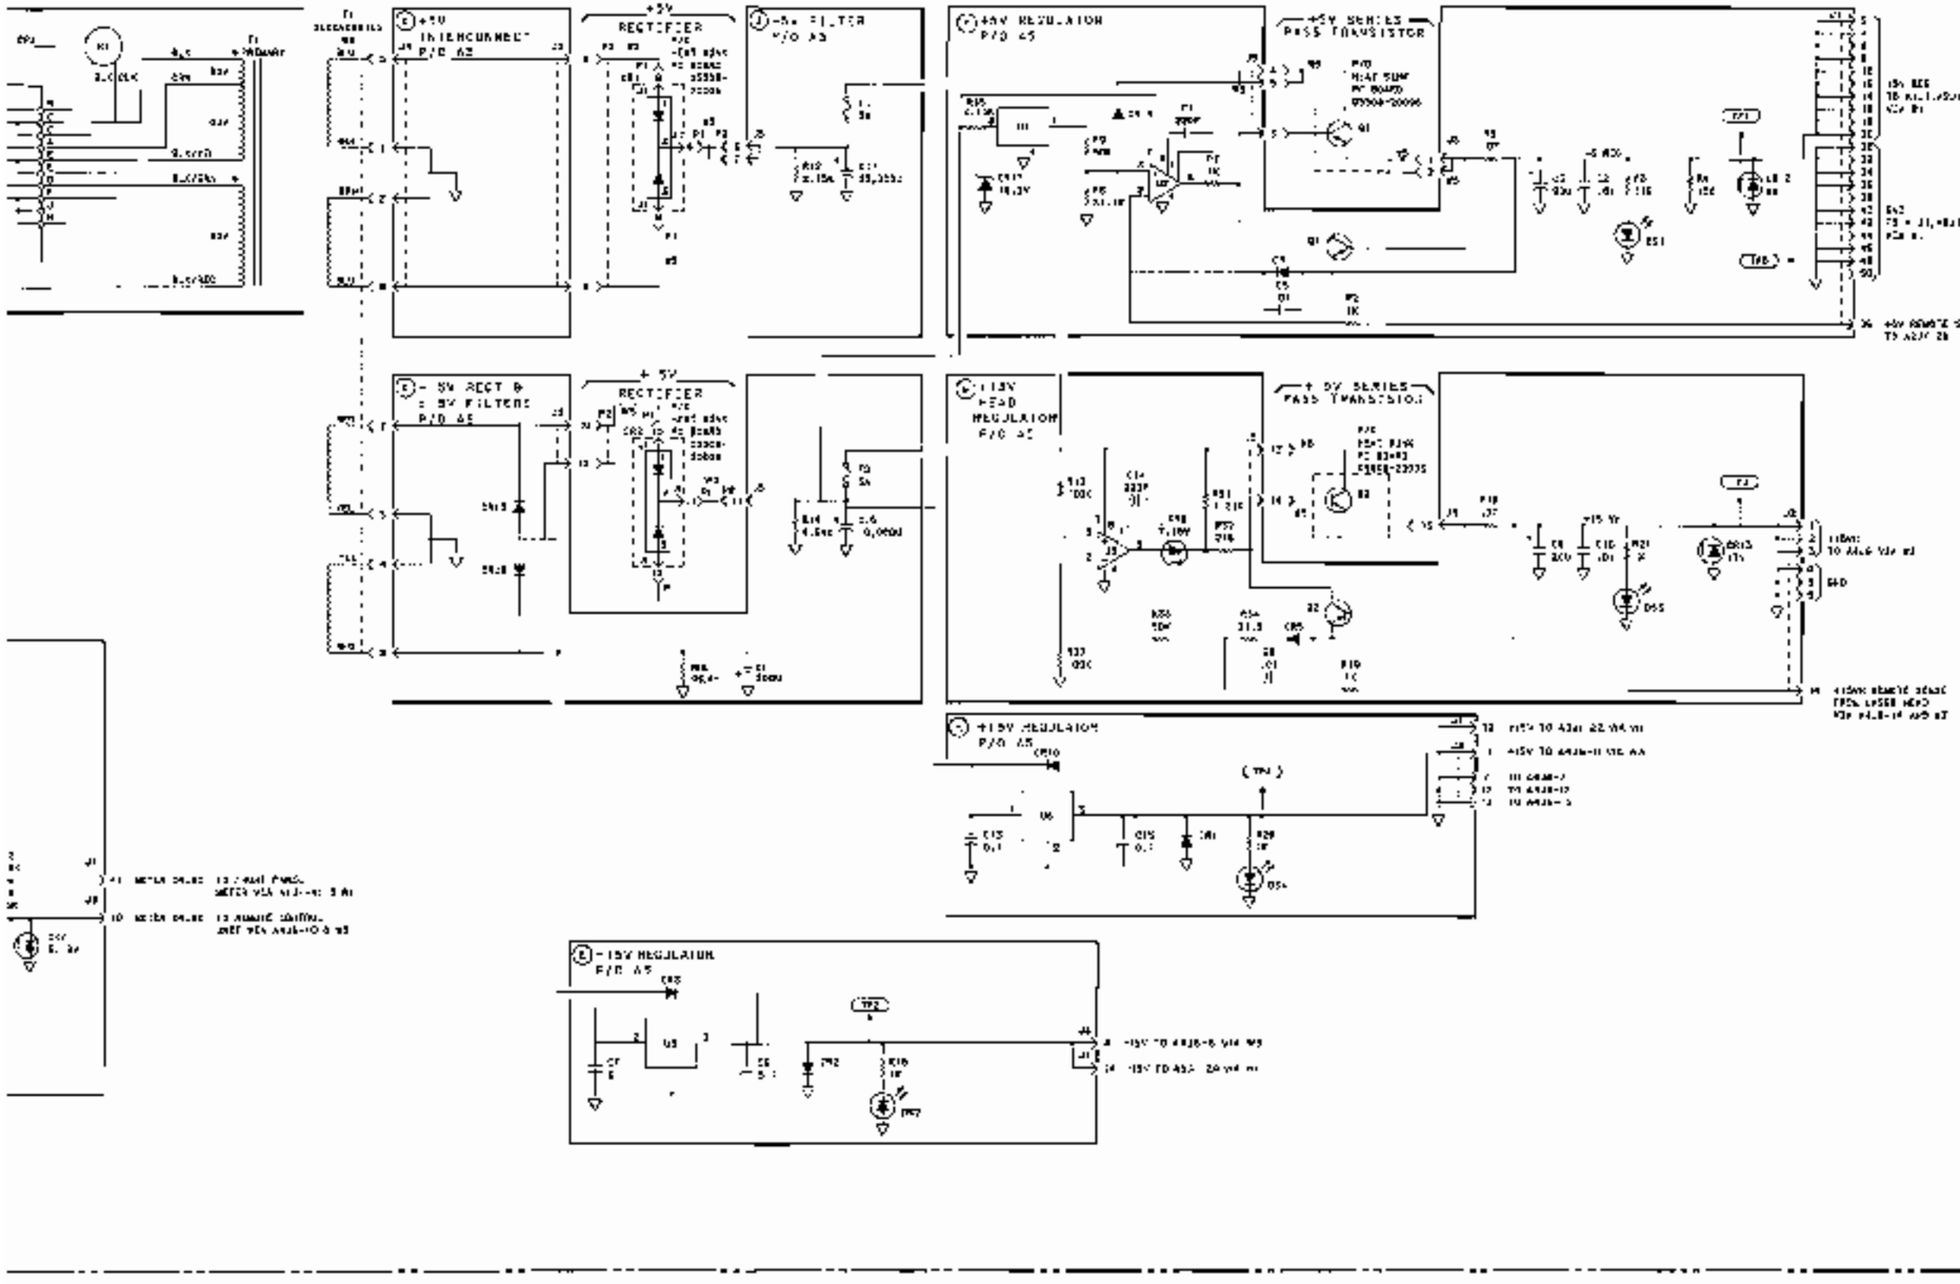

NOTES:

1. REFERENCE DESIGNATIONS WITHIN THIS ASSEMBLY ARE ABBREVIATED. ADD ASSEMBLY NUMBER TO ABBREVIATION FOR COMPLETE DESCRIPTION.
2. UNLESS OTHERWISE INDICATED:
   RESISTANCE IN OHMS
   CAPACITANCE IN FARADS
   INDUCTANCE IN HENRIES
3. ASTERISK (*) INDICATES FACTORY SELECTED COMPONENT, AVERAGE VALUE SHOWN.

ABBREVIATIONS

CLASS S
A
CPT-*
*
B -2
*
S -2
W
E -15
CR*-4,9-*, 12-17
CR*-9
F*-2
J1,J*-*
Q1-2
R2-5,7-9, 12,16,18, 19,21-25, 27-33
TP1-5
U*-6
DELETED
R1,6,10,11, 17,20,26
CR*,9
J2

LIST OF ASSEMBLY MANUFACTURERS

REFERENCE DESIGNATOR	MFR PART NO.
A3	
B -2	1854-0015
J	1854-0680
J2,5	1854-0211
J3	1854-0214
J4	1854-0483
J5	1854-0807
Q1-2	
CR*,9	4040 0281
J1,2	1854-0466

MFR PART NO.
4N3904
1854-0680
MJE340/T
MJ15003
LM340T5
2N6107
4040 0407
4040 0281
2N6057

TRANSFORMER WIRING COLOR CODE

Pin No.	Wire Color Code
1	Brown
2	Brown
3	Yellow
4	Yellow
5	Blue
6	Blue
7	Red
8	Red

W3 WIRING COLOR CODE

Pin No.	Wire Color Code
1	Brown
2	Red
3	Orange
4	Yellow
5	Green
6	Blue
7	Violet
8	Gray
9	White
10	Black
11	Brown
12	Red
13	Orange
14	Yellow

CABLE W4 WIRE COLOR CODE

Pin No.	Wire Color Code
1	Black
2	Red
3	Orange
4	Yellow
5	Green
6	Blue
7	Violet
8	Gray
9	White
10	Green
11	Brown
12	Red
13	Orange
14	Yellow
15	Green

Figure 8-8-32. 5508A A3 Power Supply Board 05506 60005

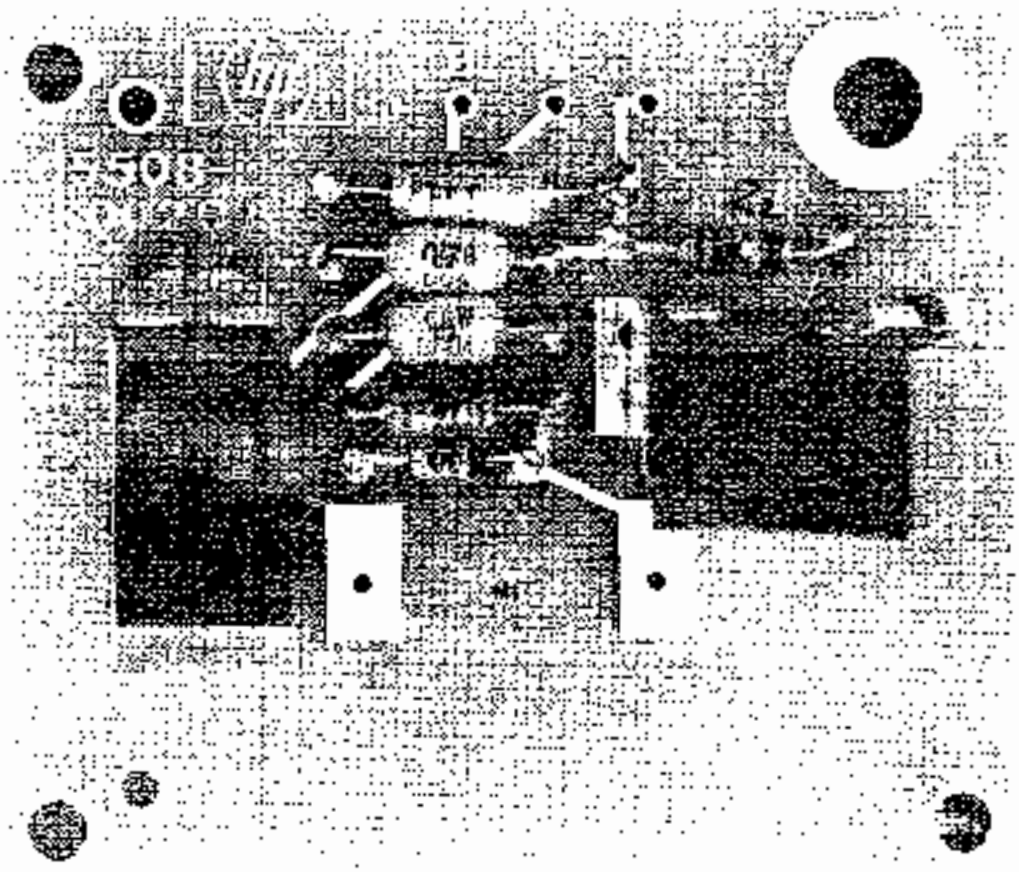



Figure 8-7-32
5508A A5 POWER SUPPLY BOARD 05508-60005

(See Page 8-8-115)

8-B-365. 5508A REMOTE CONTROL UNIT

8-B-366. The Remote Control Unit is supplied with the 5508A and allows the Measurement Display to be reset from a remote location. The RESET switch duplicates the 5508A RESET function. Operation of the Laser Head is unaffected by the reset function. Provision is also made to remotely select a record function to output data to calculators, plotters, and monitors. This is implemented by the RECORD switch and triggers the 5508A. The function is similar to the AUTO RECORD function on the 5508A. A beam strength meter is included in the Remote Control Unit and duplicates the function in the 5508A beam strength meter.



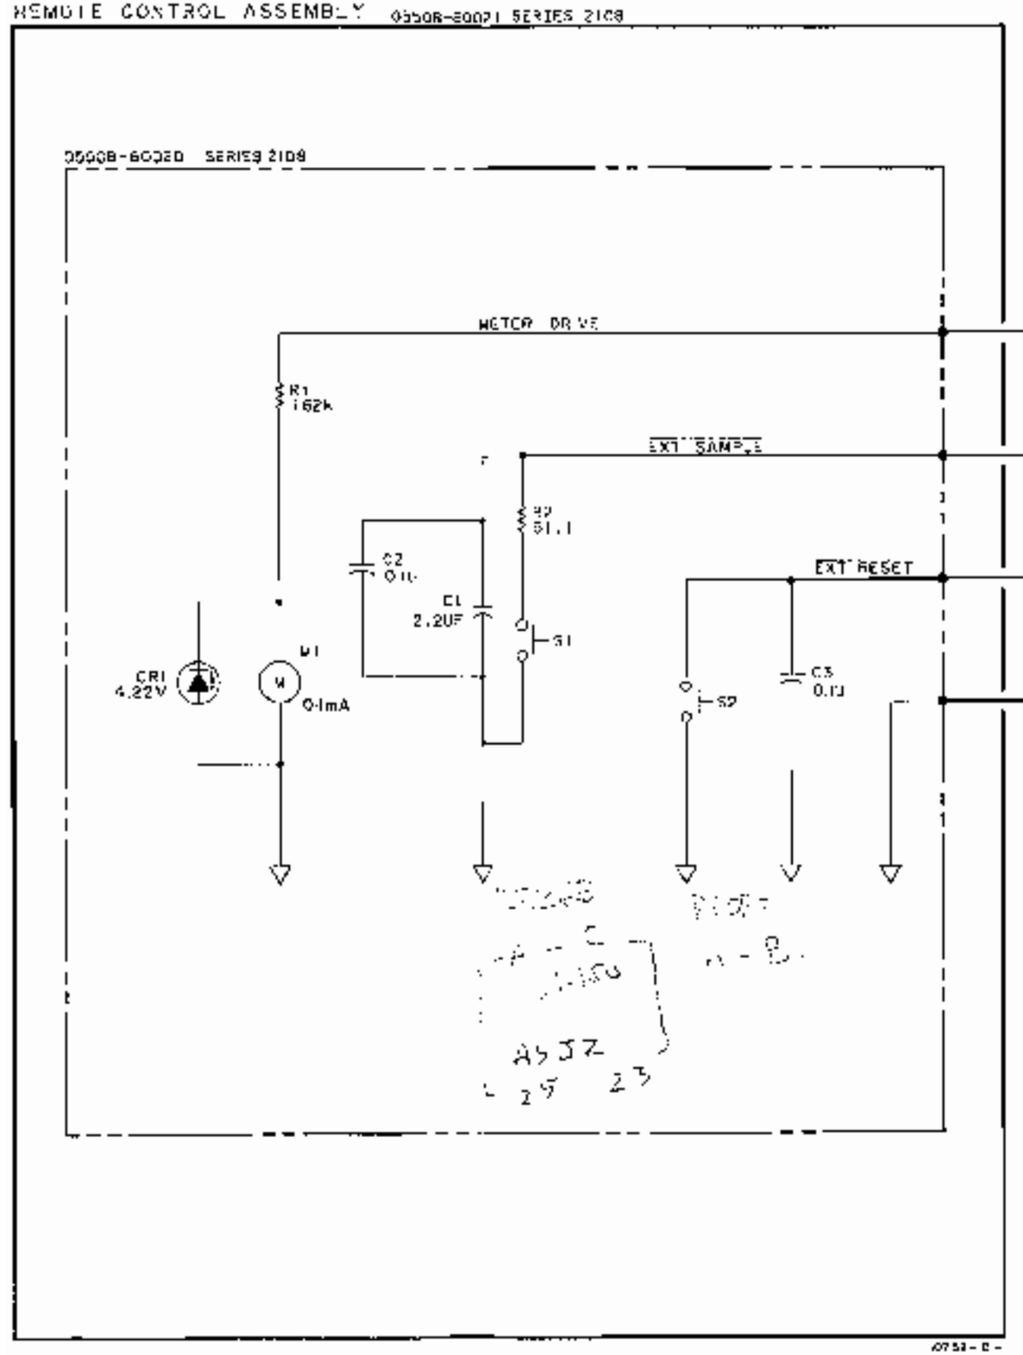

NOTES:

1. REFERENCE DESIGNATIONS WITHIN THIS ASSEMBLY ARE ABBREVIATED. ADD ASSEMBLY NUMBER TO ABBREVIATION FOR COMPLETE DESCRIPTION.
2. UNLESS OTHERWISE INDICATED:
   RESISTANCE IN OHMS;
   CAPACITANCE IN FARADS;
   INDUCTANCE IN HENRIES
3. ASTERISK (*) INDICATES FACTORY SELECTED COMPONENT, AVERAGE VALUE SHOWN.

Reference Designations
C1,3
CR1
R1, 2
S1, 2

Figure 8-8-33. Remote Control Unit 05508-60021

Figure 8-3-31
REMOTE CONTROL UNIT 05500-60021

(See Page 8-B-117)

SECTION VIII-C
5518A LASER HEAD

	Page
Block Diagram Description	8-C-1
Block Diagram	8-C-3
Quick Tuning Checkout Procedure	8-C-11
Trouble Isolation	8-C-11
Testing the Liquid Crystal Switch	8-C-13
High Voltage Section Circuit Theory	8-C-19
High Voltage Section Troubleshooting	8-C-20
A1 Connector Board Circuit Theory	8-C-19
A1 Connector Board Troubleshooting	8-C-19
A2 Measurement Receiver and Turret Switch Circuit Theory	8-C-21
A2 Measurement Receiver Troubleshooting	8-C-22
A3 Controller/Reference Board Circuit Theory	8-C-24
A3 Controller/Reference Board Troubleshooting	8-C-27
A4 Sampler Board Circuit Theory	8-C-27
A1 Connector Board Schematic Diagram	8-C-37
A2 Measurement Receiver Schematic Diagram	8-C-39
A3 Controller/Reference Board and A4 Sampler Schematic Diagram	8-C-41

SECTION VIII-C
5518A LASER HEAD

8-C-1. 5518A LASER HEAD BLOCK DIAGRAM DESCRIPTION

8-C-2. The major structures of the 5518A (see Figure 8-C-1, 5518A Block Diagram) are the 5518A control electronics, the laser assembly, the sampler assembly, the turret optics, the measurement receiver, and the reference receiver. The 5518A requires only power input from the 5508A, all control signals are internally generated. The 5518A output signal called Reference Frequency is enabled when the laser tuning is stablized. Laser tuning is stabilized by the control electronics. The output signals, Measurement Frequency and Beam Strength, require proper alignment of measurement optics in addition to stable tuning.

8-C-3. The control electronics control the tuning of the laser assembly in order to provide an accurate laser wavelength for making measurements. When properly tuned, the laser assembly outputs two laser frequencies. One laser frequency, F2, is polarized parallel to the bottom of the 5518A chassis. The other laser frequency, F1, is polarized perpendicular to F2. The wavelengths of the two laser frequencies differ only slightly because the difference frequency between F2 and F1 is small compared to their optical frequency.

8-C-4. Before the laser light is emitted from the 5518A, a portion of it is sampled by the sampler assembly. Most of this sample is fed into the reference receiver and the remainder of the sample is used to control laser tuning.

8-C-5. The reference receiver generates the TTL level, square wave signal, Reference Frequency, by mixing the two laser frequencies. The reference frequency, 1.5 to 2.0 MHz, is the difference in frequency between the two laser frequencies. The measurement receiver generates the TTL square wave signal, Measurement Frequency, by mixing the two laser frequencies after they have returned from the measurement optics. The measurement and reference frequency signals are transmitted to the 5508A in differential form.

8-C-6. During a measurement, the laser beam is directed through measurement optics and then returned to the measurement receiver. If the optics remain stationary, the measurement frequency and the reference frequency are the same. Relative motion between the measurement optics results in a change of the measurement frequency. The 5508A compares the measurement frequency to the reference frequency and calculates the displacement of the optics.

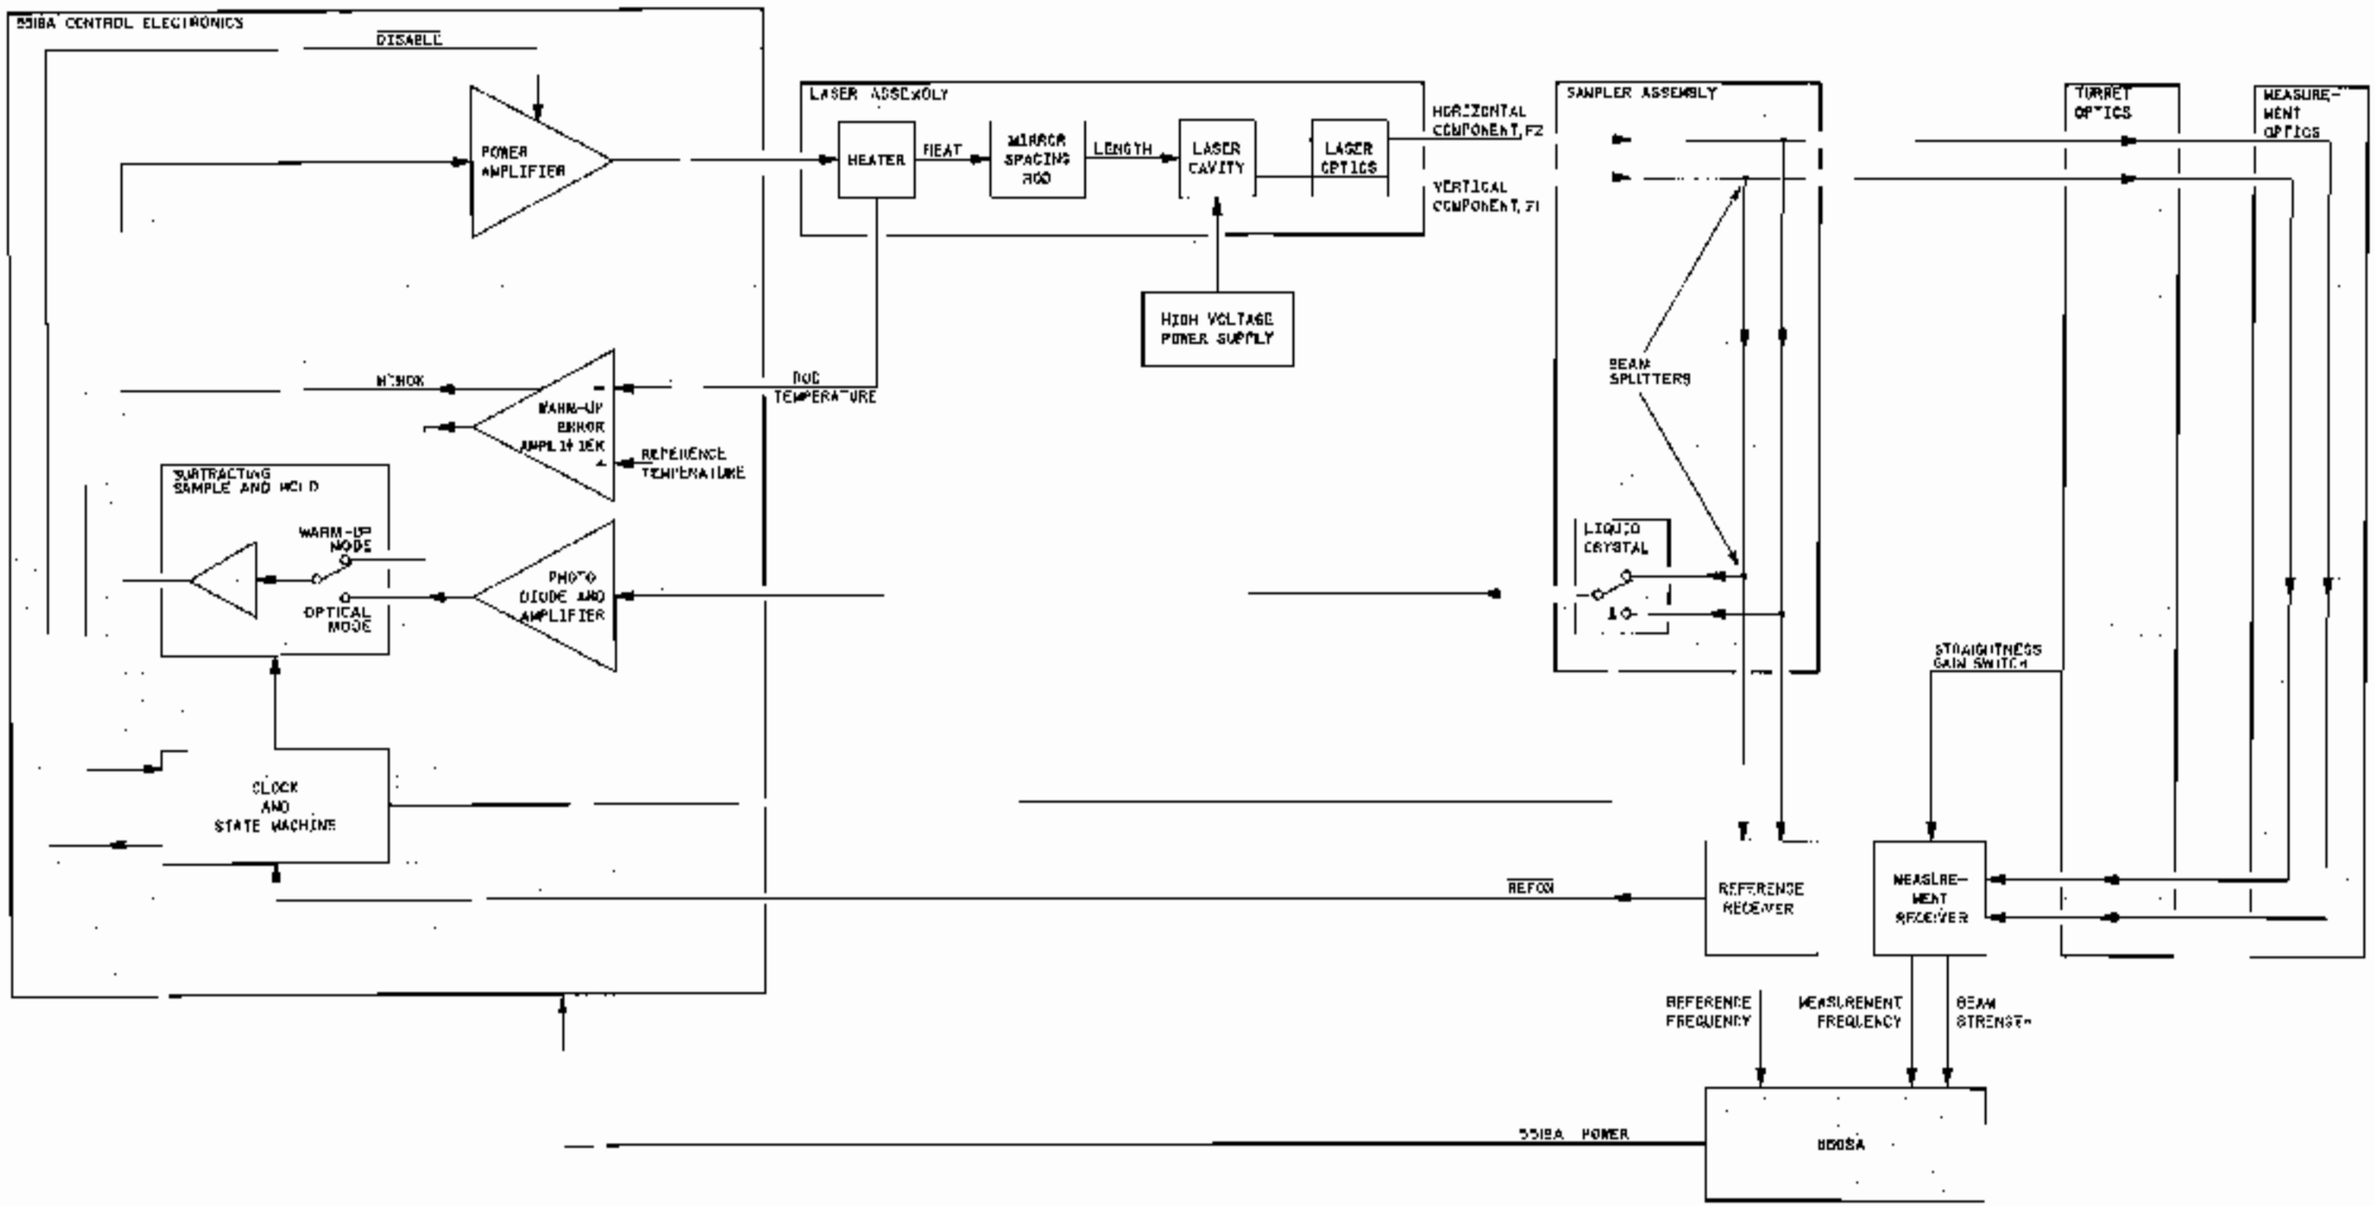


Figure 8-C-1 5518A Laser Head Block Diagram

8-C-7. Laser Tuning

8-C-8. The laser assembly will produce stable frequency components only when the laser assembly cavity length is properly controlled. The cavity length is determined by the separation of two mirrors that are held against the ends of a glass rod. The 5518A uses a thermal tuning technique to control the cavity length. Cavity length increases when the rod is heated and decreases when it cools.

8-C-9. A heater coil wrapped around the glass rod is used to increase the cavity length. Rod cooling by conduction to surrounding material is used to decrease cavity length. To properly control the rod temperature, the rate at which it cools should approximate the rate at which it is heated. The 5518A raises the cooling rate by maintaining the rod at an elevated temperature.

8-C-10. Warm-up Mode Tuning. One of two feedback loops used to control the laser assembly establishes the initial operating temperature of the glass rod. When power is first supplied to the 5518A, the state machine (see Figure 8-C-2 State Diagram for State Machine), resets to its warm-up mode. In the warm-up mode, the state machine controls the subtracting sample and hold so that the feedback is as shown in Figure 8-C-3, Feedback Loop During Warm-up Mode. The warm-up error amplifier produces an error signal that is proportional to the difference between the rod temperature and a reference temperature. The warm-up mode feedback loop controls the rod temperature until it equals the reference temperature. The reference temperature is adjustable and factory set to be higher than the hottest expected ambient temperature.

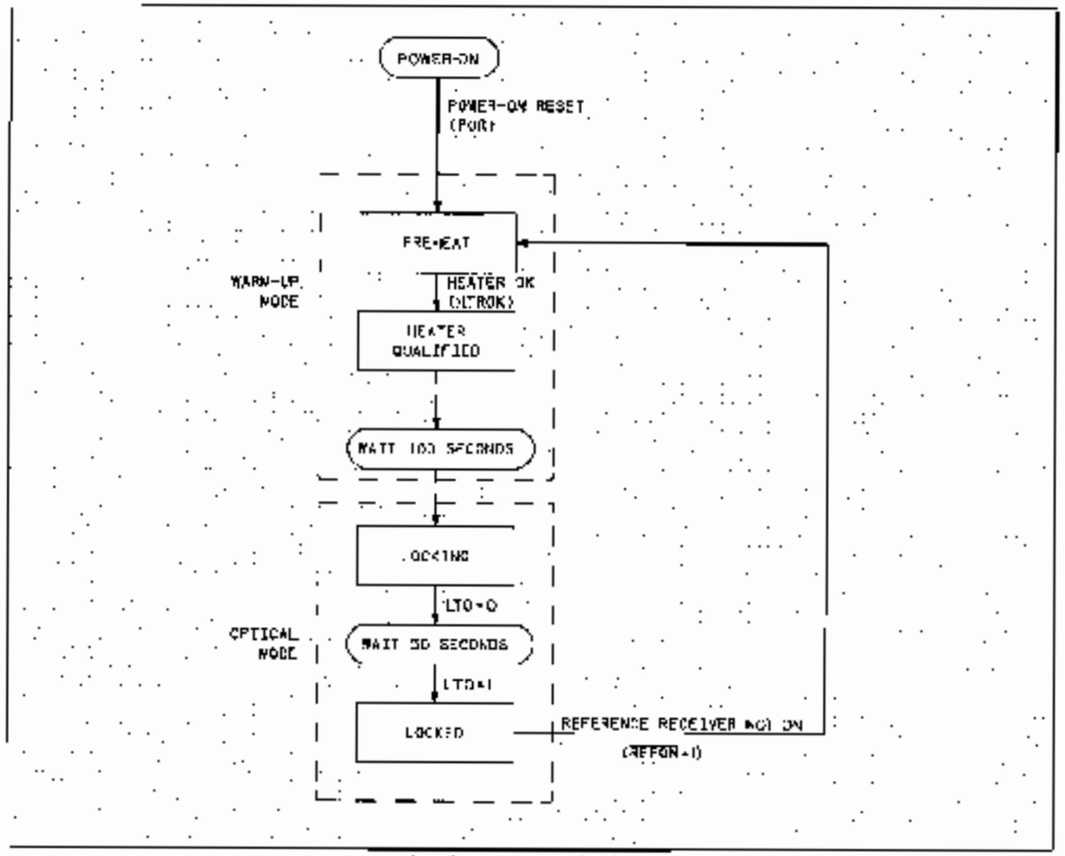


Figure 8-C-2. State Diagram for State Machine

Figure 8-C-1
5518A LASER HEAD BLOCK DIAGRAM

(See Page 8-C-3)

8-C-7. Laser Tuning

8-C-8. The laser assembly will produce stable frequency components only when the laser assembly cavity length is properly controlled. The cavity length is determined by the separation of two mirrors that are held against the ends of a glass rod. The 5518A uses a thermal tuning technique to control the cavity length. Cavity length increases when the rod is heated and decreases when it cools.

8-C-9. A heater coil wrapped around the glass rod is used to increase the cavity length. Rod cooling by conduction to surrounding material is used to decrease cavity length. To properly control the rod temperature, the rate at which it cools should approximate the rate at which it is heated. The 5518A raises the cooling rate by maintaining the rod at an elevated temperature.

8-C-10. Warm-up Mode Tuning. One of two feedback loops used to control the laser assembly establishes the initial operating temperature of the glass rod. When power is first supplied to the 5518A, the state machine [see Figure 8-C-2 State Diagram for State Machine], resets to its warm-up mode. In the warm up mode, the state machine controls the subtracting sample and hold so that the feedback is as shown in Figure 8-C-3, Feedback Loop During Warm-up Mode. The warm-up error amplifier produces an error signal that is proportional to the difference between the rod temperature and a reference temperature. The warm up mode feedback loop controls the rod temperature until it equals the reference temperature. The reference temperature is adjustable and factory set to be higher than the hottest expected ambient temperature

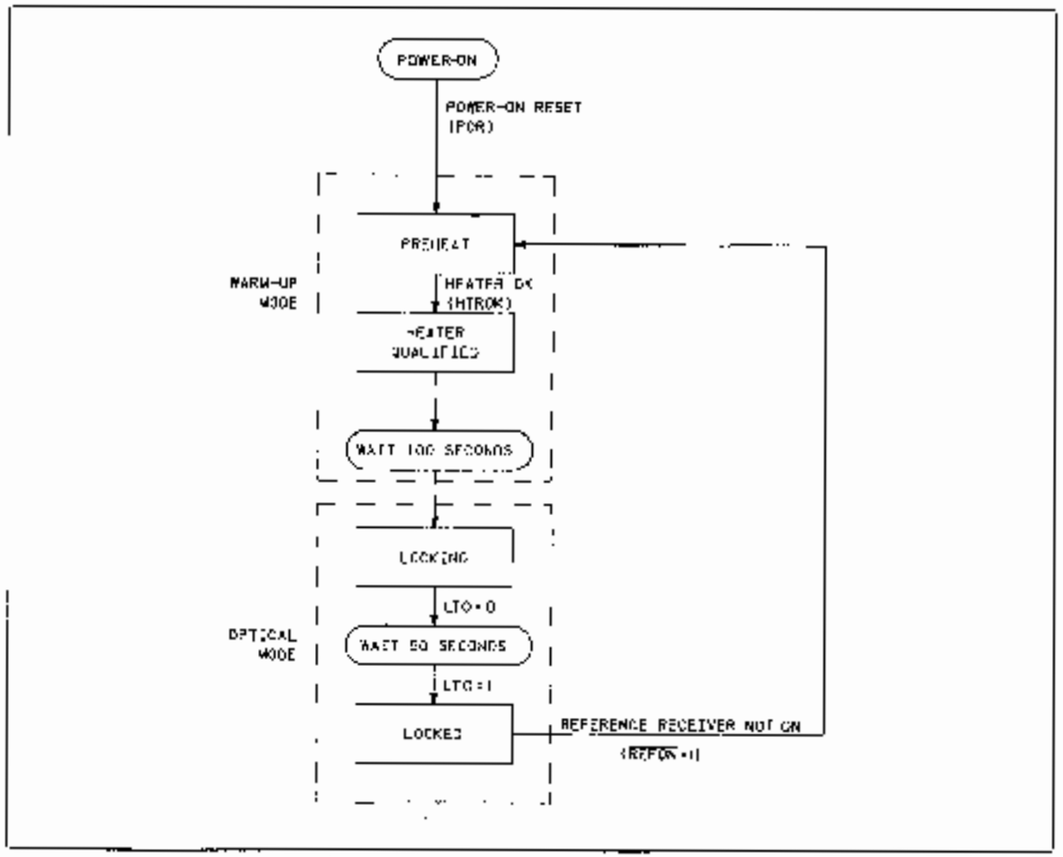


Figure 8-C-2. State Diagram for State Machine

Figure 8-C-1
5518A LASER HEAD BLOCK DIAGRAM

See Page 8-C-3]

8-C-11. The rod heater coil is used both to heat the rod and to sense its temperature. For 2.56 seconds (nominal) out of every 25.6 seconds (nominal) of the warm up cycle (see Figure 8-C-4, Warm-up Mode Timing Diagram), the state machine disables the power amplifier and the heater allowing the heater coil to stabilize to the rod temperature. The heater coil and a resistor in the power amplifier form a voltage divider. As the heater resistance increases with rising temperature, the divider voltage increases. The difference between this voltage and the reference voltage is amplified to provide the warm-up mode error signal.

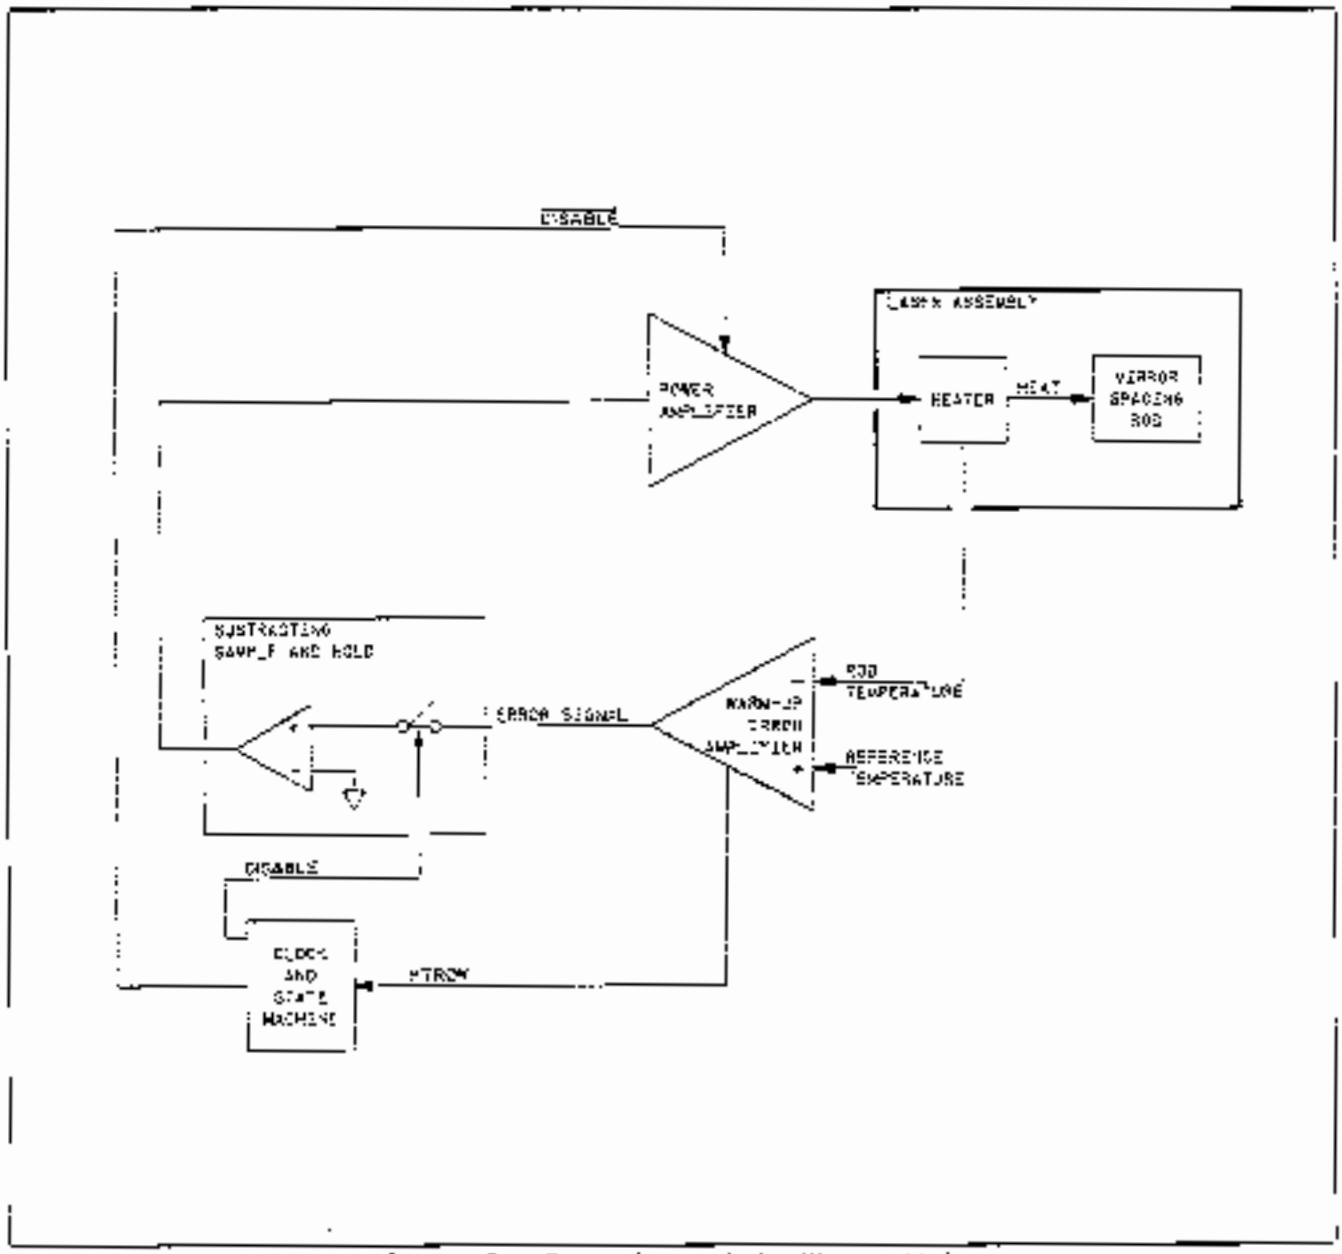


Figure 8-C-3 Feedback Loop during Warmup Mode

8-C-12. At the end of the 2.56 second disable period, the heater coil temperature has settled to the rod temperature. The error signal is sampled and held and the power amplifier is enabled. During the rest of the 25.6 second period, the power amplifier, re-enabled and under control of the sampled error signal, drives the heater.

8-C-13. When the error signal gets close to zero, the warm-up error amplifier sends a digital signal called Heater O.K. (HTROK) to the state machine. HTROK is sampled by the state machine whenever the error signal is sampled. After HTROK is sampled true, the state machine waits 100 seconds before switching to optical mode.

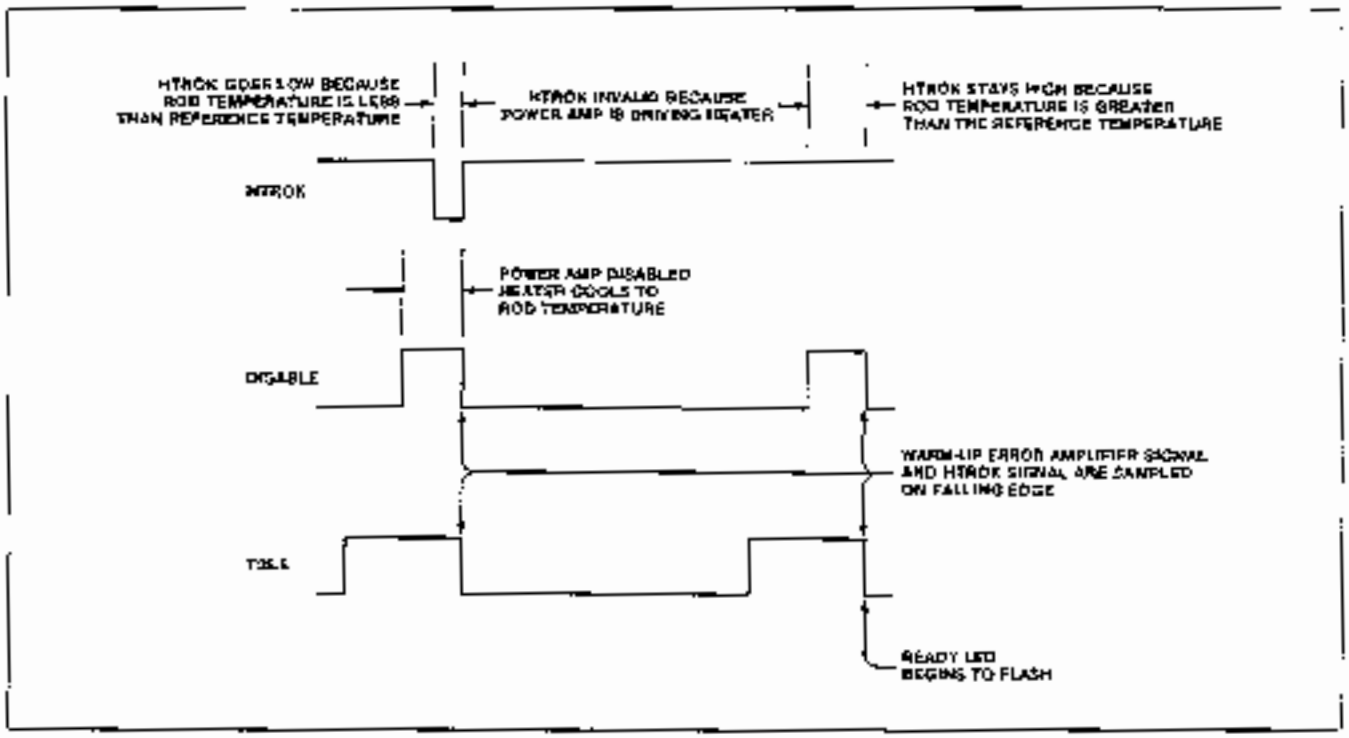


Figure 8-C-4. Warm-up Mode Timing Diagram

8-C-14. Optical Mode Tuning. In optical mode, the state machine switches the subtracting sample and hold inputs from warm-up feedback to optical feedback (see Figure 8-C-5 Feedback Loop during Optical Mode). The optical mode feedback controls the laser cavity length by measuring and comparing the power of the two laser frequency components. Cavity length is controlled such that the difference in power is zero. When the difference is maintained at zero, the desired characteristics of the laser beam are established and a measurement can be performed.

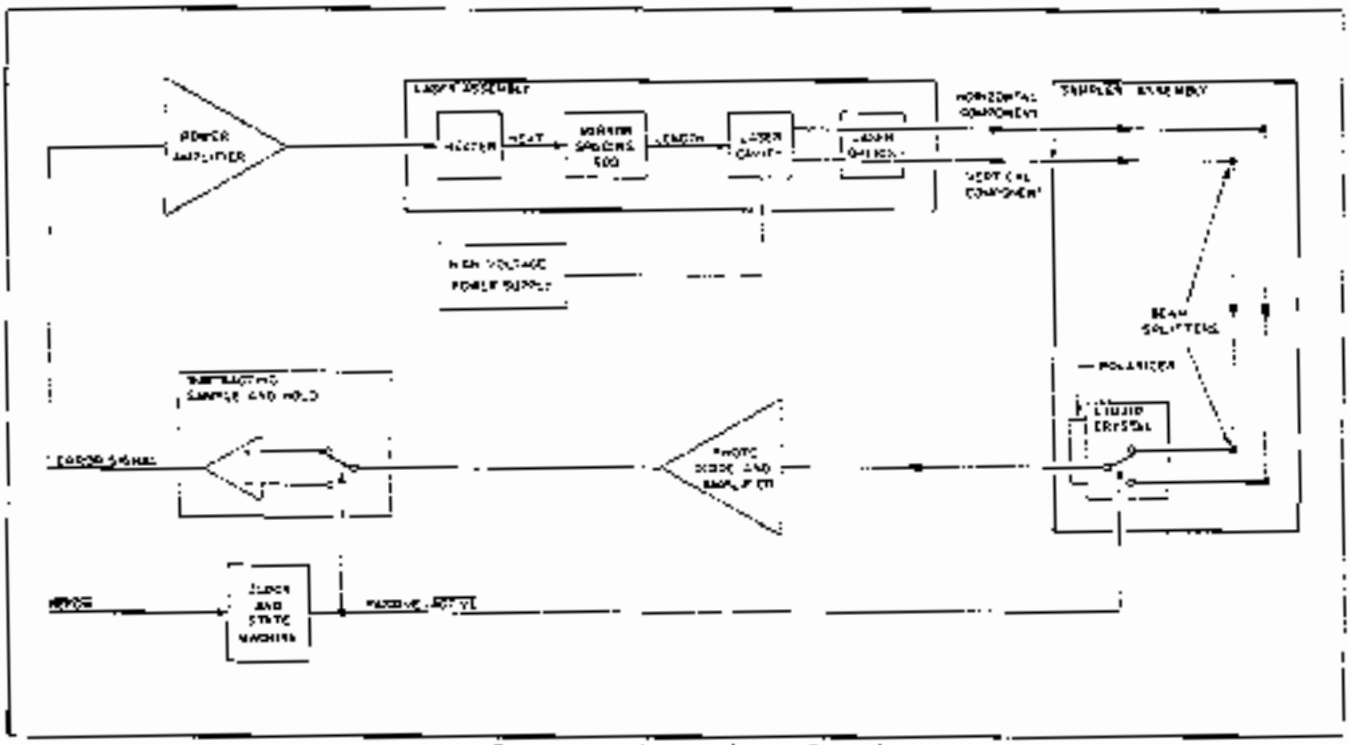


Figure 8-C-5. Servo Loop during Optical Mode

8-C-15 The power in each laser frequency component is measured by sampling some of the laser light with a pair of non-polarizing beam splitters (see Figure 8-C-6, A7 Sampler Assembly, Exploded View) and passing one of the laser frequency components, then the other, through an optical switch and onto a photodiode. The beam splitters are part of the A7 Sampler Assembly and the photodiode is mounted on the A4 Sampler Board. A liquid crystal and a polarizer comprise the optical switch.

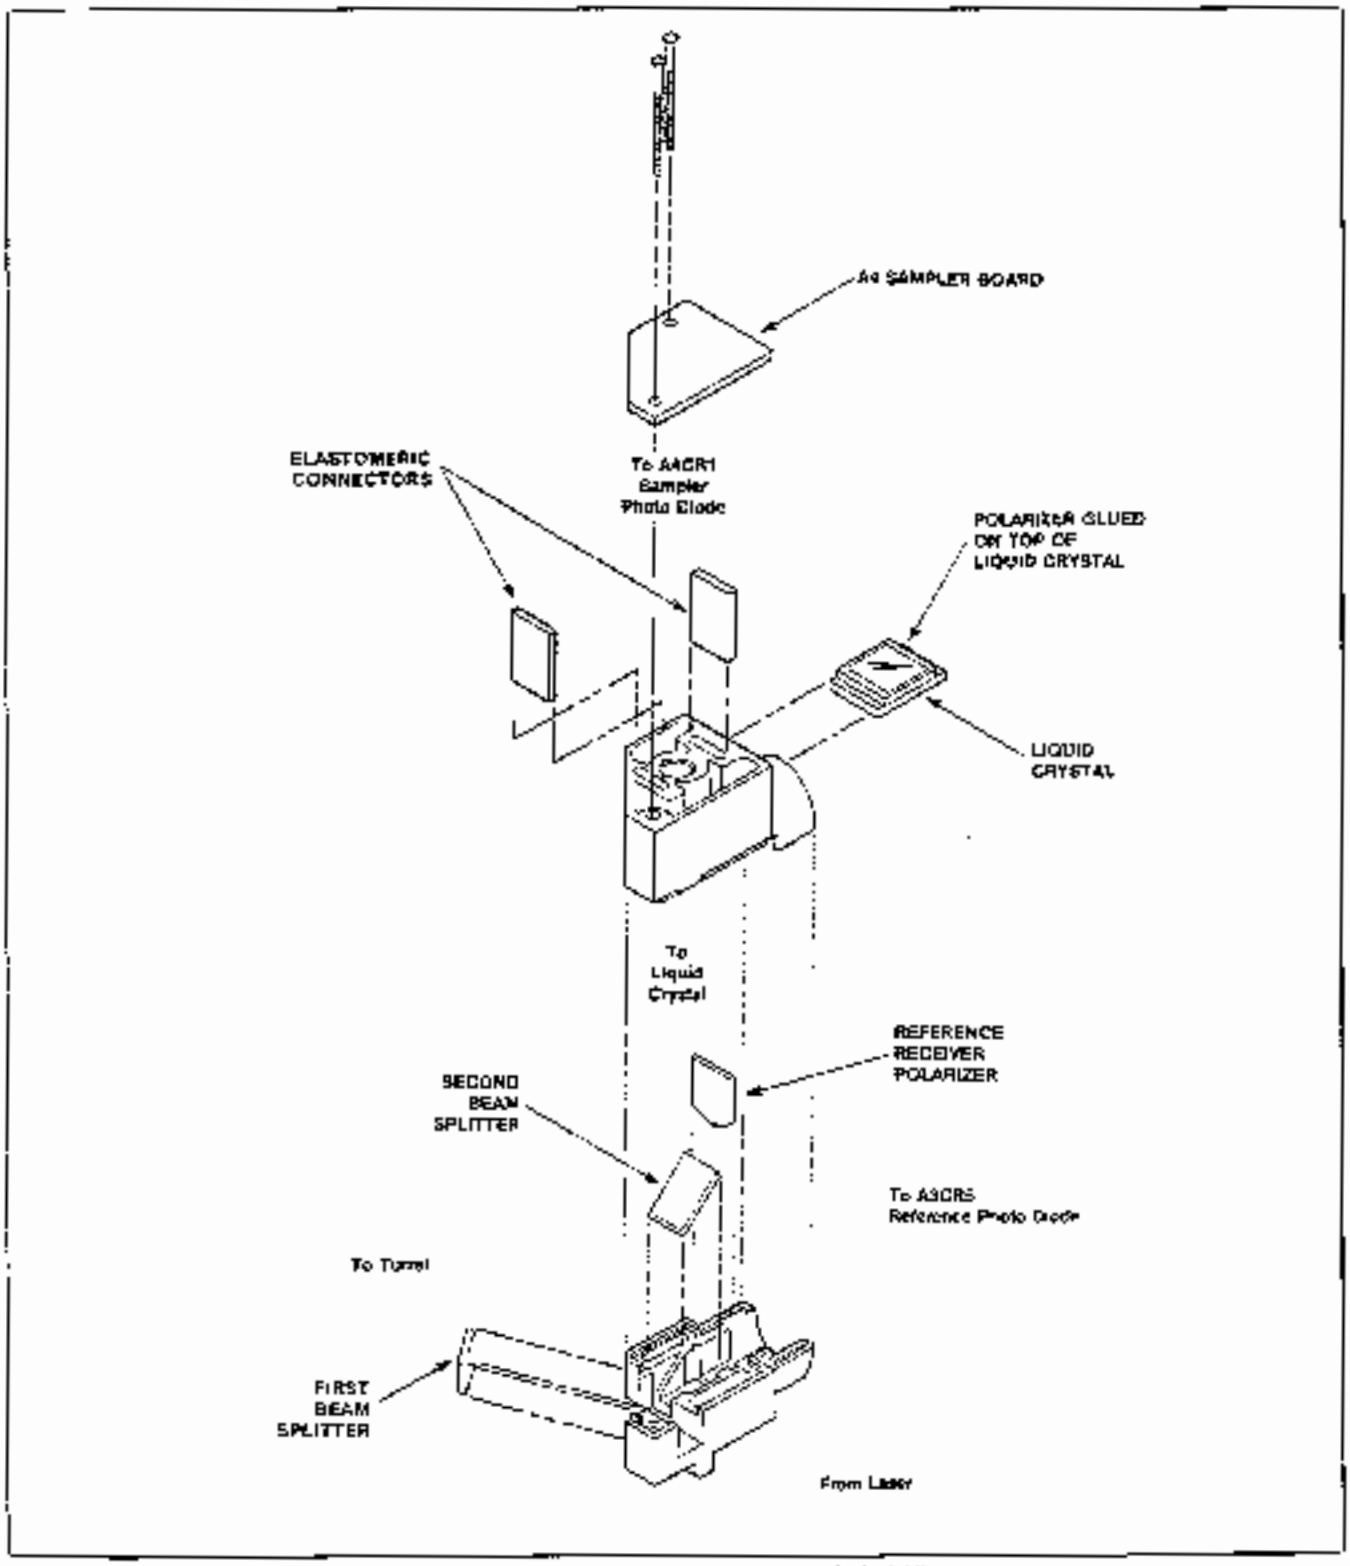


Figure 8-C-6. Sampler Assembly, Exploded View

8-C-16. When the state machine excites the liquid crystal into its active state (see Figure 8-C-7, Optical Mode Timing Diagram), the laser beam passes through the liquid crystal unaltered. The polarizer blocks the horizontal component and passes the vertical component onto the photodiode. The photodiode current is proportional to the power in the vertical component and is amplified and converted to a voltage by the photodiode amplifier. The voltage is held on the positive input of the subtracting sample and hold.

8-C-17. When the state machine places the liquid crystal in its passive state, the liquid crystal rotates the polarization of both components by 90 degrees. Now, the polarizer blocks the vertical component and passes the horizontal component. The voltage out of the photodiode amplifier is proportional to the horizontal component and is held by the negative input of the subtracting sample and hold. The error signal output of the subtracting sample and hold is proportional to any difference in power between the two components.

8-C-18. After the optical mode tuning has stabilized, LTO is held true. LTO true enables the reference frequency output. Proper laser tuning and reference receiver operation is indicated by $\overline{\text{REFON}}$ true. $\overline{\text{REFON}}$ false will cause the state machine to reset to the warm-up mode.

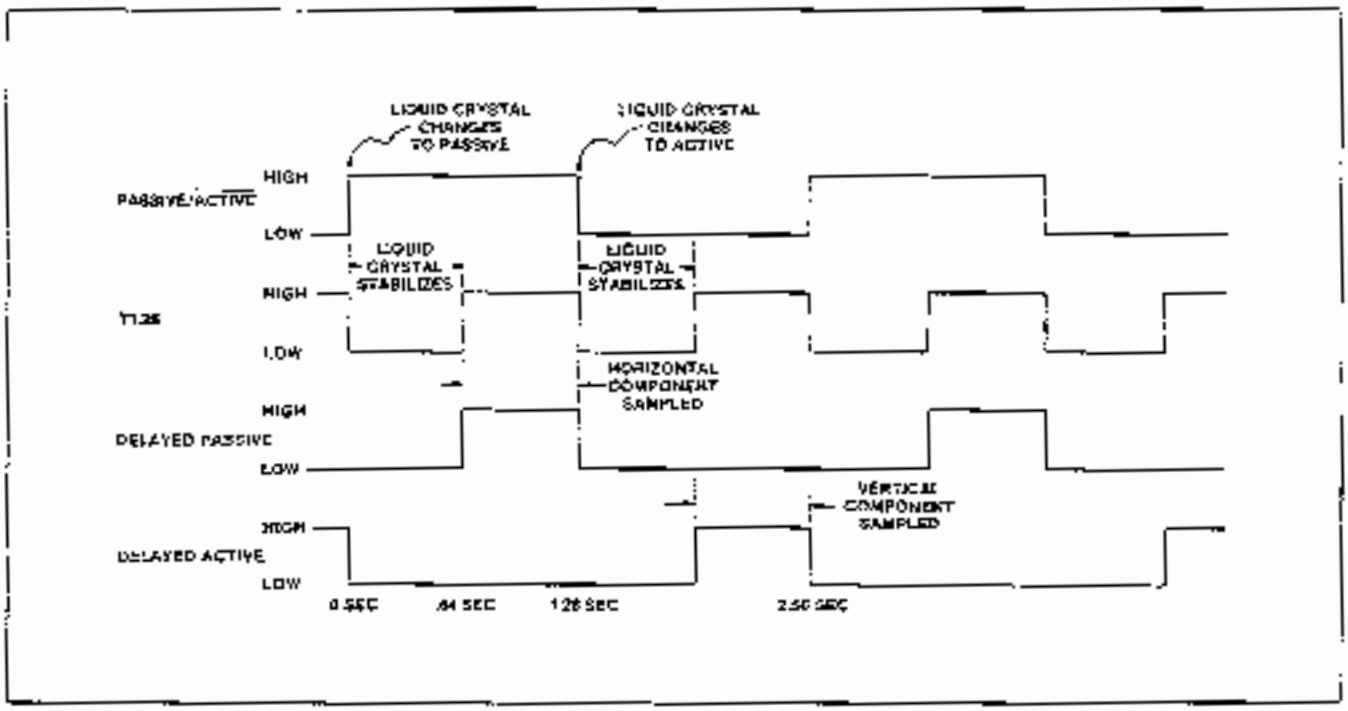


Figure 8-C-7. Optical Mode Timing Diagram

8-C-19. Laser Assembly Optics

8-C-20. The laser assembly optics ensure correct laser frequency polarizations and also collimate the laser beam. When the laser beam leaves the laser assembly, the horizontal component is polarized parallel to the bottom of the 5518A. The vertical component is polarized perpendicular to the horizontal component. The laser beam is collimated to minimize variations in beam diameter as it travels away from the laser head.

8-C-21. Reference Receiver

8-C-22. The beam splitters of the A7 Sampler Assembly direct some of the laser light through another polarizer and onto another photodiode. Because of the polarizer orientation, the beam power after this polarizer varies sinusoidally at the difference frequency of the two laser frequency components. The beam power at the difference frequency is converted to current by the photodiode and amplified to TTL levels. The frequency of the TTL output is the reference frequency. The reference receiver electronics also provide a digital signal called Reference Receiver On (REFON) that tells the state machine the laser is working properly.

8-C-23. Measurement Frequency Receiver

8-C-24. During a measurement, the vertical and horizontal components pass through the turret and measurement optics and return to the measurement receiver. The difference between their frequencies will change whenever the measurement optics are moving. The measurement frequency is detected and amplified using the same technique as described for the reference receiver. The measurement receiver is composed of a chassis mounted polarizer and the A2 Measurement Receiver Board

8-C-25. The measurement receiver electronics also produce a current signal, BEAM STRENGTH, that is proportional to the optical power at the measurement frequency. During straightness measurements, a switch in the turret assembly increases the gain of the measurement receiver to compensate for losses in the straightness mount.

8-C-26. Turret Optics

8-C-27. The major component of the turret assembly is the straightness mount. When the straightness mount is set to STRAIGHT, the laser beam exits from and returns to the 5518A through the exit aperture (see Straightness Mount, Side View, Figure 8-C-8). A beam splitter in the straightness mount transmits approximately 30% of the exit beam to the measurement optics and reflects the return beam to a mirror. The mirror reflects this beam to the measurement mirror. A tab on the straightness mount pushes the lever on the straightness switch to close the switch when the straightness mount is set to STRAIGHT. The switch increases the gain of the measurement receiver electronics to compensate for signal reduction due to losses in the straightness mount

8-C-28. When the straightness mount is set to OTHER, it places nothing in the exit or return aperture. The laser beam exits through the exit aperture and returns through the return aperture.

8-C-29. The exit aperture shutter of the turret assembly has three positions. The first blocks the laser beam entirely, the second allows a small diameter laser beam to exit for optical alignment purposes; and the third passes the entire laser beam. The return beam shutter has two positions. The first provides a target for optical alignment and the second permits the beam to pass to the measurement receiver

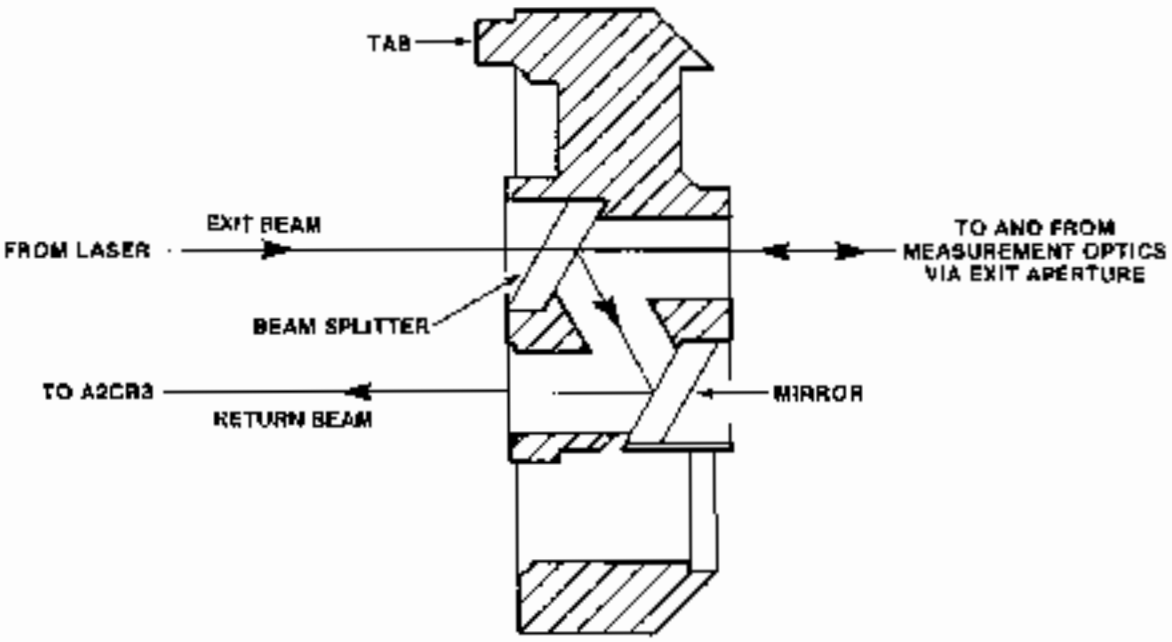


Figure 8-C-8. Straightness Mount, Side View

8-C-30. ASSEMBLY/SCHEMATIC LOCATIONS OF 5518A BLOCK DIAGRAM ELEMENTS

Element	5518A Assembly
Control Electronics	A3 and A4
Power Amplifier	A3
Warm-up Error Amplifier	A3
Subtracting Sample and Hold	A3
Photodiode and Amplifier	A4 and A3
Clock and State Machine	A3
Laser Assembly	A5
Sampler Assembly	A7
Reference Receiver	A3 and A7
Measurement Receiver	A2 and Chassis Mounted Polarizer
Turret Optics	Turret Assembly

8-C-31. 5518A INDICATORS

LASER ON

An amber indicator installed to alert the operator that the 5518A Laser Head is activated and emitting a laser beam. Electrically, this indicator monitors the +15 Volt line supplied by the 5508A which is used by the 5518A to generate its operating power.

SIGNAL

An amber indicator that indicates when a sufficient laser beam measurement signal is returned to the measurement receiver assembly within the 5518A.

READY

The READY indicator is extinguished when the 5518A is in the warm-up mode. It flashes on and off when the 5518A begins the optical mode and is fully on when the 5518A is ready for use.

8-C-32. BUILT-IN TEST AIDS

5-C-33. SeverAl jumpers are included to aid in testing. The LIQUID CRYSTAL jumper JMP3 places the liquid crystal in either the active or passive state. JMP7, HEATER, disables the power amplifier. JMP5, PHOTODIODE, substitutes a known current for the photodiode and is used for testing the photodiode amplifier and the subtracting sample and hold circuits. JMP6, POWER AMP, supplies ±100 mV to U13 pin 3 to test the power amplifier. The $\overline{\text{REFON}}$ jumper, JMP2, sets the $\overline{\text{REFON}}$ signal so that U17 cannot influence the state machine. The HTROK jumper, JMP4, sets the HTROK signal so that U15 cannot influence the state machine. If JMP4 is not in NORM, the clock runs at about 75 kHz. The RESET jumper, JMP1, places the state machine in a repetitive mode to allow signature measurements.

NOTE

There are two "LO" positions for the REFON jumper, and two "UP" positions for the POWER ON jumper. For proper placement, refer to the schematic for A3 when using these jumpers.

Paragraph 8-C-34 and Table 8-C-1 have been deleted.

8-C-35. TROUBLE ISOLATION

8-C-36. Quick Tuning Checkout Procedure

8-C-37. The following procedure provides a means to quickly check the entire optical tuning subsystem of the laser. Before performing the procedure, study the information in Paragraphs 8-C-7 through 8-C-18 to gain the necessary background information to aid in interpreting the test results. The following figure illustrates the effects of mirror spacing on F1 and F2.


8-C-38. The procedure consists of monitoring test point TP16 on A3 with an oscilloscope to determine the relative amplitudes of F1 and F2 with the heater turned off. If the sampler, photodiode, and amplifier are functioning properly and the heater is turned off, the traces on the oscilloscope will show switching to different levels as it monitors the sampling of F1 and F2. With continued observation of the trace switching, these levels which correspond to F1 and F2 will change amplitudes since the tuning is uncontrolled.

8-C-39. To perform the quick isolation procedure, proceed as follows:


a. Observe the READY LED on the rear panel of the 5518A. If after approximately 2 minutes from power-up, the LED begins flashing, you can assume that the clock, dividers, state machine, warm-up and power amplifier stages are working properly.

b. Remove the 5518A top cover.


c. Connect a dc coupled oscilloscope to TP16 on A3 as shown below. Also see Figure 8-C-14 for test point locations.

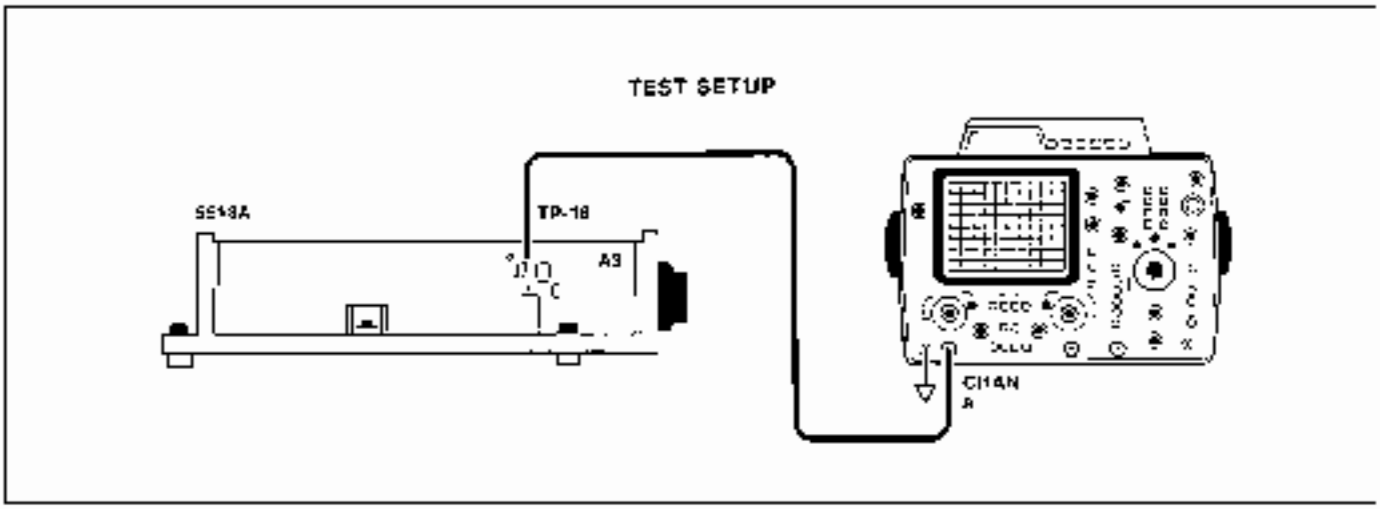


LASER TUBE TUNING CHARACTERISTICS

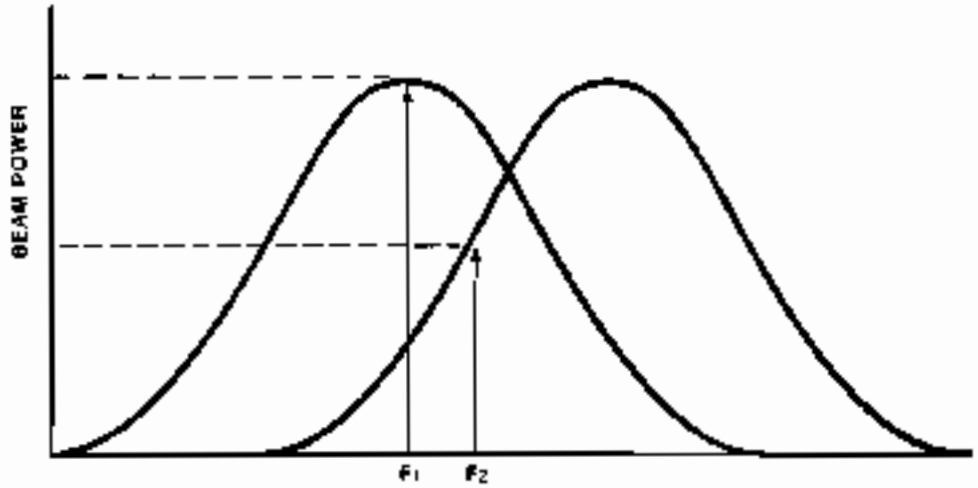

a) SPACING ROD TOO LONG

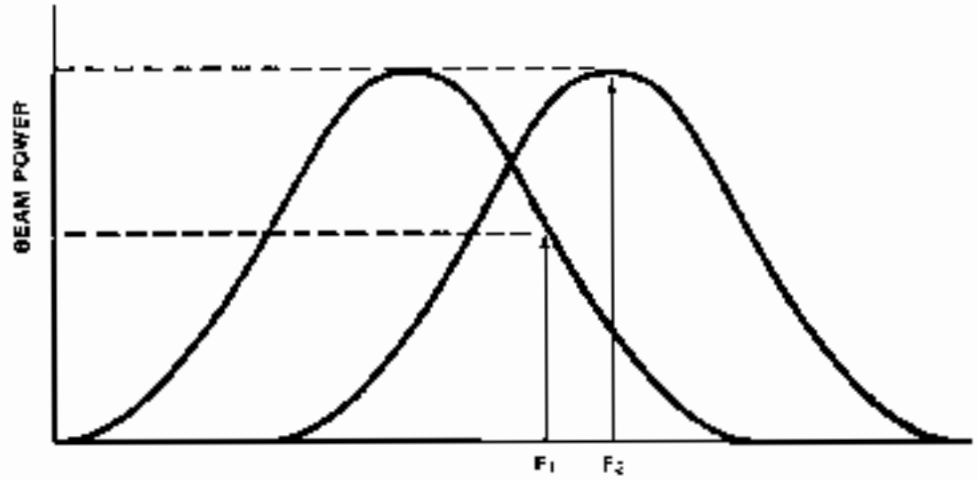

b) SPACING ROD TOO SHORT

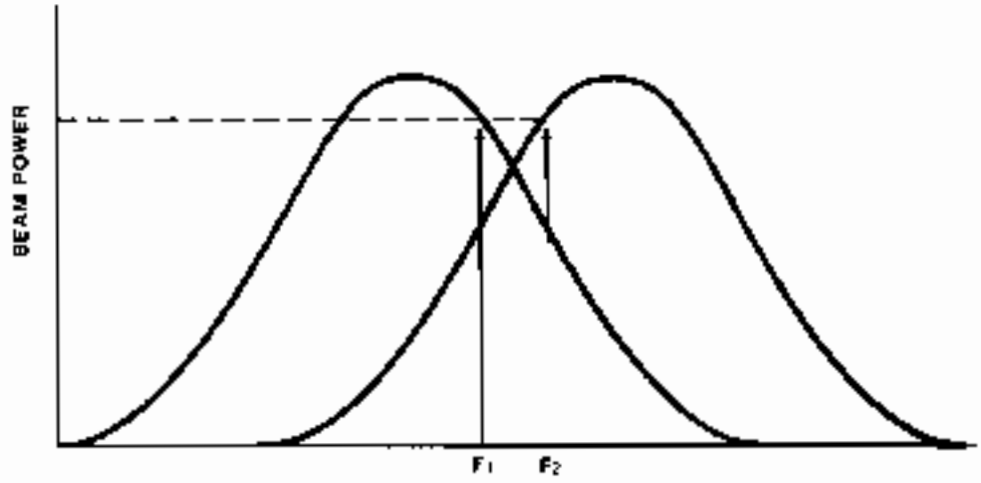

c) RESONANCE


d. On A3, change the small blue HEATER jumper JMP7 from NORM to OFF.

e. Set oscilloscope controls as follows:

1. Timebase to 2 ms/div or faster.
2. Trigger to normal. Adjust the triggering for minimum flickering of the trace
3. Vertical attenuator to 0.05 V/div for X10 probe use or to 0.5 V/div when using a direct probe. Set coupling to dc.

f. To simulate a failure to observe how the waveforms at TP16 behave, move JMP3 LIQUID CRYSTAL jumper to ACT. Note that the scope trace wanders up and down in a very smooth continuous manner with varying speed. If this occurs in step b, the liquid switch or A3U11 is defective. Return JMP3 LIQUID CRYSTAL jumper to original position.

g. If the sampler, photodiode, and amplifier are working properly, the oscilloscope display will show the trace switch between two distinct levels. See Figure below. With continued observation of the trace switching these levels which correspond to f1 and f2 will change amplitudes since the tuning is uncontrolled.

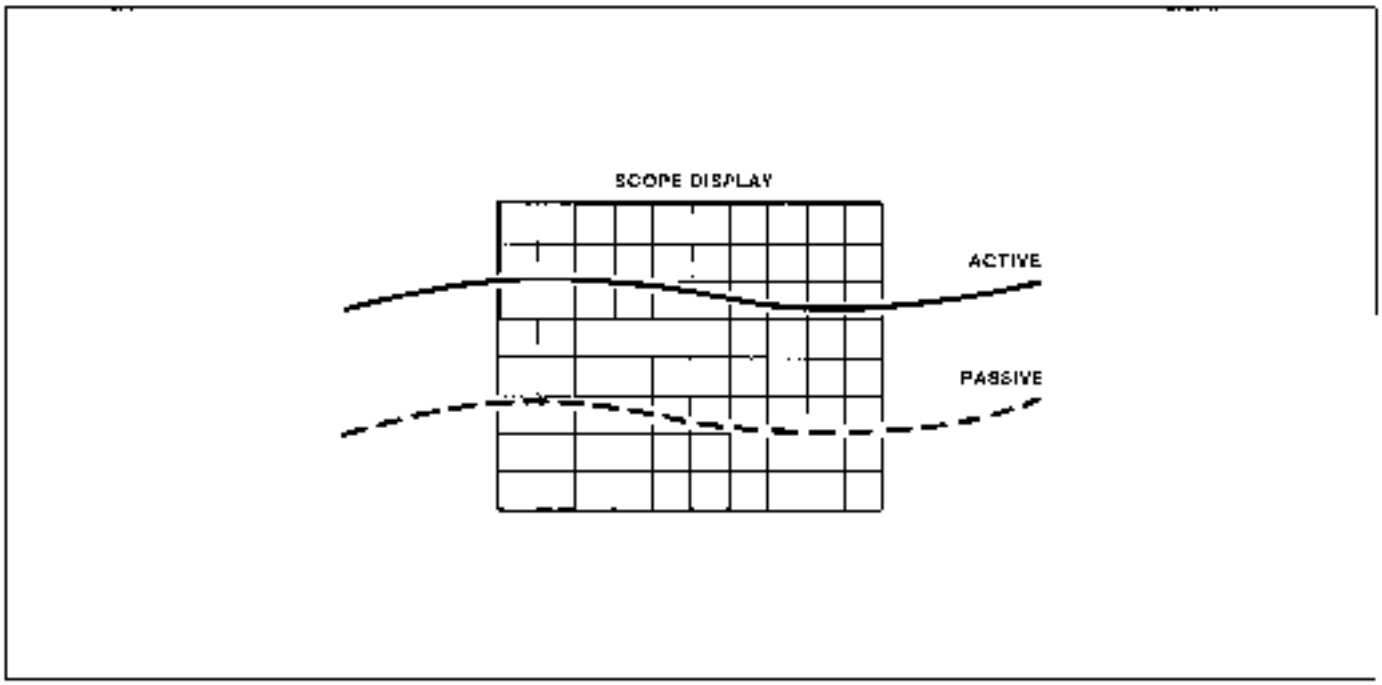

h. Disconnect the test equipment and set HEATER jumper JMP7 to NORM. Replace the 5518A cover

8-C-40. TESTING THE LIQUID CRYSTAL SWITCH

8-C-41 The following material and test equipment is required for the test:


a. A white piece of cardboard.

b. 50 Hz square wave generator (TTL-level).


c. A sheet of polarizer material: HP Part Number 1000-0616

5-C-42. To test the liquid crystal, proceed as follows:

a. Remove the liquid crystal from the sampler assembly as shown below.

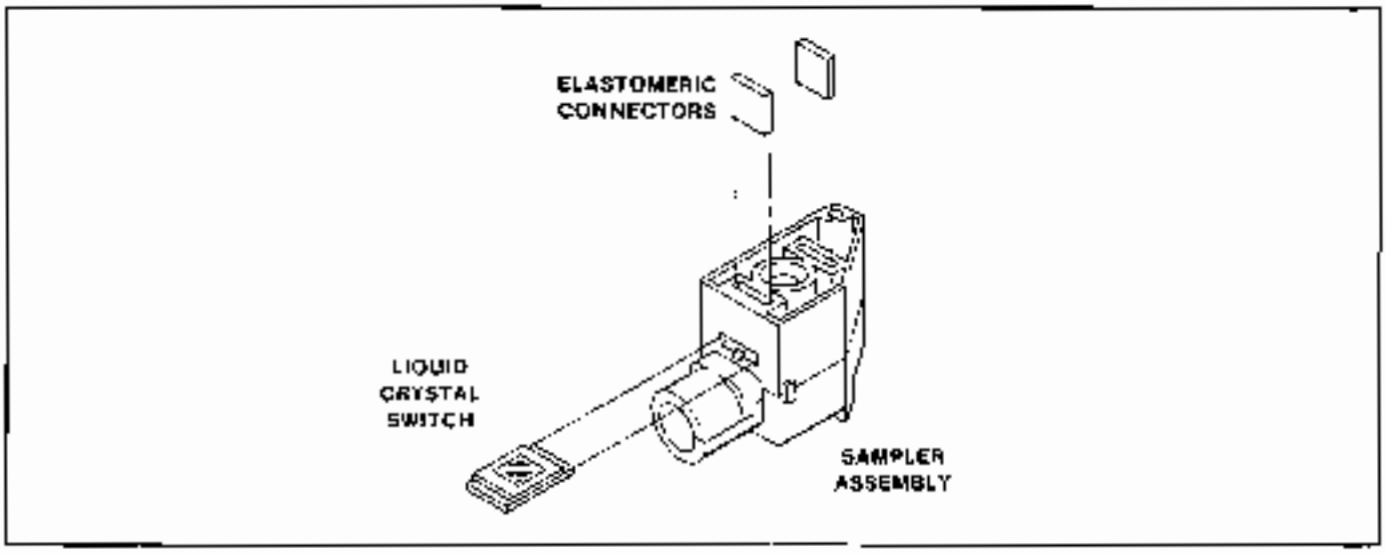

b. Place the liquid crystal in the test setup shown below

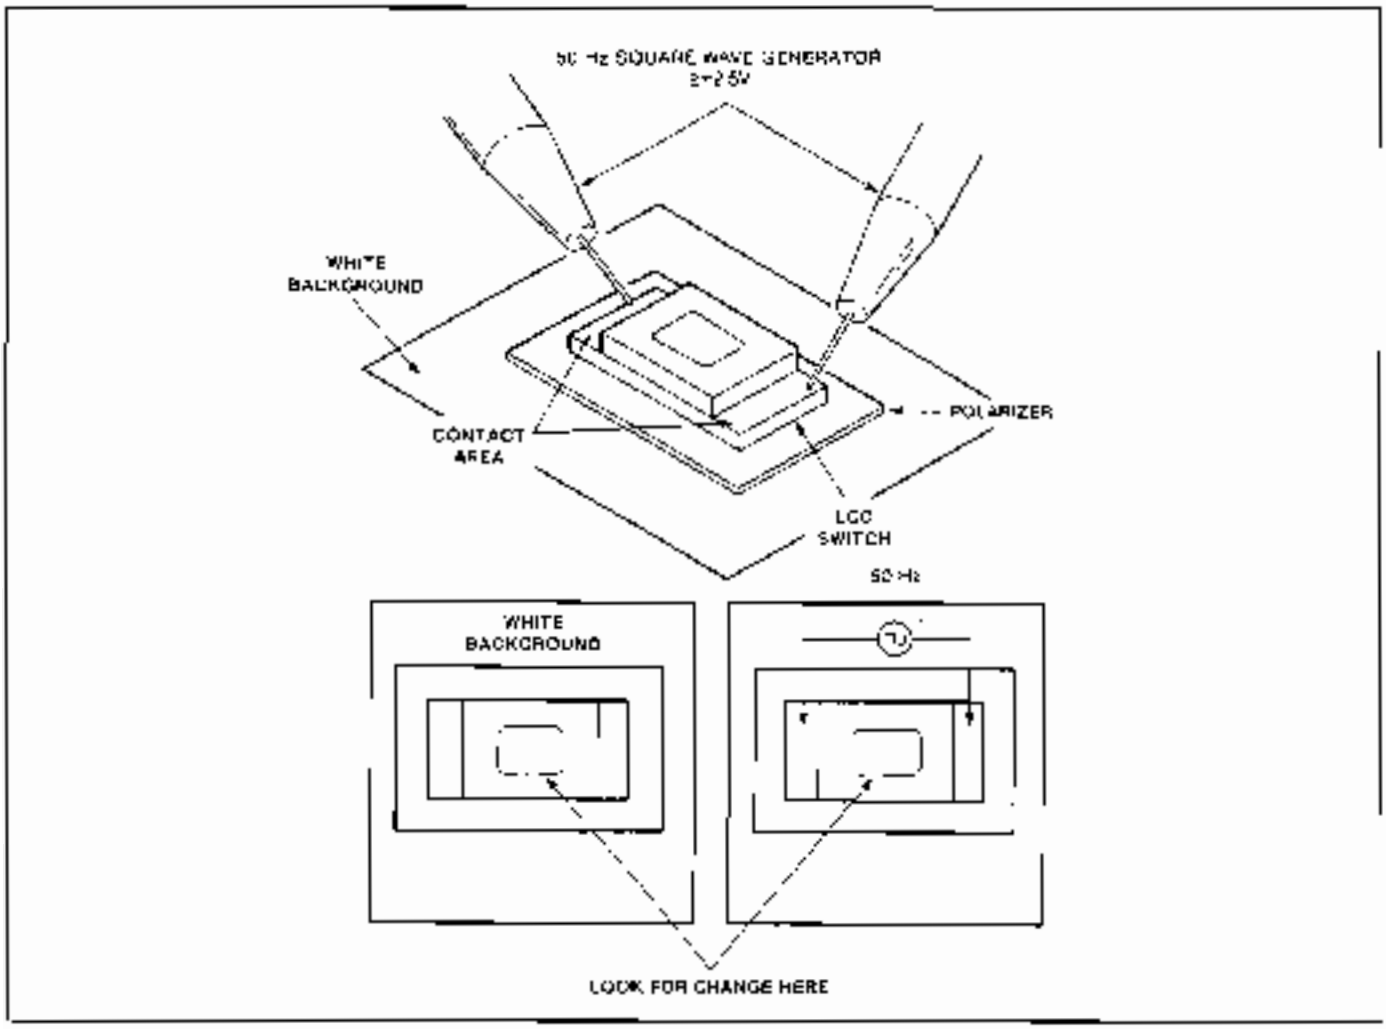

CAUTION

Do not apply dc voltage across the liquid crystal. Sustained dc current flow through the liquid crystal may damage the device.

c. Gently place the probes of the 50 Hz square wave frequency source on the end shoulders of the liquid crystal as shown and observe the window area, it should go from light to dark while probing the device. A faint change of color or no change indicates a faulty liquid crystal. The replacement HP part number for the liquid crystal is 1990-0768.

8-C-43. 5518A TROUBLE ISOLATION PROCEDURE

8-C-44. Before 5518A trouble isolation is attempted, the 5518A block diagram description (paragraphs 8-C-1 through 8-C-29) should be read. All electronic tests can be performed using an HP 5005 Signature Multimeter.

WARNING

WITH THE 5518A COVER REMOVED, UP TO 12 KILOVOLTS WILL BE PRESENT AT THE OUTPUT OF THE HIGH VOLTAGE POWER SUPPLY ASSEMBLY A6.

8-C-45. Test Setup

a. Connect the 5518A to the 5508A and turn 5508A power on. If no laser light is emitted, check that the exit shutter in the 5518A target assembly is not closed. Otherwise see Laser High Voltage Section Circuit Theory/Troubleshooting in paragraph 8-C-54.

b. Set the turret ring to OTHER. Position a retroreflector (HP 10767A) to return the laser beam to the return aperture with the return shutter open.

c. Wait for the 5508A to display something other than the warm-up countdown. Under normal operation, the countdown starts at 600 seconds and if it reaches zero – LASr FAIL will be displayed. When the laser is ready for operation, the countdown on the 5508A will be replaced by a flashing message – LASr UP. Subsequent errors will cause LASr UP to be replaced by the appropriate error message.

1. Does the 5508A display LASr FAIL?

2 If yes see step b in the procedure. If otherwise, see step a in the procedure.

8-C-46. Procedure

a. Does the 5508A display LASr UP?

1. If LASr UP is displayed, press RESET on the 5508A.

2. If the 5508A displays Hd ERROR, see step e of the Reference Receiver section of 5518A A3 Troubleshooting (Paragraph 8-C-131).

3. The 5508A display can change from flashing LASr UP to HEAD ERROR without a RESET switch closure. This can be caused by a reference signal dropout. In this case proceed with step b of this procedure.

NOTE

Hd Error, SL Error, and PA Error messages that occur with the 5518A cover removed should not be considered as errors unless they also occur with the cover on.

4. If the 5508A displays PA Error or SL Error or displays 0.00000 but the beam strength meter reads zero see the 5518A A2 Measurement Receiver Troubleshooting (Paragraph 8-C-69).

5. If the 5508A displays anything else then see 5508A servicing.

b. Remove the cover of the 5518A. Verify all boards are seated correctly and all test jumpers on A3 board are to the left (NORM). Turn 5508A power on. Check the following voltages. If any are incorrect see power supply servicing in A3 servicing procedures (Paragraph 8-C-129):

A3TP8 - 14.5V to 15.5V
A3TP9 - 4.75V to 5.25V
A3TP10 - minus 13.8V to minus 14.8V

1 Turn the 5508A power off for a few seconds, then back on. Observe READY LED on the 5518A. Find the description in steps c through f that matches your observation and follow that step.

c. LED takes longer than 3 minutes to start to blink, e.g., 5508A countdown display is less than 420 when READY LED starts to flash. Either the digital section is not working or the heater is not being heated properly. Check the following procedures:

A3 Digital Section (Paragraph 8-C-117)
A3 Power Amplifier (Paragraph 8-C-126)
A3 Warm-Up Error Amplifier (Paragraph 8-C-127)
A3 Subtracting Sample and Hold (Paragraph 8-C-124)

d. LED blinks within 3 minutes, blinks for less than 3 minutes, goes off, then repeats this action. This indicates that the warm-up mode feedback is not properly controlling the heater voltage.

1. Check:

A3 Power Amplifier (Paragraph 8-C-126)
A3 Warm-Up Error Amplifier (Paragraph 8-C-127)
A3 Digital Section (Paragraph 8-C-117)
A3 Subtracting Sample and Hold (Paragraph 8-C-124)

e LED blinks within 3 minutes, blinks for less than 3 minutes, comes on for 1 second (twice as long as when it is blinking) then goes off briefly. This action is then repeated. Either the optical mode feedback is not working or the reference receiver is defective.

f. Any other LED observation indicates a defective digital section. See A3 Digital Section Troubleshooting (paragraph 8-C-117). See Quick Tuning Checkout Procedure, Paragraph 8-C-36, and Reference Receiver Troubleshooting, Paragraph 8-C-131.

g. LED blinks within 5 or 10 seconds, comes on for a few minutes after approximately 3 minutes, then starts blinking again. Check A3 Power Amplifier section and especially A3Q3 and A3Q5.

h. Any other LED observation indicates a defective digital section. See A3 Digital Section Troubleshooting, Paragraph 8-117.

i. If a Reference Frequency Signal error is indicated after the laser has successfully reached normal operation (READY LED on continuously and Reference frequency signal output is OK), make the following observation. Does the READY LED extinguish when the failure occurs? If so, the optical tuning may be failing or the reference receiver may be resetting the state machine due to marginal signal strength. Use the Laser Power Output Test (Paragraph 4-16) as a check of the laser assembly and 5518A Quick Tuning Procedure to get an indication of the function of the optical tuning subsystem before proceeding with lower level testing. Use the Reference Receiver Troubleshooting Procedure, Paragraph 8-C-131, to check signal level if the laser assembly and tuning circuits appear to be functioning properly. If the READY LED does not extinguish, spurious errors may be occurring on the reference frequency signal. Various internal and external noise or interference may be responsible. Check A3 ground connections and Vcc coupling capacitors. Check that the 5518A cover is fastened securely. Marginal optical signal to the reference receiver may aggravate noise problems. Check for adequate signal according to Reference Receiver Troubleshooting, Paragraph 8-C-131. Improper system grounding may also cause noise problems, see Section II.

8-C-47. 5518A Assembly RemovA1 Instructions

8-C-48. Figure 8-C-10 shows the 5518A assembly locations. The exploded view diagram in Section VI provides access and removal information as well as assembly part number reference.

Reference Designator	Description
A1	Connector Board
A2	Receiver Board
A3	Controller/Reference Board
A4	Sampler Board
A5	High Voltage Power Supply
A6	Laser Assembly
A7	Sampler Assembly
A8	Straightness Mount

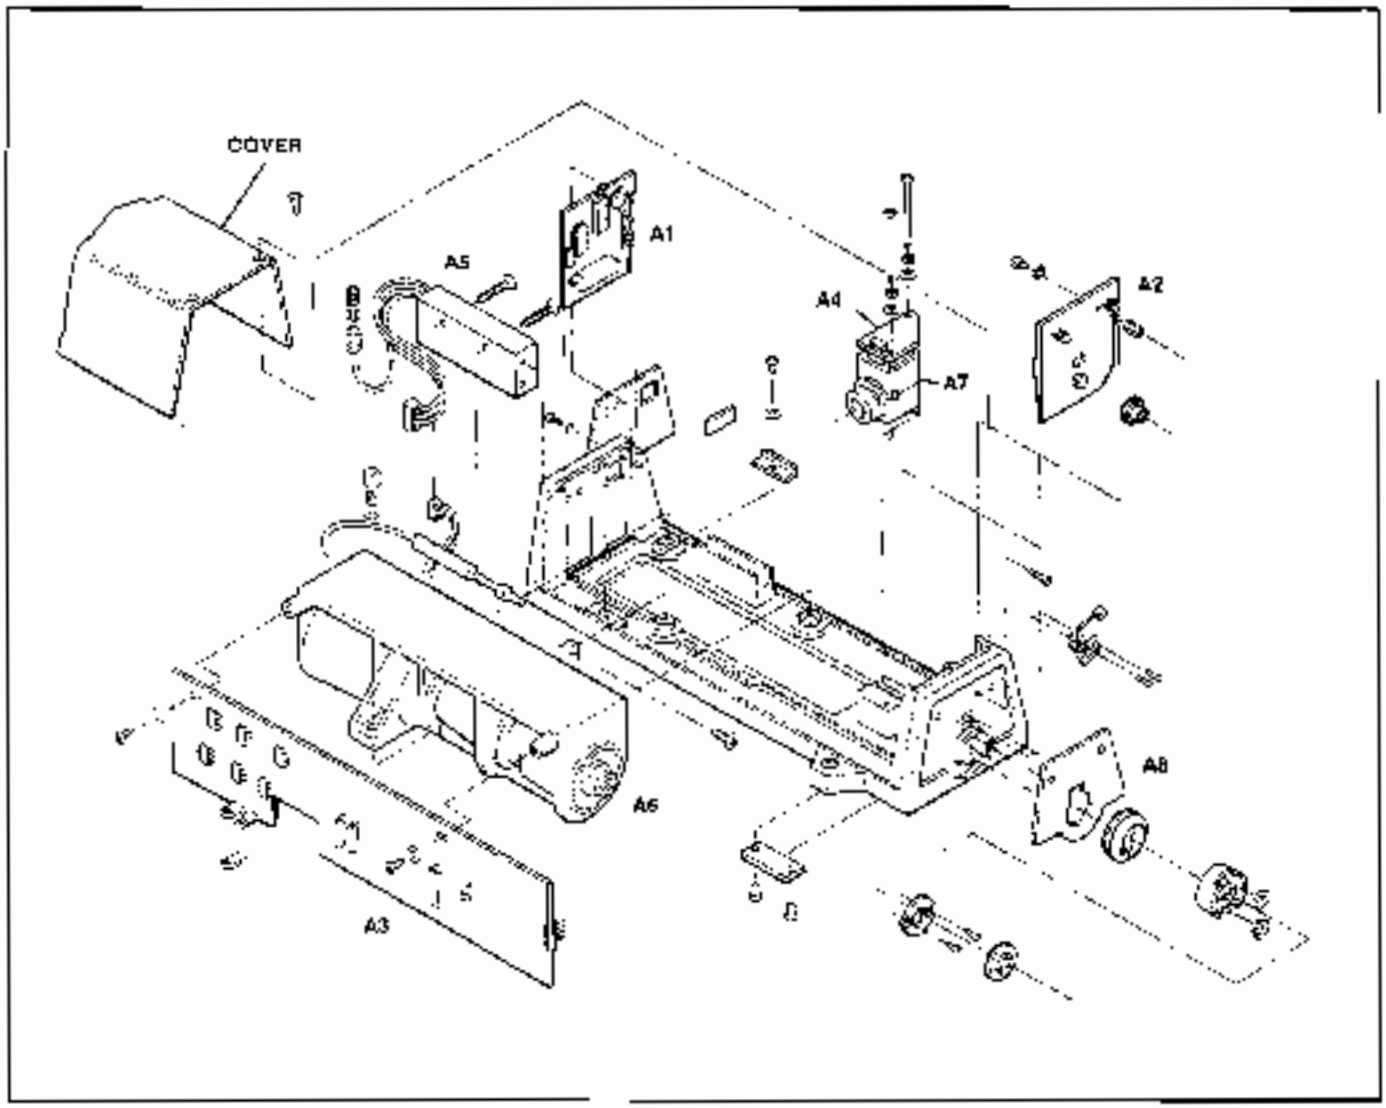


Figure 8-C-10 5518A Assembly Designations

8-C-49. 5518A A1 CONNECTOR BOARD CIRCUIT THEORY

8-C-50. The Connector Board interconnects the main laser cable, laser tube heater, laser power supply, A3 Controller/ Reference Board and via A3, the A2 Receiver Board. The schematic diagram for A1 is shown in *Figure 8-C-12.*

8-C-51 Capacitors C1 through C4 serve to filter out noise on the power supply line. C4 filters current spikes created by the high voltage power supply. Diodes CR1 and CR2 provide transient protection. F1 protects the system against laser power supply failures. J4 is the connector for the laser tube heater and cathode. DS1 lights when the high voltage supply is powered. DS2 lights when the 5518A is ready for use. R3 is used to adjust laser current as per the adjustment procedures in Section IV.

8-C-52. 5518A A1 CONNECTOR BOARD TROUBLESHOOTING

WARNING: HIGH VOLTAGE IS PRESENT ON J4 IF THE LASER IS ON AND THE TUBE CONNECTOR IS NOT CONNECTED TO J4.

8-C-53. Use the schematic diagram *Figure 8-C-12*, an ohmmeter, and a voltmeter to troubleshoot A1. Check to see if F1 is blown. Check for proper transmission of power supply voltages. Check for proper diode action across CR1 and CR2. Check C1 through C5 for shorts. Check R3 and R4.

8-C-54. 5518A LASER HIGH VOLTAGE SECTION CIRCUIT THEORY

NOTE: Newer high-voltage power supplies have two input wires rather than 3. The white/orange wire has been deleted.

8-C-55. The high voltage supply (*Figure 8-C-11*) receives +15 Volts from the 5508A through A1F1. A1R3 and A1R4 set the supplies current limit. The laser's discharge current passes through the high-voltage connector to the laser anode and from the laser cathode to A1J4 pin 1 (see *Figure 8-C-11*, "High Voltage Wiring"). Never remove A1J4 with the high voltage supply on, dangerous high voltage exists.

8-C-56. The laser assembly consists of an aluminum housing, laser tube, magnets, telescope and the quarter-wave/half-wave plate assembly. The telescope expands and collimates the beam. The quarter-wave plate and half-wave plate establish orientation of the two laser beam components.

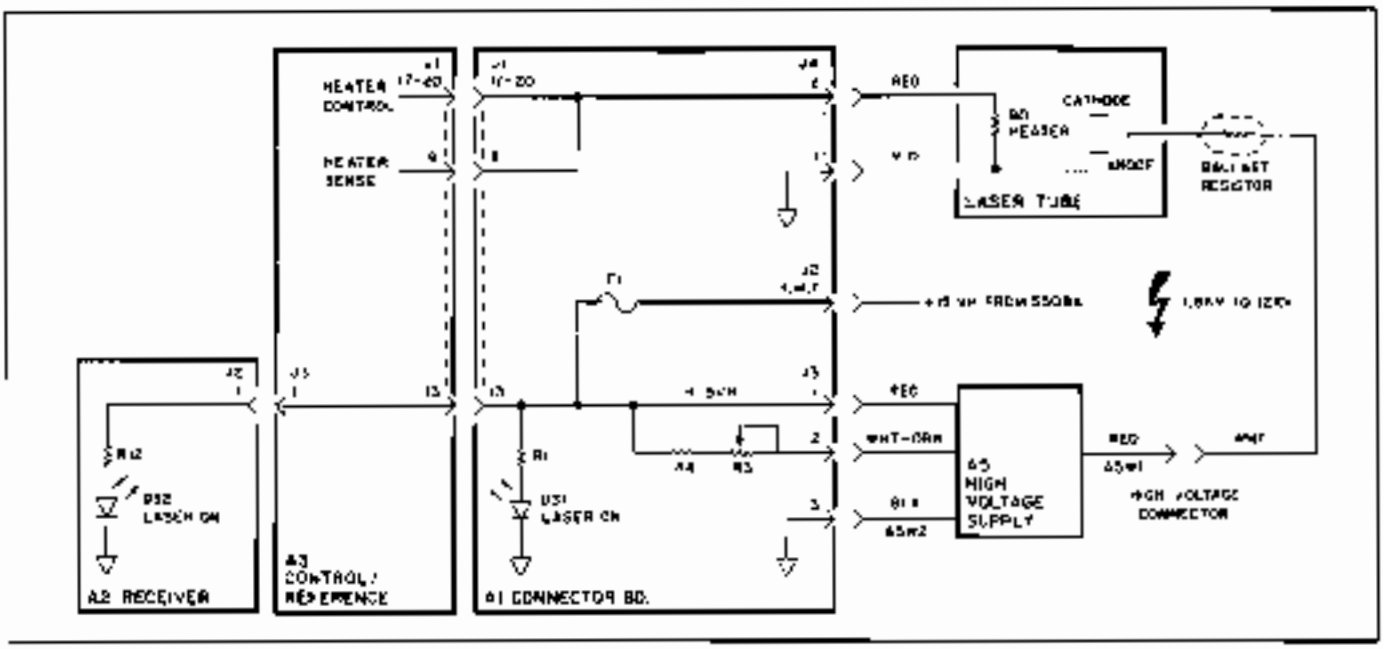


Figure 8-C-11 Laser Assembly Wiring

8-C-57. HIGH VOLTAGE POWER SUPPLY TROUBLESHOOTING

WARNING

FROM 12 KILOVOLTS TO 1.8 KILOVOLTS DC IS PRESENT ON THE ANODE OF THE LASER TUBE IN THE 5518A. EXERCISE EXTERME CAUTION WHEN WORKING INSIDE THE INSTRUMENT. THE HIGH VOLTAGE COULD CAUSE SERIOUS PERSONAL INJUFY IF CONTACTED. ANY MAINTENANCE SHOULD BE BY SERVICE TRAINED PERSONNEL ONLY.

WARNING

NEVER REMOVE A1J4 WITH THE HGIH VOLTAGE SUPPLY ON. DANGEROUS HIGH VOLTAGE EXISTS.

Note

Newer high-voltage power supplies have two input wires rather than 3. The white/orange wire has been deleted.

8-C-58. Various conditions result from a faulty HV power supply.

a. NO LASER LIGHT is emitted. Check that F1 is not blown and that the voltage at F1 is +15V. Check the high voltage connector and A1J3 and A1J4. Turn the power off and disconnect the high voltage connector. Carefully connect a high voltage probe, (you will need to make a jumper to extend the probe into the high voltage connector), turn power back on, and perform an open circuit voltage test. The voltage should be 10kV to 12 kV. If not, replace the high voltage power supply. If the laser still doesn't work then replace the laser assembly.

WARNING

AFTER TESTING, THE POWER SUPPLY MAY TAKE UP TO 3 MINUTES FOR THE VOLTAGE TO DECAY.

b. Laser light is emitted but flashes or causes a REF Error. Turn power off and disconnect A1J4. Insert a 1K resistor (R1) between the J4 pin 1 connector. (Leave J4 pin 2 disconnected). Connect an oscilloscope across Rt. Turn on the power and allow the laser to warm up. Observe the DC test voltage. It should be between 3 and 4 volts. If not, perform the current adjustment procedure in paragraph 5-22 of this manual. Set the scope to view the AC component and calculate the percent ripple. There should be less than 3% ripple in the test voltage. If not, replace the HV power supply. If the ballast resistor is bad the test voltage might be a nonperiodic intermittent voltage. If this is so, replace the laser tube assembly.

Note

If a power problem is intermittent, then sometimes a tap with a screwdriver will aggravate the problem for test purposes.

Note

If any part of the laser assembly is defective, replace entire assembly.

8-C-59. 5518A A2 MEASUREMENT RECEIVER AND 5518A TURRET SWITCH ASSEMBLY CIRCUIT THEORY

8-C-60. Paragraphs 8-C-61 through 8-C-68 contain circuit theory for the measurement receiver and the turret switch assemblies. Paragraphs 8-C-69 through 8-C-70 cover the troubleshooting information.

8-C-61. The measurement receiver (Figure 8-C-13) amplifies and converts the difference frequency of the laser beam to TTL levels and also supplies a signal to the 5508 that is proportional to the signal level of the difference frequency. The receiver circuit consists of photodiode CR3 and associated biasing; amplifier U1; a gain switching circuit Q1; and a transister level shifter Q2.

8-C-62. R11 and C6 filter the +15 VC bias voltage used to reverse bias photodiode CR3. Reverse bias reduces the diode capacitance. Direct current from the photodiode flows into R7 while alternating current from the photodiode flows through C7 to U1.

8-C-63. U1 contains two amplifiers. The gain of the first amplifier is set by the resistance between pin 6 and pin 8. The second amplifier's gain is set by R3. Counterclockwise rotation of the adjustment screw of R3 results in increased gain. Calibration procedures for R3 are given in Section V. If the gain is too high, the duty cycle of the TTL output is distorted and the beam strength current folds back.

8-C-64. In normal operation, S1 of the turret switch assembly is open allowing Q1 to conduct. The gain of the first amplifier is determined by the parallel combination of R4 and R5. When the turret of the 5518A is set for a straightness measurement, S1 is closed, Q1 is off and the gain of the first amplifier is set by R4 only. C1, R1 and R2 filter −15 VC and −15V so that noise on these supplies is not fed through Q1 to the amplifiers.

8-C-65. At the output of the second amplifier of U1, a peak detector circuit charges C9 to the peak output voltage. With no current from the photodiode, the voltage on C9 is about 1.5V. When photodiode current is present, the change in voltage on C9 is the amplitude of the signal coming out of the second amplifier. The voltage at pin 13 changes the same amount. The current sunk into pin 12 (beam strength current) is the voltage at pin 13 divided by R8. R9 protects the IC from over voltages on the cable to the 5508A.

8-C-66. When the output signal from the second amplifier is 100 millivolts or more, the voltage at pin 2 drops to light LED DS1. DS1 lit indicates that there is sufficient signal to make a measurement. R6 limits the LED current to the proper value.

8-C-67. Level Shifter Q2, CR2 and R10 shift the output of U1 to TTL levels. Capacitors C2 through C5 and C8 are used for coupling and bypass. A TTL high on U1 pin 11 ($\overline{LTO}$ FALSE) gates off the TTL output and the beam strength current. $\overline{LTO}$, an output of the 5518A state machine, is true when the 5518A is ready for use.

8-C-68. DS2 lights when the supply for the high voltage supply is on, warning the user that the laser is powered. R12 limits the LED current.

8-C-69. 5518A A2 MEASUREMENT RECEIVER TROUBLESHOOTING

NOTE

Except when noted, all components are on A2 Receiver board.

8-C-70. There are three symptoms of measurement receiver problems:

a. If the 5508A displays PA Error, go to step d.

b. If the 5508A displays SL Error, go to step h.

c. If the 5508A makes measurements but the beam strength meter does not move, go to step y.

d. Set 5518A turret to OTHER with both shutters open. Wait for 5518A READY LED to stay on. Use a clean retroreflector (HP 10767A) to return the laser beam through the return aperture. Place optical filter (HP 1000-0598) in the beam from the retroreflector to the return aperture. (Do not let the beam between the exit aperture and the retroreflector hit the filter.) Reset the 5508A. Does the 5508A display 0.000000? If yes, go to step e. If no, go to step f.

e. Measurement optics dirty or misaligned. See optics section or if a PA Error or SL Error displays on the 5508A when the turret is set to STRAIGHT, go to step x.

f. Remove the optical filter and rotate gain pot R3 fully counterclockwise (when the voltage on the outer lead of C2 no longer increases, R3 is set correctly). Again use the retroreflector to return the beam to the return aperture. Reset the 5508A. Does the 5508A display 0.000000? If yes, go to step g. If no, go to step i.

g. Check the measurement polarizer, the turret window and the photodiode lens (A2CR3) for cracks, dirt, or cloudiness. Set the gain of the measurement receiver according to the 5518A calibration procedure.

h. The measurement receiver may be oscillating or amplifying crosstalk from the reference receiver. Check all grounding and power supply decoupling of the measurement and reference receivers. Especially check the standoff between the A2 board and the instrument case. If everything is OK, go to step d.

i. Set 5518A to OTHER. Rotate R3 fully counterclockwise (voltage on outer lead of C2 should be about 0.7V). The READY LED should be lit and a TTL signal present at A3TP19 (If not see first step of reference receiver troubleshooting.). Are TTL signals present at A3U18 pins 1 and 3? If yes, go to step j. If no, go to step k.

j. Is a 400 mV p-p signal of the same frequency as in step i at the SEL FREQ test point in the Measurement Freq Multiplier section of 5508A A3 board? If yes then the Beam block ($\overline{\text{MEAS}}$) or the LOL ERROR ($\overline{\text{MEAS}}$ lines on the 5508A A3 are defective. If not then the connections between 5518A A3 and 5508A A3 are bad or the measurement line receiver (U12 of 5508A A3) is bad.

k. Is DS1, the SIGNAL LED, lit? If yes, go to step l. If no, go to step n.

l. Is a TTL signal present at A3TP20? If yes, then replace A3U4 or A3U18. If no, go to step m.

m. Is there a 0.3V to 0.7V square wave at base of Q2? If no, replace Q2 or U1. If yes, replace Q2, CR2 or R10.

n. Set turret to STRAIGHT. Return the laser beam to the exit aperture using a plane mirror HP 10773A. Does DS1 light? If yes, then replace measurement polarizer. If no, go to step o.

o. Is U1 pin 2 +0.8V? If yes, then replace DS1 or R6. If no, go to step p.

p. U1 may be bad. Remove the plane mirror. Check voltages on U1 according to the table below:

Pin	Voltage	Possible Trouble
9, 14	+5V	Power Supply
1, 15	0	Ground
11	<0.4V	U1, $\overline{LTO}$ line open
8	0.7V	C7, R4, R5, Q1, U1
7	4.8V	C4, U1
6	0.7V	R3, C2, R4, R5, Q1, U1
5	2.3V	C3, U1
4	0.8V	C2, U1
10	1.3V	C9, U1
3	5V	U1
2	5V	R6, DS1, L1
12	5V	R9, meter drive in 5508A, U1
13	0V	R8, U1
16	0.7V	Q2, U1

NOTE

If any of the voltages are incorrect, check the listed faulty parts. If all are OK, go to step q.

q. Set turret to OTHER and insert a retroreflector. Does pin 16 voltage increase by >0.2V when the retroreflector shines the beam into the return aperture in the turret? If yes, replace C3 or U1. If no, go to step r.

r. Does voltage at CR3 - R7 node go from <0.02V to >1V when shining laser into return aperture? If yes, go to step u. If no, go to step s.

s. Is voltage at CR3 - R11 node approximately 15V? If no, replace R11, C6 or CR3. If yes, go to step t.

t. Check CR3, R7, and C7. Check return aperture for obstructions. Check measurement polarizer, turret window and CR3 for scratches, dirt, or cloudiness.

u. Does voltage at CR3 – R11 node decrease by >50mV when the laser beam shines into return aperture? If no, replace R11, C6 or CR3. If yes, go to step v.

v. Shine laser into return aperture. Place the test polarizer (HP 1000-0016) in upper beam. The polarizer edge should make a 45° angle with the 5518A base. Attach DVM negative lead to A2TP1 (ground). When the polarizer is in the beam, the voltage at CR3–R7 node should be <1/10 the voltage when the polarizer is not there. The polarizer may have to be rotated 90° to get the low voltage. If this result is obtained go to step w. If not, replace the turret polarizer.

w. Does the drain to source resistance of Q1 go from <1 kohm to >30 kohm when the turret is set to STRAIGHT. If yes, replace U1, C2, or C7. If no, replace R4, R5, Q1, R13, R1, R2, C1 or straightness switch.

x. Replace the straightness mount. If the 5508A display still shows PA Error or SL Error only in straightness mode then check the straightness switch and its circuitry (R1, R2, R4, R5, R13, C1, Q1). The drain to source resistance of Q1 should go from <1 kohm to >30 kohm when the turret is set to STRAIGHT.

y. Set 5518A turret to OTHER. Wait for 5518A READY LED to stay on. Use a retroreflector (HP 10767A) to return the laser beam through the return aperture. Press RESET on 5508A. The 5508A display should read 0.00000. The beam strength meter should read greater than half way. If yes, everything is OK. If not, then block the beam and measure voltage at A3[3 pin 7 (the beam strength line). Is it 5V? If no then disconnect the 5518A from the 5508A meter drive circuit and check 5508A meter drive. If it is OK, then check the cabling or replace A2U1 or A2R9. If yes, go to step z.

z. Unblock the beam. The voltage at A3[3 pin 7 should drop from 5V. If it does, the 5518A is OK, check the 5508A. If it doesn't, check A2U1 or A2R9.

8-C-71. 5518A A3 CONTROLLER/REFERENCE BOARD AND A4 SAMPLER BOARD

8-C-72. Paragraphs 8-C-75 through 8-C-109 contain circuit theory for Assembly A3. Paragraphs 8-C-110 through 8-C-111 contain circuit theory for Assembly A4. Troubleshooting is covered in Paragraphs 8-C-112 through 8-C-131.

8-C-73. The schematic diagram for A3 and A4 is shown in Figure 8-C-14. The schematic has functional blocks that are labeled alphabetically with circled letters. These labels correspond to the circled letters in the text for the circuit theory.

8-C-74. Assemblies A3 and A4 contain the electronics for the following portions of the Laser Head Block Diagram:

a. Power Amplifier
b. Warm-up Error Amplifier
c. Photodiode and Amplifier
d. Liquid Crystal
e. Clock and State Machine
f. Subtracting Sample and Hold
g. Reference Receiver

8-C-75. 5518A A3 CONTROLLER/REFERENCE BOARD CIRCUIT THEORY

8-C-76. Clock Ⓐ

8-C-77. The frequency of oscillator U10 is determined by timing components R8, C7 and C8. For normal operation, C7 and C8 connect in parallel to give an output frequency of 100 Hz. For testing and signature analysis purposes, the oscillator can be configured to run at 20 kHz by moving the HTROK jumper JMP6 from the NORM position to the HI position. This removes C7 from the oscillator circuit.

8-C-78. Dividers Ⓑ

8-C-79. The dividers, consisting of U4A and U6, convert the 100 Hz oscillator signal into the desired periods. The first stage of the divider, U6 a dual 4-bit counter, divides the 100 Hz by 256. The last output of U6 at pin 8 has a period of 2.56 seconds (nominal). The output of U4A at pin 13 has a period of 5.12 seconds while the output at pin 9 provides a period of 25.6 seconds. These two outputs are ANDed by U2C to produce a signal called DISABLE which is high 2.56 seconds out of every 25.6 seconds. Both the subtracting sample and hold circuit and the power amplifier use the DISABLE signal.

8-C-80. State Machine Ⓕ

8-C-81. The state machine, consisting of U5, U4B and U8A, determines the four states of controller operation. The warm-up mode consists of two states, preheat and heater qualified. The optical mode has two states, locking and locked (see Figure 8-C-2, State Diagram for State Machine). The following paragraphs describe the sequence from preheat to locked.

8-C-82. Upon power-up, the power-on reset circuit places the state machine in the preheat state and the power amplifier turns the heater full on. U8A samples the HTR OK signal on the falling edge of DISABLE to allow sufficient time for the heater coil to coil to the rod temperature. See Figure 8-C-4, Warm-up Mode Timing Diagram. When the heater temperature rises to the proper value, the HTR OK signal from U15 causes the output of U8A, HTRQ, to go high. The state machine enters the heater qualified state and the READY LED blinks approximately once per second. The rate of blinking is determined by the output of U6B which is gated through U2A and U19C to the READY LED. Blinking continues until the state machine enters the locked state.

8-C-83. When HTRQ goes true U4B changes states from reset to count. Unless reset by HTR OK dropping low U4B counts for 100 seconds and then clocks U3A. This sets OPTICAL high and locks HTRQ on. The 100 second period is sufficient to stabilize the heater temperature.

8-C-84. When OPTICAL goes high, the state machine enters the locking state and optical feedback controls the heater. After this state has been held for 50 seconds LTO (U1F, pin 12) goes high and the controller enters the locked state. If REFON (a signal from the Reference Receiver) is not high, the entire circuit will be reset by the Power-On-Reset circuit. Otherwise U1F and U19E turn on the READY indicator LED indicating that the 5518A is ready for use.

8-C-85. Liquid Crystal Ⓓ

8-C-86. The liquid crystal, which is mounted on A4, connects to CMOS driver U8B via conductive rubber strips. When the PASSIVE/$\overline{\text{ACTIVE}}$ signal at U6B pin 8 is high, both outputs of U8B are high, thereby placing zero potential across the LC. This is the passive state of the LC and causes the laser beam polarization to rotate by 90°.

8-C-87. When PASSIVE/$\overline{\text{ACTIVE}}$ is low, U8B produces a 50 Hz, symmetrical square wave output to configure the LC in the active state. During this state, the LC does NOT rotate the laser beam polarizations.

8-C-88. Photodiode and Amplifier Ⓔ

8-C-89. The polarizing filter, which lies between the LC and the photodiode (CR1 of A4), allows only one of the two orthogonal components of the laser beam to strike the photodiode. During the passive state of the LC, the polarizing filter blocks the vertical component and the photodiode current is proportional to the horizontal component. During the active state, the photodiode current is proportional to the vertical component. The output of U11D at TP16 equals the photodiode current multiplied by an effective resistance of:

$$\frac{[R20 + R22]\ R17}{R20}$$

8-C-90. Warm-up Error Amplifier and Comparator Ⓘ

8-C-91. The resistance of the heater increases with increases of temperature. This effect is used in the circuit formed by R9, the laser tube heater, R16, R18, and R19 to generate an error signal on the order of 1 mV/°C. Warm-up error amplifier U14 amplifies the error signal and drives U15.

8-C-92. The output of the HTR OK comparator, U15, goes high when the error voltage nears zero. The temperature at which HTR OK occurs is set by potentiometer R16 as described in the Reference Temperature Adjustment in Section V.

8-C-93. Subtracting Sample and Hold Ⓗ

8-C-94. During warm-up mode, U19B disables the heater for 2.56 seconds out of every 25.6 seconds. During the 2.56 second disable, the heater temperature stabilizes and U12B samples the output of U14. When U12B opens, the sampled voltage is held on C13 and buffered by U11B. Switch U12C connects C14 and the input of U11C to ground.

8-C-95. During the optical mode, U11D alternately drives one of the sample and hold circuits then the other. The sample and hold circuit consisting of U12D, C14, and U11C, provides a signal that is proportional to the horizontal component. The other sample and hold circuit, U12A, C13, and U11B is used for the vertical component.

8 C-96. The first counter, U6, in the divider section controls the liquid crystal and the sample and hold circuits. A sample and hold is performed once per cycle of T1.28, alternating between the vertical and horizontal components. Thus each component is sampled once every 2.56 seconds. This is shown in Figure 8-C-7, Optical Mode Timing. The LC is allowed to stabilize for 0.64 seconds before the switch to the sample and hold is closed. The hold cycle begins when the switch opens at the end of a cycle of T2.28 and at the end of a half cycle of PASSIVE. The present half cycle of PASSIVE/$\overline{\text{ACTIVE}}$ determines which component is sampled. Op-amp U11A computes the difference between the two sample and holds.

8-C-97. Power Amplifier (J)

8-C-98. The output of U12A drives the power amplifier which in turn drives the laser tube heater. The frequency response of the power amplifier is determined by the input filter (R31, R27 and C18) and the nonlinear feedback for op-amp U13 (R32, R33, R39, R40, R41, C20, CR3 and CR4).

8-C 99. Q5 provides level shifting to drive the base of the Darlington power transistor Q3. U19B disables the output stage by grounding the base of Q5 when the heater error voltage is sampled during the warm-up mode.

8-C-100. Reference Receiver (L)

8-C-101. The reference receiver consists of diode CR5, an amplifier U17, and a transistor level shifter Q6. The receiver amplifies and converts the sinsoidal output from CR5 to TTL levels. When $\overline{\text{LTO}}$ goes low, and the received signal has an adequate signal to noise ratio, the receiver is enabled and provides a low TTL signal $\overline{\text{REFON}}$. During the warm-up and locking modes, the receiver supplies no useful information and is therefore disabled.

8-C-102. CR5 is reverse biased to reduce capacitance. The +15V bias voltage is filtered by R46 and C27. The photodiode's dc component flows into R47 while the path for ac is through C25 to U17. A polarizer oriented at 45° to both laser frequency components passes optical power at the reference frequency onto CR5. The reference frequency is the difference in frequency between the 2 optical frequency components of the laser beam.

8-C-103. U17 contains two amplifiers. The gain of the first amplifier is set by R44. R42 and R43 set the gain of the second amplifier. A peak detector circuit charges C28 to the peak level of the linear output of U17. With no current from the photodiode, the voltage on C28 is about 1.5V. When photodiode current is present, the change in voltage on C28 is the amplitude of the signal coming out of the second amplifier. When the amplitude exceeds 200 mV, the voltage at pin 2 ($\overline{\text{REFON}}$) drops to TTL low. Q6, CR6 and R45 shift the output of U17 to TTL levels. C22, C23, C24, C26 and C29 are used for coupling and bypass. A TTL high on pin 11 gates off the TTL output and causes pin 2 to TTL high.

8-C-104. Line Drivers (K)

8-C-105. U10 and U18 provide the necessary power to send the Measurement and Reference Frequency Signals to the 5508A. L3 and L4 limit the current spikes in U10 and U18. The special grounding and decoupling of the line drivers and receivers prevent crosstalk and oscillations.

8-C-106. Power-On Reset (POR) (G)

8-C-107. When power is turned on, or $\overline{\text{REFON}}$ drops low during the locked state of optical mode, the power-on reset circuit sets the state machine in the preheat state.

8-C-108. Power

8-C-109. −15 VD and −15V are supplied by the 5508A. +5V is generated by U7. CR2 protects U7. C5 stabilizes U7 and C4 filters U7 output. +15 VC is the +15 VD supply after it has been filtered by L2 and C11. L1 and C12 filter −15V. C2, 3, 6, 16, 17, 21, provide local decoupling of the supplies.

8-C-110. 5518A A4 SAMPLER BOARD CIRCUIT THEORY

8-C-111. The Sampler board connects to Controller/Reference board A3. The only active component on A4 is A4CR1, a photodiode that provides a signal to U11D on A3. Pads on the underside of A4 connect to the liquid crystal via elastomeric connector strips which project from the sampler assembly. Liquid crystal operation is discussed in the A3 theory section.

8-C-112. 5518A A3 CONTROLLER/REFERENCE BOARD TROUBLESHOOTING

8-C-113. Service for A3 is divided into the following procedures:

a. Digital

b. Photodiode and amplifier

c. Liquid crystal

d. Subtracting sample and hold

e. Power amplifier

f. Warm-up error amplifier

g. Power supplies

h. Reference receiver

8-C-114. Consult Paragraph 8-C-43, 5518A System Level Troubleshooting, to determine which procedure should be used.

8-C-115. Standard Troubleshooting Procedures

8-C-116. In the following tests, reference is frequently made to "localize the defective element by standard troubleshooting procedures". This consists of the following:

a. The test procedure places a group of IC's in a definite state and:

   1. provides the correct values of the input and output signals characteristics

      OR

   2. implies use of the schematic to determine the signal characteristics

      OR

   3. simply states a suspected component

b. When the test procedure specifies a suspected component, replace it and run the test again.

c. When signal characteristics are known, measure the signals until a component is found that has correct inputs but erroneous outputs. Most likely this component is defective. If not, check for:

   1. output loading such as a board short

   2. shorted input on a downstream circuit

   If inputs are incorrect, check for open traces and faulty outputs from previous stages.

d. If an erroneous signal comes from another board, perform the test procedure for the suspected board.

8-C-117. Digital Troubleshooting

8-C-118. This procedure covers the clock, dividers, power-on-reset, and state machine blocks of the A3 board. The procedure assumes that the power supplies are functioning properly. The procedure requires use of standard troubleshooting procedures which are outlines in Paragraph 8-116.

8-C-119. Troubleshooting Strategy: Signature analysis is used in this section to isolate faulty digital components. Malfunctions in the clock, dividers, or power-on-reset blocks will not allow the signature analyzer to operate properly. Proper clock operation is verified first, then an attempt at verifying the state machine using signature analysis is made. If the signature analyzer doesn't work the dividers and resets must be repaired and then the state machine can be verified.

NOTE

Upon successful completion of a check, unless otherwise specified, return jumpers to original position.

a. Turn power on. Position all jumpers to the left. Measure clock frequency at TP5 (CLOCK). If it is 100 Hz ±20% go to step b. If not, check clock section components.

b. Move HTROK jumper to HI. If clock frequency is now 75 kHz ±20%, go to step c. If not, check C8

c. Keep HTROK in HI. Set REFON jumper to HI. Set up signature analysis clock, start, and stop signals for falling edge detection as indicated in the lower center portion of A3. Take signatures on XU9.

pin 16 (+5V Test Signature 104C pin 2 5653
pin 3 2333
pin 5 3357
pin 7 HPBP
pin 10 U729
pin 11 6PCP
pin 12 0148
pin 13 A10H

Check signature of U19, pin 10 = A957

If these are OK, go to step m.

If the signature analyzer will not take signatures, then there is malfunction in the dividers or power-on-reset sections. go to step d.

If the signature analyzer works, but one or more signatures are wrong, go to step e.

d. Set HTROK to HI, REFON to HI, and RESET to TEST. Connect TP2, TP3, and pin X of HTROK jumper to ground (TP1 or TP18). Verify the dividers by measuring the frequencies at the following IC pins and determine that they are equal to the indicated ratios, i.e., the frequency at U6 pin 13 should be equal to the frequency at TP5 divided by 16. Note: The counter function of the signature analyzer may not work so a dedicated counter might be needed.

Measure Frequency at		Frequency Should be	If Incorrect
IC	Pin	Equal Ratio of	Faulty Part is:
U6	13 =	F(TP5/16) or ~4.8 kHz)	U6
U4	15 =	F(U6 pin 13/16 or ~300 Hz)	U4 or U6
U4	1 =	F(U4 pin 15/10) or ~30 Hz	U4
U4	7 =	F(U4 pin 1/10) or ~3 Hz	U4

If no problem is found, proceed to step e.

e. Set HTROK to HI, REFON to HI, RESET to TEST. Connect TP2, TP3, and pin X of HTROK jumper to ground. (TP1 or TP18). Set up the signature analysis clock, start, and stop signals for falling edge detection. Using the signatures listed in step s, localize the defective element by using standard signature analysis troubleshooting. Use the schematic to trace back faulty signals. Check U1 pin 6, U19 pin 10, and U2 pin 6 right away, they are critical points. If no trouble is found, go to step f.

f Remove ground connection on HTROK jumper. Is U8, pin 6 signature FP96? If not, U8A or R48B is faulty. If so, go to step g, or see Warm Up Error Amplifier Troubleshooting.

g Remove the ground connection on TP3 and leave off. Is the +5V signature (TP9) = CP5P? If not, go to step h. If so, go to step j.

h. Set HTROK to LO. Is U8 pin 1 low? if not, U8 is bad. If yes, go to i.

i. Is TP3 high? If yes, go to j. If no, check U4B, U5D, U19D, R5D.

j. Remove ground connection on TP2 and leave off. Set HTROK to HI. Is +5V signature = AF7A? If yes, go to step m. If no, go to step k.

k. Remove RESET jumper. Tie center pin to +5V. Is TP2 high? If not, replace U19 or R5B. If so, go to step l.

l. With settings same as step k, check that U4 pins 1, 2, 9, 12, 13, and 16 are all High. If not, U4 is bad. At this point, the digital section should be OK.

m. Set REFON to HI, HTROK to X, all other jumpers to left. U8 pin 5 should be high. If not, check U8A. If so, go to step n.

n. Keep REFON to HI, set HTROK to LO. U8 pin 15 should be low. If not, U8A is bad. If so, go to step o.

o. Set REFON to LO. U9, pin 9 should be low. If not, U2B is bad. If so, go to step p.

p. Turn the power off. Set REFON to HI, HTROK to HI. Check that U1, pin 5 comes on then blinks at a few Hz or so at power on. If OK, go to step q. If not, replace C1 and check CR1, R5A, R51, and R48A.

q. Turn power off. Set REFON to HI. Set POWER AMP jumper to UP. Turn power on and allow the laser to run for five minutes. Observe the voltages at U19 pins 3 and 4. Pin 3 will be mostly at a TTL low but will periodically go high for a few seconds. Pin 4 should be at a voltage of at least 10V when pin 3 is low and should immediately go low when pin 3 goes high. If this is the case, then return all jumpers to the right, the Digital Section is OK. If pin 4 doesn't go low when pin 3 goes high, replace U19. If pin 4 doesn't reach at least 10V when pin 3 is low, see A3 Power Amp section.

r. Signature Analysis Signatures

Conditions for signature analysis.

HTROK = HI, REFON = HI, RESET = TEST;
TP2, TP3, and pin X of HTROK jumper to ground.

Pin	U1	U2	U3	U4	U5	U6	U8	U19
1	X	4UHP	CCPC	6678	4CCA	41A5	CCPC	F9C3
2	X	7U30	41A5	0000	FP96	0000	UA4P	X
3	X	41A5	FP96	8A5F	P861	FO9F	27HH	7130
4	F9C3	4A39	41A5	0000	4UHP	CUBC	UA4P	X
5	UA4P	CCPC	FP96	2OH3	P861	267H	41A5	961P
6	CCPC	961P	8U33	FP96	4H86	9CHA	0000	PC06
7	0000	0000	0000	UA4P	0000	0000	0000	0000
8	27HH	7130	3P95	0000	CCPC	4UHP	4UHP	0000
9	6678	8U33	7U30	6678	CCPC	4CCA	CC8F	CCPC
10	OP7C	6678	41A5	AOHO	CCPC	4A39	4UHP	PC06
11	4UHP	538U	20H3	88F5	A5P7	FF57	41A5	7U30
12	7U30	F9C3	FP96	0000	P861	0000	CC8F	0000
13	3P95	41A5	CCPC	538U	OP7C	9CHA	C5U7	CCPC
14	41A5	41A5	41A5	0000	41A5	41A5	41A5	41A5
15	X	X	X	4UHP	X	X	X	X
16	X	X	X	41A5	X	X	X	X

8-C-120. Photodiode and Amplifier Troubleshooting

8-C-121. The procedure assumes that the power supplies are functioning properly. Use a dedicated digital voltmeter, not the signature analyzer voltmeter function.

a. Set HTROK jumper to LO, PHOTODIODE jumper to TEST, liquid crystal jumper to PASS. Is voltage at TP16 more negative than -4V? If no, go to step c. If yes, go to step b.

b. Set LIQUID CRYSTAL jumper to ACT. Is voltage at TP16 more positive than -1 V? If no, go to step c. If yes, go to step d.

c. Verify U11 pin 13 is 0 V ±10 mV. If not, replace U11. Verify voltage at TP16 is 6/11 of that at U11D pin 14 and voltage at junction of R20 - R22 is 1/11 of that at U11D pin 14. If not, check R6, R17, R20, R22, and R24. Also U12A or U12D may be incorrectly loading this node.

d. Amplifier is OK. Check photodiode. Verify laser is on. Set photodiode jumper to NORM. Measure TP16 voltage. If it is >±0.5 V then photodiode, A4CR1 is good. If it is ≅6V then either the photodiode is shorted or U11 is bad. If it is -0.5V to +0.5V go to step e.

e. Remove photodiode jumper (A3JMP5) and check for diode action between the left hand pin of the jumper and ground. If no diode action is observed, replace A4CR1. Otherwise, not enough light is reaching the photodiode. Remote the sampler assembly and inspect the liquid crystal, beam splitters and A4CR1 for dirt, scratches, etc. If OK, see Liquid Crystal Troubleshooting.

8-C-122. Liquid Crystal Troubleshooting

8-C-123. This procedure assumes the digital circuits and photodiode and amplifier circuit are functioning properly.

a. Verify laser is on. Set all jumpers on A3 to left except liquid crystal to PASS. Insert test polarizer (HP P/N 1000-0616) between laser assembly and sampler assembly. The bottom edge of the polarizer should be parallel to the base of the 5516A. Measure TP16 voltage. Is it <0.2V? If yes, go to step c. If not, go to step b.

b. Rotate polarizer 90°. Is TP16 voltage <0.2V? If yes, go to step c. If no, go to step f.

c. Rotate polarizer 90°. Is TP16 voltage <0.5V? If yes, go to step c. If no, go to step f.

d. Set Liquid Crystal jumper to ACT. Is TP16 voltage <0.2V? If yes, go to step e. If not, go to step f.

e. Rotate polarizer 90°. Is TP16 voltage >0.5V? If yes, the liquid crystal is OK. If no, go to step f.

f. Liquid crystal may not be working. See Paragraph 8-C 40, Liquid Crystal Test. Check that the elastomeric connectors are connecting A4 and liquid crystal.

NOTE

The older HP 5516A's have the black conducting rubber strips instead of the pink elastomeric connectors. The conducive rubber strips were found to develop bad contacts at A4 and the liquid crystal. If this problem develops, clean both sets of contacts with isopropyl alcohol and install the elastomeric connectors (HP part number 8160-0530).

8-C-124. Subtracting Sample and Hold Troubleshooting

8-C-125. This procedure assumes the digital circuit and photodiode and amplifier are functioning properly.

a. Set $\overline{\text{REFON}}$ jumper to LO, set HTROK to HI. Wait for READY LED to remain on. Set HTROK to NORM. Set photodiode jumper to TEST, set LIQUID CRYSTAL jumper to ACT. Using a dedicated dc voltmeter, check that the voltage at TP16 is -50 mV to +50 mV? If yes, go to step c. If no, go to step b.

b. The circuitry connected to pin 2 or pin 15 of U12 is incorrectly loading photodiode amp when switch U12A or U12D is closed. Check U11, C13, and C14.

c. Is voltage at TP13 equal to voltage at TP16 within 10 mV? If no, go to step d. If yes, go to step e

d. Verify U12 pin 8 is low. Measure voltage from U11B pin 5 to TP13. Is it -10 mV to +10 mV? If yes, go to step i. If no, U11B is defective or its output is incorrectly loaded.

e. Is voltage at TP14 equal to voltage at TP16 within 10 mV. If yes, go to step g. If no, go to step f.

f. Verify U12 pin 9 is low. Measure voltage from U11C, pin 10 to TP14. Is it -10 mV to +10 mV? If yes, go to step i. If no, U11C is defective or its output is incorrectly loaded.

g. Set POWER AMP jumper to UP. Is voltage at TP12 between-20 mV and +20 mV? If yes, go to step i. If no, go to step h.

h. Verify U11A pin 3 voltage is about 1/2 of TP13 voltage. Verify U11A pin 2 voltage = U11A pin 3 voltage. If not, U11A, R10, R12, R14, or R15 may be bad.

i. Place liquid crystal jumper to NORM. TP16 will alternate between about 0V to about -5V. Record these voltages (the ΔV function of the HP 5005A is useful here). Measure voltage at TP13. It should be the same 0V reading as at TP16, within 20 mV. If OK, go to step k. If not, go to step j

j. Measure the voltage on C13. During and just after the switch (U12A) is closed (delayed active signal on U5 pin 11), the voltage should equal the approximate zero voltage at TP16. If it is not, or if the voltage rapidly goes to zero, then C13 is shorted or the switch U12A does not work. Also check that U12B is open and U11B is not shorting this node.

k. Is the voltage at TP14 within 20 mV of the approximate -5V voltage at TP16. If yes, go to step m. If not, go to step l.

l. Measure the voltage on C14. During and just after the switch, U12D, is closed (Delayed Passive signal on U5, pin 6), the voltage should equal the approximate -5V at TP16. If it is not, or the voltage rapidly goes to zero, then C14 is shorted or U12D is faulty. Also check that U12C is open and U11C is not. shorting this node.

m. Set PHOTODIODE jumper to TEST. LIQUID CRYSTAL to PASS, POWER AMP to UP. Verify TP16 voltage is approximately -5V. Measure voltage at TP14, record this as V14. Measure voltage at U11A pin 3, record this as V3. Measure voltage at TP12. Is it equal to [2 × V3] -V14 within 30 mV? If yes, go to step o. If no, go to step n

n. Verify U11A pin 2 is at the same voltage as U11A pin 3. If not, U11A or R15 is bad. Also check R14, R10, and R11.

o. The procedure thus far has shown that the subtracting sample and hold works during optical mode. Next the operation during warm-up is checked. Turn 5508A off. Move all A3 jumpers to NORM except $\overline{\text{REFON}}$ to HI. Connect an ohmmeter between pin 6 and 7 of U12B. Turn 5508A on. Meter should read open circuit when the DISABLE signal (U2, pin 8) is low. Meter should read less than 250 ohms when DISABLE is high. (The HP 5005A measures ohms to ground so pin 6 or pin 7 of U12B will have to be grounded for this test) If the result is satisfactory, go to step p. If not, U12B is defective.

p. Connect an ohmmeter between U12 pin 10 and ground. Ohmmeter should read less than 250 ohms while OPTICAL (U5, pin 5) is low. If it does, go to step q. If not, U12C is faulty.

8-C-126. Power Amplifier Troubleshooting

a. Set HTROK jumper to HI, $\overline{\text{REFON}}$ to LO and wait for READY LED to stay on. Set POWER AMP jumper to UP. Remove HEATER jumper. Is voltage at U13 pin 3 approximately 0.1V? If not, check R37, R31, R49, R50, R51, C16, and U13. If so, go to step b.

b. Within 3 minutes of setting POWER AMP to UP, is the voltage at TP11 >13V. If yes, go to step d. If not, go to step c.

c. Is U13 pin 6 >18V. If yes, go to step j. If no, replace R33 or U13.

d. Set Power Amplifier jumper to DOWN. Is voltage at TP11 <0.6V within 3 minutes? If yes, go to step g. If no, go to step e.

e. Is U13 pin 6 ≤10V? If yes, go to step l. If no, go to step f.

f. Is U13 pin 3 approximately -0.1V? If yes, check R38 or C13. If no, check R49, R50, R51, U14.

g. While observing voltage at TP11, move POWER AMP jumper from DOWN to UP. TP11 voltage should jump to about 5V and then ramp up 0.1 V/second. If OK, go to step h. If the jump is >5.7V then either R32, R40, C20, or CR3 is open; or R35 is shorted; or check R49, R50, or R51. If the jump is >4.5V then either R32, R40, R41, CR3 or CR4 is shorted; or R39 is open; or check R49, R50, R51. If the ramping is too slow or too fast, then check R33, R49, R50, R51 and C20. If OK, go to step h.

h. When TP11 voltage is >13V, measure voltage from TP11 to TP17. If it is 5.7V to 6.7V, go to step i. If it is >6.7V, then CR4 is open. If it is <5.7V, then either R40, R41, or CR4 is shorted; or R39 is open.

i. Set HEATER jumper to OFF. Voltage at TP11 should be 0.2V to 0.6V. If so, the power amp is OK. If it is <0.2V, R9 is open.

j. Set POWER AMP to UP, HEATER jumper to NORM. Wait for U13 pin 6 to be >18V. Measure voltage at Q5 base. If it is >1V, go to step k. If it is <1V, R36 may be open.

k. Measure voltage across R37. If it is zero, then Q5 or R38 is open. If it is greater than 1V then C20, heater, or R30 is shorted; or Q5 or R33 is open; or check R21 and U14 loading this node; or Q3 is bad.

l. Set POWER AMP jumper to DOWN. Wait for U13 pin 6 to be ≤10V. Measure voltage at Q5 base. If it is >1V, then Q5 is shorted. If it is <1V, go to step m.

m. Measure voltage across R37. If it is >1V, then Q5 is shorted or R37 open. If it is zero, then Q5 or R9 is shorted or the heater is open.

8-C-127. Warm-Up Error Amplifier Troubleshooting

8-C-128. This procedure assumes the power amplifier is functioning properly.

a. Set HEATER jumper to OFF. Is TP11 voltage 0.2V to 0.6V? If yes, go to step b. If no, go to power amplifier servicing.

b. Is TP15 voltage 0.2V to 0.6V? If yes, go to step c. If no, R18, R19 or U14 is faulty.

c. Check R16 to see if it is shorted. Short TP15 to TP11. Measure U14 pin 6. Does the voltage stabilize between -1.5V and +1.5V? If yes, go to step d. If no, R21, R23 or U14 is faulty.

d. Remove TP15 to TP11 short and short TP15 to ground (TP18). Is U14 pin 6 voltage more negative than -12V? If yes, go to step e. If no, U14 is faulty.

e. Is voltage at U15 pin 3 half of U14 pin 6 voltage? If yes, go to step f. If no, R25, R26, U12 or U13 is faulty.

f. Is voltage at U15 pin 2 between 1.2V and 1.3V? If yes, go to step g. If no, R28, R29, R30 or U15 is faulty.

g. Is U15 pin 7 >3V? If yes, go to step h. If no, R5F, R48C, U8A or U15 is bad.

h. Remove TP15 short and short TP11 to ground. Is U14 pin 6 voltage >12V? If yes, go to step i. If not, U14 is bad.

i. Is U15 pin 7 between 0.10 and 0.20? If yes, the warm-up error amplifier is OK. If no, R5F, R48C, U8A or U15C is faulty.

8-C-129. Power Supplies Troubleshooting

8-C-130. If the correct voltage is not observed on A3TP8, 9, or 10 typical power supply troubleshooting should be followed. Following are suggested points to check:

a. Power comes from the HP 6331B Power Supply.

b. A1CR1 is in series with the -15V line.

c. A3L1 and A3L2 are in series with the power supplies.

d. There should be >200 ohms from +15V to ground.

e. If F1 blows, check for open in A1R3, A1R4 or middle lead of A1J3 open, or excessive current to High Voltage power supply. (See High Voltage Power Supply Troubleshooting in Paragraph 8-54.

f. Power supply components are on A1 and A3.

8-C-131. Reference Receiver Troubleshooting

a. With power removed from the 5518A set the REFON jumper on A3 to LO and HTROK to HI. Turn the 5518A power on. Does the READY LED eventually start blinking then remain on continuously? If no, see 5518A Trouble Isolation Procedure, Paragraph 8-35 and procedures recommended therein.

b. Are TTL level signals present at A3U18 pins 1 and 3 at a frequency between 1.5 and 2.0 MHz? If so the reference receiver may be working properly. If not, trace the signal path from U17 pin 16 to U16 pins 5, 6, and 7 (TP19) and check for the following:

U17 pin 16: 0.3- to 0.7-volt square wave at the REFERENCE FREQUENCY, 1.5 to 2.0 MHz

TP19, TTL level square wave at the REFERENCE FREQUENCY, 1.5 to 2.0 MHz.

If there is no activity found check U17 pin 2. If pin 2 is at a TTL high level or changing states then either the laser is not tuned properly, or the Reference Receiver is failing or not receiving adequate signal. Verify laser tuning according to step c before continuing with step d. If U17 pin 2 is at a TTL low level and there is no output activity as described above then U17 may be bad or it's output may be shorted. Go to step d.

c. Align a 10780A receiver so that the laser output beam is incident on the photodiode lens. If the laser is properly tuned the LED on top of the 10780A should light and the 10780A should output a square wave at the REFERENCE FREQUENCY. This test can be performed with the laser installed using one of the axes' receivers. In this case, if the axis interferometer is installed, vibration, etc. will modulate the REFERENCE FREQUENCY but a frequency in the range of 1.5 to 2.0 MHz should still be apparent. If no steady REFERENCE FREQUENCY signal is detected by the 10780A then a laser tuning failure is indicated which is independent of the Reference Receiver. See 5518A Trouble Isolation Procedure, Paragraph 8-35. Otherwise proceed with step d.

d. Measure and record the dc voltages at U17 pin 10 and the CR5-R40 node. With REFON jumper still set to LO, place a piece of paper between the laser assembly and the sampler assembly to block the laser beam. The voltage at U17 pin 10 should drop by 250 mV or more, indicating adequate signal, and the following dc voltages should be measured on the pins of U17 with the beam blocked:

PIN	DC VOLTAGE	POSSIBLE TROUBLE
9,12,14	V_{cc}	Power Supply
1,15	gnd	Ground
11	TTL HIGH	U17, U38, Digital Circuits
8	0.7V ±0.1	R44, U17
7	4.8V ±0.1	C23, U17
6	0.7V ±0.1	R43, R44, C23, U17
5	2.3V ±0.2	C24, U17
4	0.8V ±0.1	C23, U17
10	1.6V ±0.2	C26, U17
3	V_{cc} +0/-0.1	U17
2	V_{cc} −0/+0.1	U17
13	<50 mV	U17
16	5.7V ±0.1	Q6, U17

If any voltage is incorrect, check or replace the listed part.

If the voltage at pin 10 does not drop according to the above, measure the dc voltage at the CR5-R46 node with the beam blocked. It should be approximately 15 volts and should have increased at least 6 mV above the value measured and recorded previously when the laser beam was unblocked. If not check R46, C27 or CR5. CR5 can be checked by removing power from the 5518A and checking for diode action of CR5 using a dc ohmmeter. Resistance measured in the reverse direction should be much larger than the resistance measured in the forward direction. If CR5 is OK replace U17.

e. In cases of marginal signal strength the following factors should be checked:


Laser assembly output power

Sampler assembly function


The laser assembly output power should be checked according to Laser Power Output Test, Paragraph 4-1b.

The sampler assembly can be checked as follows:

1. Remove power from the 5528A.
2. Remove A4
3. Rest the test polarizer, HP P/N 1000-0036, (supplied with 5518A), against the exposed Reference Receiver exit port of the sampler. The test polarizer will serve as a viewing screen in order to examine the laser beam which is normally incident on the Reference Receiver photodiode. Apply power to the 5518A. Examine the laser beam cross section illuminating the polarizer. It should be circular and centered within a few millimeters with respect to the exit port although slight eclipsing is normal. If any intensity variations are visible across the beam diameter they should be straight regularly spaced lines of high and low intensity, not spots or irregular shapes. Rotate the polarizer 90° and repeat the above observations. The sampler can be removed and the internal beam splitters and polarizers examined for scratches, dirt or cloudiness. Check the A3CR5 lens for scratches, dirt, or cloudiness. Also, see Liquid Crystal Troubleshooting step f.

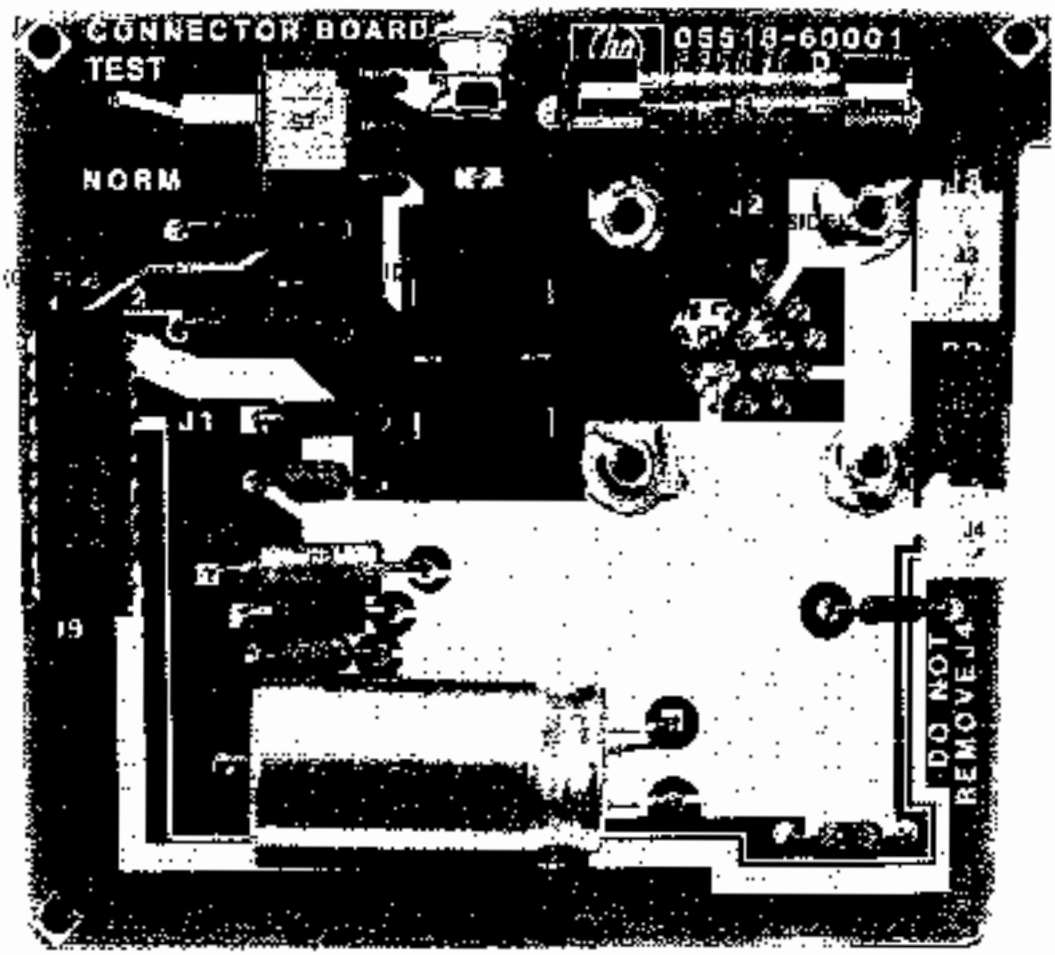

NOTE: Switches S1 and S2 have been deleted in 5518A A1 Connector boards with Date Codes 90232 and above.

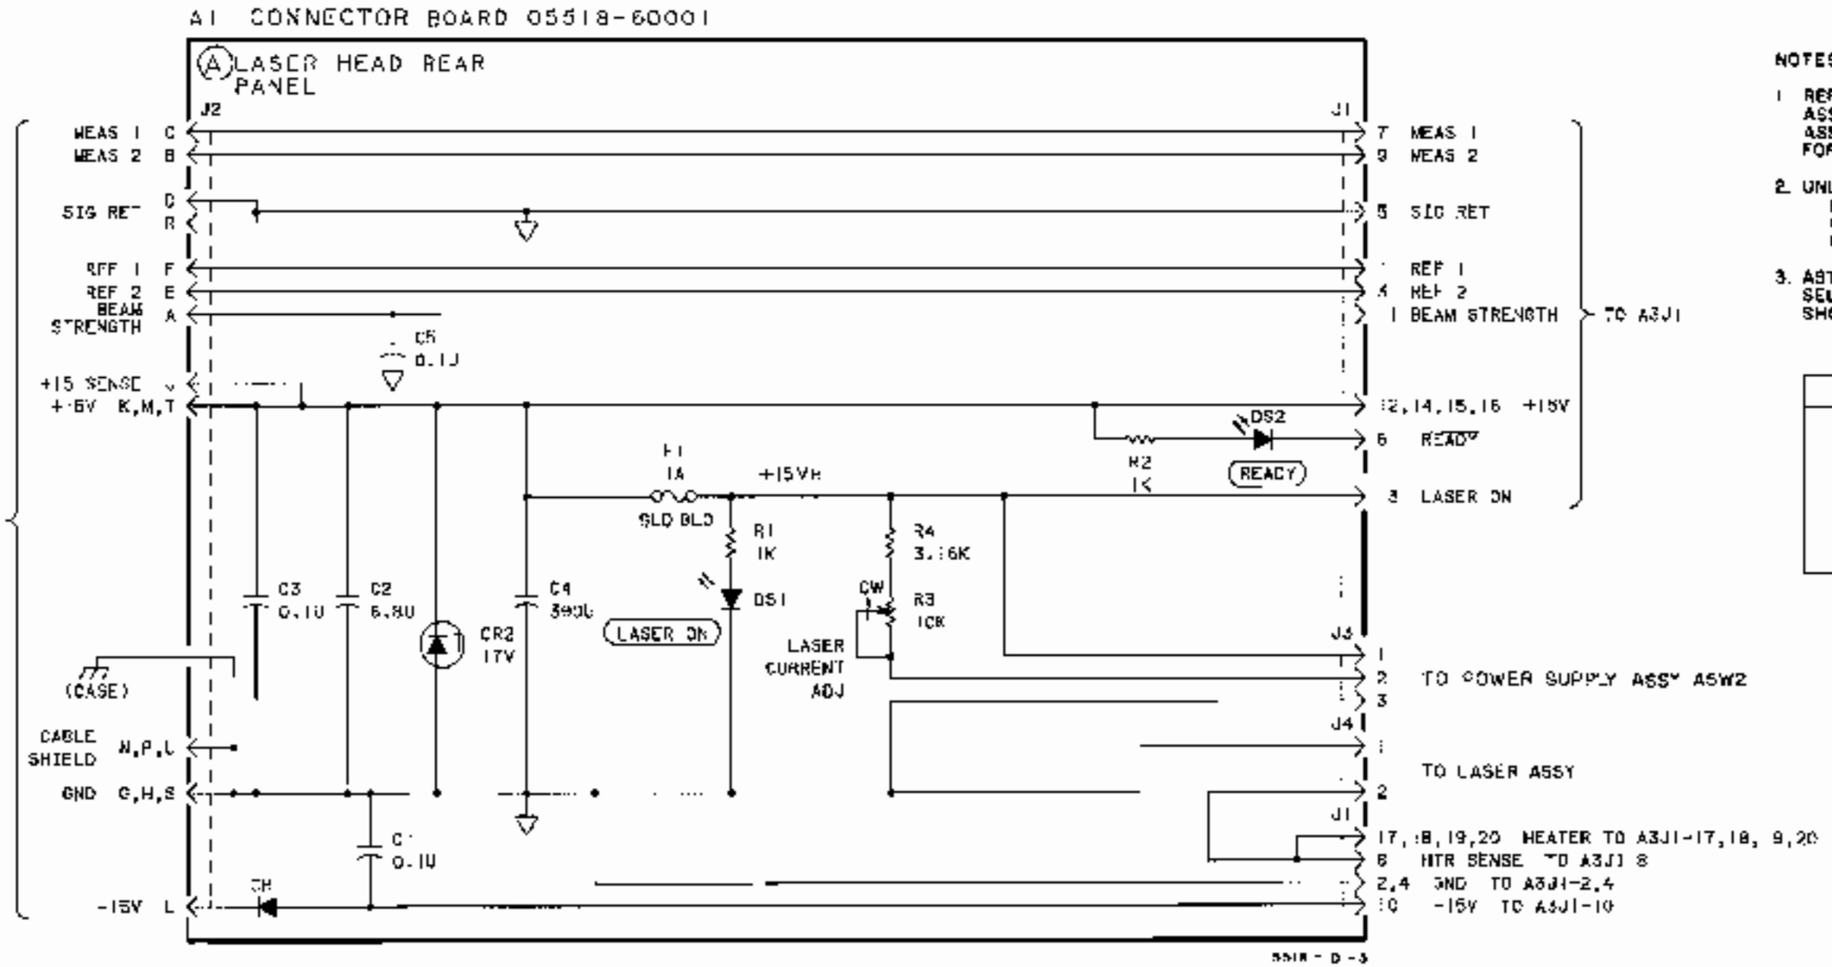

NOTES:


1. REFERENCE DESIGNATIONS WITHIN THIS ASSEMBLY ARE ABBREVIATED. ADD ASSEMBLY NUMBER TO ABBREVIATION FOR COMPLETE DESCRIPTION.
2. UNLESS OTHERWISE INDICATED:
   RESISTANCE IN OHMS;
   CAPACITANCE IN FARADS;
   INDUCTANCE IN HENRIES
3. ASTERISK (*) INDICATES FACTORY SELECTED COMPONENT, AVERAGE VALUE SHOWN.

Reference Designations
C1-5
CR1, 2
DS1, 2
F1
J1-4
R1-4


Figure 8-C-12. 5518A A1 Connector Board 05518-60001

Figure 8-C-12
551BA A1 CONNECTOR BOARD 05510-60001

|See Page 8-C-37|

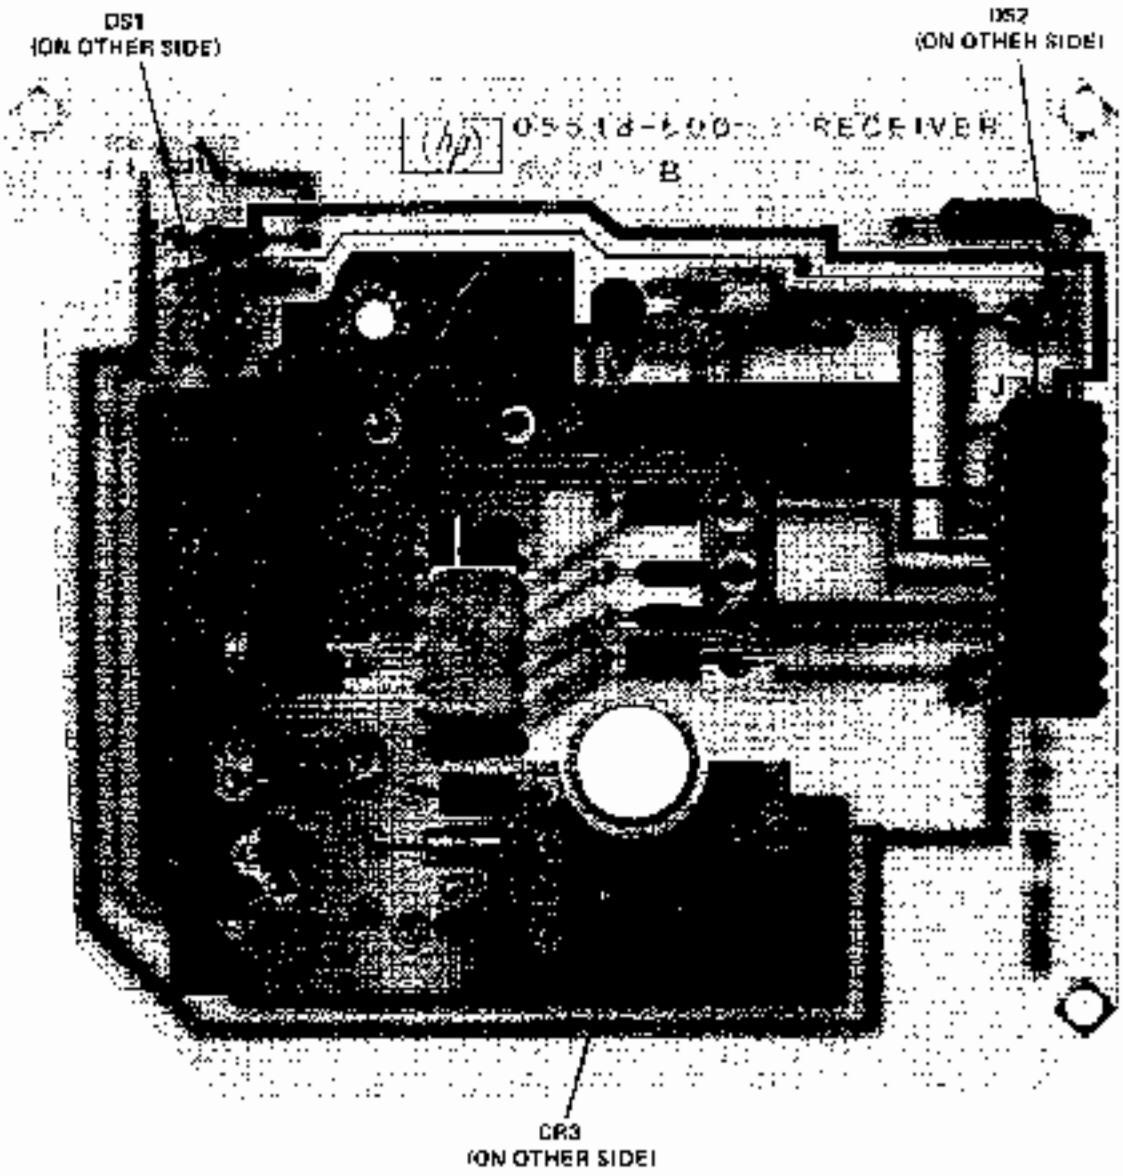
DS1
(ON OTHER SIDE)
DS2
(ON OTHER SIDE)
RECEIVER
B
CR3
(ON OTHER SIDE)

A2 MEASUREMENT RECEIVER BOARD 05518-60002 SERIES 2236

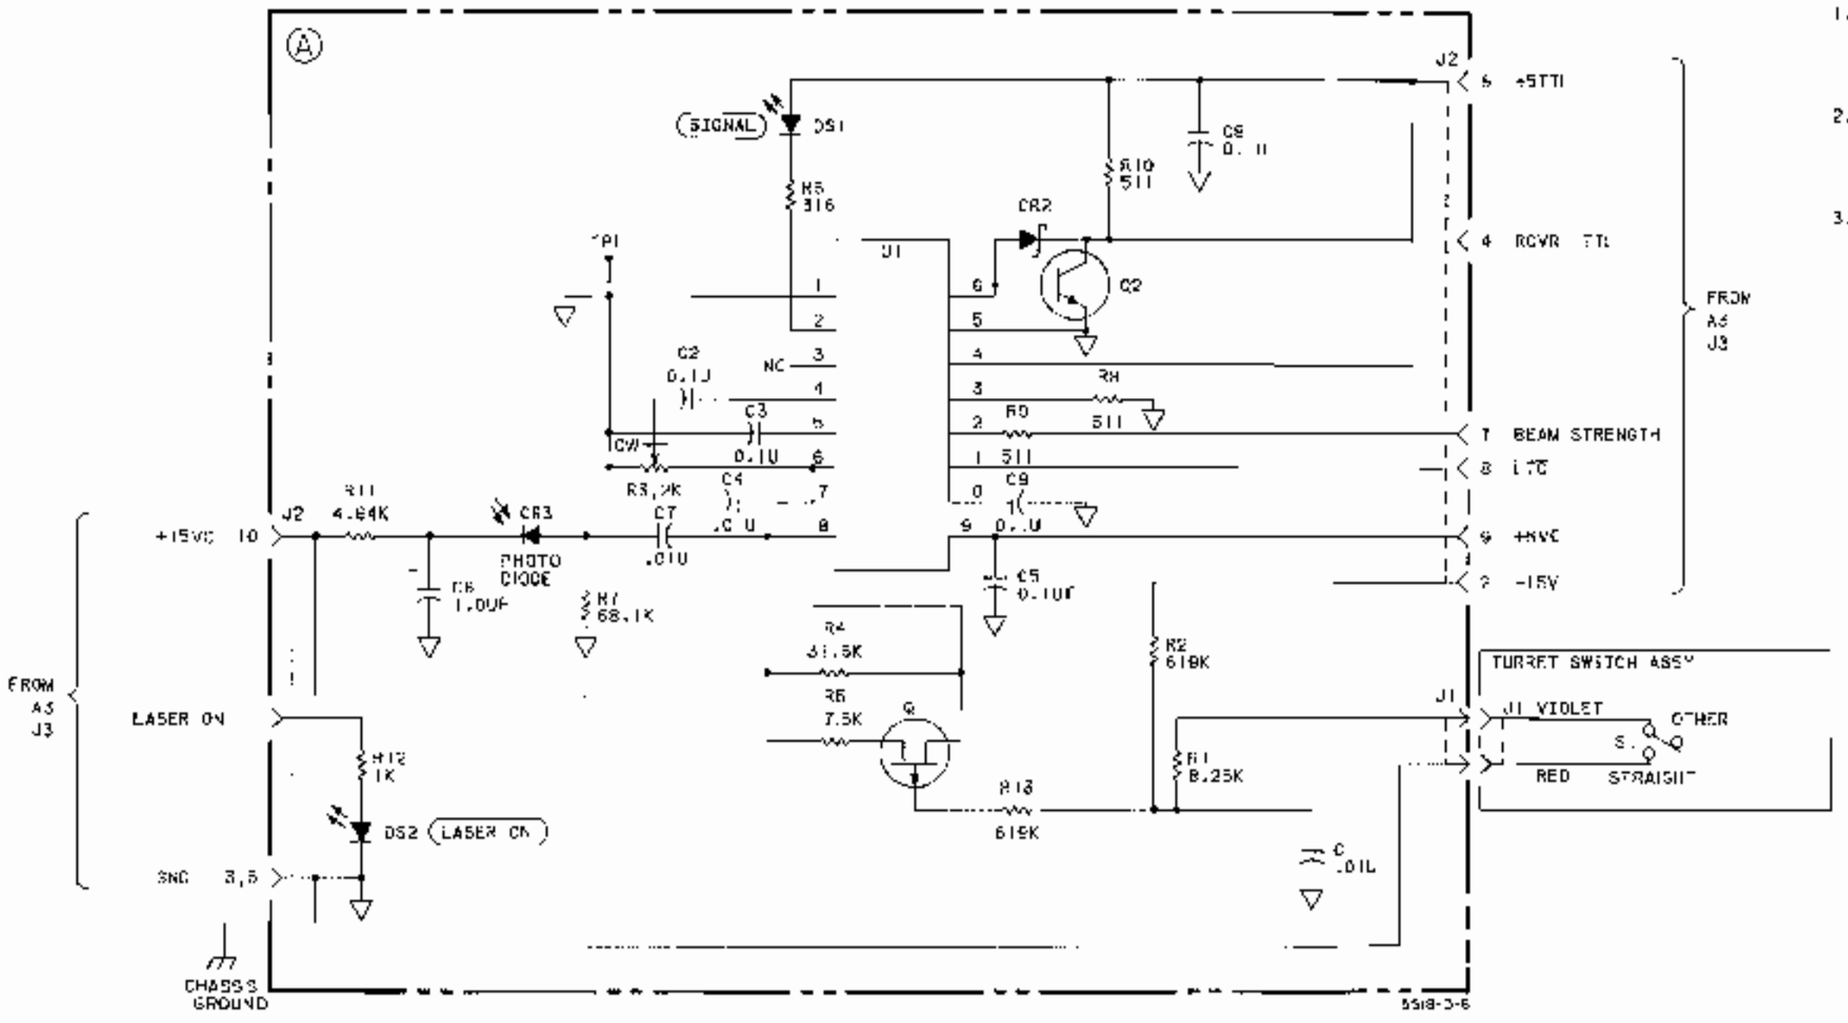

NOTES:

1. REFERENCE DESIGNATIONS WITHIN THIS ASSEMBLY ARE ABBREVIATED. ADD ASSEMBLY NUMBER TO ABBREVIATION FOR COMPLETE DESCRIPTION.
2. UNLESS OTHERWISE INDICATED:
   RESISTANCE IN OHMS;
   CAPACITANCE IN FARADS;
   INDUCTANCE IN HENRIES
3. ASTERISK (*) INDICATES FACTORY SELECTED COMPONENT, AVERAGE VALUE SHOWN.

REFERENCE DESIGNATIONS A2	
C1-9	DELETED CR1
CR2-3	
DS1-2	
J1-2	
Q1-2	
R 1-13	
TP1	
U1	
DELETED CR1	

TABLE OF ACTIVE ELEMENTS

REF DES	HP PART NO.	MFR PART NO
Q1	1855-0082	1855-0082
Q2	1854-0215	2N3904
J1	1826-0775	526-0075

Figure 8-C-13. 5518A A2 Receiver Board 05518-60002



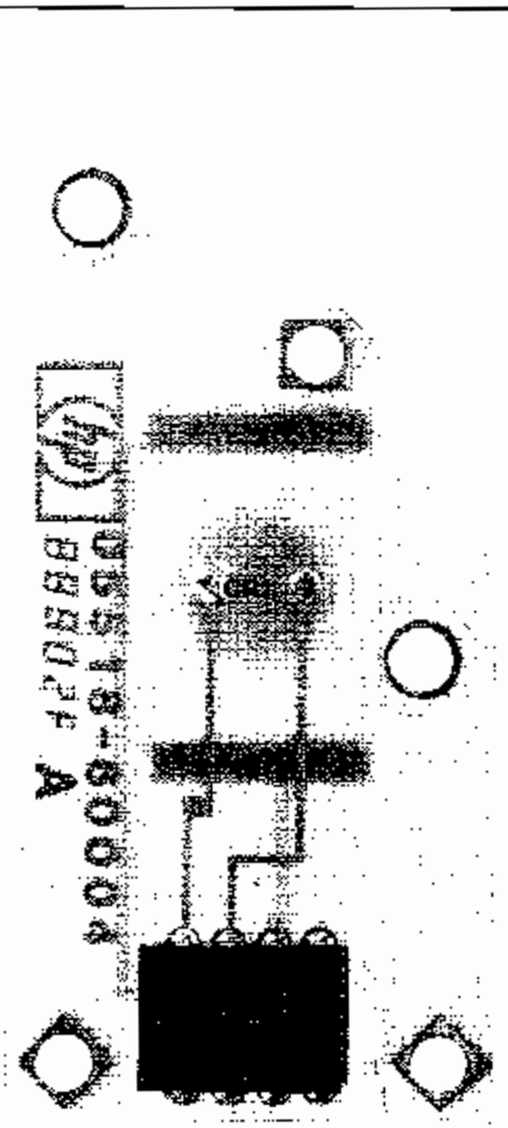


Figure 8-C-13
5518A A2 RECEIVER BOARD 05518-60002

(See Page 8-C-39)

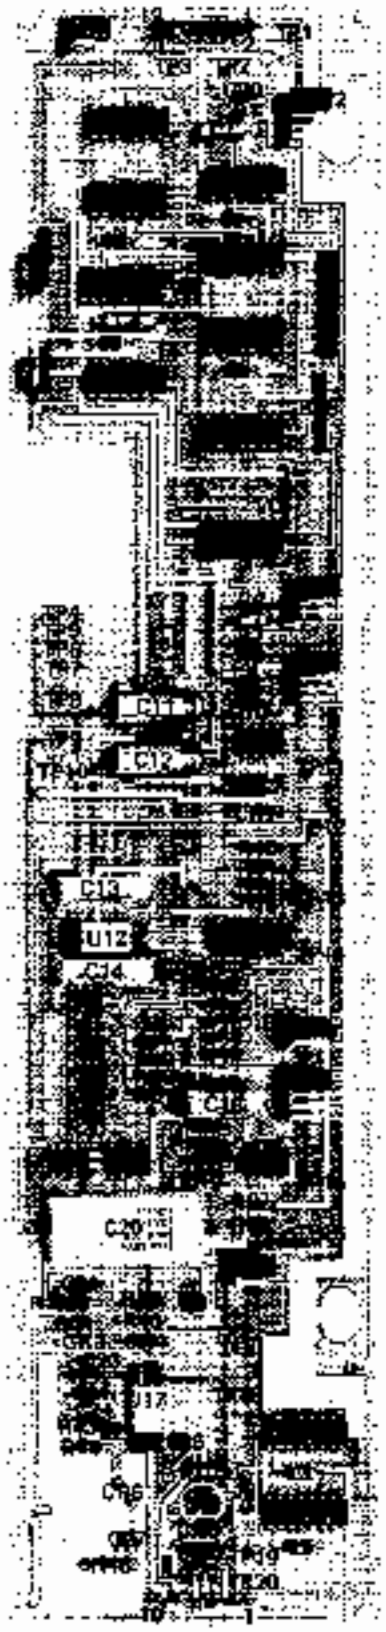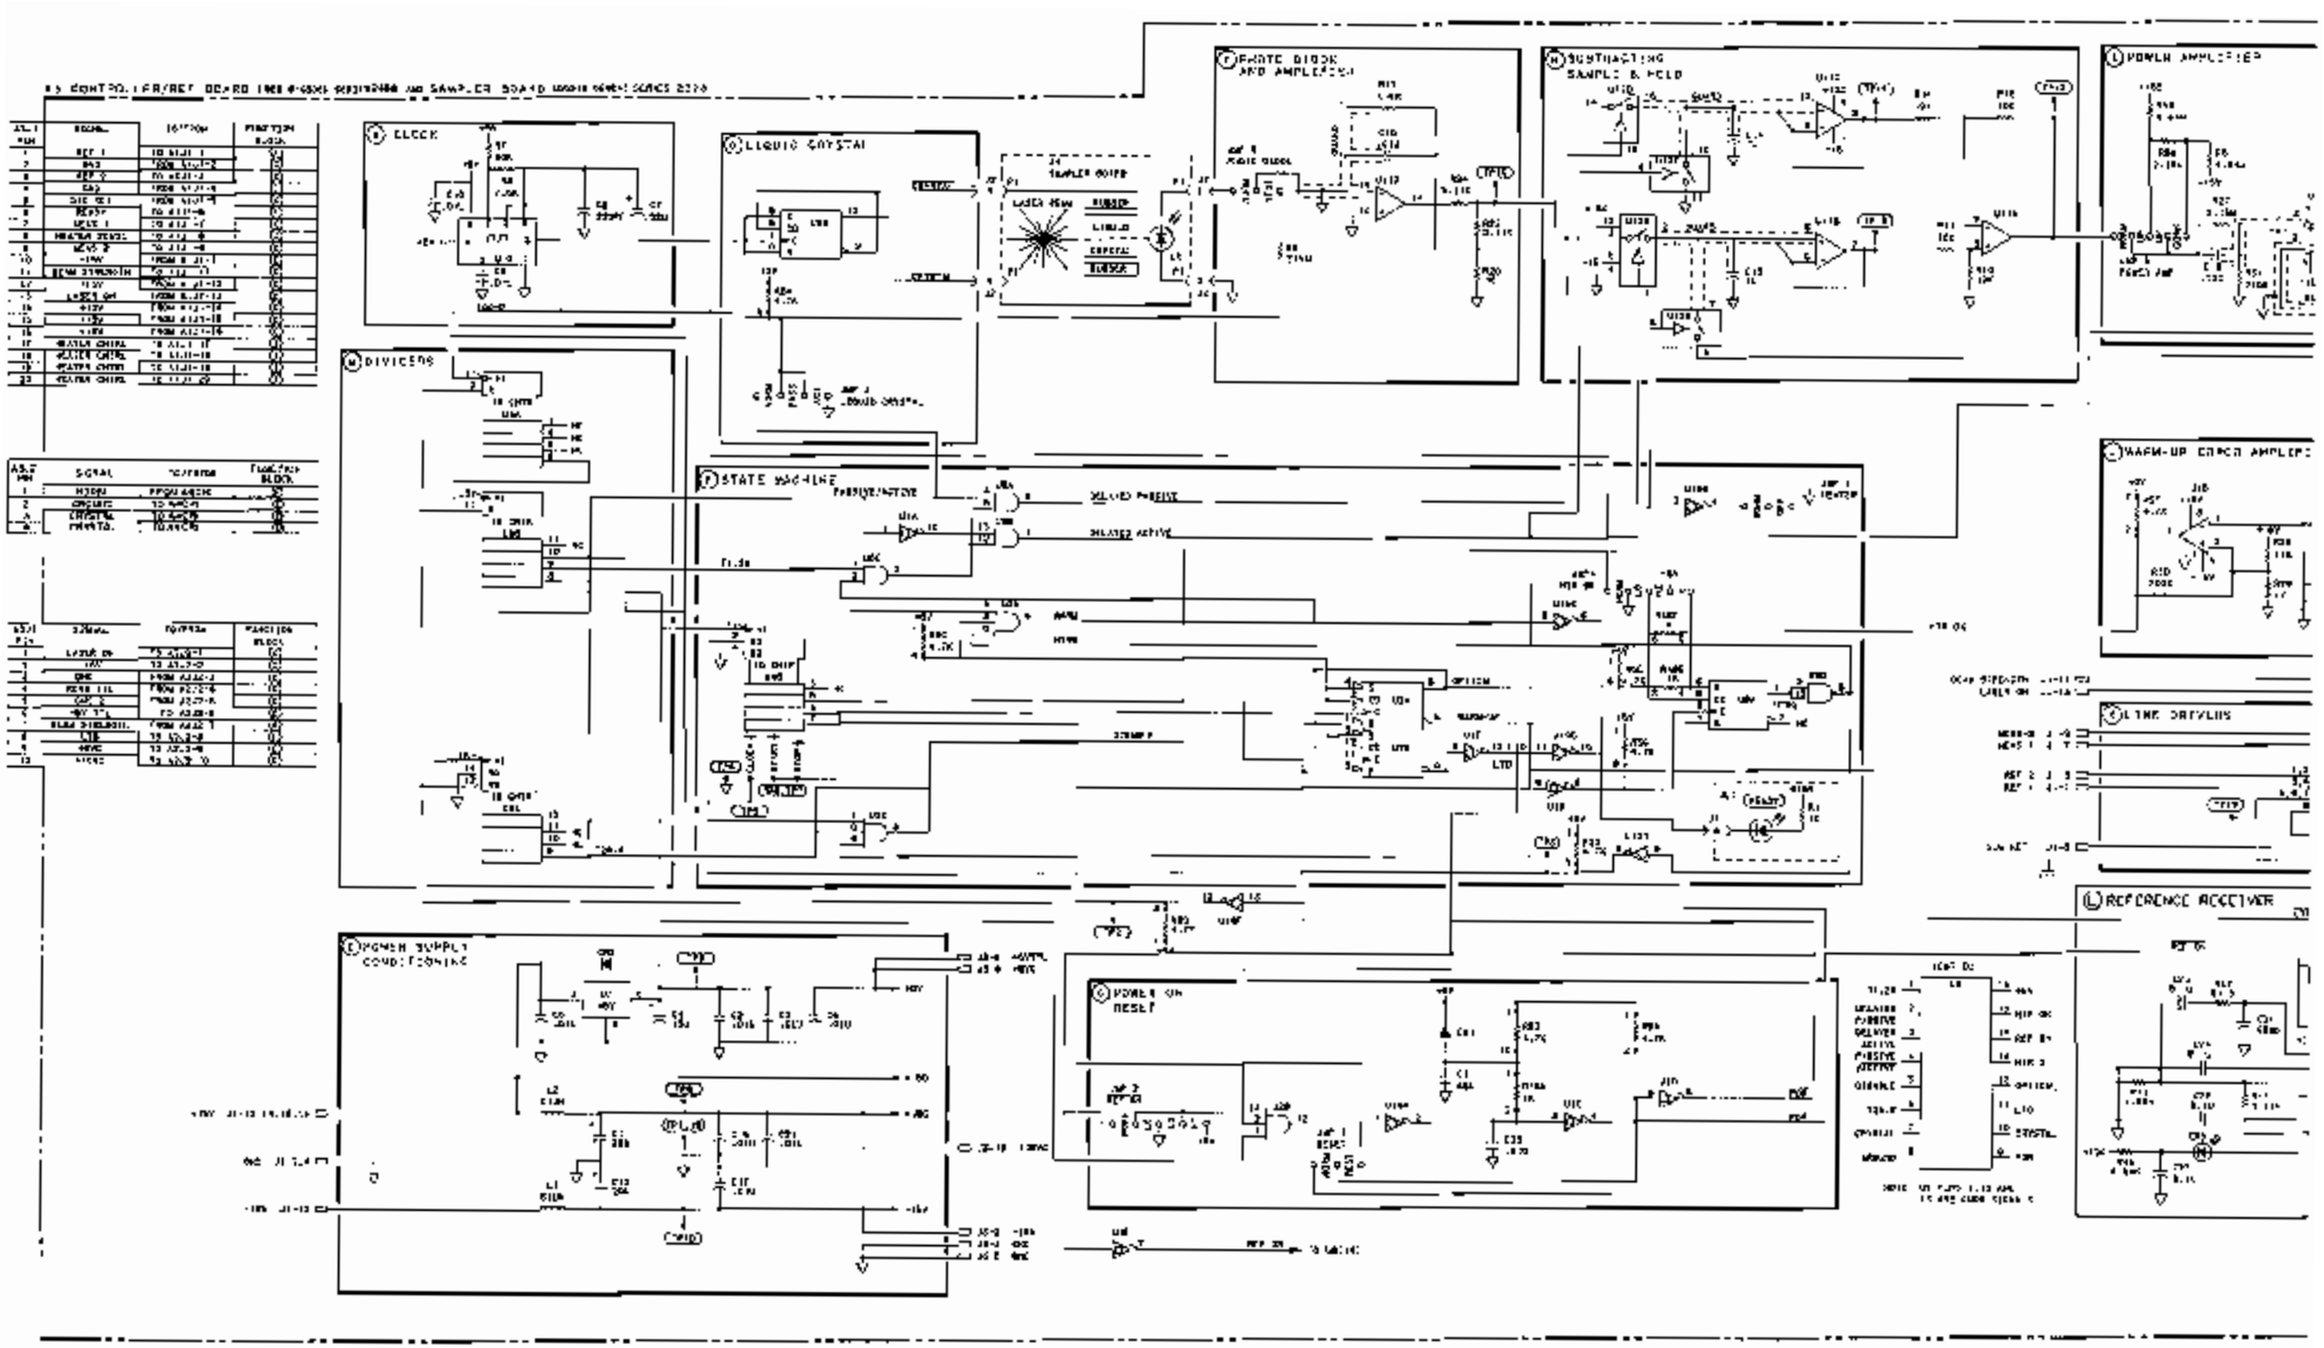

CONTROLLER/REFERENCE
COMPONENT LOCATOR
(SERIES 2408)


CONTROLLER/REF BOARD
SAMPLER BOARD
ELECT
LIQUID CRYSTAL
SAMPLER BOARD
LASER DIODE
RUBIDIUM
LITHIUM
CRYSTAL
GLASS
PULSE DRIVER AND AMPLIFIER
SUBTRACTING SAMPLE & HOLD
POWER AMPLIFIER
DIVIDERS
STATE MACHINE
PRESYNTHESIZE
SELECT PRESET
SELECT ACTIVE
WARM-UP ERROR AMPLIFIER
CLOCK DRIVERS
POWER SUPPLY CONDITIONING
POWER ON RESET
REFERENCE RECEIVER

NOTES:

1. REFERENCE DESIGNATIONS WITHIN THIS ASSEMBLY ARE ABBREVIATED. ADD ASSEMBLY NUMBER TO ABBREVIATION FOR COMPLETE DESCRIPTION.
2. UNLESS OTHERWISE INDICATED:
   RESISTANCE IN OHMS;
   CAPACITANCE IN FARADS;
   INDUCTANCE IN HENRIES
3. ASTERISK (*) INDICATES FACTORY SELECTED COMPONENT. AVERAGE VALUE SHOWN.

REFERENCE DESIGNATIONS
D1-3
DR1-8
J1-3
JMP1-7
L1-4
Q3, 5, 6
R2, 5-11, 14, 38, 39-41, 43, 44, 46, 48-52
TP1-20
U1-19

DELETED: C15, Q1, Q2, Q4, R1, R3, R4, R12, R13, R34, R35, R42, R45, R47.

TABLE OF ACTIVE ELEMENTS

Reference Desig.	HP Part No.	Mfr Part No.
D3	1853-0347	SLED100
D5, Q6	1854-0915	2N3904
U1	1820-1416	SN74LS14N
U2	1820-1201	SN74LS11N
U3	1820-1112	SN74LS74AN
U4	1820-2075	SN74LS138N
U5	1820-1201	SN74LS08N
U6	1820-2096	SN74LS139N
U7	1820-1122	7805UC
U8	1820-0555	CD4013BE
U9	1820-0510	1820-0510
U10	1820-1466	ICM7556IPA
U11	1826-0255	LM340AZ-5
U12	1826-0416	LP2951D
U13	1826-0435	MC34064P-5
U14	1826-0296	1826-0296
U15	1826-0065	UPD751C
U16,18	1820-1866	SN75110N
U17	1826-0275	1826-0275
U19	1820-0411	DAC-08A

Figure 8-C-14. 5519A A3 Controller/Reference Board 05528-60003 and A4 Sampler Board 05528-60004

Figure 8-C-14
5510A A3 CONTROLLER/REFERENCE BOARD 05518-60003 AND A4 SAMPLER BOARD 05518-60004

(See Page 8-C 41)

SECTION VIII-D
10751A/B AIR SENSOR

	Page
Circuit Theory	8-D-1
Air Pressure	8-D-1
Air Temperature	8-D-5
Air Humidity	8-D-5
Analog Ground	8-D-5
Troubleshooting	8-D-6
Cautions, Warnings	8-D-6
Air Sensor Errors	8-D-7
Humidity Indicator Troubleshooting	8-D-8
Air Temperature Troubleshooting	8-D-8
Air Pressure Troubleshooting	8-D-8
Schematic Diagram	8-D-9

SECTION VIII-D

10751A/B AIR SENSOR

8-D-1. 10751A/B AIR SENSOR CIRCUIT THEORY

8-D-2. Paragraphs 8-D-4 through 8-D-27 contain circuit theory for the 10751A/B. Paragraphs 8-D-28 through 8-D-40 cover the troubleshooting information.

8-D-3. The schematic diagram for 10751A/B is shown in Figure 8-D-4. The schematic has functional blocks that are labeled alphabetically with circled letters. These labels correspond to the circled letters in the text for the circuit theory.

8-D-4. The 10751A/B Air Sensor measures air pressure and air temperature and has provision for entering one of three values of ambient humidity, "high", "low", or "normal". These are supplied in signal form, AP, AT, and AH to the Processor in the 5508A Measurement Display where they are used to compensate for the dependence of laser wavelength on the permittivity of air.

8-D-5. Air Pressure

8-D-6. Pressure Signal Offset Circuitry (A) (D) (G)

8-D-7. The offset adjustment circuits consist of +10 V offset U5-Q2, -10 V offset U4, and offset calibration network R7. The -10 V offset is derived from the +10 V offset by means of U4 which has a gain of -1. Resistors R19A and B are precision resistors and R18 is the bias current compensating resistor. Jumper S1 allows for either positive or negative offset adjustments and is used only during calibration.

8-D-8. The ±10 V at the output of S1 is divided to ±74.4 mV by R12 and R11 and applied to jumpers S10-S17. The jumpers can apply either ±74.4 mv or ground to the R/2R network. The information applied to R7 by the jumpers is treated as a binary integer B (where $0 \leq B \leq 255$). The jumpers are set during the calibration procedures and there after should not be changed. The output of the R/2R network (pin 16) is:

$$Vout = (B \div 256) \times Vin$$

Example. $Vout = (51 \div 256) \times 74.4\ mV$

$$Vout = 14.8\ mV$$

8-D-9. U1 amplifies the output of R7 (pin 16) by 2 and sums it with the pressure signal from U3 to form AP. This gives a maximum AP offset of ±(74.4 mV × 2) = 148.8 mV. Full-scale output is 0.95 Volts. The resultant adjustment range is nominally ±16 percent. The air pressure characteristics are shown in Figure 8-D-1.

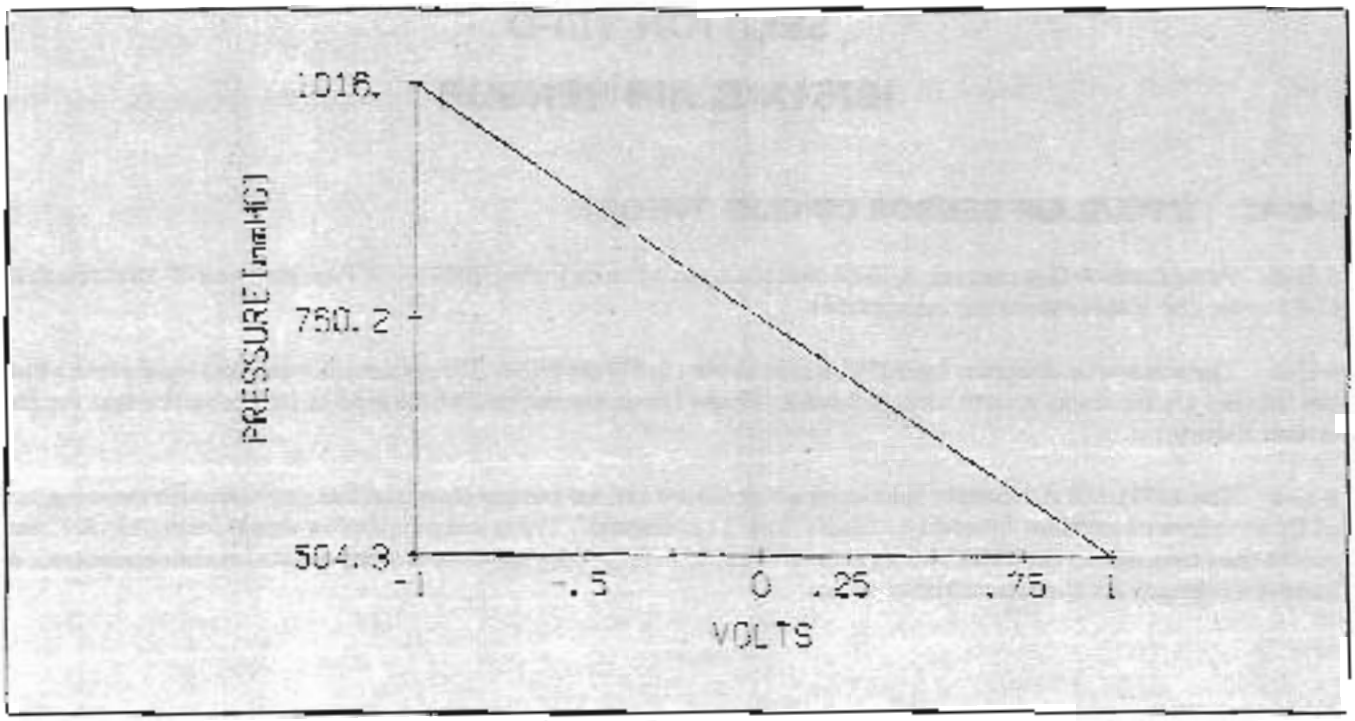


Figure 8-D-1. Air Pressure Characteristics

8-D-10. Pressure Signal Gain Circuitry (E) (H) (J) (K)

8-D-11. The block diagram for the Commutating Auto-Zero (CAZ) Instrumentation Amplifier U3 is shown in Figure 8-D-2. U3 provides amplification of the pressure transducer output (30 mV) with an accuracy of 0.1% full scale. The commutation of the differential to single-ended voltage converter allows the instrumentation amplifier to have a frequency response from DC to 10 Hz. Capacitors C10 and C11 are alternately connected to the differential inputs, then to the + input of the CAZ operational amplifier and ground.

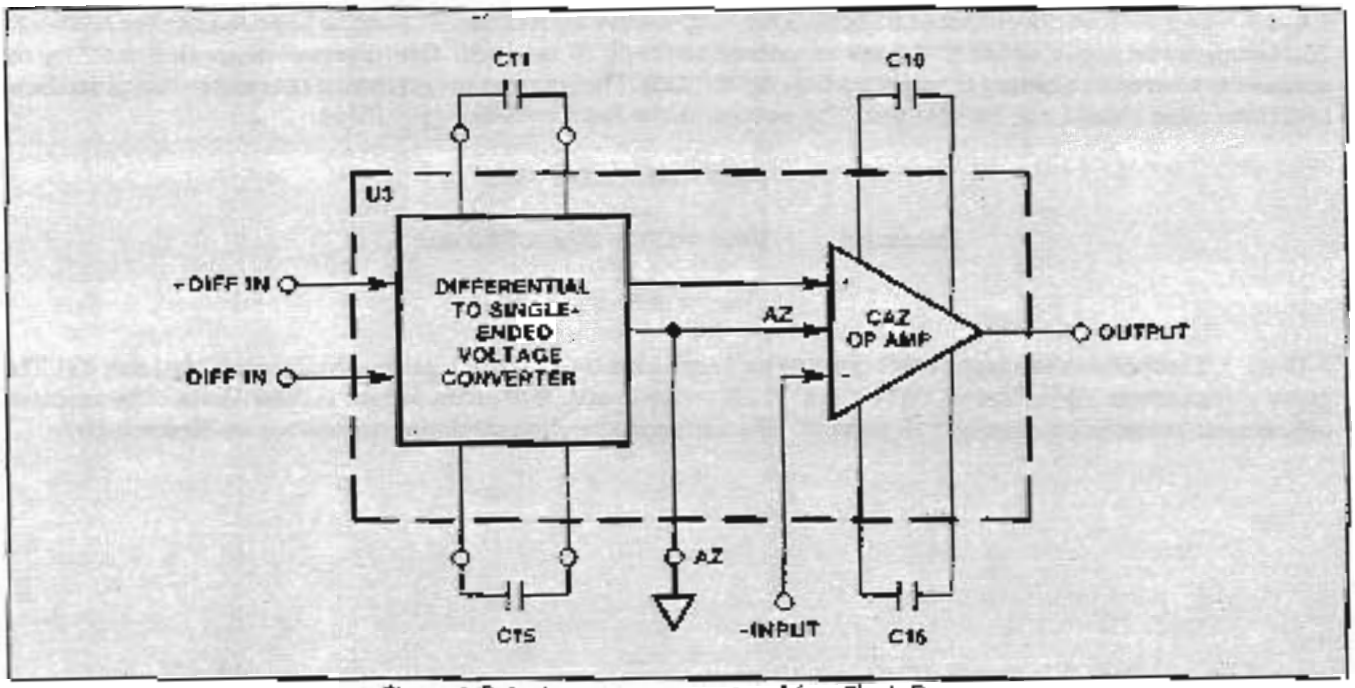


Figure 8-D-2. Instrumentation Amplifier Block Diagram

8-D-12. The CAZ op amp section of the amplifier contains two op amps whose functions alternate to provide the auto zeroing feature. Referring to Figure 8-D-3, the CAZ op amp has a third input terminal, AZ. The voltage on the AZ input is the level to which each of the internal op amps is auto-zeroed. In mode A, op amp number 2 is configured in a unity gain mode by integrated switches and charges C16 to a voltage equal to the input offset voltage of the amplifier. While C16 is charging, op amp number 1 passes the input signal with its input compensated by C10. In mode B, the functions of the internal op amps are switched.

NOTE

The voltages of C10, C16, C11, C15 cannot be measured without affecting amplifier output.

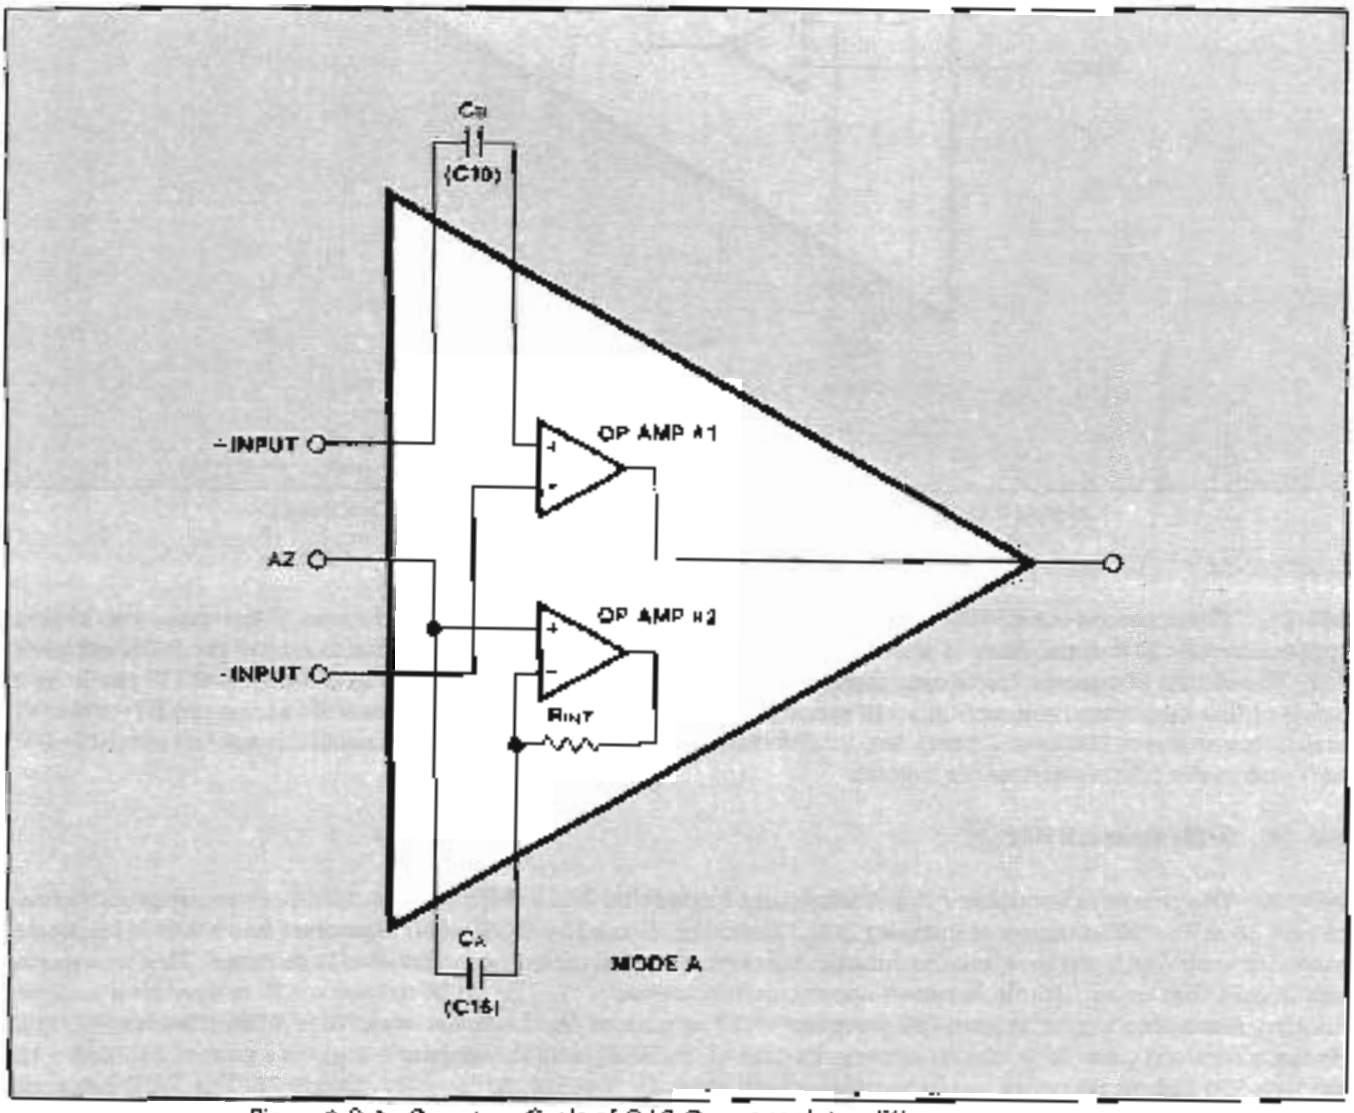


Figure 8-D-3 Operation Cycle of CAZ Operational Amplifier

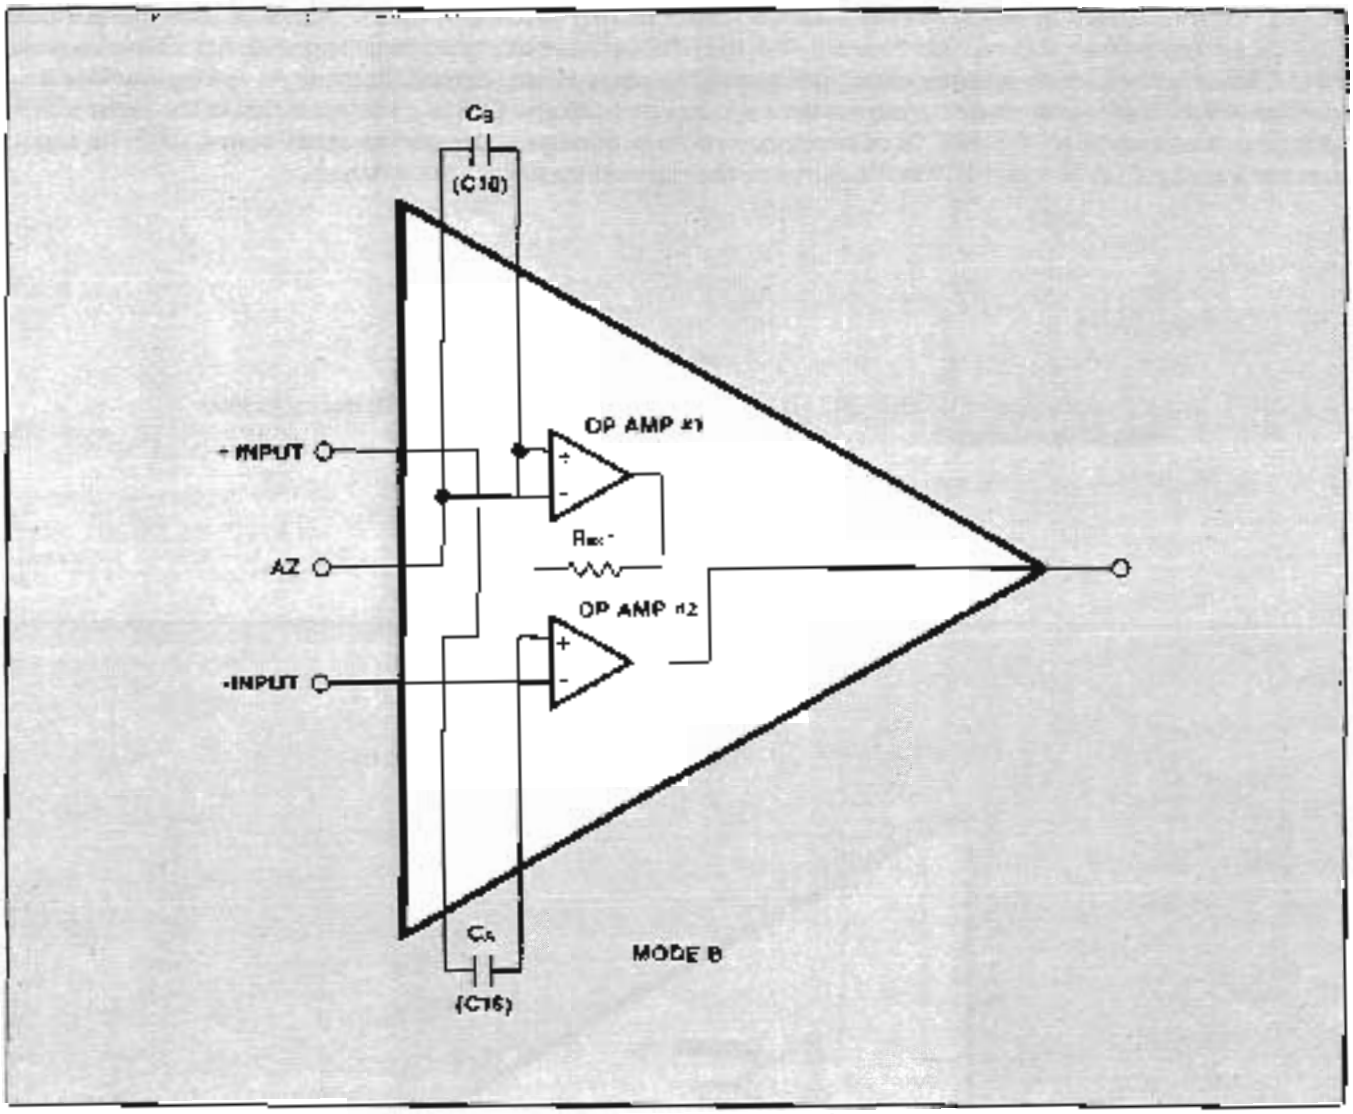


Figure 8-D 3. Operation Cycle of CAZ Operational Amplifier (Continued)

8-D-13. The op amps inside U3 are CMOS and have an output impedance of 50 kohms. Since these are driving approximately 20 kohms, there is some loss of open loop gain. Most of this loading is due to the R/2R network R16. The circuit is susceptible to oscillation when a capacitive load is connected to the output at U3 pin 9. As a result of this limitation, connecting a x20 scope probe to the output of the amplifier will cause a small (~100 mV) oscillation at about 100 kHz. Connecting a voltmeter to this node may result in an oscillation at full output (~8 V p-p) and make all measurements invalid.

8-D-14. R/2R Network R16 (H)

8-D-15. The pressure transducer is a strain-gauge bridge that has a differential output between approximately 25 and 38 mV at 30.54 inches of mercury (775.72 mm Hg). Since the 5508A A/D Converter has a 0.95 V full scale range for unipolar input to minimize quantization error, amplification up to this level is required. This translates into a gain that is adjustable between approximately 89 and 117. The R/2R network R16 is used as a voltage divider. Assuming a gain of zero (all jumpers = 0), the gain of feedback network R9 is 4.66k/554.66k = 1/119, giving a forward gain 1/1 = 118. Assuming the gain of the R/2R is 1 (all jumpers = 1, gives a gain of 255/256 ~ 1), the two 550 kohms resistors are in parallel which gives f = 4.66k/359.5k = 1/77, gain = 77. The R/2R network jumpers S2 through S9 are set during calibration and should not be changed otherwise.

8-D-16 Potentiometer R8 allows finer resolution since the R/2R adjustment resolution is limited to 9 bits. With a potentiometer accuracy of 1% (limited by shock and vibration), the combination of digital and potentiometer adjustment provides adjustment accuracy of 0.006%.

8-D-17. Output Buffer U1 (J)

8-D-18. U1 performs three functions. First, it buffers the high impedance output of U3 providing a low impedance source capable of driving the Air Sensor cable and the input impedance of the 5508A analog inputs. Second, a low pass filter configuration is used to remove the commutation spikes from U3's output. Third, the offset adjustment developed by R7 is summed into AP.

8-D-19. The low pass filter configuration is a 2nd order filter with poles at 0.3 and 2.1 Hz, a precise DC gain of 1 for the signal from U6, and a gain of 2 for the offset signal from R7. Precision resistor network R15 determines the gain. R6 affects AC gain only. R5 is a bias current compensation resistor.

8-D-20. Air Temperature (I)

8-D-21. The air temperature measurement is identical to the temperature measurement of the material temperature sensors with the exception that the Air Sensor temperature transducer AT is mounted on a heatsink in free air.

8-D-22. The Air transducer is an absolute temperature sensor which outputs 1 microampere per degree kelvin. Operational amplifier U2 provides current to voltage conversion with a trans-resistance gain of 33.5 k ohm (33.5 kohm = R1 + R3). The input range of the A/D converter in the 5508A Measurement Display is $-1\ V \leq Vin \leq +1\ V$. +10 Vref is applied to the positive input of U2 to provide the necessary offset. At 25.36 degrees centrigrade, the op amp output, AT, equals 0 Volts. It has a slope of −33.5 mV/°C over the entire operating temperature range. Resistor R2 is a bias current compensation resistor. C2 eliminates noise from the temperature signal (MT) which is essentially DC, and A2C1 and A2C2 provide EMI rejection.

8-D-23. Air Humidity (F)

8-D-24. Humidity has very little effect on the speed of light in air. For example, it exerts only 0.1ppm error on a distance measurement for 10% humidity error. For this reason, only three humidity selections are provided: 25%, 50% and 75%. These ranges are selected by a switch on the Air Sensor. If the switch is optimally set*, the maximum humidity error is 15% yielding 0.15 ppm measurement error. The signal AH is either ground, −0.7 V or −−0.7 V. The 5508A uses thresholds at ±0.5 V for this measurement. If AH is above +0.5V, RH = 75%; below −0.5 V, RH = 25%, and between −0.5 V and +0.5 V, RH = 50%.

$$\text{low} = \frac{50 + 25}{2} = 37.5\%$$

$$\text{high} = \frac{75 + 25}{2} = 62.5\%$$

8-D-25. Analog Ground

8-D-26. The 10751A/B Air Sensor is an analog circuit, whose outputs are measured by the 5508A A/D Converter with respect to true ground (5508A chassis). Ignoring U6, it is not feasible to have a low-current ground line to which AT and AP could be referenced. All of the connections tied to the ⏚ symbol on the schematic must be referred to true ground. Unfortunately, this would feed too much current back on the ground lead causing between 1.5 mV to 7 mV of ground drop depending on the resistance of the grounds wire.

*Optimal switch setting (Operator selected) for low and high

8-D-27. U6, Q1 and R17 are used to provide an alternate path for the air sensor ground current. U6 measures and replicates analog ground with a maximum offset of 150 uV and diverts the ground current from all Air Sensor ⏚ symbols into the ±15 V supplies. Analog ground is the same as the 5508A chassis potential and connects to the + input of U6. The replicated ground exists at the output of U6. CR3 protects the circuitry should the ground buffer fail and resistor R3 protects Q1 against the loss of the analog ground signal. R17 lessens the current load on Q1 to reduce its power dissipation.

8-D-28. 10751A/B AIR SENSOR TROUBLESHOOTING

CAUTION

DO NOT CONNECT TEST INSTRUMENT GROUND LEADS TO ANALOG GROUND IF THEY ARE TRUE GROUNDED (THIRD PRONG); OR REFERRED TO GROUND) ANYWHERE IN THE 5508.

If you wish to accurately measure a voltage that is referred to ⏚ it can be measured differentially, referred to ⏚ using a voltmeter with floating inputs (e.g., HP 3456A). Note that the inputs to the 5005A Signature Multimeter (recommended service equipment) are NOT floating; the [N] lead is connected to true ground.

Alternatively, you can ground the test instrument probes to the shield ground but remember that some small DC offset will exist between the probe ground and the ground inside the air sensor.

CAUTION

CMOS CHIP's, such as U3, are susceptible to static when removed from a circuit board. U3 is also subject to SCR latchup when either the air sensor is plugged into the 5508A after power-up, or when the ±5 V supplies are shorted. If you suspect that any of the power supplies has momentarily shorted, feel U3. If hot to the touch, turn off power, allow sufficient time to cool, then reapply power. If U3 heats up again within a minute or so, either U3 is bad, or a circuit fault exists which is causing SCR latchup.

Be sure to turn off the 5508A when opening the 10751 housing. The inside of the housing is conductive and catastrophic short circuits may occur.

CAUTION

The pressure transducer, 10751-60303, in the air probe senses pressure on its front face. This face is a stainless steel diaphragm which can be easily deformed by touching or undue pressure. If it is necessary to touch the transducer, avoid touching the diaphragm.

CAUTION

Static electricity can result in permanent degradation or catastrophic failure of the instrument or assemblies removed from the instrument.

All work performed on assemblies or instruments with covers removed must be at a static safe work station that provides proper grounding for the operator.

Always store and transport assemblies in a static shielding bag.

8-D-28. Proper operation of the 10751A/B can be verified when the unit is connected to a 5508A Measurement Display. All measurements can be displayed using the VOL key. The information in Paragraph 8-A-48, 10751A/B and 10757A/B/C Sensor Errors and Paragraph 8-A-79, 10751A/B Isolation should be used to verify that a problem exists in the 10751A/B before consulting the troubleshooting information in this section. Should troubleshooting be required, the 10751A/B Air Sensor Theory of Operation, Paragraph 8-D-1, provides the necessary background for applying the 10751A/B Air Sensor Troubleshooting and Repair Procedures.

8-D-30. If a 10751A/B fails, it is recommended that the unit be returned to Hewlett-Packard. Most repairs require recalibration. The Calibration procedures for the 10751A/B are given in Section IV, Performance Test and Calibration. Field repair is limited to replacing boards A1, A2, the Pressure Transducer, cables, and mechanical parts.

8-D-31. Air Sensor Errors

8-D-32. Temperature Measurements. The 10751A/B produces a voltage level, AT, that decreases linearly with increasing temperature. This signal is bipolar and centered about 0 volts at approximately 25°C (77°F). An error message is displayed by the 5508A if a temperature signal exceeds the ±1 V range of the Analog-to-Digital converter. The temperature measurements require +15 V and -15 V supplies and +10 Vref from the 5508A. Note that the temperature sensor is calibrated for 0 to 40°C operation which does not require the full ±1 Volt range of the 5508A Analog-to-Digital Converter.

8-D-33. Pressure Measurement. The 10751A/B also measures air pressure by supplying a D.C. voltage, AP, that decreases linearly with increasing air pressure. An error message is displayed by the 5508A if the air pressure signals exceed ±1 Volt. The air pressure signal is bipolar and centered about 0 Volts at 760.2 mm Hg (29.93 inches Hg). +10 Vref is not used for the air pressure measurement, only the +15 V and -15 V power supplies are required.

8-D-34. Humidity Switch. The humidity switch sends one of three voltages to the 5508A:

Switch Setting	Voltage (Nominal)
75%	0.7 V (approx)
50%	0.0 V
25%	-0.7 V (approx)

8-D-35. A/D conversion errors or faulty probes can cause probe errors to be displayed by the 5508A (See Paragraph 8-A-44, Error Messages). Inaccurate readings, which do not cause error messages, can also occur. Probe data, in english or metric units, can be observed directly by using procedures described by the front panel key descriptions in Section III.

8-D-36. The 5508A and the probes can be checked without having the Laser Head attached. By setting the Processor Board S/A test switch to 00010000 and toggling MASTER RESET the 5508A substitutes the system clock frequency into the REF and MEAS counters. In this mode, the 5508A functions exactly as it does in measurement modes except displacement will always read zero (REF = MEAS = 1 MHz). Voltage characteristics for the Air Pressure and Air Temperature signals, as given in Paragraph 8-A-91, can be used for operational verification and trouble isolation.

8-D-37. Humidity Indicator Troubleshooting

8-D-38. The humidity circuit consists of two resistors and a switch. Refer to Analog Ground troubleshooting, Paragraph 8-D-25, before replacing A1.

Switch Position	AH Value (Nominal)
HI	0.7 V
NORM	0.0 V
LOW	-0.7 V

8-D-39. Air Temperature Troubleshooting

a. Verify that +15 V, -15 V and +10 Vref are within tolerances given in Paragraph 8-A-01.


b. Verify +10 Vref on both sides of R3. Voltage drops of more than 1 mV across R3 may indicate a failure of U2. Replace A1.

c. Measure voltage on pin 2 of U2. If it is within 1 mV of +10 Vref, verify feedback resistor values before replacing A2. If pin 2 is outside this 1 mV range, disconnect the temperature sensor board from the main board. If pin 2 is now within 1 mV of +10 Vref, replace A2. Otherwise replace A1. U2 output should rise to 10 V with the temperature sensor disconnected.

8-D-40. Air Pressure Troubleshooting

a. Verify that +15 and -15 V are within tolerances given in Paragraph 8-A-01.

b. Check Pressure Transducer output. See Figure 8-D-1. If improper, replace Pressure Transducer. If OK, replace A2.

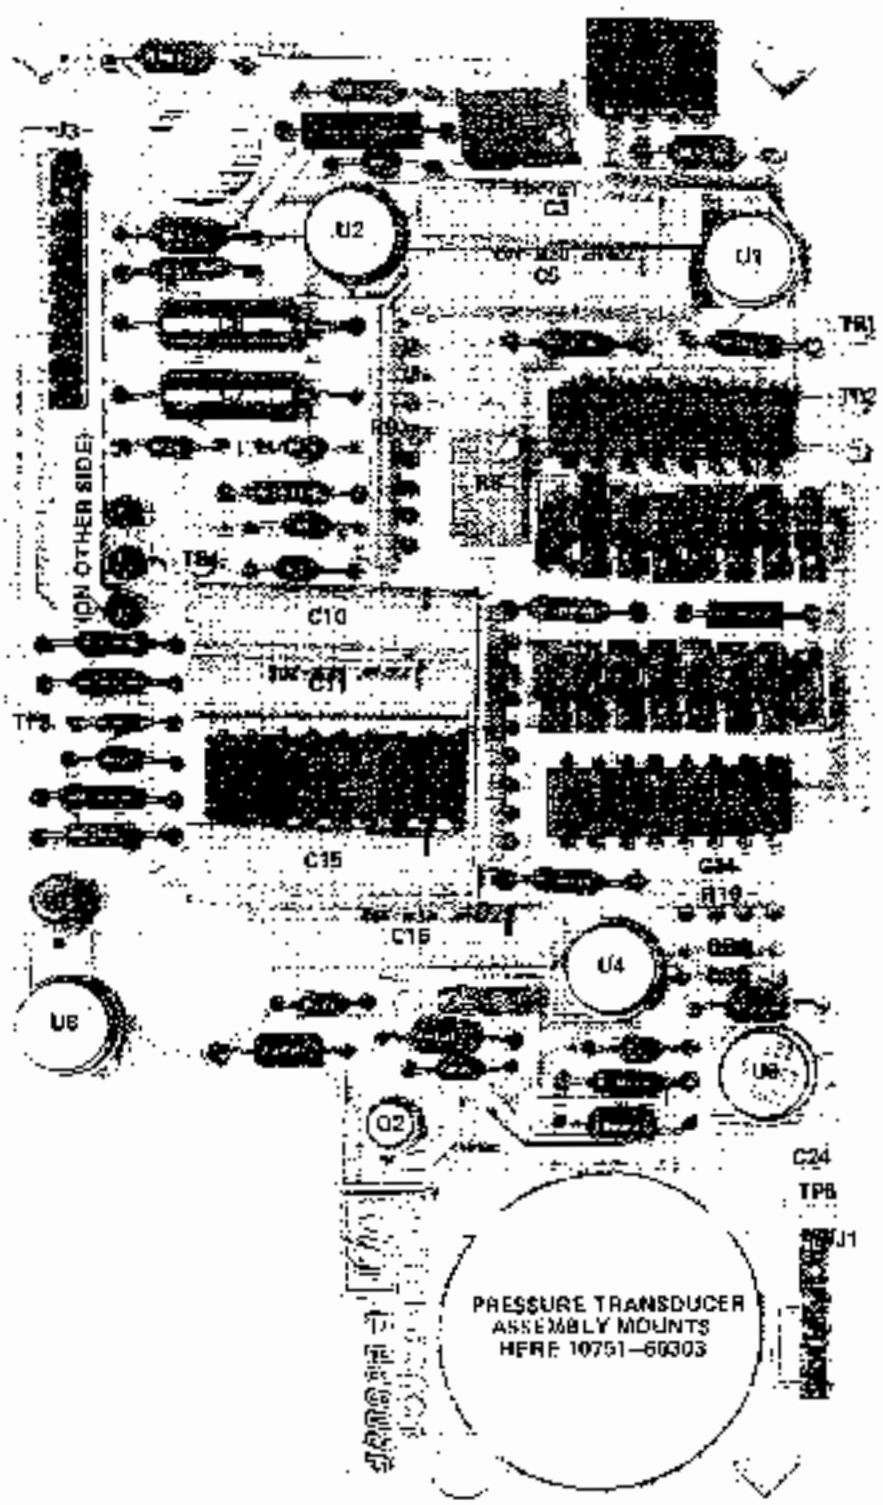
J3
U2
U1
C5
TP1
J12
R8
(ON OTHER SIDE)
TP4
C10
C11
TP3
C15
C16
C14
R19
U4
U6
U5
Q2
C24
TP5
J1
PRESSURE TRANSDUCER
ASSEMBLY MOUNTS
HERE 10751-60303

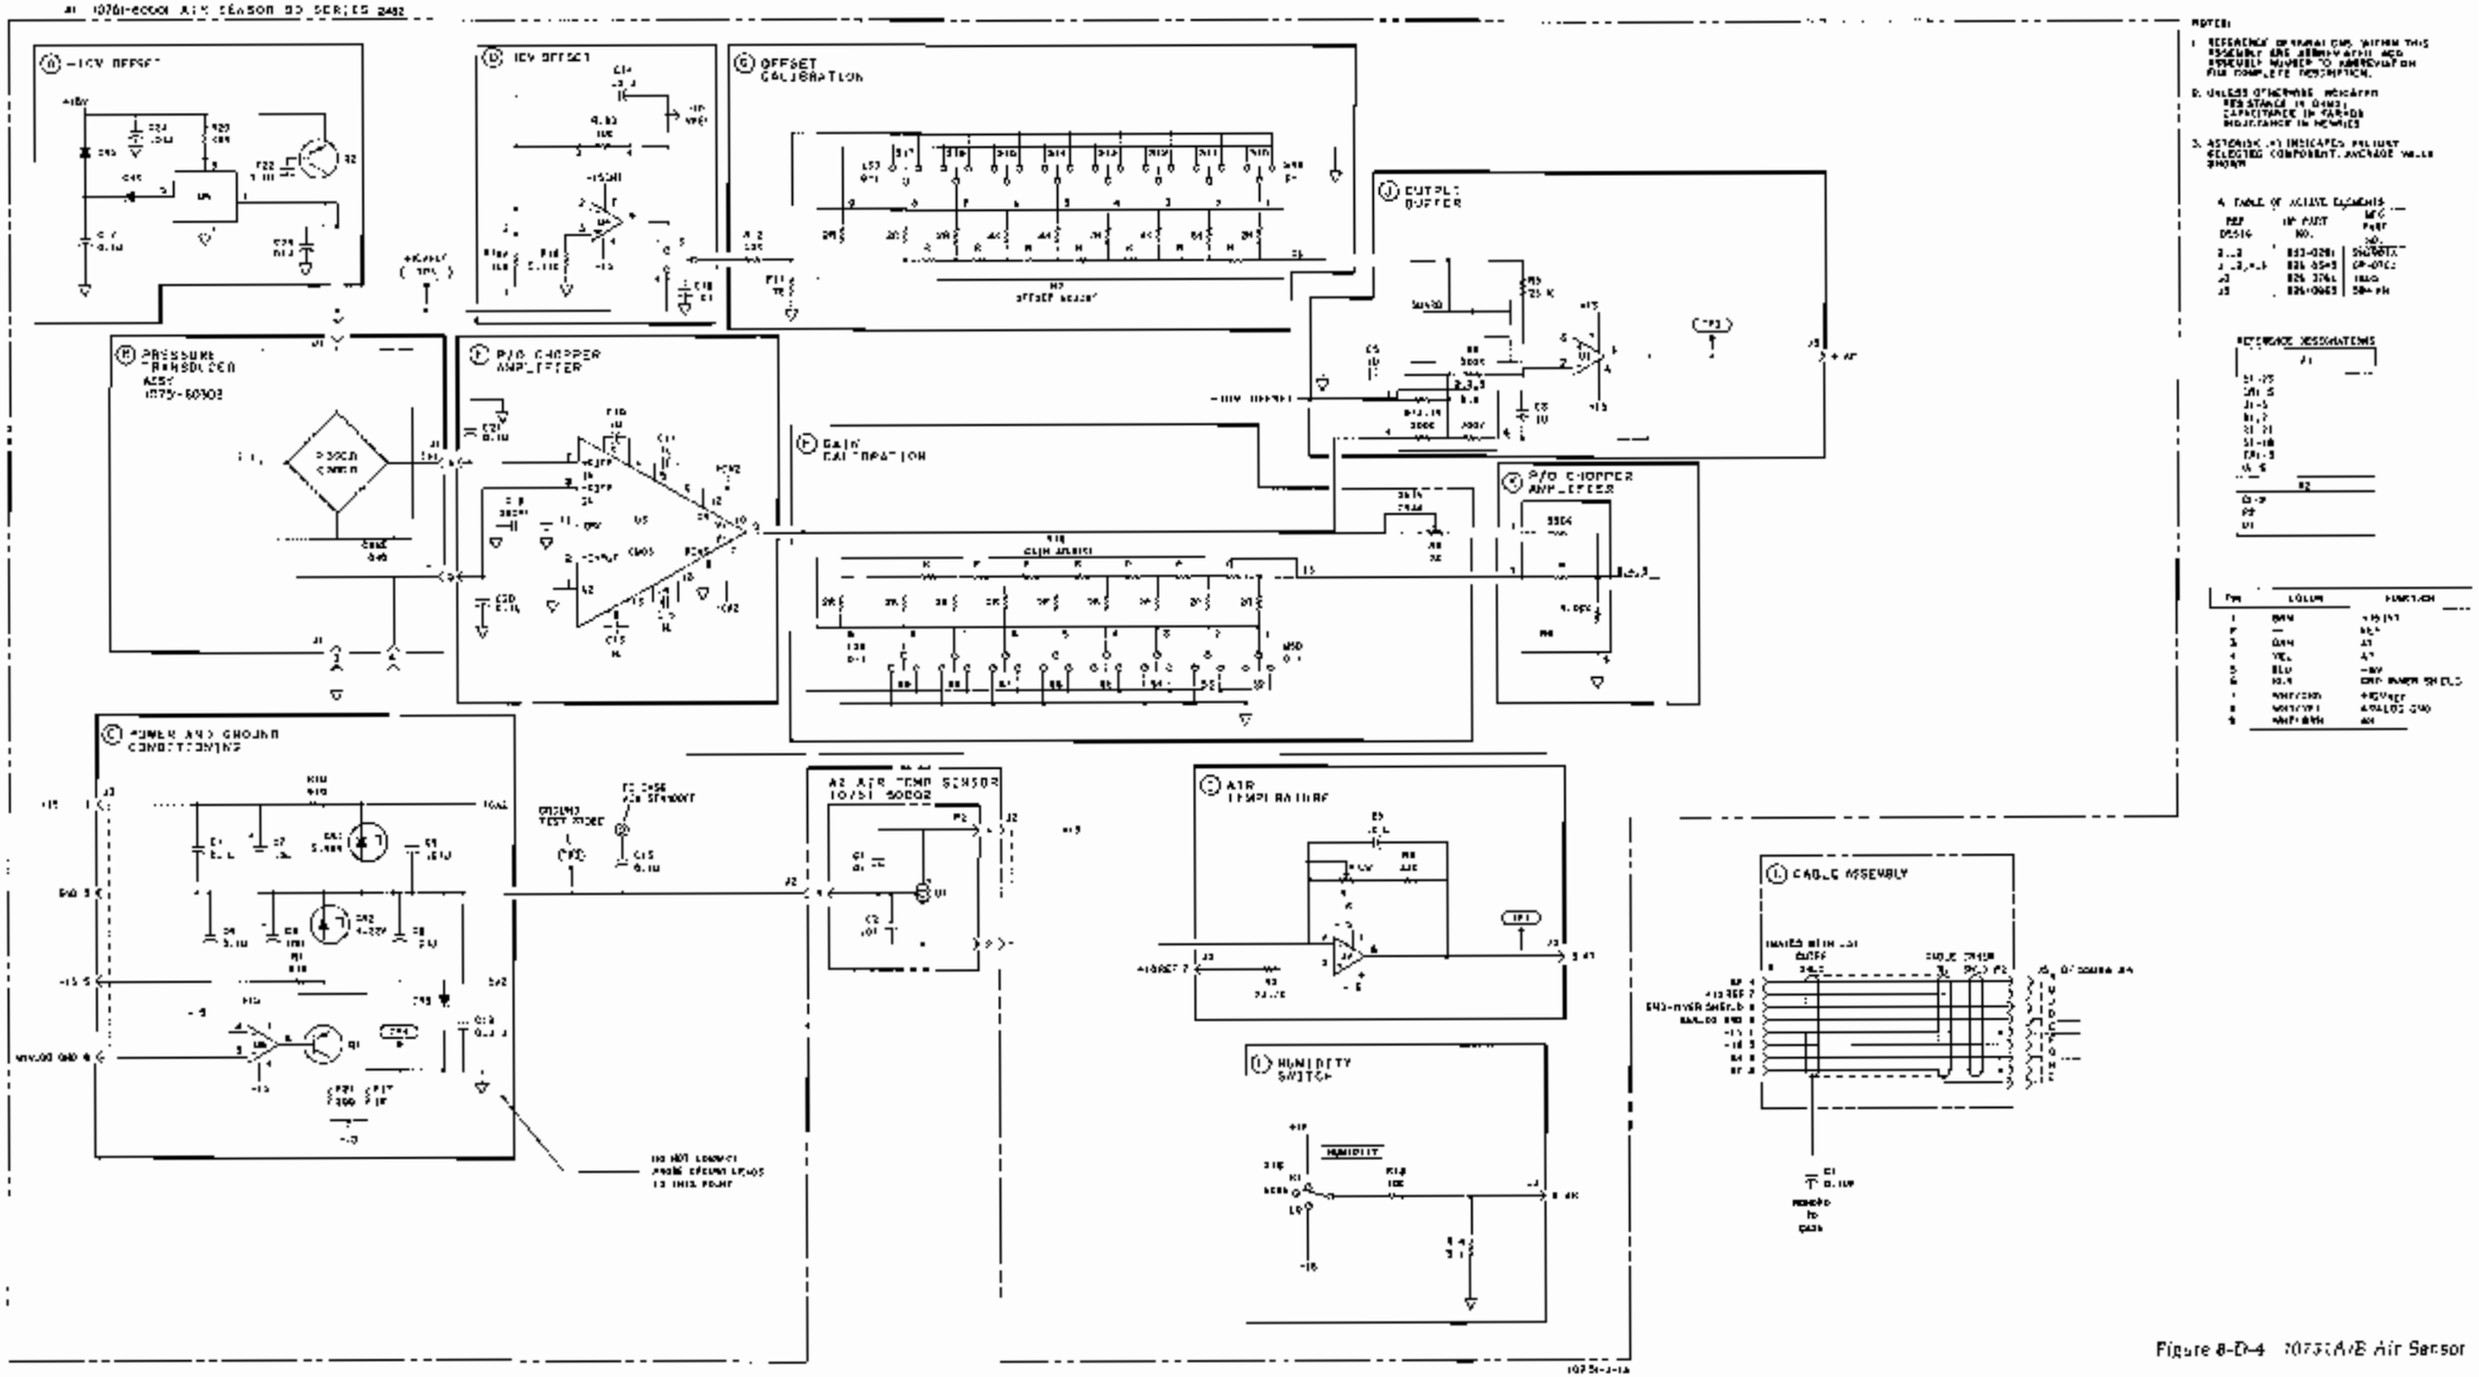


Figure 8-D-4 10751A/B Air Sensor

Figure # D-4
10751A/B AIR SENSOR

[See Page 8-D-9]

SECTION VIII-E
10757A/B/C MATERIAL TEMPERATURE SENSOR

	Page
Circuit Theory	8-E-1
Troubleshooting	8-E-3
Schematic Diagram	8-E-5

SECTION VIII-E
10757A/B/C MATERIAL TEMPERATURE SENSOR

8-E-1. 10757A/B/C MATERIAL SENSOR CIRCUIT THEORY

8-E-2. The 10757A/B/C Material Temperature Sensor furnishes an analog voltage output which varies with changes in sensor temperature (see Figure 8-E-1). The instrument is comprised of three separate functional sections.

a. a temperature-sensing thermistor network

b. an offset adjustment section

c. an analog ground buffer

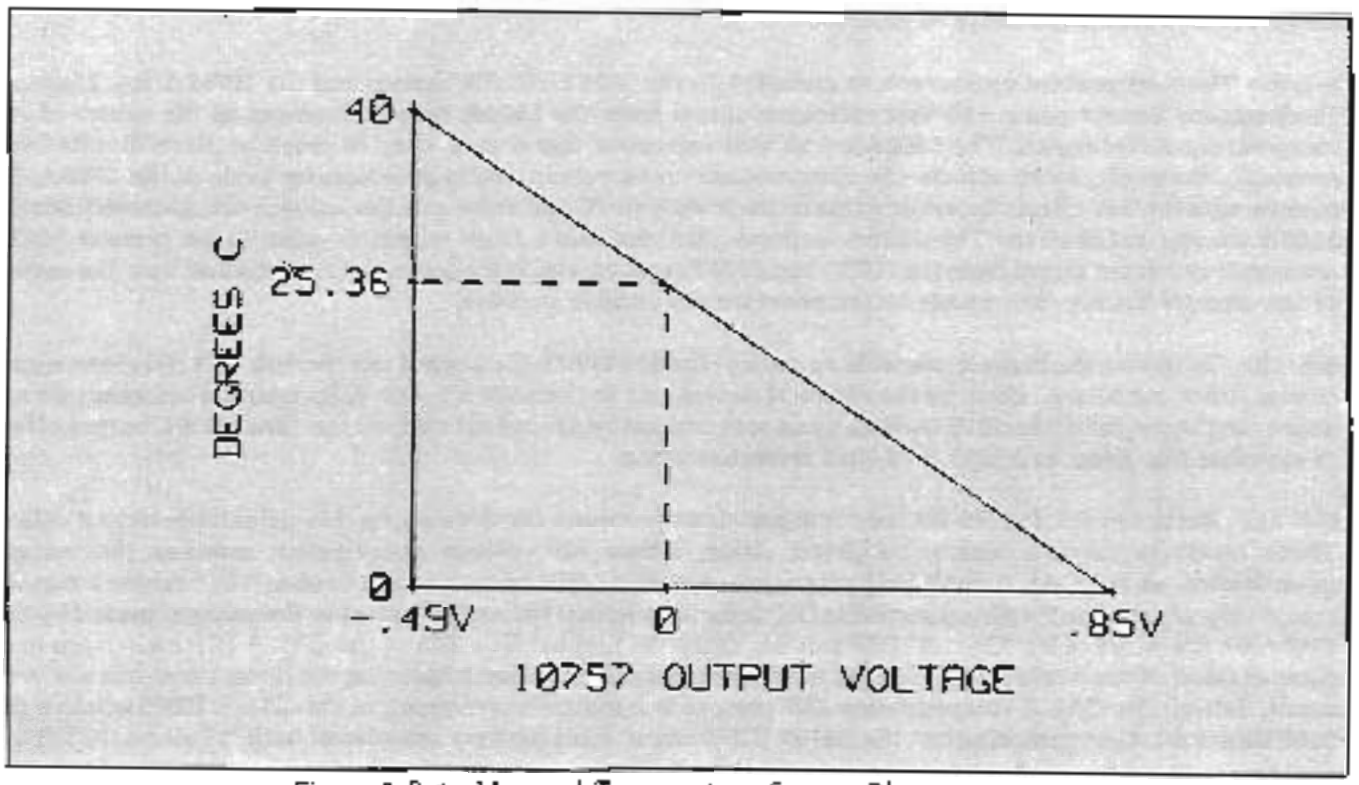


Figure 8-E-1. Material Temperature Sensor Characteristics

8-E-3. Thermistor Network

8-E-4. The instrument's main temperature sensing element is made up of two very stable thermistors (T1 and T2) and four precision resistors (R15, R17-R19). Their combined response is computer optimized to give a negative-slope linear resistance-to-temperature characteristic across U3. Resistors R18 and R19 alter the effective resistance of thermistor T1 by a factor of 1+ (R18/R19), or approximately five times. The combination of T2, R15, and R17 bend T1's inverse-logarithmic temperature-resistance response curve to the desired linear response over a 0°C to 40°C range.

8-E-5. Both T1 and T2 have a nominal resistance of 2252 Ohms at 25°C. The combined thermistor-resistor network has a nominal resistance of 2336.5 Ohms at 0°C and a slope of -16.0895 Ohms per degree, with a maximum nonlinearity of about 0.050°C as seen by op amp U3.

8-E-6. The changing resistance of the thermistor-resistor network is converted to a varying voltage by U3, scaled by the constant current passing through resistors R9, R11, and R16. The output terminal of U3 is nominally at:

$$-486.5 \text{ millivolt} + (3.35 \text{ millivolt} \times T)$$

where T is the sensor temperature in degrees C. Output buffer op amp U4 multiplies this potential by a factor of -10, giving an instrument output voltage/temperature slope of -33.5 millivolt/degree C. Gain adjust trimpot R15 allows this slope to be adjusted by ±1% to compensate for thermistor variations and resistor tolerances.

8-E-7. Offset Network

8-E-8. Ideally, the output of the 10757A/B/C is zero Volts at 25.36°C. The output of U3 is equal to -402.2 millivolts at 25.36°C, which is equivalent to a potential of 4.022 Volts at the output of the instrument. This offset is cancelled out by summing in the appropriate fixed potential from voltage reference U1. Resistors R3, R4, R6-R8, R10, R12, and R13 determine the offset magnitude, while trimpot R1 and fixed resistor R2 provide for an offset adjustment range of ±0.8%.

8-E-9. The temperature measurement circuitry in the 10751A/B Air Sensor and the 10757A/B/C Material Temperature Sensor use a +10 Volt reference signal from the 5508A base instrument as the source of the temperature offset signal. The 5508A's +10 Volt reference signal may vary as much as 10 millivolts from nominal, however, which affects the temperature measurement voltage returning back to the 5508A. To compensate for this effect, the exact value of the 5508A's +10 Volt reference deviation is programmed into the 5508A during calibration. The 5508A expects this deviation from nominal value to be present in the temperature output signal from the 10751 and 10757 sensors, and is automatically subtracted from the output of the sensors during the voltage to temperature conversion process.

8-E-10. To obtain the highest possible accuracy, the 10757A/B/C does not use the +10 Volt reference signal coming from the 5508A. Because the effect of deviations in the 5508A's +10 Volts nominal reference do not appear in the output of the 10757A/B/C, some means must be provided to adjust the 10757A/B/C output offset to simulate the effect of 5508A +10 Volt reference error.

8-E-11. Resistors R3, R4, R6-R8, and R10 provide the means for developing this adjustable output offset. These resistors form a binary weighted string whose bit voltage quantization matches the voltage quantization of the CAL A (+10 Volt reference deviation) DIP switch in the 5508A. The resistors may be selectively shorted out with a punchable DIP jumper to adjust the output offset to the value expected by the 5508A on the basis of its "CAL A" DIP switch. Only the highest five bits of the CAL A DIP switch are thus compensated in the 10757A/B/C design, as the errors associated with ignoring the lower three bits are very small. Setting the CAL A compensation DIP jumper is a matter of referring to the CAL A DIP switch in the 5508 base unit, then punching out the 10757 DIP jumper shorting bars associated with "1" bit on the CAL A switch.

8-E-12. Analog Ground Buffer

8-E-13. The temperature measurement signal produced by the 10757A/B/C is returned to the 5508A base unit by a short cable. The measurement signal is referred to the base unit's internal analog ground potential, which is supplied to the 10757 through the same cable. Drawing power supply current through this ground line would produce a small IR drop in the measurement loop, creating a temperature error proportional to the current flow.

8-E-14. Analog ground buffer U2 creates a high-precision replica of the base unit's analog ground potential while drawing negligible current through the line. Circuitry in the 10757A/B/C is referred to this ground replica rather than actual ground. Ground currents, which would otherwise adversely affect system accuracy, are instead diverted to the ±15 Volt supplies.

8-E-15. 10757A/B/C MATERIAL TEMPERATURE SENSOR TROUBLESHOOTING

NOTE

The 10757A/B/C is not field repairable and can be serviced only by complete replacement through factory exchange. Hewlett-Packard does not provide replacement parts for this product. Contact the nearest HP Sales/Service Office for assistance in exchanging defective instruments for replacement units.

NOTE

The instrument must be recalibrated after any service except after 10757-60304 cable assembly replacement.

8-E-16. If the instrument drifts or is out of specification less than 1°C:

a. Remove 10757-60301/2/3 cable assembly from the A1 Board.

b. Connect board to a 5508A and turn power on. Turn on DVM and connect DVM + and - leads to TP2 and TP1, respectively. After allowing 1/2 hour for instrument warm-up, note DVM reading.

c. Repeat the measurement 48 hours later. If the voltage at TP2 has changed by more than 700 μV, replace the A1 board. Otherwise replace the 10757-60301/2/3 cable assembly.

8-E-17. If the instrument is more than 1°C out of specification:

a. Connect the 10757-60001 board to the 5508A and switch it on.

b. Verify that + and -15 Volts (±0.7 Volt) appear on the A1 board.

c. Verify that U2 pin 3 is at 0V ±2 millivolts. If any of these voltage checks fail, replace the 10757-60304 connector cable. Otherwise, proceed.

d. Remove the 10757-60301/2/3 cable assembly from the 10757-60001 Board.

e. Measure resistance from the black lead to the white lead and from the black lead to the red lead. The sensor cable is OK if both resistances are between 2K and 3K (at room temperature), and

$$\frac{Rbw - Rbr}{0.5\ (Rbw + Rbr)} = 0.02$$

where,


Rbw = Resistance between black lead and white lead, etc.


f. Next, connect the DVM - lead to TP1. Set A1R1 and A1R16 fully counterclockwise, and the coarse offset jumper to "+".

g. Replace the existing cal match DIP jumper with one which has been punched as.

P
U Where P = a punched (broken) conductor
U and U = an unpunched (unbroken) conductor
U
U
U
U
U

h. Check the voltage at TP2. If it is not between 2.05 Volts and 2.30 Volts, replace A1.

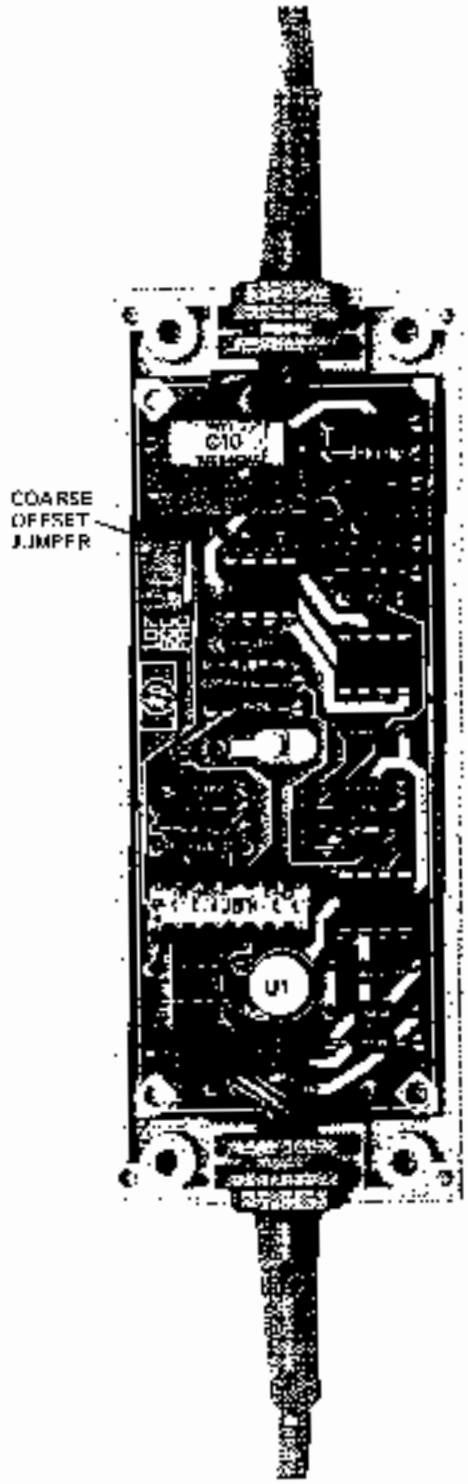
C10
COARSE
OFFSET
JUMPER
U1

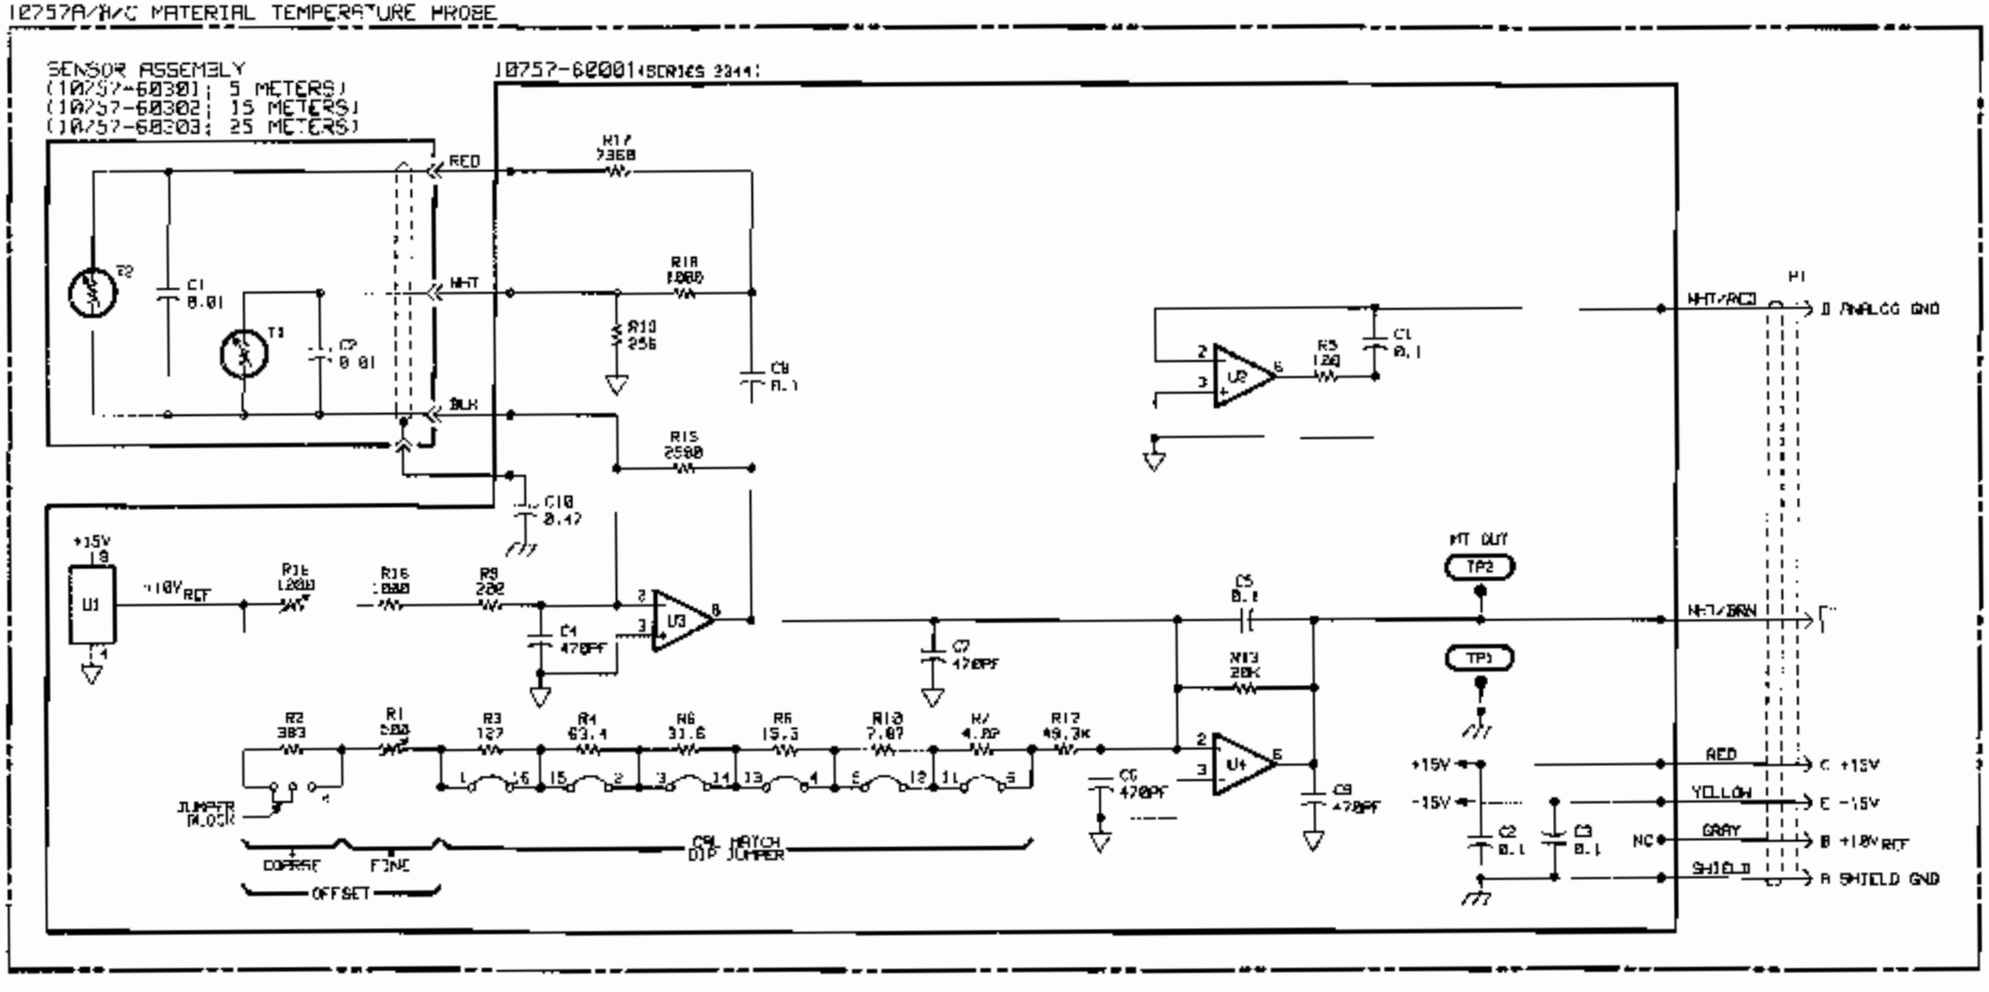

NOTES

1. REFERENCE DESIGNATIONS WITHIN THIS ASSEMBLY ARE ABBREVIATED. ADD ASSEMBLY NUMBER TO ABBREVIATION FOR A COMPLETE DESCRIPTION.
2. UNLESS OTHERWISE INDICATED:
   RESISTANCE IN OHMS;
   CAPACITANCE IN MICROFARADS;
   INDUCTANCE IN MICROHENRIES.
3. ASTERISK (*) INDICATES SELECTED COMPONENT, AVERAGE VALUES SHOWN.

REFERENCE DESIGNATIONS
A1
C1-10
J81
R1-18
S1
TP1-2
U1-4

TABLE OF ACTIVE ELEMENTS

REFERENCE DESIGNATION	HP PART NO.	MANUFACTURER PART NO.
U1	1826-0858	AD 564KH
U2-4	1826-0535	1826-0635

Figure 8-E-2. 10757A/B/C Material Temperature Sensor

Figure 8-E-2
10757A/B/C MATERIAL TEMPERATURE SENSOR

[See Page 8-E-5]

SECTION VIII-F
OPTICS

Page

Angular and Flatness Measurements 8-F-1
10770A Angular Interferometer 8-F-1
10771A Angular Reflector 8-F-1
Angular Measurement Theory 8-F-1
Flatness Measurement Theory 8-F-1

Straightness Measurements 8-F-2
10774A Short Range and 10775A Long Range Straightness Interferometer 8-F-2
Straightness Measurement Theory 8-F-2

Optical Repair 8-F-2
Cleaning Measurement Optics 8-F-3

Dimensions ..... 8-F-5 thru 8-F-9

SECTION VIII-F
OPTICS

8-F-1. INTRODUCTION

8-F-2. This section contains dimensional drawings for the Measurement Optics as shown in Figures 8-F-1 through 8-F-9. Also included is supplemental theory of operation for the Angular and Straightness Measurements. Linear measurement theory is discussed in Section 8A and should be studied before reading the following theory supplements. Troubleshooting and cleaning information is given in Paragraph 8-F-18, Measurement Optics Repair.

8-F-3. ANGULAR AND FLATNESS MEASUREMENTS

8-F-4. 10770A Angular Interferometer

8-F-5. The Angular Interferometer used in Angular and Flatness measurements is basically a Linear Interferometer with a Beam Bender located above it, see Figure 8-F-1 Angular Measurements.

8-F-6. 10771A Angular Reflector

8-F-7. The Angular Reflector contains two Retroflectors spaced at a precisely-known distance, see Figure 8-F-6, Angular Measurement Optics Dimensions.

8-F-8. Angular Measurement Theory

8-F-9. Referring to Figure 8-F-1, the Angular Optics create two parallel beam paths between the Angular Interferometer and the Angular Reflector; one path is laser frequency f1, the second path is laser frequency f2. The distance between these two paths (distance d in Figure 8-F-1) is precisely known since the two Retroreflectors are precisely positioned within the Angular Reflector. Initially, the angle between the Angular Interferometer and the Angular Reflector is assumed to be "0".

8-F-10. If either the Angular Interferometer or the Angular Reflector is tilted, the lengths of the two paths will change; this change will be recorded as phase modulation of both f1 and f2 where they recombine at the Angular Interferometer. Phase modulation is detected and recorded by the 5508A Measurement and Reference Frequency Pulse Counters in the same way as for Linear Measurements (See paragraph 8-A-11, 5508A Measurement Display).

8-F-11. Phase modulation causes the 5508A Measurement and Reference Frequency Pulse Counters to accumulate a difference in count. This count difference is multiplied by an Angular Mode Constant (stored in the 5508A) so that it is displayed in units of angular measurement.

8-F-12. Flatness Measurement Theory

8-F-13. The 10759A Footspacing kit is required to adapt the Angular Measurement Optics for flatness measurements. The footspacing kit contains footspacing pads that are machined such that their footspacing is precisely known. For example, a footspacing pad can be attached to the bottom of the 10771A Angular Reflector to allow measurement of the flatness of a surface. Knowing the footspacing, the 5508A Angular Data can be corrected to obtain flatness data in Linear Measurement Units. See the 5508A User's Guide for procedures required to make Flatness Measurements.

8-F-14. STRAIGHTNESS MEASUREMENTS

8-F-15. 10774A Short Range and 10775A Long Range Straightness Interferometer and Reflector

8-F-16. The Straightness Interferometer and Reflector have the same instrument number because they are a matched pair. They must be matched to have the reflector return the two frequency components of the Laser beam directly back into the Interferometer.

8-F-17. The Interferometer splits the two-frequency beam from the Laser Head into its two component parts: each laser frequency component leaves the Straightness Interferometer along a specific, precisely controlled path. See Figure 8-F-2 Straightness Measurements. This is possible because the Interferometer contains a Wollaston prism, which has a different index of refraction for each laser beam polarization (f2 and f1 are linearly polarized and orthogonal to each other). Each beam from the Straightness Interferometer is directed to one mirror of the Straightness Reflector. The Straightness Reflector consists of a pair of front-surface plane mirrors, rigidly mounted such that they reflect each beam back along its incoming path to the Interferometer.

8-F-18. Straightness Measuremont Theory

8-F-19. Referring to Figure 8-F-2, the two laser beam paths from the Interferometer to the Reflector (f1 and f2) have some length relative to each other. If the Straightness Interferometer of the Straightness Reflector is moved side-to-side in the Y direction, relative lengths of the two laser beam paths will change. This change will be recorded as phase modulation of both f1 and f2 where they recombine at the Straightness Interferometer. Phase modulation is detected and recorded by the 5508A Measurement and Reference Frequency Pulse Counters in the same way as for Linear Measurements (see paragraph 8-A 11. 5508A Measurement Display). This count difference is multiplied by a Straightness Mode Constant (stored in the 5508A) so that it is displayed accurately in units of Linear Measurement.

8-F-20. OPTICAL REPAIR

8-F-21. Broken Measurement Optics should be returned to Hewlett Packard. If the housings or optical components of any of these instruments are visibly damaged they will be evaluted for repair. Faulty optics should be carefully identified according to procedures in Section 8 A before returning them to Hewlett-Packard. In particular, paragraph 8-A-70. 5518A Isolation Procedure lists failure indications and displayed error messages that can be caused by the Measurement Optics, the 5518A, or the 5508A. Verifying proper operation of the 5518A and 5508A according to these procedures may be sufficient to isolate problems to a particular Optical Instrument or operator error. Troubleshooting steps for the various types of measurements are listed below:

a. Straightness Measurement Problems:

   1. Use Paragraphs 8-A-70, 5518A Isolation and 8-A-73 Straightness Measurements to verify that the 5518A works properly in STRAIGHTNESS mode.

   2. If the 5518A checks out properly, consult the 5528A User's Guide to verify proper user operation.

b. Angular/Flatness Measurement Problems

   1. Use Paragraphs 8-A-70, 5518A Isolation and 8-A-77 Angular/Flatness Measurements to verify that the 5518A works properly for Linear Measurements.

   2. If the 5518A checks out properly, consult the 5528A User's Guide to verify proper user operation.

c. Linear Measurement Problems

1. Use Paragraphs 8-A-70. 5518A Isolation and 0-A-75. Linear Measurements to verify that the 5518A works properly for Linear Measurements.

2. If the 5518A checks out properly, consult the 5528A User's Guide to verify proper user operation

8-F-22. Procedures for Cleaning Measurement Optics

WARNING

THE FOLLOWING OPTICAL CLEANING PROCEDURES DO NOT APPLY TO THE OPTICS OF THE LASER HEAD. CLEANING OF THE LASER HEAD OPTICS IS RARELY REQUIRED AND REQUIRES ACCESS TO THE INTERIOR OF THE INSTRUMENT WHERE HIGH VOLTAGES CAN BE PRESENT. ALL LASER HEAD MAINTENANCE SHOULD BE PERFORMED BY A QUALIFIED TECHNICIAN WHO IS AWARE OF THE HAZARDS INVOLVED.

8-F-23. If an optical instrument is visibly dirty on its optical surfaces the following cleaning procedures should be used.

8-F-24. The optics should be handled with care so that nothing comes in contact with the exposed glass surfaces. Fingerprints will collect dust and dirt which will attenuate and disperse the laser beam. Cleaning the optics should be avoided unless the signal intensity of the beam is noticeably reduced as indicated by the BEAM STRENGTH meter.

8-F-25. If cleaning of the optics is required, be careful to avoid rubbing particles into the coated surfaces. Permanent reduction of signal density could result. If particles are observed on the optics surface, remove by blowing off with clean pressurized air or preferably dry nitrogen. If unavailable, commercially available products such as Kodak Laboratory Sprayer or Micro Duster TX 600 from the Texwipe Company may be used. Each optical instrument is shipped with a package of lens tissue which is made specifically for cleaning optics. Use these tissues (or equivalent) with a pure industrial grade methanol in the following manner:

1. Fold the tissue into an approximate 1 inch square

2. Wet the tissue with methanol (do not saturate) and gently wipe across optical surface. Use only enough pressure to remove the contaminant.

3. Do not reuse the tissue. For additional cleaning, repeat process with a new tissue.

8-F-26. For optical surfaces hard to reach, the tissue may be held with a clamping tweezer such as a hemostatic forceps. However, care must be taken to not scratch the coated surface. Do not scrub the surface with a dry tissue. Avoid alcohol contamination with the following precautions:

a. Use only new, previously unopened containers. Alcohol absorbs water if left exposed to air. This will result in water spots when the alcohol evaporates.

b. Transfer the alcohol to a squeeze bottle that can be capped and made airtight.

c. Never transfer alcohol back into the original container

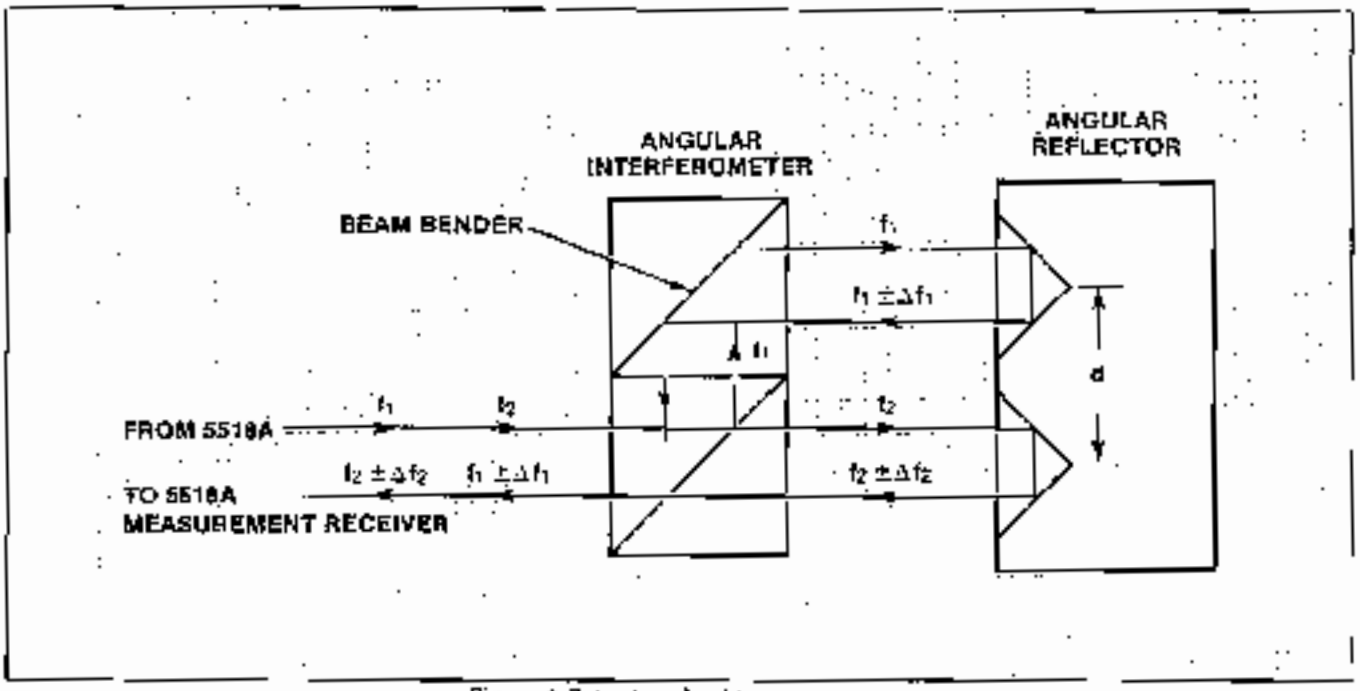


Figure 8-2-1. Angular Measurements



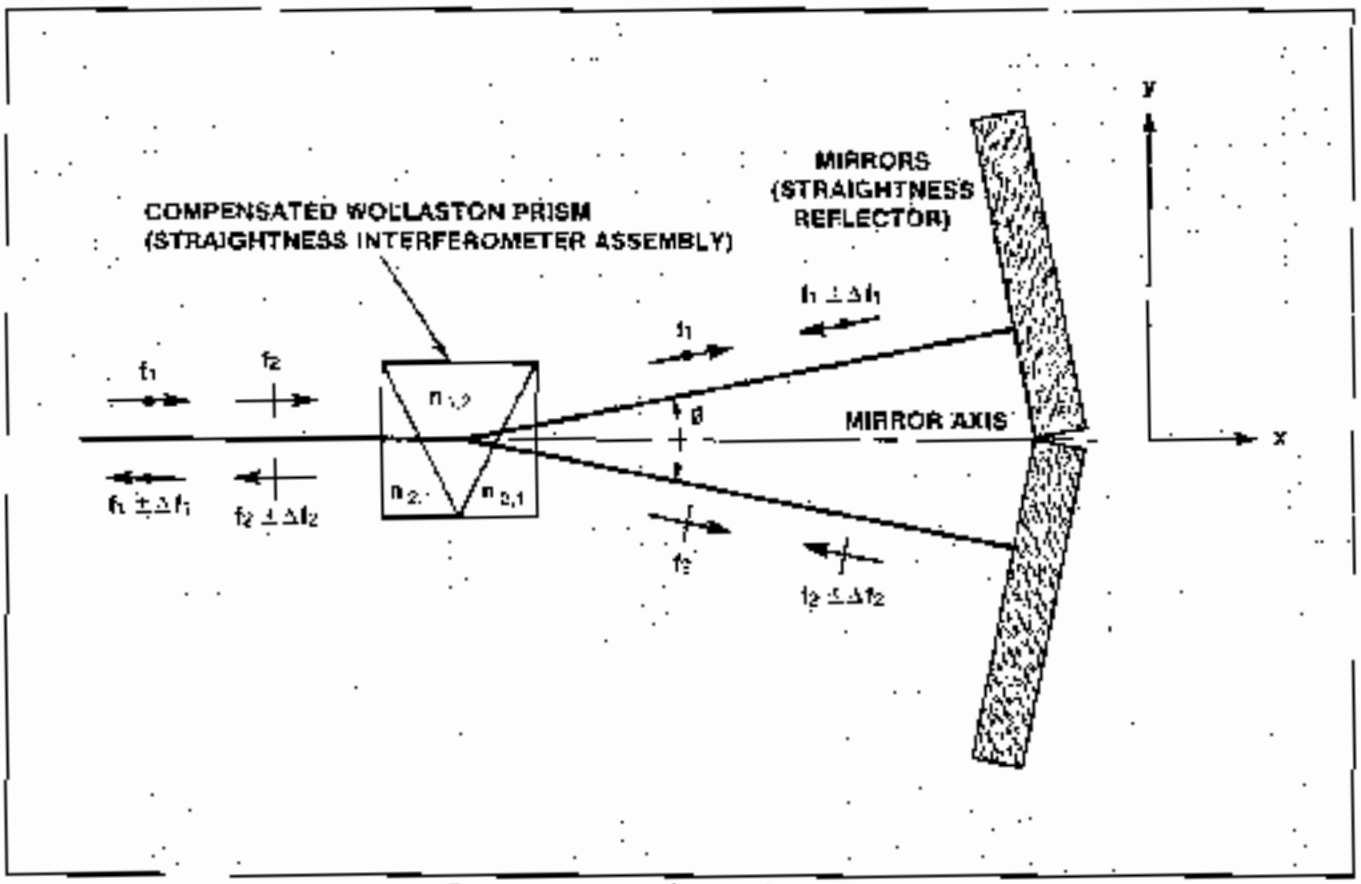


Figure 8-2-2. Straightness Measurements


LINEAR OPTICS

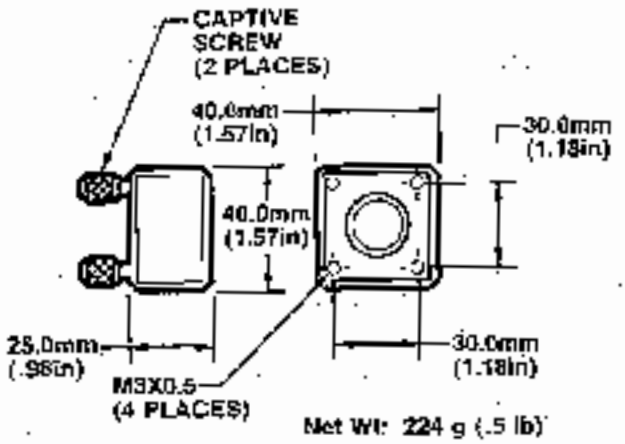

10767A
LINEAR RETROREFLECTOR

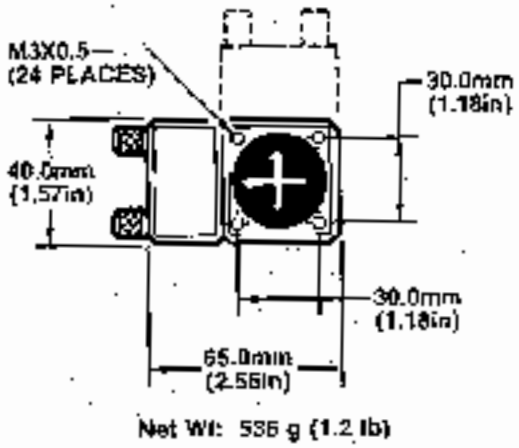


10766A/10767A
INTERFEROMETER COMBINATION

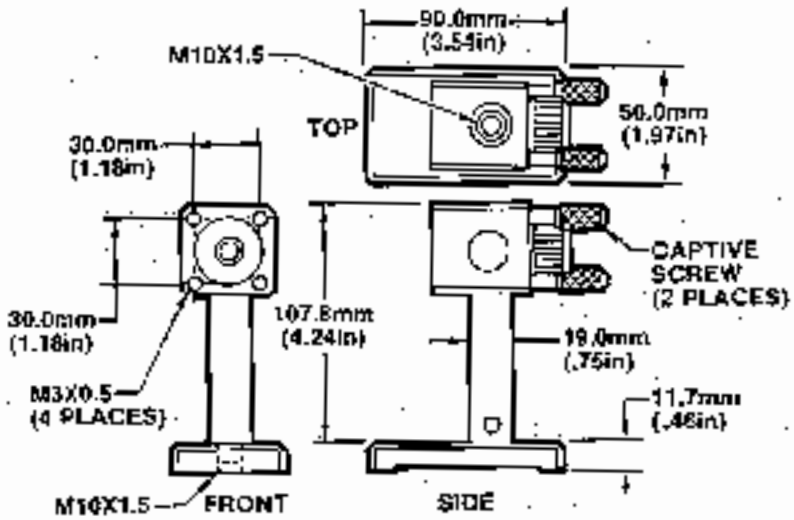


10785A HEIGHT ADJUSTER/POST
10784A BASE

Figure 8-F-3. Linear Measurement Optics and Accessories Dimensions

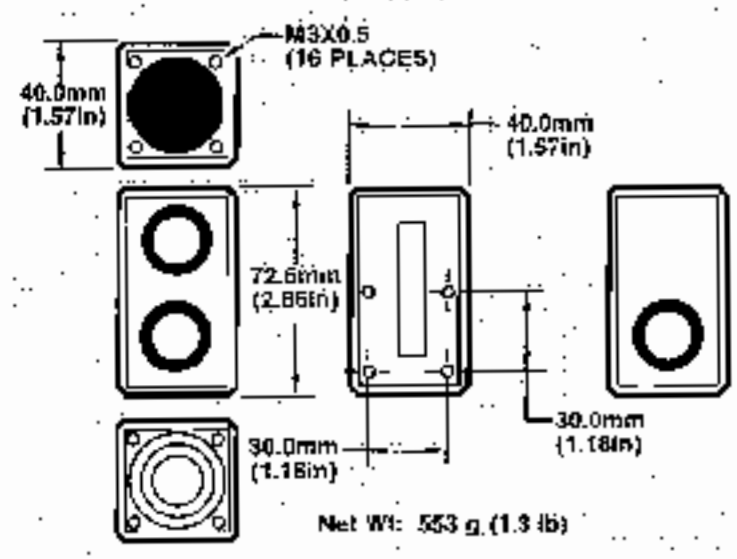


10770A
ANGULAR INTERFEROMETER

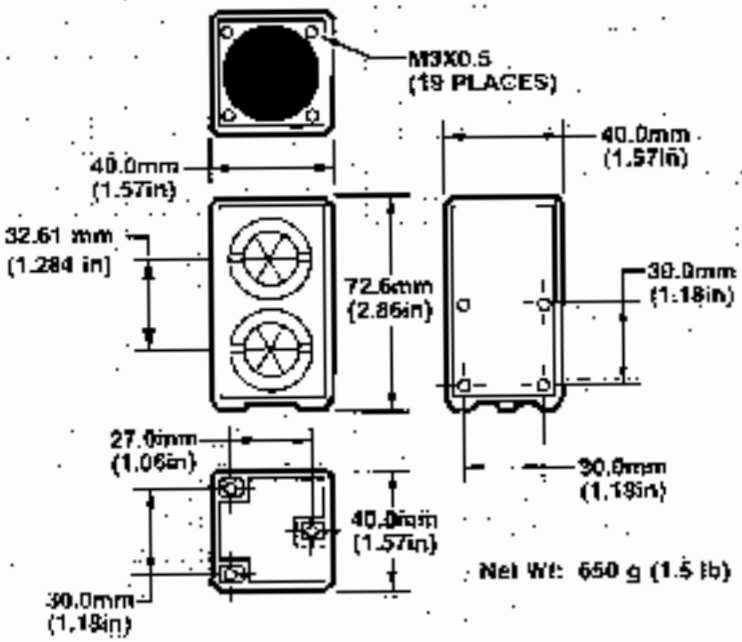


10771A
ANGULAR REFLECTOR

Figure 8-F-4. Angular Measurement Optics Dimensions

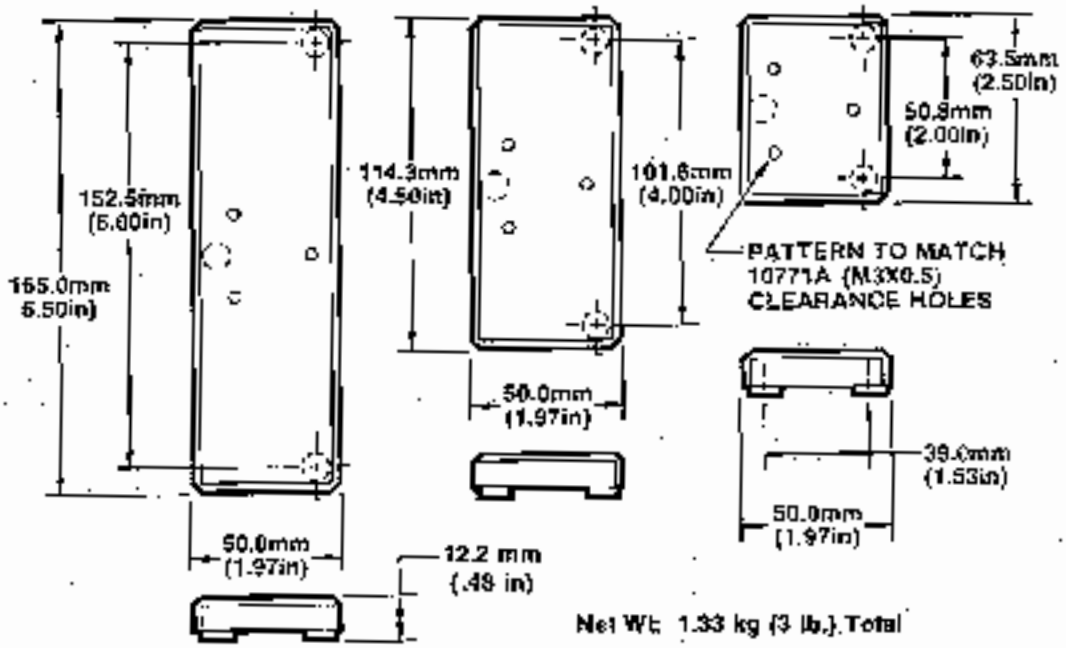

10758A
FOOT SPACING KIT

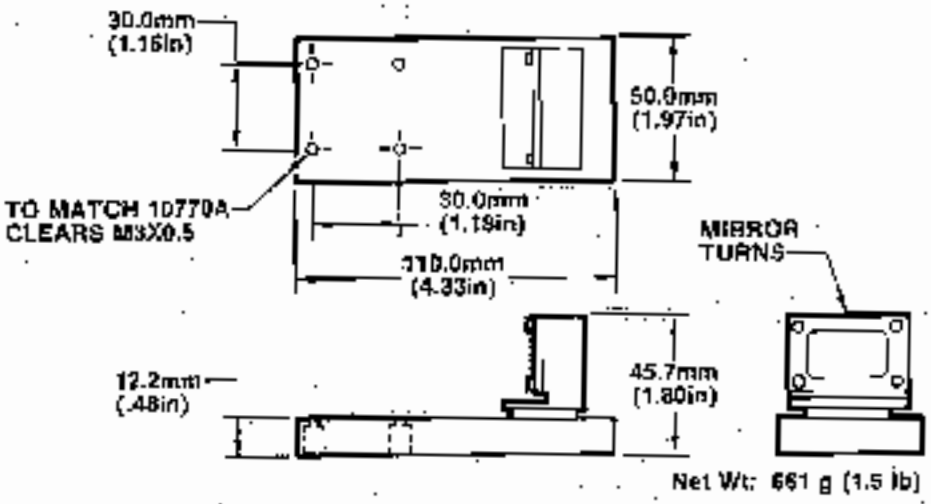

10773A
FLATNESS MIRROR

Figure 8-F-3. Flatness Accessories Dimensions

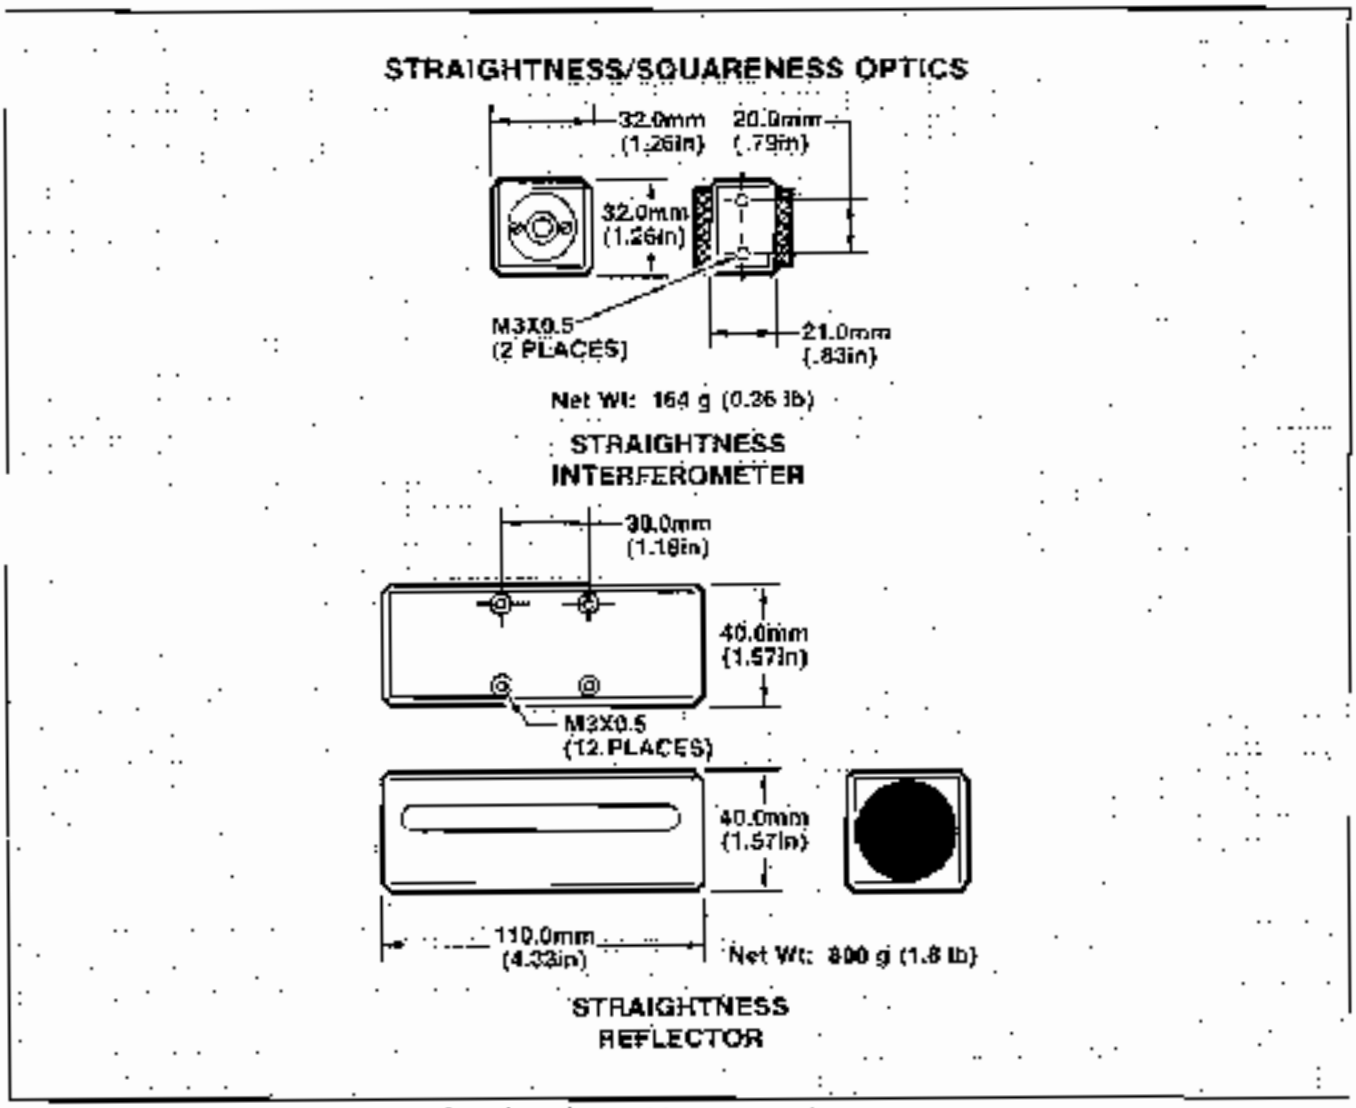


Figure 8-F-6. Straightness Measurement Optics Dimensions

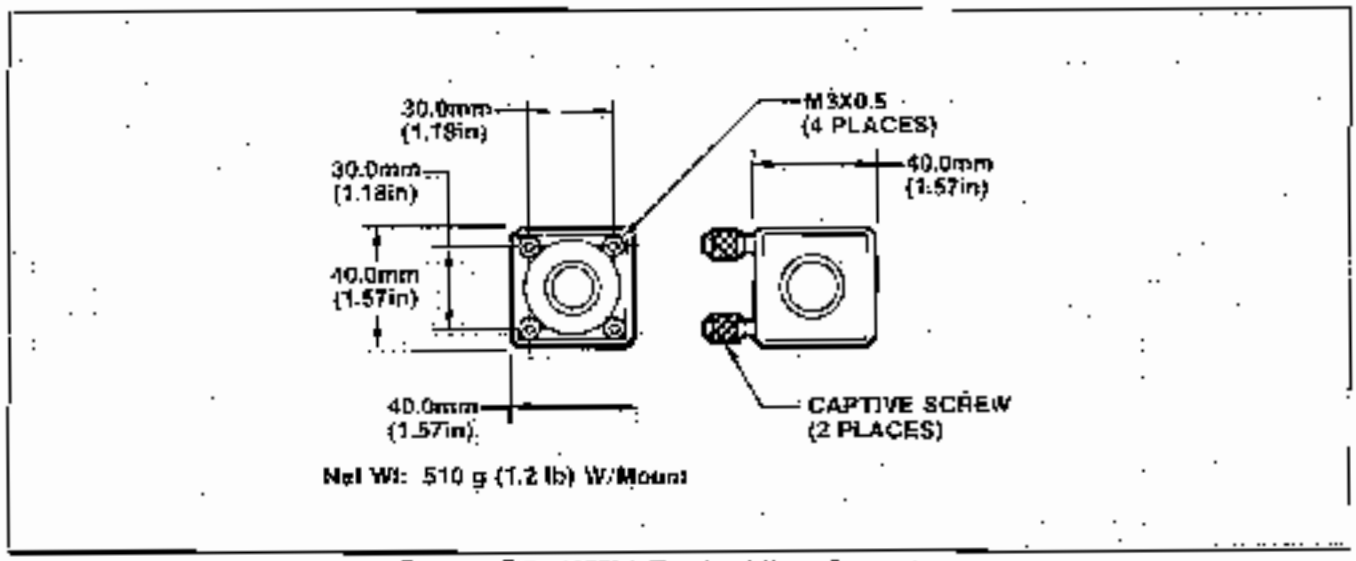


Figure 8-F-7. 10772A Turning Mirror Dimensions

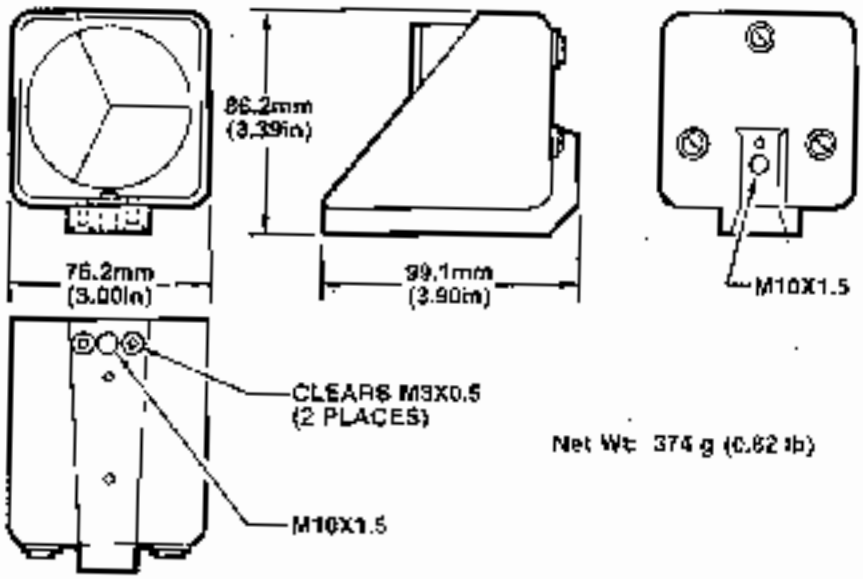


Figure 8-F-8. 10776-67001 Straightness Retroreflector Dimensions

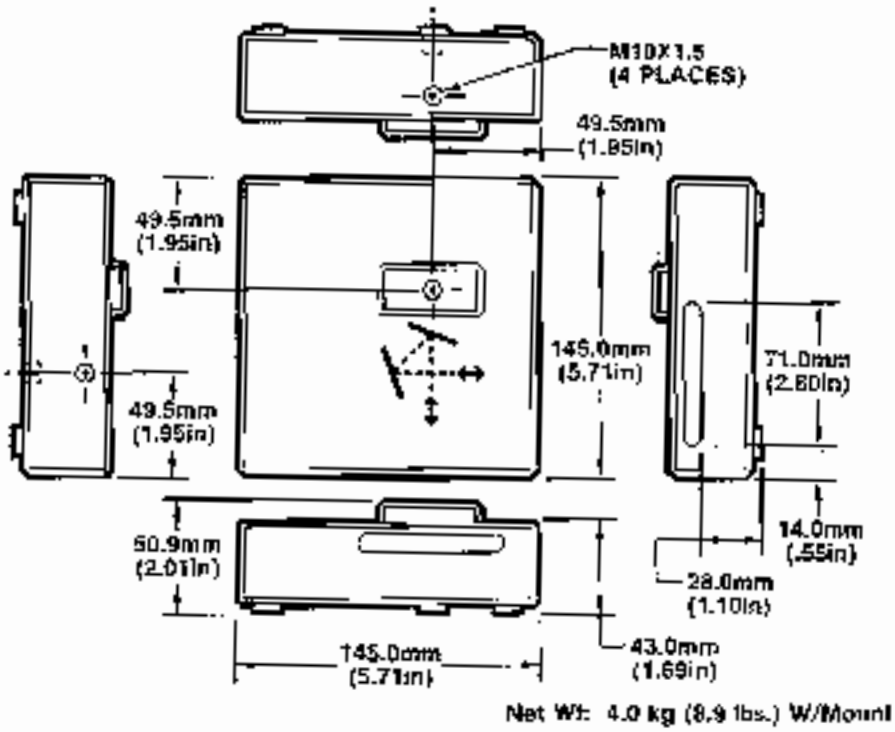


Figure 8-F-9. 10777A Optical Square Dimensions

5528A SERVICE MANUAL INDEX

A **Page**

A to D Converter A3, 5508A
Component Locator 8-B-97
Replaceable Parts 8-7
Schematic 8-B-87
Theory 8-B-78
Troubleshooting 8-D-62
Abbreviations 6-3
Adjustments 5-1
Laser Tube Current 5-5
Receiver 5-2
Reference Temperature 5-4
Air Filter
Cleaning 3-33
Part Number 3-32, 6-33
Air Humidity
Operation 3-7, 3-15, 3-21
Theory 8-D-5
Air Pressure
Calibration 4-12
Operation 3-7, 3-15
Theory 8-D-1
Air Sensor, 10751A/B
Calibration 4-8
Component Locator 8-D-9
Connector 3-11
Description 1-15
Operation 3-7
Replaceable Parts 6-15, 6-41, 6-43
Schematic 8-D-9
Specifications 1-4
Theory 8-D-1
Troubleshooting 8-D-6
Air Temperature
Calibration 4-9
Operation 3-7, 3-20
Theory 8-D-5
Analog Subsystem A3, 5508A
Component Locator 8-B-97
Replaceable Parts 6-7
Schematic 8-B-87
Theory 8-B-78
Troubleshooting 8-B-92
ANGLE Key 3-3
Angle Measurements Specifications 1-9
Angular Interferometer, 10770A 1-6, 1-15, 8-F-1, 8-F-6
Angular Optics, 5528A 1-6, 1-25
Angular Reflector, 10771A 1-6, 1-19, 8-F-1, 8-F-6
Anode Lead, 5518A 5-6, 8-C-19
Apertures, 5518A 3-14
Assembly Designations
5508A 8-B-7
5518A 8-C-10
AUTO RECORD Key 3-9

B
Backdating 7-1
Base, 10764A
Description 1-23
Specifications 1-8
Basic Measurement Technique 1-4
Beam Diameter 1-4
Beam Power Loss, Maximum Allowable 1-4
BEAM STRENGTH Meter 3-2
Block Diagram
Signal Connection and Indicator 8-A-23
System, 5528A 6-A-25
5528A 6-A-25
5508A 8-B-9
5518A 8-C-3

C
Cable Designations, 5508A 8-B-7
Cable, Interconnecting, 5518A to 5508A 2-5
Cable Lengths 1-15, 2-5
Cables and Connectors 2-2, 2-5, 3-10, 3-14, 8-A-19
Cables, Part Numbers 1-13, 2-4, 2-5
Calibration 4-3
Air Pressure 4-12
Air Temperature 4-9
Cycle 4-3
5508A 4-3
+10Vref 4-4
+0.5Vref 4-7
10751A/B 4-9
10757A/B/C 4-16
Cautions iv
Changes 1-2, 7-1
Circuit Theory — See Theory of Operation
Cleaning
Air Filter 3-30
Optics 8-F-3
Clearing Error Conditions 3-27
Compensation Number 1-9, 3-7, 8-A-2
Component Locator
5508
A1 Keyboard/Display 8-B-15
A2 Processor 8-B-45
A3 Counter 8-B-89
A3 A to D Converter 8-D-97
A3 Counter Control Circuits 8-B-71
A3 Measurement Frequency Channel 8-B-75
A3 Reference Frequency Channel 8-B-73
A4 Connector Board 8-B-101
A5 Power Supply 8-B-115
05508-60021, Remote Control Unit 8-B-117
5518A
A1 Connector Board 8-C-37
A2 Receiver 8-C-39
A3 Controller/Reference 8-C-41
A4 Sampler Board 8-C-40
10751A/B 8-D-9
10757A/B/C 8-E-5
Configurations, System 1-26
Connector Board A1, 5518A
Component Locator 8-C-37
Replaceable Parts 6-14
Schematic 8-C-37
Theory 8-C-19
Troubleshooting 8-C-19
Connector Board A4, 5508A
Component Locator 8-B-101
Replaceable Parts 6-11
Schematic 8-B-101
Theory 8-B-100
Troubleshooting 8-B-100
Connectors and Cables 2-5, 2-5, 3-10, 3-14, 8-A-19
Contents, Table of vii
Controller/Reference Board A3, 5518A
Component Locator 8-C-41
Replaceable Parts 6-15
Schematic 8-C-41
Theory 8-C-24
Troubleshooting 8-C-27
Controls, Front Panel 3-7, 3-15
Counter Board A3, 5508A
Component Locator 8-B-89
Replaceable Parts 6-7
Schematic 8-B-71, 8-D-73, 8-B-75, 8-B-87
Theory 8-B-1, 8-B-47, 8-B-48, 8-B-50, 8-B-77
Troubleshooting 8-B-2, 8-B-52, 8-B-62
Current Requirements 8-A-18, 8-B-102

D
Data Probe Grounds on the 5005A 6-B-52
Data Transfer
To External Devices 3-22
Without an HP-IB Controller 3-22
Dimensions
Equipment ..... 1-4 thru 1-8, 6-F-5 thru 6-F-9
Optics ..... 6-F-5 thru 6-F-9
DIR SENSE Key 3-9
Direct Order Mail System 6-1
DISTANCE Key 3-2
Dividers, Tab 1-2

E
ECL Logic 6-B-52
ECL Logic Threshold — Setting on 5005A 6-B-52
Effectivity
Manual 1-2, 7-1
Serial Prefix 1-3
ENGLISH-METRIC Switch
Operation 3-10
Theory 6-B-17
ENTRY Keys 3-2
Environmental Conditions 1-4, 2-7
Equipment Description 1-12
Equipment List 1-3
Error Messages 3-12, 6-A-8
EXP COEFF Key 3-8
External Reset
Operation 3-24
Theory 6-B-53

F
Factory Selected Components 5-1
Failures, Power Up 6-A-14
FCC Statement iv
Feedback Loop during Optical Mode, 5518A 6-C-6
Feedback Loop during Warmup Mode, 5518A 6-C-5
Figures, List of xiv
Flatness Accessory Kit, 5525A 1-7, 1-26
Flatness Measurements, Specifications 1-9
Flatness Mirror, 10773A 1-7, 1-26
Footspacing Kit 1-7, 1-17
Front Panel Controls, 5508A 3-1
Front Panel Controls, 5518A 3-13
Fuses
Line 2-2, 2-3, 3-29
Power Supply 6-B-15A

G
General Information 1-1

H
Height Adjuster and Post, 10785A 1-8, 1-24
High Voltage Area 5-5, 6-C-19
High Voltage Section
Circuit Theory 6-C-19
Troubleshooting 6-C-20
HP-IB 3-22, 4-17, 6-B-15, 6-B-30
Addresses 3-29
Bus Commands 3-25
Cables 2-5
Connectors 2-5, 2-6, 3-11
Diagnostics 4-19
Status Byte 3-27
Switches 3-29
Troubleshooting 6-B-30
Verification 4-19
Humidity, Air
Description 3-7
Setting of 3-15

I
IEC 1-5
IEEE 488 Port 3-11, 3-26
Initial Inspection 2-1
Inspection 2-1
Installation 2-1
Instruments Covered By This Manual 1-2
Instrument Function Codes 3-23
Interrupt Capability, HP-IB 3-27
Introduction To This Manual 1-1
Isolation Trouble
System 6-A-5
5508A 6-B-2
5518A 5-C-10, 6-C-15
5528A 6-A-5
10751A/B 6-D-6
10757A/B/C 6-E-3

K
Keyboard A1, 5508A
Component Locator 6-B-15
Replaceable Parts 6-4
Schematic 6-B-16
Theory 6-B-10
Troubleshooting 6-B-11
Keyboard Features 3-1

L
Laser Assembly
Optics 6-C-6
Wiring 6-C-19
Laser Head, 5518A
Block Diagram 5-C-3
Connections 2-5, 3-14
Description 1-12
Operation 3-17
Replaceable Parts ..... 6-14 to 6-17, 6-39
Specifications 1-4
Theory 6-C-1, 6-C-19, 6-C-21, 6-C-24, 6-C-27
Troubleshooting 6-C-11, 6-C-15, 6-C-19, 6-C-20, 6-C-22, 6-C-27
LASER ON Indicator 3-2
Laser Tube
Current Adjustment 5-5
Packaging 2-7
Shipping 2-7
Laser Tuning 6-C-4
LINE Switch 3-9
Line Voltage Selection 2-2
Linear Distance Measurements 1-9
Linear Interferometer, 10706A
Description 1-18
Specifications 1-5
Linear Measurement Kit, 5525GA
Description 1-25
Specifications 1-9
Linear Retroreflector, 10767A
Description 1-18
Specifications 1-5
Liquid Crystal, 5518A 6-C-7, 6-C-13, 6-C-26, 6-C-31
List of Figures xiv
List of Tables xvi
Locating Information 1-2
Logic
Concepts 6-6
ECL 6-B-52
Symbols 6-6
TTL 6-B-52
Long Range Straightness Optics, 10775A 1-8, 1-21
LONG STRAIGHTNESS Key 3-3

M
Mail Order System, Direct 6-1
Maintenance, Operator's 3-29
Manual
  Changes 1-2, 7-1
  Organization 1-1
Manufacturers Code List 6-22
Material Temperature Sensor, 10757A/B/C
  Calibration 4-15
  Component Locator 8-E-5
  Connection 3-11
  Description 1-15
  Matching Calibration 4-15
  Operation 3-5
  Replaceable Parts 6-21, 6-45
  Specifications 1-5
  Theory 8-E-1
  Troubleshooting 8-E-1
MATL TEMP Key 3-5
Measurement Display, 5508A
  Block Diagram 8-B-9
  Calibration 4-3
  Description 1-13
  Exploded Views 6-23, 6-25 6-27, 6-29, 6-31, 6-33, 6-35
    Cabinet Parts 6-23
    Cable Assembly Parts 8-B-7
    Chassis Parts 6-27
    Front Panel Parts 6-31
    Heat Sink Parts 6-29
    PC Board Assemblies ..... 6-4 thru 6-13
    Rack Mount Kit 6-25
    Rear Panel Parts 6-35
  Operation 3-4
  Specifications 1-4
  Theory 8-B-1
  Trouble Isolation 8-B-2
Measurement Frequency Channel A3, 5508A
  Component Locator 8-B-75
  Replaceable Parts 6-7
  Schematic 8-B-75
  Theory 8-B-50
  Troubleshooting 8-B-53
Microfiche 1-1

N
Newer Instruments, How Documented 1-2, 7-1
NORM-TEST Switch, 5518A 8-C-19

O
Older Instruments, How Documented 1-2, 7-1
Operating Environment 1-4
Operation 3-1
Operational Verification Check 3-17
Operator's Check 3-17
Operator's Maintenance 3-29
Optical Kits 1-25
Optical Mode Timing Diagram, 5518A 8-C-8
Optical Square, 10777A
  Description 1-23
  Specifications 1-8
Optics 8-A-1
  Cleaning 3-30
  Description ..... Section I, Section 8-F
  Dimensions ..... Section I Section 8-F
  Specifications ..... Section I
  Theory ..... Section 8-F
Ordering Information 5-1
Organization
  Manual 1-1
  Service Section 6-1
Output, HP-IB 3-27

P
Packaging 2-7
Performance Tests 4-1
  Safety Considerations 4-1
  5508A 4-2
  5518A 4-2
  5528A 4-1
    Laser Power Output Test 4-2
    Receiver Gain Test 4-2
  10751A/B 4-3
  10757A/B/C 4-3
Pinouts
  Air Sensor 8-A-21
  Laser Head 8-A-20
  Material Temperature Sensor 8-A-21
  Measurement Display 5508A 8-A-19
  Remote Control 8-A-19
Power
  Cable 2-4
  Module 2-2
  Requirements 2-1
Power Supply A5, 5508A
  Component Locator 8-B-115
  Replaceable Parts 6-12
  Schematic 8-B-115
  Theory 8-B-102
  Troubleshooting 8-B-104
Power-Up Self Test and Warm-Up Countdown ... 3-21, 8-A-3
Preparation for Use 2-1
PRESET Key 3-3
Pressure, Air
  Operation 3-7, 3-20
  Theory 8-D-1
Processor Board A2, 5508A
  Component Locator 8-B-45
  Replaceable Parts 6-6
  Schematic 8-B-45
  Theory 8-B-17
  Troubleshooting 8-B-18

R
Radiation, Laser Warning iv
READY Indicator 3-14
Rear Panel Features
  5508A 3-10
  5518A 3-14
Receiver A2, 5518A
  Component Locator 8-C-29
  Replaceable Parts 6-14
  Schematic 8-C-33
  Theory 8-C-21
  Troubleshooting 8-C-22
Recommended Test Equipment 1-29
Reference Designations 6-2
Reference Frequency Channel A3, 5508A
  Component Locator 8-B-73
  Replaceable Parts 6-7
  Schematic 8-B-73
  Theory 8-B-50
  Troubleshooting 8-B-52
Relative Humidity 8-D-5, 3-21, 3-7, 3-15
Remote Control Unit, 05508-60021
  Component Locator 8-B-117
  Connection 3-10
  Description 1-14
  Replaceable Parts 6-37
  Schematic 8-B-117
  Theory 8-B-117
  Troubleshooting 8-B-117
Removal Instructions
  5508A 8-B-7
  5518A 8-C-16

Replaceable Parts
Remote Control Unit ... 6-37
Summary of Tables and Figures ... 6-1
5508A
Cable Assembly Parts ... 6-6-7
Chassis Parts ... 6-27
Front Panel Parts ... 6-31
Heat Sink Parts ... 6-29
PC Board Assemblies ... 6-4 thru 6-13
Rear Panel Parts ... 6-33
5518A
Laser Head Parts ... 6-39
PC Board Assemblies ... 6-14 thru 6-17
10751A/B
Parts ... 6-41,6-43
PC Board Assemblies ... 6-18 thru 6-20
10757A/B/C
Parts ... 6-45
PC Board Assemblies ... 6-21
10753 Parts, HP ... 6-46
10753 Parts, Manufacturers ... 6-47
RESET Key ... 3-8
RESOL Key ... 3-4
RMT CONT Connector ... 5-10

S
Safety
Considerations, Electrical ... iv
Considerations, Laser ... iv
Symbols ... 6-5
Sampler Board A4, 5518A
Component Locator ... 6-C-40
Exploded View ... 6-C-7
Replaceable Parts ... 6-17
Schematic ... 6-C-47
Theory ... 6-C-27
Schematic Diagrams
5518A Measurement Display
A1 Keyboard/Display ... 6-B-15
A2 Processor ... 6-B-45
A3 A to D Converter ... 6-B-97
A5 Component Locator ... 6-B-98
A3 Counter Control Circuits ... 6-B-71
A3 Measurement Frequency Channel ... 6-B-75
A5 Reference Frequency Channel ... 6-B-73
A4 Connector Board ... 6-B-101
A5 Power Supply ... 6-B-115
05508-60021, Remote Control Unit ... 6-B-117
5518A, Laser Head
A1 Connector Board ... 6-C-37
A2 Receiver ... 6-C-39
A2 Controller/Reference ... 6-C-41
A4 Sampler Board ... 6-C-41
10751A/B ... 6-D-9
10757A/B/C ... 6-E-5
Self-Test, 5508A ... 3-21, 6-B-2
Serial Number ... 1-2
Serial Prefix Effectivity ... 1-2, 1-3
Service
Aids ... 6-2
Organization ... 6-1
Tags ... 2-9
Short Range Straightness Optics, 10774A ... 1-7
SHORT STRAIGHTNESS Key ... 3-3
Shutter Control ... 3-14
Signal Connections and Indicator Diagram ... 6-A-5
Signature Analysis ... 6-B-12
Smoothing ... 3-4
Specifications ... 1-8
Squareness Measurements ... 1-10
Standard Troubleshooting Procedures ... 6-B-54
State Diagram for State Machine, 5518A ... 6-C-4
Status Byte ... 3-27
Storage and Shipment ... 2-7
Environment ... 2-7
Packaging ... 2-7
Straightness Accessory Kit ... 1-22
Straightness Measurement Kit, 55283A ... 1-7
Straightness Measurements ... 1-10
Switch, 5508A Internal, Summary ... 6-B-5
CBI A, A3S1 ... 6-B-6
CBI B, A3S2 ... 6-B-6
Master Reset, A2S2 ... 6-B-6
Test, A2S3 ... 6-B-6
Voltmeter Test Channel Select, A3S7 ... 6-B-6
Switches, HP-IB ... 3-28, 6-B-5
Symbols, Schematic Diagram ... 6-2
System Configurations ... 1-23
System Description ... 1-19
System Troubleshooting ... 6-A-5

T
Tab System ... 1-2
Table of Contents ... vii
Tables, List of ... xvii
Temperature, Air
Operation ... 3-7
Theory ... 6-D-5
Temperature Calibration ... 4-3
Test Equipment ... 1-23
Tests, Performance ... 4-1
Theory of Operation
5508A ... 6-B-1
A1 Keyboard Display ... 6-B-10
A2 Processor ... 6-B-17
A3 Counter ... 6-B-1, 6-B-47, 6-B-48, 6-B-53 6-B-77
A4 Connector Board ... 6-B-100
A5 Power Supply ... 6-B-102
5518A ... 6-C-1
A1 Connector Board ... 6-C-19
A2 Receiver ... 6-C-21
A3 Controller/Reference ... 6-C-24
A4 Sampler Board ... 6-C-27
5528A ... 6-A-1
10751A/B ... 6-D-1
10757A/D/C ... 6-E-1
Trace Maps, Data Line, 5508A ... 6-B-32 thru 6-B-44
Tripod, 10750A
Description ... 1-16
Replaceable Parts HP ... 6-46
Replaceable Parts Manufacturer ... 6-47
Trouble Isolation ... 6-A-5
5508A ... 6-B-2
Troubleshooting ... 6-2
Power Supply ... 6-B-104
System ... 6-A-5
Tables ... 6-A-6, 6-A-12
5508A ... 6-B-2
A1 Keyboard/Display ... 6-B-11
A2 Processor ... 6-B-18
A3 Counter ... 6-B-52, 6-B-62
A4 Connector Board ... 6-B-100
A5 Power Supply ... 6-B-104
5518A ... 6-C-15
A1 Connector Board ... 6-C-19
A2 Receiver ... 6-C-22
A2 Controller/Reference ... 6-C-27
A4 Sampler Board ... 6-C-31
5528A ... 6-A-5
10751A/B ... 6-D-5
10757A/B/C ... 6-E-3
TTL Logic ... 6-B-52
Turning Mirror, 10772A ... 1-7, 1-20
Turret Optics ... 6-C-7, 6-C-9

V
VELOCITY Key 3-2
Velocity Measurements 1-9
Velocity of Light Compensation 1-3, 3-7
VOL Key 3-7
Voltmeter Mode, A3, 5508A 6-B-6, 8-B-34

W
Warmup Countdown 3-21
Warmup Mode Timing Diagram, 5518A 6-C-6
Warnings iv
Warranty 1-30
Weights of Instruments ..... Section I Specifications

5508A, Measurement Display
Block Diagram 8-B-9
Connection 2-5
Data Bus Fault Location 8-B-31
Data Line Trace Maps ..... 8-B-32 thru 8-B-44
Description 1-13
Exploded Views 6-23, 6-25, 6-27, 6-29, 6-31, 6-33, 6-35
Cabinet Parts 6-23
Cable Assembly Parts 8-B-7
Chassis Parts 6-27
Front Panel Parts 6-31
Heat Sink Parts 6-29
PC Board Assemblies ..... 6-4 thru 6-13
Rack Mount Kit 6-25
Rear Panel Parts 6-33
External Indicator Conditions 8-A-6
Internal Indications 8-A-6
Operation ..... Section III
Replaceable Parts
Exploded Views 6-23, 6-25, 6-27, 6-29, 6-31, 6-33, 6-35
PC Board Assemblies ..... 6-4 thru 6-13
Self-Test 3-21, 8-B-2
Specifications 1-4
Theory 8-B-1
Troubleshooting 8-B-2

05508-60021, Remote Control Unit
Connection 2-10
Description 1-14
Operation 3-21
Replaceable Parts 6-37
Theory 8-B-117

5518A, Laser Head
Block Diagram 8-C-8
Connection 2-5
Description 1-13
Exploded View 6-39
Indicator Conditions 8-A-7
Operation ..... Section III
Replaceable Parts
Exploded View 6-39
PC Board Assemblies ..... 6-14 thru 6-17
Specifications 1-4
Theory 8-C-1, 8-C-19, 8-C-21, 8-C-24, 8-C-27
Troubleshooting 8-C-11, 8-C-15, 8-C-19, 8-C-20, 8-C-22, 8-C-27

5528A Laser Measurement System
Block Diagram Description 8-A-1
Description 1-12
Installation 2-1
Specifications 1-1
Troubleshooting 8-A-5

10751A/B, Air Sensor
Calibration 4-9
Connection 3-11
Description 1-16
Exploded Views 6-41, 6-43
Operation 3-7
Replaceable Parts ..... 6-19 thru 6-20, 6-41, 6-43
Specifications 1-4
Theory 8-D-1
Troubleshooting 8-C-6

10753A, Tripod
Description 1-18
Replaceable Parts 6-46, 6-47
HP Parts 6-46
Manufacturer Parts 6-47

10757A/B/C, Material Temperature Sensors
Connection 3-11
Description 1-15
Exploded Views 6-45
Operation 3-5
Replaceable Parts 6-21, 6-45
Specifications 1-5
Theory 8-E-1
Troubleshooting 8-E-3

10758A, Footspacing Kit
Description 1-17
Specifications 1-7

10766A, Linear Interferometer
Description 1-18
Specifications 1-3

10767A, Linear Retroreflector
Description 1-18
Specifications 1-5

10770A, Angular Interferometer
Description 1-19
Specifications 1-6

10771A, Angular Reflector
Description 1-19
Specifications 1-8

10772A, Turning Mirror
Description 1-20
Specifications 1-7

10773A, Flatness Mirror
Description 1-20
Specifications 1-7

10774A, Short Range Straightness Optics
Description 1-21
Specifications 1-7

10775A, Long Range Straightness Optics
Description 1-21
Specifications 1-8

10776A, Straightness Accessory Kit
Description 1-22
Specifications 1-8

10777A, Optical Square
Description 1-23
Specifications 1-8

10784A, Base
Description 1-23
Specifications 1-6

10785A, Height Adjuster and Post
Description 1-24
Specifications 1-8

55280A, Linear Measurement Kit
Description 1-25
Specifications 1-5

55281A, Angular Optics
Description 1-26
Specifications 1-6

55282A, Flatness Accessory Kit
Description 1-26
Specifications 1-7

55283A, Straightness Measurement Kit
Description 1-27
Specifications 1-7

DECLARATION OF CONFORMITY

according to ISO/IEC Guide 22 and EN 45014

Manufacturer's Name:	Hewlett-Packard Company
Manufacturer's Address:	Santa Clara Division 5301 Stevens Creek Boulevard Santa Clara, California 95052-8059 U. S. A.

declares, that the product

System/Product Name:	Laser Measurement System, 5528A
System Component Model Numbers:	5508A Display, 10751A/B/C/D Air Sensor, 10757A/B/C/D/E/F Material Sensor
Product Options:	This declaration covers all options of the product.

conforms to the following Product Specifications:

Safety: IEC 1010-1 1990 + A1 / EN 61010-1: 1993

EMC: CISPR 22: 1993 / EN 55022: 1994 Class A
IEC 801-2: 1991 / EN 50082-1: 1992 4 kV CD, 8 kV AD
IEC 801-3: 1984 / EN 50082-1: 1992 3 V/m, 1kHz 80% AM, 27-1000MHz
IEC 801-4: 1988 / EN 50082-1: 1992 1 kV Power Lines, 0.5 kV Signal Lines
IEC 1000-3-2: 1995 /EN61000-3-2:1995 Harmonics, Class A
IEC 1000-3-3: 1994 /EN61000-3-3:1995 Flicker

Supplementary Information:

The product models listed above comply with the requirements of the Low Voltage Directive 73/23/EEC and the EMC Directive 89/336/EEC.

Santa Clara, California, November 7, 1995 Bruce Euler

Bruce Euler, Quality Engineering Manager

European Contact: Your local Hewlett-Packard Sales and Service Office or Hewlett-Packard GmbH, Dept. ZQ/Standards Europe, Herrenberger Straße 130, D-71034 Boblingen (FAX: +49-7031-143143)

DECLARATION OF CONFORMITY

according to ISO/ EC Guide 22 and EN 45014

Manufacturer's Name:	Hewlett-Packard Company
Manufacturer's Address:	Santa Clara Division 5301 Stevens Creek Boulevard Santa Clara, California 95052-8059 U. S. A.

declares, that the product

Product Name:	Laser Head
Model Number:	HP 5518A
Product Options:	This declaration covers all options of the product.

conforms to the following Product Specifications:

Safety: IEC 1010-1: 1990 + A1 / EN 61010-1: 1993
IEC 825-1: 1993 / EN 60825-1: 1994 Class 2

EMC: CISPR 22: 1993 / EN 55022: 1994 Class A
IEC 801-2: 1991 / EN 50082-1 1992 4 kV CD, 8 kV AD
IEC 801-3: 1984 / EN 50082-1 1992 3 V/m, 1kHz 80% AM, 27-1000MHz
IEC 801-4: 1988 / EN 50082-1 1992 1 kV Power Lines, 0.5 kV Signal Lines
EC 1000-3-2: 1995 /EN61000-3-2:1995 Harmonics, Class A
IEC 1000-3-3: 1994 /EN61000-3-3:1995 Flicker

Supplementary Information:

The product models listed above comply with the requirements of the Low Voltage Directive 73/23/EEC and the EMC Directive 89/336/EEC.

Santa Clara, California, November 7, 1995

Bruce Euer, Quality Engineering Manager

European Contact: Your local Hewlett-Packard Sales and Service Office or Hewlett-Packard GmbH, Dept. ZQ/Standards Europe, Herrenberger Straße 130, D-71034 Böblingen (FAX: +49-7031-143143)

HEWLETT PACKARD

If you need technical assistance with a Hewlett-Packard test and measurement product or application please contact the Hewlett-Packard office or distributor in your country.

United States of America:
Test and Measurement
Organization
5301 Stevens Creek Blvd
Santa Clara, CA 95052-8059
1 (800) 452-4844

Canada:
Hewlett-Packard Canada Ltd
5150 Spectrum Way
Mississauga, Ontario
L4W 5G1
(905) 206-4725

Japan:
Hewlett-Packard Japan Ltd
Measurement Assistance
Center
9-1, Takakura-cho, Hachioji-shi,
Tokyo, 192, Japan
(81) 426 48 3860

Latin America:
Hewlett-Packard
Latin American Region
Headquarters
5200 Blue Lagoon Drive
9th Floor
Miami, Florida 33126
(305) 267 4245/4220

Australia/New Zealand
Hewlett-Packard Australia Ltd
31-41 Joseph Street
Blackburn, Victoria 3130
Australia
(008) 131 347 Ext 2902
Melbourne Caller:
272 2555

Asia Pacific:
Hewlett-Packard Asia Pacific Ltd
17-21/F Shell Tower,
Times Square,
Matheson Street, Causeway Bay
Hong Kong
(852) 2599 7070

In Europe, Africa and Middle East, please call your local HP sales office or representative:

Austria/East Central Europe:
(1) 25000-0

Belgium and Luxembourg:
(02) 778 8147

Denmark:
45 99 10 00

Finland:
(90) 88 721

France:
(1) 69.82.65.00

Germany:
(0180) 532 62-33

Ireland:
(01) 284 4633

Israel:
(03) 5389 333

Italy:
(02) 92 122 999

Netherlands:
(020) 547 6669

Norway:
(22) 73 56 00

Portugal:
(11) 301 73 30

South Africa:
(011) 806 1000

Spain:
900 128 123

Sweden:
(08) 444 20 00

Turkey:
(312) 425 8813

U.K.:
(01344) 366 666

Switzerland:
(01) 735 7111

For European countries not listed, contact:
Hewlett-Packard
International Sales Europe
Geneva, Switzerland
Tel: +41-22-780 4111
Fax: +41-22-780-4770

Printed in U.S.A.
Data subject to change
Rev 01/98

HEWLETT PACKARD

Manual Part Number: 05528-90023

Printed in U.S.A.
February 1996

Printed on recycled paper

Printed on recycled paper

Artisan Technology Group is an independent supplier of quality pre-owned equipment

Gold-standard solutions

Extend the life of your critical industrial, commercial, and military systems with our superior service and support.

We buy equipment

Planning to upgrade your current equipment? Have surplus equipment taking up shelf space? We'll give it a new home.

Learn more!

Visit us at **artisantg.com** for more info on price quotes, drivers, technical specifications, manuals, and documentation.

Artisan Scientific Corporation dba Artisan Technology Group is not an affiliate, representative, or authorized distributor for any manufacturer listed herein.

We're here to make your life easier. How can we help you today?

(217) 352-9330 | sales@artisantg.com | artisantg.com

ARTISAN® TECHNOLOGY GROUP