ARTISAN®
TECHNOLOGY GROUP

Your **definitive** source for quality pre-owned equipment.

Artisan Technology Group
(217) 352-9330 | sales@artisantg.com | artisantg.com

Full-service, independent repair center
with experienced engineers and technicians on staff.

We buy your excess, underutilized, and idle equipment
along with credit for buybacks and trade-ins.

Custom engineering
so your equipment works exactly as you specify.

- Critical and expedited services
- In stock / Ready-to-ship
- Leasing / Rentals / Demos
- ITAR-certified secure asset solutions

Expert team | Trust guarantee | 100% satisfaction


All trademarks, brand names, and brands appearing herein are the property of their respective owners.

Find the *Yaskawa JANCD-FC200-2* at our website: ***Click HERE***

YASNAC i80

CNC SYSTEM FOR MACHINE TOOLS

MAINTENANCE MANUAL

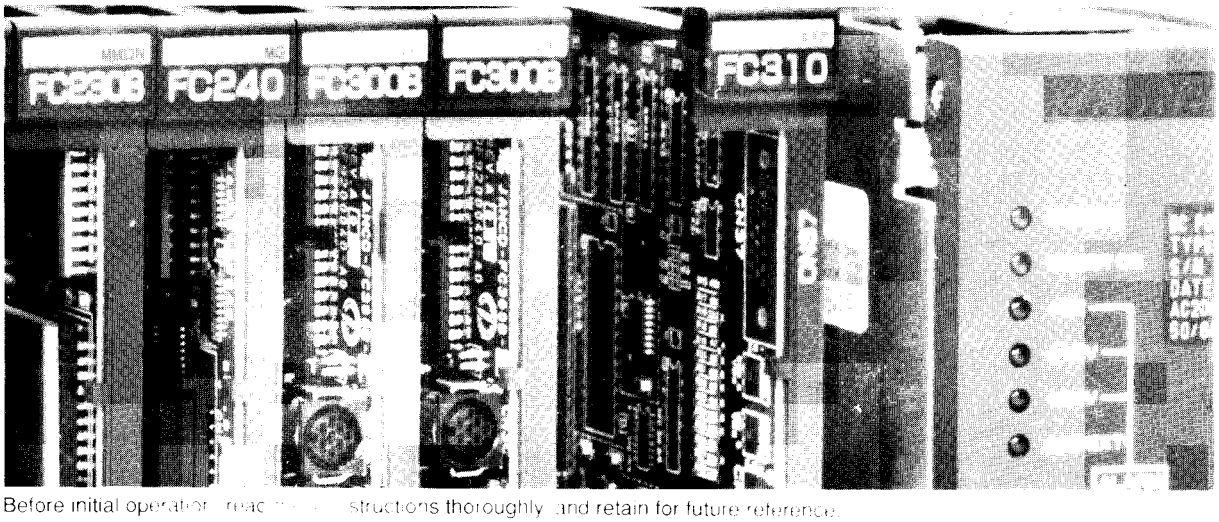

Before initial operation, read these instructions thoroughly and retain for future reference.

YASKAWA

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

This manual is primarily intended to give operators maintenance instructions for YASNAC i80.

The information contained in manual does not provide all details to be met concerning maintenance and troubleshooting. If uncertainties be encountered for particular maintenance operation, refer to following YASNAC i80 documents for additional the information:

- YASNAC i80 PLC SYSTEM (T OE-C843-11.1)
- YASNAC i80M SPECIFICATIONS (SIE-C843-11.30)
- YASNAC i80L SPECIFICATIONS (S IE-C843-11.20)
- YASNAC i80M INSTRUCTION MANUAL (T OE-C843-11.30)
- YASNAC i80M INSTRUCTION MANUAL APPENDIX (TOE-C843-11.31)
- YASNAC i80L INSTRUCTION MANUAL (T OE-C843-11.20)
- YASNAC i80L INSTRUCTION MANUAL APPENDIX (TOE-C843-11.21)
- YASNAC i80 CONNECTING MANUAL (T OE-C843-11.5)

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

CONTENTS

1 OUTLINE 1

2 ROUTINE INSPECTION SCHEDULE 57

3 MAINTENANCE INSTRUMENTS 67

4 TROUBLESHOOTING 69

5 ADJUSTMENTS UPON INSTALLATION 135

6 MODULE/UNIT REPLACEMENT PROCEDURE ... 143

7 SETTING AND ADJUSTMENT OF EACH MODULE .197

8 OPERATIONS OF FIXED FILES . ..203

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

CONTENTS

Page

1. OUTLINE 1
1.1 COMPONENTS AND INTERCONNECTIONS 2
1.2 COMPONENTS 11

2. ROUTINE INSPECTION SCHEDULE 57
2.1 ROUTINE INSPECTION 58
2.2 TAPE READER MAINTENANCE 59
2.3 CONTROL PANEL 60
2.4 AC SERVOMOTOR 62
2.5 BATTERY 63

3. MAINTENANCE INSTRUMENTS 67

4. TROUBLESHOOTING 69
4.1 TROUBLE Identification 71
4.1.1 RECOGNITION OF TROUBLE STATUS 71
4.1.2 RECOGNITION OF NC SYSTEM 72
4.2 TROUBLESHOOTING BY ALARM CODES 77
4.2.1 DISPLAY METHOD 77
4.2.1 .1 ALARM INDICATION JOB 79
4.2.2 ALARMS OOIO AND OOO11 (PARITY ERROR) 82
4.2.3 ALARMS 0016, 0017, 0018, 9016, 9017 AND 9018 (RS-232C ERROR) 83
4.2.4 ALARM 1099 (TEMPERATURE ALARM INSIDE THE PANEL) 88
4.2.5 ALARMS, 2061 T02068 (ZERO POINT RETURN AREA ERROR) 89
4.2.6 ALARMS 2071 T02078, 2081 T0 2088
(REFERENCE POINT RETURN AREA ERROR) 90
4.2.7 ALARMS 2101 TO 2108 (P-SET ERROR) 91
4.2.8 ALARM 3000 (SERVO UNREADY) 92
4.2.9 ALARM 3001 (CONTROL NOT READY) 92
4.2.1 0 ALARM 3002 (EMERGENCY STOP) 93
4.2.11 ALARMS 3041 T03048 (EXCESSIVE POSITION LAG) 94
4.2.12 ALARMS 3051 T03054 (EXCESSIVE POSITION LAG) 95
4.2.13 ALARMS 3061 T03068 (MOTOR OVERLOAD) 96
4.2.14 ALARMS 3081 T03088 (PG DISCONNECTION ERROR) 96
4.2.15 ALARMS 3091 TO 3094 (SPINDLE PG DISCONNECTION ERROR) 97
4.2.16 ALARMS 3121 T03128 (EXCESSIVE SPEED) 97
4.2.17,-ALARMS 3141 TO 3148 (PREVENTION OF UNCONTROLLED RUNNING) 98
4.2.18 ALARMS 3161 TO 3168 (ABSOLUTE ERRORS) 98
4.2.19 ALARMS 3181 T03188 (POSITION ERRORS) 99

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Page

4.2.20 ALARMS 3201 TO 3208 (SERVODRIVE UNIT COMMUNICATION ERRORS) 99
4.2.21 ALARMS 3301 T03305 (OVERCURRENT) 100
4.2.22 ALARMS 3311 T03315(MCCB TRIP) 100
4.2.23 ALARMS 3321 TO 3325 (REGENERATIVE ERROR) 100
4.2.24 ALARMS 3331 T03335 (OVERVOLTAGE) 101
4.2.25 ALARMS 3341 T03345 (UNDERVOLTAGE) 101
4.2.26 ALARMS 3351 TO 3355 (HEAT SINK OVERHEAT) 101
4.2.27 ALARMS 3361 TO 3365 (WIRE BREAK IN CURRENT INSTRUCTION CABLE) 102
4.2.28 ALARMS 3371 T03375 (MISSING PHASE) 102
4.3 TROUBLESHOOTING WITHOUT ALARM CODES 103
4.3.1 POWER CANNOT RESUPPLIED 103
4.3.2 SOLUTION TO ERRORS DETECTED IN SELF-DIAGNOSIS 104
4.3.2.1 SELF-DIAGNOSIS FUNCTIONS 104
4.3.2.2 DETAILS OF FUNCTION 105
4.3.3 CRT SCREEN DOES NOT DISPLAY 113
4.3.4 HANDLE MODE OPERATION FAULTY 113
4.3.5 MANUALJOG M0DE0PERATIoN Faulty 115
4.3.6 MANUAL RAPID MODE OPERATION FAULTY 117
4.3.7 MANUAL ZERO RETURN OPERATION FAuLTy 119
4.3.8 CYCLE START FAILURE 120
4.3.9 OPERATION IS NOT AVAILABLE WITH GO1, G02, OR G03 121
4.3.1 OSPINDLE DOES NOT ROTATE 122
4.3.119" CRT SCREEN IS DARK 123
4.3.12 EDIT DOES NOT FUNCTION 124
4.3.13 FIN WAIT OCCURS BY SPINDLE RELATED INSTRUCTION 125
4.3.14 SKIP FUNCTION (G31) OPERATION Failure 126
4.3.15 TAPE MODE DOES NOT FUNCTION 127
4.4 POWER SUPPLY VOLTAGE CHECK 128
4.4.1 CHECK AT POWER SUPPLY VOLTAGE 128
4.4.2 INDICATION OF LAMP OF POWER SUPPLY UNIT 129
4.4.3 CHECK DC POWER SUPPLY VOLTAGE 129
4.5 STATUS DISPLAY BY SELF-DIAGNOSIS FUNCTION (DGN) 130
4.5.1 OUTLINE OF DISPLAY 130
4.5.2 DISPLAYING INPUT/OUTPUT SIGNALS 131

5. ADJUSTMENTS UPONINSTALLATION 135

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Page

6. MOD ULE/UNIT REPLACEMENT PROCEDURE ····· 143
6.1 NC RACK""""""""""""""""""""""""""""""" ···· "" ·· 144
6.1.1 POWER SUPPLY UNIT (MODEL CPS-12N, MODEL CPS-16F)·····. ·· 144
6.1.2 MODEL JANCD-FCIOOB ".".". . ..". o... o"" C. COB""""""""""""""""""""""""""""" ····· 146
6.1.3 MODEL JANCD-FC190-1····· 148
6.1.4 MODEL JANCD-FC200 ····· 150
6.1.5 MODEL JANCD-FC210-1····· 152
6.1.6 MODEL JANCD-FC222/FC224 ····· """""" ."""" """....." 154
6.1.7 MODEL JANCD-FC230B····· 156
6.1.8 MODEL JANCD-FC240····· 158
6.1.9 MODEL JANCD-FC300B-3····· 160
6.1.10 MODEL JANCD-FC250(INTEXB BOARD: STANDARD SPECIFICATIONS) ··.· 162
6.1.11 MODEL JANCD-FC251(INTEXB BOARD: HIGH-SPEED SPECIFICATIONS) ·· 164
6.1.12 MODEL JANCD-FC250-1, 2 (MOTION BOARD) ····· 166
6.1.13 MODEL JANCD-FC310-1·· . . ····· 168
6.1.14 MODEL JANCD-FC400 ····· 170
6.1.15 MODEL JANCD-FC41O ····· 172
6.1.16 MODEL JANCD-FC420 ····· 174
6.1.17 MODEL JANCD-FC430 ····· 176
6.1.18 MODEL JANCD-FC440 ····· 178
6.1.19 BACK BOARD (MODELS JANCD-FC001,-FC002,-FC050,-FC052)····· . . 180
6.1.20 11-SLOT BACK BOARD (MODEL JANCD-FC006)····· 182
6.2 MACHINE CONTROL STATION ····· 184
6.2.1 9" AMGC CONTROL PANEL (MODEL JZNC-IOP01)····· 184
6.2.1.1 MODEL JANCD-FC900B ····· 184
6.2.1.2 MODEL JANCD-FC901····· 187
6.2.1.3 MODEL JANCD-FC903-1····· 188
6.2.1.4 9" MONOCHROME GRAPHIC CRT UNIT (MDT948B-3B)····· . . ····· 189
6.2.1.5 KEYBOARD (MODEL DF8203788) ····· 190
6.2.2 14" ACGC CONTROL PANEL (MODEL JZNC-IOP11)····· """""""""" ····· 191
6.2.2 .1 MODEL JANCD-FC950-100" O ····· 191
6.2.2.2 MODEL JANCD-FC951 ····· . . ····· . . . ····· 193
6.2.2.314" COLOR GRAPHIC CRT UNIT (MODEL TX1424AD) .0 ····· ..0.. 194
6.2.2.4 KEYBOARD (MODEL DF8203921) ····· 195

7. SETTING AN DADJUSTM EN TOF EACH MODULE ····· 197

8. OPERATIONS OF FIXED FILES ····· '203
8.1 TYPES OF FIXED FILES ····· 204
8.2 DISPLAY AND WRITING OF FIXED FILES ····· 205

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

INDEX

	Subject	Chapter	Par	Page
A	AC SERVO MOTOR	2	2.4	62
	ADJUSTMENTS UPON INSTALLATION	5		135
	ALARM 1099 (TEMPERATURE ALARM INSIDE THE PANEL)	4	4.2.4	88
	ALARM 3001 (CONTROL NOT READY)	4	4.2.9	92
	ALARM 3002 (EMERGENCY STOP)	4	4.2.10	93
	ALARM INDICATION JOB	4	4.2.1.1	79
	ALARMS 0010 AND 0011 (PARITY ERROR)	4	4.2.2	82
	ALARMS 0016, 0017, 0018, 9016, 9017, AND 9018 (RS-232C ERROR)	4	4.2.3	83
	ALARMS 2061 TO 2068 (ZERO POINT RETURN AREA ERROR)	4	4.2.5	89
	ALARMS 2071 TO 2078, 2081 TO 2088 (REFERENCE POINT RETURN AREA ERROR)	4	4.2.6	90
	ALARMS 2101 T02108 (P-SET ERROR)	4	4.2.7	91
	ALARMS 3000 (SERVO UNREADY)	4	4.2.8	92
	ALARMS 3041 TO 3048 (EXCESSIVE POSITION LAG)	4	4.2.11	94
	ALARMS 3051 TO 3054 (EXCESSIVE POSITION LAG)	4	4.2.12	95
	ALARMS 3061 TO 3068 (MOTOR OVERLOAD)	4	4.2.13	96
	ALARMS 3081 TO 3088 (PG DISCONNECTION ERROR)	4	4.2.14	96
	ALARMS 3091 TO 3094 (SPINDLE PG DISCONNECTION ERROR)	4	4.2.15	97
	ALARMS 3121 T03128 (EXCESSIVE SPEED)	4	4.2.16	97
	ALARMS 3141 TO 3148 (PREVENTION OF UNCONTROLLED RUNNING)	4	4.2.17	98
	ALARMS 3161 TO 3168 (ABSOLUTE ERRORS)		4.2.18	98
	ALARMS 3181 T03188 (POSITION ERRORS)	4	4.2.19	99
	ALARMS 3201 TO 3208 (SERVODRIVE UNIT COMMUNICATION ERRORS)	4	4.2.20	99
	ALARMS 3301 TO 3305 (OVERCURRENT)		4.2.21	100
	ALARMS 3311 TO 3315 (MCCB TRIP)	4	4.2.22	100
	ALARMS 3321 TO 3325 (REGENERATIVE ERROR)	4	4.2.23	100
	ALARMS 3331 TO 3335 (OVERVOLTAGE)	4	4.2.24	101
	ALARMS 3341 TO 3345 (UNDERVOLTAGE)	4	4.2.25	101
	ALARMS 3351 TO 3355 (HEATSINK OVERHEAT)	4	4.2.26	101
	ALARMS 3361 TO 3365 (WIRE BREAK IN CURRENT INSTRUCTION CABLE)	4	4.2.27	102
	ALARMS 3371 TO 3375 (MISSING PHASE)	4	4.2.28	102
B	BACK BOARD (MODELS JANCD-FCOO1, -FC002, -FC050, -FC052)	6	6.1.19	180
	BATTERY	2	2.5	63
c	CHECK AT POWER SUPPLY VOLTAGE	4	4.4.1	128
	CHECK DC POWER SUPPLY VOLTAGE	4	4.4.3	129
	COMPONENTS	1	1.2	11
	COMPONENTS AND INTERCONNECTIONS	1	1.1	2
	CONTROL PANEL	2	2.3	60
	CRT SCREEN DOES NOT DISPLAY	4	4.3.3	113
	CYCLE START FAILURE	4	4.3.8	120
D	DETAILS OF FUNCTION	4	4.3.2.2	105
	DISPLAY AND WRITING OF FIXED FILES	8	8.2	205
	DISPLAY METHOD	4	4.2.1	77
	DISPLAYING INPUT/OUTPUT SIGNALS	4	4.5.2	131
E	EDIT DOES NOT FUNCTION	4	4.3.12	124
	Il-sLOT BACK BOARD (MODEL JANCD-FCO06)	6	6.1.20	182
F	FIN WAIT OCCURS BY SPINDLE RELATED INSTRUCTION	4	4.3.13	125
	14" ACGC-CONTROL PANEL (MODEL JZNC-IOP11)	6	6.2.2	191
	14" COLOR GRAPHIC CRT UNIT (MODEL TX1424AD)	6	6.2.2.3	194
H	HANDLE MODE OPERATION FAULTY	4	4.3.4	113
I	INDICATION OF LAMP OF POWER SUPPLY UNIT	4	4.4.2	129
K	KEYBOARD (MODEL DF8203788)	6	6.2.1.5	190
	KEYBOARD (MODEL DF8203921)	6	6.2.2.4	195

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

	Subject	Chapter	Par.	Page
M	MACHINE CONTROL STATION	6	6.2	184
	MAINTENANCE INSTRUMENTS	3		67
	MANUAL JOG MODE OPERATION FAULTY	4	4.3.5	115
	MANUAL RAPID MODE OPERATION FAULTY	4	4.3.6	117
	MANUAL ZERO RETURN OPERATION FAULTY	4	4.3.7	119
	MODEL JANCD-FC100C	6	6.1.2	146
	MODEL JANCD-FC190-1	6	6.1.3	148
	MODEL JANCD-FC200	6	6.1.4	150
	MODEL JANCD-FC210-1	6	6.1.5	152
	MODEL JANCD-FC222/FC224	6	6.1.6	154
	MODEL JANCD-FC230B	6	6.1.7	156
	MODEL JANCD-FC242	6	6.1.8	158
	MODEL JANCD-FC250 (INTEXB BOARD : STANDARD SPECIFICATIONS)	6	6.1.10	162
	MODEL JANCD-FC250-1, 2 (MOTION BOARD)	6	6.1.12	166
	MODEL JANCD-FC251(INTEXB BOARD : HIGH SPEED SPECIFICATIONS)	6	6.1.11	164
	MODEL JANCD-FC300B-3	6	6.1.9	160
	MODEL JANCD-FC310-1	6	6.1.13	168
	MODEL JANCD-FC400	6	6.1.14	170
	MODEL JANCD-FC410	6	6.1.15	172
	MODEL JANCD-FC420	6	6.1.16	174
	MODEL JANCD-FC430	6	6.1.17	176
	MODEL JANCD-FC440	6	6.1.18	178
	MODEL JANCD-FC900B	6	6.2.1.1	184
	MODEL JANCD-FC901	6	6.2.1.2	187
	MODEL JANCD-FC903-1	6	6.2.1.3	188
	MODEL JANCD-FC950-1	6	6.2.2.1	191
	MODEL JANCD-FC951	6	6.2.2.2	193
	MODULE/UNIT REPLACEMENT PROCEDURE	6		143
N	NC RACK	6	6.1	144
	9" AMGC CONTROL PANEL (MODEL JZNC-IOP01)	6	6.2.1	184
	9" CRT SCREEN IS DARK	4	4.3.11	123
	9" MONOCHROME GRAPHIC CRT UNIT (MDT948-3B)	6	6.2.1.4	189
o	OPERATION IS NOT AVAILABLE WITH GOI, G02, OR G03	4	4.3.9	121
	OPERATIONS OF FIXED FILES	8		203
	OUTLINE	1		1
	OUTLINE OF DISPLAY	4	4.5.1	130
P	POWER CANNOT BE SUPPLIED	4	4.3.1	103
	POWER SUPPLY UNIT (MODEL CPS-12N, MODEL CPS-16F)	6	6.1.1	144
	POWER SUPPLY VOLTAGE CHECK	4	4.4	128
R	RECOGNITION OF NC SYSTEM	4	4.1.2	72
	RECOGNITION OF TROUBLE STATUS	4	4.1.1	71
	ROUTINE INSPECTION	2	2.1	58
	ROUTINE INSPECTION SCHEDULE	2		57
s	SELF-DIAGNOSIS FUNCTIONS	4	4.3.2.1	104
	SETTING AND ADJUSTMENT OF EACH MODULE	7		197
	SKIP FUNCTION (G31) OPERATION FAILURE	4	4.3.14	126
	SOLUTION TO ERRORS DETECTED IN SELF-DIAGNOSIS	4	4.3.2	104
	SPINDLE DOES NOT ROTATE	4	4.3.10	122
	STATUS DISPLAY BY SELF-DIAGNOSIS FUNCTION (DGN)	4	4.5	130
T	TAPE MODE DOES NOT FUNCTION	4	4.3.15	127
	TAPE READER MAINTENANCE	2	2.2	59
	TROUBLE IDENTIFICATION	4	4.1	71
	TROUBLESHOOTING	4		69
	TROUBLESHOOTING BY ALARM CODES	4	4.2	77
	TROUBLESHOOTING WITHOUT ALARM CODES	4	4.3	103
	TYPES OF FIXED FILES	8	8.1	204

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

1. OUTLINE

1

The YASNAC i80 provides you with an internal self-diagnosis function. System maintenance can easily by accomplished with DGN and other main functions as listed below;

(1) Microprocessor always monitors the machine operations internally and can display the status with function keys.
If any failure occurs, NC immediately stops with the blinking of alarm displays. Also the same precedure can be executed on machine sequence for the application of built-in type programmable controller.

(2) ON/OFF SIGNAL of Input to NC/Output from NC can be displayed with DGN.

(3) Setting value of various parameters such as accel/decel time constant and rapid speed can be checked on the CRT,

CONTENTS

1. OUTLINE 1
1.1 COMPONENTS AND INTERCONNECTIONS 2
1.2 COMPONENTS 11

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

1.1 COMPONENTS AND INTERCONNECTIONS

(1) Component Arrangement

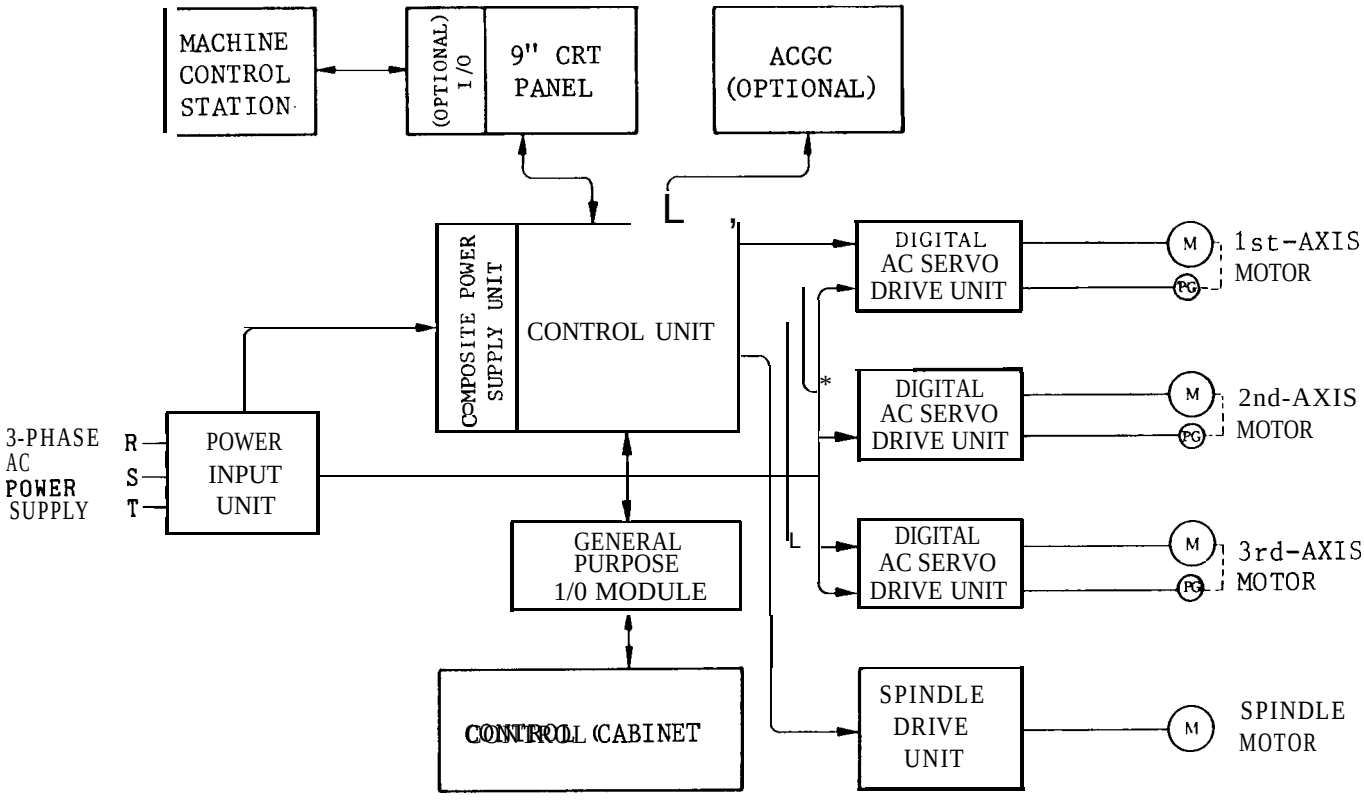


Fig. 1.1 Component Arrangement of YASNACi

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(2) Interconnection Diagram

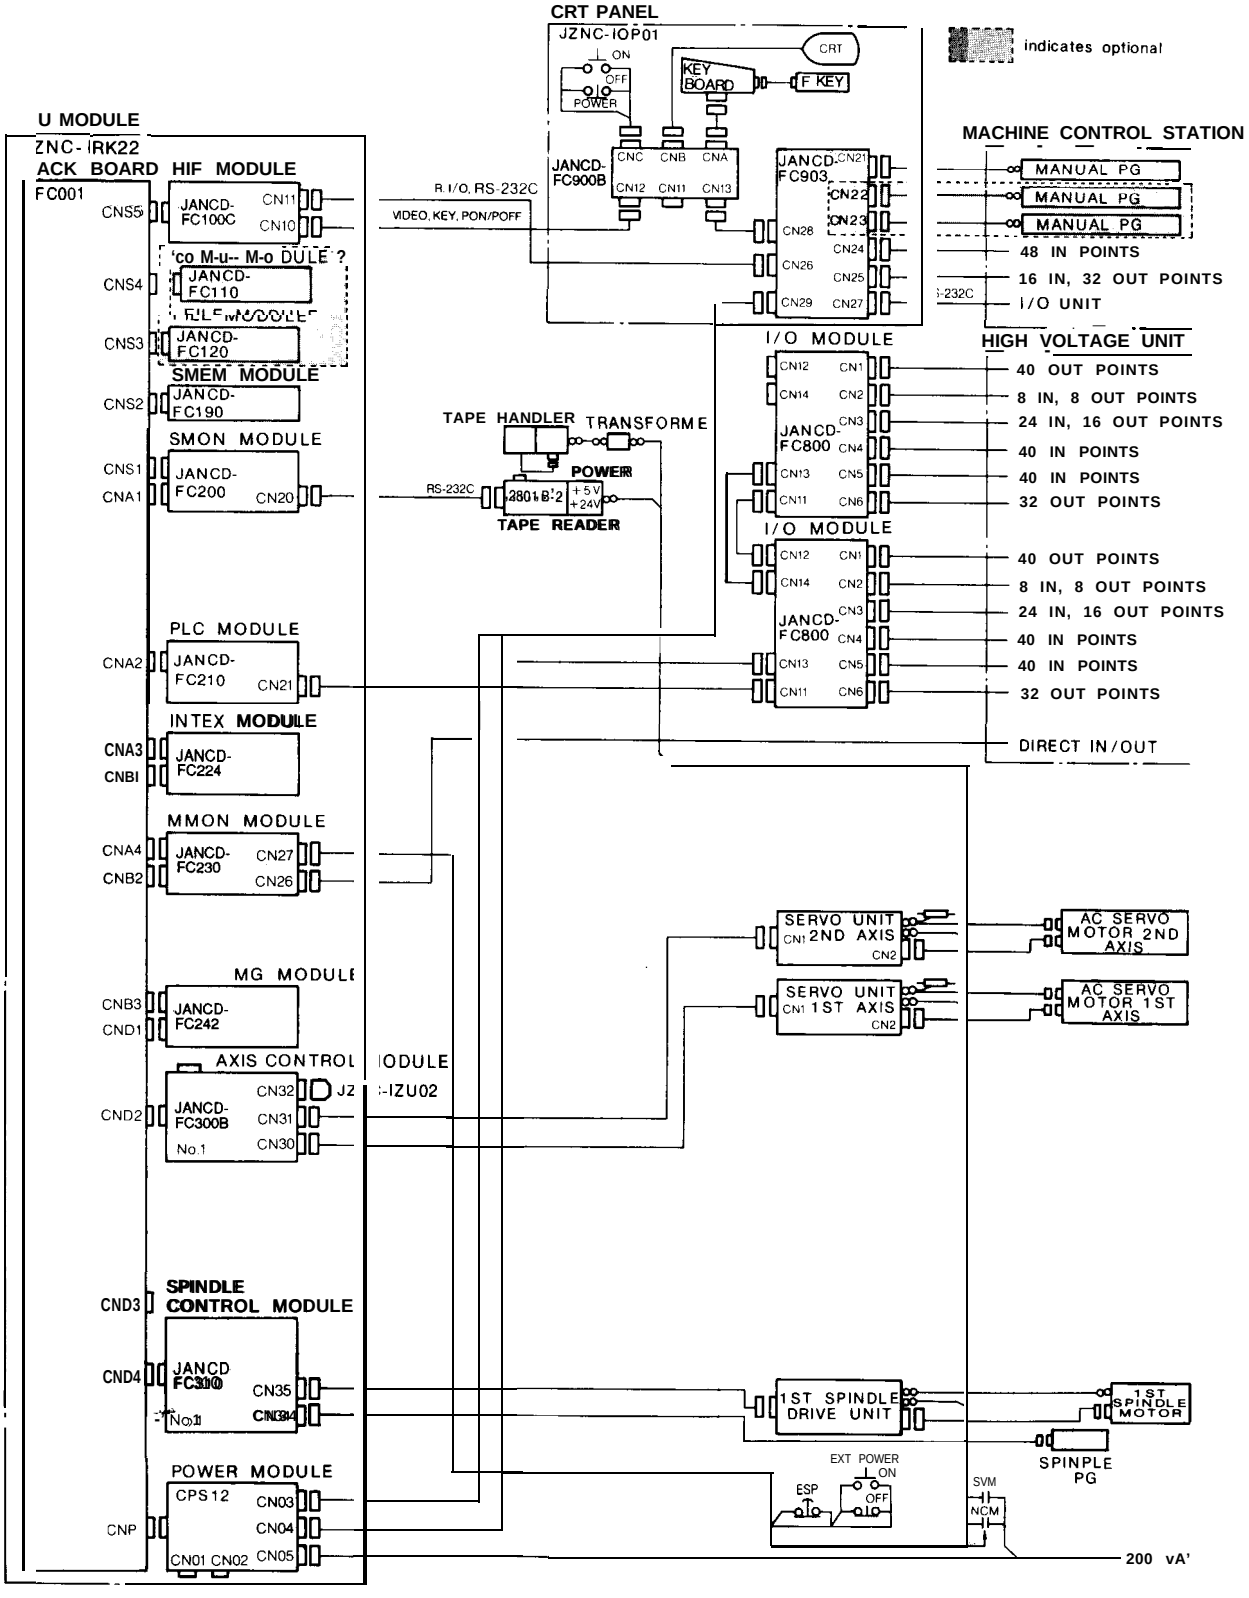


Fig. 1.2 Interconnection Diagram (YASNAC-i80L for Lathe)

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

1.1 COMPONENTS AND INTERCONNECTIONS (Cent'd)

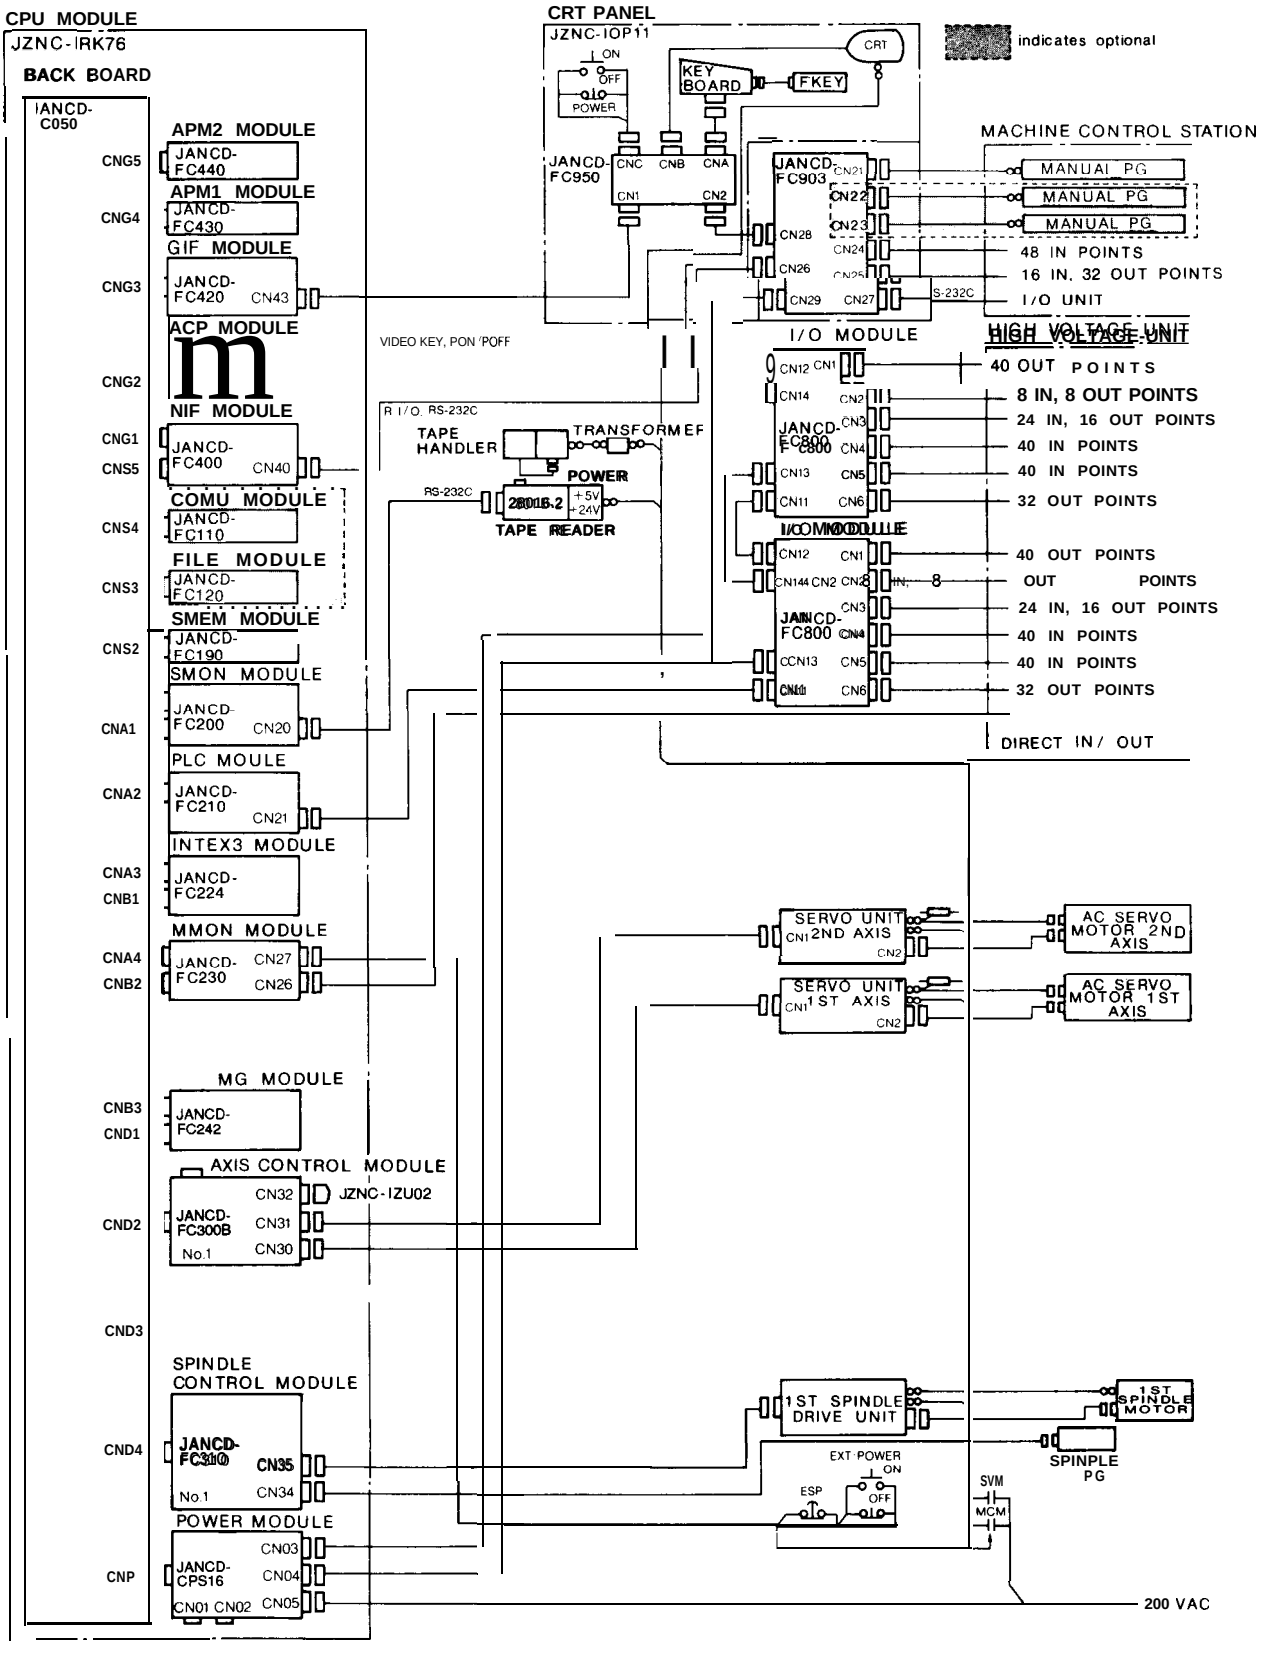


Fig. 1.3 Interconnection Diagram [Y AS NAC-i80L for Lathe with ACGC]

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

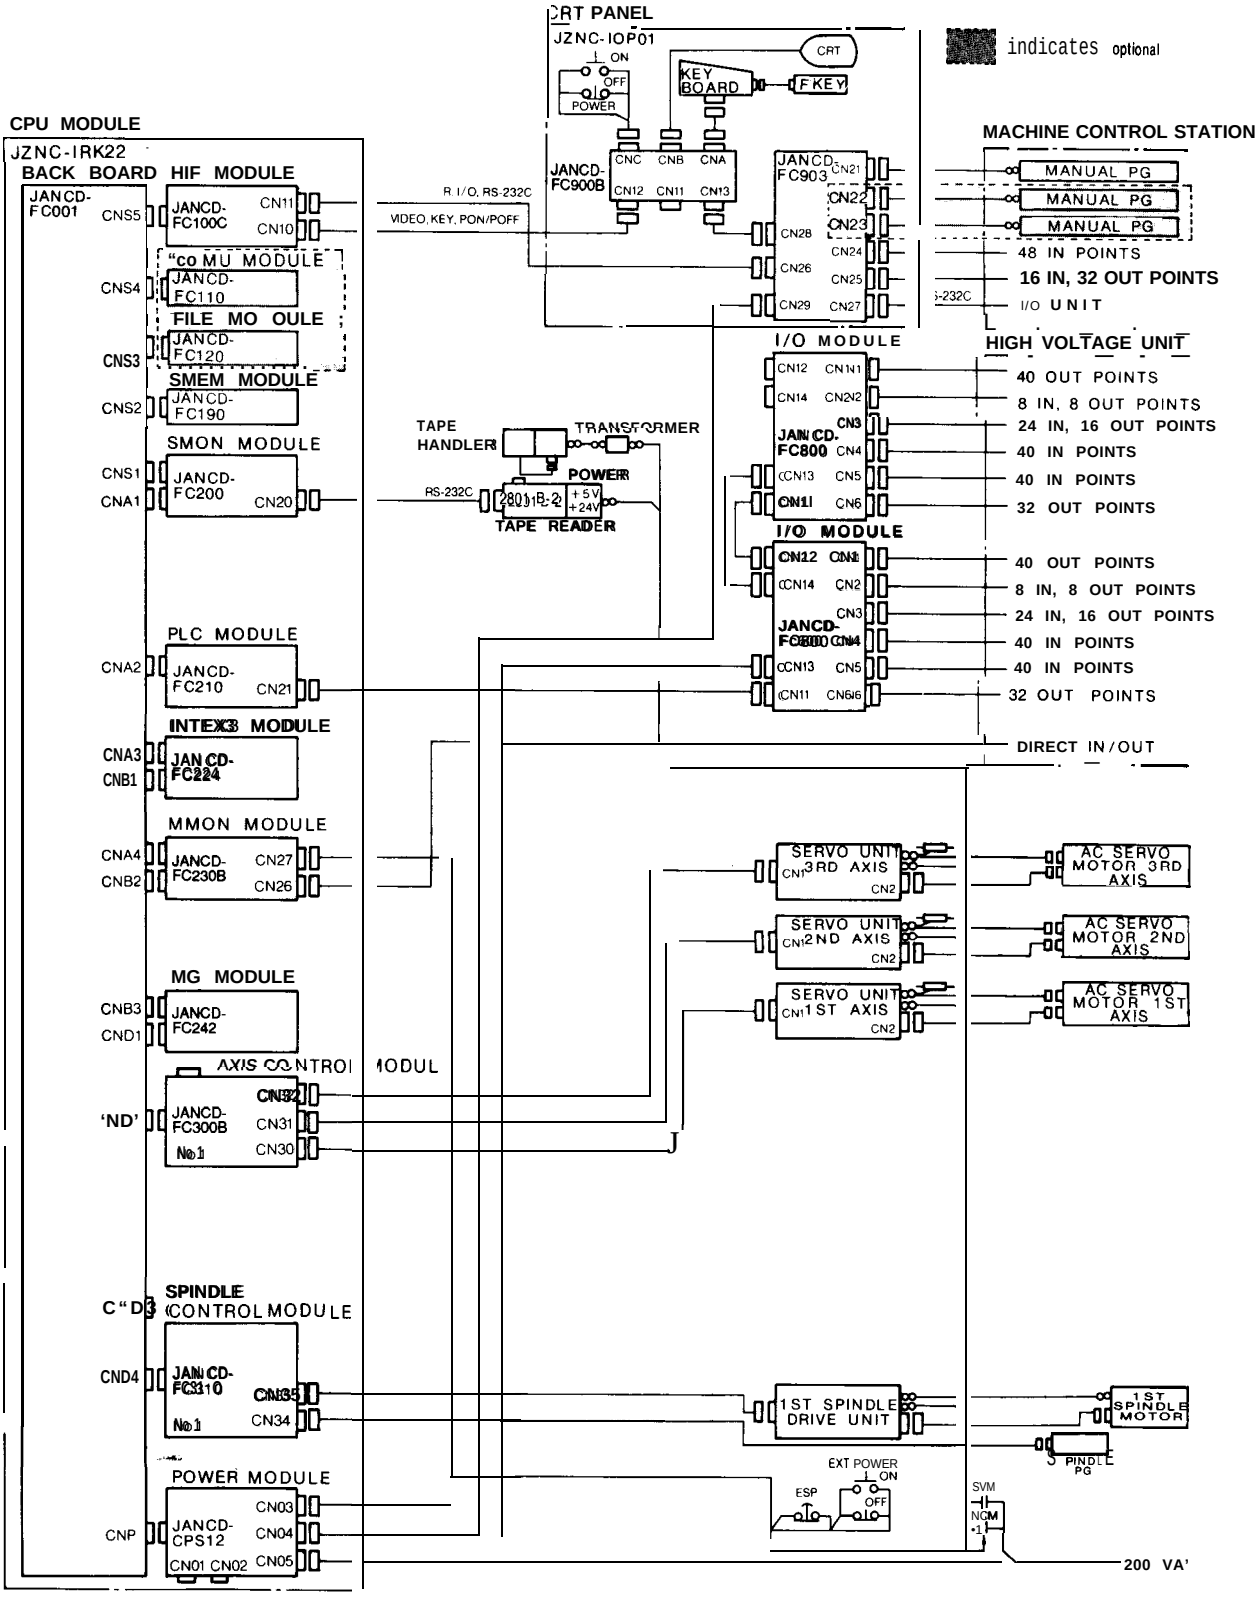


Fig. 1.4 Interconnection Diagram [Y AS NAC-i80M for Machining Center]

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

1.1 COMPONENTS AND INTERCONNECTIONS (Cent'd)

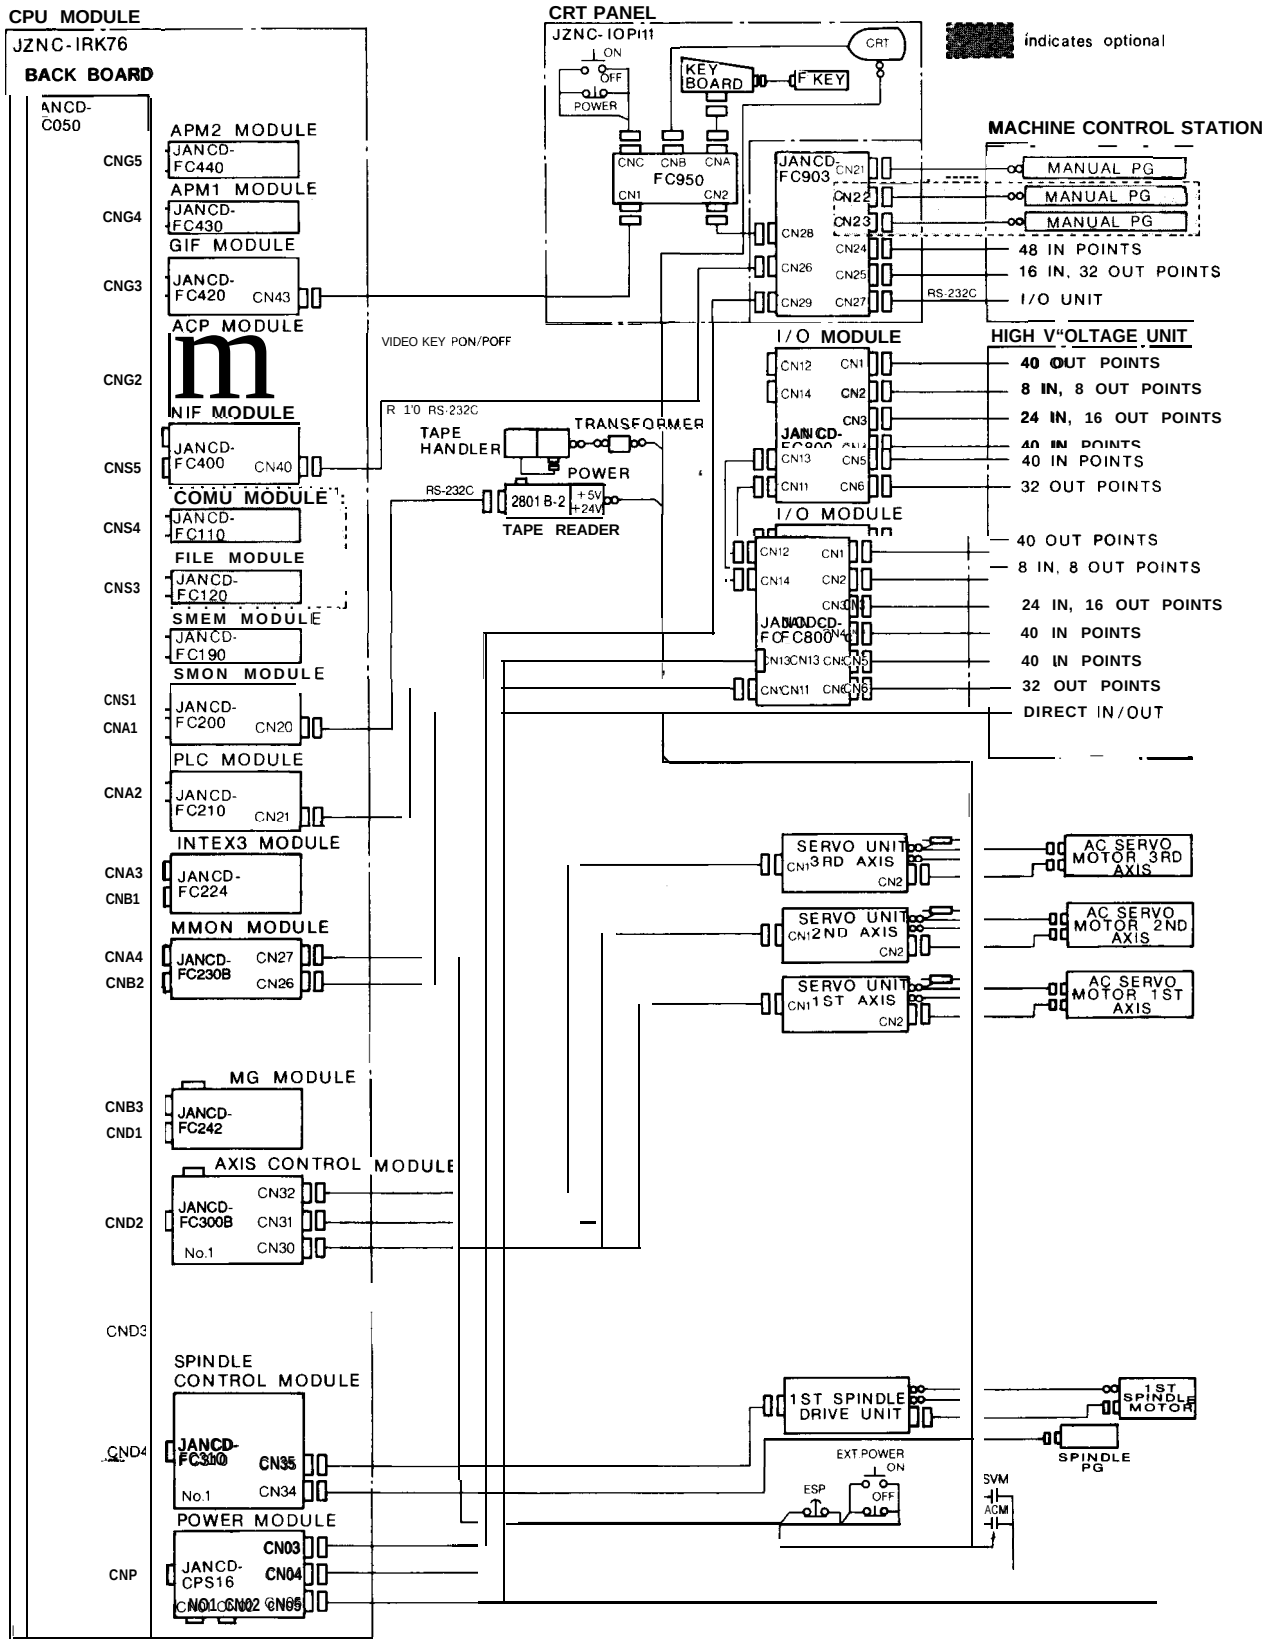


Fig. 1.5 Interconnection Diagram [Y AS NAC-i80M for Machining Center with ACGC)

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

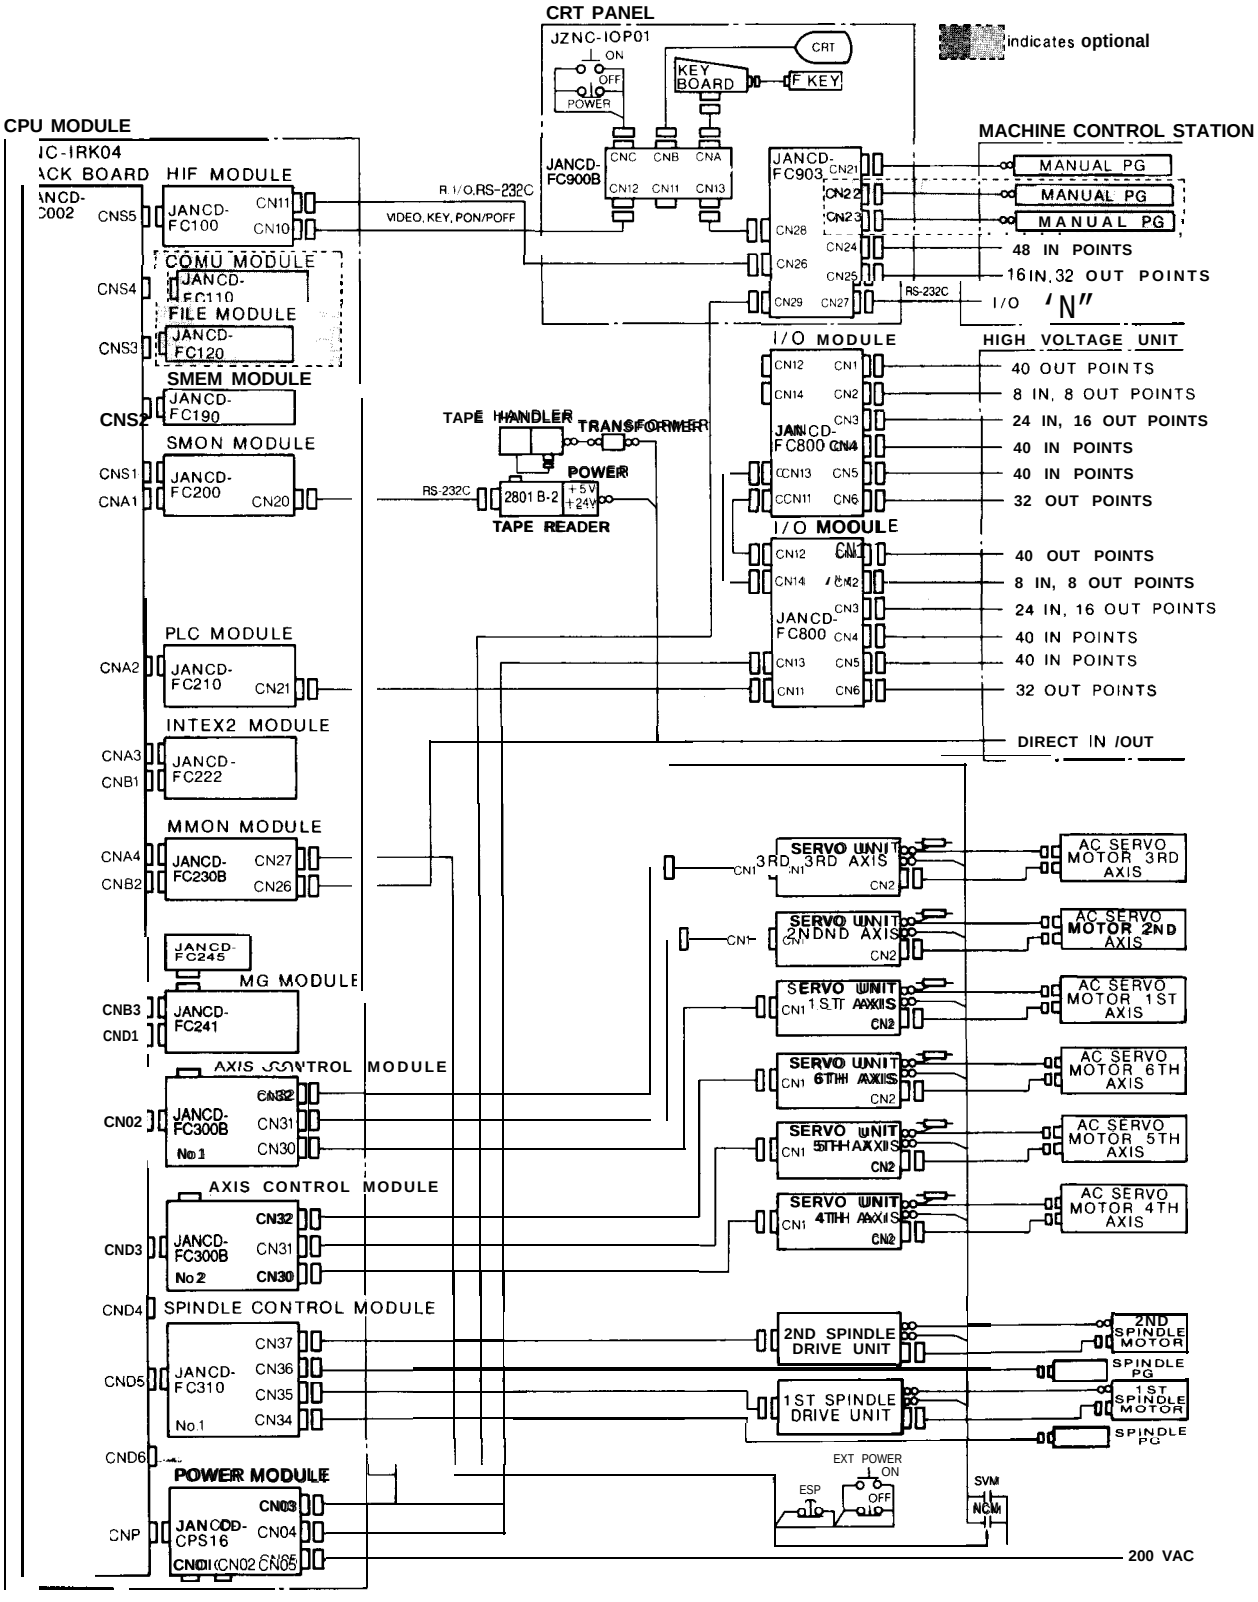


Fig. 1.6 Interconnection Diagram [Y AS NAC-i80L for Multi-Axis Lathe)

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

1.1 COMPONENTS AND INTERCONNECTIONS (Cent'd)

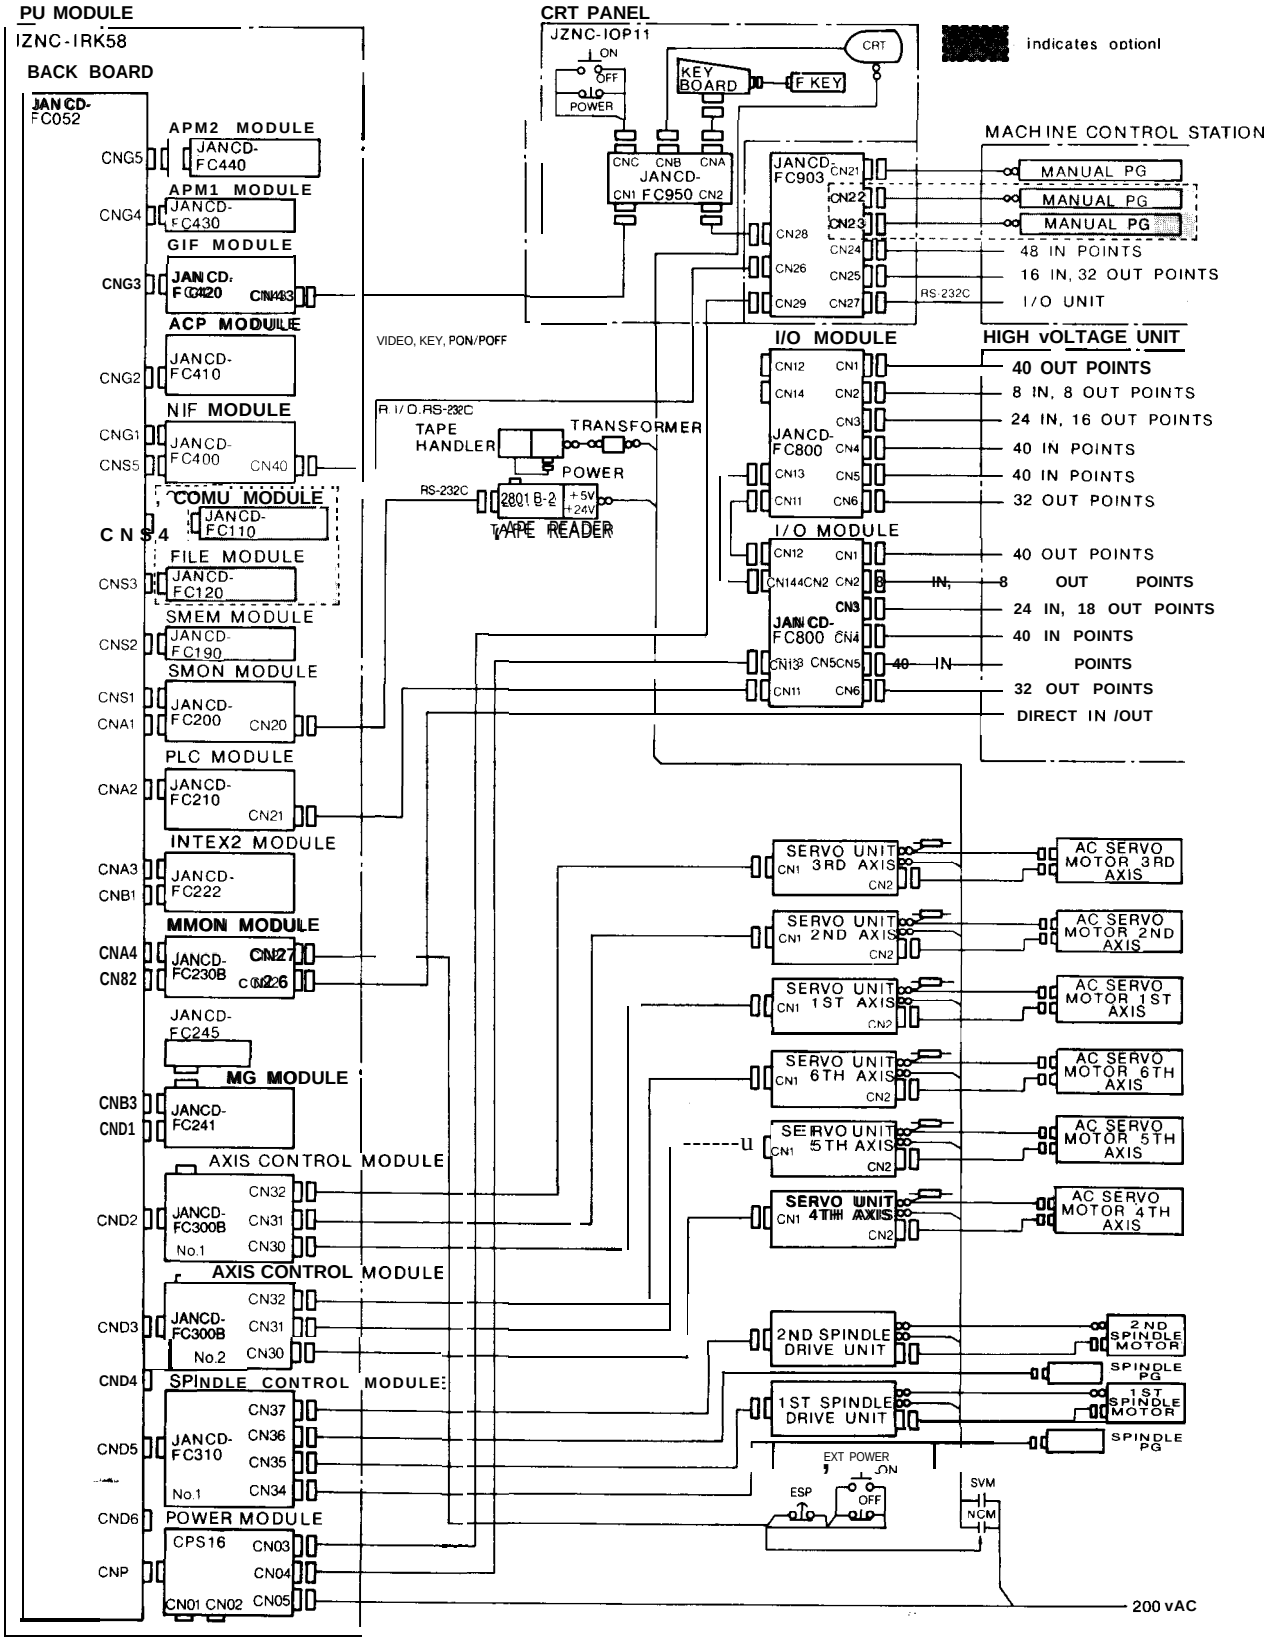


Fig. 1.7 Interconnection Diagram [Y AS NAC-i80L for Multi-Axis Lathe with ACGC]

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

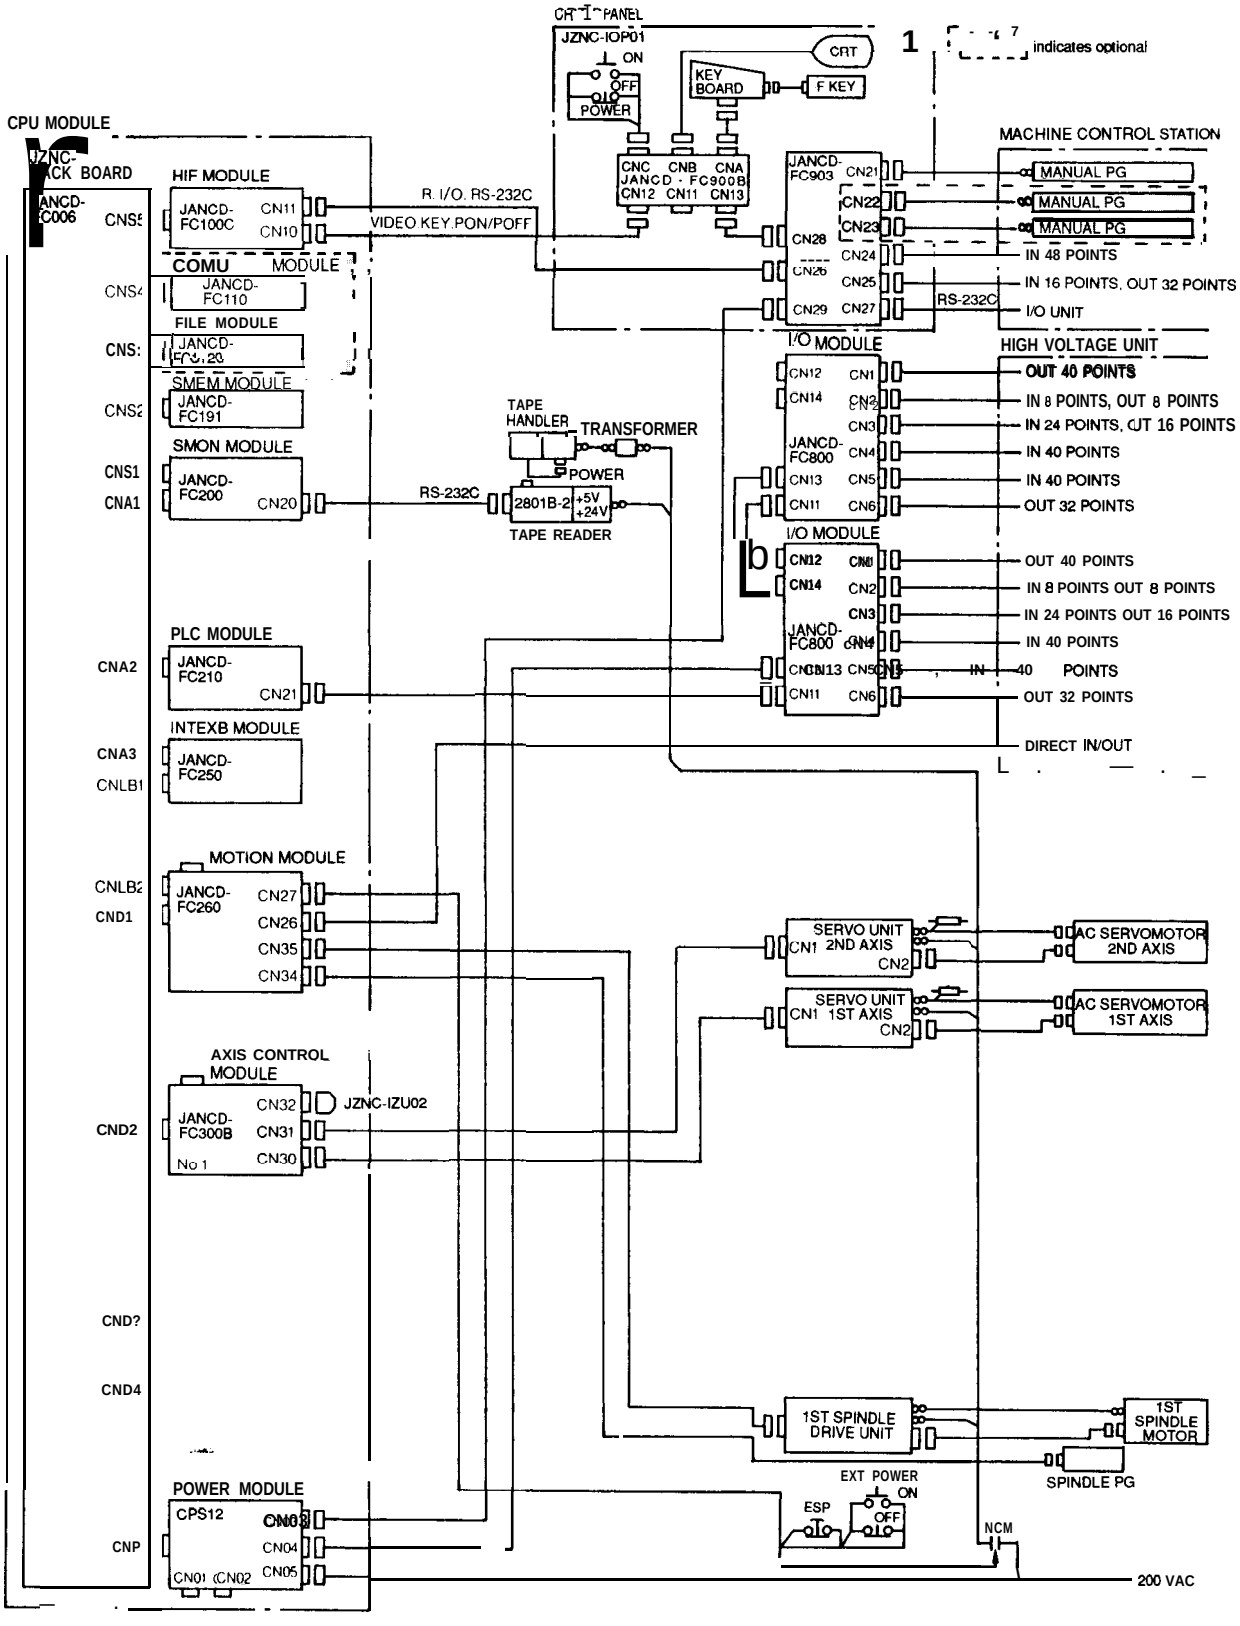


Fig. 1.8 Interconnection Diagram [Y AS NAC-i80LB for Lathe]

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

1.1 COMPONENTS AND INTERCONNECTIONS (Cent'd)

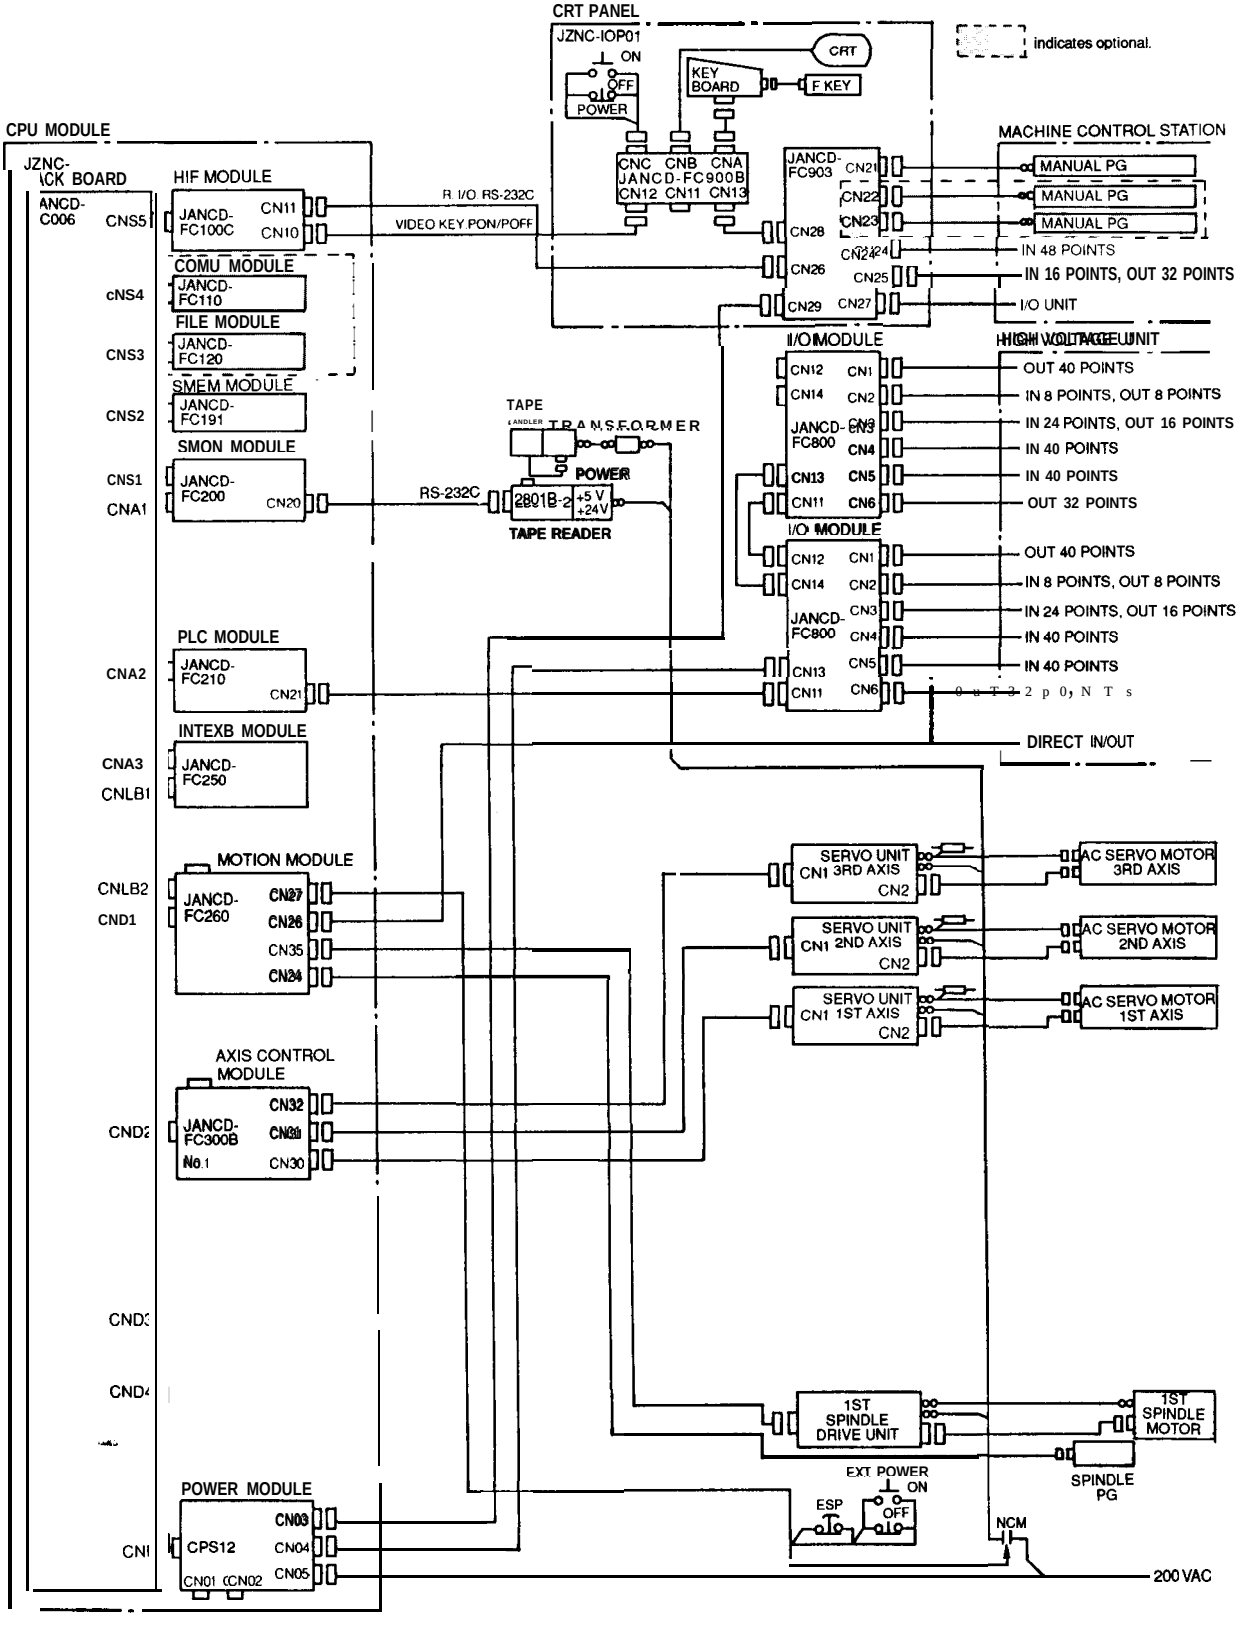


Fig. 1.9 Interconnection Diagram [Y AS NAC-i80MB for Machining Center]

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

1.2 COMPONENTS

(1) NC Major Components

Table 1.1 NC Major Components


Component Name	Model	Supply Code	Remarks
9" AMGC NC Rack 1	JZNC-IRK22		Feed control: 3 axes; spindle control: 1 axis; standard rack
9" AMGC NC Rack 2	JZNC-IRK04		Feed control: 6 axes; spindle control: 2 axes; rack for multiaxis
9" AMGC NC Rack3	JZNC-IRK31	—	Feed control: 3 axes; spindle control: 1 axis; standard rack
9" AMGC NC Rack 4	JZNC-IRK31	—	Feed control: 5 axes; spindle control: 2 axes; rack for multiaxis
14" ACGC NC Rack 1	JZNC-IRK76		Feed control: 3 axes; spindle control: 1 axis; rack for ACGC
14" ACGC NC Rack 2	JZNC-IRK58		Feed control: 6 axes; spindle control: 2 axes; rack for ACGC multiaxis
9" AMGC Control Panel	JZNC-IOPOIE	DUN20280	9" black-and-white CRT. lHPG panel with 1/0
14" ACGC Control Panel	JZNC-IOP11E	DUN2031O	14" color CRT, without panel 1/0
Remote I/O Module	JANCD-FC800	DTN8150	112-point input, 96-point source output
Panel I/O Unit	JZNC-IAU02-1 JZNC-IAU02-2 JZNC-IAU02-3	DUN20820 DUN20830 DUN20840	Separated-type panel 1/0 unit, 1HPG Separated-type panel 1/0 unit, 2HPG Separated-type panel 1/0 unit, 3HPG
Tape Reader Unit	JZNC-IAU51	—	200VAC input RS-232C tape reader unit

- JZNC-IRK22 Module — Go to (2).
- JZNC-IRK04 Module — Go to (3).
- JZNC-IRK31 Module — Go to (4).
- JZNC-IRK41 Module — Go to (5).
- JZNC-IRK76 Module — Go to (6).
- JZNC-IRK58 Module — Go to (7).
- JZNC-IOP01 E Module — Go to (8).
- JZNC-IOP11E Module — Go to (9).
- JZNC-IAU51 Module — Go to (10).
- Option Modules — Go to (11).
- YASNAC i80 digital AC servo drive unit — Go to (12).
- Spindle drive unit — Go to (13).
- Maintenance unit — Go to (14).

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

1.2 COMPONENTS (Cent'd)


•9“ AMGC Standard Rack (Model JZNC-IRK22)

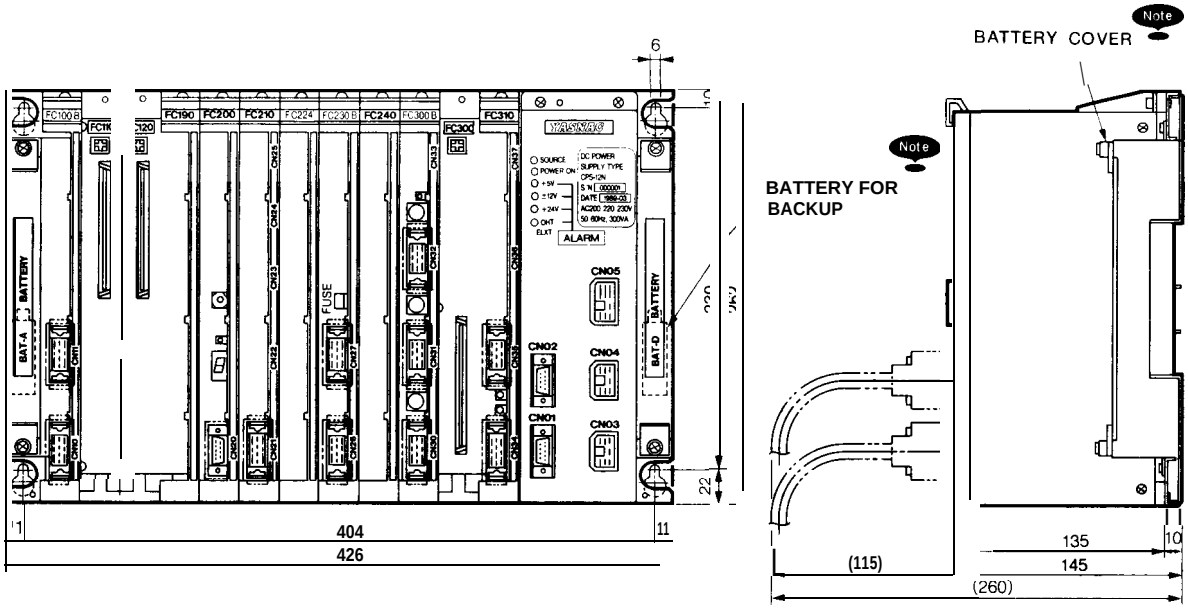

Approx. mass :7.5 kg

Note When replacing the battery for backup, remove the battery cover. (one at each side)

▪9“ AMGC Multiaxis (Model JZNC-IRK04)

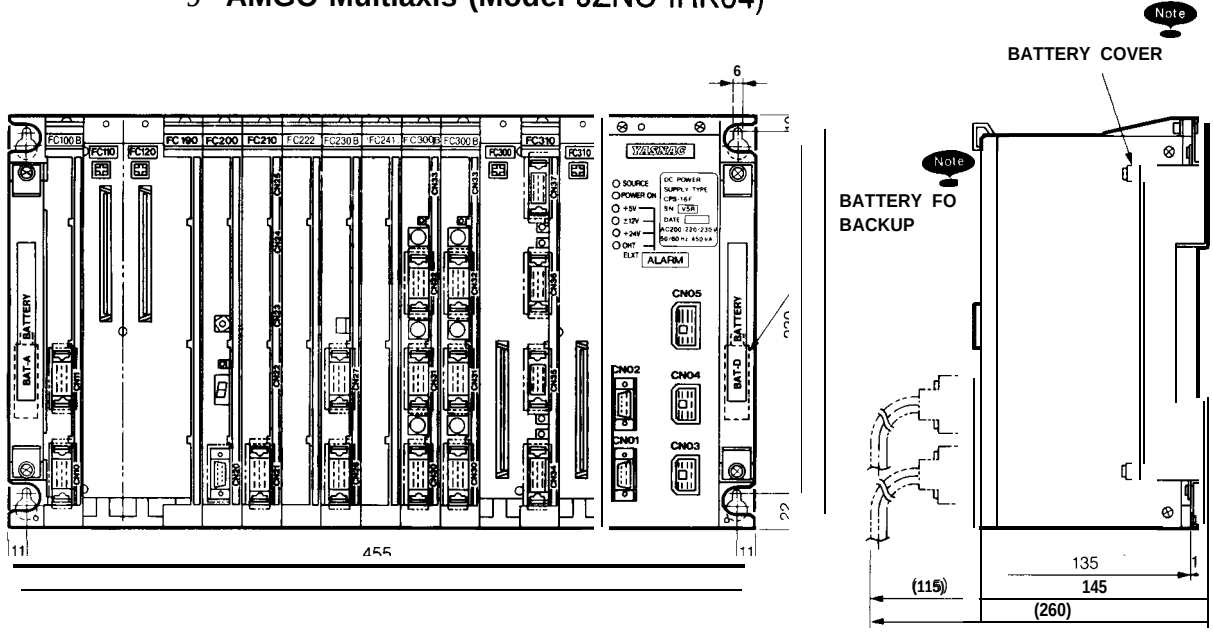


Approx. mass :8.0 kg

Note When replacing the battery for backup, remove the battery cover. (one at each side)

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


.9“ AMGC Standard Rack (Model JZNC-IRK31)

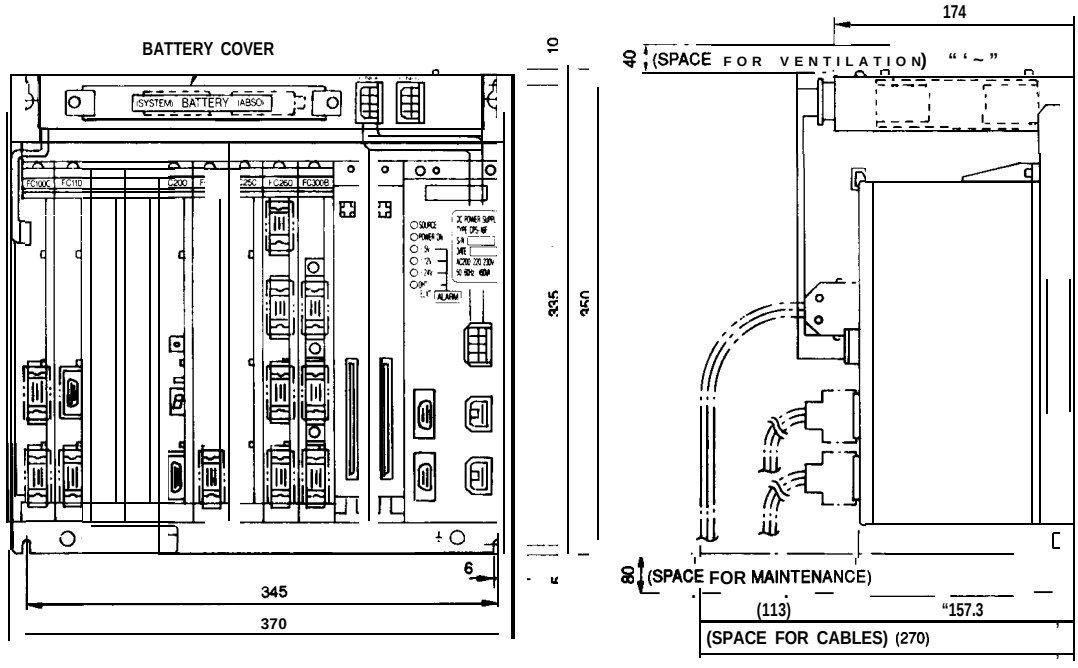

Approx. mass :12 kg

Note When replacing the battery for backup, remove the battery cover. (two on the rack)

.9“ AMGC Multiaxis (Model JZNC-IRK41)

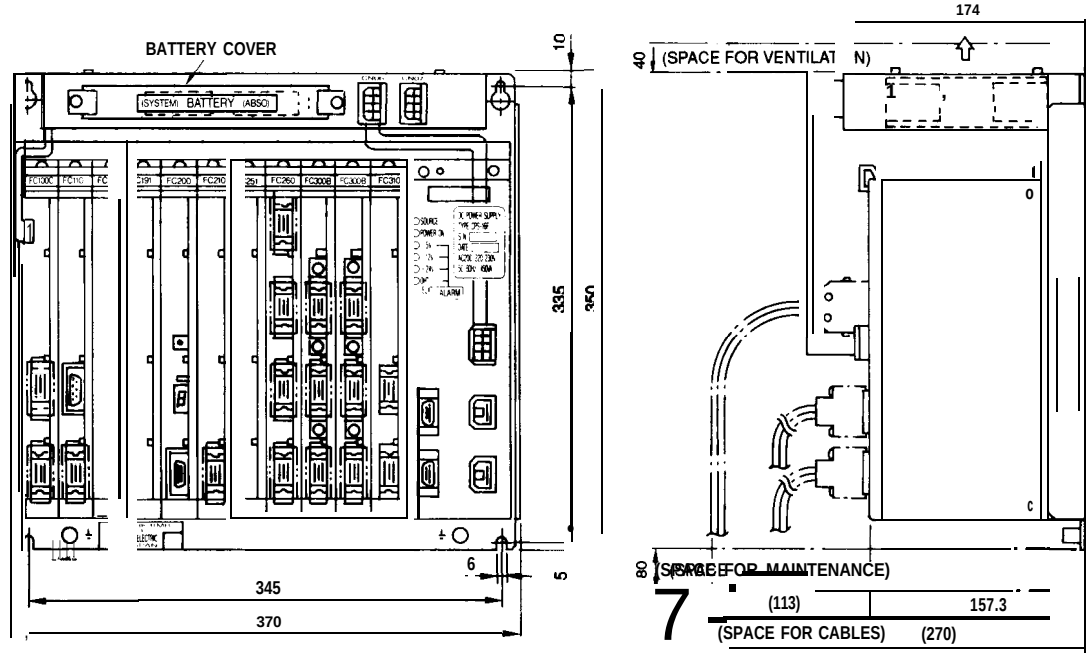


Approx.

Note When replacing the battery for backup, remove the battery cover. ‘ass:’2 ‘g (two on the rack)

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

1.2 COMPONENTS (Cent'd)


- **Rack for 14" ACGC (Model JZNC-IRK76)**

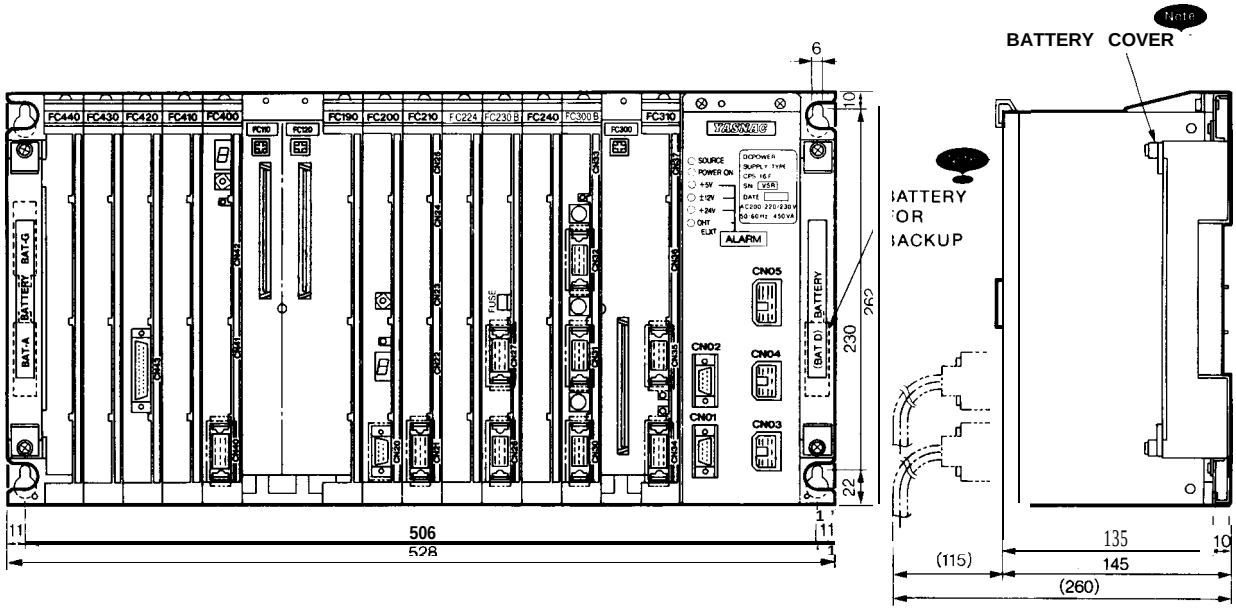

Approx. mass :9.0 kg

Note When replacing the battery for backup, remove the battery cover. (two at the left side and one at the right side)


- **.Rack for 14" ACGC (Model JZNC-IRK58)**

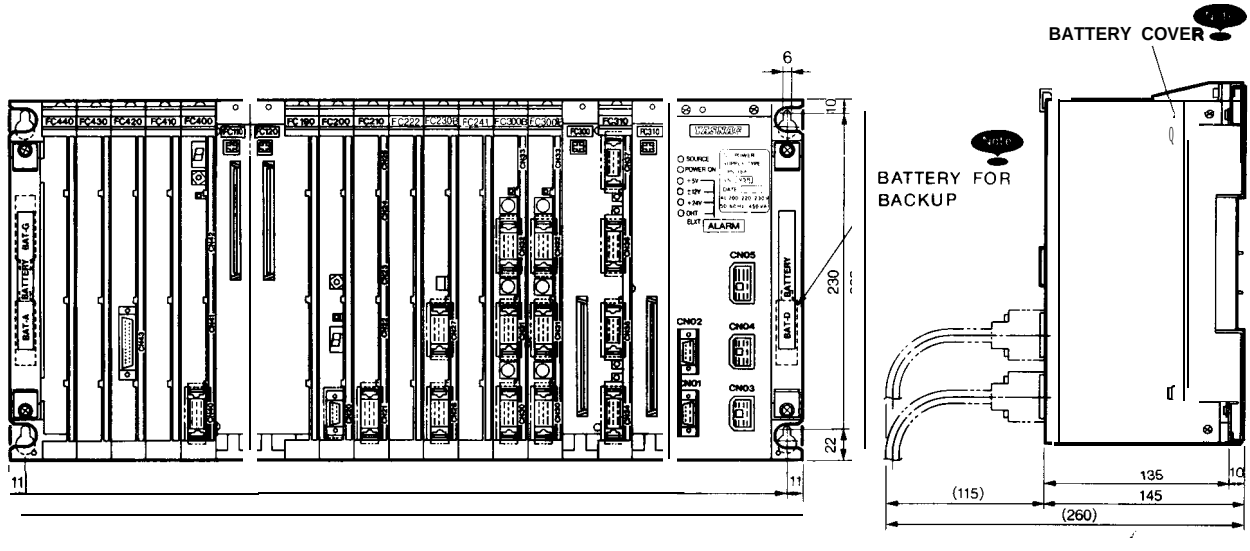


Approx. mass :10 kg

Note When replacing the battery for backup, remove the battery cover. (two at the left side and one at the right side)

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

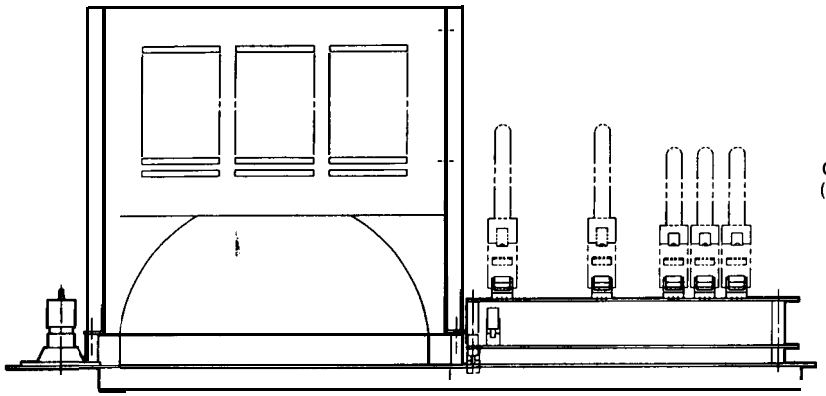


CN12
(FC900B

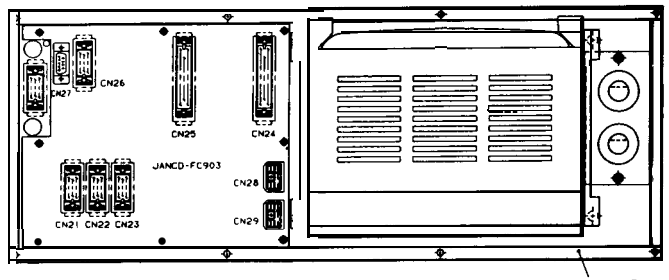


REAR VIEW

PACKING
(ENTIRE CIRCUMFERENCE)

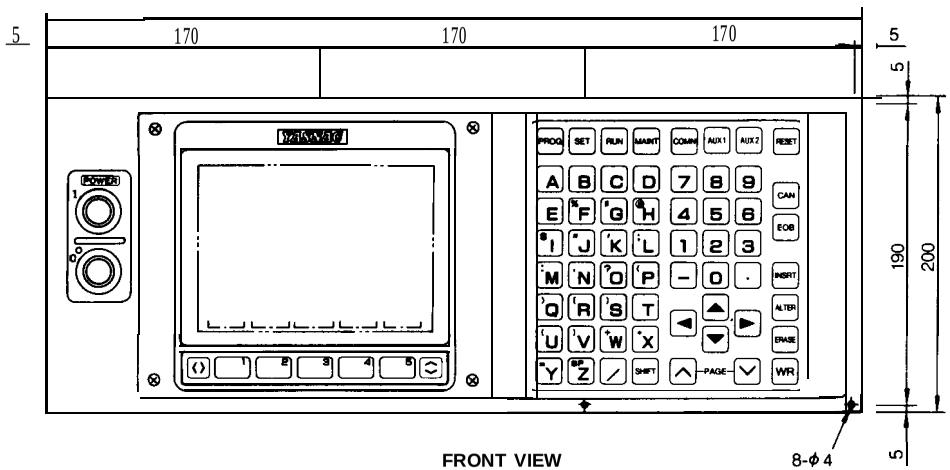


FRONT VIEW

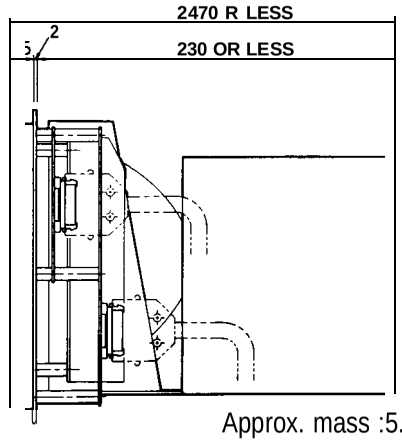

Approx. mass :5.5 kg

1. Panel surface finish:
   Japan Painting Institution Color number No. 1034
   Japan Etching Co., Ltd. Satin finish No. 7 equivalent leather-tone painting
2. When the thickness of the operation panel mounting material is 8 mm or more
   Notch the slash portion with a depth of 8 mm or more.

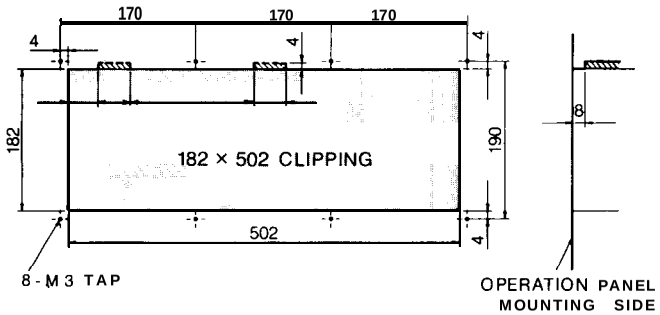

Operation Panel Mounting Hole Processing Diagram


Board Name	Connector Number	Board Connector	Cable Connector
JANCD FC900B	CN12	IR-20RFD2	MRP-20M01
JANCD FC903	CN21	MR-20RFD2	MRP-20M01
	CN22	MR-20RFD2	MRP-20M01
	CN23	MR-20RFD2	MRP-20M01
	CN24	MR-50RMD2	MRP-50F01
	CN25	MR-50RMD2	MRP-50F01
	CN26	MR-20RMD2	MRP-20F01
	CN27	17SE-13090-37	17JE-23090-02(D8B)
	CN28	172037-1	Already connected
	CN29	172037-1	172026-11

No cable connector is supplied. User must provide an equivalent connector.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


1.2 COMPONENTS (Cent'd)


.14" ACGC Operation Panel (Model JZNC-IOP11 E)

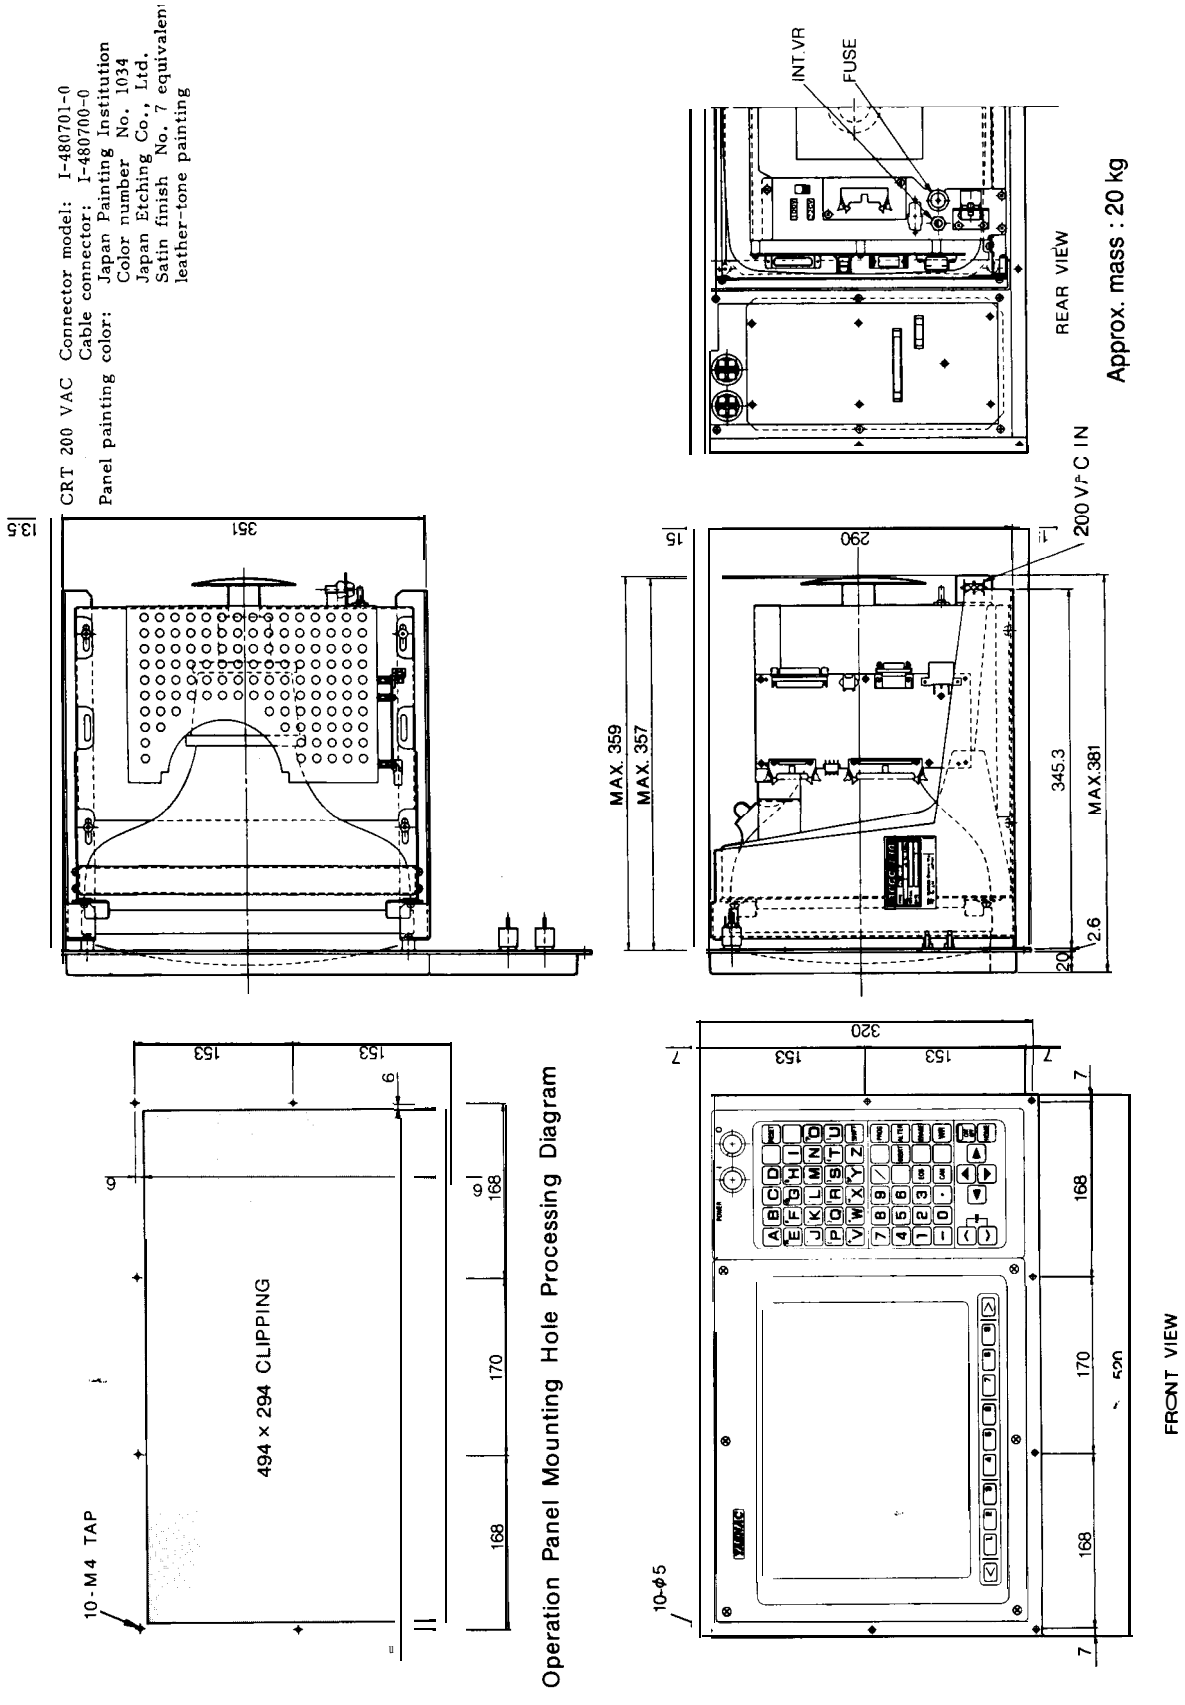

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

- Remote I/O Module (Model JAN CD-FC800)



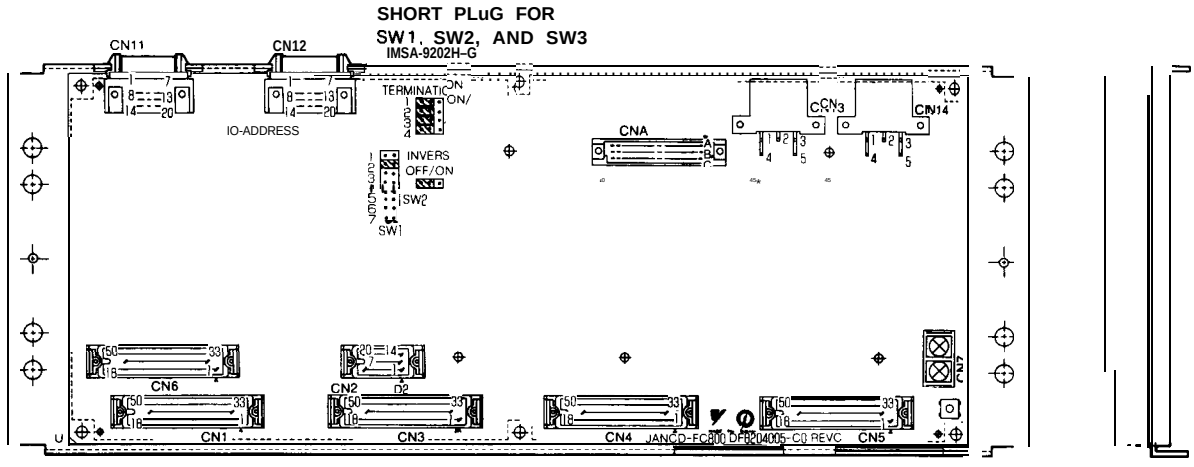


.Panel [/0 Unit


Model JZNC-IAU02-1 (HPG1 axis specifications. Without CN22 and CN23)

Model JZNC-IAU02-2 (HPG2 axis specifications. Without CN23)

Model JZNC-IAU02-3 (HPG3 axis specifications)

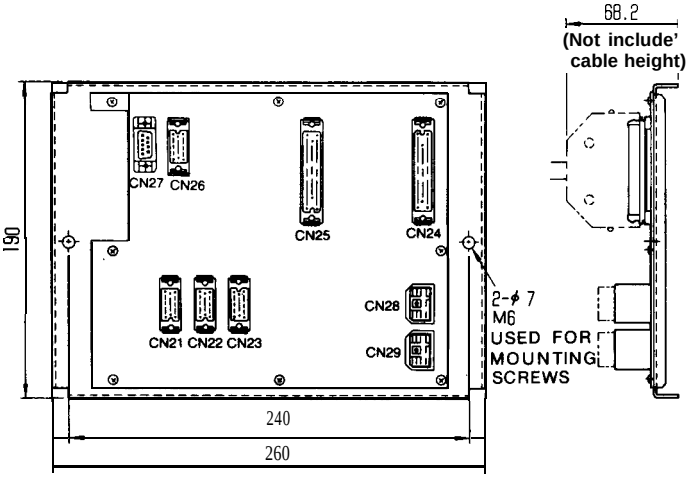

Mounting Board Processing Diagram

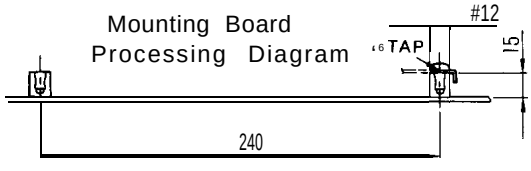


Connector Number	Board Connector	Cable Connector	Remarks
CN21	**MR-20RFD2**	MRP-20M01	Used for HANDLE PG
CN22	MR-20RFD2	MRP-20M01	Used for HANDLE PG
CN23	MR-20RFD2	MRP-20M01	Used for HANDLE PG
CN24	MR-50RMD2	MRP-50F01	Used for panel 1/0
CN25	MR-50RMD2	MRP-50F01	Used for panel 1/0
CN26	M R-20RMD2	M R P - 2 0 F 0 1	Used for remote 1/0
CN27	17 JE-13090-37	17JE-23090-02 (D8B)	Used for panel RS-232C
CN28	172037-1	172026-1	Used for power supply
CN29	172037-1	172026-1	Used for power supply

No cable connector is supplied, The machine manufacturer should provide an equivalent connector.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

.Tape Reader Unit (Power Built-in Type) (Model JZNC-IAU51)

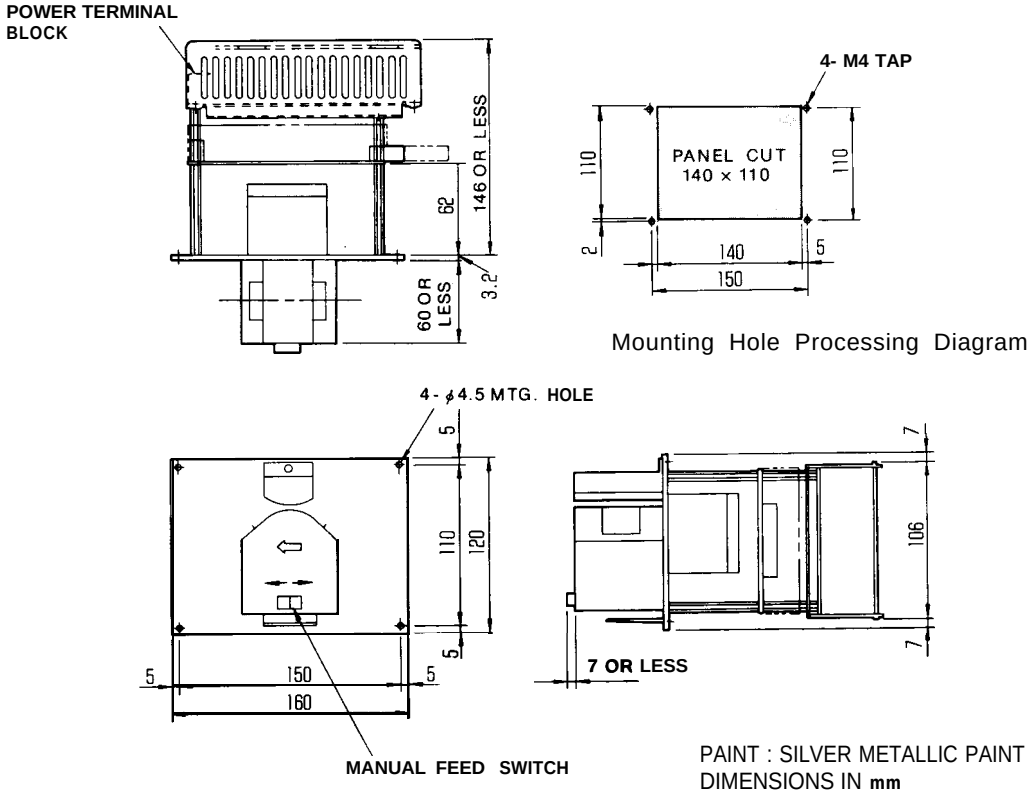

Mounting Hole Processing Diagram

PAINT : SILVER METALLIC PAINT
DIMENSIONS IN **mm**


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(2) JZNC-IRK22 **Module**

Table 1.2 JZNC-IRK22 Module

Model	Supply Code	Abbreviation	Remarks
CPS-12N	AVR0842	CPS	+5V 13A, +24V 1.5A, +12V 1.3A, −12V 0.3A
JAN CD-FC001	DTN701O	BB1	AMGC12 slot back board
JAN CD-F C1OOC	DTN9770	HIF	9“ monochrome CRT/keyboard interface
JAN CD- FC190-1	DTN7020	SMEM	FC200 memory RAM 384kB
JAN CD- FC200	DTN6470	SMON	System management
JAN CD-FC21O-1	DTN6850	PLC	Sequence controller, without RS-232C
JAN CD-FC224	DTN9450	INTEX3	NC program analysis
JAN CD-FC221	DTN801O	ROMS	ROM board (two boards for model FC224 are used)
JANCD-FC230B	DTN8490	MMON	Motion management
JAN CD-FC242	DTN1026O	MG	Data distribution
JANCD-FC300B-3	DTN8570	AX1	Feed control: 3 axes
JANCD-FC31O-1	DTN6720	AX2	Spindle control: 1 axis

.Model CPS-12N

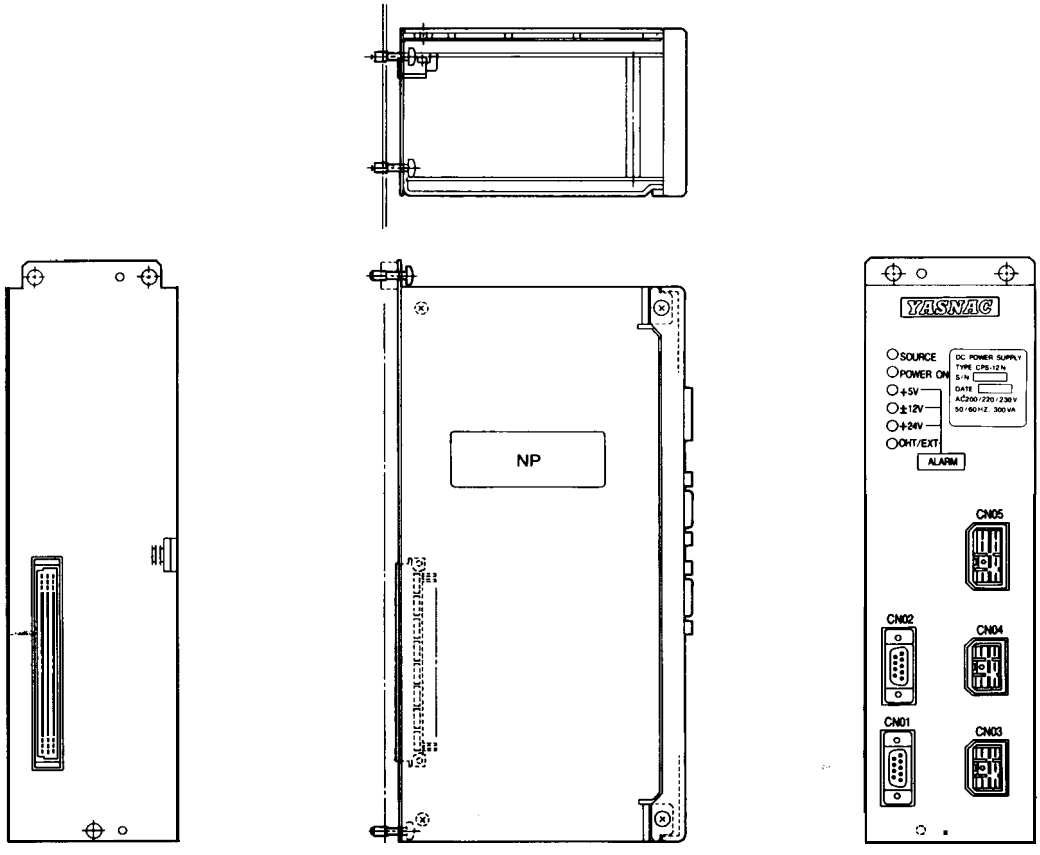


Approx. mass :1.52 kg

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


1.2 COMPONENTS (Cont'd)

- AMGC12 Slot Back B a d (Model JANCD-FC001

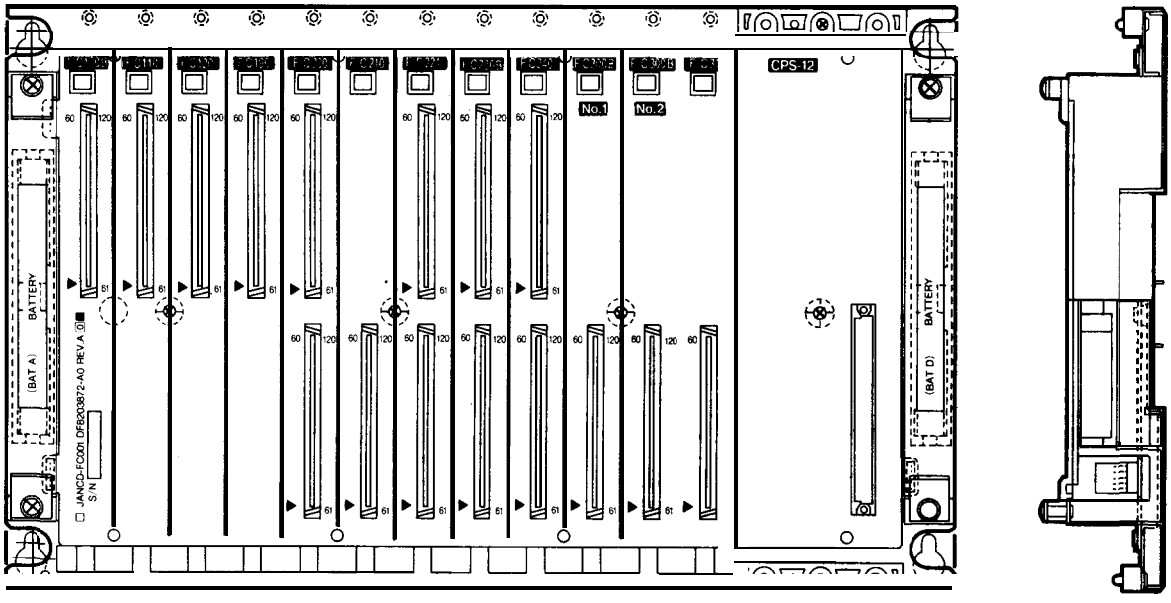

Approx. mass : 2.26 kg


- 9" Monochrome CRT/Keyboard Interface (Model JANCD-FC100C)

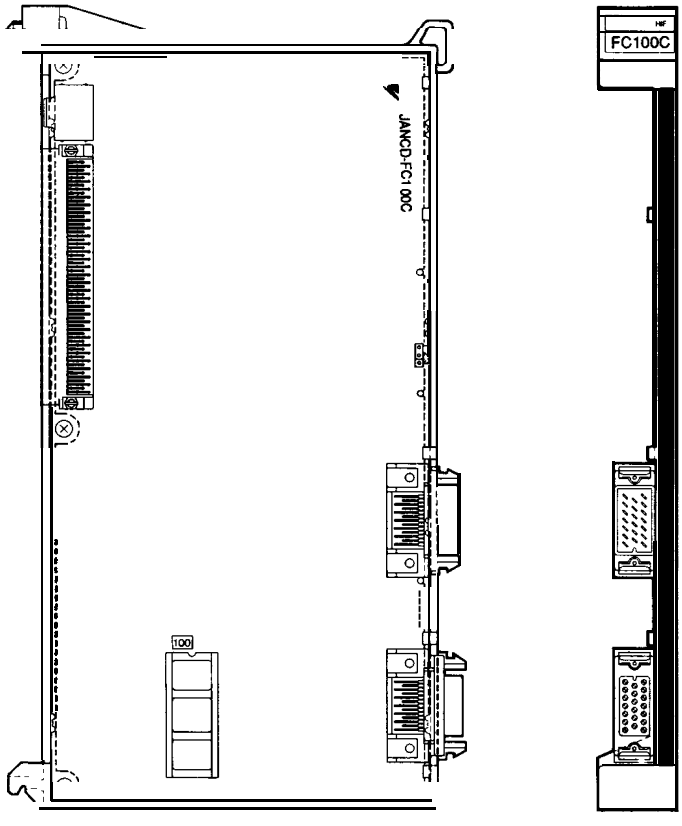

Approx. mass : 0.26 kg

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

.Model
JAN CD-FC190-1

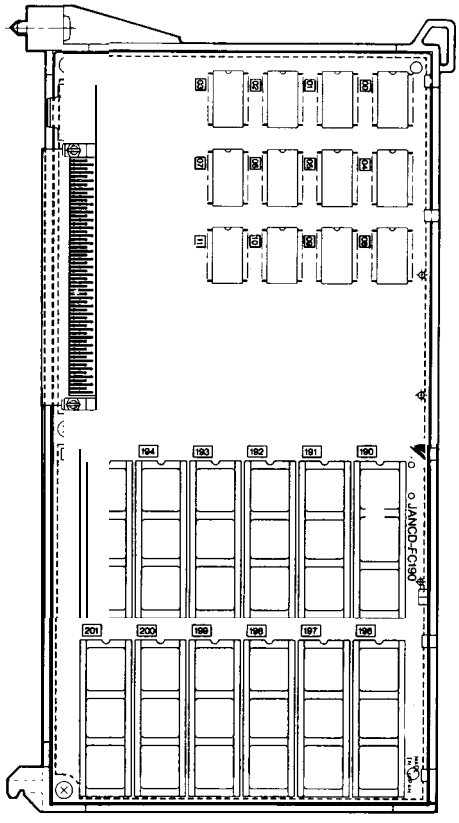





a

Approx. mass :0.32 kg

.Model
JAN CD-FC200

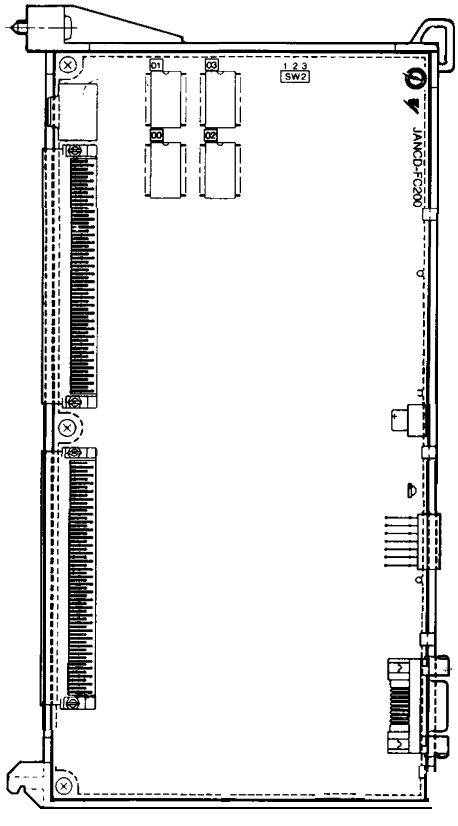




Approx. mass :0.3 kg


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

•Sequence Controller (Model JANCD-FC21O-1)

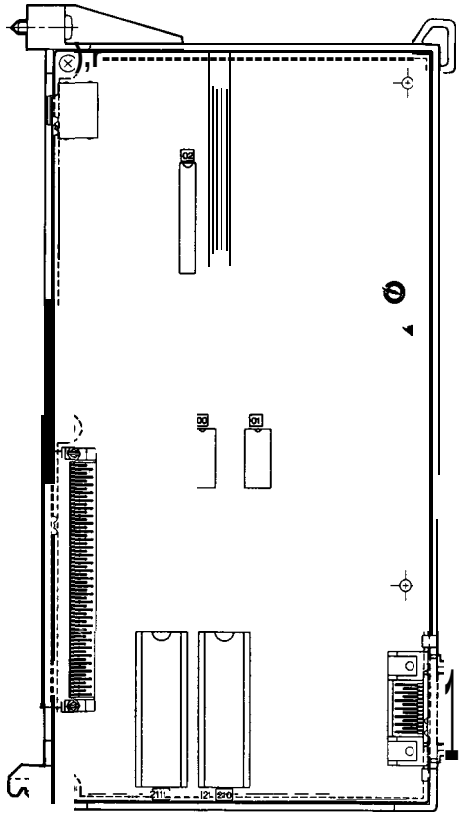

Approx. mass :0.28 kg


- **Model JAN CD-FC224 (NC program analysis)**

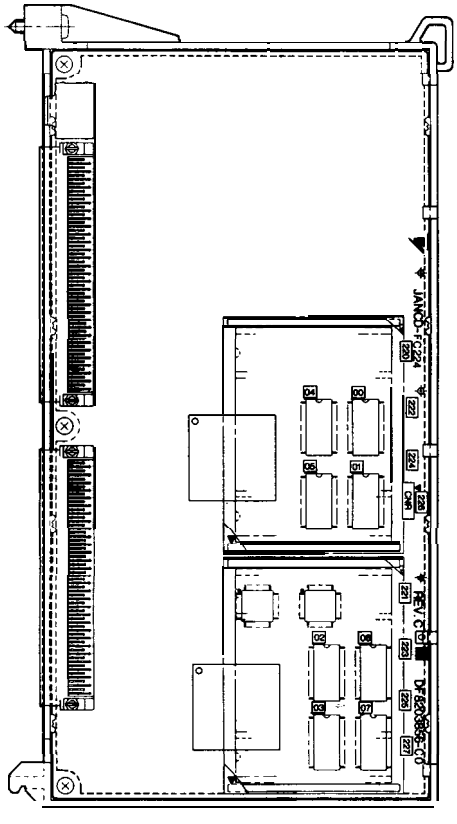

Approx. mass : 0.42kg


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

. ROM Board (Model JANCD-FC221)

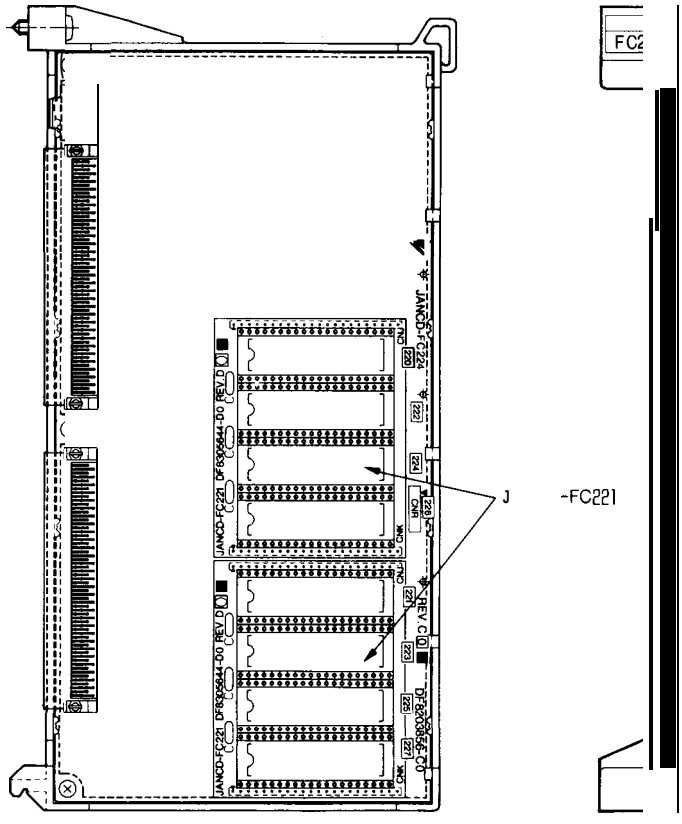

Approx. mass :0.07 kg


. Model JANCD-FC230B

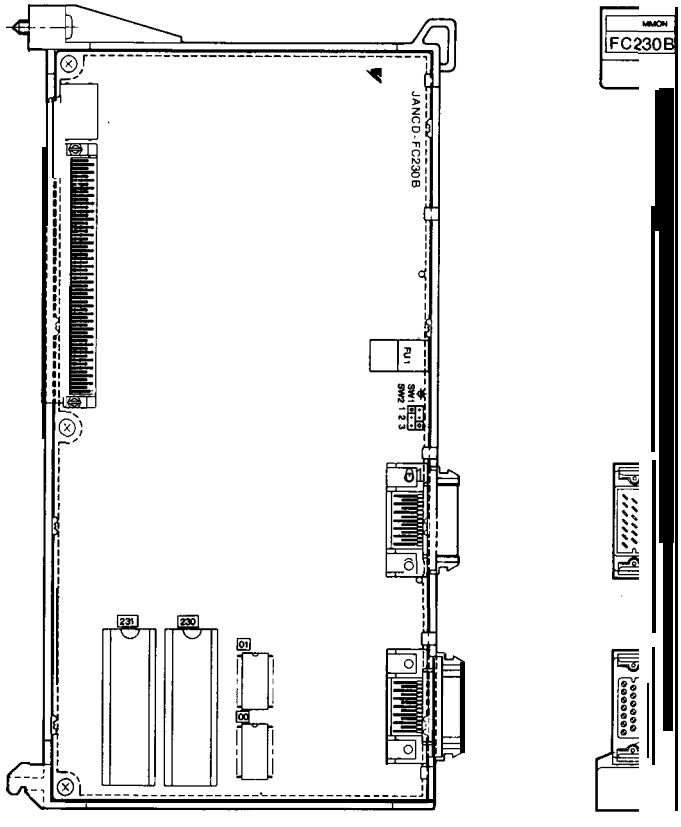

Approx. mass :0.28 kg


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

.Model JANCD-FC242

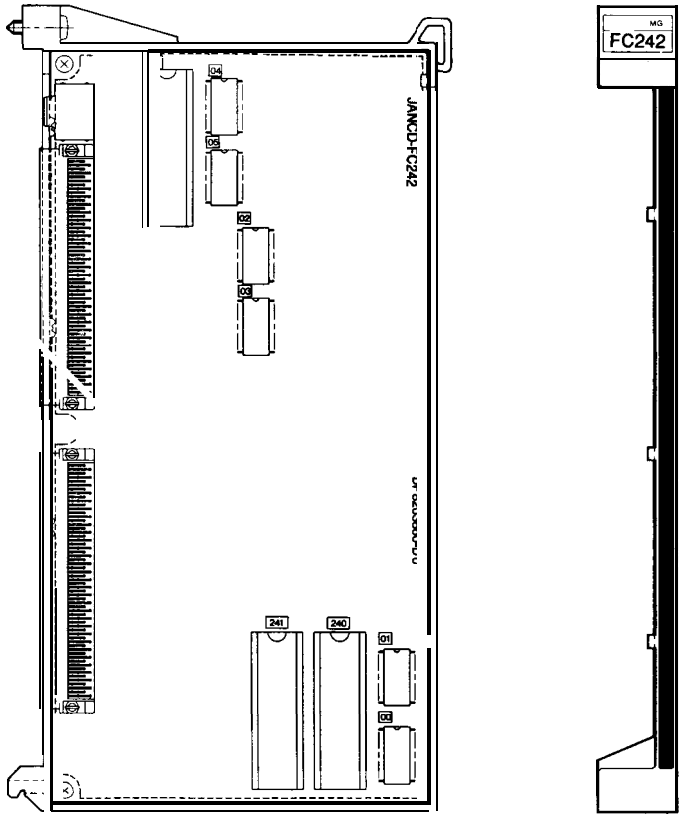

Approx. mass :0.26 kg

.Model JANCD-FC300B-3 (Feed control: 3 axes)

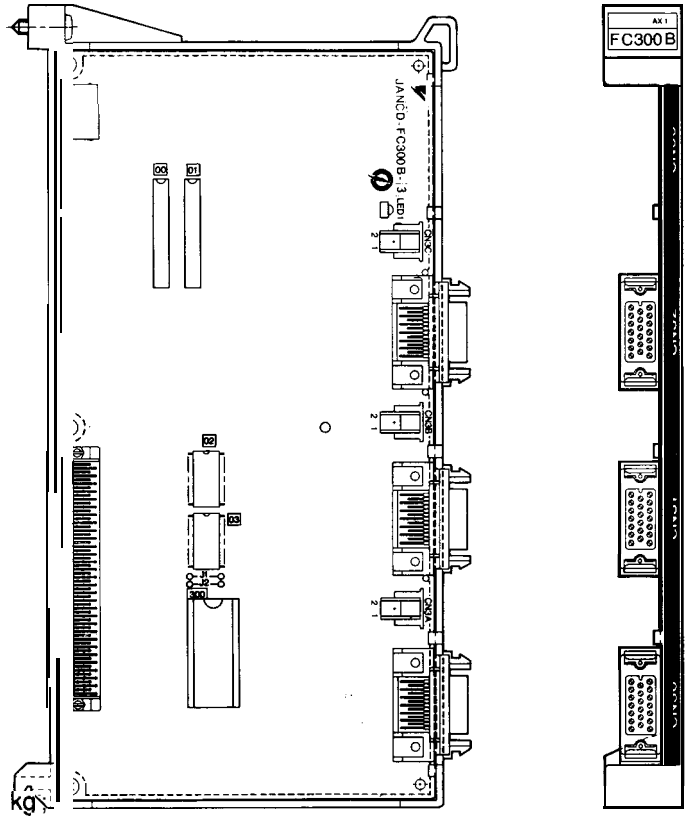


Approx. mass :0.34 kg

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

.Model JAN CD- FC31O-1 (Spindle control: 1 axis)

a

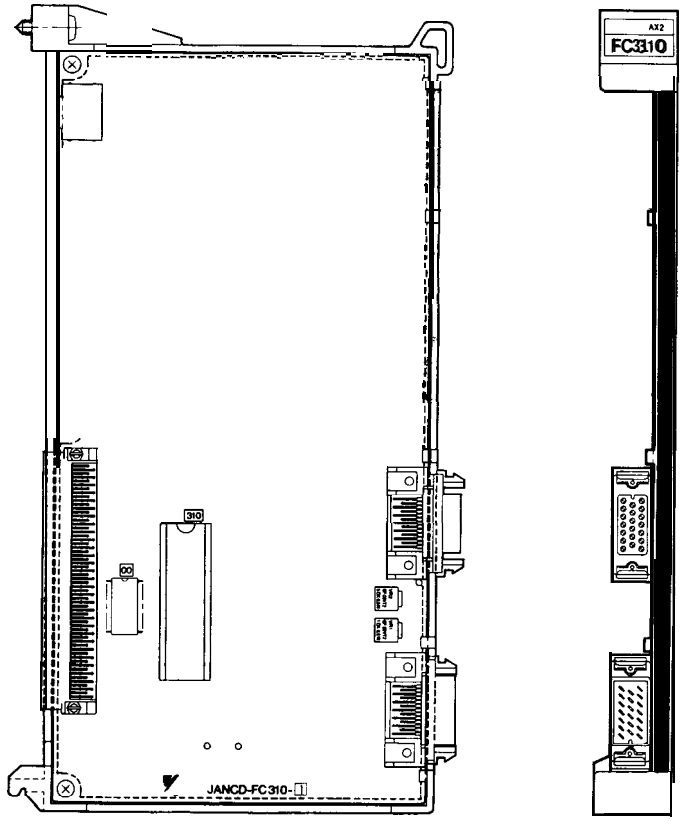

Approx. mass :0.24 kg


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


(3) JZNC-IRK04 **Module**


Table 1.3 JZNC-IRK04 Module


Model	Supply Code	Abbreviation	Remarks
CPS-16F	AVR843	CPS	+5V 21A, +24V 1.5A, +12V 1.3A, −12V 0.3A
JAN CD-FC002	DTN8070	BB2	AMGC14 slot back board
JAN CD-F C1OOC	DTN9770	HIF	9" monochrome CRT/keyboard interface
JAN CD-F C190-1	DTN7020	SMEM	FC200 memory RAM 384kB
JAN CD-FC200	DTN6470	SMON	System management
JAN CD-F C21O-1	DTN6850	PLC	Sequence controller, without RS-232C
JAN CD-FC222	DTN8110	INTEX2	NC program analysis
JAN CD-FC221	DTN801O	ROMS	ROM board (two boards for model FC222 are used)
JAN CD-F C230B	DTN8490	MMON	Motion management
JAN CD-FC241	DTN8520	MG2	Data distribution
JANCD-FC300B-3	I) TN8570	A X 1	Feed control: 3 axes
JANCD-FC31O-2	DTN6730	AX2	Spindle control: 2 axes

- **Model CPS-16F**

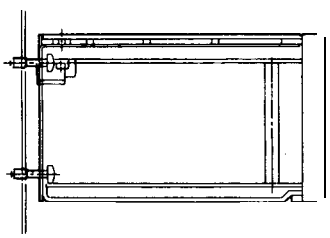

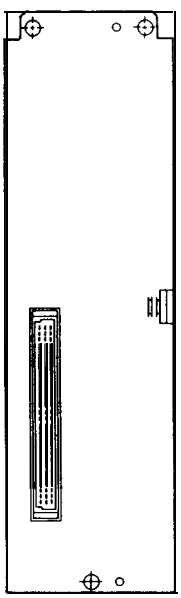


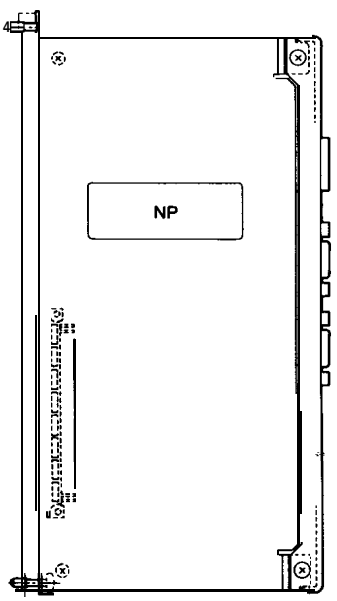

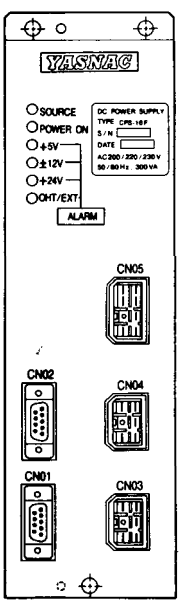

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

.AMGC14 Slot Back Board (Model JAN CD-FC002)

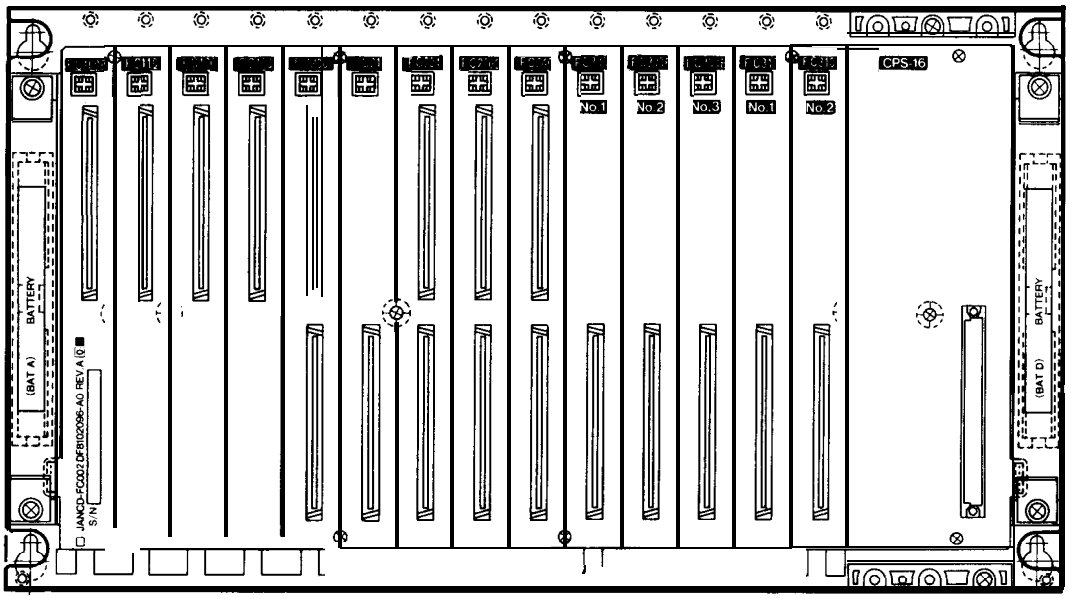

Approx. mass :2.26 kg


•JANCD-FC1OOC	•JANCD-FC21O-1	•JANCD-FC230B
• JANCD-FC190-1	• JANCD-FC221	• JANCD-FC300B-3
• JANCD-FC200		


For the models description shown above, see Table 1.2, and for the model JANCD-FC222, see Table 1.11.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

1.2 COMPONENTS (Cent'd)


- **Model JAN CD-FC31O-2 (Spindle control: 2 axes)**

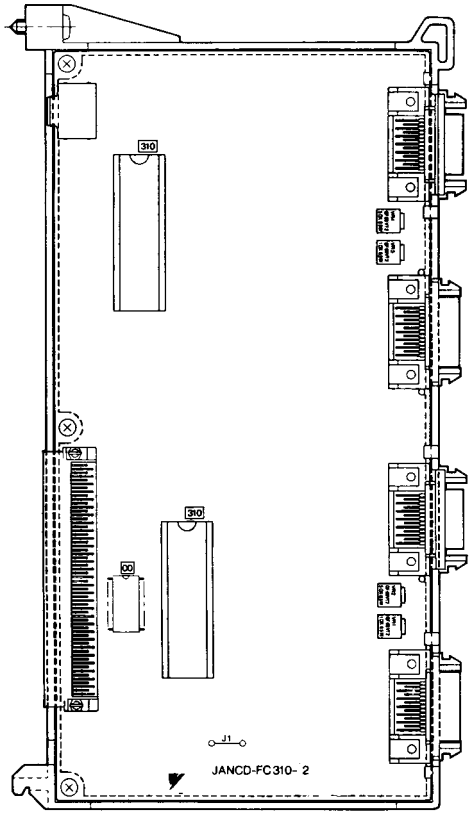




Approx. mass :0.2 kg

.Model JAN CD-FC241

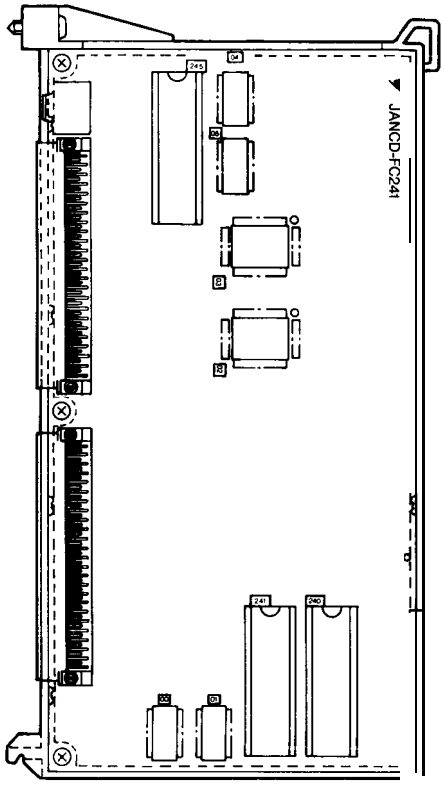



Approx. mass: 0.28 kg


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(4) JZNC-IRK31 Module

Table 1.4 JZNC-IRK31 Module

Model	Supply Code	Abbreviation	Remarks
CPS-12N	AVR0842	CPS	+5V 13A, +24V 1.5A, +12V 1.3A, −12V 0.3A
JAN CD- FC006	DTN1023O	BB3	AMGC11 slot back board
JAN CD-F C1OOC	DTN9770	HIF	9“ monochrome CRT/keyboard interface
JAN CD- FC191-1	DTN1OO3O	SMEM2	FC200 memory RAM 384kB
JAN CD- FC200	DTN6470	SMON	System management
JAN CD- FC21O-1	DTN6850	PLC	System controller, without RS-232C
JAN CD- FC250	DTN1018O	INTEXB	NC program analysis
JAN CD-F C260-1	DTN102OO	MOTION	Motion management, data distribution, spindle control: 1 axis
JAN CD-F C300B-3	DTN8570	AX1	Feed control: 3 axes

.Model JANCD-FC006

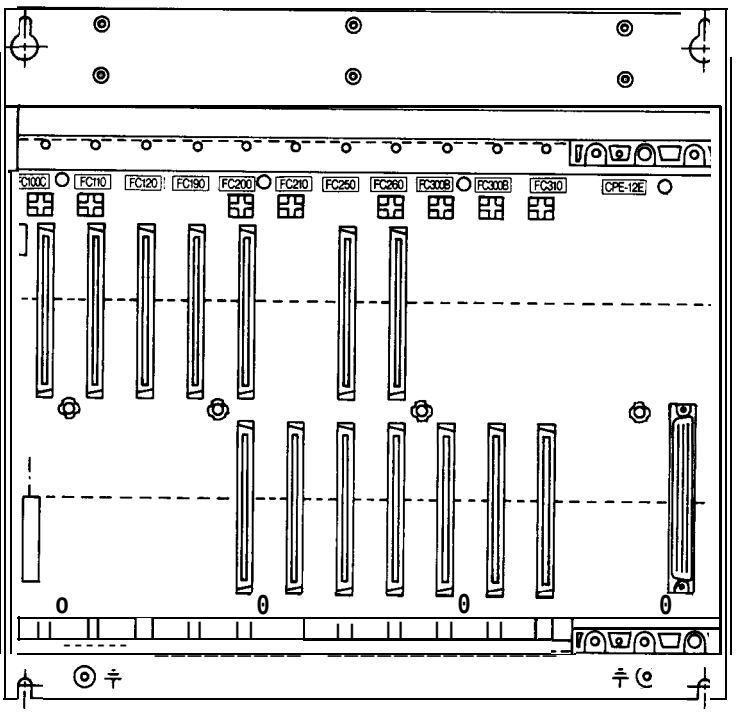


Approx. mass :4.93 kg

.JANCD-FC1OOC “ JANCD-FC200 “ JANCD-FC21O-1
“ JANCD-FC300B-3

For the models description shown above, see Table 1.2.


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

▪ **Model** JANCD-FC191-1

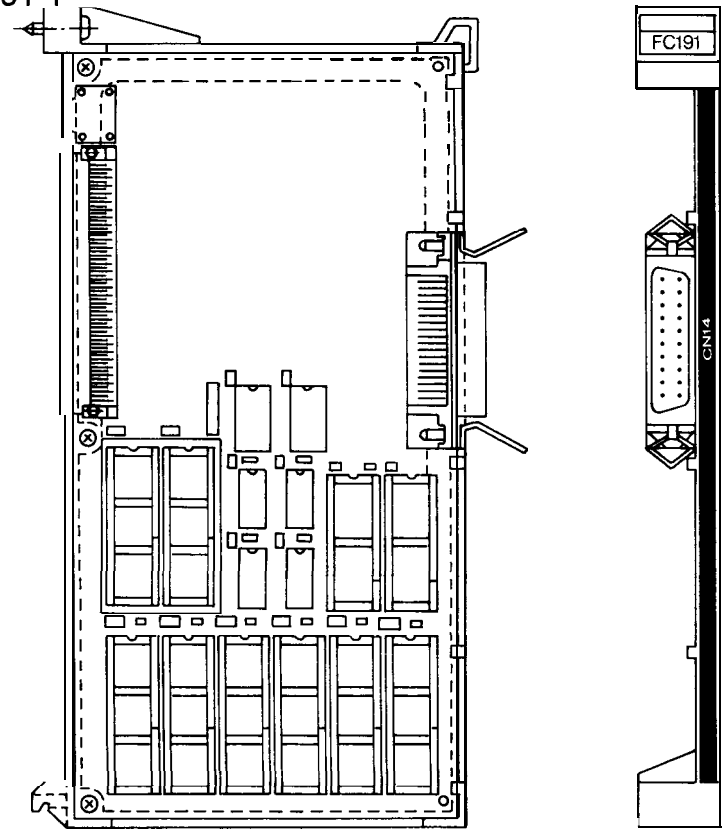

Approx. mass :0.25 kg


▪ **Model JANCD-FC250**

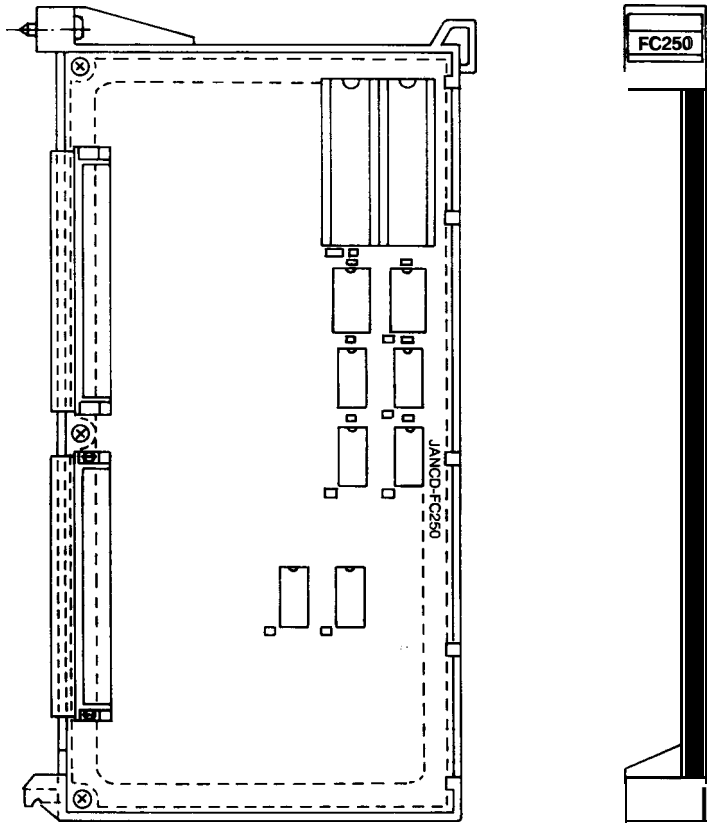

Approx. mass :0.27 kg

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

- **Model JANCD-FC260-I**

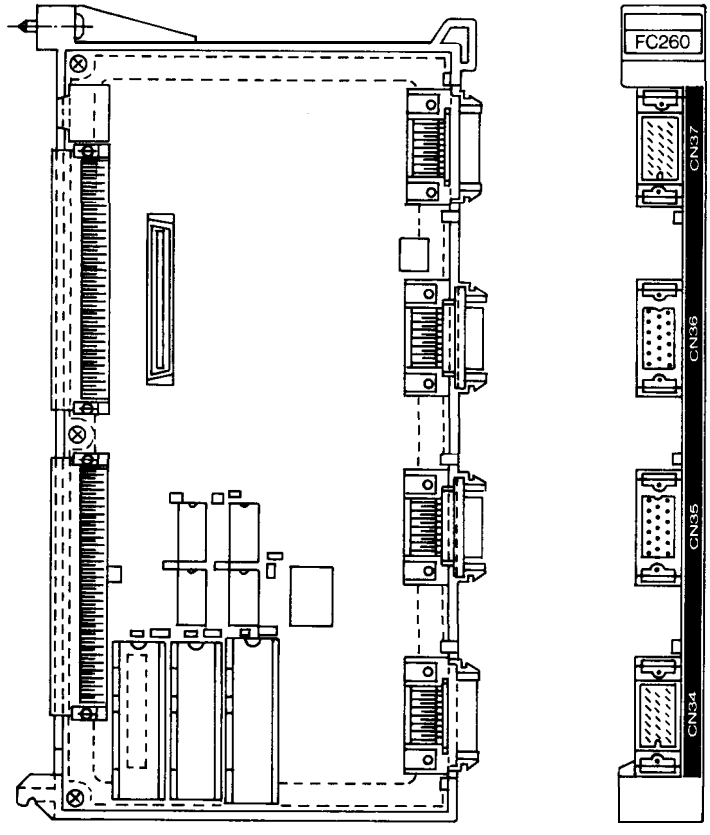

Approx. mass :0.34 kg

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(5) JZNC-IRK41 **Module**

Table 1.5 JZNC-IRK41 Module

Type	Supply Code	Abbreviation	Remarks
CPS-12N	AVR0842	CPS	+5V 13A, +24V 1.5A, +12V 1.3A, –12V 0.3A
JAN CD- FC006	DTN1023O	BB3	AMGC11 slot back board
JAN CD- FC1OOC	DTN9770	HIF	9" monochrome CRT/keyboard interface
JAN CD-F C191-1	DTN1OO3O	SMEM2	FC200 memory RAM384kB
JAN CD- FC200	DTN6470	SMON	System management
JAN CD-F C21O-1	DTN6850	PLC	Sequence controller, without RS-232C
JAN CD- FC250	DTN1018O	INTEXB	NC program analysis
JAN CD-F C260-1	DTN102OO	MOTION	Motion management, data distribution, spindle control: 1 axis
JAN CD- FC300B-3	DTN8570	AX1	Feed control: 3 axes
JAN CD-F C31O-I	DTN6730	AX2	Spindle control: 3 axes

- JANCD-FC1OOC
- " JANCD-FC200
- " JANCD-FC21O-1
- " JANCD-FC300B-3
- " JANCD-FC31O-1


For the models description shown above, see Table 1.2.

- " JANCD-FCO06
- " JANCD-FC191-1
- " JANCD-FC250
- JANCD-FC260

For the models description shown above, see Table 1.4.


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

▪Model JANCD-FC251

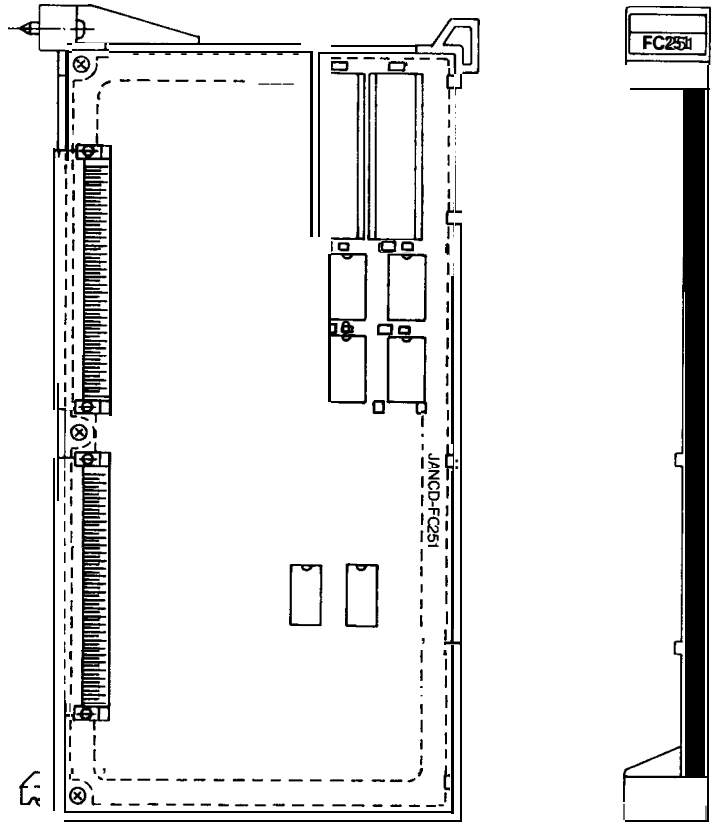

Approx. mass :0.27 kg

▪ Model JANCD-FC265

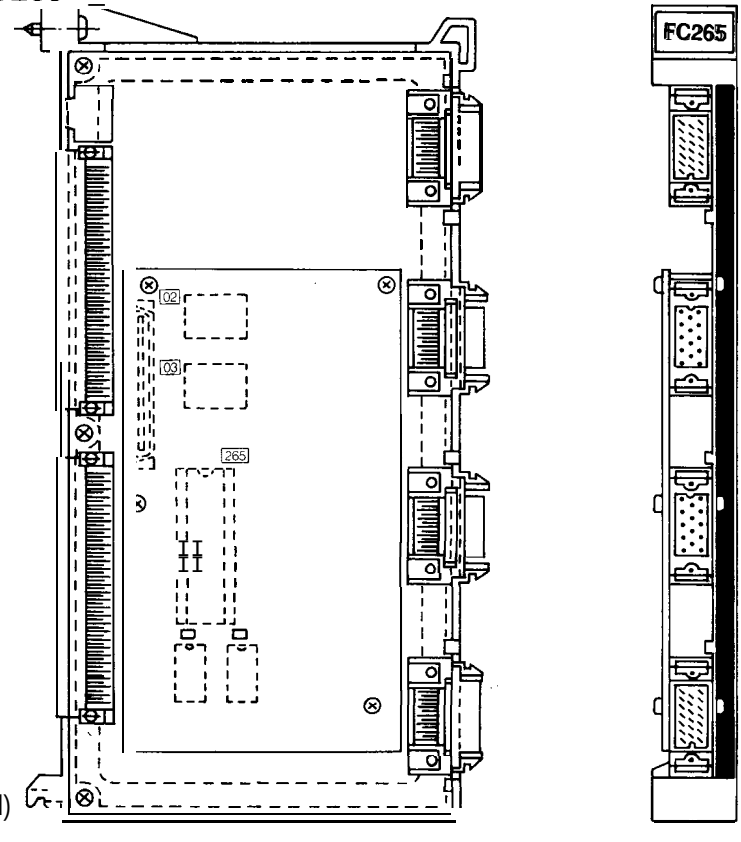

This figure shows model JANCD-FC265 attached to model JANCD-FC260.

Approx. mass :0.11 kg
(only JANCD-FC265 board)

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

1.2 COMPONENTS (Cent'd)


(6) JZNC-IRK76 **Module**

Table 1.6 JZNC-IRK76 Module

Model	Supply Code	Abbreviation	Remarks
CPS-16F	AVR843	CPS	+5V 21A, +24V 1.5A, +12V 1.3A, –12V 0.3A
JAN CD-FC050	DTN8030	ABB1	ACGC16 slot back board
JAN CD-F C190-1	DTN7020	SMEM	FC200 memory RAM 384kB
JAN CD-FC200	DTN6470	SMON	System management
JAN CD- FC21O-1	DTN6850	PLC	Sequence controller, without RS-232C
JAN CD-FC224	DTN9450	INTEX3	NC program analysis
JAN CD- FC221	DTN801O	ROMS	ROM board (two boards for model FC224 are used)
JAN CD-F C230B	DTN8490	MMON	Motion management
JAN CD-FC240	DTN6530	MG	Data distribution
JAN CD-F C300B-3	DTN8570	AX1	Feed control: 3 axes
JAN CD- FC31O-1	DTN6720	AX2	Spindle control: 1 axis
JANCD-FC400	DTN7090	NIF	ACGC-NC interface module
JANCD-FC41O	DTN7080	ACP	ACGC main module
JAN CD-FC221	DTN801O	ROMS	ROM board (two pieces for FC41O are used)
JANCD-FC420	DTN8040	GIF	ACGC graphic control module
JAN CD-FC430	DTN7060	APM1	ACGC application memory module
JAN CD-FC440	DTN7070	APM2	ACGC application memory module

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

• ACGC16 S ot Back Board (Mode JANCD-FC050)

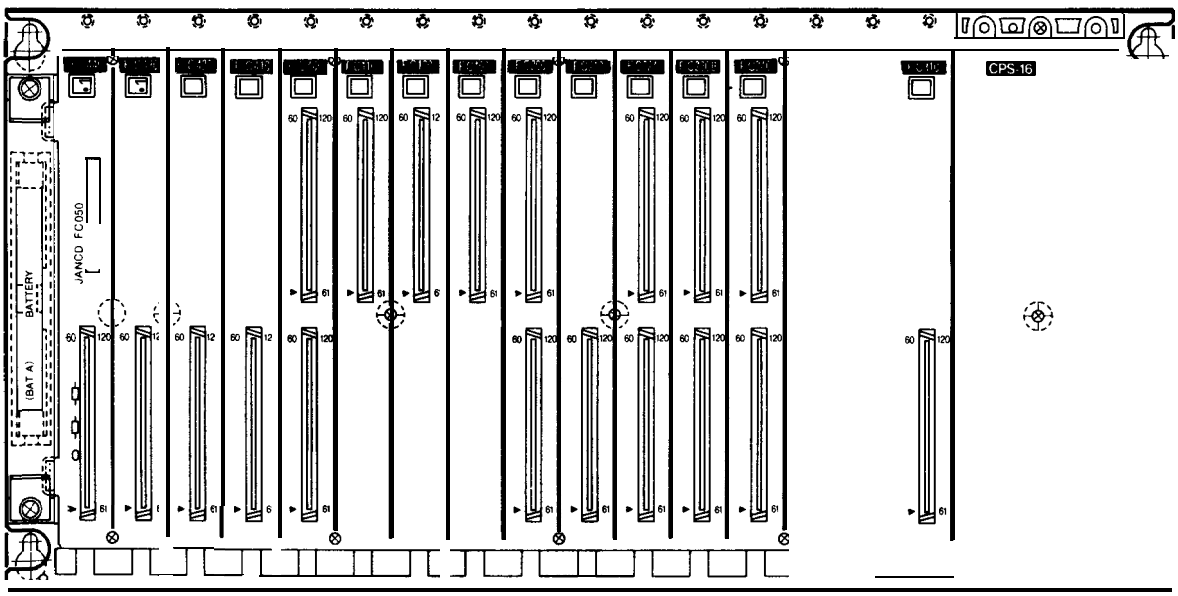


• JANCD-FC190-1	• JANCD-FC224	• JANCD-FC240
• JANCD-FC200	• JANCD-FC221	• JANCD-FC300B-3
• JANCD-FC210-1	• JANCD-FC230B	• JANCD-FC310-1

For the models description shown above, see Table 1.2.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


1.2 COMPONENTS (Cent'd)

- **ACGC-NC Interface module (Model JANCD-FC400)**

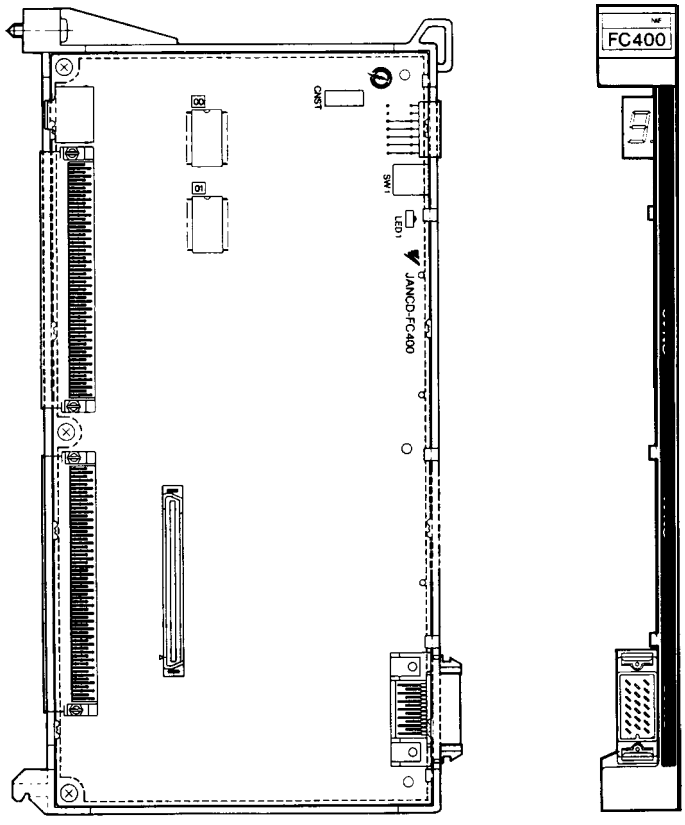

Approx. mass :0.28 kg


- **ACGC Main Module (Model JANCD-FC41O)**

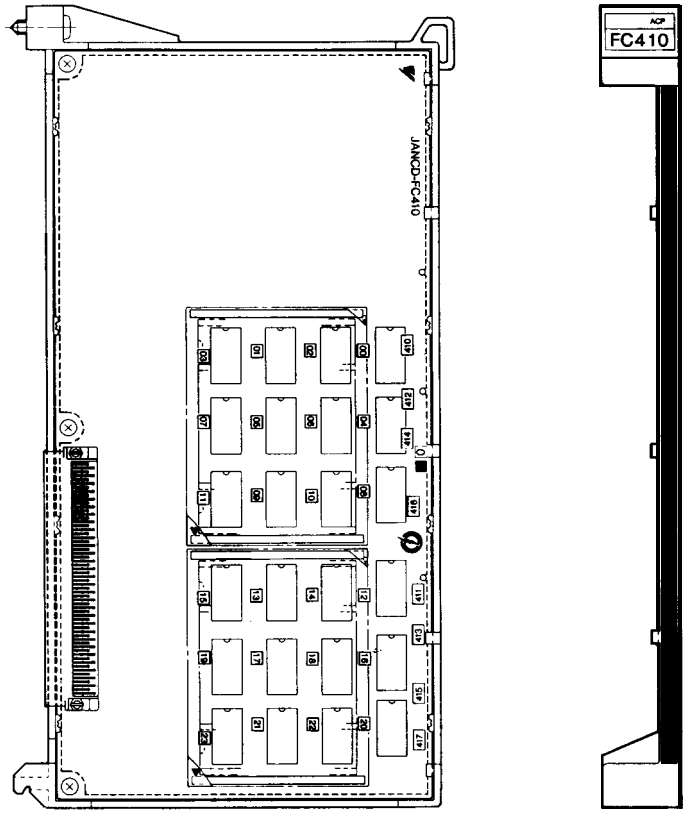

Approx. mass :0.46 kg


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

.ROM Board (Model JANCD-FC221)

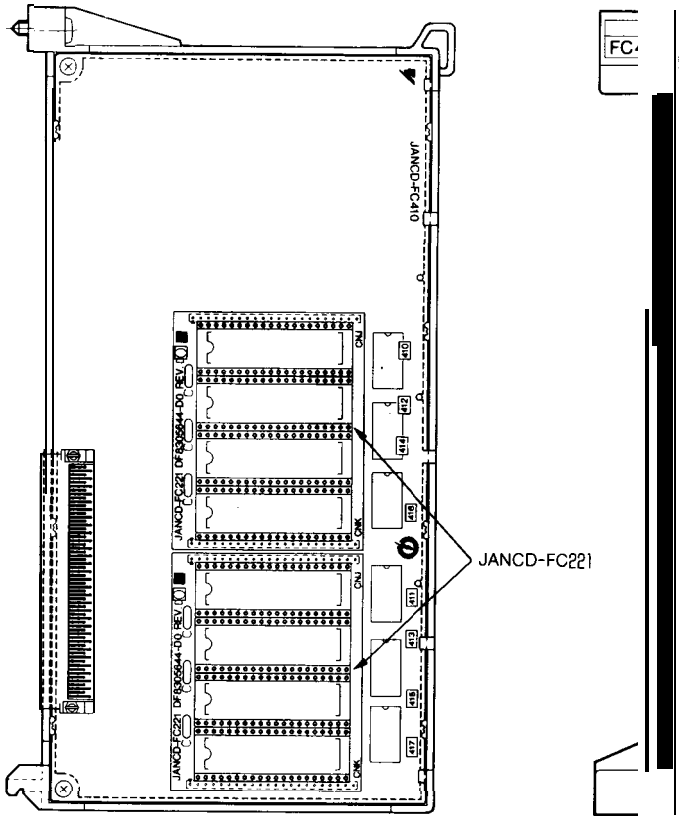

Approx. mass :0.07 kg


.ACGC Graphic Control Module (Model JANCD-FC420)

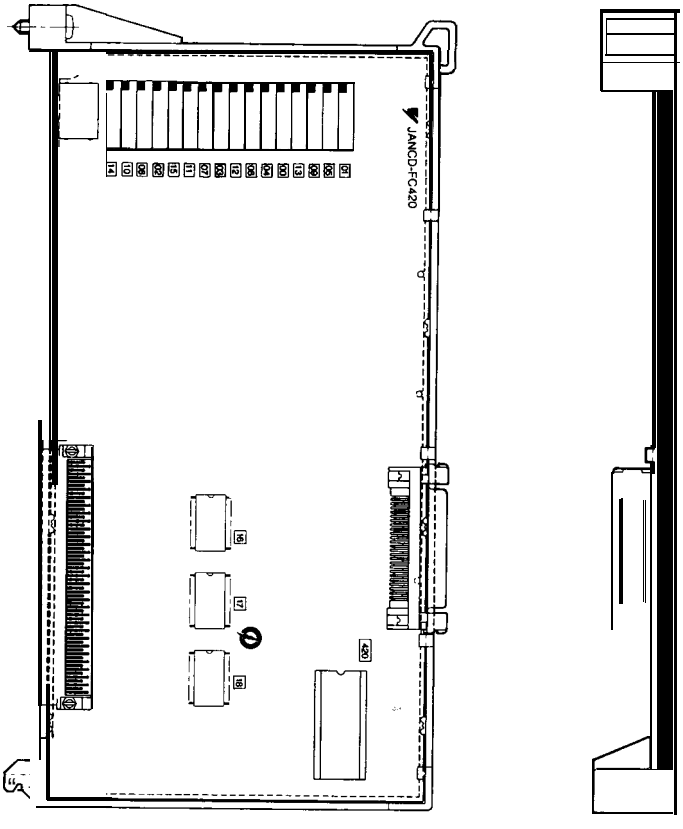


Approx. mass :0.28 kg

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


.ACGC Application Memory Module (Model JANCD-FC430)

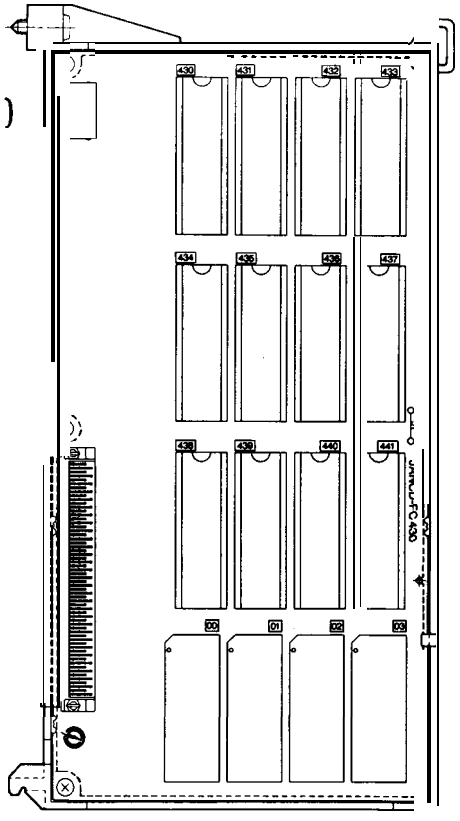




Approx. mass :0.28 kg

.A C G C Application Memory Module (Model JANCD-FC440)

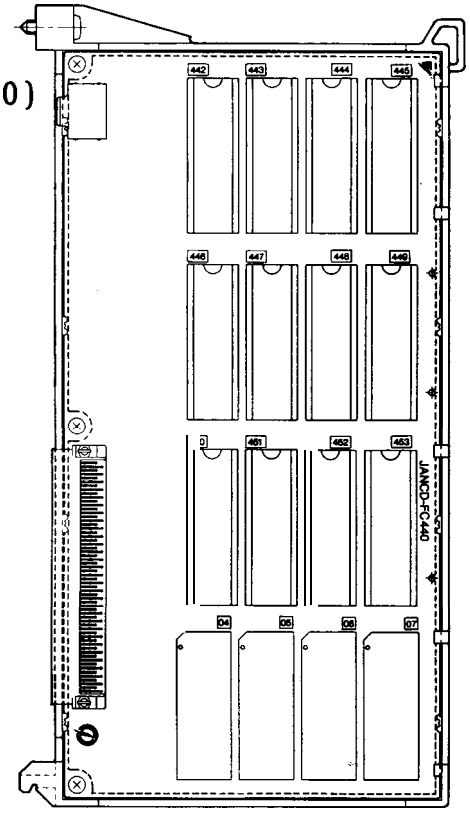



Approx. mass :0.28 kg

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


(7) JZNC-IRK58 Module

Table 1.7 JZNC-IRK58 Module

Model	Supply Code	Abbreviation	Remarks
CPS-16F	AVR843	CPS	+5V 21A, +24V 1.5A, +12V 1.3A, -12V 0.3A
JANCD-FC052	DTN8030	ABB2	ACGC18 slot back board
JAN CD- FC190-1	DTN7020	SMEM	FC200 memory RAM 384kB
JAN CD-FC200	DTN6470	SMON	System management
JANCD-FC21O-1	DTN6850	PLC	Sequence controller, without RS-232C
JAN CD-FC222	DTN8110	INTEX2	NC program analysis
JAN CD- FC221	DTN801O	ROMS	ROM board (two boards for model FC222 are used)
JAN CD- FC230B	DTN8490	MMON	Motion management
JAN CD-FC241	DTN8520	MG	Data distribution
JANCD-FC300B-3	D TN8570	A X 1	Feed control: 3 axes
JANCD-FC31O-2	DTN6730	AX2	Spindle control: 2 axes
JANCD-FC400	DTN7090	NIF	ACGC-NC interface module
JAN CD-FC41O	DTN7080	ACP	ACGC main module
JANCD-FC221	DTN8010	ROMS	ROM board (two pieces for FC410 are used)
JANCD-FC420	DTN8040	GIF	ACGC graphic control module
JAN CD-FC430	DTN7060	APM1	ACGC application memory module
JAN CD- FC440	DTN7070	APM2	ACGC application memory module

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

.Model JAN CD-FC052

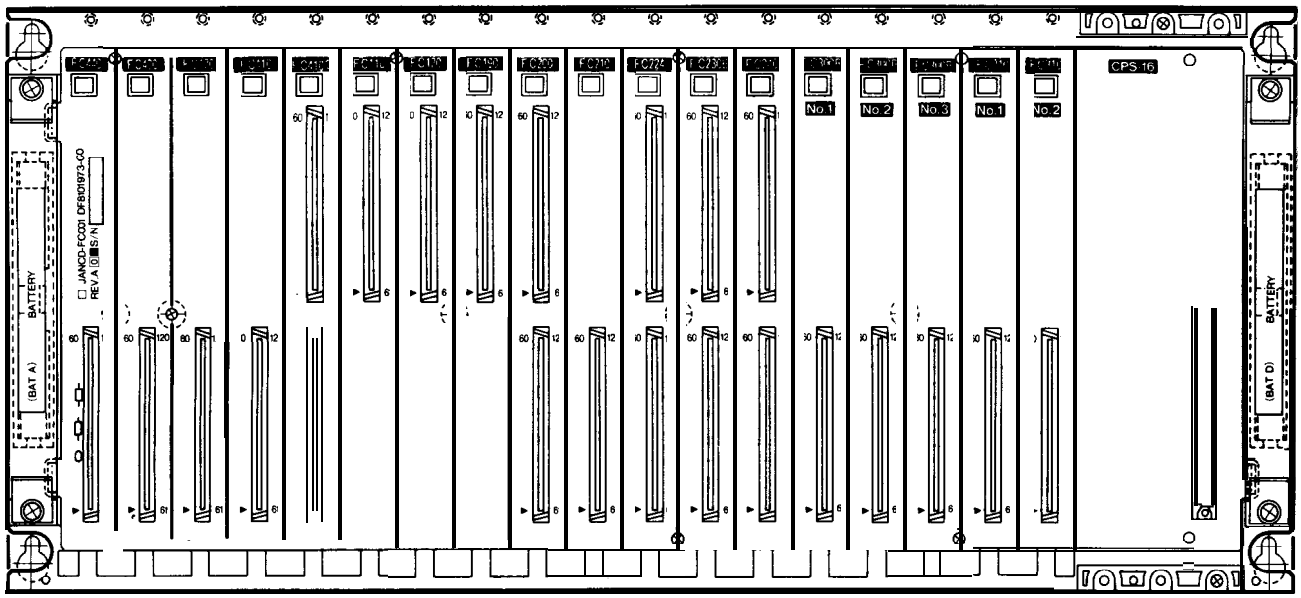

- JANCD-FC190-1
- JANCD-FC200
- JANCD-FC21O-1
- JANCD-FC221
- JANCD-FC230B
- JANCD-FC300B-3

For the models description shown above, see Table 1.2.

- JANCD-FC241
- JANCD-FC310-2

For the models description shown above, see Table 1.3.

- JANCD-FC400
- JANCD-FC41O
- JANCD-FC221
- JANCD-FC420
- JANCD-FC430
- JANCD-FC440

For the models description shown above, see Table 1.6.


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(8) JZNC-IOP01E Module

Table 1.8 JZNC-IOP01E Module


Model	Supply Code	Abbreviation	Remarks
JAN CD-FC900B-1	DTN8500	SP	Panel interface (for CRT)
JAN CD-FC901	DTN6670	FKEY	Function keyboard
JAN CD-FC903-1	DTN8080	PI02	Panel 1/0 lHPG
MD T948B-3B	CRT16		9“ monochrome graphic CRT unit
DE9400035	SW825		Keyboard unit

.Panel Interface (Model JANCD-FC900B)

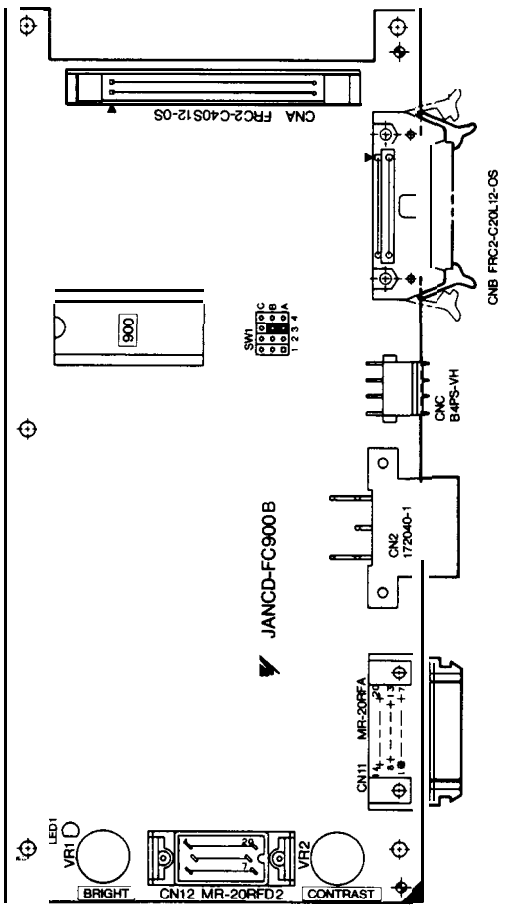

Approx. mass :0.2 kg

.Panel I/O (Model JANCD-FC903-1)

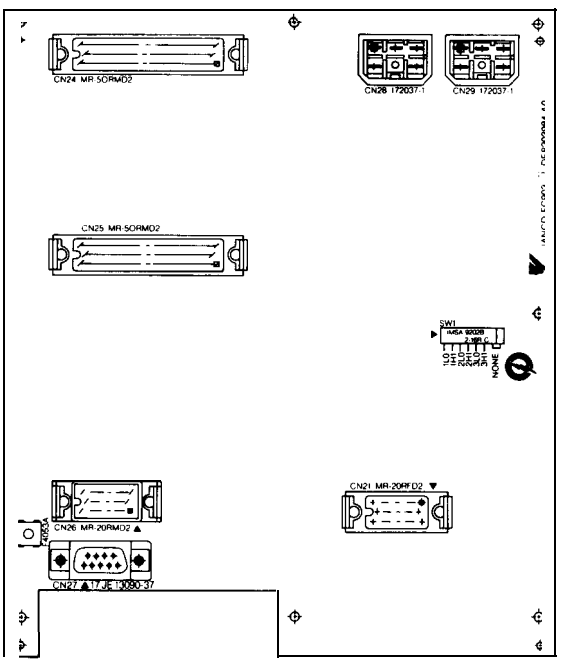

Approx. mass :0.3 kg


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(9) JZNC-IOPI 1 E Module

Table 1.9 JZNC-IOP11 E Module

Model	Supply Code	Abbreviation	Remarks
JAN CD-F C950-1	DTN8190	ASP	Panel interface
JAN CD-FC951	DTN8050	FKEY	Function keyboard
TX1424AD	CRT13		14" monochrome graphic CRT unit
DE8412739	SW826		Keyboard unit

.Panel Interface (Model JANCD-FC950-1)

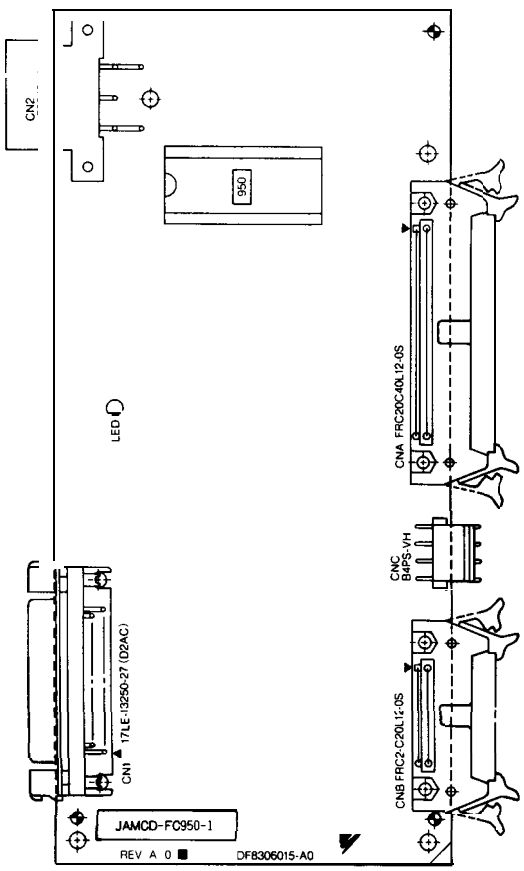

Approx. mass :0.18 kg

(1 O) JZNC-IAU51 Module

Table 1.10 JZNC-IAU51 Module

Model	Supply Code	Abbreviation	Remarks
MO DE L2801 B-2	RED18		RS-232C tape reader
EYG300/55GTL	AVR904		Composite power for 5/24V tape reader
MOD EL1500	RED14		Option
MOD EL1402-1	RED13		Option

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


(11) Option Modules

Table 1.11 Option Modules

Model	upply Code	Abbreviation	Remarks
JAN CD-FC110	DTN6450	COM	Communication module
JAN CD-F C120-1	DTN6370	FILE	Expanded RAM 64kB (320 m)
JAN CD- FC120-2	DTN6760	FILE	Expanded RAM 192kB (640 m)
JAN CD- FC120-3	DTN6770	FILE	Expanded RAM 448kB (1280 m)
JAN CD-F C120-4	DTN6980	FILE	Expanded RAM 960kB (2560 m)
JAN CD-F C120-5	DTN6990	FILE	Expanded RAM 1984kB (5120 m)
JAN CD-F C190-2	DTN7030	SMEM	FC200 memory RAM 512kB
JAN CD- FC191-2	DTN1OO4O	SMEM2	FC200 memory RAM 640kB
JAN CD- FC191-3	DTN1OO5O	SMEM2	FC200 memory RAM 384kB, with printer I/F
JAN CD- FC191-4	DTN1OO6O	SMEM2	FC200 memory RAM 640kB, with printer I/F
JAN CD- FC21O-2	DTN6500	PLC	Sequence controller 2 CH RS-232C
JAN CD-FC222	DTN811O	INTEX2	NC program analysis (With extended CPU)
JAN CD-F C245-1	DTN6820	FG	Interpolation computing element x 1
JAN CD-F C245-2	DTN6590	FG	Interpolation computing element x 2
JANCD-FC251	DTN1018O	INTEXB2	NC program analysis (with high-performance CPU)
JANCD-FC260-2	DTN1024O	MOTION	Motion management, data distribution, without spindle control
JANCD-FC265	DTN1021O	FG2	Interpolation calculator (for FC 260)
JANCD-FC301-3	DTN6660	LIF	Linear scale interface: 3 axes
JANCD-FC401	DTN7050	FDC	Floppy disk control
JANCD-FC470	DTN7040	ARM	ACGC debug memory module
JANCD-FC801	DTN8160	ADM	Remote I/O A/D module
JANCD-FC802	DTN8170	DAM	Remote 1/0 A/D module
JAN CD- FC803-3	DTN8140	DLB	Branch board : 3 axes
JANCD-FC900B-2	DTN8530	SP	Panel interface (for EL)
JAN CD- FC903-2	DTN8090	PIo2	Panel 1/0 2HPG
JANCD-FC903-3	DTN81OO	PI02	Panel 1/0 3HPG
JAN CD- FC950-2	DTN8200	ASP	Panel interface, video printer
JAN CD- FC950-3	DTN821O	ASP	Panel interface, JIS keyboard
JAN CD- FC950-4	DTN8220	ASP	Panel interface, video printer, JIS keyboard


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

- **Communication Module (Model JANCD-FC110)**

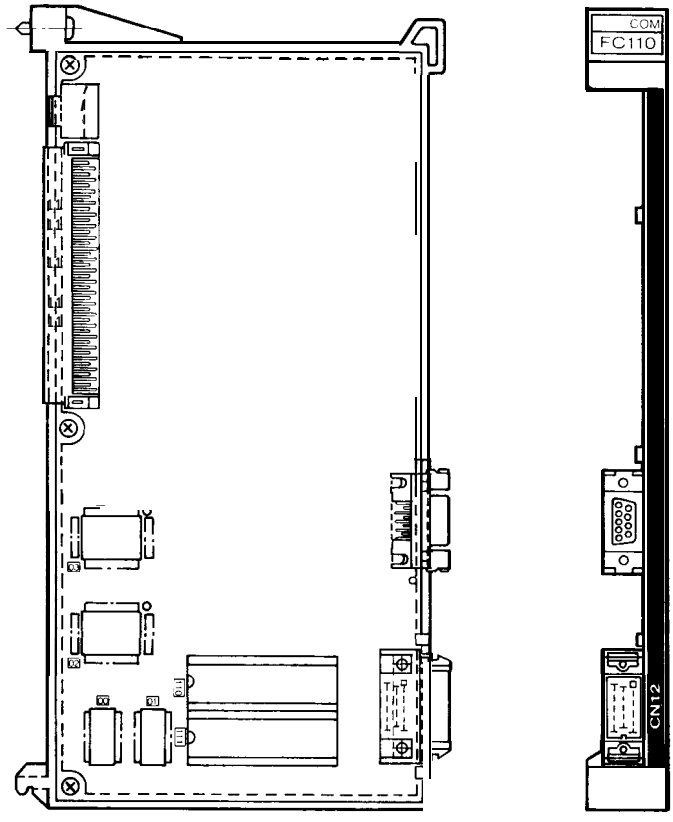

Approx. mass :0.31 kg


- Expanded RAM (Model JANCD-FC120)

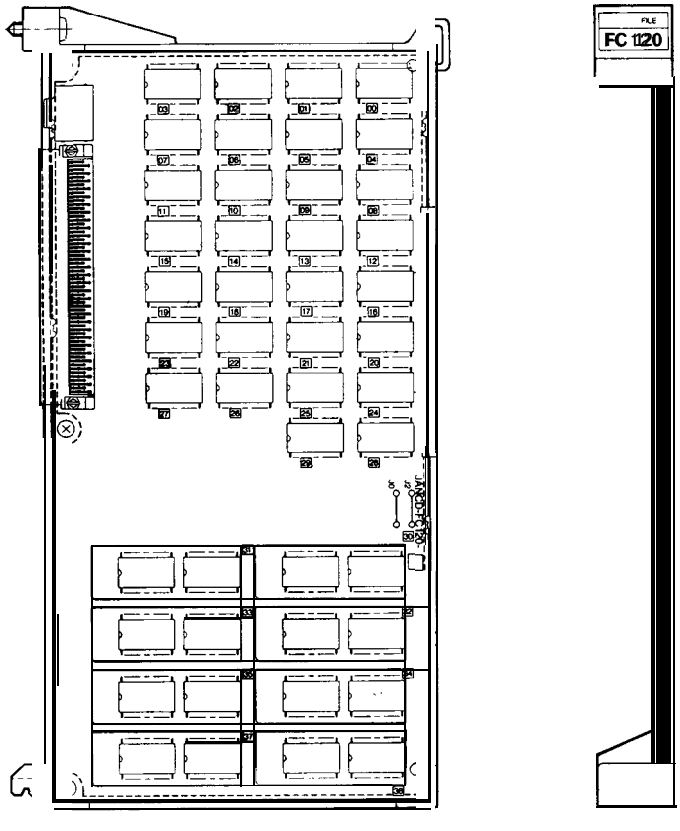

Approx. mass :0.27 kg


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

- **Sequence Controller (Model JANCD-FC21 O-2)**

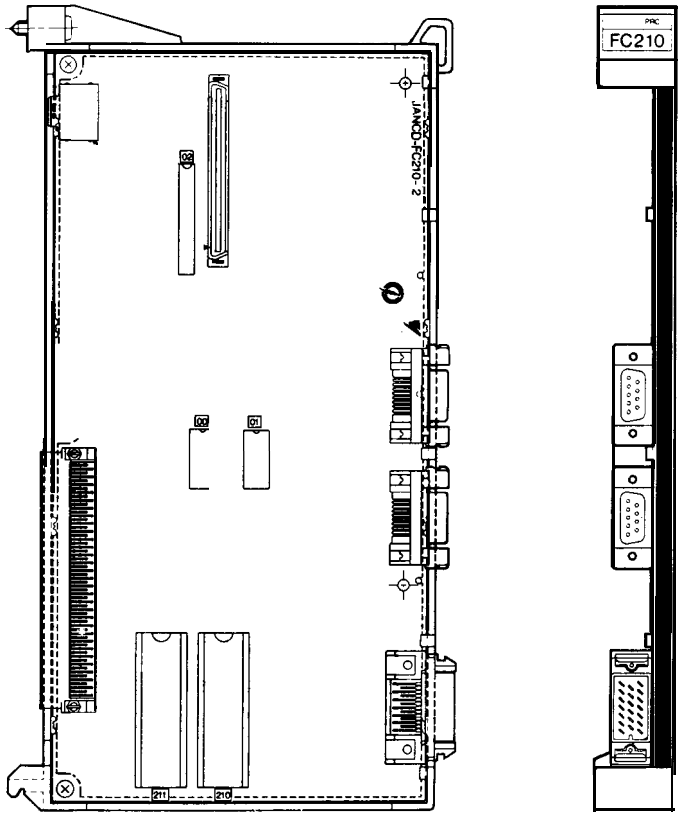

Approx. mass :0.32 kg


- **NC Program Analysis (Model JANCD-FC222)**

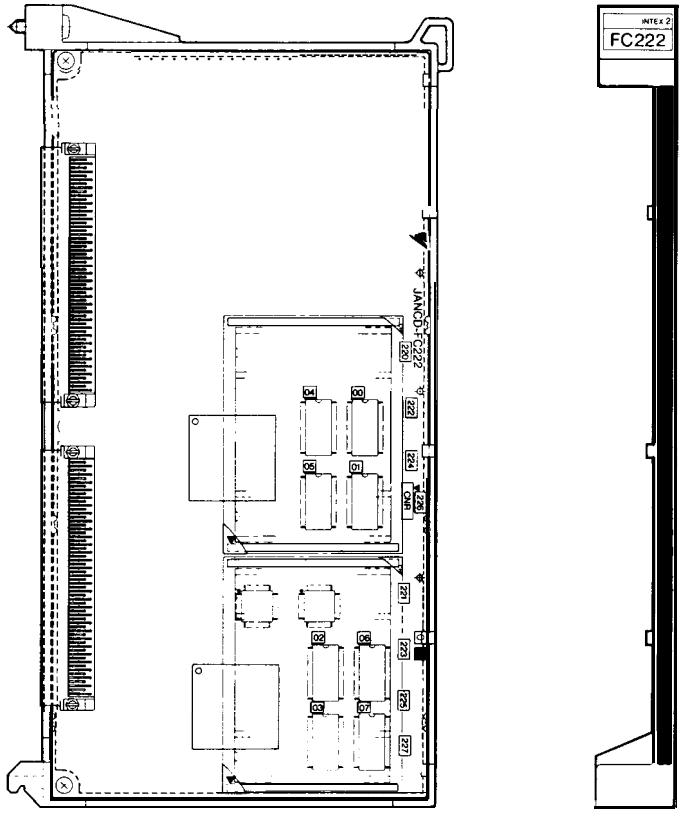

Approx. mass :0.42 kg

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


.Floppy Disk Control (Model JANCD-FC401)

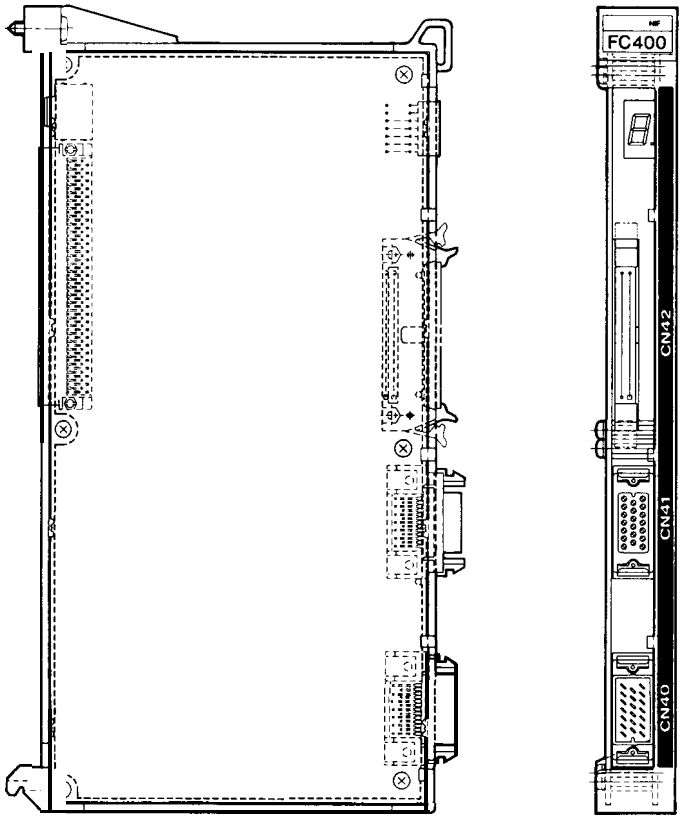

Note This figure shows model JANCD-FC401 attached to model JANCD-FC400.

Approx. mass :0.22 kg


• ACGC Debug Memory Module (Model JANCD-FC470)

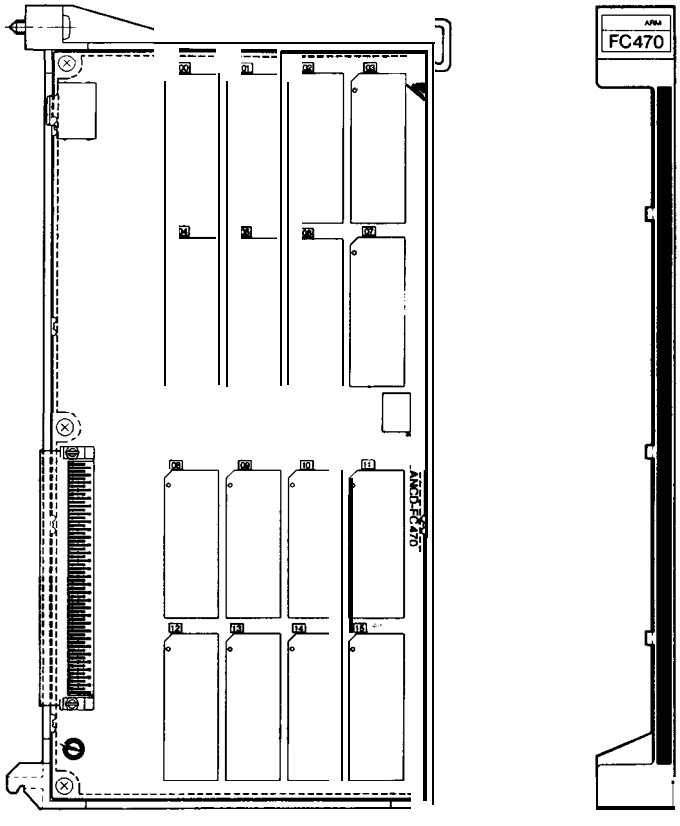

Approx. mass : 0.35kg


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

.Panel 1/0 (Models JAN CD-FC903-2 and -3)

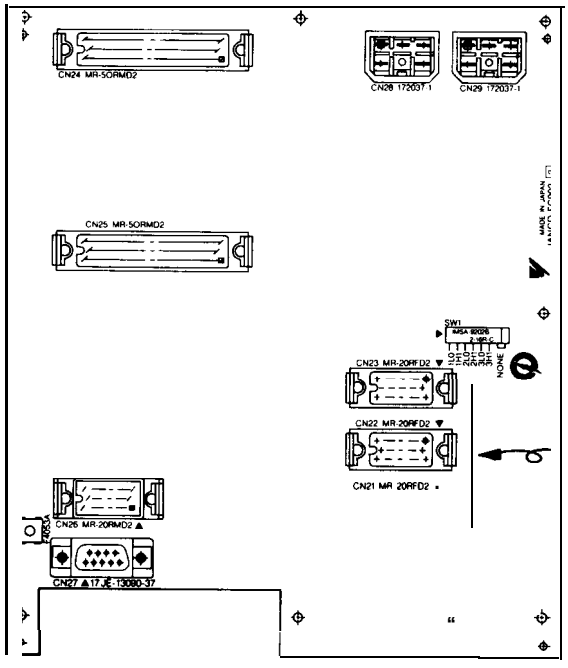

-No CN23 for JANCD-FC 903-2.

.Panel Interface (Models JAN CD-FC950-2, -3, and -4)

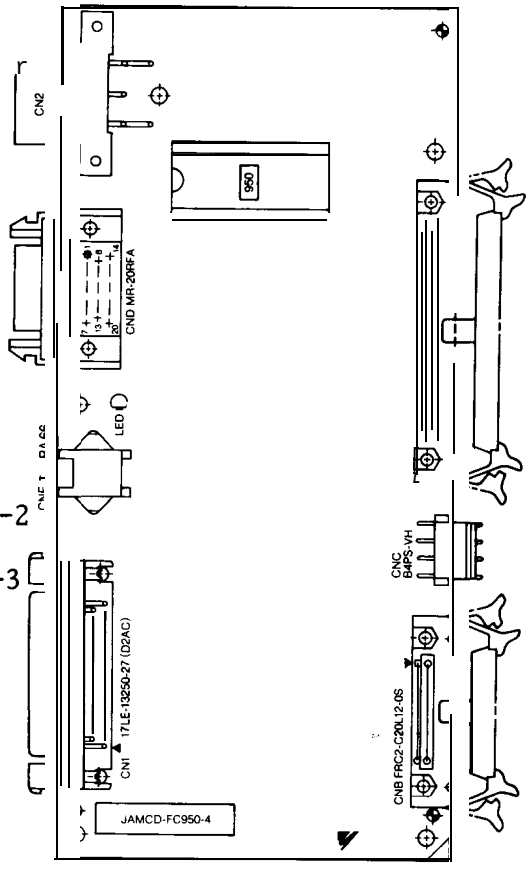

Note

Model JANCD-FC950-2 has no CNE.
Model JANCD-FC950-3 has no CND.
Model JANCD-FC950-4 has CND and CNE.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(12) Combination of Servopack (SC Type) and Motor

Table 1.12 Combination of Servopack (SC Type) and Motor

Motor Model		SERVOPACK CACR-IR					
		05SC	10SC	15SC	20SC	30SC	44SC
M Series	USAMED-03BS	o					
	USAMED-06BS		0	0			
	USAMED-09BS		0	0			
	USAMED-12BS			○	○		
	USAMED-20BS			○	○	○	
	USAMED-30BS					○	○
	USAMED-44BS						○
F Series	USAFED-02CS	0					
	USAFED-03CS	0					
	USAFED-05CS	0	0				
	USAFED-09CS		0	0			
	USAFED-12CS			0	0		
	USAFED-20CS				○	○	
	USAFED-30CS						
	USAFED-44CS						0
G Series	USAGED-02AS	0					
	USAGED-03AS	0					
	USA GE D-05AS	0	0				
	USAGED-09AS		0	0			
	USAGED-12AS			0	0		
	USAGED-20AS				0	0	
	USAGED-30AS					0	0
	USAGED-44AS						0
S Series	USASEM-02AS	0					
	USASEM-03AS	0					
	USASEM-05AS	0	0				
	USASEM-08AS		0	0			
	USASEM-15AS			0	0		
	USASEM-30AS					0	0
D Series	USA DE D-05ES	0	0				
	USA DE D-10ES			0	0		
	USA DE D-15ES				0	0	
	USA DE D-22ES					0	0
	USA DE D-37ES						0
R Series	USA REM-01CS	u					
	USA REM-02CS	○					
	USA REM-03CS	0					
	USA REM-05CS	0	0				
	USA REM-07CS		○	○			

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(13) Combination of Servopack (SB Type) and Motor

Table 1.13 Combination of Servopack (SB Type) and Motor

Motor Model		SERVOPACK CACR-IR					
		05SB	10SB	15SB	20SB	30SB	44SB
M Series	USAMED-06BS		○				
	USAMED-09BS		○				
	USAMED-12BS			○			
	USAMED-20BS				○		
	USAMED-30BS					○	
	USAMED-44BS						○
F Series	USAFED-05CS	○					
	USAFED-09CS		○				
	USAFED-12CS			○			
	USAFED-20CS				○		
	USAFED-30CS					○	
	USAFED-44CS						○
G Series	USAGED-05AS	○					
	USAGED-09AS		○				
	USAGED-12AS			○			
	USAGED-20AS				○		
	USAGED-30AS					○	
	USAGED-44AS						○
S Series	USASEM-05AS	○					
	USASEM-08AS		○				
	USASEM-15AS						
	USASEM-30AS						
D Series	USADED-05ES	○					
	USADED-10ES			○			
	USADED-15ES						
	USADED-22ES					○	
	USADED-37ES						
R Series	USAREM-05CS	○					
	USAREM-07CS		○				


Applicable Encoder Type for Motor Models

Motor Model	Encoder Type		
	15-bit Absolute Encoder	15-bit New-type Incremental Encoder	17-bit Absolute Encoder
M Series	○	○	○
F Series	○	○	
G Series	○	○	
S Series	○	○	
D Series	○	○	
R Series	○		

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


1.2 COMPONENTS (Cent'd)

.SERVOPACK Model CACR-IR03-20SB

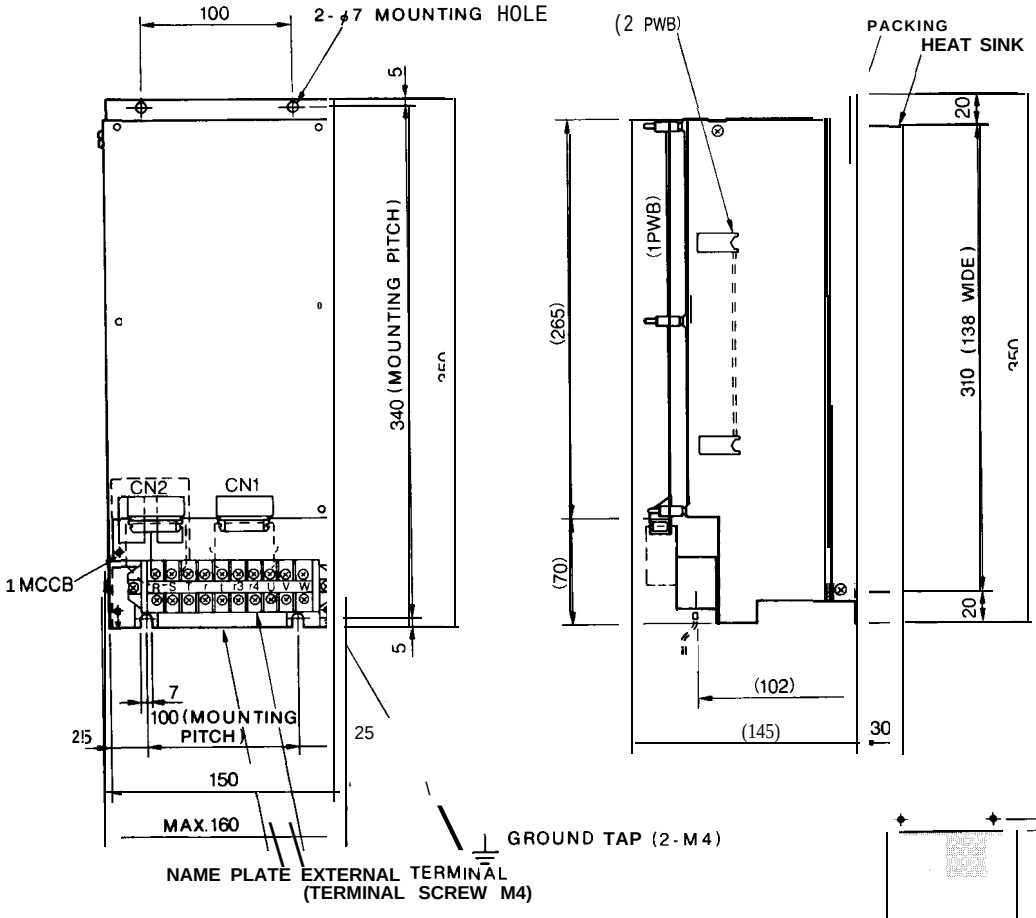

	SE RVOPACK Connector Model	Manufacturer
CN1	MR-20RFA	Honda Communication Industry Co., Ltd.
CN2	MR-20RMA	Honda Communication Industry Co., Ltd.


Approx. mass: 5.5kg

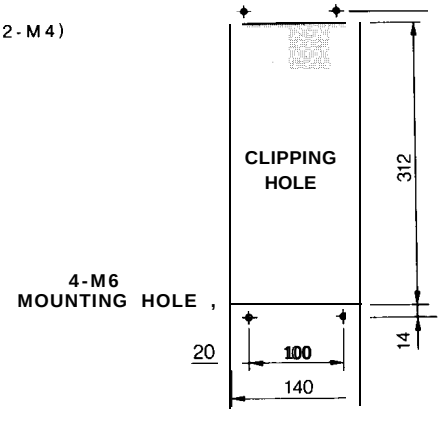

Mounting Hole Processing Diagram


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

.SERVOPACK Model CACR-IR30SB

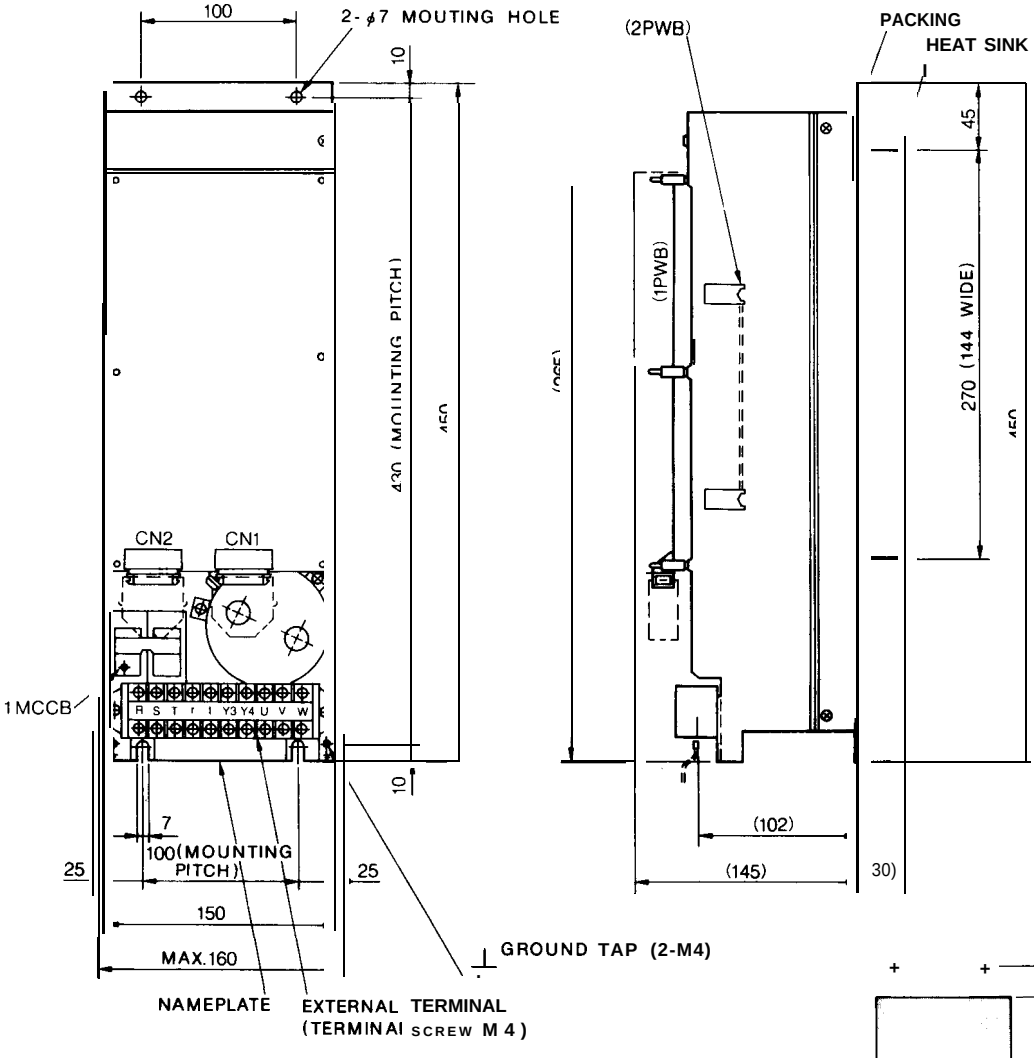

	SE RVOPACK Connector Model	Manufacturer
CN1	MR-20RFA	Honda Communication Industry Co., Ltd.
CN2	MR-20RMA	Honda Communication Industry Co., Ltd.

Approx. mass: 9kg

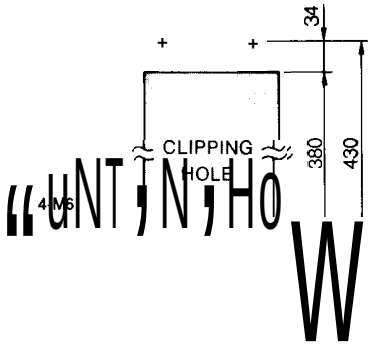


Mounting Hole Processing Diagram

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

1.2 COMPONENTS (Cent'd)

.SERVOPACK Model CACR-IR44SB

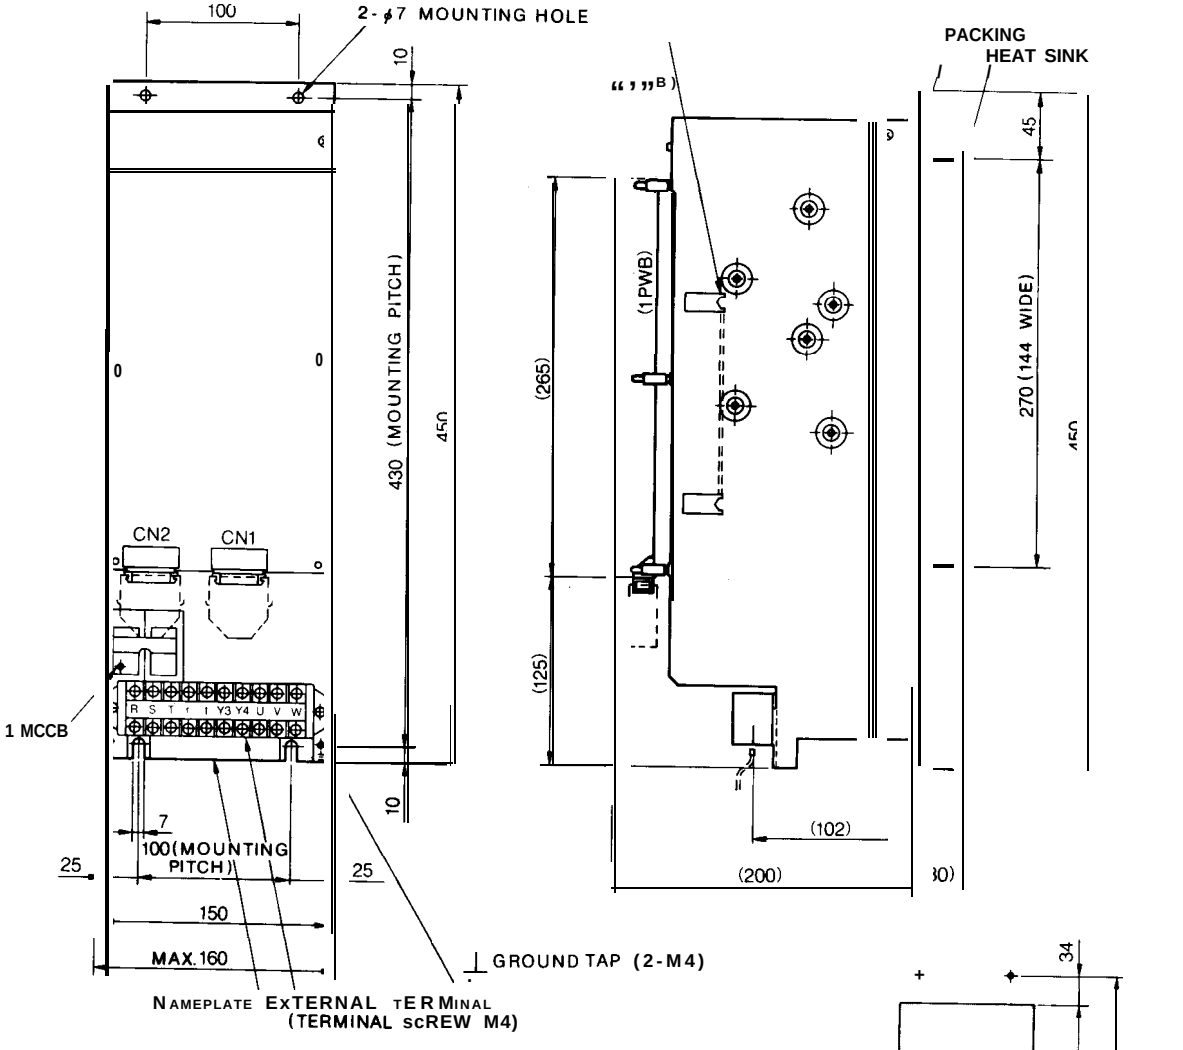



	SERVOPACK Connector Model	Manufacturer
CN1	MR-20RFA	Honda Communication Industry Co., Ltd.
CN2	MR-20RMA	Honda Communication Industry Co., Ltd.


Mounting Hole Processing Diagram


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

▪ SERVOPACK Model CACR-IR□□SC

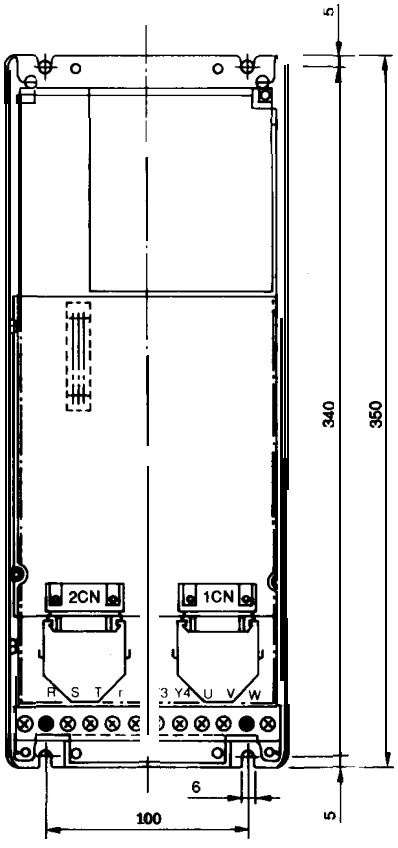

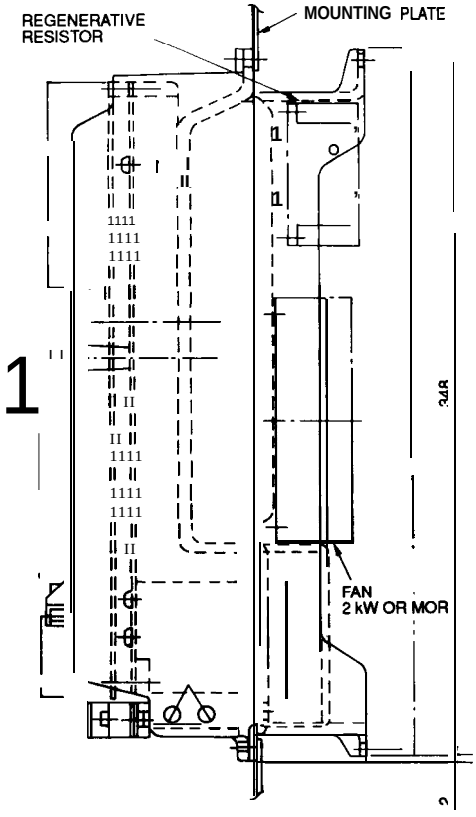

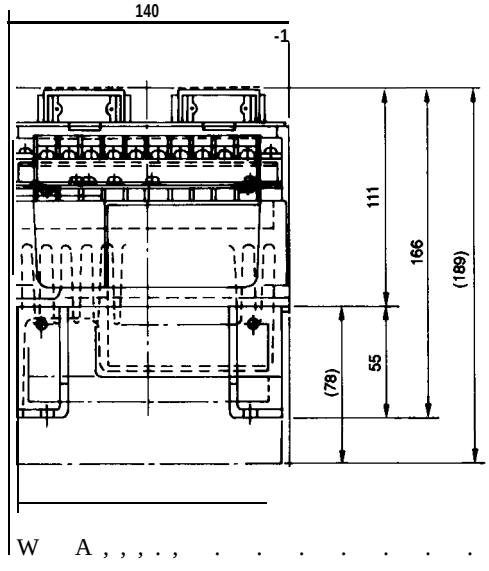

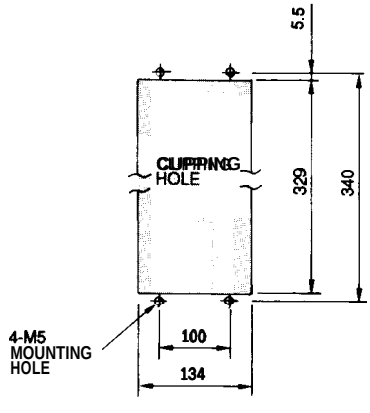

Mounting Hole Processing Diagram

W A , , , . , ...

	SE RVOPACK Connector Model	Manufacturer
CN1	MR-20RFA	Honda Communication Industry Co., Ltd.
CN2	MR-20RMA	Honda Communication Industry Co., Ltd.


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(14) Spindle Drive Unit (VS-626MTIII)


Table 1.14 Spindle Drive Units

Drive Unit Model	Supply Code	Spindle Motor Specification Model	Remarks
CIMR-MTIII-3.7K	—	UAASKA-04CA1 UAASKA-04CA3	Flanged end Foot-mounted type
CIMR-MTIII-5.5K	—	UAASKA-06CA1 UAASKA-06CA3	Flanged end Foot-mounted type
CIMR-MTIII-7.5K	—	UAASKA-08CA1 UAASKA-08CA3	Flanged end Foot-mounted type
CIMR-MTIII-11K	—	UAASKA-11CA1 UAASKA-11CA3	Flanged end Foot-mounted type
CIMR-MTIII-15K	—	UAASKA-15CA1 UAASKA-15CA3	Flanged end Foot-mounted type

.Models CIMR-MTIII-3.7K, -5.5K, -7.5K

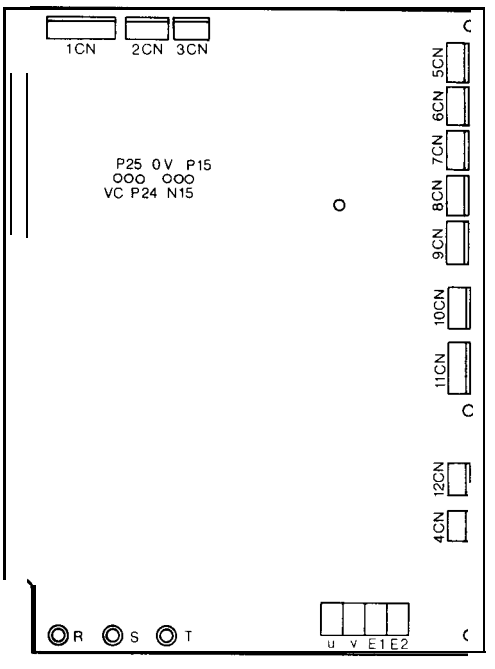

.Models CIMR-MTIII-11K, -15K

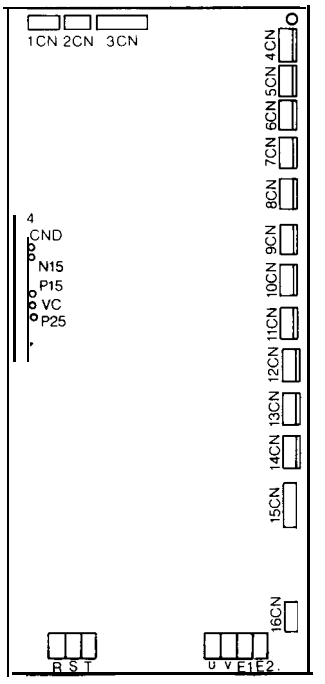


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(15) Spindle Drive Unit (VS-626VM3)


Table 1.15 Spindle Drive Units

Drive Unit Model	Supply Code	Spindle Motor Specification Model	Remarks
CIMR-VMS23P7	—	UAASKA-04CZ1 UAASKA-06CZ3	Flanged end Foot-mounted type
CIMR-VMS25P5	—	UAASKA-06CZ1 UAASKA-06CZ3	Flanged end Foot-mounted type
CIMR-VMS27P5	—	UAASKA-08CZ1 UAASKA-08CZ3	Flanged end Foot-mounted type
CIMR-VMS2011	—	UAASKA-11CZ1 UAASKA-11CZ3	Flanged end Foot-mounted type
CIMR-VMS2015	—	UAASKA-15CZ1 UAASKA-15CZ3	Flanged end Foot-mounted type
CIMR-VMS2018	—	UAASKA-19CZ1 UAASKA-19CZ3	Flanged end Foot-mounted type
CIMR-VMS2022	—	UAASKA-22CZ1 UAASKA-22CZ3	Flanged end Foot-mounted type
CIMR-VMS2030	—	UAASKJ-30CZ1 UAASKJ-30CZ3	Flanged end Foot-mounted type

• In-panel Mounted Type

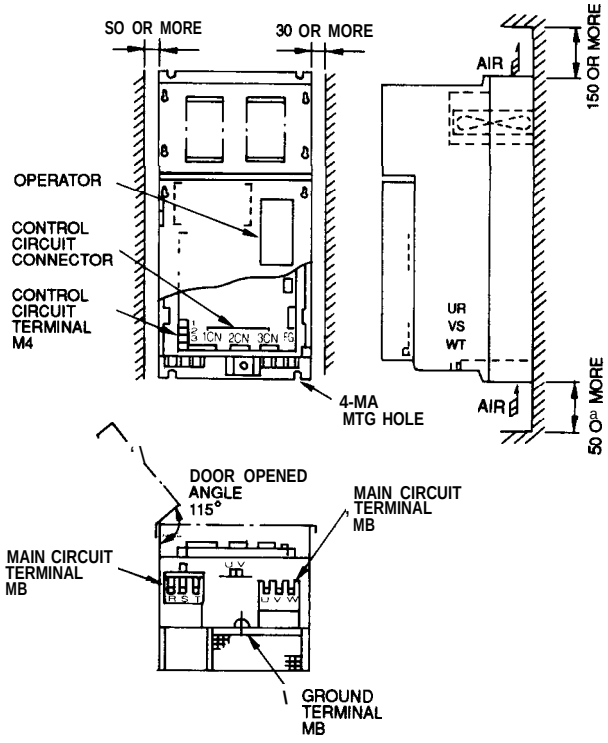

• Heat Sink External Cooling Type

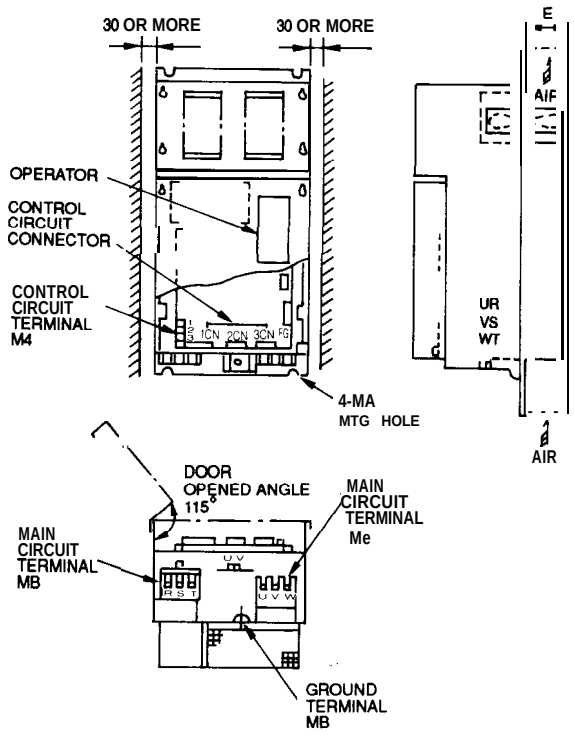

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(16) **Maintenance Unit**

Table 1.16 Maintenance Unit

Model	Supply Code	Abbreviation	Remarks
JZNC-IDU03	DUN20560	ISD	Sequence ladder editing unit
JZNC-IDU04	DUN20290	FDC	FDD unit for developing ACGC
JZNC-IDU05	DUN20770	AXIM	Monitor board for software support

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


2. ROUTINE INSPECTION SCHEDULE

This section explains the requirements to be observed for maintenance time in order to keep the equipment in optimum operating condition for an extended period.

2

CONTENTS

2. ROUTINE INSPECTION SCHEDULE 5 7
2.1 ROUTINE INSPECTION 5 8
2.2 TAPE READER MAINTENANCE 59
2.3 CONTROL PANEL 60
2.4 ACSERVOMOTOR 6 2
2.5 BATTERY 63

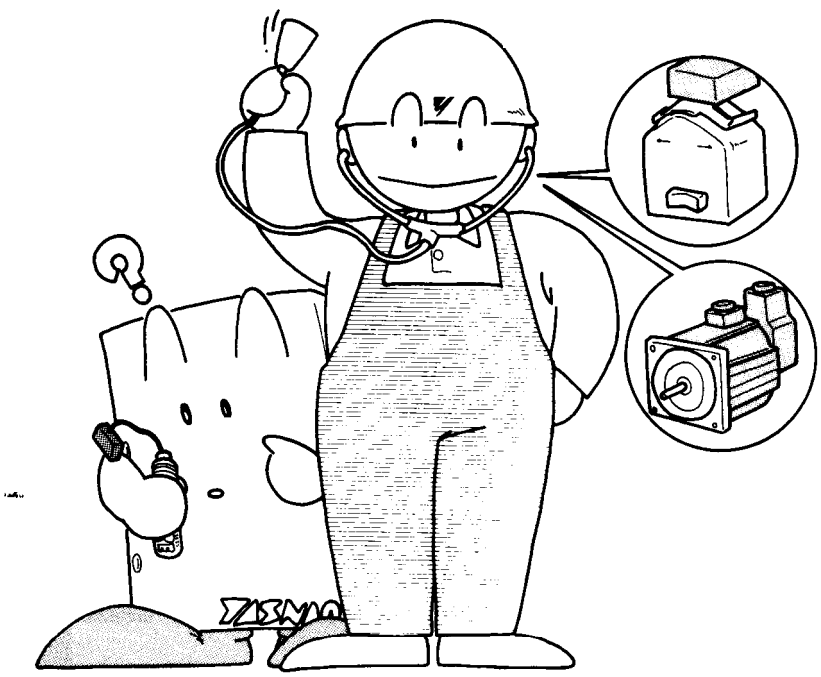

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

2.1 ROUTINE INSPECTION


Table 2.1 shows items that should be inspected routinely.

Table 2.1 Routine Inspection

Section	Check Item	Frequency	With the System-off	With the System-on	Remarks
Tape Reader	Cleaning of Reading Head	As required	○		Including light source
	Cleaning of Tape Tumble Box	As required	○		
	Lubricating of Tension Arm Shaft End	As required	○		
Control Panel	Doors Tightly Closed	Daily	o		
	Checking for Loose Fit and Gaps in Side Plates and Worn Door Gaskets	Monthly	o		
AC Servomotor	Vibration and Noise	Daily		o	Feel by hand, and perform an audible inspection
	Motor Contamination and Breakage	Daily or as required	o	0	Visual inspection
Battery		At power on	○	o	Check if alarm for BATTERY is displayed on CRT screen.

Except for those checks which can be made with the NC in the energized state, such as checks for external cleanliness, vibration, and noise, be sure to turn off the power supply to the NC before starting to undertake routine maintenance service.

To turn power OFF to the NC completely, set MCCB (Molded Case Circuit Breaker) on the power panel at the machine to the OFF position .

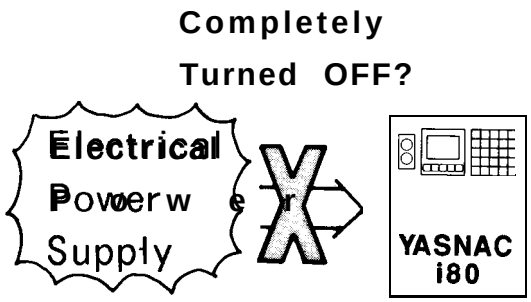


Note

Turning OFF the power supply by depressing the 'POWER OFF button on the NC control panel is not sufficient, because several areas in the housing are still energized, and are potentially dangerous.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

2.2 TAPE READER MAINTENANCE

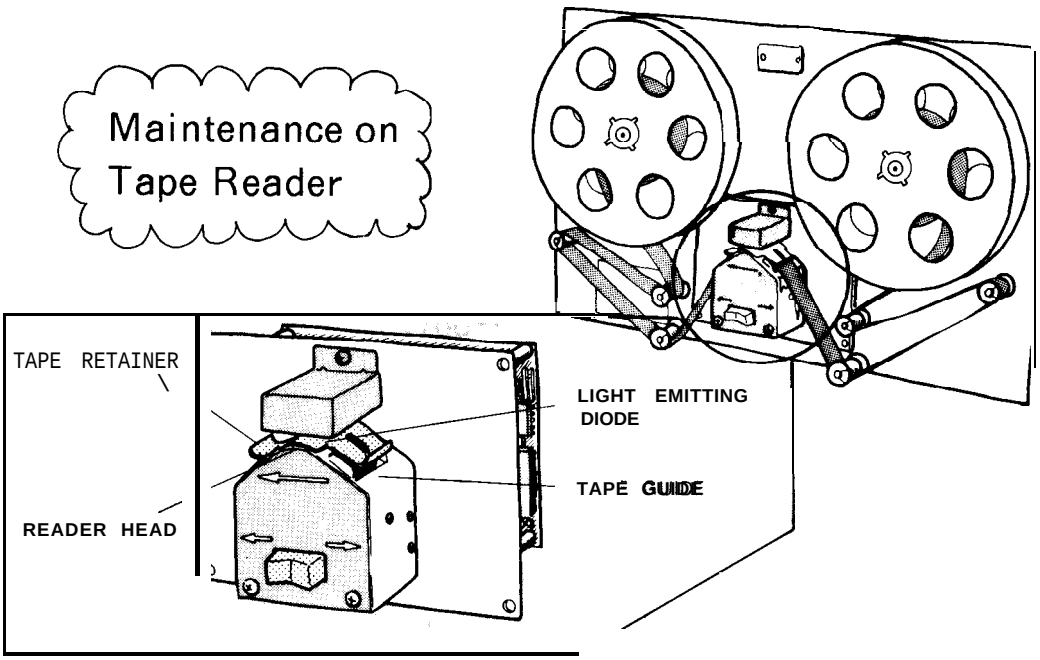

2

(1) Cleaning the Tape Reader Head
(as required)

(a) **Remove tape contamination** and dust from the glass with a blower brush. If the glass is stained with oil or oily dust, wipe it using gauze or a soft cloth with absolute alcohol. Also clean the tape guide and the tape retainer.

(b) Remove the dust, if any on top of LED (light source) with a blower brush.

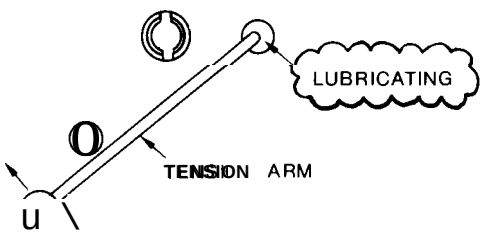


Fig.2.1 8-inch Tape Reel

(2) **Lubricating of Tension Arm Shaft (as Required)**

For the control with 6-inch or 8-inch diameter reels, lubricate the shaft end of tension arm, when the tension arm does not move smoothly.

Note **When trouble occurs in feeding or winding tape with 8-inch diameter reels, open the front door and brush away dust around the photo-coupler using a blower brush.**

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

2.3 CONTROL PANEL


This section explains YASKAWA's standard cabinet. For cabinets customized for customers, refer to the manual issued by machine manufacturer.


(1) **Checks for Tight Closing of Doors** (daily)

(a) The control panal is constructed as a dust-proof, sheet-steel enclosure with gasketed doors so as to keep out dust and oil mists. Keep each door tightly closed at all times.

(b) After inspecting the control with the door open, close the door and fasten door locks (two per door) securely using the key provided (No. YE001) . When opening or closing, insert the key all the way into the keyhole and turn until it clicks (approximately a quarter-turn) . The key can be removed from an open or closed position.



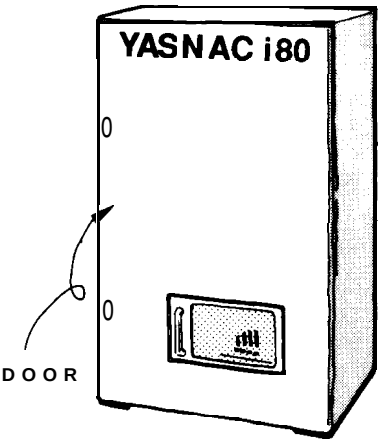

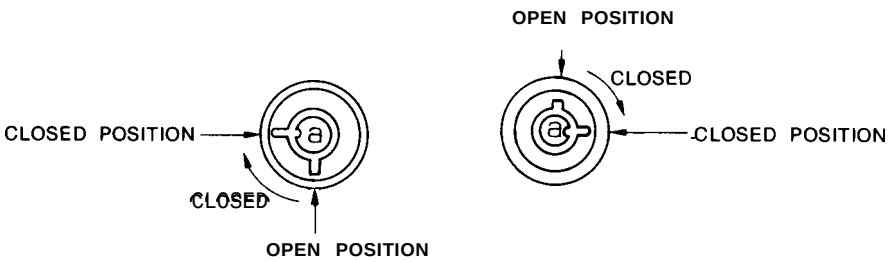

Left - Hand Hinged Door Right-Hand Hinged Door

Movable part "a " is notched horizontally, ... Closed

Movable part "a " is notched vertically. . . . . Open

Note **If the optional door interlocking switch is provided, opening the door shuts off the main power supply and stops all operations.**


Fig. 2.2 Door Lock

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(2) Checking for Opening and Damage (monthly)


(a) Check gaskets on the rims of front and rear doors.

Is the packing damaged?

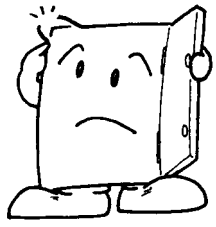


(b) Check if the inside of enclosure is dusty. Clean it, if necessary.

Dusty ?

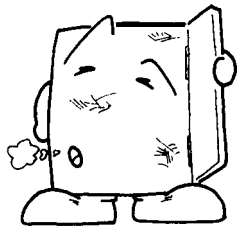

(c) Check for any opening in the door base with the doors shut tightly.


Is any opening found?

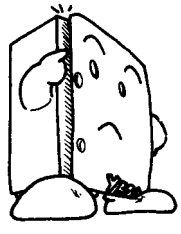

Constant execution of the maintenance work described above will keep YASNAC i80 in optimum condition for an extended period.


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


2.4 AC SERVOMOTOR

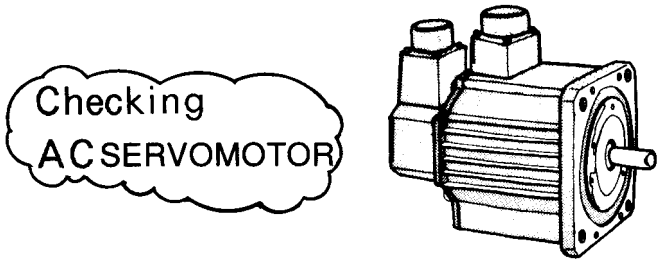

(1) **Vibration and Noise** (daily or as required)

Vibration can be checked by resting the hand on the motor, and for noise, using a listening stick is recommended. If any abnormality is found, contact maintenance personnel immediately.

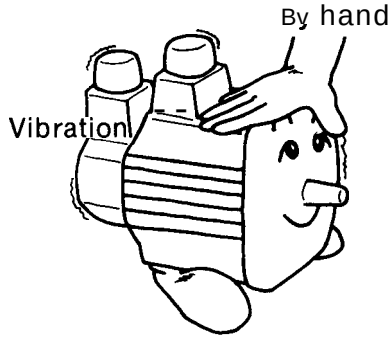


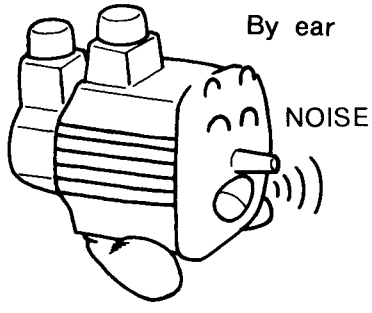

(2) **Motor Contamination and Damage** (daily or as required)

Check the motor exterior visually. If dirt or damage should be observed, inspect the motor by removing the machine cover. Refer to the machine manufacturer's manual.


Checking visually for contamination and damage

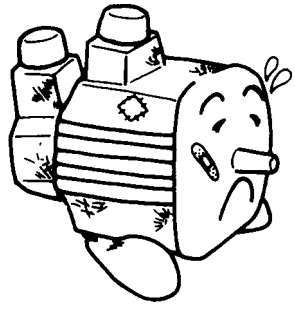

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


2.5 BATTERY

Checking Battery

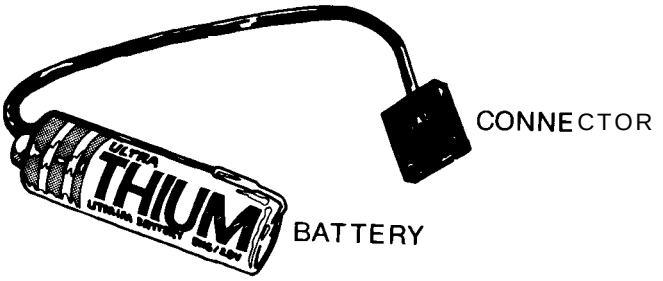

2

Make sure that "BAT" is not displayed on the lower right portion of the CRT screen at power ON. If it is displayed, the battery must be replaced within a month.

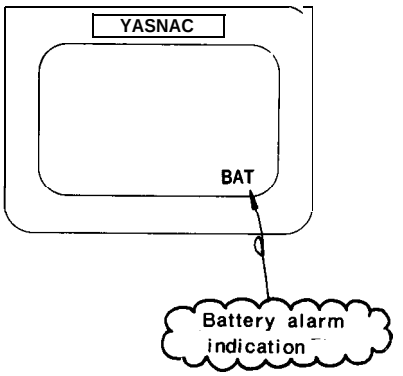

Note **No commercially available batteries can be used. When replacing the battery, be sure to contact your YASKAWA representative.**

<Replacing Procedure>

1. Depress the POWER OFF pushbutton.
2. If a door interlock switch is provided, turn it **OFF. The** power can be turned ON, with the door open.
3. Open the door so that the NC rack (model: JZNC-IRK ☐☐☐) is visible.
4. Turn power ON.
5. Check if the LED on the model JANCD-FC200, model JANCD-FC300B and model JANCD-FC400 boards goes ON. If the battery must be replaced, the LED goes ON.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

2.5 BATTERY (Cent'd)

Fig. 2.3, Fig. 2.4 shows the arrangement of LED and the battery.

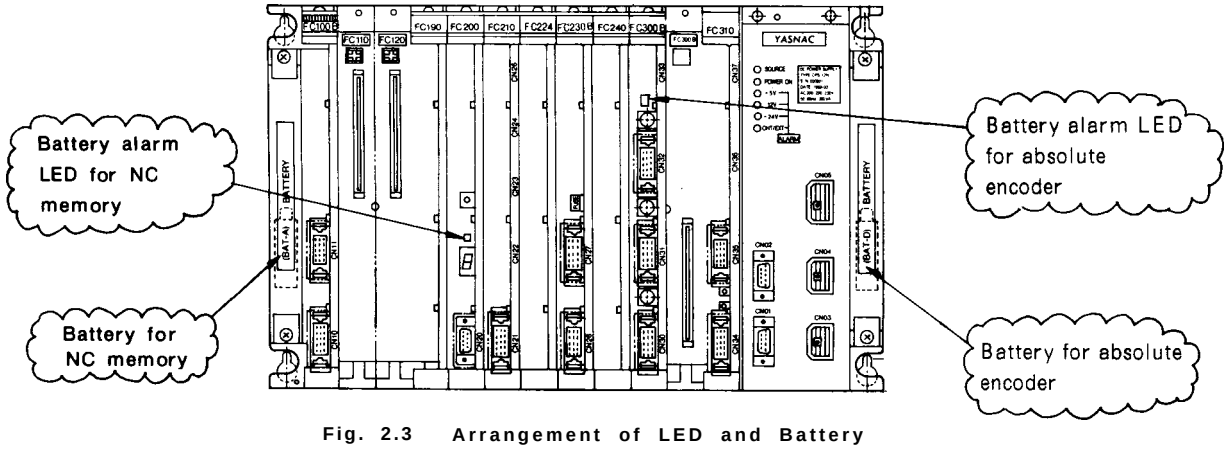


Fig. 2.3 Arrangement of LED and Battery
(9" AMGC NC Rack 1)

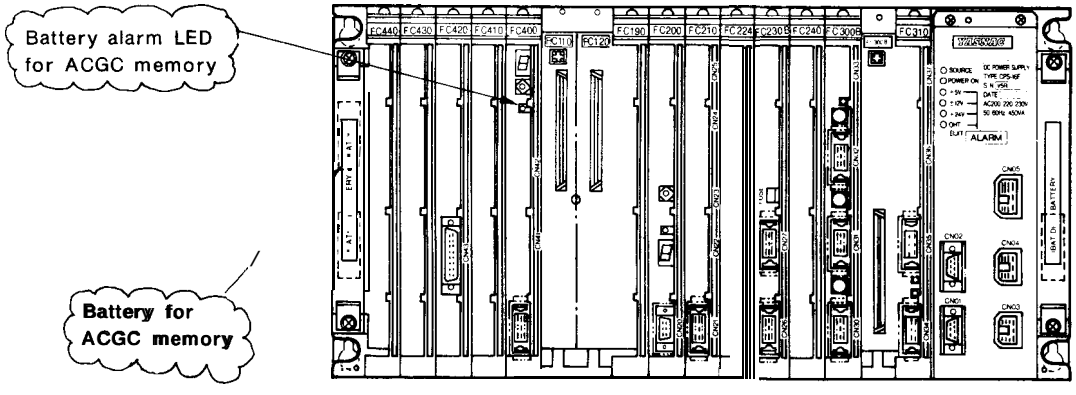


Fig. 2.4 I3attery Layout (14" ACGC NC Rack 1)

Note

Three types of batteries are available: for NC memory, for absolute encoder and for ACGC memory.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

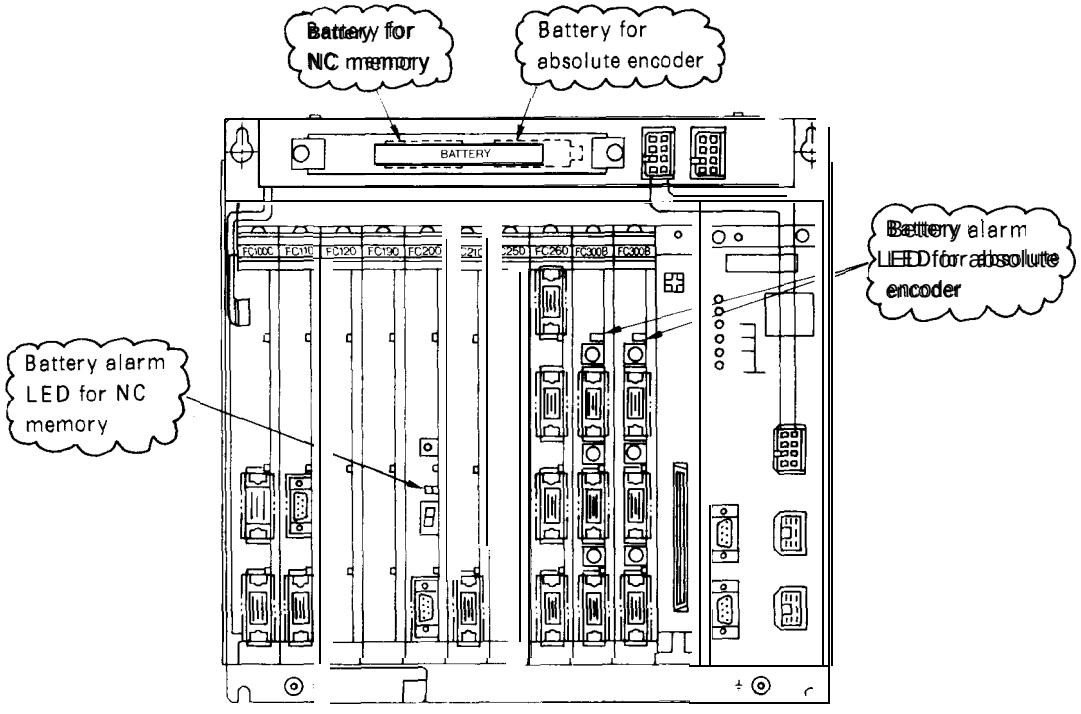


Fig. 2.5 Battery Layout (9" AMGC NC Rack 3)

.000 The procedure for checking a defective battery is completed at this point.

Battery model: ER6V3 Supply code BA507

- ❑ Turn the power OFF. Use a screwdriver to remove the screws and remove the battery cover. Remove the battery mounted in the holder.
- ❑ Put the new battery in the holder and set the connector. The direction of the connector does not matter. Poor connection will not cause conduction. See Fig. 2.6.

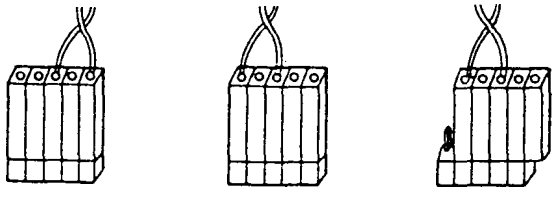


Fig. 2.6 Battery Connection

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

2.5 BATTERY (Cent'd)

- With the power ON, make sure that the blinking display on the CRT screen or the red LED at the front of the model JANCD-FC200, model JANCD-FC300B and model JANCD-FC400 boards goes OFF.

Note ① **If they are still illuminated, it is due to an improper battery connection or a defective battery.**

② When any of alarms 2121 and after (encoder battery error) occurs, DGN #35024(*BALM) is not output. When DGN #35024(*BALM) **is output, the LED goes on only in the case where the CMOS backup battery is exhausted.**
This battery differs from the encoder battery.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


3. MAINTENANCE INSTRUMENTS

This section describes maintenance instruments.

3

CONTENTS

3. MAINTENANCE INSTRUMENTS.....67

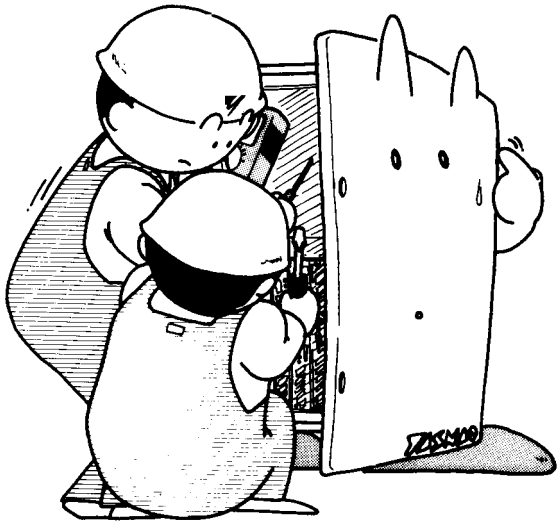


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

3. MAINTENANCE INSTRUMENTS (Cent'd)


(1) Measuring Instruments

Table 3.1 Measuring Instruments

Name	Allowable Measuring Range	Purpose
Tester or Multi-Purpose Digital Meter	10 to 300 VAC (at 40 to 100 Hz) Tolerance: ±2%	To measure AC power voltages
	Several mV to 100 VDC Tolerance: ±2%	To measure DC power voltages
	Up to multiples of 10 MΩ Tolerance: ±5%	To measure currents, etc.

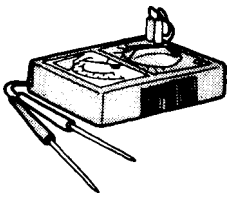

TESTER

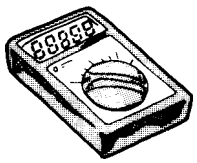


MULTI-PURPOSE DIGITAL METER

(2) Tools

Phillips screwdrivers: large, medium, and smal 1
Standard screwdrivers: medium and small
ROM extractor: IC EXTRACTOR model GX-6

⊕ PHILLIPS SCREWDRIVER

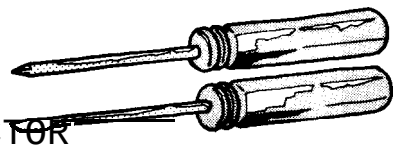

⊖ STANDARD SCREWDRIVER

(3) Chemicals

Cleaning agent for tape reader (absolute alcohol)



(4) Maintenance parts

Fuse model: HM03 **0.3 A**
Approx. mass: 0.4 g



Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4. TROUBLESHOOTING

This section describes troubleshooting by alarm codes, troubleshooting without alarm codes, supply voltage checks, and status display by the on-line diagnostics function.
The contents of this section should be understood fully to minimize the down time of your system due to malfunctions.

CONTENTS

4. TROUBLESHOOTING 69

4.1 TROUBLE IDENTIFICATION 71
4.1.1 RECOGNITION OF TROUBLE STATUS 71
4.1.2 RECOGNITION OF NC SYSTEM 72

4.2 TROUBLESHOOTING BY ALARM CODES 77
4.2.1 DISPLAY METHOD 77
4.2.2 ALARMS 0010 AND 0011 (PARITY ERROR) 82
4.2.3 ALARMS 0016, 0017, 0018, 9016, 9017 AND 9018 (RS-232C ERROR) 83
4.2.4 ALARM 1099 (TEMPERATURE ALARM INSIDE THE PANEL) 88
4.2.5 ALARMS 2061 TO 2068 (ZERO POINT RETURN AREA ERROR) 89
4.2.6 ALARMS 2071 TO 2078, 2081 TO 2088
(REFERENCE POINT RETURN AREA ERROR) 90
4.2.7 ALARMS 2101 TO 2108 (P-SET ERROR) 91
4.2.8 ALARM 3000 (SERVO UNREADY) 92
4.2.9 ALARM 3001 (CONTROL NOT READY) 92
4.2.10 ALARM 3002 (EMERGENCY STOP) 93
4.2.11 ALARMS 3041 TO 3048 (EXCESSIVE POSITION LAG) 94
4.2.12 ALARMS 3051 TO 3054 (EXCESSIVE POSITION LAG) 95
4.2.13 ALARMS 3061 TO 3068 (MOTOR OVERLOAD) 96
4.2.14 ALARMS 3081 TO 3088 (PG DISCONNECTION ERROR) 96
4.2.15 ALARMS 3091 TO 3094 (SPINDLE PG DISCONNECTION ERROR) 97
4.2.16 ALARMS 3121 TO 3128 (EXCESSIVE SPEED) 97
4.2.17 ALARMS 3141 TO 3148 (PREVENTION OF UNCONTROLLED RUNNING) 98

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

CONTENTS

4.2.18 **ALARMS 3161 TO 3168 (ABSOLUTE** ERRORS) 98
4.2.19 **ALARMS 3181** TO 3188 (POSITION ERRORS) 99
4.2.20 ALARMS 3201 TO 3208 (SERVODRIVE UNIT COMMUNICATION ERRORS) 99
4.2.21 ALARMS 3301 TO 3305 (OVERCURRENT) 100
4.2.22 ALARMS 3311 TO 3315 (MCCB TRIP) 100
4.2.23 ALARMS 3321 TO 3325 (REGENERATIVE ERROR) 100
4.2.24 ALARMS 3331 TO 3335 (OVERVOLTAGE) 101
4.2.25 ALARMS 3341 TO 3345 (UNDERVOLTAGE) 101
4.2.26 ALARMS 3351 TO 3355 (HEAT SINK OVERHEAT) 101
4.2.27 ALARMS 3361 TO 3365 (WIRE BREAK IN CURRENT INSTRUCTION CABLE) 102
4.2.28 ALARMS 3371 TO 3375 (MISSING PHASE) 102

4.3 TROUBLESHOOTING WITHOUT ALARM CODES 103
4.3.1 POWER CANNOT BE SUPPLIED 103
4.3.2 SOLUTION TO ERRORS DETECTED IN SELF-DIAGNOSIS 104
4.3.3 CRT SCREEN DOES NOT DISPLAY 113
4.3.4 HANDLE MODE OPERATION FAULTY 113
4.3.5 MANUAL JOG MODE OPERATION FAULTY 115
4.3.6 MANUAL RAPID MODE OPERATION FAULTY 117
4.3.7 MANUAL ZERO RETURN OPERATION FAULTY 119
4.3.8 CYCLE START FAILURE 120
4.3.9 OPERATION IS NOT AVAILABLE WITH G01, G02, OR G03 121
4.3.10 SPINDLE DOES NOT ROTATE 122
4.3.11 9" CRT SCREEN IS DARK 123
4.3.12 EDIT DOES NOT FUNCTION 124
4.3.13 FIN WAIT OCCURS BY SPINDLE RELATED INSTRUCTION 125
4.3.14 SKIP FUNCTION (G31) OPERATION FAILURE 126
4.3.15 TAPE MODE DOES NOT FUNCTION 127

4.4 POWER SUPPLY VOLTAGE CHECK 128
4.4.1 CHECK AT POWER SUPPLY VOLTAGE 128
4.4.2 INDICATION OF LAMP OF POWER SUPPLY UNIT 129
4.4.3 CHECK DC POWER SUPPLY VOLTAGE 129

4.5 STATUS DISPLAY BY SELF-DIAGNOSIS FUNCTION (DGN) 130
4.5.1 OUTLINE OF DISPLAY 130
4.5.2 DISPLAYING INPUT/OUTPUT SIGNALS 131

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.1 TROUBLE IDENTIFICATION

Try to fully analyze the circumstances in which trouble occurs. This is necessary for identifying the trouble and/or for assisting YASNAC service personnel who may be called in to correct the trouble. Verifying the following points will minimize the down time of your system.


4.1.1 RECOGNITION OF TROUBLE STATUS


(1) **What operation will cause the trouble? (Is other operation performed normally?)**

(2) **When does the trouble occur: every time or frequently?**

(3) Was there any external disturbance such as power interruption or lightning when the trouble occurred?


(4) Did it occur during or after operation of mode switches such as EDIT or memory, or process keys such as PROG **'r** SET **'r 'oft 'eys on CRT panel?**

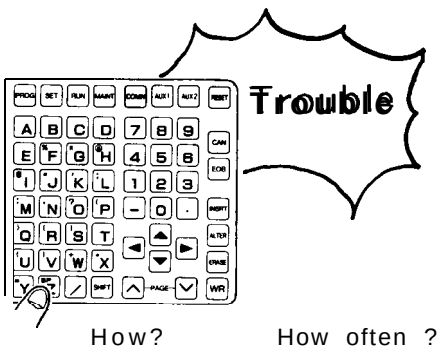

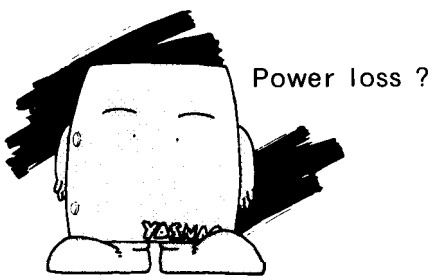

(5) Ensure the following points if the trouble occurred as related to feed and/or spindle operation:

.Check of LED on the drive unit
.ON/OFF check of circuit breaker
.Time of trouble occurrence such as
at power ON.
at acceleration.
at deceleration.
at steady-state running.

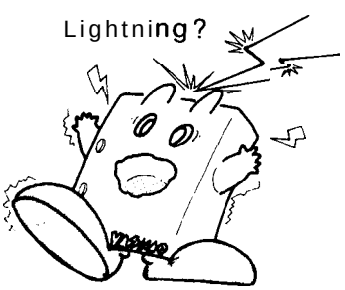

(6) Does it depend on the part program?

Record the machining program, offset, work coordinate system shift amount or coordinate system set value if it depends on the part program.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.1.2 RECOGNITION OF NC SYSTEM

Ensure the following points so as to correctly recognize the status of the machine and equipment regardless of the details of the trouble.

(1) Name of machine manufacturer
(2) Time of delivery
(3) Name and model of machine
(4) Name and model of NC unit and others

Note **The NC unit is provided with an interlock swicth. When the operator opens the door, the NC unit power supply is tripped by MCCB and the interlock switch is released. Do not start the check operation until the interlock switch is released.**

(Example)
NC unit: YASNAC i80M
Servo drive: CACR-IR05SB
Servo motor: USAGED-05F
Spin dle drive: VS-626 MT III (CIMR-MT III-7. 5K)
Spindle motor: UAASKA-08CA3

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(5) NC System Software

YASNAC i80 software is identified by a system number and version number.

(a) **System Number (NC: □□□□□-□□)**

A system number denotes the number of the system software and consists of five integer digits and a revision number of two digits.
The system number of NC basic software is displayed on the initial screen at power on.

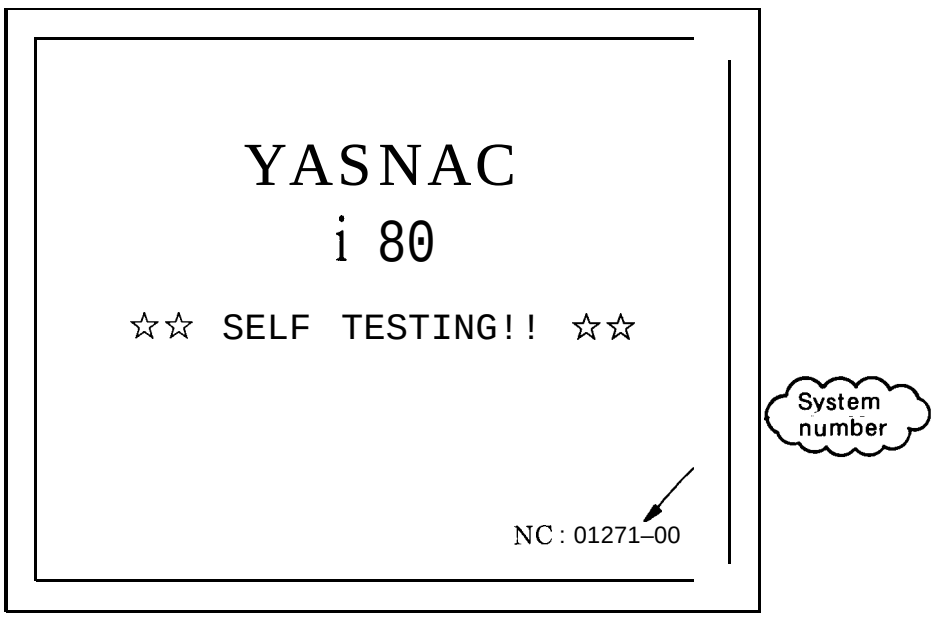


Fig. 4.1 NC Screen at Power on

Optional software is also assigned a system number.

Examples: Communication module
PLC ladder
ACGC application

(b) **Version Number (COM:V□□.□□)**

A version number denotes the number of the software of each CPU of the NC basic section , and consists of two integer digits and two fractional digits.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(c) System Consistency


(i) The function is provided to check whether NC basic software products have version numbers that are consistent with CPUs.

(ii) For optional software products, only the integer part of the system number is checked for con sistency.
If a lack of consistency is found, a serious alarm occurs and the second entry cannot be made.

(iii) Calling up the system consistency check screen

❑ Depress the MAINT key.


2 Depress the operation selection key ⟨⟩ in function selection mode, and the soft keys shown in the figure will be displayed.

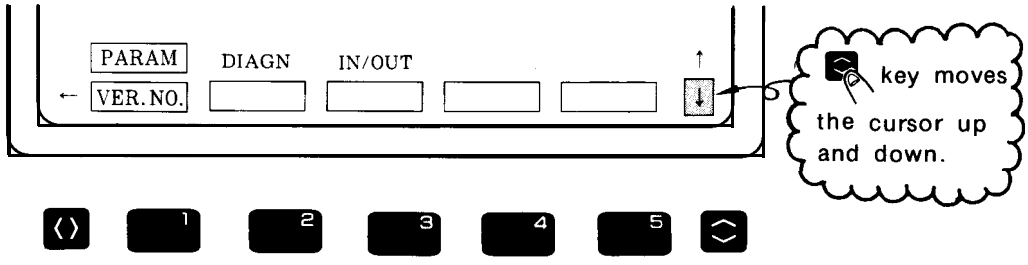

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

3 Depress VER.NO. key.

The screen is displayed as shown in the figure below.

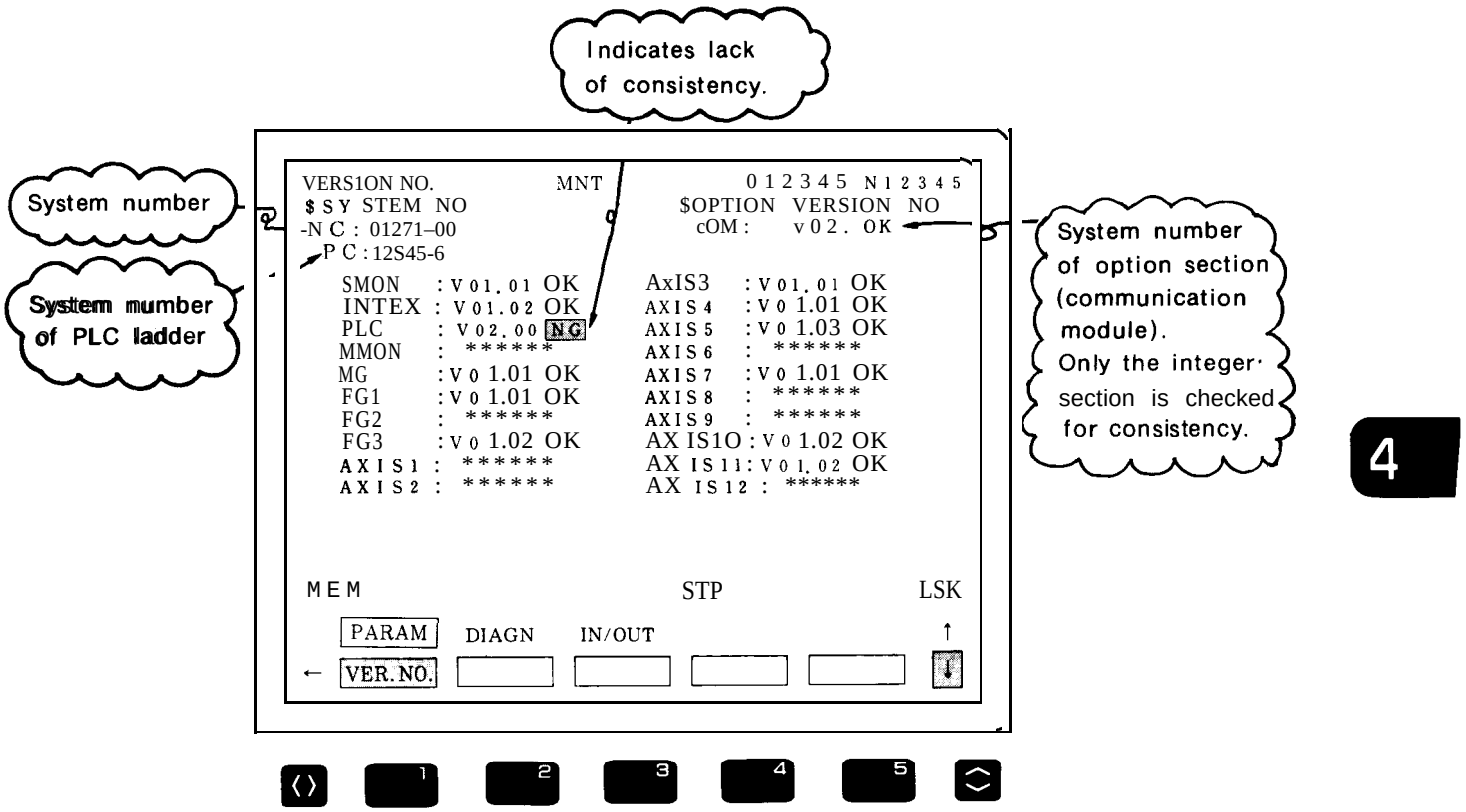

Note **The PLC ladder system number is also displayed in kanji characters. NG portion is reversely displayed. A number exceeding 99 is displayed with a question mark (?).**

Fig. 4.2 Version Number Display Screen

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

CAUTION Only the system number of the NC basic section can be obtained from the screen at power on .

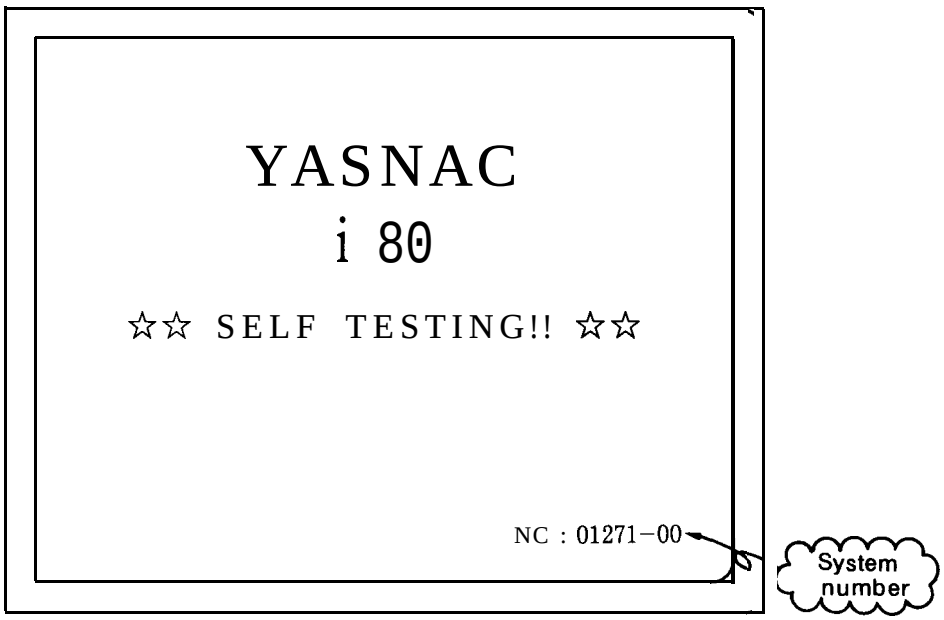


Fig. 4.3 Version Number Display Screen

(6) As required, check whether parameters match the list supplied with YASNAC i80.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.2 TROUBLESHOOTING BY ALARM CODES

This description covers the troubles displayed by alarm codes that were recognized by diagnostic function of NC unit during normal operation.
For details, refer to Section 8 of the Appendix “List of Alarm Codes " , which is separate from the YASNAC i80M or L instruction manual.
Especially difficult troubles are explained in Section 8 of the Appendix which is separate from this manual.

4.2.1 DISPLAY METHOD

When an alarm occurs, the number of the highest order alarm and a comment are displayed on the stationary display field at the bottom of the CRT screen regardless of the mode and selected screen display. For stationary display, refer to Par. 3.4.1 of the YASNAC i80M or L operation manual. In this case, detailed information of the alarm can be displayed by the following operations:

<Operation>

1. Depress the 0 COMN key.

   – The common screen will be displayed.

2. Depress the ALARM 2 job selection soft key.

   → The alarm job is selected. Select alarm function or users function which is displayed on the stationary display field.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


Table 4.1 Classification by Alarm Number

No.	Explanation	stop	output	Reset, Method, Remarks
#0000 to #0049	Error related to editing and operation, error occurring even in BG	Block stop	Input error, alarm	Reset
#0050 to #0099	Error related to editing and operation, error not occurring in BG	Block stop	Input error, alarm	Reset. Power off in case of #0050 and #0051
#0100 to #0499	Program error	Block stop	Input error, alarm	Reset
#1000 to #1099	Program error, DNC, CMOS total, etc.	Block stop	Input error, alarm	Reset
#2000 to #2199	Machine error, OT, reference point return, machine setup completed, imposition, etc.	Coasting to a stop or immediate stop	Alarm	Reset after removing the cause. In case of "machine setup completed", a reset is automatically made when the power is first turned on.
#3000 to #3299	Servo, spindle related ESP, CPU mutual monitoring	Immediate stop servo off	Alarm	Reset after removing the cause. For SVOFF, a reset is automatically made at SVON.
#8000 to #8049	Memory check error, watchdog timer error, offline error	Immediate stop servo off	Alarm	For maintenance Halt each CPU. Switch to the maintenance screen.
#9000 to #9049	Error occurring during BG operations (basically the same as 0000 to 0049)	Not stopped	BG error output	Soft key reset or reset
No. Missing BAT Indication BAT. AXIS	Battery error Encoder alarm	Not stopped	None	Replace the battery.
No. Missing Warning Message	Wrong key operation, minor editing operation error	Not stopped	Warning	Next key operation

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.2.1.1 ALARM INDICATION JOB

Job Selection Soft key
(ALARM)

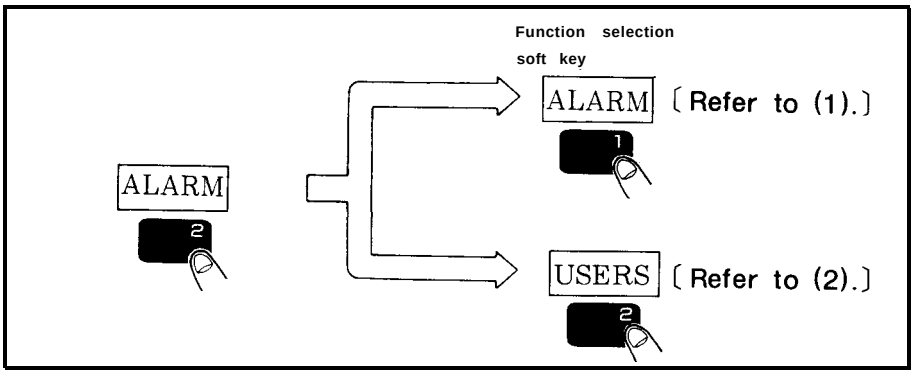

Depressing the job selection soft key ALARM causes either of the following functions to be displayed:


- **Alarm function [refer to (1)]**
- **Users' function [refer to (2)]**

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(1) Alarm Function

Depressing the 

fun ction selection soft key causes all alarms to be displayed.

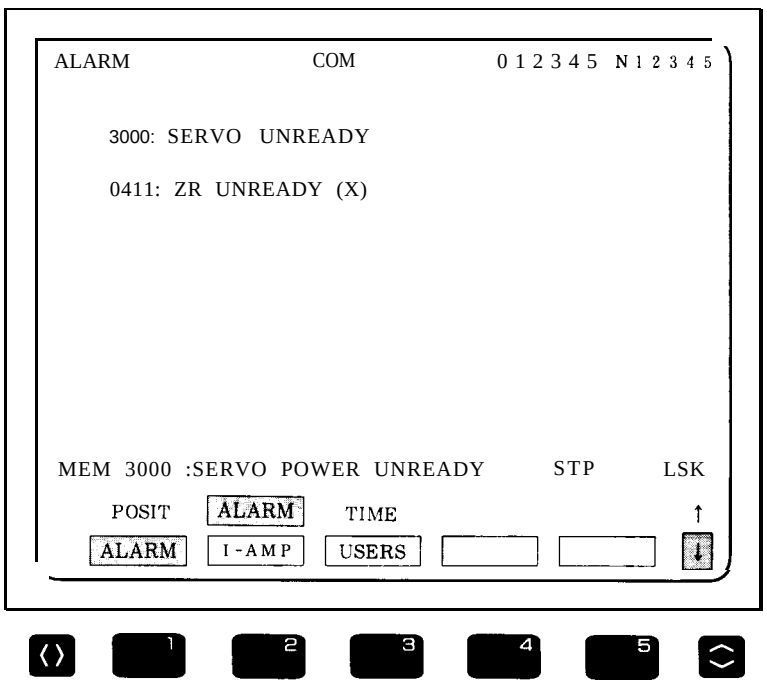

Note **See (2) for the following:**
Sequence error 0: 1080
1: 2180
2: 3240

Fig. 4.4 Alarm Function Screen

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(2) **Users' Function**

Depressing the USERS 2 function selection soft key causes the users' function screen to be displayed. Use ^ or v key for switching of pages.

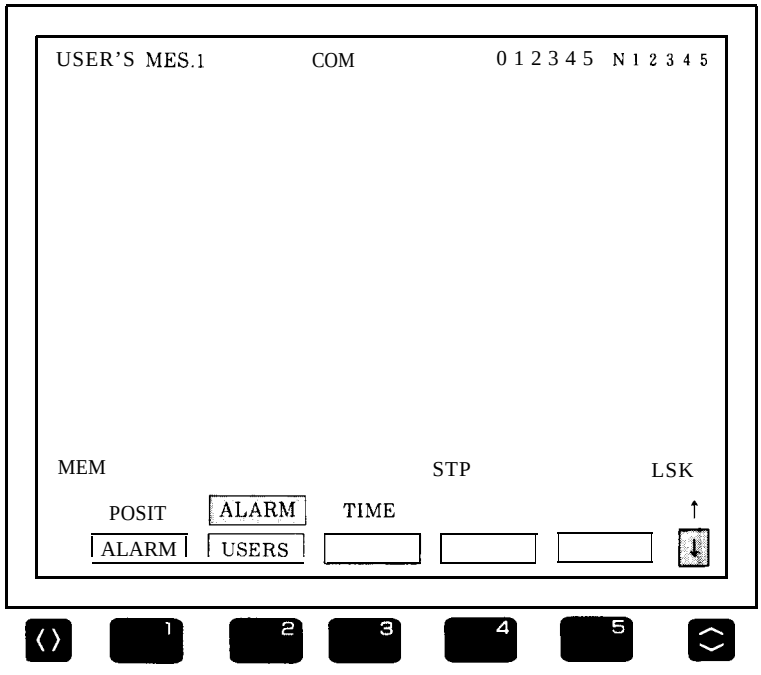


Fig 4.5 Users Function Screen

CAUTION


These troubles are concerned with machine sequence.
For details, refer to the manuals prepared by the machine manufacturer.

Eliminate the cause of the alarm and depress the RESET key, and the alarm state and the alarm display will be reset.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.2.2 ALARMS 0010 AND 0011 (PARITY ERROR)

Table 4.2

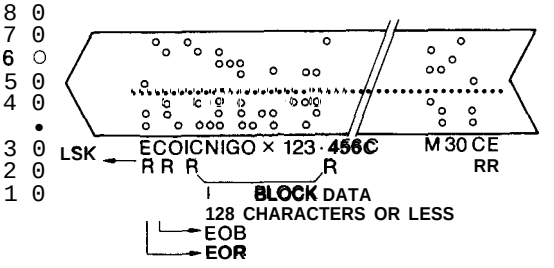Cause of Trouble	Check Method	Solution
Alarm 0010 (TH Error)	1) In case of tape operation: The number of data holes for each character is checked on the NC tape. An alarm is issued when the number is: Even: For EIA tape Odd: For 1S0 tape (The description that follows applies to the EIA code.)  	• Clean tape reader. • Check tape itself if the feed hole is faulty and/or the nap is raised on the hole. • Failure of tape reader itself
	2) In case of memory operation or at time of EDIT, failure in program area.	Failure of JANCD-FC200 board or of expansion memory board (FC120 board)
Alarm 0011 (TV Error)	In case of tape operation: The tape should be capable of TV check. (Number of characters for one block should be even, including EOB.)	If the tape cannot perform TV check, use it by setting SET pm0004 D_1 = O, pm0002 D_1 = O (TV check OFF) or make it so that it can perform TV check.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.2.3 ALARMS 0016,0017,0018,9016, 9017 AND 9018 (RS-232C ERROR)

Cause of Trouble	Check Method	Solution
Alarm 0016 9016 (Communication Error)	Communication error of RS-232C (ex. too rich noise level)	• Check cable grounding.
Alarm 0017 9017 (Overrun)	After RS-232C interface stop code was output, more than 10 characters were read.	
Alarm 0018 9018 (Line Selection)	RS-232C interface line was erroneously selected.	• Check the specifications of RS-232C equipment • Check parameters.

Note **0017 and 9017 are online and offline codes, respectively, For example, online trans - mission error is indicated by 0017 and offline transmission error is indicated by 9017.**

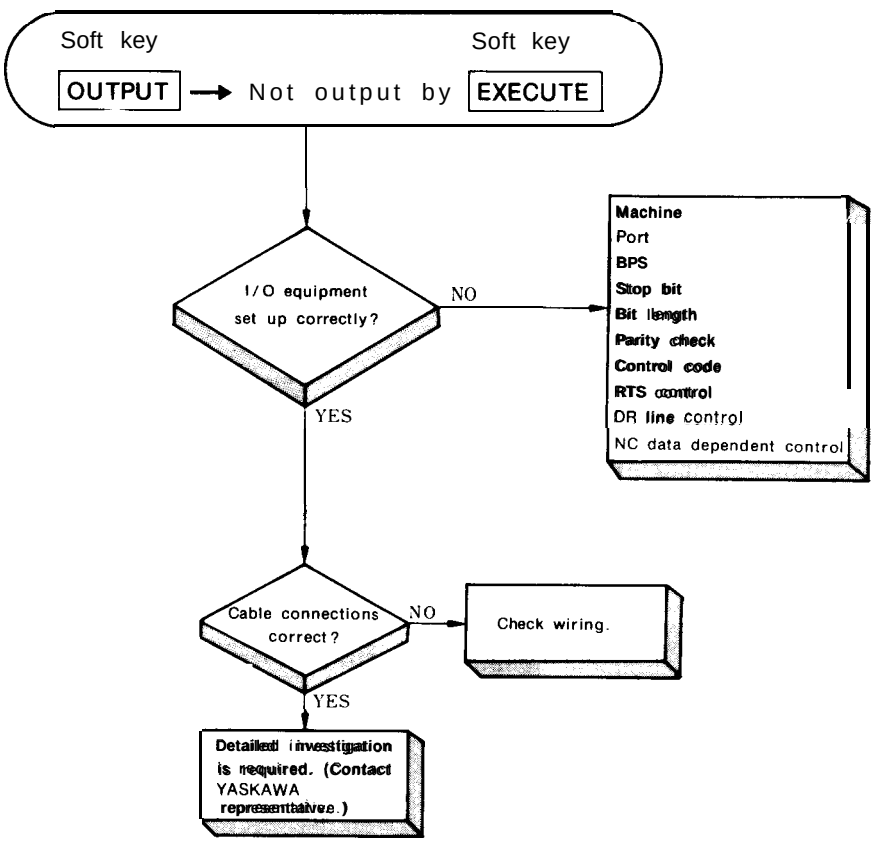


Fig. 4.6 RS-232C Interface Troubleshooting Flowchart

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

.Setting of Applicable Interface
Set the data transmission baud rate, stop bit length, and control code sending command specifications.

<Operation>

❑ Depress the MAINT key.

❑ Depress the IN/OUT 3 job selection soft key.

– The 1/O verification job is selected.

❑ Depress the RS-232C 5 function soft key.

– Select the 1/O equipment setup function.

❑ Set parameters one after another interactively.

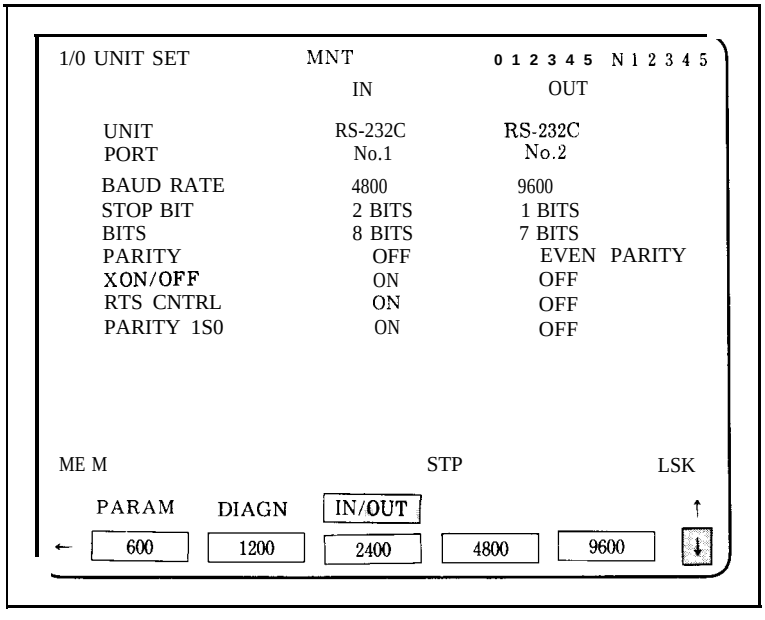


Fig. 4.7 Setting of Serial Interface

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Table 4.3 shows settings of serial interface.

Table 4.3 Settings of Serial Interface

Menu Item	Input	output
UNIT	YE tape reader	YE tape puncher
	General-purpose RS-232C	General-purpose RS-232C
PORT	First	First
	Second	Second
BAUD RATE	75	75
	150	150
	300	300
	600	600
	1200	1200
	2400	2400
	4800	4800
	9600	9600
STOP BIT	1 bit	1 bit
	2 bits	2 bits
BIT LENGTH	7 bits	7 bits
	8 bits	8 bits
PARITY	Even parity	Even parity
	Odd parity	Odd parity
	Without	Without
CONTROL CODE	With	With
	Without	Without
RTS CONTROL	With	With
	Without	Without
PARITY ISO	With	With
	Without	Without

Note The two RS-232C ports cannot be used at the same time. Set the first and the second ports separately.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

For example, to switch from the first port to second port:

- ❑ Put the cursor on the port to switch to.
- ❑ Depress the operation selection key .
- ❑ 1 Depressing the desired soft key writes data to the cursor position determined above.

Table 4.4 shows RS-232C voltage levels and Table 4.5 shows RS-232C interface connection cables.

Table 4.4 RS-232C Voltage Levels


	$V_0 < -3$ V	$V_0 < +3$ V
Function	OFF	ON
Signal Status	Mark	Space
Logic	1	0

Table 4.5 Connection Cable (A) for Terminal Connection RS-232C Interface

NC Side (D B-9P)			Connection	External Equipment
Symbol	Signal	Pin No.		Symbol
FG	Frame Grounding	1		FG
SD	Send Data	2		SD
RD	Receive Data	3		RD
RS	Send Request	4		RS
Cs	Sendable	5		Cs
DR	Data Set Ready	6		DR
SG	Signal Grounding	7		SG
ER	Data Terminal Ready	9		$\overline{\text{IO BUSY}}$
				ER

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Fig. 4.8 shows connection example of standard RS-232C tape reader.

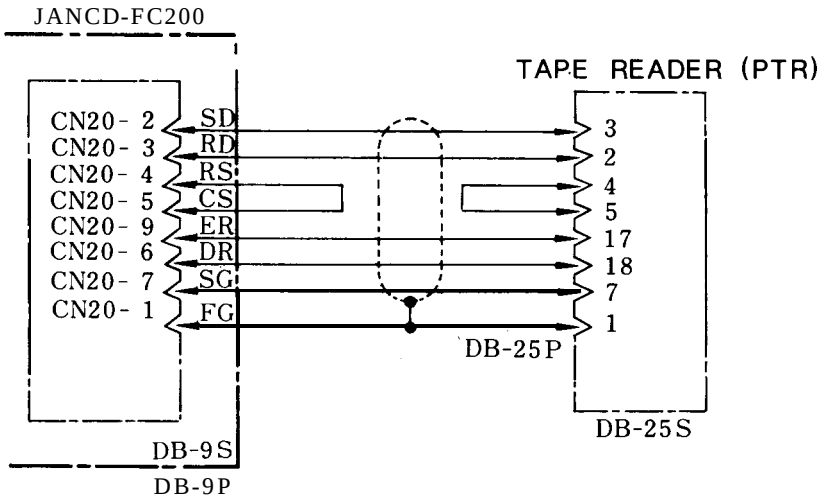

4

Note **Keep cable length from tape reader to main board (model JANCD-FC200) less than 3m. Contact your YASKAWA representative in advance if it is necessary to exceed 3m.**

Fig. 4.8 Exampleof 1st RS-232C Interface

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.2.4 ALARM 1099 (TEMPERATURE ALARM INSIDE THE PANEL)


Table 4.6

Cause of Trouble	Check Method	Solution
Ambient temperature of NC rack exceeded the specified value (70 "C ± 3 "C) by measuring at top of CPS-12N or CPS-16F as a result of fan failure.	• Open NC panel door and ensure that the fan runs normally. • Ensure that air comes out of exhaust port at the cooling duct. • Ensure that air intake port of cooling duct is not blocked.	• Replace the fan if faulty. Call our service personnel Yaskawa representative (YASREP). • If cooling duct is clogged, remove the cause of clogging and restart the operation.
Failure of power supply unit (CPS-12N or CPS-16F) Temperature detector is built inside the power (supply unit.)	• Turn OFF power supply, open the door of NC panel and cool it for about 30 min. If the alarm still lights.	l'he power supply unit must be NC placed. Contact Yaskawa representative (Y ASREP).
Ambient temperature of NC panel is too high. (Applicable temperature range is O ℃ to +40 'C.)	• Measure the ambient temperature. • The temperature may rise if NC panel is exposed to direct rays of the sun.	• Reduce the effects of temperature rise by shielding the NC unit, etc.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.2.5 ALARMS 2061 TO 2068 (ZERO POINT RETURN AREA ERROR)

Table 4.7

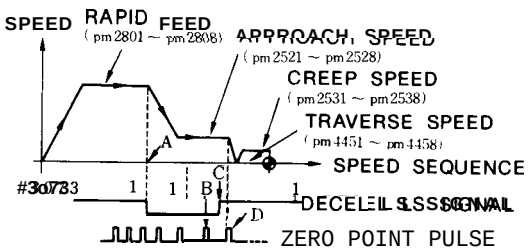Cause of Trouble	Check Method	Solution
Zero point return start position was at zero point side rather than at deceleration LS side	Try zero point return again while observing the deceleration LS DECLS: DGN #3073 D_0 (1st-axis) #3073 D_1 (2nd-axis) #3073 D_2 (3rd-axis) #3073 D_3 (4th-axis) #3073 D_4 (5th-axis) #3073 D_5 (6th-axis) #3073 D_6 (7th-axis) #3073 D_7 (8th-axis) As shown below an alarm results when zero point return is made between DECLS and zero point. Note that this error check can be performed only after power supply is turned OFF and the manual return to zero point has been completed. 	Return it to the deceleration LS or try the zero point return again from a more distant point.
Final distance of zero point return is too short, or, approach speed is too fast.	Perform the zero point return by jog feed. Try to change parameter for final distance. Compare the parameter for approach speed with parameter list.	Make final distance (parameter) longer: • PRM pm4451 to pm4458 • Approach speed: pm2521 to pm2528

4

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.2.6 ALARMS 2071 TO 2078,2081 TO 2088 (REFERENCE POINT RETURN AREA ERROR)

Table 4.8

Cause of Trouble	Check Method	Solution
This type of alarm results when reference point return performed manually. It also occurs by reference point return at low speed due to DECLS chattering. Occurs at high speed by error or reference point pulse.	Observe DECLS chattering: [/0 Signal #3073 D_0 (1st-axis) #3073 D_1 (2nd-axis) #3073 D_2 (3rd-axis) #3073 D_3 (4th-axis) #3o73 D_4 (5th-axis) #3073 D_5 (6th-axis) #3073 D_6 (7th-axis) #3073 D_7 (8th-axis) Observe reference point pulse: [/0 Signal In case of i80M #3610 D_6 (1st-axis) #3611 D_6 (2nd-axis) #3612 D_6 (3rd-axis) #3613 D_6 (4th-axis) #3614 D_6 (5th-axis) In case of i80L #3620 D_2 (1st-axis) #3621 D_2 (2nd-axis) #3622 D_2 (3rd-axis) #3623 D_2 (4th-axis) to to #3627 D2 (8th-axis)	Adjustment of replacement of LS • Failure of module JANCD-FC800 Replace AC servo drive. Replace FC300B board. Replace AC motor. Replace PG cable.
The alarm occurs at automatic reference point return.	In case of G28 : Same as above	Same as above
	In case of G27 : Programmed position differs from reference point.	Check the program.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.2.7 ALARMS 2101 TO 2108 (P-SET ERROR)

P-Set Error results when difference between command position and machine position does not fall within parameters pm1321 (1st-axis) to pm1328 (8th-axis) at the time of completing positioning with G00, G27, G28, G29 and G30.
Check is also required at the time of ERROR DETECT ON (Input signal 3004 D_4 = 1, In i80L multi-program system, #3054 D_4 = 1 for the second program, #3064 D_4 = 1 for the third program) and G04 (dwell).

Table 4.9

Cause of Trouble	Check Method	Solution
Machine runs too heavy.	Observe reference torque by using monitor board.	Lighten machine load.
Servo error pulse exceeds setting range.	Check error pulse in the error pulse display.	FC300B or AC servo drive unit may be defective. Contact your YASKAWA representative.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.2.8 ALARM 3000 (SERVO UNREADY)

Table 4.10

Cause of Trouble	Check Method	Solution
Secondary power supply is not applied.	This is a normal result when depressing NC RESET after primary power application, or resetting emergency stop alarm, " etc.	Depress POWER ON button again.
In case of automatic servo power application 1/0 input specification is not activated by secondary power supply.	Ensure that it is set to 1/0 Signal #3005 $D_0 = 1$ (SVON) #3503 $D_0 = 1$ (SVONS)	Check wiring and sequence.
Emergency stop input.	Check if ALM3002 displays, or #3503 $D_4 = 1$.	Reset emergency stop input.
Secondary power supply was tripped by other alarm.	Check for other alarm display.	Take corrective action according to alarm code.

4.2.9 ALARM 3001 (CONTROL NOT READY)

This type of alarm results when position lag exceeds the range of pm1321 (lst-axis) to pm1328 (8th-axis) after power application and self-diagnosis.


Table 4.11

Cause of Trouble	Check Method	Solution
Machine is running	Select ERROR PULSE display screen from common process current value display and read the values of X-, Y-, Z-, 4th and 5th. axis.	This is a problem of the machine side rather than failure of NC unit. Contact machine manufacturer.
PG signal keeps feeding.		Replace PG or servo. Contact your YASKAWA representative.
FC300B failure		Replace FC300B. Contact your YASKAWA representative.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.2.10 ALARM 3002 (EMERGENCY STOP)

Table 4.12

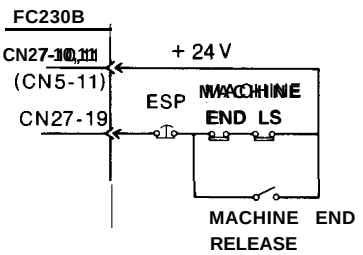Cause of Trouble	Check Method	Solution
Emergency stop button depressed, or, machine end LS is out of place.	After ensuring I/O signal #3500 D_2 = O (during emergency stop), check continuity of emergency stop button or machine end LS shown below. For correct connection, refer to connection diagram prepared by machine manufacturer. 	Reset the emergency stop button. Release it from machine end LS according to instruction manual prepared by machine tool manufacturer.
Failure of FC230B or FC260	This FC230 failure if alarm 3002 lights even at #3500 D_2 = 1	Replace FC230B or FC260. Contact your YASKAWA representative.
Drop of +24 V power voltage	Check +24 VDC power. If the voltage is below +20 V, it indicates possible trouble.	Replace CPS-12N or CPS-16F (power supply unit). Contact your YASKAWA representative.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.2.11 ALARMS 3041 TO 3048 (EXCESSIVE POSITION LAG)

Excessive position lag results when the lag of machine to command value exceeds 120% at 100% rapid traverse rate.

Table 4.13

Cause of Trouble	Check Method	Solution
Motor load is too large and movement command is too small. e.g. • Excessive drilling load • Machine requires lubricant. • Program error causes tool/work contact.	• Observe motor current or torque monitor if alarm occurs during idle running ⊕/⊖ direction at jog or rapid mode after turning ON the power. • Check oil film on slide surface of machine and check oil level in tank.	Restart operation if machine remove the trouble.
Torque is not applied.	• Check torque limit parameters (pm1671 to pm1678, pm1681 to pm1688) signal. • Check torque reference on monitor board.	• Correct torque limitation. • Replace AC SERVOPACK. • Replace the motor
Wiring failure	Check wiring. Refer to Connecting Manual (T0E-C843-11.5).	Refer to Connecting Manual Par. 11. Connection of Feed Servo Unit.
The movement distance per motor rotation is specified incorrectly.	Feed at low speed such as in handle mode, etc. It will be normal if the actual movement distance equals the position display change distance.	Determine correct movement distance (pm1821 to pm1828) per motor rotation from gear ratio and ball-type screw pitch.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.2.12 ALARMS 3051 TO 3054 (EXCESSIVE POSITION LAG)

Excessive position lag results when the lag of machine to command value exceeds parameter pm1351 to pm3054.

Table 4.14 Alarms 3051 to 3054 (Excessive Position Lag : spindle)

Cause of Trouble	Check Method	Solution
Motor load is too large and movement comman is too small. e.g. • Excessive drilling loa • Machine requires lubricant. • Program error causes tool/work contact.	• Observe motor current or torque monitor if an alarm occurs during idle running ⊕/⊖ direction (forward/ reverse) at log or rapid mode after turning ON the power. • Check oil film on slide surface of machine and check oil level in tank.	If the cause is in the machine, correct the trouble and restart operation.
Torque is not applied.	• Check torque limit signal. • Check torque monitor and motor current. (For details, refer to the spindle controller manual.)	• Correct torque limitation. • Replace spindle drive. • Replace the spindle motor.
D/A circuit failure (output continues)	With the check connector CN3D of model JANCD-FC31O (or FC260) board, check that output voltage changes according to command. A3 (O V) between A5 and A3 of 1st spindle and between Al and A3 of 2nd spindle.	Replace model JANCD-FC310 (or FC260) board.
Failure of spindle controller (speed command continues)	Refer to the instruction manual of spindle drive.	Replace the spindle controller unit.
Wiring failure	Refer to Section 12 of YASNAC i80 Connecting Manual (TOE -C843-11.5).	Refer to Section 12 of YASNAC i80 Connecting Manual (TOE-C843-11.5).
Incorrect setting of PG magnification	Determine correct PG magnification from PG pulse count, gear ratio, ball-type screw pitch and compare it with parameter pm1053 to pm1056.	Set correct PG magnification.
Too low setting of Kp (position loop gain) causes excessive positior lag. ---		If the setting is much smaller than the standard value set by machine manufacturer, enlarge parameter pm1417 (1st-spindle axis), pm1437 (2nd-spindle axis), pm1457 (3rd-spindle axis) and pm1477 (4th-spindle axis). See Section 5 for Kp adjustment method. For details, contact machine manufacturer.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.2.13 ALARMS 3061 TO 3068 (MOTOR OVERLOAD)

Table 4.15

Cause of Trouble	Check Method	Solution
Cutting condition is too severe.	Did it occur during drilling and/or threadcutting ?	Wait until temperature of servo motor cools down. Then, restart operation by alleviating the condition.
Machine runs heavily due to shortage of lubricant on the guide face of machine.	Check the oil film on the guide face.	Check oil tank and oil pipe according to instruction manual of machine.
AC servo drive unit or FC300B failure	Motor overload alarm activates even if wiring is correct. It may cause an alarm.	Replace AC Servo drive unit or FC300B board. Contact your YASKAWA representative.

4.2.14 ALARMS 3081 TO 3088 (PG DISCONNECTION ERROR)

Signal wire disconnection check of A and B phases from PG.

Table 4.16

Cause of Trouble	Check Method	Solution
Disconnection or contact failure of signal wire between NC unit and AC servo drive unit	• Check for looseness and removal of FC300B board's connectors CN30, CN31, CN32. • Check looseness and removal of AC servo drive unit connectors. • Perform wiring check according to Connecting Manual (TOE-C843-11.5).	• Correct looseness and/or removal of connectors. • Correct wiring as necessary.
Failure of PG detector circuit connection	This type of alarm results when main power is applied though result of check for above items are normal.	Replace FC300B. Contact your YASKAWA representative.
Motor model parameter setting error.	Check if "O" is set to motor model parameter (pm1061 to pm1068).	Set the motor model parameter (pm1061 to pm1068) correctly.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.2.15 ALARMS 3091 TO 3094 (SPINDLE PG DISCONNECTION ERROR)

Signal wire disconnection of A, B, and C phases from spindle PG.

Table 4.17 Alarm 3091 (Spindle PG Disconnection Error)

Cause of Trouble	Check Method	Solution
Disconnection or contact failure of signal wire between NC unit and spindle controller	• Check for looseness and removal of model JANCD-FC31O board connectors CN34 (spindle FB). • Check for looseness and/or removal of spindle controller. • Perform wiring check according to Connecting Manual (T OE-C843-11 .5).	• Correct for looseness and/or removal of connectors. • Correct wiring as necessary.
No shorting plug connector even without spindle PG.	Shorting plug connector to CN34 or CN36 (with 2nd spindle) at model JANCD-FC31O board is required for such specifications without spindle PG.	Mount shorting plug connector.
Failure of PG detector circuit connection	Check whether this alarm occurs when main power is applied even though results of check for above items are normal.	Replace FC31O (or FC260). Contact your YASKAWA representative.
PG failure	If alarm occurs at slow rotation, PG may be defective.	Replace PG.

4.2.16 ALARMS 3121 TO3128 (EXCESSIVE SPEED)

These alarms are detected when a command for excessive speed is issued and motor rotation speed exceeds 1.2 times the maximum rotation speed.

Table 4.18 Alarms 3121 to 3125 (Excessive Speed)

Cause of Trouble	Check Method	Solution
Erroneous wiring of motor	Check wiring according to YASNAC i80 Connecting Manual (T OE-C843-11 .5).	If erroneous wiring is found, correct the wiring.
Erroneous wiring of encoder	Check wiring according to YASNAC i80 Connecting Manual (TOE-C843-11.5).	If erroneous wiring is found, correct the wiring.
The movement distance per motor rotation is specified incorrectly.	Feed at low speed such as in handle mode, etc. It will be normal if the actual movement distance equals the position display change distance.	Determine correct move ment distance (pm1821 to pm1825) per motor, rotation from gear ratio and ball-type screw pitch.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.2.17 ALARMS 3141 TO 3148 (PREVENTION OF UNCONTROLLED RUNNING)

These alarms detect uncontrolled running due to erroneous wiring of the motor or encoder.

Table 4.19 Alarms 3141 to 3145 (Prevention of Uncontrolled Running)

Cause of Trouble	Check Method	Solution
Failure of model JANCD-FC300B board	Check whether the alarm is caused merely by application of control power.	Replace model JANCD-FC300B board.
Erroneous wiring of motor	Check wiring according to YASNAC i80 Connecting Manual (T OE-C843-11 .5).	If erroneous wiring is found, correct the wiring.
Erroneous wiring of encoder	Check wiring according to YASNAC i80 Connecting Manual (TOE -C843-11.5).	If erroneous wiring is found, correct the wiring.
New incremental encoder pole sense input signal (phase C) malfunction (by noise)	Check whether alarm occurs often when primary power supply is turned on.	• Restart operation after turning off the power and then turning it on. • Provide some noise prevention.

4.2.18 ALARMS 3161 TO3168 (ABSOLUTE ERRORS)

Malfunction of absolute encoder is detected.

Table 4.20 Alarms 3161 to 3165 (Absolute Errors)

Cause of Trouble	Check Method	Solution
Failure of model JANCD-FC300B board	Check whether the alarm is caused merely by application of control power.	Replace model JANCD-FC300B board.
Erroneous wiring of encoder	Check wiring according to YASNAC i80 Connecting Manual (TOE-C843-11 .5).	If ecconeous wiring is found, correct the wiring.
Malfunction of absolute encoder	Check whether alarm lamp goes out after power is turned off, then on again.	Restart operation after turning power off, then on again.
Malfunction of absolute encoder	Check whether the wiring of absolute encoder is correct and alarm occurs.	Retry setup of absolute encoder.
Backup-battery defective or not con-netted	Check whether battery alarm occurs at the same time.	Connect or replace backup battery.
Fault of absolute encoder	Check whether alarm occurs although all of the above check items are satisfied.	Replace the motor.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.2.19 ALARMS 3181 TO 3188 (POSITION ERRORS)

Malfunction of PG pulse counter inside absolute encoder is detected.

Table 4.21 Alarms 3181 to 3188 (Position Errors)

Cause of Trouble	Check Method	Solution
Failure of model JANCD-FC300B board	Check whether the alarm is caused by mere application of control power.	Replace model JANCD-FC300B board.
Erroneous wiring of encoder	Check A, B, and C phase pulses using monitor board.	If erroneous wiring is found, correct the wiring.
Malfunction of PG pulse counter inside absolute encoder (due to noise)	Check whether the alarm occurs frequently during operation.	• Restart operation after turning power OFF, then ON again. • Take appropriate corrective action for noise.

A
a

4.2.20 ALARMS 3201 TO 3208 (SERVODRIVE UNIT COMMUNICATION ERRORS)

Serial communication error between NC and AC servodrive unit is detected.

Table 4.22 Alarms 3201 to 3208 (Servodrive Unit Communication Errors)

Cause of Trouble	Check Method	Solution
Erroneous wiring	Check wiring according to YASNAC i80 Connecting Manual (TOE-C843-11.5).	Refer to Section 11 of YASNAC i80 Connecting Manual (TOE-C843-11.5) and correct the wiring.
Wrong setting of AC servo drive unit ID switch	Check setting of ID switch of AC servo drive unit according to YASNAC i80 Connecting Manual (TOE-C843-11.5).	Refer to Section 11 of YASNAC i80 Connecting Manual (TOE-C843-11.5) and correct the setting.
Defective AC servodrive unit or model JANCD-FC300B board	Check whether the alarm occurs when the wiring and ID switch are not erroneous.	Replace model JANCD-FC300B board or AC servo drive unit. Contact your YASKAWA representative.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.2.21 ALARMS 3301 TO 3305 (OVERCURRENT)

Table 4.23 Alarms 3301 to 3305 (Overcurrent)

Causeof Trouble	Check Method	Solution
Control board fault	Alarm occurs immediately after control power is turned ON.	Replace SERVOPACK.
Current feedback circuit error	Alarm occurs after main power is turned ON. MCCB is not tripped.	Replace SERVOPACK.
Main circuit transistor module error	Alarm occurs after main power is turned ON.	Replace SERVOPACK.
Motor grounding	Alarm occurs after main power is turned ON. MCCB is tripped.	Replace motor.

4.2.22 ALARMS 3311 TO 3315 (MCCB TRIP)

Table 4.24 Alarm s 3311 to 3315 (MCCB Trip)

Causeof Trouble	Check Method	Solution
Control board fault	Alarm occurs immediately after control power is turned ON.	Replace SERVOPACK.
Main circuit thyristor-diode module error	Alarm occurs after main power is turned ON.	Replace SERVOPACK.
MCCB failure	Alarm occurs after main power is turned ON.	Replace SERVOPACK.

4.2.23 ALARMS 3321 TO 3325 (REGENERATIVE ERROR)

Table 4.25 Alarms 3321 to 3325 (Regenerative Error)

Causeof Trouble	Check Method	Solution
Control board fault	Alarm occurs immediately after control power is turned ON.	Replace SERVOPACK.
Regenerative transistor error	Alarm occurs 0.5 to 1 second after main power is turned ON. MCCB is not tripped.	Replace SERVOPACK.
Wire break in regenerative resistor	Alarm occurs after main power is turned ON.	Replace SERVOPACK. Check regenerative resistor and replace if necessary.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.2.24 ALARMS 3331 TO 3335 (OVERVOLTAGE)

Table 4.26 Alarms 3331 to 3335 (Overvoltage)

Causeof Trouble	Check Method	Solution
Excess load $GD_2(WK_2)$	Alarm occurs when motor is started or slowed down.	Check load machine inertia converted into motor axis.
Regenerative processing circuit error	Alarm occurs when motor is started or slowed down.	Replace SERVOPACK.

4.2.25 ALARMS 3341 TO 3345 (UNDERVOLTAGE)

Table 4.27 Alarms 3341 to 3345 (Undervoltage)

Cause of Trouble	Check Method	Solution
Main circuit th yristor-diode module error	Alarm occurs after main circuit power is turned ON.	Replace SERVOPACK.

4.2.26 ALARMS 3351 TO 3355 (HEAT SINK OVERHEAT)

Table 4.28 Alarms 3351 to 3355 (Heat Sink Overheat)

Cause of Trouble	Check Method	Solution
Control board fault	Alarm occurs immediately after control power is turned ON.	Replace SERVOPACK.
Fan stops	Alarm occurs during operation. (If control power is turned OFF and then immediately turned ON again, alarm remains ON. Operation can be restarted only if system is reset after a while.)	Check whether fan is running.
High ambient temperature near SERVOPACK (over 55°C 131°F)	Alarm occurs during operation. (If control power is turned OFF and then immediately turned ON again, alarm remains ON. Operation can be restarted only if system is reset after a while.)	Take necessary action to lower servopack ambient temperature.
Motor circuit connection error	Motor turns at low torque. Alarm occurs after a while.	Connect properly.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.2.27 ALARMS 3361 TO 3365 (WIRE BREAK IN CURRENT INSTRUCTION CABLE)

Table 4,29 **Alarms 3361 to 3365 (Wire Break in Current Instruction Cable)**

Cause of Trouble	Check Method	Solution
Control board fault	Alarm occurs immediately after control power is turned ON.	Replace SERVOPACK.
Wire break or connection error between NC and SERVOPACK	Alarm occurs immediately after control power is turned ON.	Connect properly.
Other alarm (not really wire break in current instruction cable)	There is another alarm.	Correct causal alarm.

4.2.28 ALARMS 3371 TO 3375 (OPEN PHASE)

Table 4.30 Alarms 3371 to 3375 (Open Phase)

Causeof Trouble	Check Method	Solution
Control board fault	Alarm occurs 'immediately after control power is turned ON.	Replace SERVOPACK.
Imperfect connection of 3-phase power supply	Alarm occurs after main power is turned ON. MCCB is not tripped.	Connect properly.





Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.3 TROUBLESHOOTING WITHOUT ALARM CODES

The following examples are instructions for locating and correcting the troubles not indicated by alarm codes. For further details of signal meanings expressed by the address DGN , refer to Section " Details of Signals" in Connecting Manual. (TOE-C843-11. 5)

4.3.1 POWER CANNOT BE SUPPLIED

Table 4,31
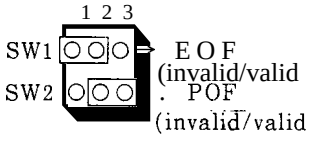
<table>
<tr><th>Cause of Trouble</th><th>Check Method</th><th>Solution</th></tr>
<tr><td>No power supplied to NC unit.</td><td>insure that SOURCE LED (green) of DC power supply (CPS-12N or -16F) inside CPU module ights.</td><td>Check molded-case circuit breaker or NC panel and also connector CN05 of CPS-12N or -16F.</td></tr>
<tr><td>Alarm LED of CPS-12N or-16F lights.</td><td>CPS-12N or -16F LED Display
<table><tr><th></th><th>Signal Name</th><th>Display</th><th>LED Color</th><th>Function & Cause</th></tr><tr><td>Nor-mal</td><td>Power supply status</td><td>SOURCE</td><td>Green</td><td>Lights when AC power is on, out when power is off.</td></tr><tr><td></td><td>Power on status</td><td>POWER ON</td><td>Green</td><td>Lights when SOURCE input above 170 VAC at NCMX ON.</td></tr><tr><td>Trou ble Dis-play</td><td>+5 v Trouble
+12 V Trouble
-12 V Trouble</td><td>+5 v, ±12 v</td><td>Red</td><td>Lights at +5 V overvoltage or overcurrent.
Lights at +12 V overvoltage or 12 V undervoltage.</td></tr><tr><td></td><td>+24 V Trouble</td><td>+24 V</td><td>Red</td><td>Lights at +24 V overvoltage or overcurrent.</td></tr><tr><td></td><td>Exter-nal Trouble</td><td>OHT/ EXT</td><td>Red</td><td>Lights with external EXALM signal, and overheat.</td></tr></table>Note LED lights for external trouble (EXT) when CN05 connector between 4 and 7 short-circuits.</td><td>When trouble in Table on the left is displayed by LED, correct the trouble, then, turn ON power again. If the trouble is not corrected by this procedure, trouble may be in the power unit. Contact your YASKAWA representative (YASREP).
If overcurrent causes the trouble and the cause is removed, the power supply can be turned on again after it is turned off.
Unless the main circuit breaker is turned off and then on, the power supply cannot be turned on again even if the cause has been removed since the alarm circuit in the CPS cannot be reset.</td></tr>
<tr><td>Power ON/OFF Switch is not set properly.

(Set at factory prior to shipment)</td><td>SW1 and SW2 Settina
<table><tr><th></th><th>Use panel (POF) only</th><th>Use external device (E OF) only</th><th>Use both</th></tr><tr><td>SW5
Swl
SW2</td><td></td><td></td><td></td></tr></table></td><td>Set correctly shorting plug SW1 and SW2 at left corner on JANCD-FC230B or FC260</td></tr>
</table>

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.3.2 SOLUTION TO ERRORS DETECTED IN SELF-DIAGNOSIS

Table 4.32 Solution to Errors Detected in Self-Diagnosis

Cause of Trouble	Check Method	Solution
Error identified by self-diagnosis	• Both diagnostic items passed and the diagnostic item leading up to the error are displayed and the NC unit stops. • CPU cannot function normally and this is a major failure. The main system shuts off the servo power, but, depress the emergency stop and power OFF buttons to check for proper AC input voltage and ensure power is OFF.	• Record the diagnostic item leading up to NC unit stop, turn on power again and contact your YASKAWA representative. • Remove any noise source near the NC unit. Turn on the main power under emergency stop conditions. Contact your YASKAWA representative immediately if it is "CPU ERROR". If normal, start operation after ensuring correct parameters, settings, offsets and programs.

4.3.2.1 SELF-DIAGNOSIS FUNCTIONS

Self-diagnosis functions are:

(1) Memory Check
- .CMOS check
- .ROM check
- .RAM check

(2) System Consistency Check

(3) Operation Monitoring by Software

(4) Operation Monitoring by Hardware

(5) Division Error Detection

(6) LED Display

(7) Processing Program Area, Initialization Check

(8) Expanded Memory Consistency Check

(9) Axis Configuration Parameter Consistency Check

(10) Overheat Detection

(11) Battery Alarm Detection

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.3.2.2 **DETAILS OF FUNCTION**

(1) Memory Check

Backup memory CMOS existing only in model JAN CD-FC200 board and ROM/RAM memory on all CPU boards are self-diagnosed.
Self-diagnosis includes items checked at system startup and after startup.

(a) CMOS Check

(i) Total Check

Total check is made after system startup and CMOS error is detected by total check sum on CMOS memory.
This check is performed or not depending on the system number.

Numbers checked . . . "0" " 1" "2" "4"

When an error occurs in CMOS, the following alarms are generated:

Alarm	
	ALM1090: Setting total check error ALM1091: Parameter total check error ALM1092: Keep memory total check error ALM1093: Offset total check error ALM1094: Macro program variable total check error ALM1095: Processing program total check error

If an alarm occurs for some reason, CMOS data may be destroyed. The alarm can be erased by temporarily writing the data from the CRT control panel, then depressing the RESET key on the control panel.

Note **No alarm can be erased for processing programs.**

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(ii) **Power-off Check**

A check is made at system srartup to see if CMOS data to be backed up from each CPU was saved correctly at previous power off.

This check is performed or not depending on the system number.

Numbers checked . . . "0" "1" "2" "4"

When an error occurs in CMOS, the following alarms are generated:

Alarm	
	ALM3270: power-off error (keep memory) ALM3271: Power-off error (tool life management) ALM3272: Power-off error (macro program) ALM3273: Power-off error (internal memory)

(b) ROM Check

ROM check consists of total check on ROMs of all CPUs, whether at system start up or after startup. When an optional function is added, its memory area is also checked.

This check is performed or not depending on system number.

Numbers checked ... "0" "1" "2" "4"

When an error occurs in ROM, the board in which the error occurs, and its ROM number are displayed

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

CPU in which an error occurs and its ROM number		
	FC190	**190, 191, 192, 193, 194,** 195, **196, 197, 198, 199, 200,** 201, **202. 203**
	FC210	210
	FC222/FC224	**200,** 221**, 222, 223, 224,** 225, **226, 227**
	FC230B	**230, 231**
	FC250/FC251	250, 251 (i80B)
	FC260	260, 261 (i80B)
	FC265	265 (i80B)
	FC240/FC241	240, 245
	FC300B	300
	FC310	**310**

(c) RAM Check

RAM check is performed to see if RAMs of all CPUS operate normally at system startup. RAM check is conducted for all system numbers.
An error is displayed only when the system operates with the following system numbers:

Displayable numbers ... "0" "1" "2"

The CPU in which an error occurred and its RAM number are shown below.

FC200	:	04, 05
FC190	:	BASIC 00~03 , 06~11 OP 12~13
FC210	:	00~02 ISD 04~09
FC222/FC224	:	00-09
FC230B	:	00, 01
FC240/FC241	:	00-05
FC250/FC251	:	00~05 (i80B)
FC260"	:	00~03 (i80B)
FC265	:	00~01 (i80B)
FC300B	:	00-03
FC310	:	00

(2) System Consistency

See (c) of (5) of Par. 4.1.2.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(3) Operation Monitoring by Software

Normal operation of the entire system is monitored by software.

System software checks whether a partner CPU is normally operating among CPUs. If the partner CPU is stopped, an alarm occurs.

Numbers checked . . . "0", "1", "2", "4"

Alarm	ALM3260 : SMON-INTEX Synchronous error ALM3261 : SMON-MMON Synchronous error/ SMON-MOTION Synchronous error (i80B) ALM3262 : MMON-MG Synchronous error ALM3263 : MMON-PLC Synchronous error /MOTION-PLC Synchronous error (i80B) ALM3264 : MG-AXIS Synchronous error/MOTION-AXIS Synchronous error (i80B) ALM3265: ACGC Synchronous error ALM3266 : DNC Synchronous error

(4) Operation Monitoring by Hardware

Normal operation of system software is monitored by hardware. This is performed for specific system numbers.

When system software does not access hardware for a given period, it is regarded as a hardware failure and a hardware monitoring error is displayed.

Numbers checked . . . "0", " 1" , "2", "4"

(5) Division Error

A division error occurring in system software is detected and the entire system is stopped. The address in which the division error occurred is displayed on the screen.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(6) LED Display

Self-diagnosis results are displayed on 7-segment LED on the model JAN CD-FC200 board.

(a) Initial Self-Diagnosis Status Display at Power on

Pass indication is made on the initial self-diagnosis display screen at power on. At the same time, the same number as in the pass indication is displayed on the 7-segment LED.

Self-diagnosis status contents	
	0: Local RAM check path (FC200) 1: Bus gate set path i80 : (FC200, FC210, FC222/FC224, FC230B, FC240/FC241) i80B : (FC200, FC210, FC250/FC251, FC260) 2: A-common RAM check path 3: CPU activation check path among FC200, FC210, FC222/FC224, FC230B and FC240/FC241 (i80) CPU activation check path among FC200, FC210, FC250/FC251, FC260 and FC265 (i80B) 4: Option RAM check path (FC190) & system configuration parameter information transfer path 5: First request path from model JANCD-FC200 6: Operation processor initialization & self-diagnosis 7: Path for supplying a clock to each CPU 8: Parameter common, local RAM transfer path 9: Common and local RAM transfer paths of offset and macro information A: CMOS fixed file check path (screen 10) B: Inter-CPU regular operation check started (screen 11) C: CPU normal mode setup completed (except for FC200) (screen 12). D: CPU normal mode (except for FC200) (screen 13)

(b) System Operation Display

The point of the 7-segment LED blinks about every one second. The system is operating normally while it is blinking.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(c) System Error Indication

When a major error occurs in the system, the entire system is stopped, a system error is displayed on the screen, and the contents are displayed on 7-segment LED as well.

System error display contents	
	1: Watchdog error
	2: ROM check error
	3: Packet communication ID error
	4: Packet communication packet length error
	5: Packet communication check sum error
	6: Packet communication data length error
	7: Packet communication undefined function error
	8: Packet communication undefined command issue error
	9: Packet communication undefined code error
	A: Division error
	B: Undefined interrupt error
	C: File operation error

(7) Processing Program Area, Initialization Check

At power ON, a check is made to see if the processing program area was initialized previously with all system numbers and is available for use.
An alarm occurs when the processing program area was initialized, and when initializatio-n was performed but CMOS destruction may occur due to a weak battery.

Alarm	
ALM3010:	Processing program memory not initialized

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(8) Expanded Memory Consistency Check

When the processing program area is provided with expanded memory, since the memory capacity of memory board varies, a consistency check is performed to prohibit the use of expanded memory in a fault state.

When the processing program area is initialized with all system numbers, a check is made for the same memory length as the expanded **memory** board. Otherwise, an alarm occurs.

Alarm

ALM3011: Processing program expanded memory unmatch

4

(9) Axis Configuration Parameter Consistency Check

After a check is made at power ON for consistency between the configuration of physical axis and axis configuration parameters, if axis parameters determining conditions of system operation are not specified correctly, the operation is prohibited. Detailed explanation follows. A check is made to see if axis type in physical axis information and parameter axis information is specified correctly for feed axis and spindle. A check is made to see if the number of physical axis is greater than the number of parameter axis, and if specification of three axis for one slot is consistent between physical axis and parameters.


Alarm

ALM3012: Axis configuration parameter unmatch

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(1 O) Overheat Detection

Power overheat is always checked after system startup, and upon detection of overheat, an alarm occurs.

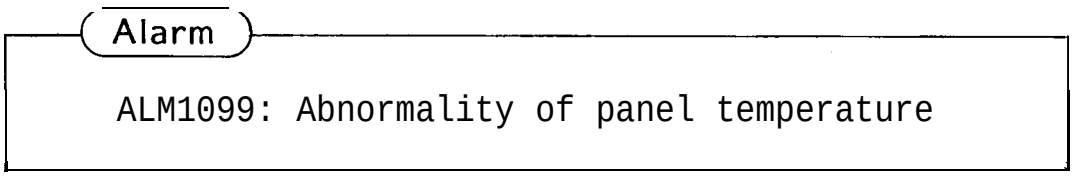

(11) Battery Alarm Detection

Voltage drop due to an exhausted battery is detected after system startup and a battery alarm is displayed on the screen.
Once a battery alarm occurs, alarm indication on the screen is not erased by replacing the battery. Turn power OFF, then ON again.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.3.3 CRT SCREEN DOES NOT DISPLAY

CRT screen may not display any data as a result of trouble of CRT unit itself, display circuit and/or connection cable. If there is no display on the screen even after the NC unit power is applied, check to ensure that the wire is properly connectedto the NC operator's station, connectors are not loose, or fuse inside CRT unit is not blown (referto Par. 4.3.11 9, "CRT SCREEN IS DARK").

Contact your YASKAWA representative, if the trouble can not be located even after the above procedure.

4.3.4 HANDLE MODE OPERATION FAULTY

Table 4.33

Cause of Trouble	Check Method	Solution
HANDLE mode signal not entered.	• 1/0 signal #3000 $D_2 = 1$ Bit set to O ? All other bits (D_0, D_1, D_3 through D_7) must be set to O. • Check the mode indication in the stationary display field on the screen.	Select HANDLE mode. Check mode switch wiring.
Axis selection signal not entered.	Confirm that one optional axis of the Following axes is entered: [/0 signal #3070 $D_0 = 1$ (1st-axis) $D_1 = 1$ (2nd-axis) $D_2 = 1$ (3rd-axis) $D_3 = 1$ (4th-axis) $D_4 = 1$ (5th-axis) $D_5 = 1$ (6th-axis) $D_6 = 1$ (7th-axis) $D_7 = 1$ (8th-axis) • For second handle #3080 $D_0 = 1$ (1st-axis) $D_1 = 1$ (2nd-axis) $D_2 = 1$ (3rd-axis) $D_3 = 1$ (4th-axis) $D_4 = 1$ (5th-axis) $D_5 = 1$ (6th-axis) $D_6 = 1$ (7th-axis) $D_7 = 1$ (8th-axis) • For third handle #3081 $D_0 = 1$ (1st-axis) $D_1 = 1$ (2nd-axis) $D_2 = 1$ (3rd-axis) $D_3 = 1$ (4th-axis) $D_4 = 1$ (5th-axis) $D_5 = 1$ (6th-axis) $D_6 = 1$ (7th-axis) $D_7 = 1$ (8th-axis)	Select an axis. Check the axis selection switch wiring.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Table 4.33 (Cent'd)

<table>
<tr><th>Cause of Trouble</th><th>check Method</th><th>Solution</th></tr>
<tr><td>Power is not supplied to HANDLE PG.</td><td>Check that +5 V is supplied on terminal of handle PG.
Confirm that the HANDLE PG signal connector is not removed.</td><td>Refer to " Manual pulse generator" of the Connecting Manual to check the wiring, and wire correctly.</td></tr>
<tr><td>Two or three handles</td><td></td><td>Set option parameters.</td></tr>
<tr><td>HANDLE PG trouble
FC903 board trouble</td><td>This is a counter monitor.
Confirm that #3037 (one handle), #3038 (two handles), #3o39 (three handles) values changes when HANDLE PG is turned.</td><td>Replace HANDLE PG.</td></tr>
<tr><td>Manual pulsing magnification input is selected.</td><td>Manual pulsing magnification input 1/0 signal #3002
<table>
<tr><th>D7
M P4</th><th>D6
MP2</th><th>D5
MP1</th><th>Magnifi-
cation</th></tr>
<tr><td>0</td><td>0</td><td>0</td><td>x 1</td></tr>
<tr><td>o</td><td></td><td>1</td><td>x 10</td></tr>
<tr><td>0</td><td>1</td><td>0</td><td>× 100</td></tr>
<tr><td>0</td><td>1</td><td>1</td><td>x 100</td></tr>
<tr><td>1</td><td colspan="2">Either O or 1</td><td>x 100</td></tr>
</table></td><td>Check wiring of the magnification setting switch.</td></tr>
<tr><td>Others: Related parameters</td><td>The max speed in HANDLE mode
PRM pm2860 (linear axis)
PRM pm2861 (rotation axes)
Time constant at accel/decel in 'HANDLE mode
PRM pm2561 - pm2568
Optional magnification setting at magnification × 100 selection time
(For pm2003 D7 = 1)
PRM pm2459</td><td>Verify it with the parameter table attached at the factory prior to shipment.</td></tr>
</table>

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.3.5 MANUAL JOG MODE OPERATION FAULTY

Table 4.34 Manual Jog Mode Operation Faulty

<table>
<tr><th>Cause of Trouble</th><th>Check Method</th><th>Solution</th></tr>
<tr><td>Jog mode not selected signal</td><td>Check whether 1/0 signal #3000 D, is 1. All other bits (Do, D₂ to D₇) must beset toO.
[n i80L multi-program system, check #3050 for second program and #3060 for third program.</td><td>Select JOG mode.
Check mode wiring switch.</td></tr>
<tr><td>Jog axial direction not input</td><td>Check the following 1/0 signals:
#3071 D₀ (+1st-axis) #3071 D₅ (+6th-axis)
#3072 D₀ (−1st-axis) #3072 D₅ (–6th-axis)
#3071 D ₁ (+2nd-axis) #3071 D ₆ (+7th-axis)
#3072 D, (–2nd-axis) #3072 D ₆ (–7th-axis)
#3071 D ₂ (+3rd-axis) #3071 D₇ (+8th-axis)
#3072 D₂ (–3rd-axis) #3072 D, (–8th-axis)
#3071 D₃ (+4th-axis)
#3072 D₃ (–4th-axis)
#3071 D₄ (+5th-axis)
#3072 D ₄ (–5th-axis)</td><td>Check the push button switch or selection switch wiring. In some cases, it is handled as a prohibited item for the sequence. Refer to the machine manufacturer's reference manuals for details.</td></tr>
<tr><td>Jog speed signal not input. The setting o jog speed parameter is in error.</td><td>Feed Override/Manual JOG Feed Rate Selection
<table>
<tr><th rowspan="2">Step</th><th colspan="5">I/O signal #3002</th><th rowspan="2">Manual JOG Feed Rata (Manual Operation Mode)</th></tr>
<tr><th>D₄ JV 16</th><th>D₃ JV 8</th><th>D₂ JV 4</th><th>D₁ JV 2</th><th>D₀ JV 1</th></tr>
<tr><td>1</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>Parameter pm2400 Setting speed</td></tr>
<tr><td>2</td><td>0</td><td>0</td><td>0</td><td>0</td><td>1</td><td>Parameter pm2401 Setting speed</td></tr>
<tr><td>3</td><td>0</td><td>0</td><td>0</td><td>1</td><td>0</td><td>Parameter pm2402 Setting speed</td></tr>
<tr><td>4</td><td>0</td><td>0</td><td>0</td><td>1</td><td>1</td><td>Parameter pm2403 Setting speed</td></tr>
<tr><td>5</td><td>0</td><td>0</td><td>1</td><td>0</td><td>0</td><td>Parameter pm2404 Setting speed</td></tr>
<tr><td>6</td><td>0</td><td>0</td><td>1</td><td>0</td><td>1</td><td>Parameter pm2405 Setting speed</td></tr>
<tr><td>7</td><td>0</td><td>0</td><td>1</td><td>1</td><td>0</td><td>Parameter pm2406 Setting speed</td></tr>
<tr><td>8</td><td>0</td><td>0</td><td>1</td><td>1</td><td>1</td><td>Parameter pm2407 Setting speed</td></tr>
<tr><td>9</td><td>0</td><td>1</td><td>0</td><td>0</td><td>0</td><td>Parameter pm2408 Setting speed</td></tr>
<tr><td>10</td><td>0</td><td>1</td><td>0</td><td>0</td><td>1</td><td>Parameter pm2409 Setting speed</td></tr>
<tr><td>1 1 1 0 1 1 1 0 1 1 1 0</td><td></td><td></td><td></td><td></td><td></td><td>Parameter pm2410 Setting speed</td></tr>
<tr><td>12</td><td>0</td><td>1</td><td>0</td><td>1</td><td>1</td><td>Parameter pm2411 Setting speed</td></tr>
<tr><td>13</td><td>0</td><td>1</td><td>1</td><td>0</td><td>0</td><td>Parameter pm2412 Setting speed</td></tr>
<tr><td>14</td><td>0</td><td>1</td><td>1</td><td>0</td><td>1</td><td>Parameter pm2413 Setting speed</td></tr>
<tr><td>15</td><td>0</td><td>1</td><td>1</td><td>1</td><td>0</td><td>Parameter pm2414 Setting speed</td></tr>
<tr><td>16</td><td>0</td><td>1</td><td>1</td><td>1</td><td>1</td><td>Parameter pm2415 Setting speed</td></tr>
<tr><td>17</td><td>1</td><td>0</td><td>0</td><td>0</td><td>0</td><td>Parameter pm2416 Setting speed</td></tr>
</table></td><td></td></tr>
</table>

4

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Table 4.34 Manual Jog Mode Operation Faulty (Cent'd)

<table>
<tr><th>Cause of Trouble</th><th>Check Method</th><th>Solution</th></tr>
<tr><td></td><td>Feed Override/Manual JOG Feed Rate Selection (Cent'd)
<table>
<tr><th rowspan="2">Step</th><th colspan="5">I/O signal #3002</th><th rowspan="2">Manuel JOG Feed Rate (Manual Operation Mode)</th></tr>
<tr><th>D4</th><th>D3</th><th>D2</th><th>D1</th><th>D0</th></tr>
<tr><th></th><th>JV 16</th><th>JV 8</th><th>JV 4</th><th>JV 2</th><th>JV 1</th><th></th></tr>
<tr><td>18</td><td>1</td><td>0</td><td>0</td><td>0</td><td>1</td><td>Parameter pm2417 Setting speed</td></tr>
<tr><td>19</td><td>1</td><td>0</td><td>0</td><td>1</td><td>0</td><td>Parameter pm2418 Setting speed</td></tr>
<tr><td>20</td><td>1</td><td>0</td><td>0</td><td>1</td><td>1</td><td>Parameter pm2419 Setting speed</td></tr>
<tr><td>21</td><td>1</td><td>0</td><td>1</td><td>0</td><td>0</td><td>Parameter pm2420 Setting speed</td></tr>
<tr><td>22</td><td>1</td><td>0</td><td>1</td><td>0</td><td>1</td><td>Parameter pm2421 Setting speed</td></tr>
<tr><td>23</td><td>1</td><td>0</td><td>1</td><td>1</td><td>0</td><td>Parameter pm2422 Setting speed</td></tr>
<tr><td>24</td><td>1</td><td>0</td><td>1</td><td>1</td><td>1</td><td>Parameter pm2423 Setting speed</td></tr>
<tr><td>25</td><td>1</td><td>1</td><td>0</td><td>0</td><td>0</td><td>Parameter pm2424 Setting speed</td></tr>
<tr><td>26</td><td>1</td><td>1</td><td>0</td><td>0</td><td>1</td><td>Parameter pm2425 Setting speed</td></tr>
<tr><td>27</td><td>1</td><td>1</td><td>0</td><td>1</td><td>0</td><td>Parameter pm2426 Setting speed</td></tr>
<tr><td>28</td><td>1</td><td>1</td><td>0</td><td>1</td><td>1</td><td>Parameter pm2427 Setting speed</td></tr>
<tr><td>29</td><td>1</td><td>1</td><td>1</td><td>0</td><td>0</td><td>Parameter pm2428 Setting speed</td></tr>
<tr><td>30</td><td>1</td><td>1</td><td>1</td><td>0</td><td>1</td><td>Parameter pm2429 Setting speed</td></tr>
<tr><td>31</td><td>1</td><td>1</td><td>1</td><td>1</td><td>0</td><td>Parameter pm2430 Setting speed</td></tr>
<tr><td>32</td><td>1</td><td>1</td><td>1</td><td>1</td><td>1</td><td>Parameter pm2431 Setting speed</td></tr>
</table>
In i80L multi-program system, check #3052 for second program and #3062 for third program. Does 1/0 signal #3002 (#3052, #3072) change according to the list when the jog speed selection switch is changed? Are parameters pm2400 to pm2431 set correctly?</td><td>Check wiring of the jog speed selection switch. Set the command speed or the number of necessary steps in parameters pm2400 to pm2431.</td></tr>
<tr><td>An axis interlock signal is entered.</td><td>Jog is correct when:
#3078 DO = 1 (1st-axis) #3078 D5 = 1 (6th-axis)
#3078 D1 = 1 (2nd-axis) #3078 D6 = 1 (7th-axis)
#3078 D2 = 1 (3rd-axis) #3078 D7 = 1 (8th-axis)
#3078 D3 = 1 (4th-axis)
#3078 D4 = 1 (5th-axis)
When O, the axis does not work.</td><td>An axis interlock signal is entered for some reason. Refer to the manual of the machine manufacturer to release the axis interlock.</td></tr>
<tr><td>The machine is ir LOCK position.</td><td>The position display changes in MACHINE LOCK mode. Check the machine lock switch input.
1/0 signal #3006 D5
(In i80L multi-program system, #3056 D5 for second program and #3066 D5 for third program.)
Check the internal torque switch.
Setting #0000 D,
(In i80L multi-program system, #0024 D1 for second program and #0027 D1 for third program.)</td><td>Check wiring of the machine lock switch Set pmOOOO (pmO024, pmO027) D1 to O.</td></tr>
</table>

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.3.6 MANUAL RAPID MODE OPERATION FAULTY

Table 4.35 Manual Rapid Mode Operation Faulty

<table>
<tr><th>Cause 0{ Trouble</th><th>Check Method</th><th>Solution</th></tr>
<tr><td>Rapid mode not selected</td><td>:heck 1/0 signal #3000 Do = 1. (In i80L multi-program system, check #3050 for econd program and #3060 for third program.)
\ll other bits (D , to D7) must be set O.</td><td>Select mode. Check the wiring.</td></tr>
<tr><td>Axial directior specifi-cation is not sele-cted.</td><td>:heck the following 1/0 signals:
#3071 Do (+1st-axis) #3072 D 2(–3rd-axis) #3071 D5(+6th-axis)
#3072 Do (−1st-axis) #3071 D3(+4th-axis) #3072 D5 (–6th-axis)
#3071 D 1(+2nd-axis) #3072 D3 (–4th-axis) #3071 D6(+7th-axis)
#3072 D 1 (–2nd-axis) #3071 D4(+5th-axis) #3072 D 6 (–7th-axis)
#3071 D 2 (+3rd-axis) #3072 D 4 (–5th-axis) #3071 D7 (+8th-axis)
#3072 D, (−8th-axis)</td><td>Select axial direction. Check the wiring.</td></tr>
<tr><td>Rapid override not inpu</td><td>Input Status and Rapid Traverse Rate
<table>
<tr><th colspan="2">I/O Signal #3003 Input Status</th><th colspan="4">Rapid Traverse Rate</th></tr>
<tr><th>ROV2</th><th>ROV1</th><th>1st-axis</th><th>2nd-axis</th><th>3rd-axis</th><th>4th-axis</th></tr>
<tr><td>1</td><td>1</td><td>pm2801 Setting speed</td><td>pm2802 Setting speed</td><td>pm2803 Setting speed</td><td>pm2804 Setting speed</td></tr>
<tr><td>1</td><td>0</td><td>(pm2801 Setting speed) × 1/2</td><td>(pm2802 Setting speed) × 1/2</td><td>(pm2803 Setting speed) × 1/2</td><td>(pm2804 Setting speed) × 1/2</td></tr>
<tr><td>0</td><td>1</td><td>(pm2801 Setting speed) × 1/4</td><td>(pm2802 Setting speed) × 1/4</td><td>(pm2803 Setting speed) × 1/4</td><td>(pm2804 Setting speed) × 1/4</td></tr>
<tr><td>0</td><td>0</td><td colspan="4">F0 (#2447 Setting speed)</td></tr>
<tr><td>ROV2</td><td>ROV1</td><td>5th-axis</td><td>6th-axis</td><td>7th-axis</td><td>8th-axis</td></tr>
<tr><td>1</td><td>1</td><td>pm2805 Setting speed</td><td>pm2806 Setting speed</td><td>pm2807 Setting speed</td><td>pm2808 Setting speed</td></tr>
<tr><td>1</td><td>0</td><td>(pm2805 Setting speed) × 1/2</td><td>(pm2806 Setting speed) × 1/2</td><td>(pm2807 Setting speed) × 1/2</td><td>(pm2808 Setting speed) × 1/2</td></tr>
<tr><td>0</td><td>1</td><td>(pm2805 Setting speed) × 1/4</td><td>(pm2806 Setting speed) × 1/4</td><td>(pm2807 Setting speed) × 1/4</td><td>(pm2808 Setting speed) × 1/4</td></tr>
<tr><td>0</td><td>0</td><td colspan="4">F3 (#2447 Setting speed)</td></tr>
</table>
1. 0: Open 1: Closed
2. Rapid override. 6-step specifications are as shown below. (6-step specifications: Parameter pm2000 D 3=1
3. In i80L multi-program system, check #3053 for second program and #3063 for third program.</td><td>Select override and set param-eters.</td></tr>
</table>

4

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Table 4.35 Manual Rapid Mode Operation Faulty (Cent'd)


<table>
<tr><th>Cause o' Trouble</th><th>Check Method</th><th>Solution</th></tr>
<tr><td>Rapid override not inpu</td><td>For 6 steps specifications
<table><tr><th colspan="3">Input Status</th><th>Rapid Traverse Rata</th></tr><tr><th>ROV4</th><th>ROV2</th><th>ROV1</th><th>1st-axis to 8th-axis</th></tr><tr><td>1</td><td>0</td><td>1</td><td>F2 (pm2449 Setting speed)</td></tr><tr><td>1</td><td>0</td><td>0</td><td>F1 (pm2448 Setting speed)</td></tr><tr><td>0</td><td>1</td><td>1</td><td>100%</td></tr><tr><td>0</td><td>1</td><td>0</td><td>50%</td></tr><tr><td>0</td><td>0</td><td>1</td><td>25%</td></tr><tr><td>0</td><td>0</td><td>0</td><td>Fo (pm2447 Setting speed)</td></tr></table></td><td>Select override and set param-eters.</td></tr>
<tr><td>Param-eters no set correctl</td><td>Check the following 1/0 signals:
pm2801 lst-axis rapid traverse rate pm2805 5th-axis rapid traverse rate
pm2802 2nd-axia rapid travers rate pm2806 6th-axis rapid traverse rate
pm2803 3rd-axis rapid traverse rate pm2807 7th-axis rapid traverse rate
pm2804 4th-axis rapid traverse rate pm2808 8th-axis rapid traverse rate</td><td></td></tr>
<tr><td>An axis interloc signal i: entered,</td><td>Jog is correct when:
#3078 D o = 1 (1st-axis) #3078 D4 = 1 (5th-axis)
#3078 D1 = 1 (2nd-axis) #3078 D5 = 1 (6th-axis)
#3078 D2 = 1 (3rd-axis) #3078 D6 = 1 (7th-axis)
#3078 D, = 1 (4th-axis) #3078 D7 = 1 (8th-axis)
When O, the axis does not work.</td><td>An axis interlock signal is entered for some reason. Refer to the manu-al of the machine manufac-turer to release the axis interlock.</td></tr>
<tr><td>The ma chine is in LOC position</td><td>[/0 signal #3006 D 6 = 1. (In i80L multi-program system, pm3056, for second program and #3066 D 6 for third program.)
Setting pmOOOO D 1 = 1 (In i80L multi-program system, pmO024 D 1 = 1 for second program and pmO027 D, = 1 for third program.)
Check machine lock switch input.</td><td>Check switch. Check whether parameter pm0000 D1 is 1.</td></tr>
</table>

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.3.7 MANUAL ZERO RETURN OPERATION FAULTY

This chapter assumes that manual feed (JOG) and manual rapid traverse rate (RAPID) operate normally.

Table 4.36 Manual Zero Return Operation Faulty

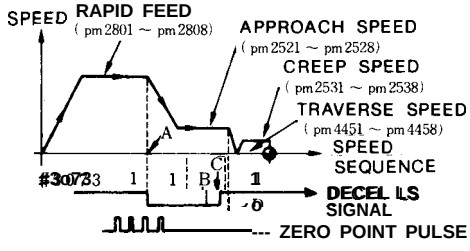Cause of Trouble	Check Method	Solution
Mode not set to zero return	/0 signal #3007 Do must be 1. (In i80L nulti-program system, #3057 D ₀for second rogram and #3067 Do for third program.) characteristically, the signal runs to OT at he existing speed even when it has passed oint A in the figure shown below.	Select the manual return-to-reference point mode or the relative switch. Check the wiring.
Rapid or jog mode not selected	n parallel with 1/0 signal #3007 D_0 = 1, #3000 ₀ or D_1 must be 1. In i80L multi-program ystem, check #3050 for second program and "3060 for third program. Unless this condition s satisfied, the operation cannot start.	Use a sequence change, etc. to enable the manual return-to-reference point signal and JOG or RAPID signal to be input simultaneously.
Deceleration limit switch not input	 eturn to Reference Point Control I/O Signal: Confirm that 1/0 signals #3073 Do to D_7 change as above, transmitting 1/0 signals at a low speed such as jog, etc.	Check the deceleration limit switch to check the wiring. If both the deceleration limit switch and wiring are normal, replace the model JANCD-FC800 board.
Parameter not set correctly	Referring to the above figure, verify the elative parameter with the attached parameter sheet.	If the parameter is different from the finally set value of the parameter sheet, reset it.
A dog position for the deceleration limit switch is arranged adequately.	occasionally dislocation may occur by one otation of the motor.	Arrange the dog position to make the rising point (point C in the above figure) of the deceleration limit switch signal come to the center of points B through D of origin pulses [In i80M, 1/0 monitor #3610 (D_6) to #3614 (D_6). In i80L, I/O monitor #3620 (D_2) to #3627 (D_2).] of each axis, sending the signal in handle mode.
Others: • Coupling loose • Dog loose • Noise	This is a case in which the position is slipped at random. Shielded cable used for PG signal?	If loose, tighten. Check the shield processing and contact your YASKAWA representative.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.3.8 CYCLE START FAILURE

Table 4.37 Cycle Start Failure

Cause of Trouble	Check Method	Solution
The cycle start signal is not input. The field hold is opened.	.s the parameter set to 1/0 signal #3003 $D_0 = 1$ when the cycle start switch is depressed? In ;his case, the field hold signal must be)pened. Normal at 1/0 signal #3003 $D_1 = 1$. (In i80L multi-program system, #3053 Do for :ycle start and #3053 D, for feed hold of second program, #3063 D ofor cycle start and #3063 D 1 :or feed hold of third program.)	Check the switch and wiring. If the machine interlock is working intermittently, refer to the manual of the machine manufacturer.
The start interlock signal is entered.	Normal at 1/0 signal #3004 $D_2 = O$. (In i80L multi-program system, #3054 D 2 for second program and #3054 D 2 for third program.)	If the machine interlock is working intermittently, refer to the manual of the machine manufacturer.
The machine is under resetting.	Normal at 1/0 signal #3500 $D_1 = O$. Confirm that the external reset input 1/0 signal #3004 D_1 is also O. (In i80L multi-program system, #335o D_1 for resetting and #3o54 D, for external reset input of second program. #3580 D_1 for resetting and #3064 D_1 for external reset input of third program.)	If the parameter is not set to O in several seconds, contact your YASKAWA representative.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.3.9 OPERATION IS NOT AVAILABLE WITH GO1 , G02, OR G03

Table 4.38 Operation is not Available with GO1, G02, or G03

<table>
<tr><th>Cause of Trouble</th><th>Check Method</th><th>Solution</th></tr>
<tr><td>Spindle rotation is checked during feeding every minute.</td><td>Check whether parametr pm1000 D7 is 1. [If 1, heck spindle rotation (1/0 signal #3111 D6).]</td><td>Rotate the spindle.
For dry runs, set pm1000 D 7 to O and do not check spindle rotation.</td></tr>
<tr><td>Improper spindle speed</td><td>Check whether parameter pm1000 D 7 = 1. [If o, check spindle speed match (1/0 signal 3111, for second spindle. #3121 D6).]</td><td>[f wiring is proper, JANCD-FC800 board or spindle drive unit may be defective. Contact your YASKAWA representative.</td></tr>
<tr><td>Cutting feed override is set to O%.

In dry run state, manual jog feed speed is set correctly.</td><td>Check whether 1/0 signals #3040 D 4 to D 0 are set correctly.


I/O Signal #3040 D4 ~ Do / Feed Override (automatic operation mode)
Ov 16 | Ov 8 | Ov 4 | Ov 2 | 0V 1
0 0 0 0 0 — 0%
0 0 0 0 1 — 10%
.0 0 0 1 0 — 20%
0 0 0 1 1 — 30%
0 0 1 0 0 — 40%
0 0 1 0 1 — 50%
0 0 1 1 0 — 60%
0 0 1 1 1 — 70%
0 1 0 0 0 — 80%
0 1 0 0 1 — 90%
0 1 0 1 0 — 100%
0 1 0 1 1 — 110%
0 1 1 0 0 — 120%
0 1 1 0 1 — 130%
0 1 1 1 0 — 140%
0 1 1 1 1 — 150%
1 0 0 0 0 — 160%
1 0 0 0 1 — 170%
1 0 0 1 0 — 180%
1 0 0 1 1 — 190%
1 0 1 0 0 — 200%
1 0 1 0 1 — 220%
1 0 1 1 0 — 240%
1 0 1 1 1 — 260%
1 1 0 0 0 — 280%
1 1 0 0 1 — 300%
1 1 0 1 0 — 340%
1 1 0 1 1 — 380%
1 1 1 0 0 — 420%
1 1 1 0 1 — 460%
1 1 1 1 0 — 500%
1 1 1 1 1 — 540%</td><td>• Turn override switch. If the wiring is faulty, correct it.
• Check parameter setting.</td></tr>
<tr><td>Start interlock signal i input.</td><td>Check whether 1/0 signal #3004 D, is 1. (Normal if it is O.)</td><td>Release the interlock with reference to instruction.</td></tr>
<tr><td>Axis-interlock is input</td><td>Check whether 1/0 signals #3078 (Do to D4) are O. (Not interlocked if they are 1.)</td><td>Release the interlock with reference to instruction.</td></tr>
<tr><td>Servo system setting is erroneous.</td><td>Is manual feeding enabled? (Check whether the machine operates in manual mode.)</td><td>See Par. 4.3.7.</td></tr>
</table>

4

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.3.10 SPINDLE DOES NOT ROTATE




Table 4.39 Spindle Does Not Rotate
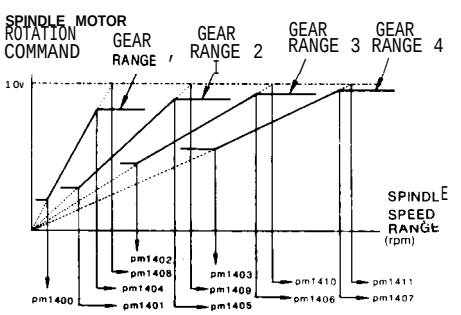
<table>
<tr><th>Cause of Trouble</th><th>Check Method</th><th>Solution</th></tr>
<tr><td>Program error
• S command is missing.
• Start M code is missing. (M03, M04, etc.)</td><td>Check on the RUN screen</td><td>Correct the program.</td></tr>
<tr><td>The start signal is not issued.</td><td>Check output signals (#1100 level) on the 1/0 signal screen.</td><td>Release interlock with reference to the manual issued by the machine manufacturer.</td></tr>
<tr><td>Spindle rotation command is not issued,</td><td>Check spindle voltage with spindle unit.</td><td rowspan="2">Correct the wiring and sequence so that command voltage develops at the spindle unit.</td></tr>
<tr><td>S5-digit specification</td><td>Check #3654 to #3656 (in multiple spindle system #3664-3666 for second spindle, #36'74-676 for third spindle, and #3684-3686 for fourth spindle) on the 1/0 signal screen.</td></tr>
<tr><td>Spindle drive is in alarm state.</td><td>Check alarm indication of spindle drive unit.</td><td>Remove the cause of alarm of spindle drive unit.</td></tr>
<tr><td>Erroneous combination of GRO and SOR.
O is entered to parameters #1412 and #1413.</td><td>Check 1/0 signal #3110 (in multiple spindle system #3120 for second spindle, #3130 for bird spindle, and #3140 for fourth spindle) according to the table below.
GRO, SOR Input And S4-digit Command Analog Voltage
<table>
<tr><th colspan="2">1/0 Signal #3110 (#3120, #3130, #3140)</th><th rowspan="2">S4-digit Command Analog Voltage Value</th></tr>
<tr><th>D_7
GRO Input</th><th>D_6
SOR Input</th></tr>
<tr><td>0</td><td>0</td><td>Voltage corresponding to spindle speed range specified in NC program</td></tr>
<tr><td>0</td><td>1</td><td>Voltage corresponding to parameter pm1412(pm1432, pm1452, pm1472)</td></tr>
<tr><td>1</td><td>0</td><td>Parameter pm1413(pm1433, pm1453,pm1473) setting value</td></tr>
<tr><td>1</td><td>1</td><td>O v</td></tr>
</table>
Note
1. 0: Contact open 1: Contact closed
2. Note that setting parameter SSTPAB (pm1000 D,) to 1 causes SSTP to be input reversely.</td><td>The limit switch may be faulty or the sequencer may malfunction. Check input signals with reference to the manual issued by the machine manufacturer.
This combination causes command voltage of OV, and the spindle does not rotate.
When O is set, the spindle does not ratate.
Set correct values in parameter pm1412(pm1432, pm1452, pm1472) and pm1413 (pm1433, pm1453, pm1473).</td></tr>
<tr><td>Spindle related paraeters are set incorrectly.
<table>
<tr><td>#3110 D_0</td><td>GR1</td></tr>
<tr><td>#3110 D_1</td><td>GR2</td></tr>
<tr><td>#3110 D_2</td><td>GR3</td></tr>
<tr><td>#3110 D_3</td><td>GR4</td></tr>
</table>
(2nd-spindle #3120, 3rd-spindle #3130. 4th-spindle #3140)</td><td>
</td><td>Correct parameters.</td></tr>
</table>

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.3.11 9“ CRT SCREEN IS DARK

Table 4.40 9“ CRT Screen is Dark

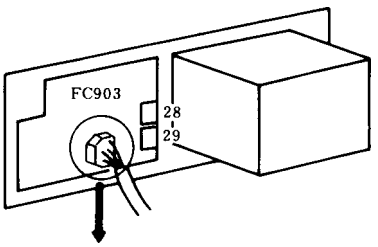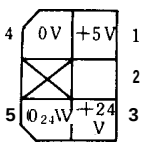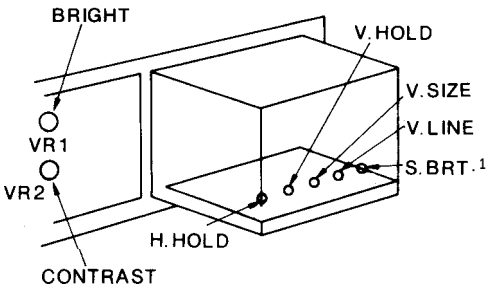Cause of Trouble	Check Method	Solution
Power voltage is too low.	Check it with CN13 on the model JANCD-FC900B board or CN28 on the model JANCD-FC903 board at rear side of 9“ CRT unit.   **CN 13 (Model JANCD-FC900B board)** **CN 28 (Model JANCD-FC903 board)**	• If the voltage drops at power cable, replace the cable. • If model CPS-12N or CPS-16F output voltage is also low, it may be caused by failure of model CPS-12N or CPS-16F. Contact your YASKAWA representative.
Escutcheon is dirty.	Check visually if the surface of escutcheon and the section between escutcheon and CRT are dirty.	Clean up CRT display and escutcheon.
Brightness is not properly adjusted.		[Do not perform setup change of CRT as a rule.] Perform adjustment with VR1 (BRIGHT) on model JANCD-FC900B board.
Hardware failure	(Trouble other than above)	Replace CRT unit or model JANCD-FC900B board. Contact your YASKAWA representative.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.3.12 EDIT DOES NOT FUNCTION

Table 4.41 Edit Does Not Function

Cause of Trouble	Check Method	Solution
Erroneous input signal (a) The edit lock signal is entered. (b) The setting edit 10cI signal is entered.	Lock at 1/0 signal pm3007 D_2 = 1. Lock at setting pmOOOO D_7 = 1.	Select the edit lock release. Set setting pmOOOO D_7 to O. For the procedure, refer to YASNAC i80M Instruction Manual (TOE-C843-11.30) and YASNAC i80L Instruc tion Manual (T0E-C843-11.20).
A parameter to lock a specially numbered program is turned on.		This is a setting to prevent programs from being destroyed by erroneous edit operation. For modification of parameters, refer to YASNAC i80M Instruction Manual (TOE-C843-11.30) and YASNAC i80L Instruc· tion Manual (T0E-C843-11.20).
Others: (a) Memory capacity exceeded (b) Stored program volume exceeded (c) Overlapped stored program numbers	MEMORY OVER! PROGRAM OVER! ALREADY IN! A warning alarm is issued for each.	. Refer to YASNAC i80M Instruction Manual (TOE-C843-11.30) and " Part Program Editing" of the YASNAC i80L Instruction Manual (TOE-C843-11.20). • Continue the edit operation after erasing unnecessary programs.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.3.13 FIN WAIT OCCURS BY SPINDLE RELATED INSTRUCTION

The sequential processing entered some signal wait mode and was then discontinued.


Table 4.42 Fin Wait Occurs by Spindle Related Instruction

Cause of Trouble	Check Method	Solution
A signal identical with the spindle speed is not entered.	If this trouble occurs at the time of command issuing such as " M03 S1OO", etc., confirm 1/0 signal pm3111 D_6 = 1 (pm3121 D_6 for 2nd-spindle). Refer to the circuit diagram of the machine manufacturer to confirm 1/0 input section 1/0 signal #1000 level.	If no trouble is found in the wiring, there is a possibility of a fault model JAN CD-FC800 board or fault spindle drive unit. Contact your YASKAWA representative.
The axis zero speed signal is not entered.	If this trouble occurs at stop time " M05°, refer to the circuit diagram of the machine manufacturer to confirm 1/0 input section 1/0 signal #1000 level.	If no trouble is found in the wiring, there is a possibility of a fault model JANCD-FC800 board or fault spindle drive unit.
Other	If this trouble occurs at the time of " M19° or "M20", spindle orientation command, refer to the circuit diagram of the machine manufacturer to confirm the 1/0, especially the orientation-related sections.	If no trouble is found in the wiring, there is a possibility of a fault model JANCD-FC800 board or fault spindle drive unit. Contact your YASKAWA representative.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.3.14 SKIP FUNCTION (G31) OPERATION FAILURE


Table 4.43 Skip Function (G31) Operation Failure

Cause of Trouble	Check Method	Solution
Input failure of skip signal	Jse 1/0 signal #3514 D ₀ to D ₂ to confirm the kip signal ON/OFF.	Confirm operation of the contactless switches, etc.
Model JANCD-FC230B or FC260 board is wrong.	⟨efer to YASNAC i80 Connecting Manual TOE-C843-11.5).	Replace model JANCD-FC230B or FC260 board. Contact your YASKAWA represent ative.
Parameter not set correctly	'arameter pm2001 Do D₄ 1: Use a transmission speed shown at the skip function (G31) command time as a speed set to parameter pm2440. O: Use a transmission speed shown at the skip function (G31) command time as a speed assigned by the F code. 'or example, the machine does not work vhen the transmission speed is O at the)arameter pm2440 G31 command time. 'arameter pm5011 Do to D₂ let a signal mode shown at the start time of he "SKIP" input for the D ₀ skip function,  Ⓐ : When this parameter is set to "O", start the operation at the time of change from 24 V to O V. Ⓑ : When this parameter is set to " ı", start the operation at the time of change from O V to 24 V. Note When this parameter is changed, turn power on, then off again. Parameter pm5010 Do to D₂ Determine ENABLE/DISABLE of an input control circuit of "SKIP" for the skip function. 1. When the skip function is used, set the bit to "l". 2. When this parameter ıs changed, turn power on, then off again.	Set the relevant parameters correctly.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.3.15 TAPE MODE DOES NOT FUNCTION

Table 4.44 Tape Mode Does Not Function

<table>
<tr><th>Cause of Trouble</th><th>Check Method</th><th>Solution</th></tr>
<tr><td>Failure of input signal. Mode input is not correct.</td><td>/0 signal #3000 D4 should be 1 and #3000 Do to D3 and D5 to D7 should e O. (TAPE should appear on CRT screen.)
In i80L multi-program system, #3050 for second program and #3060 for bird program.)</td><td></td></tr>
<tr><td>TAPE mode does not start,</td><td>See Par. 4.3.8, “CYCLE START FAILURE”.</td><td></td></tr>
<tr><td>Parameter failures such as baud rate, stop bit, and control code</td><td>See Par. 4.2.3, “ALARMS 0016, 0017, 0018, 9016, 9017 AND 9018 RS-232C ERROR) “ .</td><td></td></tr>
<tr><td>Tape reader setting failure</td><td>
<table>
<tr><th colspan="6">Dip Switch</th><th rowspan="2">Read Spaed</th><th rowspan="2">Trans-mission Beud Rate</th><th rowspan="2">AUTO Self-Checking</th><th rowspan="2">Input Control</th></tr>
<tr><th colspan="2">For PTR Speed</th><th colspan="2">For Trans-mission Rate</th><th>Input Control Selec-tion</th><th>For Self-Check-ing</th></tr>
<tr><th>S1</th><th>S2</th><th>B1</th><th>B2</th><th>C/L</th><th>STS</th><th>char/s</th><th></th><th></th><th></th></tr>
<tr><td>*ON</td><td>OFF</td><td>OFF</td><td>OFF</td><td>ON</td><td>OFF</td><td>270</td><td>4800</td><td>AUTO</td><td></td></tr>
<tr><td>ON</td><td>ON</td><td></td><td></td><td></td><td>OFF</td><td>300</td><td></td><td>AUTO</td><td></td></tr>
<tr><td>OFF</td><td>OFF</td><td></td><td></td><td></td><td>OFF</td><td>200</td><td></td><td>AUTO</td><td></td></tr>
<tr><td></td><td></td><td>ON</td><td>ON</td><td></td><td>OFF</td><td></td><td>5600</td><td>AUTO</td><td></td></tr>
<tr><td></td><td></td><td>ON</td><td>OFF</td><td></td><td>OFF</td><td></td><td>2400</td><td>AUTO</td><td></td></tr>
<tr><td></td><td></td><td>OFF</td><td>OFF</td><td></td><td>OFF</td><td></td><td>1200</td><td>AUTO</td><td></td></tr>
<tr><td></td><td></td><td></td><td></td><td></td><td>ON</td><td></td><td></td><td>Self-checking</td><td></td></tr>
<tr><td></td><td></td><td></td><td></td><td>ON</td><td></td><td></td><td></td><td></td><td>Code control</td></tr>
<tr><td></td><td></td><td></td><td></td><td>OFF</td><td></td><td></td><td></td><td></td><td>Line control</td></tr>
</table>
* Standard setting
(Dip switch arrangement) . standard setting


Setting of Tape Reader</td><td>Check setting status of tape reader Model 2801 B-2 according to the table on the left and set it correctly again.</td></tr>
<tr><td>Connection failure</td><td>• Check the wiring status of RS-232C cable according to the YASNAC i80 Connecting Manual (TOE -C843-11.5).
• Check loosening and removal of connector.</td><td>Correct connection. Plug in the connector again.</td></tr>
<tr><td>Failure of tape reader</td><td>• Depressing the switch for feeding tape does not cause the tape to be moved .“
• LED (red) of the tape reader is off.
1. Power to the tape reader is off.
2. The tape reader itself is defective.</td><td>Replace the tape reader. Replace the model JANCD-FC200 board or failed cable tape reader.</td></tr>
<tr><td>Other</td><td>Check the tape retainer again.</td><td></td></tr>
<tr><td>Failure of tape reader power (EYG 300/55 GTL)</td><td>•Check that input voltage 200 V is supplied.
•Check that output voltage is 5 V or 24 V.</td><td></td></tr>
</table>

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.4 POWER SUPPLY VOLTAGE CHECK

4.4.1 CHECK AT POWER SUPPLY VOLTAGE

The voltage between terminals CN05-1 and CN05-5 in the power supply unit (model CPS-12N or model CPS-16F) should be within 200/220VAC +15% (170 to 253VAC) at 50/60Hz +2 Hz.

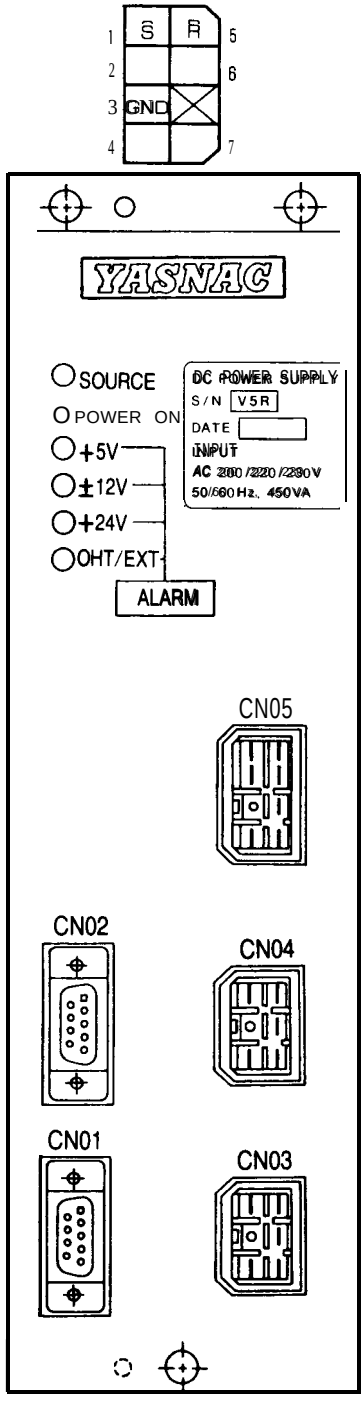


Fig. 4.9 External View of Power Supply Unit Model CPS-16F

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


4.4.2 INDICATION OF LAMP OF POWER SUPPLY UNIT

Table 4.45 Indication Lamp

Indication	Color	Meaning
SOURCE	Green	With this lamp on, AC input is executed or DC high voltage will still be applied even if AC input OFF.
POWER ON	Green	Power on with normal DC output.
+5 V	Red	+5 V fault output
±12 V	Red	±12 V fault output
+24 v	Red	+24 V fault output
EXT. ALARM	Red	Alarm input from external power supply etc. is ON.

4.4.3 CHECK DC POWER SUPPLY VOLTAGE

Measure at CN03 of model CPS-12N or model CPS-16F.



CN03

+5 V : Measure CN03 1-4
+12 V : Measure CN03 2-4
+24 V : Measure CN03 3-5

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.5 STATUS DISPLAY BY SELF-DIAGNOSIS FUNCTION (DGN)

When the 1/0 section of the NC unit is suspected of failure, diagnostic numbers can be keyed-in on the NC control panel to display and check 1/O signals for status.

4.5.1 OUTLINE OF DISPLAY

Table 4.46 Diagnostic Nos. and Contents

Diagnostic No.	Display Contents	Remarks
#1000 to #1077	Input signals for machine too"	Refer to machine manufacturer's manual.
#1 100 to #1 175	Output signals to machine tool	
#3500 to #3659	Output signals to power sequence (PLC) (standard output signal)	Refer to Appendix of YASNAC i80M Instruction Manual (TOE-C843-11.31) or Appendix of YASNAC i80L Instruction Manual (TOE-C843-11.21). For details of signals, refer to YASNAC i80 Connecting Manual (TOE-C843-11.5).
#3000 to #3119	Input signals to power sequence (PLC) (standard output signal)	


Note 1. With a power sequence (PC) setup built-in, the meanings of signals #1000 to #1077 and #1100 to #1175 depend on each power sequence program. Read the machine manufacturer's manual.

	D_7	D_6	D_5	D_4	D_3	D_2	D_1	D_0
Display :	0	0	0	0	1	1	1	1
	Contact opened				Contact closed			

2. For keep memory, refer to Section. 8, " OPERATIONS OF FIXED FILES".

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.5.2 DISPLAYING INPUT/OUTPUT SIGNALS

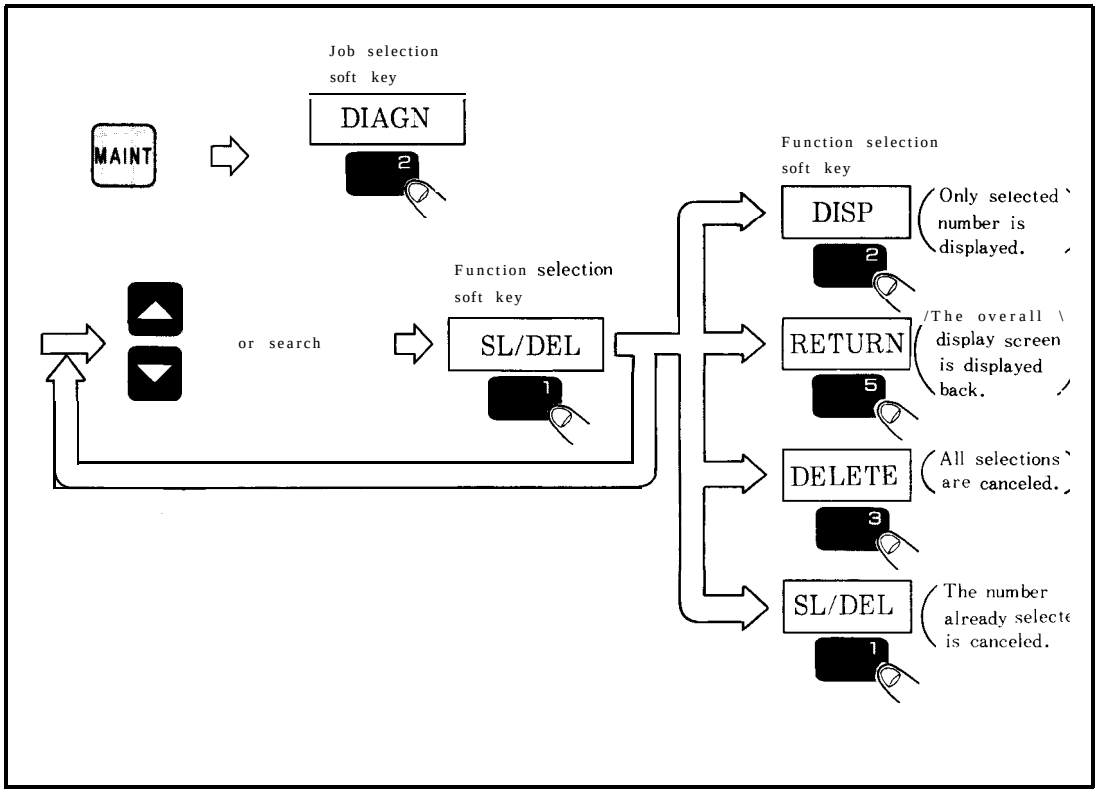

4

❑ Depress the MAINT key.

❑ Depress the IN/OUT job selection key.

2

– On/Off status of 1/0 signal can be displayed.

Note **The status of 1/0 signal can be displayed at all times, including during automatic operation.**

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.5 STATUS DISPLAY BY SELF-DIAGNOSIS FUNCTION (DGN) (Cent'd)

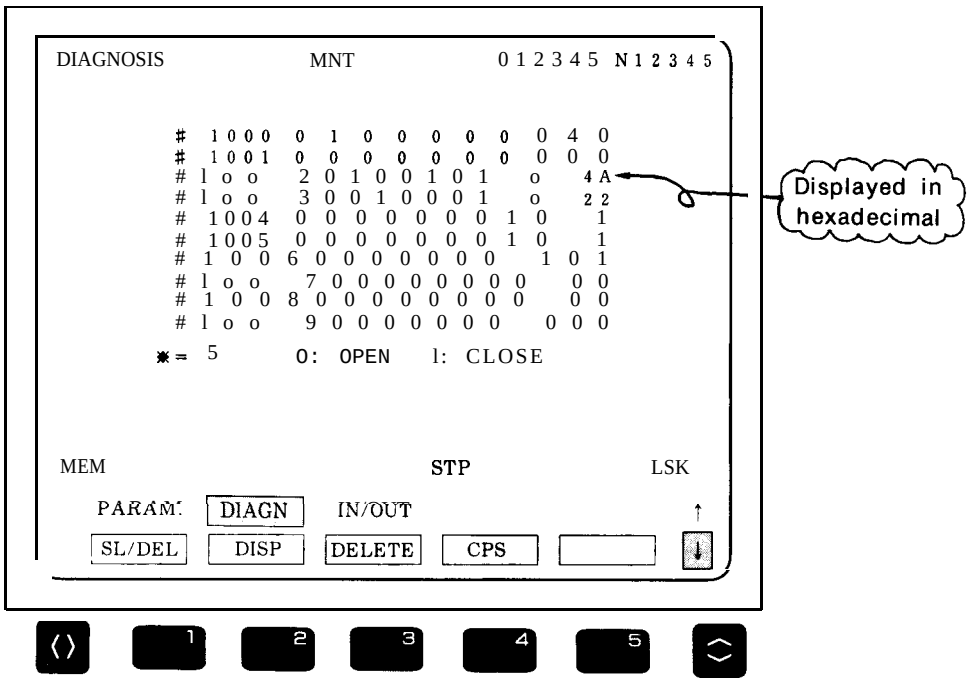


Fig. 4.10 I/O Monitor Display Screen

Note

1. **For details of this display, refer to Par. 4.6.3 of YASNAC i80M Instruction Manual** (TOE-C843-11.30) **and APPENDIX "STANDARD 1/0 DIAGNOSTIC CODES" of YASNAC i80M Instruction Manual** (TOE-C843-11.31)**.**

2. **Numeric values at the right end of the** I/O **monitor display screen are displayed in hexadecimal for convenience of maintenance.**

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

- **Procedure for Displaying I/O Signals**

3 This unit permits any number to be selected to display 1/0 signals.

First, depress the  key to move the cursor to a desired number, or search for a desired number to move the cursor that number.

❑ Depress the [SL/DEL] function selection soft key, and "*" and the number of selected numbers will be displayed.

5 Select the numbers to be displayed by repeating steps 3 and ❑ .

Note Up to 10 numbers can be selected.

4

6

(a) Depress the [DISP] 2 function selection soft key, and only a selected number will be displayed.

(b) Depressing the [RETURN] 5 function selection soft key returns control to the overall display screen .

(c) Depressing the [DELETE] 3 function selection soft key cancels all selections.

(d) Moving the cursor to the number already selected and depressing the [SEL/DEL] function selection soft key cancels selection of that number only.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

4.5 STATUS DISPLAY BY SELF-DIAGNOSIS FUNCTION (DGN) (Cent'd)

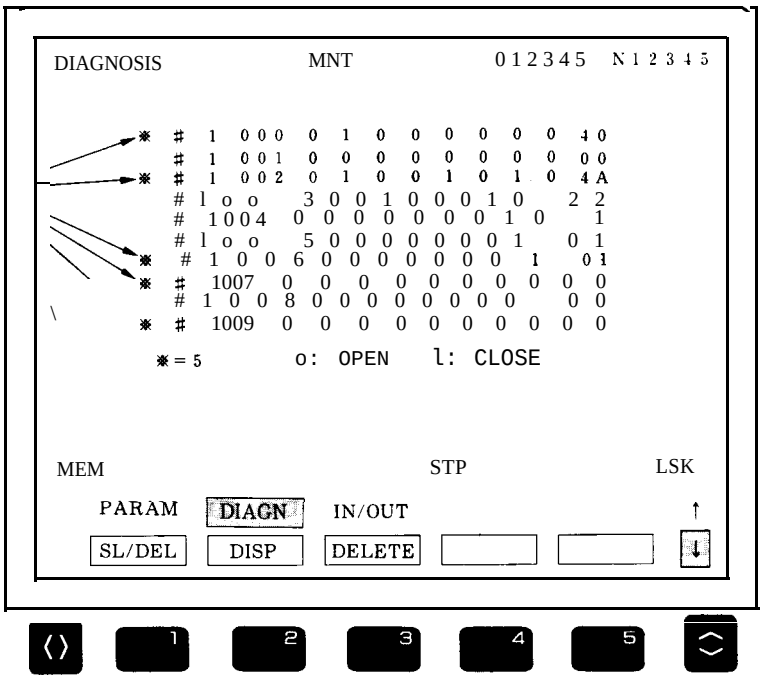


Fig. 4.11 I/O Display Screen

Depressing the DISP function selection soft key causes the following screen to be displayed.

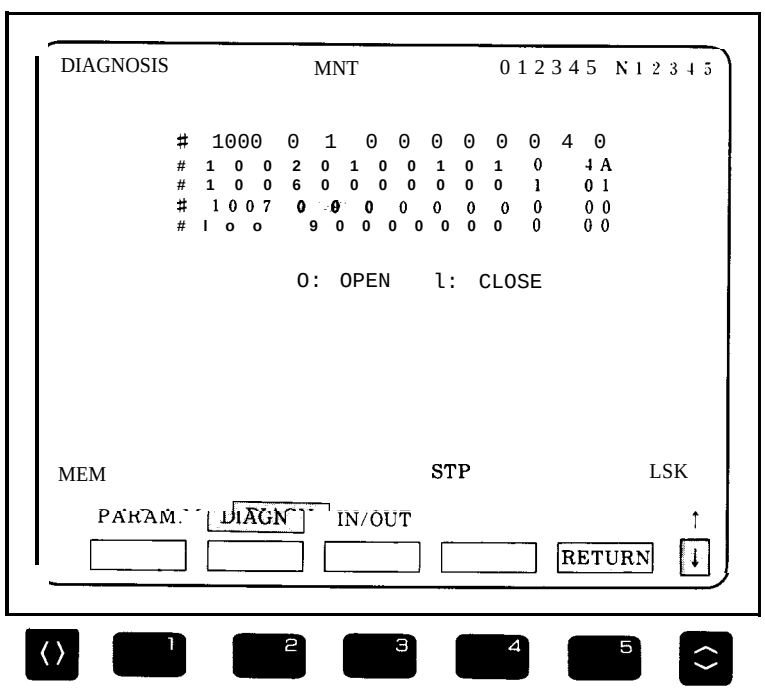


Fig. 4.12 Selection Display Screen


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

5. ADJUSTMENTS UPON INSTALLATION

This section explains adjustment procedures at YASNAC i80 installation.

CONTENTS

5. ADJUSTMENTS UPON INSTALLATION 135

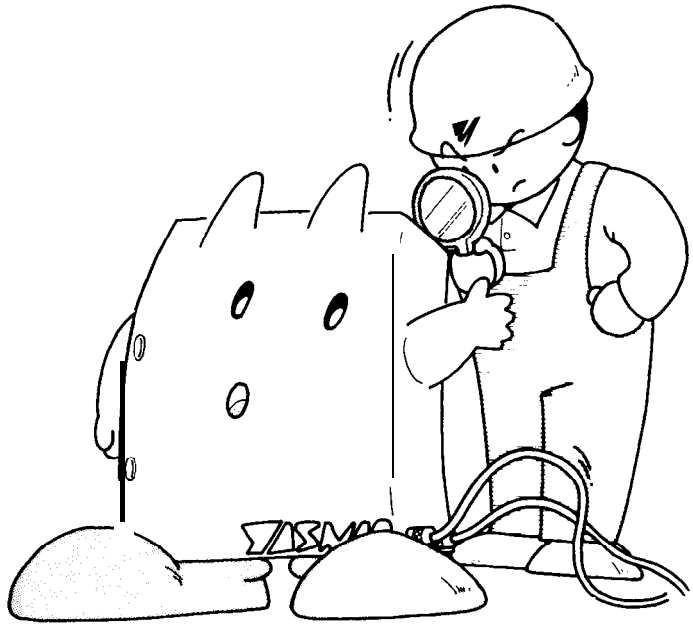

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

5. ADJUSTMENTS UPON INSTALLATION (Cent'd)

Upon installation , make adjustments in reference to the adjustment procedures given. in the table below.


Table 5.1 Adjustment Procedures

No.	Procedure	Remarks
1	Check the interior and exterior of the control cabinet.	
2	Check screw terminals for tightness.	
3	Connect external cables and check.	
4	Connect the power input cable.	
5	Check connector and module locations to be sure of positive connections.	
6	Check settings.	
7	Check input power supply voltage and frequency.	
8	Check that the composite power supply unit outputs are not short-circuited.	
9	Check the output voltages after initially applying power.	
10	Check the 1/0 signals between the NC unit and the machine tool.	
11	Check parameters and setting data.	
12	Perform a second power application.	
13	Check to be sure the emergency stop functions.	
14	Check movement on each axis by manual feed.	
15	Adjust the servo system.	
16	Check that all NC functions operate successfully.	

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


(1) Check the Interior and Exterior of the Control Cabinet.

- Check the control panel exterior for contamination and/or damage.
- Check the module connections inside the cabinet for tightness.
- Check the cables and lead bundle inside the cabinet for damage.

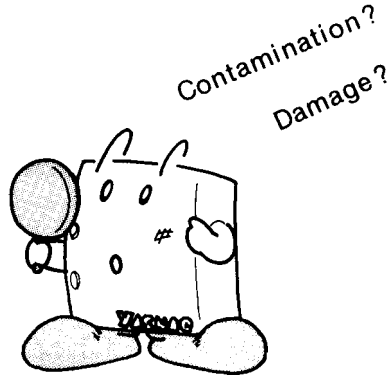

(2) Check Screw Terminals for Tightness.


- Power input unit terminal block
- Power on /off pushbutton switches on MDI and CRT unit.
- Control power transformer terminal block
- Check each terminal block cover, if any, for dislocation.

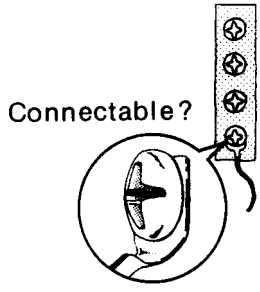

5

(3) Connect External Cables.

- Check that the cable shield is connected to the ground block through a clamp.
- Check that a protective ground wire is installed between the NC and the machine tool.
- Check that the protective ground wire is of a one-point ground type.

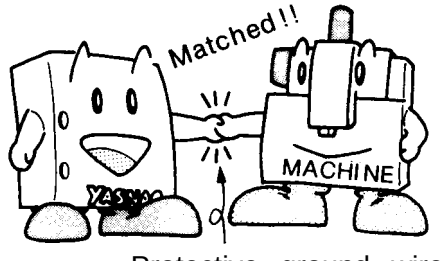


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

5. ADJUSTMENTS UPON INSTALLATION (Cent'd)


(4) Connect the Power Input Cable.

Before connecting the power input cable, verify that power input terminals R, S, and T inside the unit are not shorted.

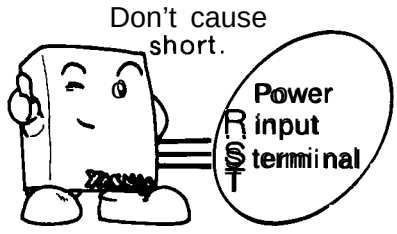

(5) Check Connector and Module Locations and Insertions.

- Check that the screws on the module clamps are tightened on the CPU rack.
- Check that the clamp claws on Honda connectors are tightened and that clamp screws are securely in place.
- Check that the clamp claws on power supply connectors are in place.
- Check that the clamp claws on flat cables are in place.

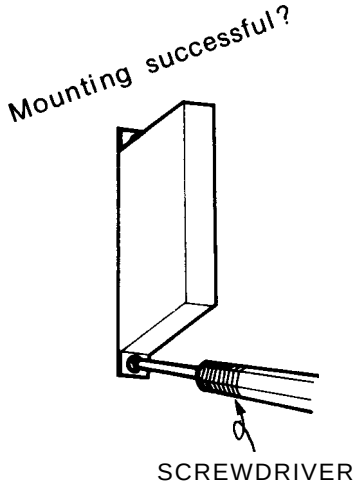



(6) Check Setting.

Verify the control power transformer setting in reference to the input power supply voltage.

(7) Check Input Power Supply Voltage and Frequency.


- Check that the power supply voltage and frequency meet ratings.
- Check that the input power supply capacity is high enough for power consumption of the control unit,

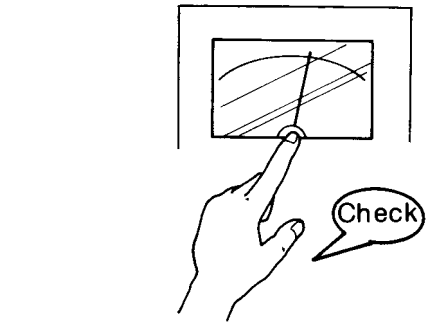

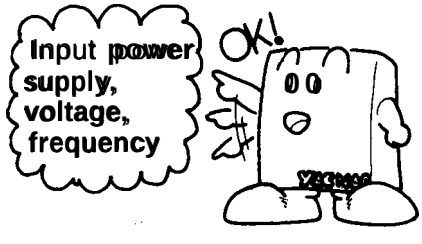

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


(8) Check That the Composite Power Supply Unit Outputs are not Short-Circuited.

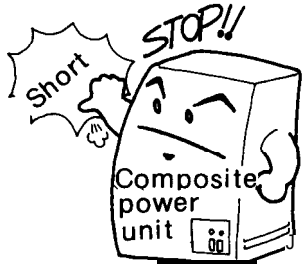

Check for short-circuits between:

- +5V and 0V
- +12V and 0V
- +24V and 0V
- -12V and 0V

(9) Check the Output Voltage After Initially Applying Power.

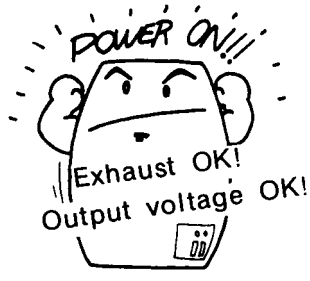


Depress the POWER ON pushbutton for first power application.

- Check that the air flow from the cooling air exhaust port is normal.
- Verify the output voltage of the composite power supply unit.

Rated Output	Output Voltage Range
+5 V	4.75 to 5.25 V
+12 V	11.87 to 13.12 V
–12 V	–11.87 to –13.12 V
+24 V	20.4 to 27.6 V

(10) Check the 1/0 Signals Between the NC and the Machine Tool.

Check I/O signals.

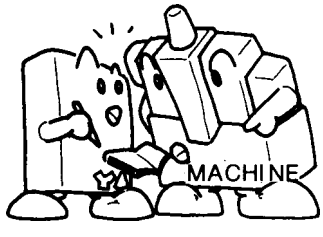


- Check that 1/0 signals according to the list of 1/0 signals.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

5. ADJUSTMENTS UPON INSTALLATION (Cent'd)

(11) Check Parameters and Setting Data.

Conduct checkups according to parameter numbers and setting data contents.

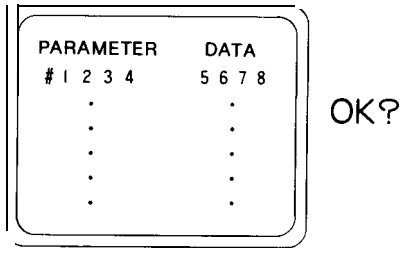


(12) Perform a Second Power Application.

Depress the POWER-ON pushbutton again for a second power application.



- An alarm, if displayed, should be dealt with according to the list of alarms.
- Check that each axis can be placed under servo clamp. For error pulse display for checking of servo clamp, perform the following operations:

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

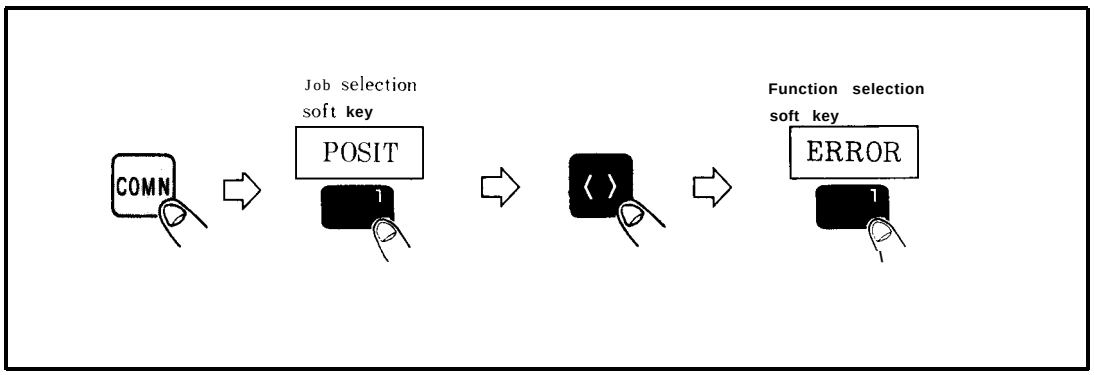

❑ Depress the COMN key.

Note **This key is a shared screen display key. It is used to temporarily obtain another display during a process (e. g., stepping).**

❑ Depress the POSIT job selection soft key.

❑ Move the cursor downward by using key and depress the ERROR function selection soft key.

The error pulse screen is displayed.

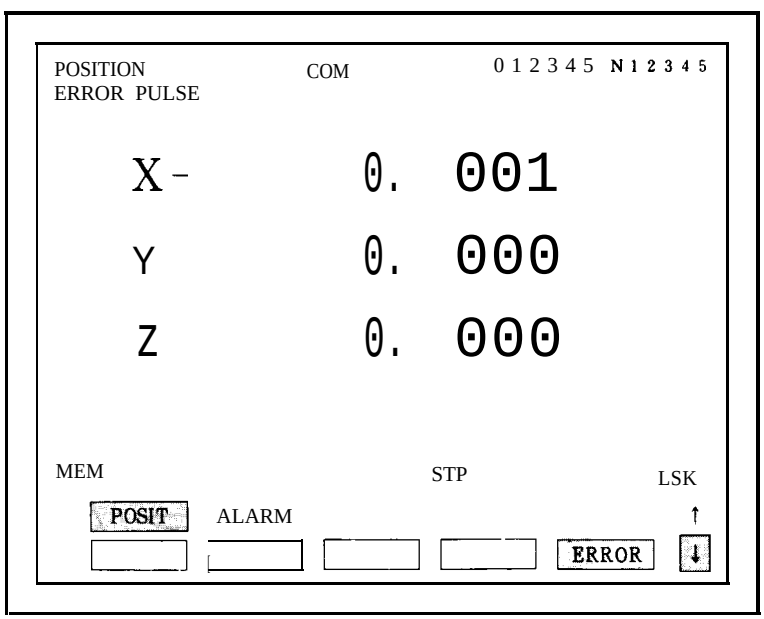


Fig. 5.1 Error Pulse Display Screen


5

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


5. ADJUSTMENTS UPON INSTALLATION (Cent'd)

(13) Verify the Emergency Stop.

With emergency stop activated (e.g. , by emergency stop pushbutton, machine end LS) , check that the second power supply (servo power supply) is turned off and that the alarm display " 3002: EMERGENCY STOP" appears.

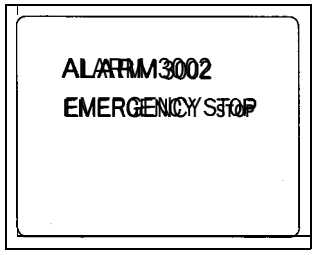


Display OK?

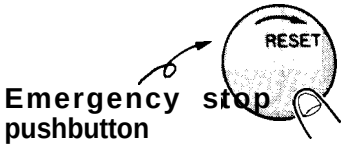


Emergency stop pushbutton

(14) Check Movement on Each Axis by Manual Feed.

- Check that the machine tool properly follows up on the movement made by handle or step feed.
- Also operate the machine by manual jog feed. Activate its OT limit switch intentionally, and check to see that the machine is stopped by detection of an over-travel alarm.
- Check that the machine tool follows in the entire feed rate range in manual jog and rapid traverse rate.

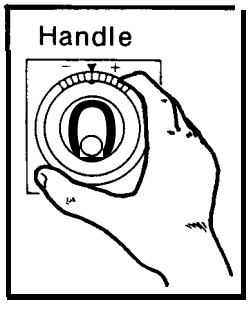


Machine operation OK'?

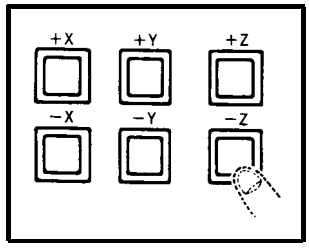

(15) Adjust the Servo System.

(16) Check That all NC Functions Activate Successfully.

Operation OK !!

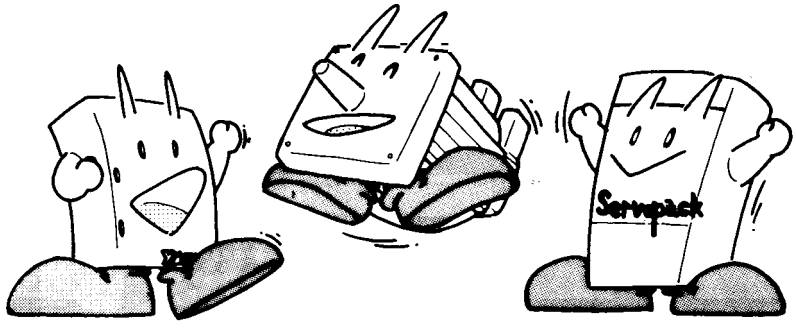

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6. MODULE/UNIT REPLACEMENT PROCEDURE

This section explains the procedures for replacing modules and units.
The procedures for replacing modules and units in the NC rack and control panel should be understood fully for correct replacement.

CONTENTS

6. MOD ULE/UNI T REPLACEMENT PROCEDURE 143

6.1 NCRACK 144
6.1.1 POWERSUPPLY UNIT(MODELCPS-12N,MODELCPS-16F) 144
6.1.2 MODELJANCD-FC100B 146
6.1.3 MODELJANCD-FC190-1 148
6.1.4 MODELJANCD-FC200 150
6.1.5 MODELJANCD-FC210-1 152
6.1.6 MODEL JANCD-FC222/FC224 154
6.1.7 MODELJANCD-FC230B 156
6.1.8 MODELJANCD-FC242 158
6.1.9 MODELJANCD-FC300B-3 160
6.1.10 MODEL JANCD-FC250(INTEXB BOARD : STANDARD SPECIFICATIONS) ... 162
6.1.11 MODEL JANCD-FC251(INTEXB BOARD : HIGH-SPEED SPECIFICATIONS) ... 164
6.112 MODEL JANCD-FC250-1, 2 (MOTION BOARD) 166
6.1.13 MODEL JANCD-FC31O-1 168
6.1.14 MODEL JANCD-FC400 170
6.1.15 MODEL JANCD-FC41O 172
6.1.16 MODEL JANCD-FC420 174
6.1.17 MODEL JANCD-FC430 176
6.1.18 MODEL JANCD-FC440 178
6.1.19 BACK BOARD (MODELS JANCD-FC001,-FC002,-FC050,-FC052) 180
6.1.20 11-SLOT BACK BOARD (MODEL JANCD-FCO06) 182


6.2 MACHINE CONTROL STATION 184
6.2.1 9“ AMGC CONTROL PANEL (MODEL JZNC-IOP01) 184
6.2.214” ACGC CONTROL PANEL (MODEL JZNC-IOP11) 191

6

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1 NC RACK

6.1.1 POWER SUPPLY UNIT (MODEL **CPS-12N,** MODEL **CPS-16F)**

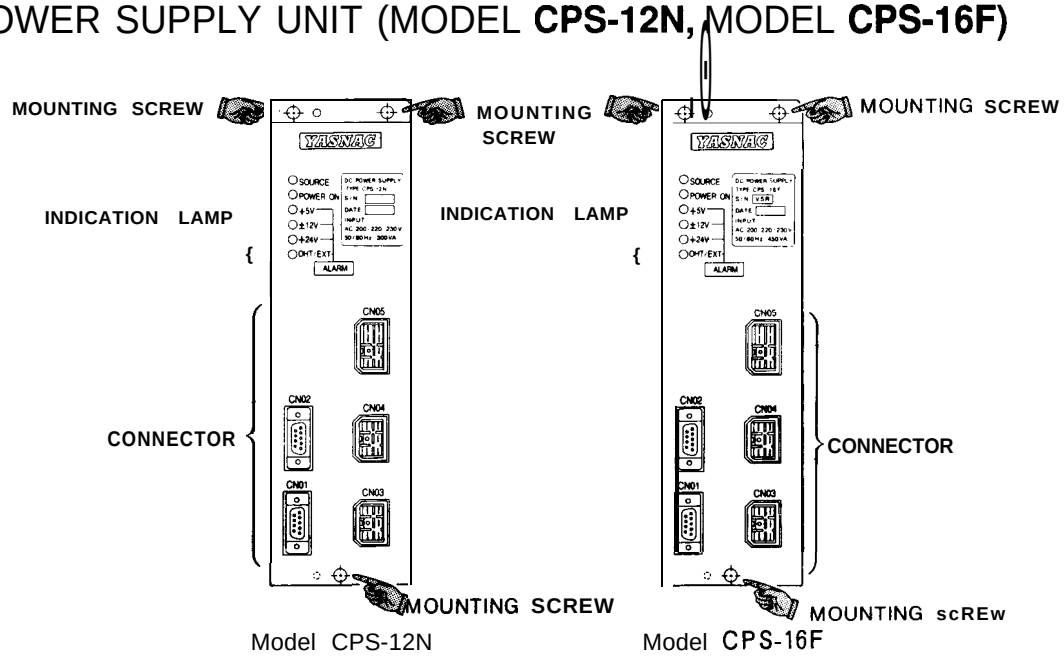

(1) **Removal**

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power supply unit is off], then pull out the CN03, CN04, and CN05 cables.

(b) Loosen the mounting screws in the three positions in the figure and remove the power supply unit from the NC rack.

(2) Installation

(a) Insert the power supply unit in line with the guide of the NC rack.

(b) Loosen the mounting screws in the three positions in the figure.

(c) Insert the CN03, CN04, and CN05 cables into the original positions.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(3) **Checking Functions After Replacement**

(a) Check that +5V, ± 12V, and +24V outputs are not shorted due to overloading.

(b) Check that 200VAC input is in the range from 170 to 253VAC.

(c) Check that 200VAC is supplied with SOURCE lamp on.

(d) Check that upon the first application of power to the NC, each output is output normally and the alarm indication lamp (red) is off.

Normal value:	+5V	4.75 to 5.25V
	+12V	11.87 to 13.12V
	-12V	-11.87 to -13.12V
	+24V	20.4 to 27.6V


(e) Check that the NC operates normally upon application of the second power to the NC.

6

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1 NC RACK (Cent'd)

6.1.2 MODEL JANCD-FC1OOC

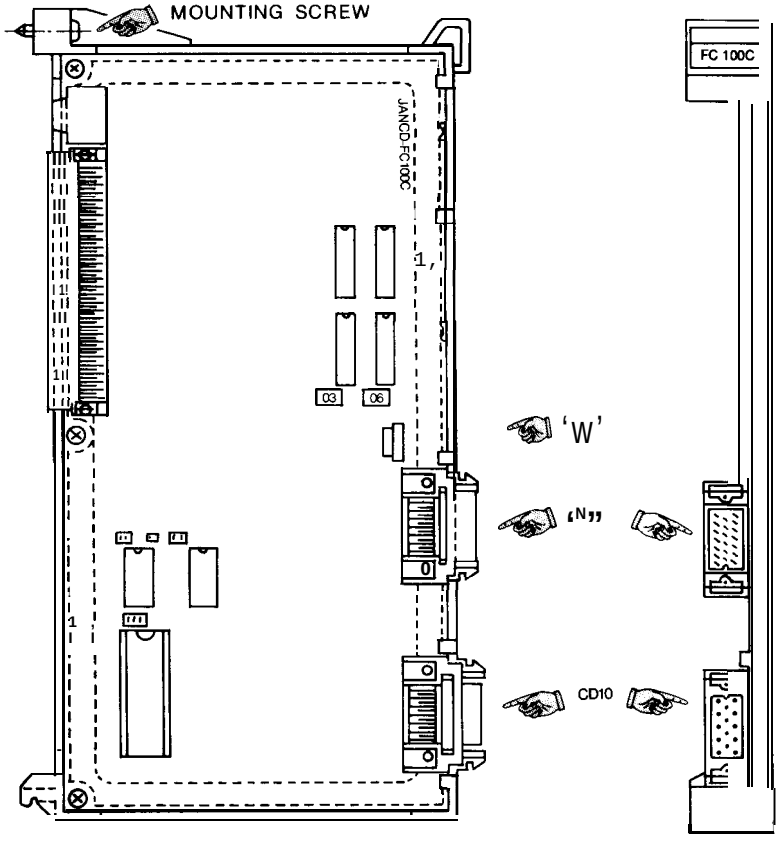

(1) **Removal**

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], then pull out the CN1O and CN11 cables.

(b) Loosen the mounting screw in the figure and remove the module from the NC rack.

(2) Installation

See the figure for the exterior of the module.

(a) Check the model and REV number of the replacement module for consistency.

(b) Check that the ROM number and label contents of the replacement module are the same as those of the module to be replaced.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(c) Set SW1 on the module as it was before replacement.

(d) Insert the module in line with the guide of the NC rack and tighten mounting screw.

(e) Insert the CN10 and CN11 cables into the original positions.

(3) Checking Functions After Replacement

(a) Check that +5V, ± 12V, and +24V outputs are not shorted due to overloading.


(b) Check that the initial is screen is displayed by initially applying power to the NC.

(c) Check that keys on the control panel can be operated.

(d) With model JANCD-FC903, check that switches on the machine control panel can be operated.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1.3 MODEL JANCD-FC190-1

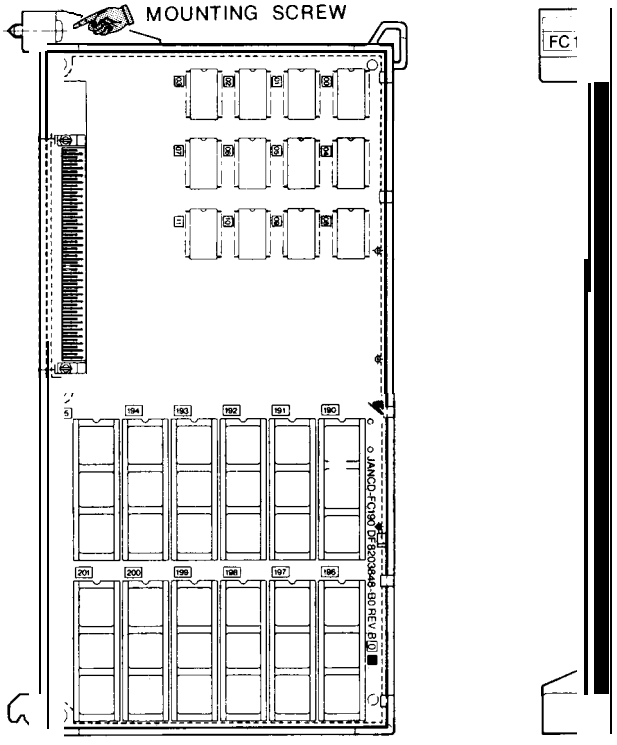

(1) **Removal**

Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], loosen the mounting screw in the figure, and remove the module from the NC rack.

(2) Installation

See the figure for the exterior of the module.

(a) Check the model and REV number of the replacement module for con sistency.

(b) Check that the ROM number and label contents of the replacement module are the same as those of the module to be replaced.

(c) Insert the module in line with the guide of the NC rack and tighten the mounting screw.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(3) Checking Functions After Replacement

(a) Check that +5V, ± 12V, and +24V outputs are not shorted due to overloading.


(b) Check that the initial screen is displayed by applying the first power to the NC.

6

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1 NC RACK (Cent'd)

6.1.4 MODEL JANCD-FC200

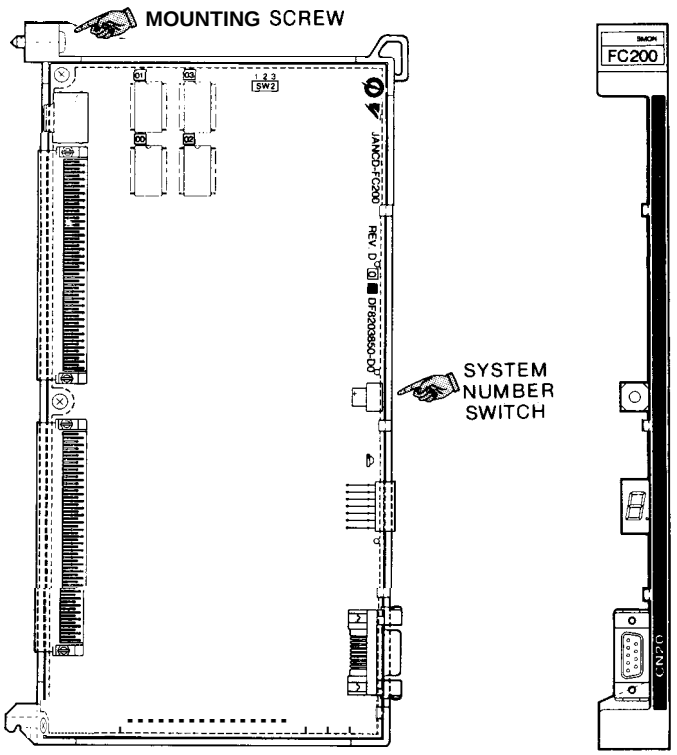

This module contains CMOS RAM in which NC program parameter values and offset values are stored. Accordingly, their contents must be copied when replacing the module.

(1) **Removal**

Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off 1, loosen the mounting screw in the figure, and remove the module from the NC rack.

(2) Installation

See the figure for the exterior of the module.

(a) Check the model and REV number of the replacement module for con sistency.

(b) Check that the system number switch of the replacement module is O.

(c) Insert the module in line with the guide of the NC rack and tighten the mounting screw.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(3) Checking Functions After Replacement

(a) Check that +5V, ± 12V, and +24V outputs are not shorted due to overloading.


(b) Check that the initial screen is displayed by initially applying power to the NC.

(c) Store the NC program, parameter values, and offset values copied in advance.

(d) After turning power off, apply the initial power and second power again and check that no alarm occurs.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1.5 MODEL JANCD-FC21O-1

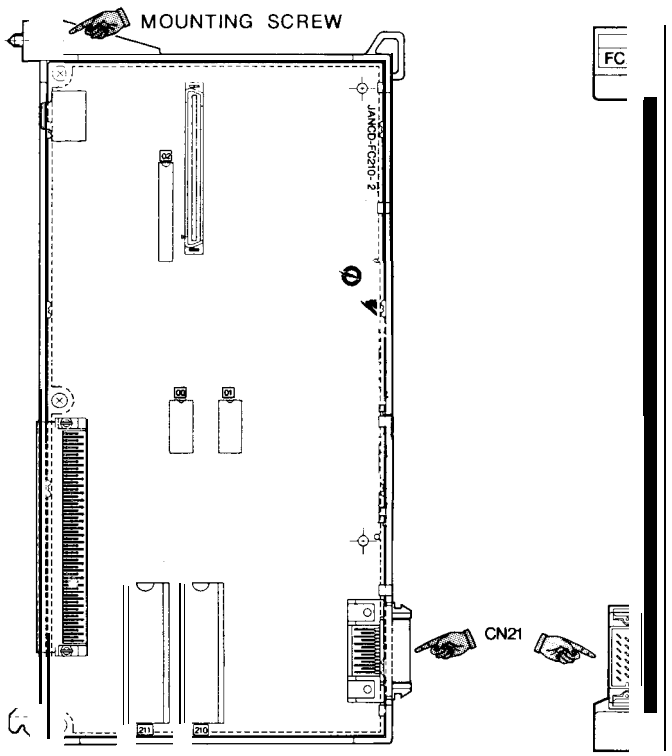

(1) Removal

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], then pull out the CN21 cable.

(b) Loosen the mounting screw in the figure and remove the module from the NC rack.

(2) Installation

See the figure for the exterior exterior of the module.

(a) Check the model and REV number of the replacement module for consistency.

(b) Check that the label **contents** and ROM numbers 210 and 211 of the replacement module are the same as those of the module to be replaced.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(c) Insert the module in line with the guide of the NC rack and tighten the mounting screw.

(d) Insert the CN21 cable into the original position.


(3) Checking Functions After Replacement

(a) Check that +5V, ± 12V, and +24V outputs are not shorted due to overloading.

(b) Apply the initial power and second power again and check that no alarm occurs.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1.6 MODEL JANCD-FC222/FC224

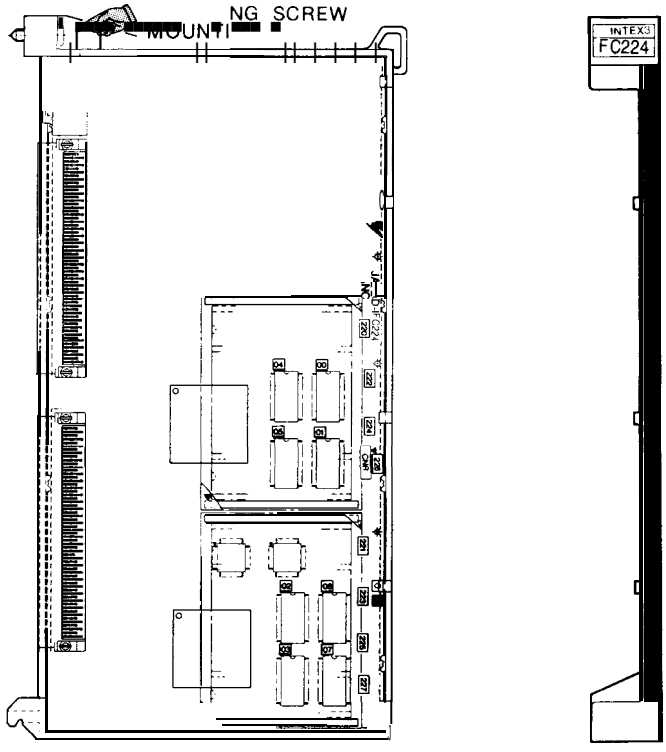

(1) Removal

Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], loosen the mounting screw in the figure, and remove the module from the NC rack.

(2) Installation

See the figure for the exterior of the module.

(a) Check the model and REV number of the replacement module for consistency.

(b) Check that the ROM number and label contents of the replacement module are the same as those of the module to be replaced.

(c) Insert the module in line with the guide of the NC rack and tighten the mounting screw.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


(3) **Checking Functions After Replacement**

(a) Check that +5V, ± 12V, and +24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1.7 MODEL **JANCD-FC230B**

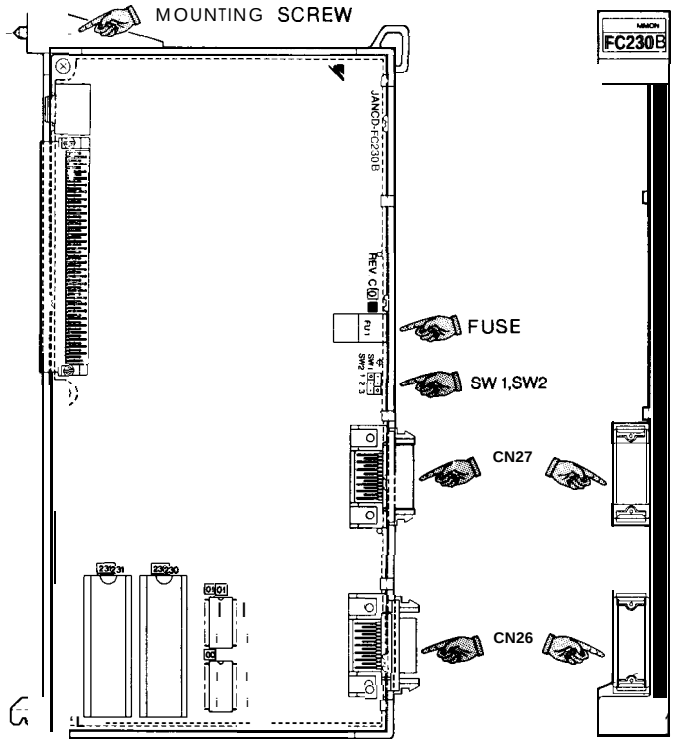

(1) Removal

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], then pull out the CN26 and CN27 cables.

(b) Loosen the mounting screw in the figure and remove the module from the NC rack.

(2) Installation

See the figure for the exterior of the module.

(a) Check the model and REV number of the replacement module for consistency.

(b) Check that the ROM number and label contents of the replacement module are the same as those of the module to be replaced.

(c) Set SW1 and SW2 on the module as they were before replacement.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(d) Check visually that the fuse is not blown.

(e) Insert the module in line with the guide of the NC rack and tighten mounting screw.

(f) Insert the CN26 and CN27 cables into the original positions.


(3) Checking Functions After Replacement

(a) Check that +5V, ± 12V, and +24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1.8 MODEL JANCD-FC242

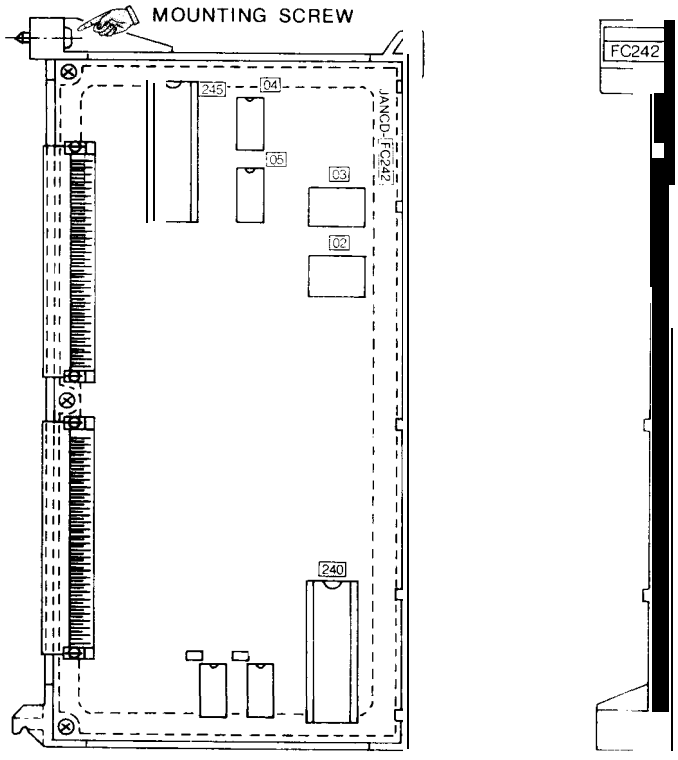

(1) Removal

Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], loosen the mounting screw in the figure, and remove the module from the NC rack.

(2) Installation

See the figure for the exterior of the module.

(a) Check the model and REV number of the replacement t module for consistency.

(b) Check that the ROM number and label contents of the replacement module are the same as those of the module to be replaced.

(c) Insert the module in line with the guide of the NC rack and tighten mounting screw.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


(3) **Checking Functions After Replacement**

(a) Check that +5V, ± 12V, and +24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1.9 MODEL JANCD-FC300B-3

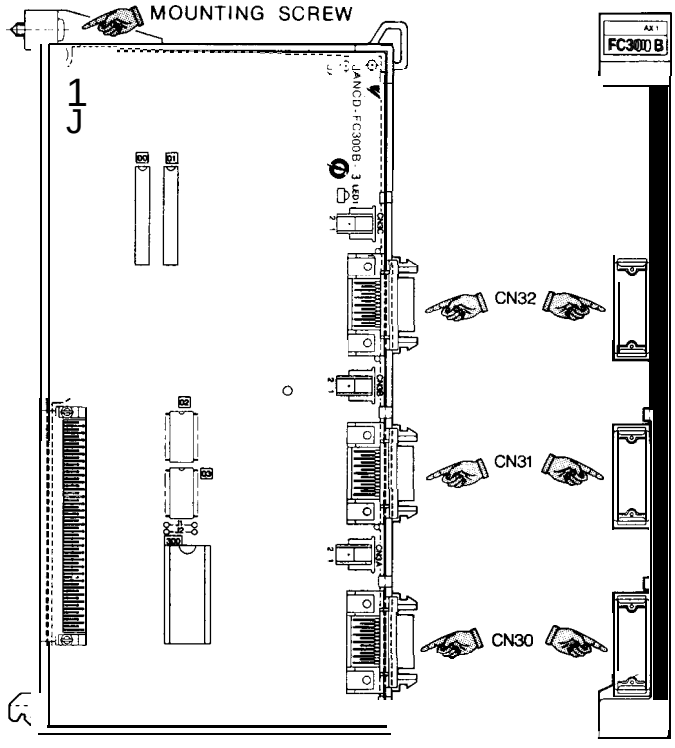

(1) Removal

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], then pull out the CN30, CN31, and CN32 cables.

(b) Loosen the mounting screw in the figure and remove the module from the NC rack.

(2) Installation

See the figure for the exterior of the module.

(a) Check the model and REV number of the replacement module for consistency.

(b) Check that the ROM number and label contents of the replacement module are the same as those of the module to be replaced.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(c) Insert the module in line with the guide of the NC rack and tighten mounting screw.

(d) Insert the CN30, CN31, and CN32 cables into the origin al positions.

(3) **Checking Functions After Replacement**


(a) Check that +5V, ± 12V, and +24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

(c) Check that the feed axis can be controlled manually.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1.10 MODEL JANCD-FC250 (INTEXB BOARD : STANDARD SPECIFICATIONS)

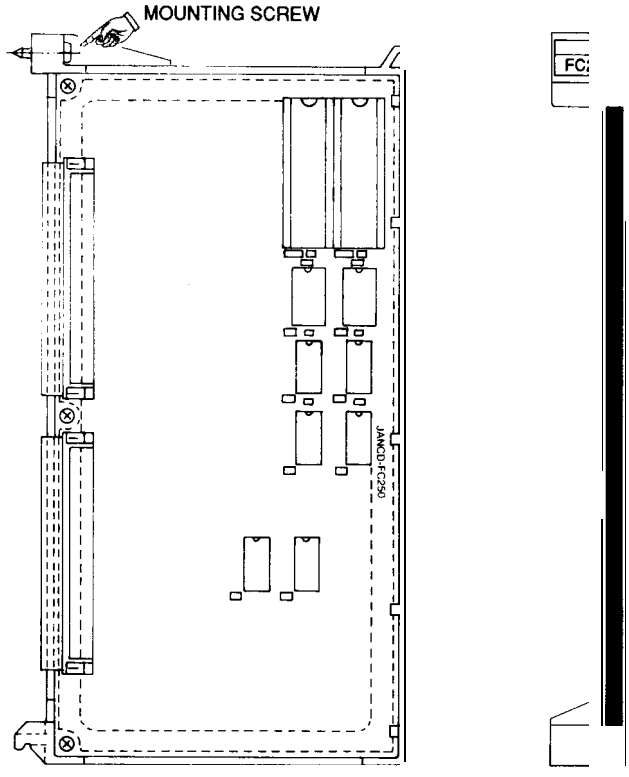

(1) Removal

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit CPS-12N is off].

(b) Loosen the mount ing screw in the figure and remove the module from the NC rack.

(2) Installation

(a) Check the model and REV number of the replacement module for consistency.

(b) Check that the ROM number and label contents of the replacement module are the same as those of the module to be replaced.

(c) Insert the module in line with the guide of the NC rack and tighten mounting screw.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


(3) **Checking Functions After Replacement**

(a) Check that+ 5V, ± 12V, and + 24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1.11 MODEL JANCD-FC251(INTEXB BOARD : HIGH-SPEED SPECIFICAT-IONS) "

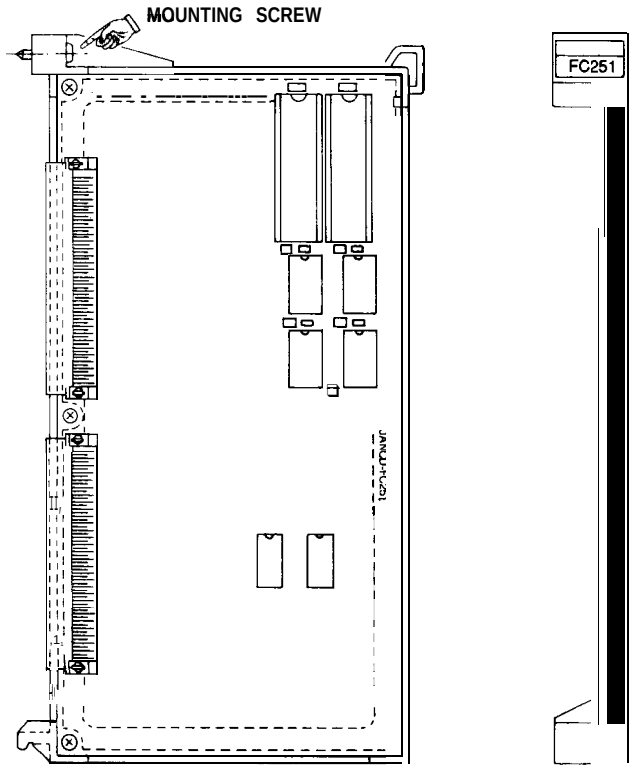

(1) Removal

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit CPS-12N is off].

(b) Loosen the mount ing screw in the figure and remove the module from the NC rack.

(2) Installation

(a) Check the model and REV number of the replacement module for consistency.

(b) Check that the ROM number and label contents of the replacement module are the same as those of the module to be replaced.

(c) Insert the module in line with the guide of the NC rack and tighten mounting screw.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(d) Insert the CN10 and CN11 cables into the original position.

(3) **Checking Functions After** Replacement


(a) Check that+ 5V, ± 12V, and + 24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

6

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1.12 MODEL JANCD-FC250-I ,2 (MOTION BOARD)

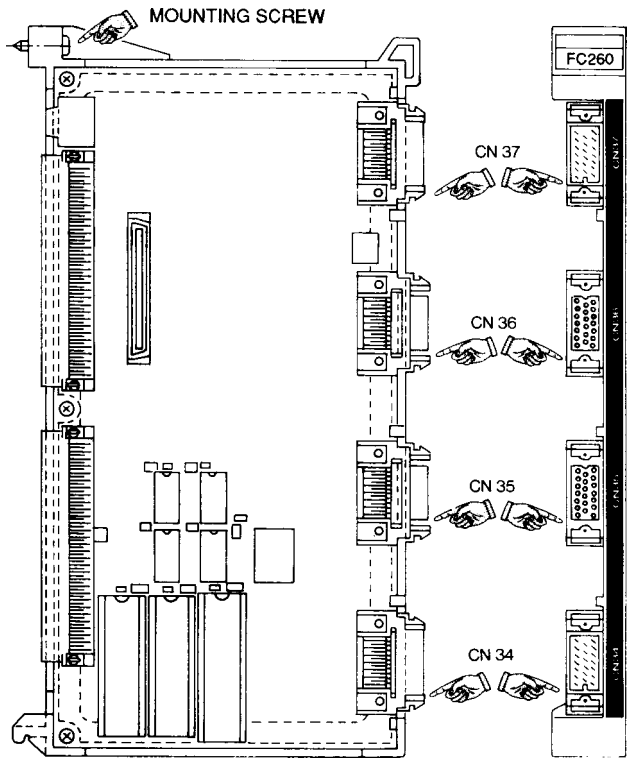

(1) Removal

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit CPS-12N is off].

(b) Pull out the cables connected to CN26, CN27, CN34, and CN35 .

(c) Loosen the mounting screw in the figure and remove the module from the NC rack.

(2) Installation

(a) Check the model and REV number of the replacement module for consistency.

(b) Check that the ROM number and label contents of the replacement module are the same as those of the module to be replaced.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(c) Return the settings of SW1 and SW2 on the module to those made before the replacement.

(d) Check visually that the fuse is not blown.

(e) Insert the module in line with the guide of the NC rack and tighten mounting screw.

(f) Insert the CN26, CN27, CN34, and CN35 cables into the original position.


(3) **Checking Functions After Replacement**

(a) Check that+5V, ±12V, and +24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1.1 3 MODEL JANCD-FC31O-1

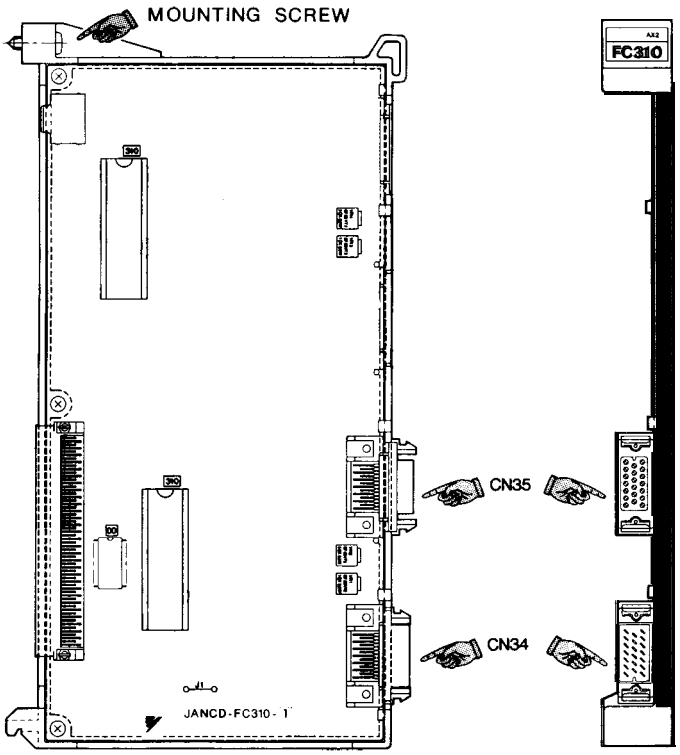

(1) Removal

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], then pull out the CN34 and CN35 cables.

(b) Loosen the mounting screw in the figure and remove the module from the NC rack–.

(2) Installation

See the figure for the exterior of the module.

(a) Check the model and REV number of the replacement module for con sistency.

-. (b) Check that the ROM number and label contents of the replacement module are the same as those of the module to be replaced.

(c) Insert the module in line with the guide of the NC rack and tighten mounting screw.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(d) Insert the CN34 and CN35 cables into the original positions.

(3) Checking Functions After Replacement


(a) Check that +5V, ± 12V, and +24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

(c) Check that the spindle can be controlled manually.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1.14 MODEL JANCD-FC400

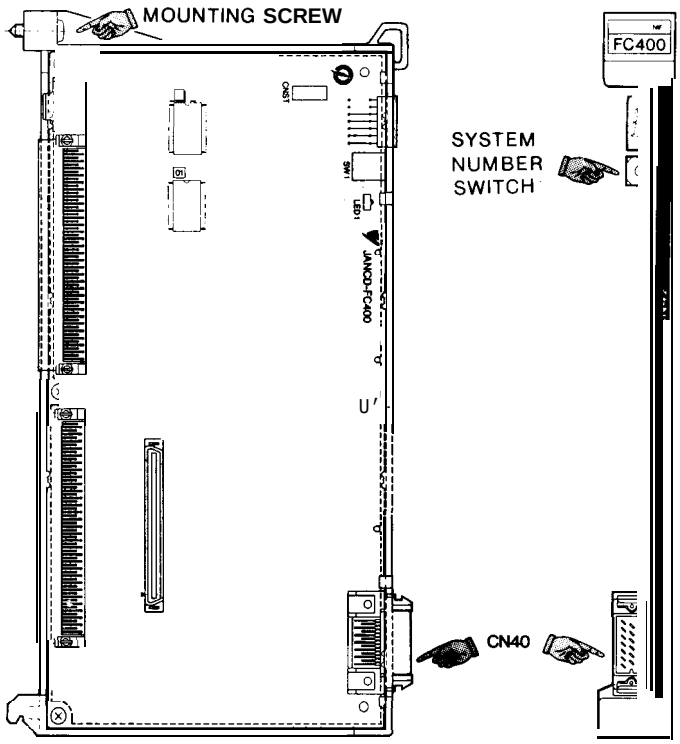

(1) Removal

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], then pull out the CN40 cable.

(b) Loosen the mounting screw in the figure and remove the module from the NC rack.

(2) Installation

See the figure for the exterior of the module.

(a) Check the model and REV number of the replacement module for con sisten cy

(b) Check that the system number switch of the replacement module is 0.

(c) Insert the module in line with the guide of the NC rack and tighten mounting screw.

(d) Insert the CN40 cable into the original position.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(3) **Checking Functions After Replacement**


(a) Check that +5V, ± 12V, and +24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

(c) With model JANCD-FC903, check that switches on the machine control panel can be operated.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1.15 MODEL JANCD-FC41O

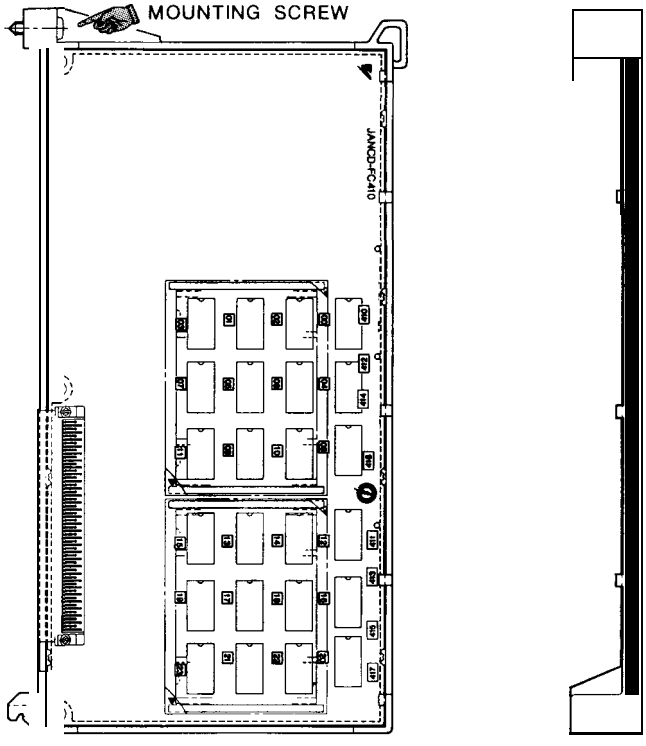

(1) Removal

Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], loosen the mounting screw in the figure, and remove the. module from the NC rack.

(2) Installation

See the figure for the exterior of the module.

(a) Check the model and REV number of the replacement module for consistency.

(b) Check that the ROM number and label contents of the replacement module are the same as those of the module to be replaced.

(c) Insert the module in line with the guide of the NC rack and tighten mounting screw.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


(3) **Checking Functions After Replacement**

(a) Check that +5V, ± 12V, and +24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1.16 MODEL JANCD-FC420

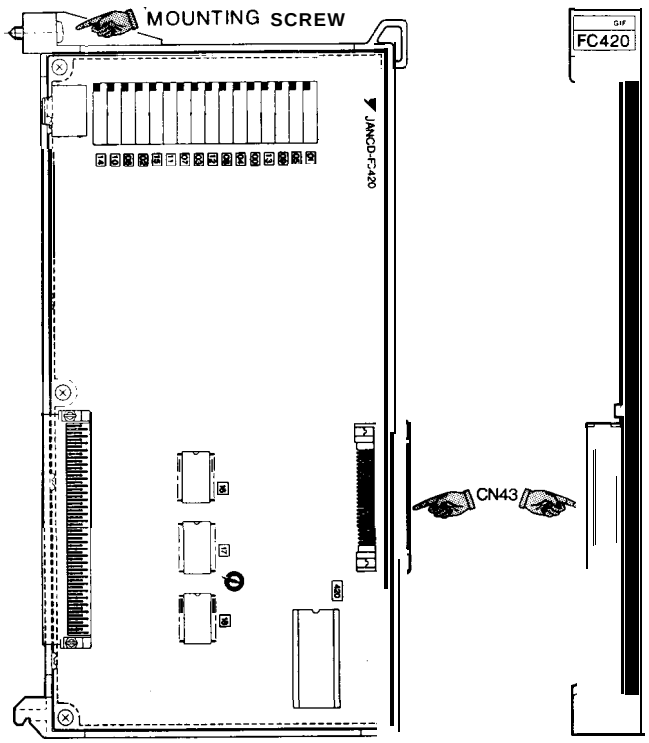

(1) Removal

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], then pull out the CN43 cable.

(b) Loosen the mounting screw in the figure and remove the module from the NC rack.

(2) Installation

See the figure for the exterior of the module.

(a) Check the model and REV number of the replacement module for consistency.

(b) Check that the ROM number and label contents of the replacement module are the same as those of the module to be replaced.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(c) Insert the module in line with the guide of the NC rack and tighten mounting screw.

(d) Insert the CN43 cable into the original position.


(3) Checking Functions After Replacement

(a) Check that +5V, ± 12V, and +24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1.17 MODEL JANCD-FC430

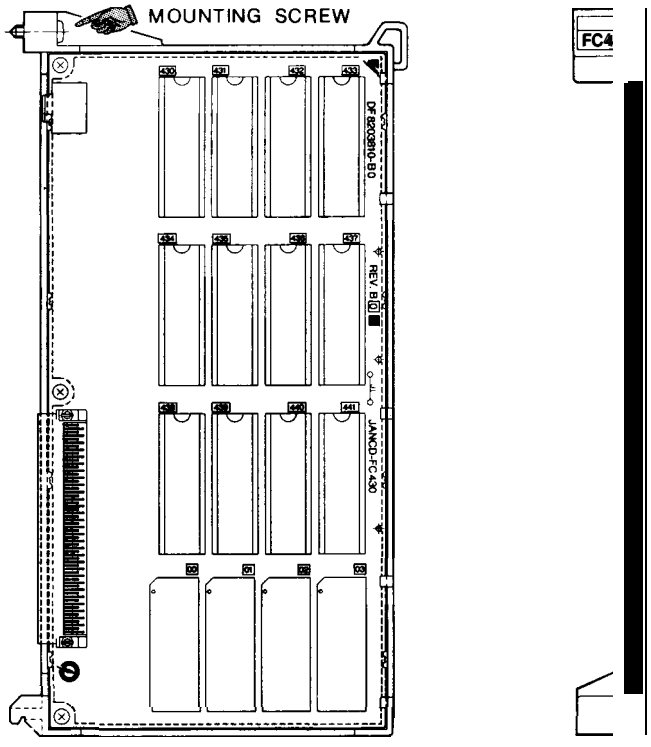

This module contains CMOS RAM in which ACGC application programs are stored. Accordingly, their contents must be copied when replacing the module.

(1) **Removal**

Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], loosen the mounting screw in the figure, and remove the module from the NC rack.

(2) **Installation**

See the figure for the exterior of the module.

(a) Check the model and REV number of the replacement module for consistency.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(b) Check that the ROM number and label contents of the replacement module are the same as those of the module to be replaced.

(c) Insert the module in line with the guide of the NC rack and tighten mounting screw.

(3) Checking Functions After Replacement

(a) Check that +5V, ± 12V, and +24V outputs are not shorted due to overloading.


(b) Check that the initial screen is displayed by applying the first power to the NC.

(c) Store the ACGC application programs copied in advance.

(d) After turning power off, apply the first power and second power again and check that no alarm occurs.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1.18 MODEL JANCD-FC440

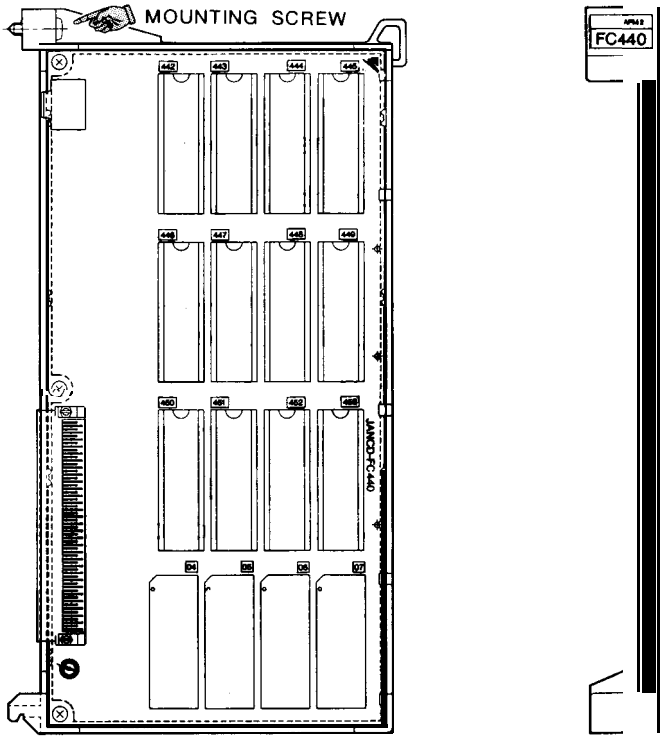

This module contains CMOS RAM in which ACGC application programs are stored. Accordingly, their contents must be copied when replacing the module,

(1) **Removal**

Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], loosen the mounting screw in the figure, and remove the module from the NC rack.

(2) **Installation**

See the figure for the exterior of the module.

(a) Check the model and REV number of the replacement module for consistency.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(b) Check that the ROM number and label contents of the replacement module are the same as those of the module to be replaced.

(c) Insert the module in line with the guide of the NC rack and tighten mounting screw.

(3) Checking Functions After Replacement

(a) Check that +5V, ± 12V, and +24V outputs are not shorted due to overloading.


(b) Check that the initial screen is displayed by applying the first power to the NC.

(c) Store the ACGC application programs copied in advance.

(d) After turning power off, apply the first power and second power again and check that no alarm occurs.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1.19 BACK BOARD (MODELS **JANCD-FC001**, **-FC002, -FC050, -FC052)**

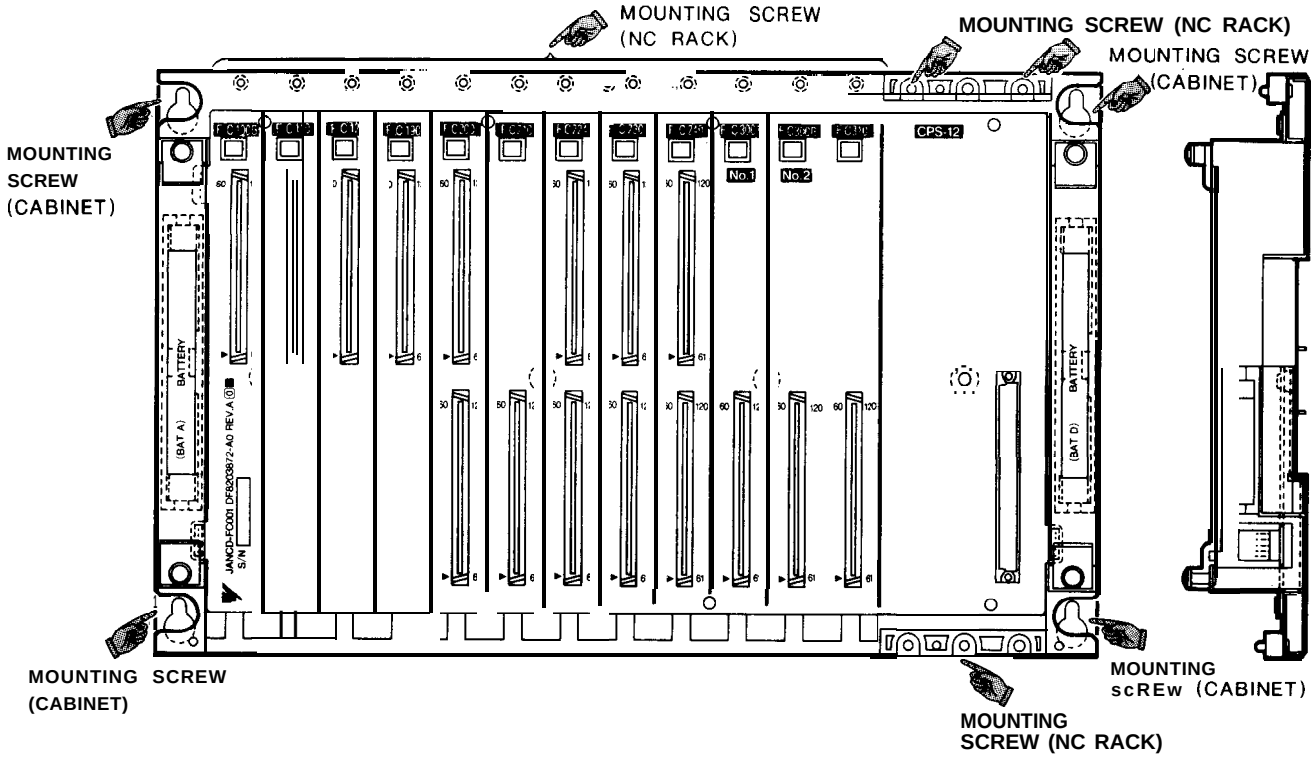

(1) Removal

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off.]

(b) Pull out all cables connected to the NC rack.

(c) Loosen the mounting screws (NC rack) in the figure and remove all modules from the NC rack.

(d) Loosen the mounting screws (cabinet) in the figure and remove the modules from the cabinet.

(2) Installation

See the figure for the exterior of the module.

(a) Check the model and REV number of the replacement module for consistency.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(b) Install the module in the cabinet and tighten the mounting screws.

(c) Insert all modules in line with the guide of the NC rack and tighten mounting screws (NC rack) .

(d) Insert all the cables into the original positions.

(3) Checking Functions After Replacement


(a) Check that +5V, ±12V, and +24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

Note **FC200 (SMON) and FC120 (FILE: optional) boards are provided with CMOS RAM (programs, parameters and offset data) and with backup by super capacitor. Therefore, installation must be completed within 16 hours after removal of the boards.**

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.1.20 11-SLOT BACK BOARD (MODEL JANCD-FC006)

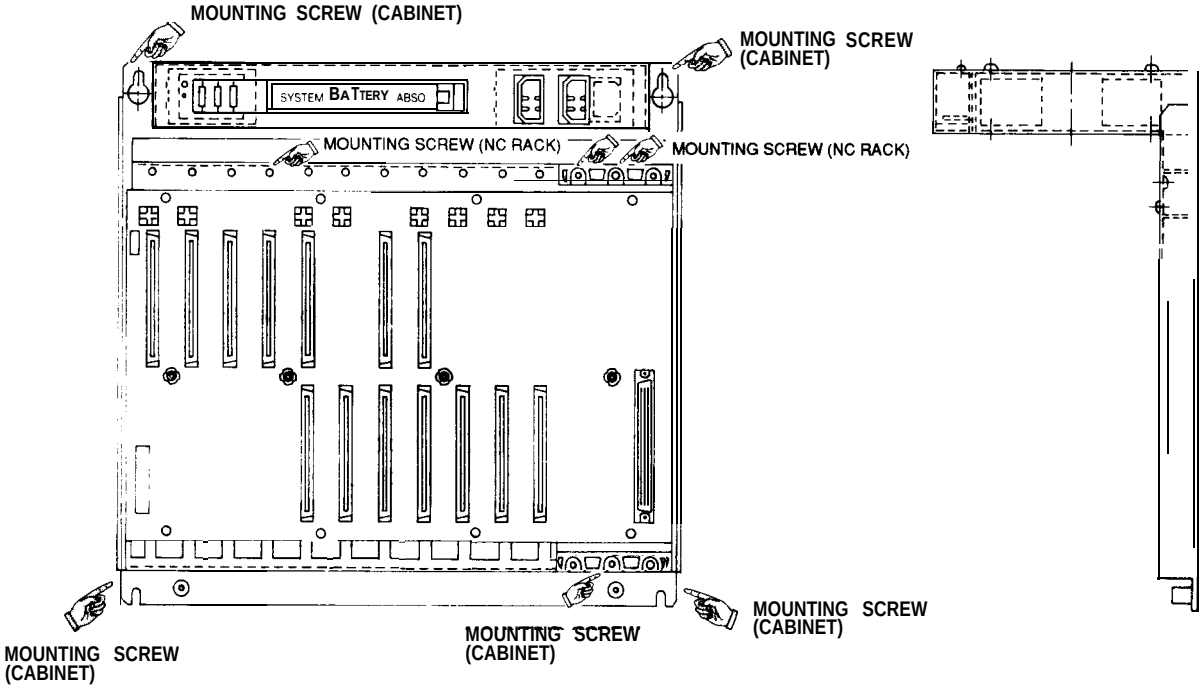

(1) Removal

(a) Check that AC input power is not supplied [the SOURCE indication-lamp (green) of the--power unit is off

(b) Pull out all cables connected to the NC rack.

(c) Loosen the mounting screws (NC rack) in the figure and remove all modules from the NC rack.

(d) Loosen the mounting screws (cabinet) in the figure and remove the modules from the cabinet.

(2) Installation

'-" **(a)** Check the model and REV number of the replacement module for consistency.

(b) Install the module in the cabinet and tighten the mounting screws.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(c) Insert all modules in line with the guide of the NC rack and tighten mounting screws (NC rack).

(d) **insert** all the cables into the original positions.

(3) **Checking Functions After Replacement**

(a) Check that+ 5V, ± 12V, and + 24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

Note

FC200 **(SMON) and** FC120 **(FILE: optional) boards are provided with CMOS RAM (programs, parameters and offset data) and with backup by super capacitor. Therefore, installation must be completed within 16 hours after removal of the boards.**


6


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.2 MACHINE CONTROL STATION

6.2.1 9“ AMGC CONTROL PANEL (MODEL JZNC-IOP01)

6.2.1.1 MODEL JANCD-FC900B

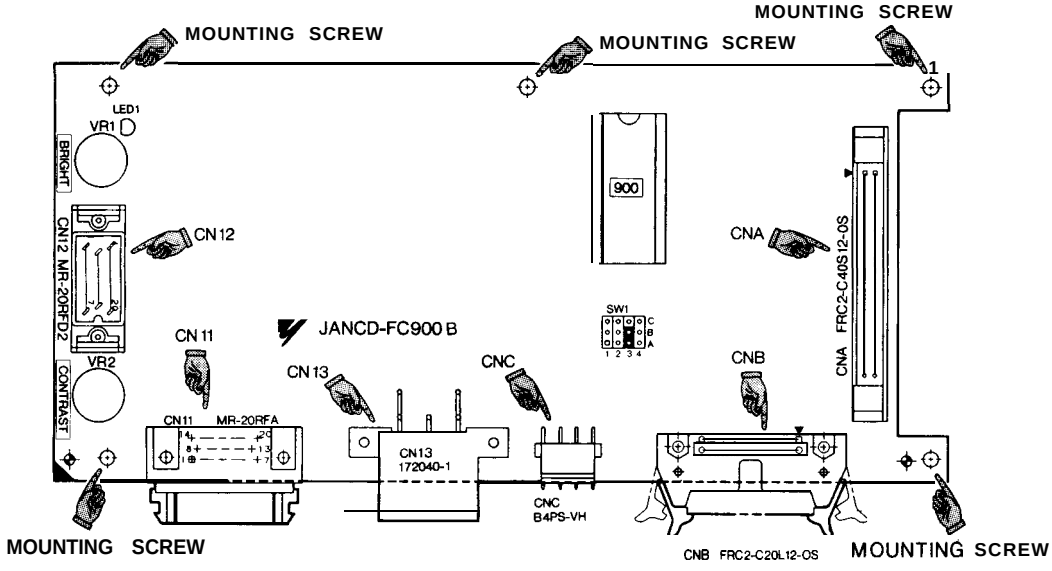

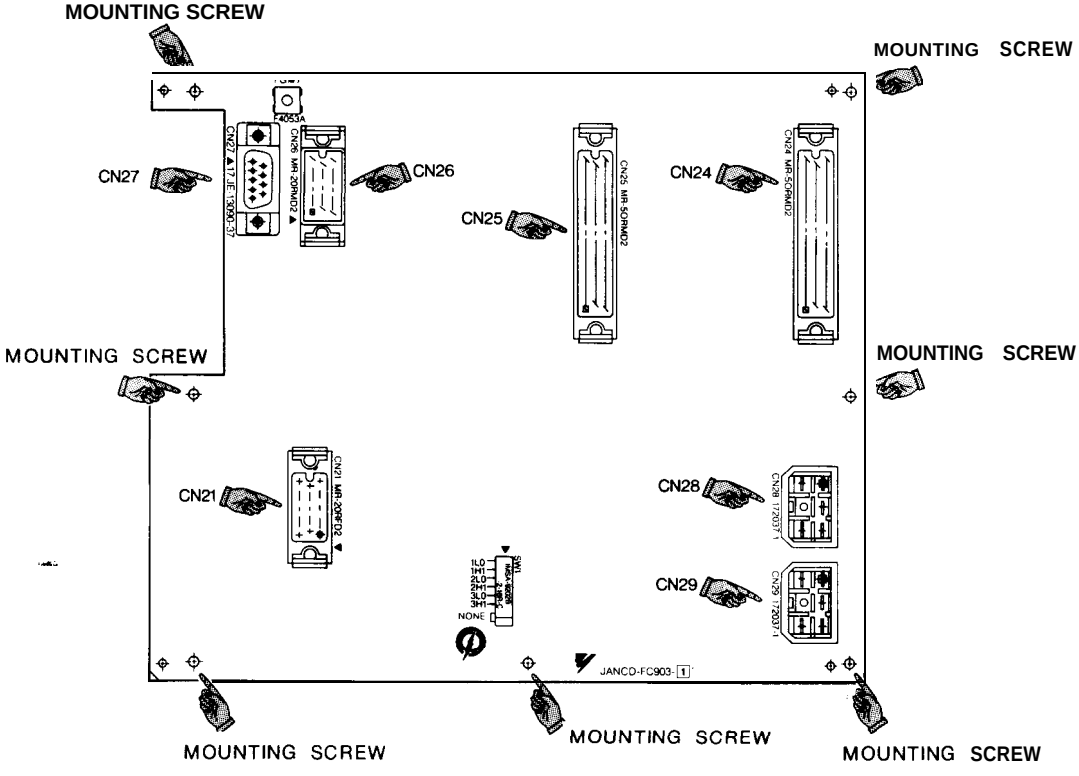

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(1) Removal

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], then pull out cables connected to CN21, CN24, CN25, CN26, CN27, CN28, and CN29 of model JANCD-FC903-1.

(b) Loosen the mounting screws of model JANCD-FC903-1 and remove model JANCD-FC903-1 from the control panel.

(c) Pull out the cables connected to CN11, CN12, CN13, CNA, CNB, and CNC of model JANCD-FC900B.

(d) Loosen the mounting screws of model JANCD-FC900B and remove model JANCD-FC900B from the control panel.

(2) Installation

See the figure for the exterior of the module.

(a) Check the model and REV number of the replacement module for consistency.

(b) Check that the ROM number and label contents of the replacement module are the same as those of the module to be replaced.

(c) Check that the setting of SW1 is the same as that before replacement.

(d) Install model JANCD-FC900B on the control panel.

(e) Connect the cables to CN11, CN12, CN13, CNA, CNB, and CNC of model JANCD-FC900B.

(f) Install model JANCD-FC903-1 on the control panel.

(g) Insert all remaining cables to the original positions.

(3) **Checking Functions After Replacement**

(a) Check that +5V, +12V, and +24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


(c) Check that the brightness and contrast of the CRT are normal.

(d) Check that keys on the control panel can be operated and the buzzer sounds.

(e) Check that switches on the machine control panel can be operated.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.2.1.2 MODEL JANCD-FC901

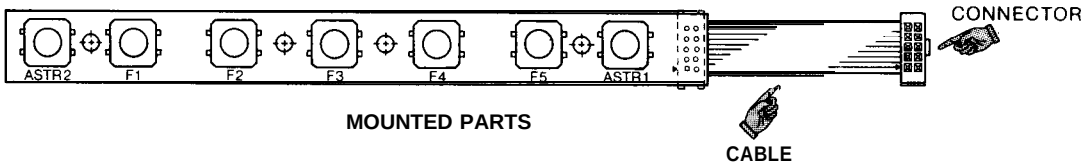

(1) Removal

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], then pull out the cable of model JANCD-FC901 connected to CNB of the keyboard.

(b) Loosen the cover mounting screws and remove the CRT cover from the control panel.

(c) Loosen the mounting screws and remove model JANCD-FC901 from the control panel.

(2) Installation

See the figure for the exterior of the function keyboard.

(a) Check the model and REV number of the replacement function keyboard for consistency.

(b) Install model JANCD-FC901 on the control panel.

(c) Install the cover on the control panel.

(d) Insert the model JANCD-FC901 cable into the original position of the keyboard.

(3) **Checking Functions After Replacement**


(a) Check that +5V, +12V, and +24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

"(c) Check that keys on the control panel can be operated.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.2.1.3 MODEL JANCD-FC903-1

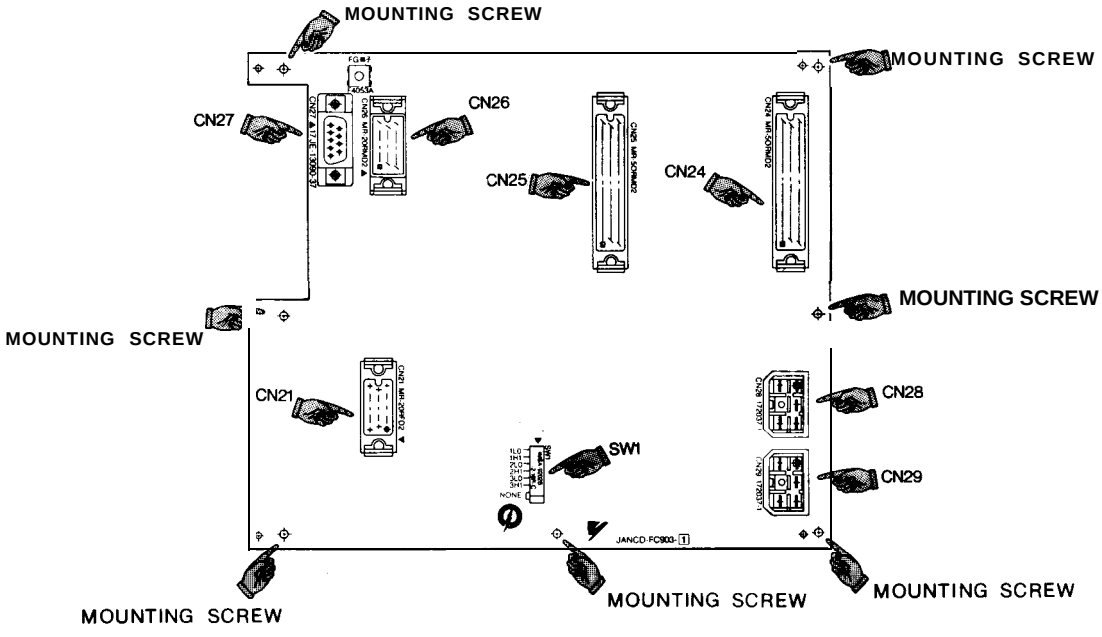

(1) Removal

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], then pull out cables connected to CN21, CN24, CN25, CN26, CN27, CN28, and CN29 of model JANCD-FC903-1O

(b) Loosen the mounting screws of model JANCD-FC900B and remove model JANCD-FC903 from the control panel.

(2) Installation

See the figure for the exterior of the module.

(a) Check the model and REV number of the replacement module for consistency.

(b) Check that the setting of SW1 is the same as that before replacement.

(c) Install model JAN CD-FC903-1 on the control panel according to the figure.

(d) Insert all cables to the original positions.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(3) **Checking Functions After Replacement**

(a) Check that +5V, +12V, and +24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

(c) Check that switches on the machine control panel can be operated.

6.2.1.4 9" MONOCHROME GRAPHIC CRT UNIT (MDT948-3B)

(1) **Removal**

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], then pull out the cable connected to CNB of model JANCD-FC900B.

(b) Loosen the mounting screws and remove CRT from the control panel.

(2) Installation

(a) Check the model and REV number of the replacement module for consistency.

(b) Insert the cable to the original position.

(3) **Checking Functions After Replacement**

(a) Check that +5V, +12V, and +24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

(c) Check that the brightness and contrast of the CRT are normal.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.2.1.5 KEYBOARD (MODEL DF8203788)

(1) Removal

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], then pull out cables connected to CN21, CN24, CN25, CN26, CN27, CN28, and CN29 of model JANCD-FC903-1.

(b) Loosen the mounting screws of model JANCD-FC900B and remove model JANCD-FC903 from the control panel,

(c) Pull out the cables connected to CN12, CN13, CNA, CNB, and CNC of model JANCD-FC900B.

(d) Loosen the mounting screws and remove model JAN CD-FC900B from the control panel.

(e) Loosen the mounting screws and remove the keyboard from the control panel.

(2) Installation

(a) Check the model and REV number of the replacement module for consistency.

(b) Install keyboard on the control panel.

(c) Install model JANCD-FC900B on the control panel.

(d) Connect the cables to CN12, CN13, CNA, CNB, and CNC of model JANCD-FC900B.

(e) Install model JANCD-FC903-1 on the control panel.

(f) Insert all remaining cables to the original positions.

(3) **Checking Functions After Replacement**

(a) Check that +5V, +12V, and +24V outputs are not shorted due to overloading.


(b) Apply the first power and second power again and check that no alarm occurs.

(c) Check that keys on the control panel can be operated and the buzzer sounds.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.2.2 14" ACGC CONTROL PANEL (MODEL JZNC-IOP11)

6.2.2.1 MODEL JANCD-FC950-1

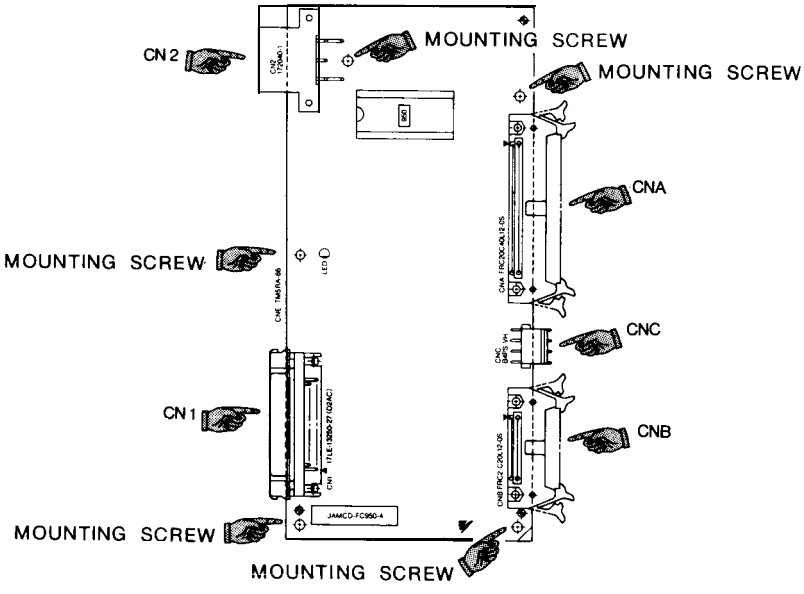

(1) Removal

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], then pull out cables connected to CNA, CNB, CNC, CN1, and CN2.

(b) Loosen the mounting screws in the figure and remove model JANCD-FC950-1 from the control panel.

(2) Installation

See the figure for the exterior of the module.

(a) Check the model and REV number of the replacement module for consistency.

(b) Check that the ROM number and label contents of the replacement module are the same as those of the module to be replaced.

(c) Install model JANCD-FC950-1 on the control panel.

(d) Insert all the cables of model JANCD-FC950-1 to the origin al positions.

6

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(3) **Checking Functions After Replacement**

(a) Check that +5V, +12V, and +24V outputs are not shorted due to overloading.


(b) Apply the first power and second power again and check that no alarm occurs.

(c) Check that the brightness and contrast of the CRT are normal.

(d) Check that keys on the control panel can be operated and the buzzer sounds.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.2.2.2 MODEL JANCD-FC951

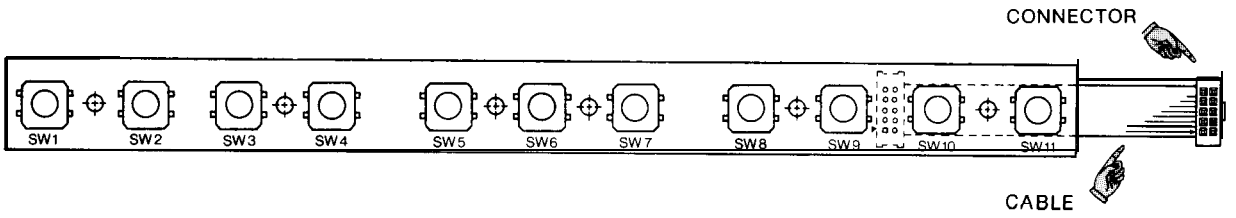

(1) Removal

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], then pull out the cable of model JANCD-FC951 connected to CNB of the keyboard.

(b) Loosen the mounting screws and remove the CRT cover from the control panel.

(c) Loosen the mountin g screws and remove model JANCD-FC951 from the control panel.

(2) Installation

See the figure for the exterior of the function keyboard.

(a) Check the model and REV number of the replacement function keyboard for con sistenc y.

(b) Install model JANCD-FC951 on the control panel.

(c) Installthe cover on the control panel.

(d) Insert the model JANCD-FC951 cable into the original position of the keyboard.

(3) **Checking Functions After Replacement**

(a) Check that +5V, +12V, and +24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

(c) Check that keys on the control panel can be operated.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.2.2.3 14" COLOR GRAPHIC CRT UNIT (MODEL TX1424AD)

(1) Removal

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], then pull out the cable connected to CNB of model JANCD-FC905.

(b) Pull out the 200VAC cable connected to CRT.

(c) Loosen the mounting screws and remove CRT from the con trol panel.

(2) Installation

(a) Check the model and REV number of the replacement module for consistency.

(b) Insert the cable to the original position.

(c) Install CRT on the panel.

(3) Checking Functions After Replacement

(a) Check that +5V, +12V, and +24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

(c) Check that the brightness and contrast of the CRT are normal.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6.2.2.4 KEYBOARD UNIT (MODEL DF8203921)

(1) Removal

(a) Check that AC input power is not supplied [the SOURCE indication lamp (green) of the power unit is off], then pull out the cable connected to CNA of model JANCD-FC905.

(b) Pull out the CNB cable connected to model JANCD-FC951.

(c) Loosen the mounting screws and remove the keyboard from the control panel.

(2) Installation

(a) Check the model and REV number of the replacement module for consistency.

(b) Install the keyboard on the control panel.

(c) Insert all the cables into the original positions.

(3) Checking Functions After Replacement

(a) Check that +5V, +12V, and +24V outputs are not shorted due to overloading.

(b) Apply the first power and second power again and check that no alarm occurs.

(c) Check that keys on the control panel can be operated and the buzzer sounds.

(d) Check that CRT OFF indication lamp is turned on and off by operating the CRT OFF key.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

7. SETTING AND ADJUSTMENT OF EACH MODULE

This section explains setting and adjustment of each module. Perform setting and adjustment of a module according to the explanation given.

CONTENTS

7. SETTING AND ADJUSTMENT OF EACH MODULE 197

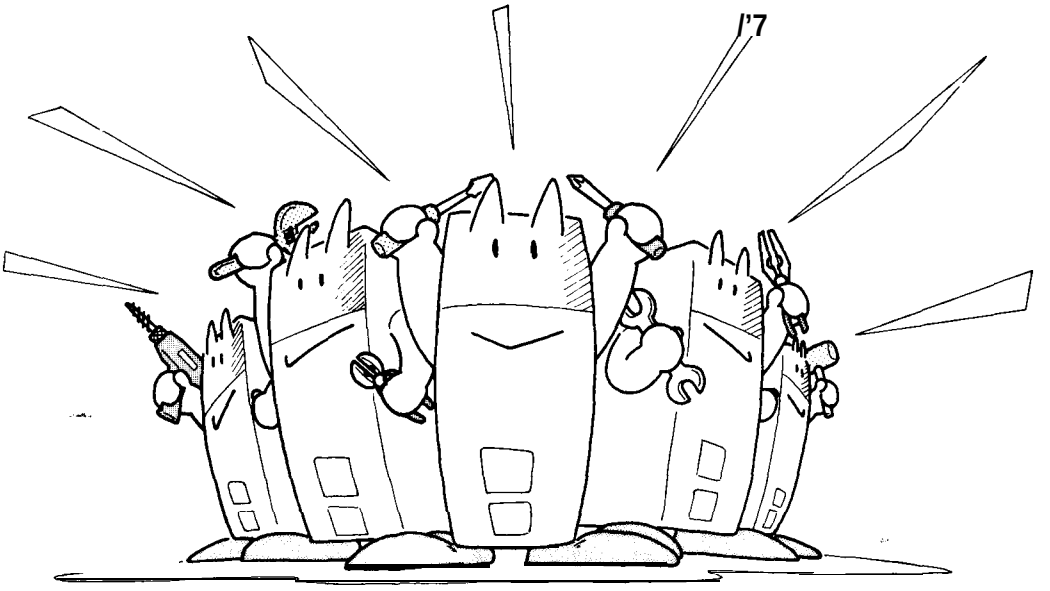


a

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

7. SETTING AND ADJUSTMENT OF EACH MODULE (Cent'd)

- **Model JANCD-FCI 00C**

Swl : Switch for selecting 9" CRT or EL display (EL)

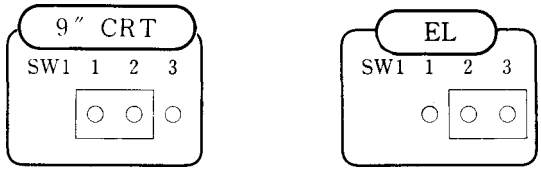

- **Model JANCD-FC200**


Swl : System number switch (16-position rotary switch)

Swl [0]: Normal operation mode
[1]: End user parameter than ge mode
[4]: Ladder edit mode

Note **SW1 [2], [3], and [51 to [F] are used only for maintenance. Only YASKAWA service personnel must use these switches.**

- **Model JANCD-FC230B or FC260**

SW1 , SW2: Switches for selecting the panel and external switches for–apply-ing power

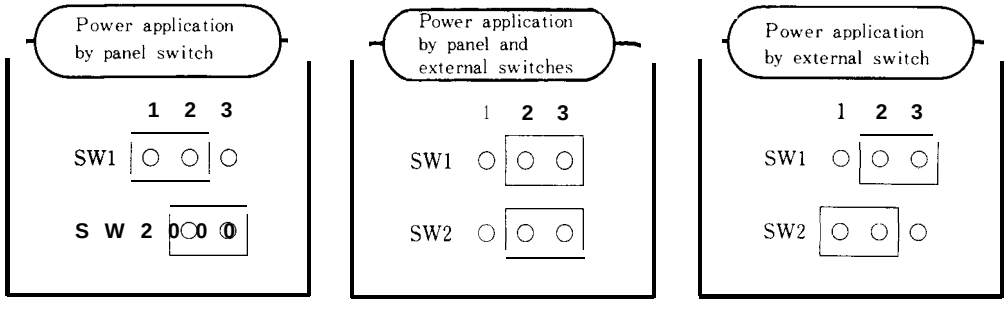

- **Model JANCD-FC31 O-1 (-2) /FC260**

D/A voltage adjustment VR: Adjusted at the factory before delivery. Readjustment is unnecessary.

VR1: First spindle gain adjustment
VR2: First spindle zero adjustment
(VR3: Second spindle gain adjustment).
(VR4: Second spindle zero adjustment)

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

▪Model JANCD-FC400

Swl : System number switch (16-position rotary switch)

SW1[0]: **Normal operation mode**
When power is applied, the system is started up in synchronization with NC and an application program (index "1") is executed immediately.

[11: NC **built-in program development mode**
When power is applied, the system is started up in synchronization with NC and the screen of application program development mode is displayed.

[2]: Stand-alone **execution mode**
When power is applied, ACGC is started up singly and an application program (index "1") is executed immediately.

[41: Stand-alone **program development mode**
When power is applied, ACGC is started up singly and the screen of application program development mode is displayed.

Note SW [3], and [5] to [F] are used only for maintenance. Only YASKAWA service personnel must use these switches.


7

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com


7. SETTING AND ADJUSTMENT OF EACH MODULE (Cent'd)

.Model JAN CD-FC800

(1) Swl: 1/0 address selection switch

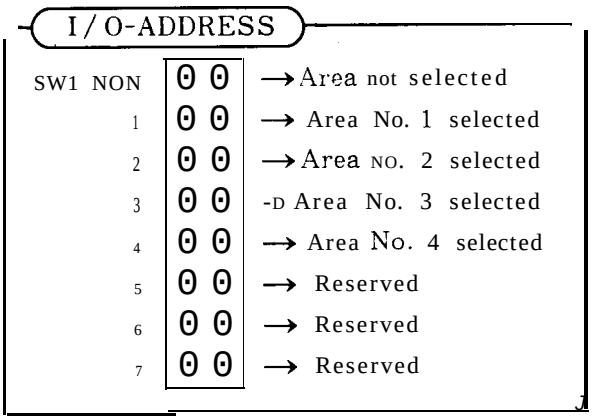


(2) SW2: Logical reverse switch

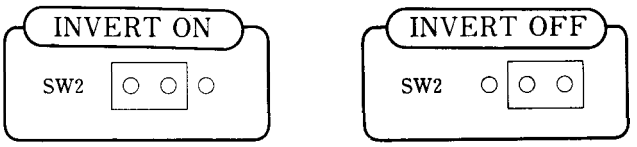

Note **This switch activates or deactivates the function for using logical "1" as the logic when contact is closed, regardless of +24 V/0$_{24}$.**

(3) SW3: Terminator

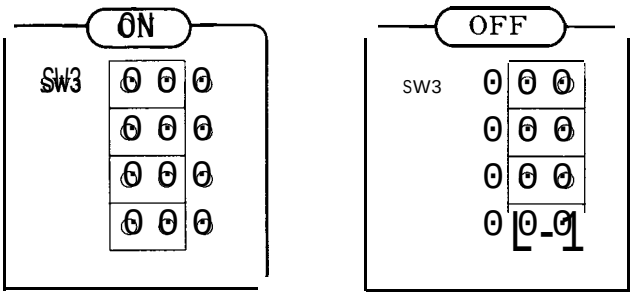

1. For a single remote 1/O board used and the last of two or more remote 1/0 boards used, set the switch to the ON position,

2. In other cases, set the switch to the OFF position.

Note **Set the switch so that all positions are set to OFF or ON.**


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(4) Relationship Between Area Numbers and 1/0 Address Ports

Input Port				Output Port			
Model JAN CD-FC9		Model JAN CD- FC80C		Model JAN CD- FC903		Model JAN CD- FC800	
Area number	Addres port	Area number	Address port	Area number	Address port	Area number	Address port
1 – 1	#looo ≀ #loo7	1	#1000 ≀ #1013	1 – 1	#1100 ≀ #1103	1	#1100 ≀ #1111
1 – 2	#1008 ≀ #1015			1 – 2	Prohibited		
2 – 1	#1016 ≀ #1023	2	#1016 ≀ #1029	2 – 1	#1116 ≀ #1123	2	#1116 ≀ #1127
2 – 2	#1024 ≀ #1031			2 – 2	Prohibited		
3 – 1	#1032 ≀ #1039	3	#1032 ≀ #1045	3 – 1	#1132 ≀ #1135	3	#1132 ≀ #1143
3 - 2	#1040 ≀ #1047			3 – 2	Prohibited		
	None	4	#1048 ≀ #1061		None	4	#1148 ≀ #1159
	None	5	#1064 ≀ #1077		None	5	# 1164 ≀ #1175

•Model JAN CD-FC900B

SW1, SW2 , SW3 : **Video signal timing adjustment switch**

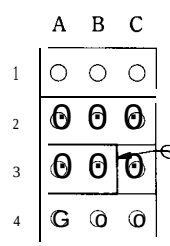

Standard setting at delivery


7

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

7. SETTING AND ADJUSTMENT OF EACH MODULE (Cent'd)

.Model .JANCD-FC903

Swl : I/O address selection switch

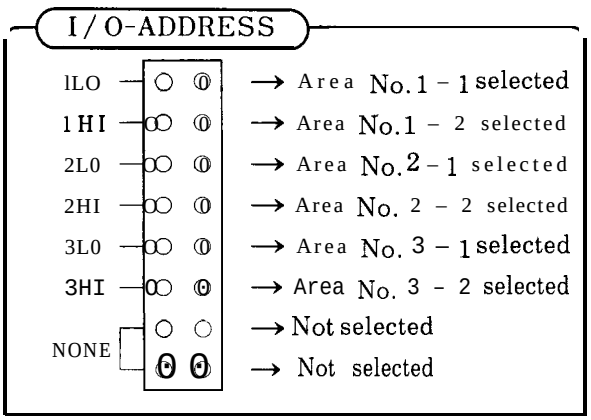


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

8. OPERATIONS OF FIXED FILES

Fixed files refer to all data files to determine the operation conditions of NC unit, such as parameters and settings.
This section explains the types, disp ays, and writing of fixed files.
This section should be understood fully for operation.

CONTENTS

8. OPERATIONS OF FIXED FILES 203
8.1 **TYPES OF FIXED FILES** 204
8.2 **DISPLAY AND WRITING OF** FIXED FILES 205

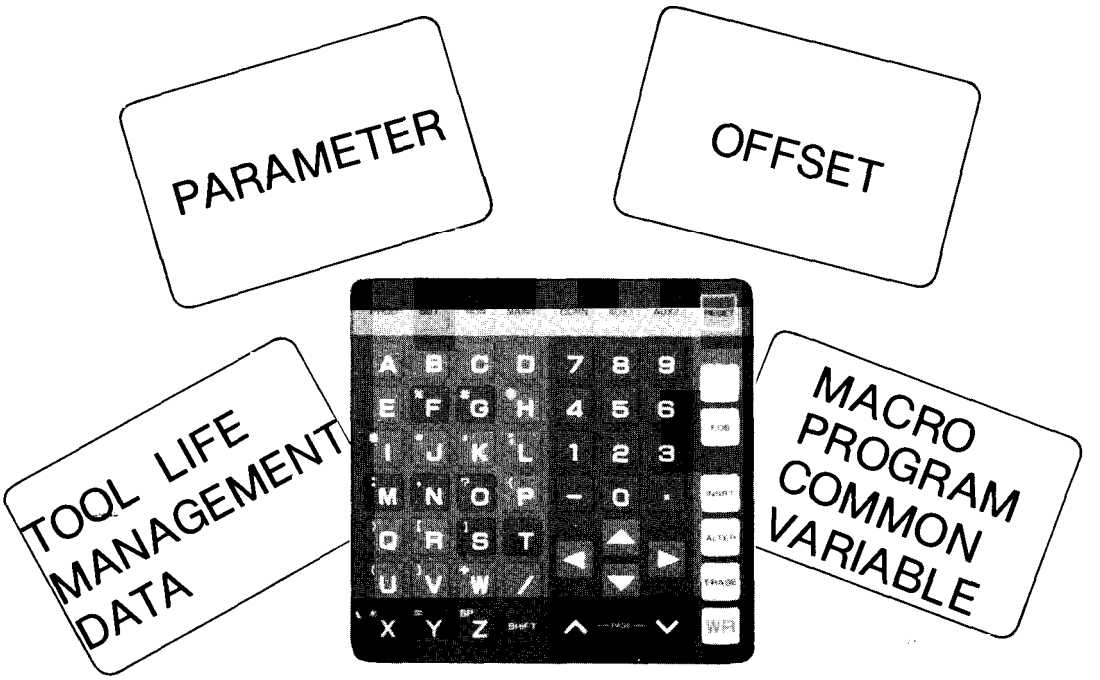


8

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

8.1 TYPES OF FIXED FILES

Types of fixed files are shown below. The asterisk (*) indicates an option.

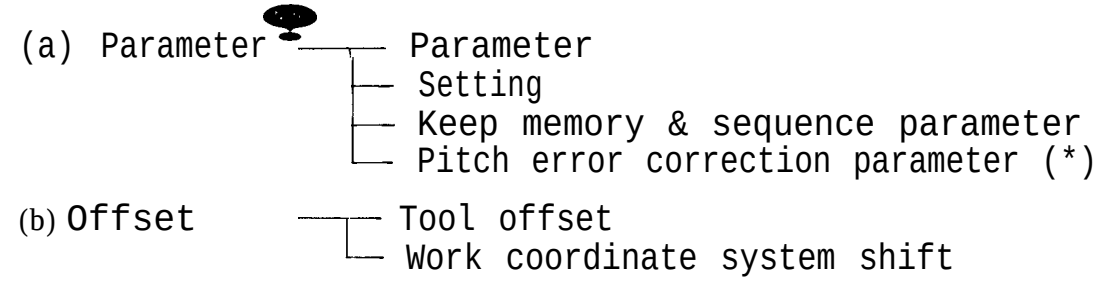

Note

This unit places various parameters **in internal memory. According to their contents, unit operation conditions such as tape codes and rapid feed speeds are determined. Parameters can be displayed at all times, including during automatic operation, regardless of the mode. For the contents of parameters, refer to Section** 9 **" PARAMETER NUMBERS" of Appendix (TOE** -C843-11**. 31) of YASNAC i80M Instruction Manual or Appendix (TOE-C843-11. 21) of YASNAC i80L Instruction Manual. For the contents of sequence parameters** (pm7000 **to** pm7099) **, refer to the manual issued by the machine manufacturer. Keep memory contains important in formation for controlling g machine sequences, which is held even when power is turned** off. **Incorrect setting may lead to machine trouble. Great care should be taken according to the manual issued by machine manufacturer.**

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

8.2 DISPLAY AND WRITING OF FIXED FILES

Each fixed file permits screen display, writing, and 1/0 verification.

Table 8.1 Display, Writing, and I/O Verification of Fixed Files

Item		Display Screen and Write Process	System No. Interlock	I/O Verification Process	System No. Interlock
Parameter	Parameter	Maintenance	Available	Maintenance	Available
	Setting	maintenance, Drive	Not available	Maintenance	Not available
	Keep Memory	Maintenance	Available	Maintenance	Available
	Pitch Error	Maintenance	Available	Maintenance	Available
Offset	Tool Offset	Step	Not available	Maintenance	Not available
	Workpiece Coordinate System	Step	Not available	Maintenance	Not available
Tool Life Management		Step	Not available	Maintenance	Not available
Macro Program Common Variable		Drive	Not available	Maintenance	Not available

Note

System number and interlock have the following rules:

1. For writing of parameters and keep memory, system number must be set to 1. A system number is set by the parameter replacement switch on the control panel or to the value pm0109.
2. Setting of parameter replacement switch
   OFF: SYSTEM (pmO109 = O). Normal operation is performed
   Writing of parameters is prohibited,
   ON: PARAMETER (pm0109 = 1). Selected to write parameters.
   Cycle start is prohibited.
3. When other than the values shown above is specified, normal operation cannot be guaranteed.
4. Effective only when the system number switch on the FC200 board is set to O.
5. System number setting pm0109 must be used as O, except when writing parameters


8

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

8.2 DISPLAY AND WRITING OF FIXED FILES (Cent'd)

(1) Displaying and Writing Fixed File

(a) Parameter Function

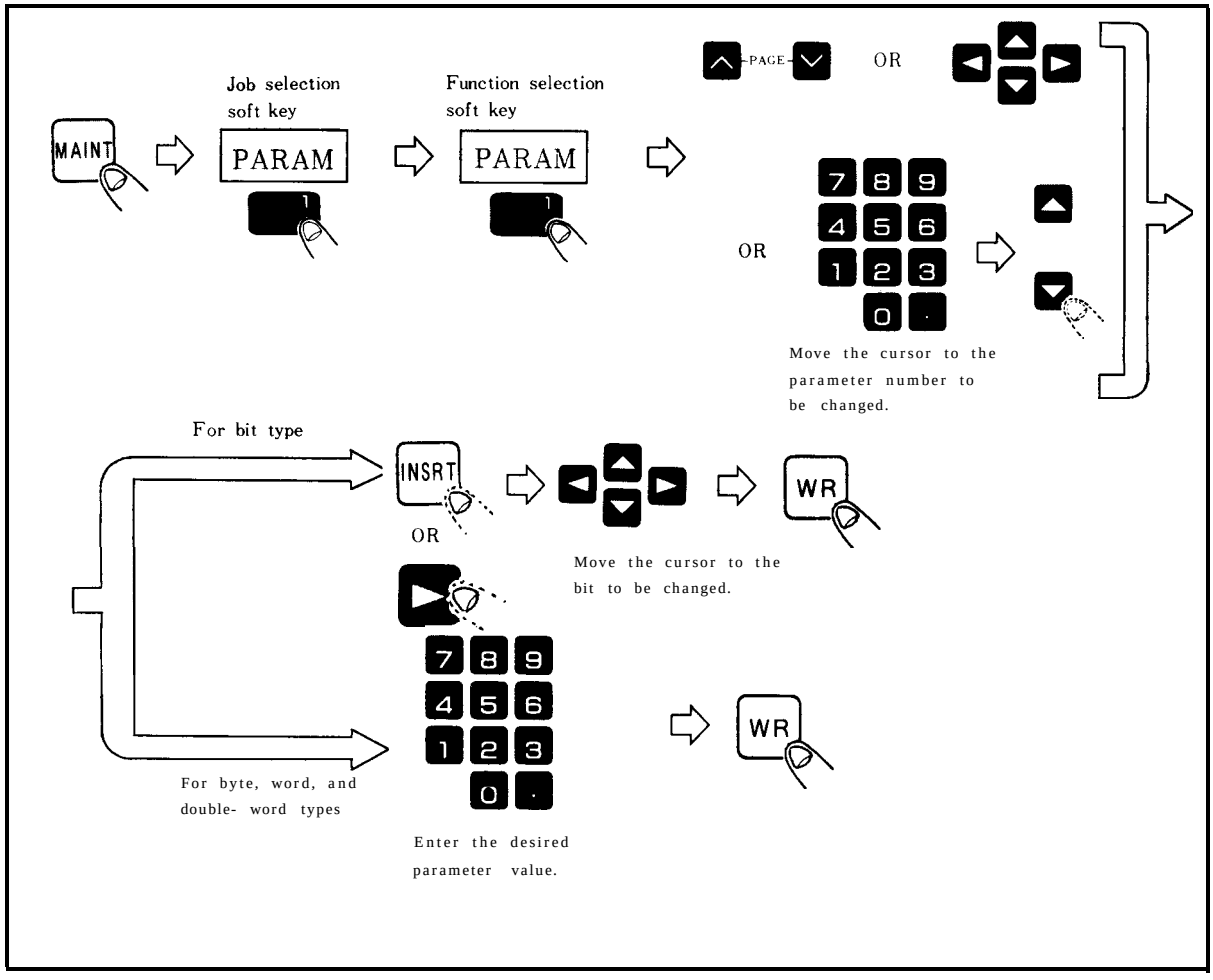


(a) Depress the MAINT key.

(b) Depress the PARAM 1 job selection soft key.

(c) Depress the PARAM 1 function selection soft key.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(d) Move the cursor to the parameter number to be changed, by one of the following operations:

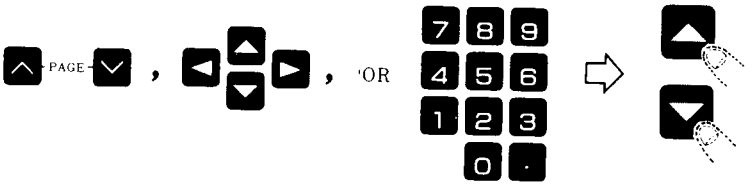

Enter a parameter number.

(e) Parameter numbers are of bit type, or byte, word, and double-word types, depending on the numbers.

Note **For details of parameter numbers, refer to Section 9 "PARAMETER NUMBERS" of Appendix (TOE-C843-11.31) of YASNAC i80M Instruction Manual or Appendix (TOE-C843-11.21) of YASNAC i80L Instruction Manual.**

- **For bit type** → (f)
- **For byte, word, and double-word types** → **(h)**

(f) Depress the INSRT, , or cursor key.

—— The cursor moves to the desired bit position,

8

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(g) Movethe cursor to the bit to be changed and depress the WR key.

Each time the WR key is depressed, the bit is turned ON or OFF.

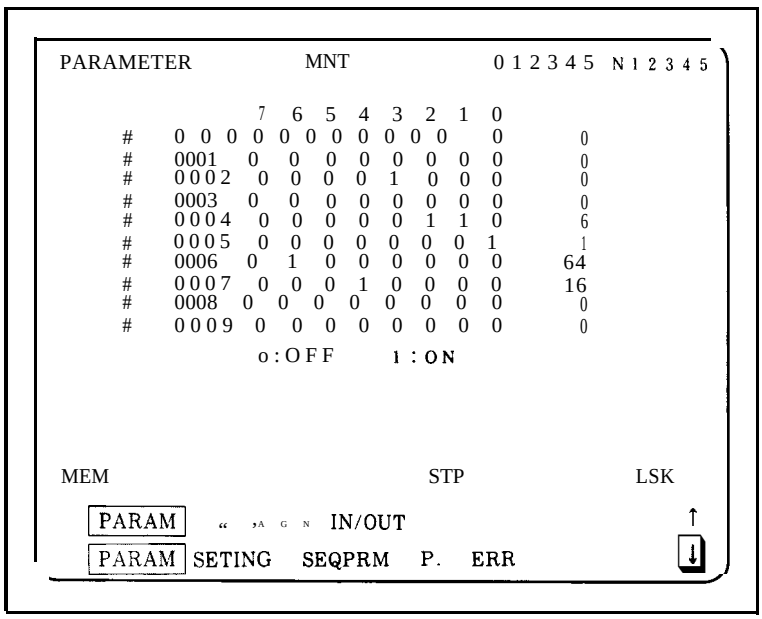


Fig. 8.1 Bit Type Screen

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(h) Enter the desired parameter value.

(i) Depress the WR key.

— The parameter value is entered.

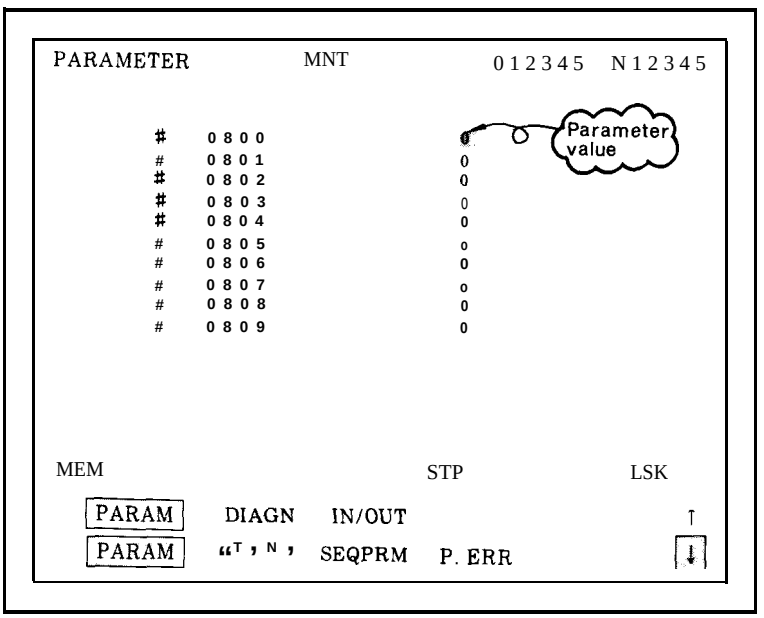



Fig. 8.2 Byte, Word, Double-Word Type Screen

8

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

8.2 DISPLAY AND WRITING OF FIXED FILES (Cent'd)

(b) Setting Function

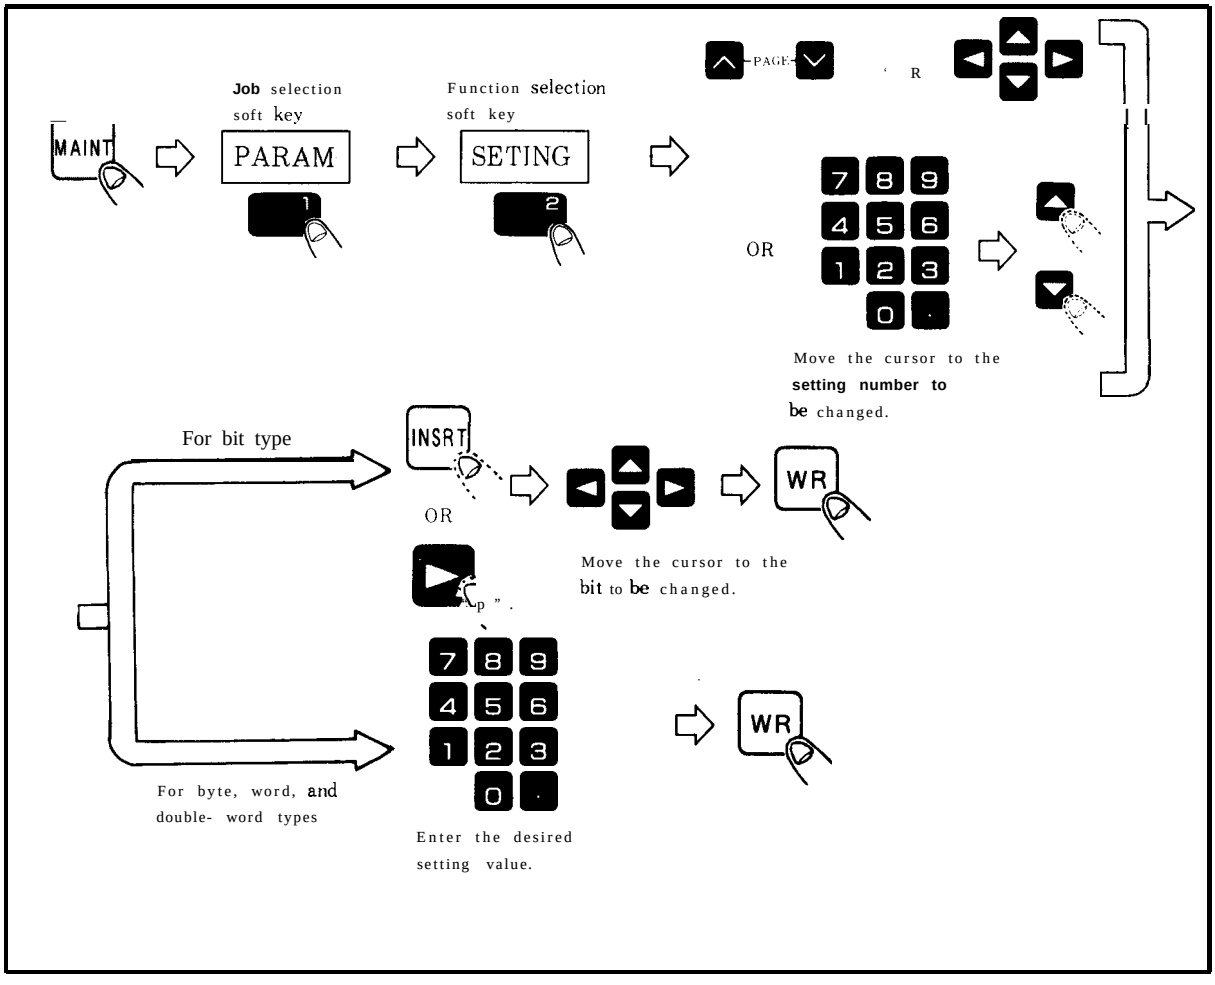


(a) Depress the MAINTAIN key.

(b) Depress the PARAM job selection soft key.

(c) Depress the SETING fun ction selection soft key,

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(c) Keep Memory Function

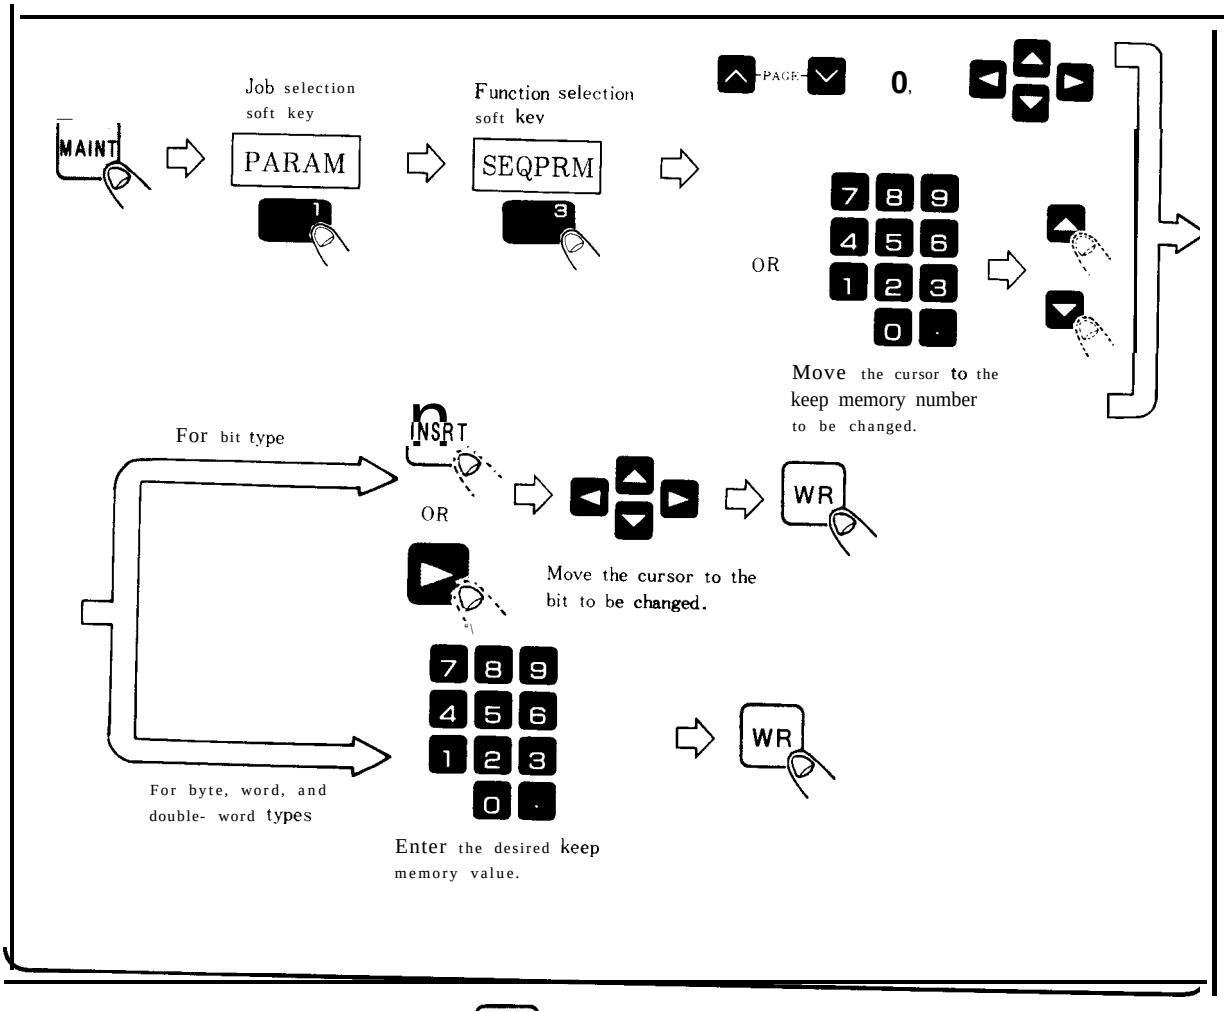

(a) Depress the MAINT key.


(b) Depress the PARAM 1 job selection soft key.

(c) Depress the SEQPRM 3 function selection soft key.

8

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(d) Move the cursor to the setting number to be changed, by one of the following operations:

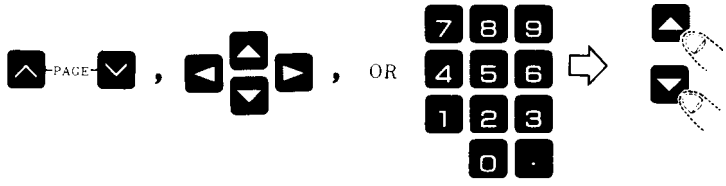

Enter a setting number.

(e) Setting numbers are of bit type, or byte, word, and double-word types, depending on the numbers.

> **.For bit type — (f)**
> **.For byte, word, and double-word types — (h)**

(f) Depress the INSRT or ▶ **cursor key.**

— The cursor moves to the desired bit position .

(g) Move the cursor to the bit to be changed and depress the WWR key.

Each time the WR key is depressed, the bit is turned on or off.


(h) Enter the desired parameter value.

(i) Depress the WR key.

— The setting value is entered.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(d) Move the cursor to the keep memory number to be changed, by one of the following operations:

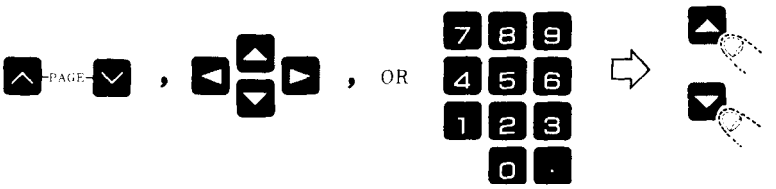

Enter a keep memory number.

(e) Keep memory numbers are of bit type, or byte, word, and double-word types, depending on the numbers.

- For bit type → (f)
- For byte, word, and double-word types → (h)

(f) Depress the INSRT key,

— The curse} moves to the desired bit position.

(g) Move the cursor to the bit to be changed and depress the WR key.

Each time the WR key is depressed, the bit is turned on or off.

(h) Enter the desired keep memory value.

(i) Depress the WR key.


— The keep memory value is entered.

8

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

8.2 DISPLAY AND WRITING OF FIXED FILES (Cent'd)

(d) Pitch Error Function

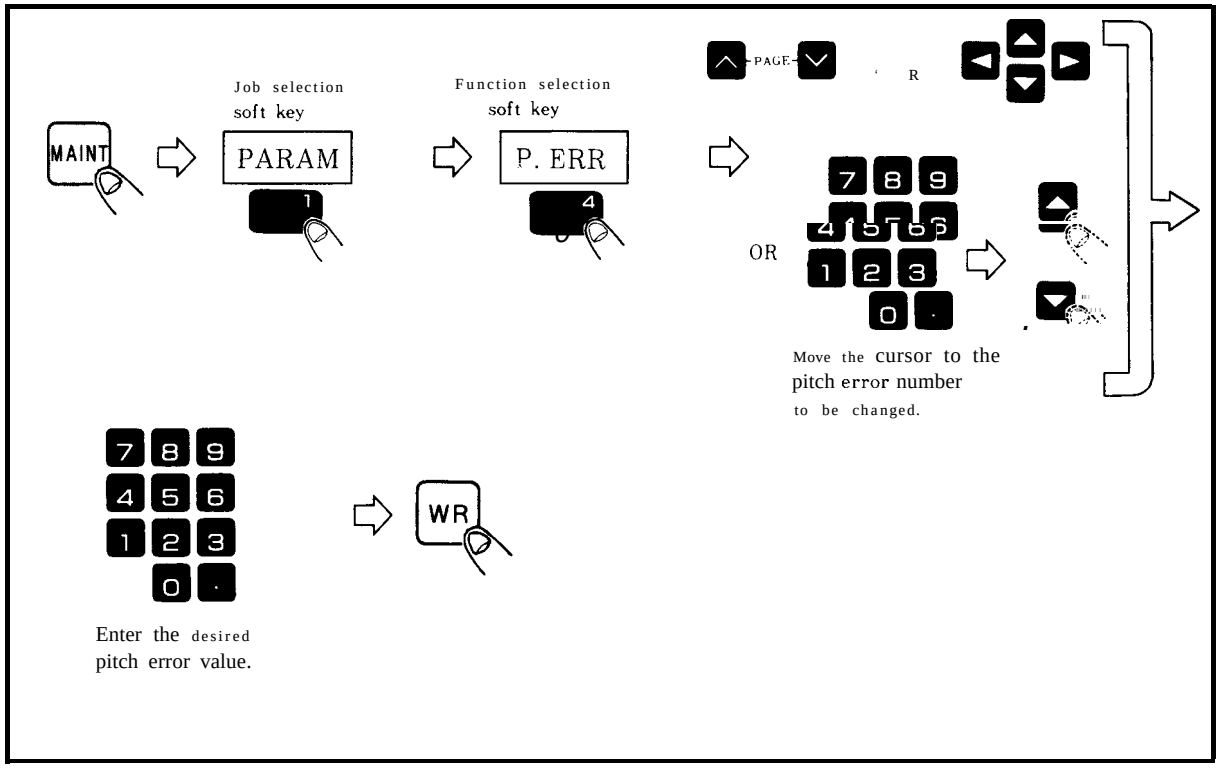

(a) Depress the MAINTAIN key.

(b) Depress the PARAM job selection soft key,

(c) Depress the P. ERR function selection soft key.

(d) Move the cursor to the pitch error number to be changed, by one of the following operations:

PAGE , , OR

Enter a pitch error number.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

(e) Enter the desired pitch error number.

(f) Depress the 

key.

— The pitch error number is entered.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

YASNAC i80

CNC SYSTEM FOR MACHINE TOOLS

MAINTENANCE MANUAL

TOKYO OFFICE Ohtemachi Bldg, **I-6-I** Ohtemachi, Chiyoda-ku, **Tokyo, 100 Japan**
Phone (03)3284-9111 Telex YASKAWAJ33530 Fax (03)3284-9034
YASKAWA ELECTRIC AMERICA, INC.
Chicago-Corporate Headquarters **2942 MacArthur Blvd.** Northbrook, IL **60062-2028,** U.S.A
Phone (708)291-2340 Fax (708)498-2430
Chicago-Technical Canter 3160 MacArthur Blvd. **Northbrook, IL 80082-1917,** U.S.A
Phone (708)291-0411 Fax (70S) 291-1018
MOTOMAN INC.
805 Liberty **Lane West** Carrollton, **OH 45449,** U.S **A**
Phone (513) 847-6200 Fax (513) 847-6277
YASKAWA ELÈTRICO DO BRASIL COMÉRCIO LTDA.
Rua Conde **Do** Pinhal 8-5°, Andar **Sala 51 CEP 01501-S50** Paulo-SP, **Brash**
Phone (011) 35-1911 Fax (011) 37-7375
YASKAWA ELECTRIC EUROPE GmbH
Am Kronberger **Hang 2, 65824** Schwalbach, **Germany**
Phone (49) 6196-569-300 Fax (49) 6196-888-301
Motoman Robotics AB
Box 130 S-38500. Torsås, **Sweden**
Phone O4B6-10575 Fax 0486-11410
Motoman Robotec GmbH
Kammerfeldstraße **1, 85391** Allershausen, **Germanv**
Phone 08166-900 Fax 08166-9039
YASKAWA ELECTRIC UK LTD.
3 Drum Mains Park Orchardton **Woods** Cumbernauld, **Scotland, G68 9LD** U.K
Phone **(236)735000 Fax (236)458182**
YASKAWA ELECTRIC KOREA CORPORATION
8th Floor Seoul Center Bldg, **91-1,** Sogong-Dong, Chung-ku, **Seoul, Korea 100-070**
Phone . (02)776-7844 Fax .[02)753-2639
YASKAWA ELECTRIC (SINGAPORE) PTE. LTD.
Haad Office : CPF Bldg, **79 Robinson Road** #13-05, Singapore **0106, SINGAPORE**
Phone 221-7530 Telex (87) 24890 YASKAWA RS **Fax 224-5854**
service Center :221 Henderson Road, # 07-20 Henderson Building Singapore **0315, SINGAPORE**
Phone 276-7407 Fax 276-7406
YATEC ENGINEERING CORPORATION
Shen Hsiang **Tang Sung** Chiang Building **10F 146 Sung** Chiang **Road, Taipei,** Taiwan
Phone (02) 563-0010 Fax (02) 567-4677
SHANGHAI OFFICE Room No 8B **Wan** Zhong **Building 1303 Yan An Road (West), Shanghai 200050, CHINA**
Phone (86) 212-1015 Fax (86) 212-1015
TAIPEI OFFICE Shen Hsiang Tang Sung Chiang Building 10F 146 Sung Chiang **Road, Taipei, Taiwan**
Phone (02) 563-0010 Fax (02) 567-4677

YASKAWA ELECTRIC CORPORATION

YASKAWA

TOE-C843-11.2E
© **Printed in Japan December 1994 91**
590.111

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Artisan Technology Group is an independent supplier of quality pre-owned equipment

Gold-standard solutions

Extend the life of your critical industrial, commercial, and military systems with our superior service and support.

We buy equipment

Planning to upgrade your current equipment? Have surplus equipment taking up shelf space? We'll give it a new home.

Learn more!

Visit us at **artisantg.com** for more info on price quotes, drivers, technical specifications, manuals, and documentation.

Artisan Scientific Corporation dba Artisan Technology Group is not an affiliate, representative, or authorized distributor for any manufacturer listed herein.

We're here to make your life easier. How can we help you today?

(217) 352-9330 | sales@artisantg.com | artisantg.com

ARTISAN® TECHNOLOGY GROUP