

ARTISAN®
TECHNOLOGY GROUP

Your **definitive** source for quality pre-owned equipment.

Artisan Technology Group
(217) 352-9330 | sales@artisantg.com | artisantg.com

Full-service, independent repair center
with experienced engineers and technicians on staff.

We buy your excess, underutilized, and idle equipment
along with credit for buybacks and trade-ins.

Custom engineering
so your equipment works exactly as you specify.

- Critical and expedited services
- In stock / Ready-to-ship
- Leasing / Rentals / Demos
- ITAR-certified secure asset solutions

Expert team | Trust guarantee | 100% satisfaction

All trademarks, brand names, and brands appearing herein are the property of their respective owners.

Find the *Cognex MVS-8110/CVM1-32* at our website: ***Click HERE***

Cognex MVS-8000 Series

OMI 2.3.1 Release Notes

OMI 2.3.1

590-6413

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

The software described in this document is furnished under license, and may be used or copied only in accordance with the terms of such license and with the inclusion of the copyright notice shown on this page. Neither the software, this document, nor any copies thereof may be provided to or otherwise made available to anyone other than the licensee. Title to and ownership of this software remains with Cognex Corporation or its licensor.

Cognex Corporation assumes no responsibility for the use or reliability of its software on equipment that is not supplied by Cognex Corporation. Cognex Corporation makes no warranties, either express or implied, regarding the described software, its merchantability or its fitness for any particular purpose.

The information in this document is subject to change without notice and should not be construed as a commitment by Cognex Corporation. Cognex Corporation is not responsible for any errors that may be present in either this document or the associated software.

Copyright © 2001 Cognex Corporation
All Rights Reserved
Printed in U.S.A.

This document may not be copied in whole or in part, nor transferred to any other media or language, without the written permission of Cognex Corporation.

The hardware and portions of the software described in this document may be covered by one or more of the following U.S. patents. Other U.S. and foreign patents are pending. Patents are categorized for convenience only, and may fall into other listed or unlisted categories.

BGA:	6,067,376; 6,115,042; 6,118,893; 6,130,959; 6,141,009; 6,151,406
Calibration:	5,960,125; 5,978,080; 5,978,081; 5,978,521
Checkpoint:	5,481,712 and other Vision Tools and Hardware patents
Hardware:	4,972,359; 5,526,050; 5,657,403; 5,793,899; 5,982,395; 6,124,889; 6,157,751
Image Acquisition:	6,025,854; 6,025,905
Lighting and Optics:	5,367,439; 5,861,910; 5,912,768; 5,953,130; 6,011,586
Surface Inspection:	6,092,059
Surface Mount Devices:	5,371,690; 5,500,906; 5,801,966; 5,805,722; 5,933,523; 5,978,502; 6,026,176
Vision Applications:	4,728,195; 5,673,334; 5,859,923; 5,878,152; 5,900,975;5,918,196; 5,970,166; 5,982,927; 5,987,159; 6,134,343; 6,148,120
Vision Programming:	5,481,712; 5,964,844
Vision Tools:	5,495,537; 5,548,326; 5,583,954; 5,602,937; 5,640,200; 5,717,785; 5,742,037; 5,751,853; 5,768,443; 5,796,868; 5,818,443; 5,825,483; 5,825,913; 5,845,007; 5,850,466; 5,872,870; 5,909,504; 5,943,441; 5,949,901; 5,949,905; 5,974,169; 5,987,172; 5,995,648; 6,002,793; 6,005,978; 6,055,328; 6,061,476; 6,064,388; 6,067,379; 6,075,881; 6,078,700; 6,137,893; 6,141,033; 6,154,567; 6,157,732; 6,167,150
Wire Bonder:	5,532,739; 5,550,763; 5,581,632; 5,640,199; 5,642,158; 5,676,302; 5,754,679; 5,757,956; 5,796,868; 5,835,622; 5,861,909; 5,901,241; 5,912,984; 5,991,436; 6,035,066; 6,061,467

The following are registered trademarks of Cognex Corporation:

acuCoder	acuFinder	acuWin	Checkpoint	Cognex, Vision for Industry	
Cognex	CVL	ID Expert	PasteInspect	PatInspect	PatMax
PatQuick	PixelProbe	Virtual Checksum	VisionPro	VisionX	

The following are trademarks of Cognex Corporation:

The Cognex logo	acuLight	acuReader	BGAII	CIT	CNLPAS
CNLSearch	Cognex 1500	Cognex 1600	Cognex 2000	Cognex 3000	Cognex 4000
Cognex 5000	Cognex 8000	CVC-1000	DisplayInspect	DisplayQuick	FiberInspect
ID Sensor	In-Sight	MVS-7000	MVS-8000	MVS-8100	MVS-8110
MVS-8120	MVS-8200	MVS-8200/CPCI	MVS-8200/PCI	MVS-8200/VME	MVS-82400
MVS-82400/CPCI	MVS-82400/PCI	MVS-82400/VME	Non-Linear OCR	Object Manager	OMI
PatFind	SMD4	UltraLight	VAN	VC1	VC2
VC3	VC4	Vision Appliance	VisionLinx	Vision Solutions	WinOCR
WireBonder II					

Other product and company names mentioned herein may be the trademarks of their respective owners.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Contents

About This Release 8
New in OMI 2.3.1 8
New in OMI 2.3 8
Hardware Supported 9
Cognex Frame Grabbers Supported 9
Multi-CPU Systems Supported 9
Dual Frame Grabber Configurations Supported 10
Cameras and Video Formats Supported 11
Cameras and Camera Lenses 11
Special Camera Settings 11
MVS-8100, MVS-8100M, and MVS-8100M+ Supported Cameras 12
MVS-8100L Supported Cameras 13
MVS-8100C Supported Cameras 14
MVS-8110 Supported Cameras 14
CVM1 Supported Cameras 15
CVM4 Supported Cameras 16
CVM6 Supported Cameras 17
MVS-8120 Supported Cameras 18
CVM1 Supported Cameras 18
CVM4 Supported Cameras 19
CVM6 Supported Cameras 19
Video Formats Supported In This Release 20
Host System Information 26
System Requirements 26
Video Card Requirements 27
Operating System Requirements 28
Service Pack Requirements 28
Installation Information 30
Before You Install 30
Installing OMI Software 30
Windows 2000 Installation 31
Windows NT Installation 31
Windows 98 Installation 32
Installing Adobe Acrobat Software 33
Uninstalling OMI Software 33
Uninstalling Windows 2000 Drivers 33
Uninstalling Windows NT Drivers 34
Uninstalling Windows 98 Drivers 34
Documentation Supplied With This Release 35
Hardware Limitations 37
Incorrectly Configured MVS-8100 May Fail Silently 37

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Contents

Cannot Install MVS-8100L Drivers 37
MVS-8100L Appears Twice in Device Manager Listings 37
PCI Bus Compatibility Problem 38
Genlock Not Supported with Pulnix TM-9701 and Sony XC-003 38
MVS-8100C Does Not Support 6-Bit Acquisition 38
OMI Software Information 39
New in OMI 2.3.1 39
Edit Mask Button Launches Mask Editor 39
Enhancements to OCVLine 39
New in OMI 2.3 39
Bc Object 39
Bc Object Dialog Box Changes 39
Bc Object API Changes 40
Image Object 40
Image Object Dialog Box Changes 40
Image Object API Changes 40
Image and Mask Editor 41
Visual Basic Notes 41
Strings Returned by Functions Must be Allocated 41
Display Notes 42
Fast Live Video and Desktop Color Depth 42
Colormap Flashing When Switching Apps Using 256-color Desktop ... 42
OMI Now Uses DMA at All Times 43
Form Containing Display OCX Must Use Correct Palette 43
Object Manager Notes 43
Global Objects Referenced by Other Objects Cannot be Reloaded 43
Image Acquisition Notes 43
Genlock Supported for One Camera Port on MVS-8110 43
Using Two Digital Cameras with CVM6 43
Image Artifacts 44
Setting Image Properties in Semi-Trigger and Auto-Trigger Modes 44
Unarmed Triggers in Semi-Trigger Mode Can Cause Overrun Error 44
Symbol Object Notes 45
Symbol Tool Can Fail after Initial Success 45
Preventing Decode() Failure on Certain Symbols 45
Sample Code Notes 46
Threads Sample Program Limited to Four Threads 46
C++ Sample Code Displays Extra Warnings 46
Known Bugs and Issues 47
OmiWin Issues 47
Incomplete Updates When View Is Closed 47
World Coordinates, Color Pixels in Status Bar 47
Cannot Save Color Images Using File->Save 47
Cannot Display Unwrapping Region Whose Curve > 358 47

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Double-Clicking .OMI/.MAC File Only Works If OMIWin Not Running .. 48
OMI May Lock Up After Pressing Ctrl-Alt-Del or If Screen Saver Becomes Active with Live Display 48
Applications Built Using OMI 48
OMI Application Always Loses Focus When Started 48
System Limitations 48
Only Use Pulnix TM-6CN for Strobed Acquisition Using Genlock 48
Limited Support for Overlay Graphics on Color Images on Win98 48
Multiple Monitors Not Supported Under Win98 49
Manual Strobing Only Suitable for Diagnostic Purposes on MVS-8100 49
Poor Performance Switching Genlocked Cameras on MVS-8110 49
32-Bit Desktop, Can't Display Mono and Color Live from XC-003 49
MVS-8100C, XC-75CE, Win95/98: Master/Slave Hangs or Reboots PC 49
Calib Object 49
Point Calibration is Now Linear 49
CNLSearch Object 50
Point Search Not Available for Nonlinear Algorithms 50
Display Object 50
AcuDisplay::Refresh() Argument Ignored 50
MVS-8110, Strobe, XC-75CE or TM-7EX: Bad Image After Live Video . 50
MVS-8100C, XC-75CE, Full Format Live Video: Corrupted Image 50
Image Object 51
CCIR Formats Different Size on MVS-8100 and MVS-8110 51
May Need to Adjust CTI Offset For XC-75CE on MVS-8100 51
KP-F100: OMI Hangs If Selected Port Has No Camera 51
Color Camera Ports Confusing on MVS-8100C 51
MVS-8100C Problems with Strobed Acquisitions 52
KP-F100 Images Jump When Leaving Live Video 52
Activating Live Video for Master or Slave Hangs OMI 52
Problems Switching From Slave to Manual Mode On MVS-8110 52
6-Bit Live Video Appears Dark 52
Images Black on MVS-8100 for Genlocked Sony XC-75/XC-75CE 53
Strobe Does Not Fire on First Acquisition 53
Leftmost Pixels Dark When Using XC-75CE Under Certain Conditions 53
Pulnix TM-6CN Requires Genlock Enabled on MVS-8100M and MVS-8100C 53
OcvFont Object 53
ShowExtractArea() Only Works If Dialog Box Is Open 53
Overlay Object 54
Live Video Display Affected by Overlay Object 54
MVS-8110/CVM1 and XC-55: Moving Box Overlay Hangs OMI 54
PMPattern Object 54
PMPattern Cannot Be Trained with Nonlinear Calibration 54
Proces Object 55
Functions that Require 6-Bit Images Not Available with MVS-8100C ... 55

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Contents

View Object 55
25% Zoom Can Produce Incorrect Offsets 55
OMI Documentation Notes 56
Documentation Corrections 56
Functions Return Zero As Warnings 56
Documented Limit No Longer Exists for ImageSharpness 56
IDB Editor Can Open Image and Mask Editor 56

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

OMI 2.3.1 Release Notes

This document describes the OMI 2.3 software release for the MVS-8100, MVS-8100L, MVS-8110, and MVS-8120. These release notes contain the following sections:

- *About This Release* provides an overview of the contents of this release of the OMI software.
- *Hardware Supported* describes the Cognex hardware supported by this release of OMI.
- *Cameras and Video Formats Supported* lists the cameras and video formats supported in this release of OMI as well as the camera cables you need to connect cameras to your frame grabber.
- *Host System Information* describes the PC host system you need to run OMI, including information about video cards.
- *Installation Information* describes how to install the OMI software.
- *Hardware Limitations* contains information about specific Cognex frame grabbers.
- *OMI Software Information* contains information about the OMI software supplied with this release.
- *Known Bugs and Issues* lists system limitations and software bugs known at the time of this release, the conditions under which they occur, and available workarounds.
- *OMI Documentation Notes* contains information about the documentation associated with this release.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

About This Release

This section provides an overview of the specific features of this release of OMI.

New in OMI 2.3.1

OMI 2.3.1 is identical to OMI 2.3 with the following enhancements:

- The Cognex MVS-8100L frame grabber is now supported.
- Enhancements to the OCVLine tool (see *Enhancements to OCVLine* on page 39).
- Minor bug fixes.

New in OMI 2.3

OMI 2.3 includes the following features added or improved since the release of OMI 2.2:

- The Cognex MVS-8120 frame grabber is now supported. The MVS-8120 is an update and a replacement for the MVS-8110. Support for the MVS-8110 continues in OMI 2.3
- Support for improved I/O option boards for the MVS-8120.
- New support for BC128 barcode reading and improved performance for other barcodes.
- New support for acquisition of color images for processing. All three planes (RGB) are acquired at once, but only one plane can be processed at a time.
- Support for Windows 2000. Support for Windows 95 is discontinued in OMI 2.3
- Various bug fixes and enhancements including those that were provided as patches to OMI 2.2.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Hardware Supported

This section describes the Cognex hardware and hardware configurations that OMI 2.3.1 supports.

Cognex Frame Grabbers Supported

OMI 2.3.1 supports the following Cognex frame grabbers and Windows operating systems:

Cognex Frame Grabber	Windows 98 Windows 98J	Windows NT 4.0 Windows NT 4.0J	Windows 2000 Windows 2000J
MVS-8100 MVS-8100M	●	●	●
MVS-8100L	●	●	●
MVS-8100C	●	●	●
MVS-8110/CVM1 MVS-8110/CVM4 MVS-8110/CVM6		●	●
MVS-8120/CVM1 MVS-8120/CVM4 MVS-8120/CVM6	●	●	●

Table 1. Supported Cognex frame grabbers and Windows operating systems

Note OMI 2.3.1 supports the MVS-8100M+ only when its video input filter is configured to work as an MVS-8100M. To enable this configuration, see the *MVS-8100 Hardware Manual's* discussion of the settings for jumpers JP16 and JP17.

Multi-CPU Systems Supported

OMI 2.3.1 supports multi-CPU systems under Windows 2000 and Windows NT for all Cognex frame grabbers except for the MVS-8100L and the MVS-8110.

Multi-CPU systems are not supported under Windows 98.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Dual Frame Grabber Configurations Supported

Limited support for dual frame grabbers is available in this release. For specific configuration information, please contract your Cognex sales representative.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Cameras and Video Formats Supported

This section describes the cameras and video formats that OMI 2.3 supports. Camera support varies by frame grabber, and, if your frame grabber supports them, by Cognex Video Module (CVM).

To use this section effectively, look up the frame grabber and CVM you plan to use in the following sections. Then, refer to the section *Video Formats Supported In This Release* on page 20 to find out which video formats you can use.

Caution *The tables list the Cognex camera cables required. Cameras must be connected using the Cognex cables shown in these tables. Using non-Cognex camera cables could damage your Cognex hardware, your camera, or both.*

Cameras and Camera Lenses

You may purchase cameras for use with your frame grabber through Cognex, or you may use your own compatible cameras. Consult with your Cognex representative for cabling and other requirements if you plan to use non-standard cameras. Failing to do so may affect the warranty coverage on your vision processor.

Cognex offers a lens kit (P/N 800-1000), which includes five lenses (8.5 mm, 12.5 mm, 16 mm, 25 mm, and 50 mm F2.8 macro), a C-mount adapter, and an extension tube set.

Cognex also offers a variety of camera lenses that you can order individually, including all the lenses in the lens kit, plus 50 mm, 75 mm, and 135 mm lenses. You can also order a C-mount adapter, a 2X extender lens, or an extension tube set.

In the following tables, the term *rapid reset* means that the camera resets the sync signal the instant that a request for an image arrives.

Special Camera Settings

Certain supported cameras require special settings when used with MVS-8000 hardware. All special camera settings are listed in the hardware manual for your frame grabber.

The cameras that require special settings are:

- Sony XC-55 and XC-55BB
- Sony XC-ST50 and XC-ST50CE in rapid-reset mode
- Pulnix TM-9701

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

If you are using the Hitachi KP-F100 or Basler A113P digital cameras with an MVS-8120/CVM6, see the connection diagram and usage notes in the *MVS-8120 Hardware Manual*.

If you are using the Cognex CVC-1000 high-speed camera with an MVS-8120/CVM4, see the usage notes in the *MVS-8120 Hardware Manual*.

MVS-8100, MVS-8100M, and MVS-8100M+ Supported Cameras

The MVS-8100, MVS-8100M, and MVS-8100M+ frame grabbers support the RS-170 and CCIR cameras for monochrome image acquisition shown in Table 2. The table also shows the required Cognex cable for each camera.

Camera	Notes	Cognex Camera Cable Part Number
Sony XC-75 Sony XC-75CE		300-0181
Sony XC-55 Sony XC-55BB	Supported on 8100M and 8100M+ only	300-0239
Sony XC-ST50 Sony XC-ST50 CE	Interlaced	300-0181
Sony XC-ST50 RR Sony XC-ST50 CE RR	Supported on 8100M+ only	300-0317
Pulnix TM-9701		300-5180 plus adapter For MVS-8100, MVS-8100M, and MVS-8100M+ in MVS-8100 compatibility mode, use 300-5179 adapter. For MVS-8100M+ in CCF mode, use 300-0339 adapter.

Table 2. MVS-8100 cameras and cables

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Camera	Notes	Cognex Camera Cable Part Number
Pulnix TM-7EX		300-0155
Pulnix TM-6CN	Provides sync signals to the MVS-8100. See the *MVS-8100 Hardware Manual* for information on using an external sync source.	300-0264

Table 2. MVS-8100 cameras and cables

MVS-8100L Supported Cameras

You may purchase cameras for use with the 8100L through Cognex, or you may use your own compatible cameras. Consult with your Cognex representative for cabling and other requirements if you plan to use nonstandard cameras. Failing to do so may affect the warranty coverage on your vision processor.

Table 3 shows the supported cameras for the 8100L.

Camera	EIA/ CCIR	Notes	Cognex Camera Cable Part Number
Sony XC-75	EIA		300-0181
Sony XC-75CE	CCIR		300-0181
Sony XC-ST50	EIA	With switches in free-running mode	300-0181
Sony XC-ST50CE	CCIR	With switches in free-running mode	300-0181
Pulnix TM-6CN	CCIR	Supplies sync to the 8100L	300-0264
Pulnix TM-7EX	EIA		300-0155

Table 3. 8100L supported cameras and cables

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

MVS-8100C Supported Cameras

The MVS-8100C and MVS-8100C/CPCI frame grabbers support the RS-170 and CCIR cameras for monochrome image acquisition, and NTSC cameras for color image acquisition, shown in Table 4. The table also shows the required Cognex cable for each camera.

Camera	Type	Cognex Camera Cable Part Number
Sony XC-75	Monochrome, RS-170	300-0181
Sony XC-75CE	Monochrome, CCIR	300-0181
Sony XC-55, XC-55BB	Monochrome, electronic shuttered (rapid reset)	300-0239
Sony XC-ST50	Monochrome, RS-170	300-0181
Sony XC-ST50 CE	Monochrome, CCIR	300-0181
Pulnix TM-9701	Monochrome, RS-170, progressive scan	300-5180 with 300-5179 adapter
Pulnix TM-7EX	Monochrome, RS-170	300-0155
Pulnix TM-6CN	Monochrome, CCIR, provides sync to 8100C	300-0264
Sony XC-003	Color, NTSC	300-0243

Table 4. 8100C supported cameras and required camera cables

MVS-8110 Supported Cameras

The MVS-8110 frame grabber uses different Cognex Video Modules (CVMs) to support different cameras. The CVM is either on-board hardware or a factory-installed daughter card that provides the interface to the cameras. The following sections list the cameras supported by various CVMs when installed on an MVS-8110.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

CVM1 Supported Cameras

CVM1 has four independent acquisition channels, and allows the connection of up to four analog cameras. Image acquisitions can occur on all four camera channels simultaneously. The cameras that MVS-8110 frame grabbers support on CVM1 are shown in Table 5.

Camera	EIA / CCIR	Notes	Cognex Camera Cable Part Number
Sony XC-75	EIA RS-170	Interlaced, full, single-field or half-resolution	300-0099
Sony XC-75CE	CCIR	Interlaced, full, single-field or half-resolution	300-0099
Sony XC-75 RR	EIA RS-170	Rapid reset version of XC-75; half-resolution	300-0136
Sony XC-75CE RR	CCIR	Rapid reset version of XC-75CE; half-resolution	300-0136
Sony XC-7500	EIA		300-0200
Sony XC-55, Sony XC-55BB	EIA RS-170	Rapid reset, progressive scan, full resolution; must be used in E-DONPISHA II mode (set via switches)	300-0136
Sony XC-ST50	EIA RS-170	With switches in free-running mode; full, single-field or half-resolution	300-0099
Sony XC-ST50CE	CCIR	With switches in free-running mode; full, single-field or half-resolution	300-0099
Sony XC-ST50 RR	EIA RS-170	With switches in rapid reset mode; half resolution	300-0136 plus 300-0313 adapter *or* 300-0316 See caution below

Table 5. CVM1 supported cameras and cables

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Camera	EIA / CCIR	Notes	Cognex Camera Cable Part Number
Sony XC-ST50CE RR	CCIR	With switches in rapid reset mode; half resolution	300-0136 plus 300-0313 adapter *or* 300-0316 See caution below
Pulnix TM-9701	EIA RS-170	Rapid reset, progressive scan; full resolution	300-0127
Pulnix TM-7EX	EIA RS-170	Interlaced, full, half, or single-field resolution; camera must sync to vision processor	300-0127
Toshiba IK-M41MA			300-0208

Table 5. CVM1 supported cameras and cables

Caution *Cable 300-0316 and adapter 300-0313 are for use with the Sony XC-ST50 family of cameras only. Do not connect these cables to other Sony cameras such as the XC-75 or XC-55 or you may damage your CVM module, your camera, or both.*

CVM4 Supported Cameras

CVM4 is a camera video module for the Cognex CVC-1000 camera. The CVC-1000 is a high-speed, lightweight camera that requires the camera control functions resident in a separate CVM module. The CVC-1000 camera can be used only with a CVM4 module.

CVM4 can support simultaneous image acquisitions on up to four CVC-1000 cameras.

CVM4 supports a single camera, the Cognex CVC-1000, which is connected using the Cognex cable shown in Table 6.

Camera	Cognex Breakout Cable Part Number	Cognex Camera Cable Part Number
Cognex CVC-1000	Four-camera breakout cable, 300-0220	300-0223
	One-camera breakout cable, 300-0224	

Table 6. CVM4 camera cable part numbers

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Note CVC-1000 cameras must be connected in camera port order. See *CVC-1000 Usage Notes* in the MVS-8110 Hardware Manual for information on connecting CVC-1000 cameras.

CVM6 Supported Cameras

CVM6 has two independent acquisition channels for digital cameras and one independent acquisition channel for an analog camera. The cameras that MVS-8110 frame grabbers support on CVM6 are shown in Table 7.

Camera	A / D	EIA / CCIR	Type	Cognex Camera Cable Part Number
Hitachi KP-F100	D	RS-422	Digital, rapid reset	300-0214 plus 300-0266. Also requires power supply equivalent to Hitachi 45752C1
Sony XC-75	A	EIA RS-170	Interlaced, full, single-field or half-resolution	300-0181
Sony XC-75CE	A	CCIR	Interlaced, full, single-field or half-resolution	300-0181
Sony XC-55	A	EIA RS-170	Rapid reset, progressive scan, full resolution; must be used in E-DONPISHA II mode (set via switches)	300-0231
Sony XC-55 BB	A	EIA		300-0136
Sony XC-ST50	A	EIA RS-170	With switches in free-running mode; full or half resolution	300-0181
Sony XC-ST50CE	A	CCIR	With switches in free-running mode; full or half resolution	300-0181

Table 7. CVM6 supported cameras and cables

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

MVS-8120 Supported Cameras

The MVS-8120 uses different Cognex Video Modules (CVMs) to support different cameras. The CVM is a factory-installed daughter card that provides the interface to the cameras.

This section lists the CVMs used with the MVS-8120 and the cameras they support.

CVM1 Supported Cameras

CVM1 supports the RS-170 and CCIR cameras for monochrome image acquisition shown in Table 8. The table also shows the required Cognex cable for each camera.

Camera	EIA/ CCIR	Notes	Cognex Camera Cable Part Number
Sony XC-75	EIA	Interlaced	300-0099
Sony XC-75CE	CCIR	Interlaced	300-0099
Sony XC-75 RR	EIA	Rapid reset version of XC-75; half-resolution, single field	300-0136
Sony XC-75CE RR	CCIR	Rapid reset version of XC-75CE; half-resolution, single field	300-0136
Sony XC-55, Sony XC-55BB	EIA	Rapid reset, progressive scan; must be used in E-DONPISHA II mode (set via switches)	300-0136
Sony XC-ST50	EIA	Interlaced	300-0099
Sony XC-ST50CE	CCIR	Interlaced	300-0099
Sony XC-ST50 RR	EIA	Rapid reset version of XC-ST50	300-0316 -or- 300-0136 plus 300-0313
Sony XC-ST50CE RR	CCIR	Rapid-reset version of XC-ST50CE	300-0316 -or- 300-0136 plus 300-0313

Table 8. CVM1 supported cameras and cables

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Camera	EIA/ CCIR	Notes	Cognex Camera Cable Part Number
Pulnix TM-9701	EIA	Progressive scan	300-0127
Pulnix TM-7EX	EIA	Interlaced	300-0127
Pulnix TM-6CN	CCIR	Interlaced	300-0136

Table 8. CVM1 supported cameras and cables

CVM4 Supported Cameras

CVM4 supports only the Cognex CVC-1000 camera, shown in Table 9. The table also shows the required Cognex cable for that camera.

Camera	Cognex Breakout Cable Part Number	Cognex Camera Cable Part Number
Cognex CVC-1000	Four-camera breakout cable, 300-0220	300-0223
	One-camera breakout cable, 300-0224	

Table 9. CVM4 camera cable part numbers

Note If you are using the four-camera breakout cable, be sure to connect CVC-1000 cameras in numerical order: connect the first camera to branch 1, the second to branch 2, and so on. Do not skip any branches. See the hardware manual for your frame grabber for important information on connecting CVC-1000 cameras.

CVM6 Supported Cameras

CVM6 supports the analog and digital cameras shown in Table 10. The table also shows the required Cognex cable for each camera.

Camera	Type	Cognex Camera Cable Part Number
Sony XC-75	Analog, EIA	300-0181
Sony XC-75CE	Analog, CCIR	300-0181
Sony XC-55	Analog, EIA, rapid reset	300-0231

Table 10. CVM6 supported cameras and cables

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Camera	Type	Cognex Camera Cable Part Number
Sony XC-75 RR	Analog, EIA, rapid reset	300-0231
Sony XC-75CE RR	Analog, CCIR, rapid reset	300-0231
Sony XC-ST50	Analog, EIA	300-0181
Sony XC-ST50 RR	Analog, EIA, rapid reset	300-0318 -or- 300-0231 plus 300-0313
Sony XC-ST50CE	Analog, CCIR	300-0181
Sony XC-ST50CE RR	Analog, CCIR, rapid reset	300-0318 -or- 300-0231 plus 300-0313
Pulnix TM-9701	Rapid reset, progressive scan	300-0302
Pulnix TM-7EX	Analog, EIA	300-0302
Pulnix TM-6CN	Analog, CCIR	300-0264
Hitachi KP-F100	Digital, RS-422, rapid reset	Cognex cable 300-0214 and Hitachi cable C-CG-100
Basler A113P	Digital, RS-422, rapid reset	300-0214 and 300-0268

Table 10. CVM6 supported cameras and cables

Video Formats Supported In This Release

A video format is a combination of camera type and image size selected from the **Acquisition** tab of the OMI **Image** dialog. Table 11 on page 21 lists the video formats supported under OMI 2.3.1.

Format Num in the first column is the video format number used by **SetVideoFormatNum** and **GetVideoFormatNum** which were deprecated in OMI 2.3.

Note that the **Format** drop-down box in the **Acquisition** tab of the OMI **Image** dialog may show camera formats in addition to the ones listed in the table. Those formats, while available, have not been qualified with OMI 2.3.1 and may give unpredictable results if you use them.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Format Num	Video Format Name	8100 8100M	8100L	8100C	8110/CVM1	8110/CVM4	8110/CVM6	8120/CVM1	8120/CVM4	8120/CVM6
	Basler A113P 1279x1024 ExtPixClk (rapid-reset, level-controlled, fixed-timing) CCF									●
16	Cognex CVC1000 640x480*					●			●	
	Hitachi KP-F100 1280x1024 ExtPixClk (rapid-reset, shutter-sw-twoTrigger) CCF									●
18	Hitachi KP-F100 1280x1024						●			
9	PULNiX TM-6CN 760x574	●	●	●						
	Pulnix TM-6CN 760x574 ExtPLLCo CCF							●		●
14	Pulnix TM7EX 320x240				●					
	Pulnix TM-7EX 320x240 IntDrv CCF							●		●
15	Pulnix TM7EX 640x240	●	●	●						
	Pulnix TM-7EX 640x240 IntDrv CCF							●		●
13	Pulnix TM7EX 640x480	●	●	●	●					
	Pulnix TM-7EX 640x480 IntDrv CCF							●		●
6	PULNiX TM-9701 640x480	●		●	●					

Table 11. Video Formats Supported by OMI 2.3.1

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Format Num	Video Format Name	8100 8100M	8100L	8100C	8110/CVM1	8110/CVM4	8110/CVM6	8120/CVM1	8120/CVM4	8120/CVM6
	Pulnix TM-9701 640x480 IntDrv (analog-out, rapid-reset, shutter-sw-doublePulse) CCF							●		●
17	Sony XC-003 640x480			●						
	Sony XC-55 640x480 IntDrv (rapid-reset, shutter-sw-EDONPISHAII) CCF							●		●
5	Sony XC55BB 640x480 (8100M)	●		●	●		●			
2	Sony XC75 320x240				●		●			
	Sony XC-75 320x240 ExtPLLCo CCF							●		●
	Sony XC-75 320x240 IntDrv (rapid-reset, shutter-sw-SDONPISHA) CCF							●		●
	Sony XC-75 320x240 IntDrv CCF							●		●
11	Sony XC75 640x240	●	●	●	●		●			
	Sony XC-75 640x240 ExtPLLCo CCF							●		●
	Sony XC-75 640x240 IntDrv CCF							●		●
3	Sony XC75 640x480	●	●	●	●		●			
	Sony XC-75 640x480 ExtPLLCo CCF							●		●
	Sony XC-75 640x480 IntDrv CCF							●		●

Table 11. Video Formats Supported by OMI 2.3.1

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Format Num	Video Format Name	8100 8100M	8100L	8100C	8110/CVM1	8110/CVM4	8110/CVM6	8120/CVM1	8120/CVM4	8120/CVM6
4	Sony XC7500 640x480				●					
0	Sony XC75CE 380x287				●		●			
	Sony XC-75CE 380x287 ExtPLLCo CCF							●		●
	Sony XC-75CE 380x287 IntDrv (rapid-reset, shutter-sw-SDONPISHA) CCF							●		●
	Sony XC-75CE 380x287 IntDrv CCF							●		●
12	Sony XC75CE 760x287	●	●	●	●		●			
	Sony XC-75CE 760x287 ExtPLLCo CCF							●		●
	Sony XC-75CE 760x287 IntDrv CCF							●		●
1	Sony XC75CE 760x574	●	●	●	●		●			
	Sony XC-75CE 760x574 ExtPLLCo CCF							●		●
	Sony XC-75CE 760x574 IntDrv CCF							●		●
	Sony XC75CERR 380x287				●					
8	Sony XC75RR 320x240				●					
	Sony XC-ST50 320x240 ExtPLLCo CCF							●		●

Table 11. Video Formats Supported by OMI 2.3.1

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Format Num	Video Format Name	8100 8100M	8100L	8100C	8110/CVM1	8110/CVM4	8110/CVM6	8120/CVM1	8120/CVM4	8120/CVM6
	Sony XC-ST50 320x240 IntDrv (rapid-reset, shutter-sw-SDONPISHA) CCF							●		●
	Sony XC-ST50 320x240 IntDrv CCF							●		●
21	Sony XC-ST50 320x240			●	●		●			
	Sony XC-ST50 640x240 ExtPLLCo CCF							●		●
	Sony XC-ST50 640x240 InvDrv CCF							●		●
22	Sony XC-ST50 640x240	●	●	●	●		●			
	Sony XC-ST50 640x480 ExtPLLCo CCF							●		●
	Sony XC-ST50 640x480 IntDrv CCF							●		●
23	Sony XC-ST50 640x480	●	●	●	●		●			
	Sony XC-ST50CE 380x287 ExtPLLCo CCF							●		●
	Sony XC-ST50CE 380x287 IntDrv (rapid-reset, shutter-sw-SDONPISHA) CCF							●		●
	Sony XC-ST50CE 380x287 IntDrv CCF							●		●
24	Sony XC-ST50CE 380x287			●	●		●			
	Sony XC-ST50CE 760x287 ExtPLLCo CCF							●		●

Table 11. Video Formats Supported by OMI 2.3.1

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Format Num	Video Format Name	8100 8100M	8100L	8100C	8110/CVM1	8110/CVM4	8110/CVM6	8120/CVM1	8120/CVM4	8120/CVM6
	Sony XC-ST50CE 760x287 IntDrv CCF							●		●
25	Sony XC-ST50CE 760x287	●	●	●	●		●			
	Sony XC-ST50CE 760x574 ExtPLLCo CCF							●		●
	Sony XC-ST50CE 760x574 IntDrv CCF							●		●
26	Sony XC-ST50CE 760x574	●	●	●	●		●			
28	Sony XC-ST50CERR 380x287				●					
27	Sony XC-ST50RR 320x240				●					
	Teli CS8531 640x480 IntDrv (shutter-sw-random-trigger, dual-tap) CCF									
7	Toshiba IK-M41MA 320x240				●					

Table 11. Video Formats Supported by OMI 2.3.1

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Host System Information

This section describes the host (PC) software and hardware that you need to use OMI 2.3.1.

System Requirements

To install and use the current OMI release, the host PC must meet the following minimum requirements:

- The PC's PCI or AGP chip set must be compliant with the PCI 2.1 specification. Motherboards with Intel chip sets that support Pentium/MMX or later CPUs are known to be compliant. Cognex has not tested motherboards made with non-Intel chip sets.
- A Windows operating system that supports the Cognex frame grabber you will use, as described under *Operating System Requirements* on page 28.
- A CD-ROM drive, or access to one over a network, to install the OMI software.
- A PCI- or AGP-based video display adapter with at least 8 Megabytes of memory.
- A mouse or other pointing device supported by your Windows version.
- If using Windows 98, the runtime components of DirectX 6.0 or later.

To use OMI at its maximum potential, the host PC must meet the following additional requirements:

- The CPU must be an Intel Pentium/MMX, Celeron, Pentium II, or Pentium III running at 166 MHz or higher.
- The Windows desktop must be in 8-, 16-, or 32-bit color mode; the desktop must be in 16- or 32-bit mode to display color images.
- To display full-resolution images (640x480 or larger), the Windows desktop must be at least 800x600 pixels.
- Cognex recommends the use of an AGP video card with at least 16 MB of memory.
- The system should use bus-mastered DMA disk drivers instead of the standard PIO drivers. Bus-mastered drivers improve system performance, as the CPU is less heavily used during disk IO. Windows NT typically defaults to PIO drivers. Windows 98 installs the drivers but does not always enable them. Check with your motherboard vendor to determine if it provides bus-mastered IDE drivers. For more information see the article at:

  http://support.microsoft.com/support/kb/articles/Q182/5/32.ASP

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Video Card Requirements

The minimum requirement for video cards used with the current OMI release is a PCI- or AGP-based video display adapter with at least 8 MB of RAM. A 2X AGP video card with at least 16 MB of memory is strongly recommended.

Table 12 provides detailed recommendations for video card capabilities.

Video Card Feature	Recommendations
PCI video cards	Adequate when using an 8-bit acquisition FIFO and an 8-bit desktop color depth when maximum acquisition frame rate is not required.
AGP video cards	2X or better strongly recommended.
8 MB of video memory	Adequate when using an 8-bit acquisition FIFO and an 8-bit desktop color depth.
16 MB of video memory	• Recommended when using 16- or 32-bit desktop color depths. • Required when using the overlay plane with an 8-bit acquisition FIFO and 8-bit desktop color depth, or 16-bit acquisition FIFO and 16-bit desktop color depth.
32 MB of video memory	• Recommended when using a 32-bit desktop color depth. • Required when using the overlay plane with a 32-bit acquisition FIFO and 32-bit desktop color depth (if supported by your hardware).

Table 12. Video card requirements for OMI 2.3

Note If you are using an AGP video card, avoid installing other cards in PCI slot 1 (since this shares an interrupt with the AGP slot). If you are using a PCI video card, avoid installing it in any PCI slot numbered 5 or higher.

The following video display adapters were used in testing OMI 2.3.1:

- ATI Xpert 128 AGP (recommended for use with 32-bit desktop)
- NVIDIA GeFORCE2 AGP
- Matrox Millennium G200 and G400 AGP (recommended for use with 32-bit desktop)
- ATI Xpert 98 PCI (not recommended for use with 32-bit desktop)

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

- ATI Xpert XL PCI (not recommended for use with 32-bit desktop; no longer available from ATI)
- Matrox Millennium II PCI (not recommended for use with 32-bit desktop)

Note If you are using any ATI card with Windows 2000, make sure you obtain the most up-to-date Windows 2000 drivers from ATI.

The following video card is known to not work correctly with OMI:

- ATI RADEON

The following video card is not supported under Windows 2000 and is not recommended for use with OMI:

- ATI Rage Fury MAXX

Operating System Requirements

OMI 2.3.1 requires one of the following Microsoft operating systems installed on the host machine:

- Windows 98
- Windows 98J
- Windows NT 4.0
- Windows NT 4.0J
- Windows 2000
- Windows 2000J

OMI 2.3.1 does not run on Windows 95 or Windows ME.

Service Pack Requirements

OMI 2.3.1 has been tested against the service pack or release levels of Microsoft products shown in Table 13. Later service packs or release levels may work, but have not been tested and are not supported by Cognex for use with this version of the software.

Product	Service Pack or Release Level Supported
Windows NT 4.0	Service Pack 6a
Windows NTJ 4.0	Service Pack 6a

Table 13. Service pack release levels supported by OMI 2.3.1

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Product	Service Pack or Release Level Supported
Windows 98	Second Edition
Windows 98J	Second Edition
Windows 2000	Service Pack 1
Windows 2000J	Service Pack 1
Visual C++ 6.0	Service Pack 4

Table 13. Service pack release levels supported by OMI 2.3.1

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Installation Information

This section describes specific limitations and other information about installing OMI software. For information about installing hardware, refer to the hardware manual for your Cognex frame grabber.

Before You Install

Please take a moment to familiarize yourself with the information in this section before installing OMI 2.3.1.

- Verify that the system on which you will install OMI software meets all hardware and software requirements described in the section *Host System Information* on page 26.
- When installing OMI under Windows NT or Windows 2000, you must have Administrator privileges for the system on which you are installing the software.
- Set the **Plug and Play** option in the BIOS as follows, depending on your operating system:
  Windows 98: **Yes**
  Windows 2000 or Windows NT: **No**
- Fully uninstall any earlier version of CVL or OMI before installing the current version. You can uninstall both CVL and OMI using the **Add/Remove Programs** control panel. Depending on the release level of software installed, the name of the application to remove appears as **Vision**, **Cognex Vision**, or **Cognex CVL** in the list of programs. See also *Uninstalling OMI Software* on page 33.

Note The uninstall program for some previous versions of OMI may not remove the MVS-8100 drivers. If the drivers are not removed before you install the new software, you may be unable to run OMI applications. Depending on your operating system, see *Uninstalling Windows 2000 Drivers* on page 33, *Uninstalling Windows NT Drivers* on page 34, or *Uninstalling Windows 98 Drivers* on page 34 for instructions on removing the drivers manually.

Installing OMI Software

This section provides an overview of installing OMI software and device drivers for MVS-8000 series frame grabbers.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Windows 2000 Installation

If you have already installed your frame grabber hardware, use the installation procedure for Windows 98 (replacing *\Drivers\win98* with *\Drivers\win2000*). See *Windows 98 Installation* on page 32.

Note If you have installed two boards in your Windows 2000 system and use the Windows 98 installation procedure, the Plug and Play installation wizard will run twice, once for each board.

If you have not yet installed your frame grabber hardware, follow these steps to install OMI under Windows 2000:

Note For Windows 2000 systems, make sure the **Plug and Play** option in the BIOS is set to **Yes**.

1. Install the OMI software by inserting the CD-ROM, double-clicking the *setup.exe* icon, and following the on-screen prompts. The installation program installs both OMI software and the Windows 2000 device drivers for your frame grabber.
2. Keep the following points in mind as you install the software:
   - If your computer system has been upgraded from Windows NT to Windows 2000, make sure you have uninstalled any previously installed version of OMI or OMI software. You might need to manually remove driver files as described in the section *Uninstalling OMI Software* on page 33.
   - Be sure to select the correct frame grabber family so that the right device driver is installed.
3. Power the PC off and install the Cognex MVS-8000 series frame grabber as described in its hardware manual.
4. Power the PC back on. When you restart your system, Windows 2000 displays messages indicating that it has detected and installed the new hardware.

Note As OMI drivers are not signed, Windows 2000 systems may refuse to install a driver. You can prevent Windows 2000 from blocking the installation of unsigned drivers by opening the **System** control panel, clicking the **Hardware** tab, clicking the **Driver Signing** button, and selecting either **Ignore** or **Warn**.

Windows NT Installation

If you are installing OMI under Windows NT, follow the steps in this section.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Note For Windows NT systems, make sure the **Plug and Play** option in the BIOS is set to **No**.

1. Power the PC off and install the Cognex MVS-8000 series frame grabber as described in its hardware manual.
2. Power the PC back on and start Windows NT.
3. Install the OMI software by inserting the CD-ROM, double-clicking the *setup.exe* icon, and following the on-screen prompts. The installation program installs both OMI software and the NT device drivers for your frame grabber.
4. Keep the following points in mind as you install the software:
   - Make sure you have uninstalled any previously installed version of OMI or OMI software. You may need to manually remove a driver file, as described in the section *Before You Install* on page 30.
   - Be sure to select the correct frame grabber family so that the right device driver is installed.

Windows 98 Installation

If you are installing OMI under Windows 98, follow these steps:

Note For Windows 98 systems, make sure the **Plug and Play** option in the BIOS is set to **Yes**.

1. Power the PC off and install the Cognex MVS-8000 series frame grabber as described in its hardware manual.
2. Power the PC back on and start Windows 98.

While starting, Windows 98 detects the new hardware and displays the **Add New Hardware Wizard** dialog box.

3. Insert the OMI installation CD-ROM.
4. Check the **Specify a Location** checkbox and uncheck all other checkboxes.
5. Click **Browse** and navigate to the following folder on your OMI CD-ROM: *\Drivers\win98\8100* (if you are using an MVS-8100) or *\Drivers\win98\8120* (if you are using an MVS-8120).

   Windows 98 detects and installs the drivers in that folder.
6. Install the OMI software by inserting the CD-ROM, double-clicking the *setup.exe* icon, and following the on-screen prompts.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Installing Adobe Acrobat Software

OMI documentation is delivered in Adobe Acrobat format on the OMI installation CD-ROM. If you have not already installed the Adobe Acrobat Reader software, you can install it as follows:

1. Double click the **rs405eng.exe** icon within the *\Acrobat* folder on the OMI installation CD-ROM.
2. Follow the on-screen prompts.

Uninstalling OMI Software

To uninstall OMI software, use the **Add/Remove Programs** control panel. The application to remove is named **Cognex OMI <version>**.

If you are using Windows 98 or Windows 2000, you must remove the hardware as well as the software, but you do not need to use the **Add/Remove Hardware** control panel (unless you had the Plug and Play wizard install the drivers under Windows 2000, in which case the OMI uninstall program will not remove the drivers).

Note The installer requests that you restart your Windows system after uninstalling OMI. If you attempt to re-install OMI without first restarting your system, the installer will not allow the installation to proceed.

Caution *Do not cancel an uninstallation when the system prompts you to confirm the uninstallation. If you cancel the uninstallation, your system might be left in an inconsistent state.*

Uninstalling Windows 2000 Drivers

After uninstalling OMI from a Windows 2000 system, make sure that the MVS-8100 driver files were removed.

1. Check whether the following driver files were removed by the uninstallation:

- **MVS-8100 driver**
  \winnt\system32\drivers\v8100.sys

If these drivers were not removed, uninstall them as follows:

2. Search within the *\winnt* directory for all files ending in *.inf* that contain the string "Cognex" in their contents. You can use the **Search** command in the **Start** menu to do this. Delete these files and any similarly named files that end in *.pnf.* For example, if you find the string "Cognex" in the file *foo.inf,* you would also delete the file *foo.pnf* if it exists.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

3. Reboot the PC.
4. Right click on **My Computer** and from the resulting popup menu, select **Manage** > **Device Manager**.
5. From the Device Manager list of installed **Cognex Hardware**, right click the icon for the respective **Cognex Frame Grabber** and from the popup menu select **Uninstall**.
6. Check whether the driver files listed in step 1 were removed by the uninstallation and if not, delete the files from Windows Explorer.

Uninstalling Windows NT Drivers

After uninstalling OMI from a Windows NT system, make sure that the MVS-8100 driver files were removed.

1. Check whether the following driver files were removed by the uninstallation and if not, delete the files from Windows Explorer:

- **MVS-8100 driver**
  \winnt\system32\drivers\v8100.sys

Uninstalling Windows 98 Drivers

After uninstalling OMI from a Windows 98 system, make sure that the MVS-8100 driver files were removed.

1. Check whether the following driver files were removed by the uninstallation:

- **MVS-8100 drivers**
  (OMI 2.1): *\windows\system\8100.vxd* and *\windows\inf\other\Cognex,Inc.v8100.inf*
  (OMI 2.2): *\windows\system\8100.vxd* and
  \windows\inf\other\Cognex Corporation8100.inf
  (OMI 2.2 CR2, OMI 2.3): *\windows\system32\drivers\v8100.sys*

If these drivers were not removed, uninstall them as follows:

2. Search within the *\winnt* directory for all files ending in *.inf* that contain the string "Cognex" in their contents. You can use the **Search** command in the **Start** menu to do this. Delete these files and any similarly named files that end in *.pnf.* For example, if you find the string "Cognex" in the file *foo.inf,* you would also delete the file *foo.pnf* if it exists.
3. In the System control panel, select the **Device Driver** tab.
4. In the Other Devices section, highlight **Cognex Frame Grabber 8100** and click **Remove**. If this entry is not found, remove any entries in the Unknown Devices section, if present.
5. Reboot the **PC** to let Windows 98 detect the frame grabber as a new device.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

6. Check whether the driver files listed in step 1 were removed by the uninstallation and if not, delete the files from Windows Explorer.

Documentation Supplied With This Release

The following table lists the documentation supplied with this release:

Document	Contains
OMI 2.3.1 Release Notes	Software installation information, known bugs, and supplemental information
MVS-8100 Hardware Manual *MVS-8100L Hardware Manual* *MVS-8100C Hardware Manual* *MVS-8110 Hardware Manual* *MVS-8120 Hardware Manual*	Installation and configuration information for the Cognex MVS-8100, MVS-8100L, MVS-8100C, MVS-8110, and MVS-8120 hardware
OMI User's Guide	Tutorial information on building OMI applications, working with the sample code, and acquiring and displaying images
OMI Object Reference	An online manual describing the OMI objects. Two versions of this document are supplied: *omiref.pdf* (optimized for on-screen use) and *omirefpr.pdf* (optimized for printed use).
Vision Tool Guide	Descriptions of how the Cognex MVS-8000 vision tools work; describes algorithms, parameters, and results.
OMI Fiducial Finder Programmer's Guide	Overview and reference descriptions of the optional Fiducial Finder tool.
OMI Help System	A context-sensitive help system you access by clicking the **?** button while using OMIWin

Some of the manuals included with this release may be labeled for OMI 2.2. The information in those manuals is still accurate for OMI 2.3.1.

Except for the *Release Notes,* all printed manuals are also supplied in Adobe Acrobat format on the installation CD-ROM. Selecting the Full Installation option copies these Acrobat files to your hard disk, in the *\Vision\OMI\Doc* folder. If you select the Custom Installation option, you can copy the files to your hard disk by selecting the appropriate checkbox during installation. If you don't copy the files to your hard disk, you can open them directly from the CD-ROM directory *\Doc*.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

OMI 2.3.1 Release Notes

Note When reading OMI documentation online, click on entries in the table of contents or index to go directly to that topic.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Hardware Limitations

This section describes specific limitations of and cautions about Cognex frame grabbers.

Incorrectly Configured MVS-8100 May Fail Silently

If OMI quits immediately after you launch it, you may have misconfigured your MVS-8100,

If you have configured jumper J3 with pins 2 and 3 covered so that connected cameras do not draw power from the PCI bus, you must connect Cognex cable P/N 300-0175 to the external power connector J2.

See your *MVS-8100 Hardware Manual* for diagrams and additional information.

Cannot Install MVS-8100L Drivers

If you are having trouble installing the Cognex MVS-8100L drivers, make sure that any previously instead drivers were completely removed. See *Uninstalling OMI Software* on page 33.

In particular, search within the *\winnt* directory for all files ending in *.inf* that contain the string "Cognex" in their contents. You can use the **Search** command in the **Start** menu to do this. Delete these files and any similarly named files that end in .pnf. For example, if you find the string "Cognex" in the file *foo.inf,* you would also delete the file *foo.pnf* if it exists.

MVS-8100L Appears Twice in Device Manager Listings

Under Windows 2000 and Windows 98, the Cognex MVS-8100L appears in the Device Manager list as two devices:

Cognex Frame Grabber 8100L
Cognex Frame Grabber 8100L (0x878)

This condition is normal for the MVS-8100L. It is related to the way the Windows Plug and Play system tries to identify the MVS-8100L.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

PCI Bus Compatibility Problem

Because of problems with the third-party PCI bus controller chip used on the original MVS-8100, the MVS-8100 may experience acquisition-related problems in some computer systems. These problems do not occur with the MVS-8100M or MVS-8100C. All current and recent MVS-8100 orders are filled with the MVS-8100M. Consult the *MVS-8100 Hardware Manual* to distinguish an original MVS-8100 from an MVS-8100M.

The problems affecting the original MVS-8100 can include image jitter during live video display and/or missed or corrupted single acquisitions. The problems can be intermittent and unpredictable. The problems may occur only when the MVS-8100 is installed in a particular PCI slot.

For example, when used in Hewlett-Packard Vectra VA and Vectra VL models that use the Pentium Pro or Pentium II CPU, original Cognex MVS-8100 frame grabbers have been observed to work best when installed in PCI slot 4 (the fourth slot away from the motherboard). These MVS-8100s may exhibit problems synchronizing with video cameras when installed in PCI slots 1, 2, or 3 on these Hewlett-Packard PCs.

A diagnostic utility is available from Cognex Technical Support that can detect the bus conditions that cause this problem. Use this utility to determine if your MVS-8100s will be affected by the problem in the PCs and slots you intend to use.

Genlock Not Supported with Pulnix TM-9701 and Sony XC-003

When the video format for the current camera is for the Pulnix TM-9701 or the Sony XC-003, the **Genlock Enabled** checkbox is correctly greyed out on the **Advanced** tab of the Image object's dialog box. However, it is still possible to use the Image object's **SetGenlockState()** function as a Script, Visual Basic, C, or Visual C++ command to enable genlock support for this camera.

For the Pulnix TM-9701, using **SetGenlockState()** appears to enable genlock support, the genlock setting is actually ignored by OMI when the current frame grabber board is an MVS-8100, MVS-8110, or MVS-8120 and the current video format is for the Pulnix TM-9701.

MVS-8100C Does Not Support 6-Bit Acquisition

The MVS-8100C does not acquire 6-bit images, which means that the following Proces object functions cannot be used: **EdgDir0**, **EdgMag**, **Equalize**, **Hipas**, and **Quantize**.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

OMI Software Information

This section provides usage information for this release of the OMI software. It describes new software features and characteristics of OMI behaviors that are not bugs, but warrant discussion.

New in OMI 2.3.1

This section describes changes from OMI 2.3.

Edit Mask Button Launches Mask Editor

In OMI 2.3, clicking the Edit Mask button did not launch the mask editor. This has been fixed in OMI 2.3.1.

Enhancements to OCVLine

Two new capabilities were added to the OCVLine algorithm so that it works better with characters that may not be evenly spaced or that may be slightly rotated. These kinds of characters are typically produced by dot matrix printers.

The RetryDistance parameter lets you specify the number of pixels to advance to try to find a character if OCVLine fails to locate one.

The AngleTolerance parameter lets you specify the amount of rotation for each character. This tolerance parameter is enabled only when the new scoring selection property, UsePatMaxScoring, is set.

New in OMI 2.3

This section describes changes from OMI 2.2.

Bc Object

The Bc (barcode) object now supports reading Bc128 barcodes in addition to the Bc39 and UPC Type A barcodes that OMI 2.2 supported.

Bc Object Dialog Box Changes

The Bc object dialog box has been redesigned to accommodate the new barcode.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Bc Object API Changes

The only change to the Bc object's API is that the **SetCodeType()** function accepts a new value to denote the Bc128 barcode.

Image Object

The Image object now supports the Cognex MVS-8120 frame grabber and a wider range of cameras and video formats. These are described in detail in *Cameras and Video Formats Supported* on page 11.

Previous versions of OMI used video format numbers to specify video formats. Newer versions of OMI use video format names; you should use video format names in any new applications you write.

Video formats are either built in to OMI or are available though Camera Configuration Files (CCFs) in the directory specified by the environment variable *COGNEX_CCF_PATH* (usually *C:\Program Files\Cognex\Common\ccf*).

The image object now lets you use any of the RGB color planes with a vision tool without acquiring a new image. When a vision tool requires a grey-scale image, the conversion is performed automatically according to the **GreyConversion** setting, and the resulting grey-scale image is cached. If you change the conversion method, the cached image is released, and a new grey-scale image will be created with the new conversion method when a vision tool needs it.

Image Object Dialog Box Changes

The list of camera formats in the **Acquisition** tab no longer includes the video format numbers. Only video format names are displayed.

Image Object API Changes

Beginning with OMI 2.3, video formats are specified by name instead of by number. This release introduces four new functions to specify video formats:

- **SetVideoFormat** / **GetVideoFormat**
- **GetVideoFormatCount**
- **GetVideoFormatFromIndex**

These functions are described in detail in the *OMI 2.3 Object Reference*.

SetGreyConversion now causes the specified RGB plane to be used when a vision tool needs to convert a color image into a grey-scale image; this means that you can use all three planes from the same color image without acquiring the image three times

SetTriggerEnable and **GetTriggerEnable** allow you to enable or disable triggers.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Image and Mask Editor

The **Edit Mask** button in the Mask Object dialog box now opens the Cognex Image and Mask Editor. In earlier releases, the **Edit Mask** button opened the Paint program supplied with Windows.

The Cognex Image and Mask Editor enables users to view and edit a mask "in place" on top of the image being masked. When opened from the Mask Object dialog box, the editor is automatically initialized with the mask values appropriate for the vision object using the mask.

Masks that are children of CNLSModel and PMTool objects have a palette of *Care* and *Don't Care* pixel values that can be set as the foreground and background colors for drawing. Masks used by PMPattern objects have a palette that includes *Care*, *Don't Care But Score*, and *Don't Care and Don't Score* pixel values.

Note The Image and Mask Editor must be opened from the Mask dialog box to create masks that OMI objects can use. If you run the editor as a standalone application, OMI cannot use the masks you create.

The introduction of the Image and Mask Editor changes the interface of the Mask object. Because the editor works with both an underlying image and the mask image, the Mask object interface now refers both to an "original image" (the image being masked) and to the mask image. Refer to the documentation of the Mask object dialog box and API in the *OMI Object Reference* for additional information. A new *Deprecated Functions* section contains a list of API changes.

Visual Basic Notes

Strings Returned by Functions Must be Allocated

When an OMI function takes a string as input, such as to supply a file name, the string may be declared like this:

```
Dim InputString As String
```

If an OMI function returns a value as a string, such as **AcuBc_GetString()** and other functions, the string declaration must allocated enough storage for the expected string, like this:

```
Dim OutputString As String * 20
```


Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Display Notes

Fast Live Video and Desktop Color Depth

When using some PCI-based video cards, you may experience high CPU usage if you display live grey-scale video with your Windows desktop set to a color depth other than 256-color or 65,536-color (High Color) modes. This does not occur with the recommended AGP-based video cards.

If you detect high CPU usage (as shown by the Window NT Task Manager, or the Windows 98 System Monitor), set your Windows desktop to 256-color mode or 65,536-color (High Color) mode before launching OMIWin to display live grey-scale video.

To display live color video using the MVS-8100C and a color camera, the Windows desktop *must* be set to either 16-bit color depth (called 65,536 colors or High Color) or 32-bit color depth (called True Color).

Note Some Windows 98 video drivers offer a "High Color 16-bit" option that actually offers only 15-bit color depth (32,768 colors). Live color video will not work at this resolution using these drivers. If you suspect you are having this problem, contact Cognex Technical Support.

Colormap Flashing When Switching Apps Using 256-color Desktop

If you set the Windows desktop to use 256 colors, Windows uses a palette of 256 colors, and the topmost window on the Windows desktop imposes its palette on all other windows. If you switch between applications, each application re-imposes its own palette on the entire Windows desktop as it becomes the topmost active window. This is known as colormap flashing and is normal for all 256-color desktop windowing systems.

Under these conditions, if you select another application while leaving the OMIWin window visible, the OMIWin window may not display its colors correctly. When you reselect the OMIWin window, its colors will be displayed correctly again. To avoid colormap flashing altogether, set the Windows desktop to use a higher color depth as described in the previous section.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

OMI Now Uses DMA at All Times

OMI 2.3 automatically uses direct memory addressing (DMA) whenever possible to speed up transfers of live video from the frame grabber to the PC's video card for display. The **Use Video DMA** setting of the Object Manager (available in the Object Manager's Properties dialog and with the **SetUseVideoDma** function) no longer has any effect.

Form Containing Display OCX Must Use Correct Palette

If your Windows desktop is set to 256 colors, you must use the correct palette for each Visual Basic form in which you have inserted the OMI display OCX. You must set the PaletteMode to **Custom** and set the Palette to the standard OMI palette (supplied in *sample/vb/omipal.bmp*).

Object Manager Notes

Global Objects Referenced by Other Objects Cannot be Reloaded

Global objects referenced by other objects cannot be individually reloaded into a project in which they already exist. You must perform a **NewProject()** call or delete the current instances of the global objects before attempting to reload them.

Image Acquisition Notes

Genlock Supported for One Camera Port on MVS-8110

You can only configure one camera at a time for genlock acquisition using the MVS-8110. Configuring multiple cameras to use genlock causes image corruption.

Using Two Digital Cameras with CVM6

If you are using two digital cameras with a Cognex MVS-8120/CVM6 or an MVS-8110/CVM6, you must use the following procedure, or you may encounter difficulties.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

The CVM6 supports one analog camera and 2 digital cameras. The analog camera is analog port 0. The digital cameras are digital ports 0 and 1. Referring to camera 0 can mean either analog port 0 or digital port 0, depending on the video format.

In the Image object, if your camera port is set to 0, you can select either an analog or a digital camera format. If you want to use the second digital port (digital port 1), you must also be using digital port 0. Once you have set up the first digital camera, follow these steps to set up the image object to use the second digital camera:

1. Set the camera port to port 0
2. Select the video format for the digital camera you have connected to digital port 0. This puts the image object into digital mode, so that the port numbers refer to digital ports.
3. Set the camera port to port 1. At this point the Image object is in an invalid state, because every camera has its own independent video format, which generally defaults to XC-75.
4. Select the video format for the digital camera you have connected to digital port 1

At this point, the Image object is again consistent and can be used for acquisition.

Image Artifacts

Some images acquired using an MVS-8100 will exhibit extraneous fringes of dark pixels on the right side of high-contrast dark-to-light image edges.

Setting Image Properties in Semi-Trigger and Auto-Trigger Modes

If you want to change Image object properties while you are performing acquisition using semi-trigger mode or auto-trigger mode, you must call **StartAcquire()** after changing the properties and before calling **CompleteAcquire()**. If you do not call **StartAcquire()**, the properties are not changed.

Unarmed Triggers in Semi-Trigger Mode Can Cause Overrun Error

You acquire images using semi-trigger mode by following these steps:

1. You arm the trigger by calling **StartAcquire()**.
2. The system receives a hardware trigger, causing an image to be acquired.
3. You call **CompleteAcquire()** to obtain the image.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

If the trigger is received before you arm the acquisition by calling **StartAcquire()**, an overrun error occurs. You must reset the state of the acquisition system by calling **CompleteAcquire()**.


Symbol Object Notes

Symbol Tool Can Fail after Initial Success

When the Symbol object learns a new 2-D symbol, it shows its intermediate results during the learning process. Sometimes, the Symbol object will report the correctly decoded string during the learning process but will fail to return the decoded string at the end of the learning process and will return a value of -1.

Typically, this behavior occurs when the 2-D symbol in the training image is warped, degraded, or at too low a resolution. If this happens when the Points are being set manually, it indicates that the parameters are close to the correct ones. If this happens when Points are being learned automatically, it indicates that either the resolution of the image is too low, or the image needs preprocessing.

This behavior can also occur when the edge of the Area boundary is too close to the 2-D symbol in the training image. The edge of the Area boundary should be no closer to the edge of the symbol than a distance equal to twice the width of one of the individual squares that comprise the symbol, as shown in the following figure:

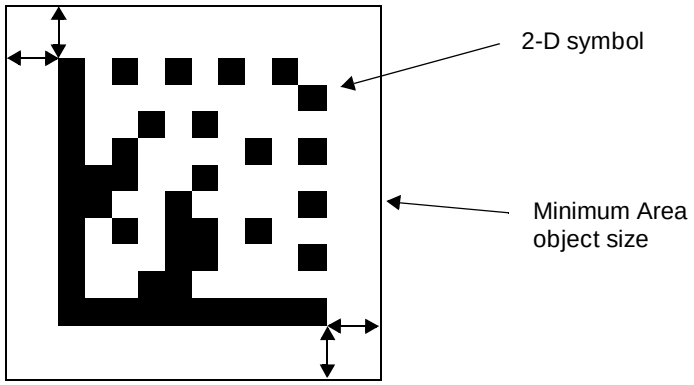

Preventing Decode() Failure on Certain Symbols

After a symbol is found within a defined area, **Decode()** begins symbol recognition. The following paragraph explains how to prevent **Decode()** from failing when the found symbols are different sizes.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

The **Learn()** function determines the optimum configuration of a symbol search and its decoding parameters. *ScaleRange*, a decoding parameter, is the percent of scale (size) difference tolerated when the **Find()** and **Decode()** functions search for a symbol. When you initially perform **Learn()** on an image, the function sets *ScaleRange* to 0. If you do not increase the *ScaleRange* when you **Find()** another symbol, a slight difference in the new symbol's size may cause **Decode()** to fail. Therefore, when you find and decode subsequent symbols that may be smaller or larger than the initial symbol, adjust *ScaleRange* in proportion to the difference in size.

Sample Code Notes

Threads Sample Program Limited to Four Threads

The sample program that demonstrates writing a threaded OMI application (*vision**omi**sample**thrd_app*) will not work correctly if you attempt to create more than four threads.

C++ Sample Code Displays Extra Warnings

Some extraneous warning messages may appear in the debug output of the OMI sample program in the *sdi_app* folder. Ignore the warning messages: `"Warning: Creating a pane with no document,"` and `"Warning: failed to load indicator string 0x01f9."`

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Known Bugs and Issues

This section lists known bugs and issues that affect installing OMI and using OMI vision tool objects. The OMI objects are listed in alphabetical order.

OmiWin Issues

Incomplete Updates When View Is Closed

When you close a view in the main OmiWin window, several parts of the GUI do not update appropriately. If a view window is active and you close the view, the main OmiWin window's title bar still displays the name of the closed view and the toolbar buttons that operate on views will continue to act on the closed view until you select a different view.

World Coordinates, Color Pixels in Status Bar

The status bar in the OmiWin display window shows the pixel value and the pixel and world coordinates at the current mouse position. Note that:

- The world coordinates only take into account the linear portion of the current world transform. The non-linear portion (if any) is ignored. This means that the position of tool result graphics, when checked using the mouse and the status bar, may not be the same as the results reported by tool dialog boxes.
- Pixel values are not displayed for color images. Only the coordinate data is shown.

Cannot Save Color Images Using File->Save

You cannot use the **File->Save** command in OmiWin to save a color image. You can save a color image using the Save command of the Image object or the Save command of a Proces object with the appropriate child Image object to save the grey-scale image that corresponds to the color image. The grey-scale image is based on the GreyConversion setting.

Cannot Display Unwrapping Region Whose Curve > 358

When you are using the Proces object to perform a polar unwrapping, the OmiWin GUI cannot display an unwrapping region whose **Curve** is greater than 358.89. At higher values, the handles of the region display, but the region itself does not. OMI still can perform the unwrapping operation.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Double-Clicking .OMI/.MAC File Only Works If OMIWin Not Running

Double-clicking a .OMI or .MAC file in Windows Explorer when OmiWin is already running will bring the running OmiWin to the top, but will not open the clicked file.

OMI May Lock Up After Pressing Ctrl-Alt-Del or If Screen Saver Becomes Active with Live Display

If you are using live display, press Ctrl-Alt-Del to bring up the security dialog, then press Cancel OMI will lock up. If you are using live display and the screen saver becomes active, OMI will lock up when you exit the screen saver.

Applications Built Using OMI

OMI Application Always Loses Focus When Started

Whenever you launch a program that makes calls to the OMI programming interface, the program automatically loses focus immediately after it is launched.

System Limitations

Only Use Pulnix TM-6CN for Strobed Acquisition Using Genlock

The Pulnix TM-6CN is the only camera that can be used to reliably acquire strobed images while operating in genlock mode.

Limited Support for Overlay Graphics on Color Images on Win98

With the MVS-8100C, creating many Overlay graphics in many different colors has been found to overtax the Windows 95 and 98 graphics systems, eventually requiring a reboot. To avoid this problem, limit yourself to a small number of colors if you are creating many graphics in the Overlay object or, if you need to use many colors, limit the number of graphics.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Multiple Monitors Not Supported Under Win98

OMI 2.3 does not support multiple-monitor configurations under Windows 98.

Manual Strobing Only Suitable for Diagnostic Purposes on MVS-8100

Manual strobing is the initiation of strobe pulses with software when not using hardware triggering. On the MVS-8100 family, manual strobing should be used only during development and for diagnostic purposes. For production applications, always use hardware triggering to initiate strobes.

Poor Performance Switching Genlocked Cameras on MVS-8110

When you are using a MVS-8110 and switch from one genlocked camera to another, the first acquisition from the new camera takes approximately 500 to 700 ms.

32-Bit Desktop, Can’t Display Mono and Color Live from XC-003

If you create two views that simultaneously display color and monochrome live video from a single Sony XC-003 camera, OMI may hang or cause a system crash.

MVS-8100C, XC-75CE, Win95/98: Master/Slave Hangs or Reboots PC

On a system running Windows 95 or 95J or Windows 98 or 98J and using an XC-75CE camera (CCIR format) on an MVS-8100C, if you configure one Image object as the slave of another Image object and then acquire using either Image object (the master or the slave), the system can hang or reboot the PC.

Calib Object

Point Calibration is Now Linear

If you use point calibration, the calibration computed is linear. If you specify point correspondence pairs which are not perfectly rectangular, the four pixel coordinate points may not be mapped to the exact world coordinate points you specify.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

CNLSearch Object

Point Search Not Available for Nonlinear Algorithms

You cannot use the CNLSearch object's point search feature with any of the CNLPAS algorithms. Point search is only supported for the Normalized Search and Absolute Search algorithms.

Display Object

AcuDisplay::Refresh() Argument Ignored

The first argument to **AcuDisplay::Refresh()** (which determines whether to clear overlay graphics) is ignored by the function. For compatibility with future versions, set this argument to 0.

To clear overlay graphics, call the **Show()** function individually for each object that is displaying graphics.

MVS-8110, Strobe, XC-75CE or TM-7EX: Bad Image After Live Video

This problem has been seen on the MVS-8110 using a strobe with an XC-75CE or TM-7EX camera: At the end of live video, the fields in the last image appear to be offset slightly when the target is moving.

MVS-8100C, XC-75CE, Full Format Live Video: Corrupted Image

When using live video on a Cognex MVS-8100C and an XC-75CE camera at full resolution (760x574) and a 32-bit desktop, the live image may be corrupted. You can avoid this problem by reducing the desktop depth to 8 or 16 bits.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Image Object

CCIR Formats Different Size on MVS-8100 and MVS-8110

If you use a CCIR-format camera on the MVS-8100 or MVS-8100C, the full-resolution images are 768x570 pixels; half-resolution images are 768x285 pixels. With an MVS-8110, full-resolution CCIR images are 768x574 pixels; half-resolution images are 768x287 pixels.

May Need to Adjust CTI Offset For XC-75CE on MVS-8100

You may experience black image fields when acquiring images from a Sony XC-75CE camera using the MVS-8100. These failures can occur once every 500 to 1000 acquisitions when using triggered acquisition at a trigger rate of 15 Hz.

You can prevent this problem from happening by setting a value of 24 in the **CTI Offset** field on the Trigger/Strobe tab of the Image dialog, or using the Image object's **SetCtiOffset()** function.

KP-F100: OMI Hangs If Selected Port Has No Camera

If you configure an Image object for the KP-F100 camera, then select a camera port that has no camera attached, your system will hang. If you connect the KP-F100 camera after OMI hangs, OMI detects the camera and resumes operation.

Color Camera Ports Confusing on MVS-8100C

Color cameras can only be connected to camera ports 1 and 3 on the MVS-8100C, leaving ports 0 and 2 unused, as described in the *MVS-8100C Hardware Manual*. However, with a correctly-connected color camera on port 1, OMIWin incorrectly provides access to the camera's settings through an Image object configured (in the Image object's dialog box or using its **SetCamera** function) to use either Camera 0 or Camera 1. Likewise, for a correctly-connected color camera on the board's port 3, access to the camera's settings is possible through an Image object configured to use either Camera 2 or Camera 3.

This makes possible the confusing situation where the settings of one camera are controlled by two Image objects using, at least apparently, two different cameras. To avoid the errors that might result from such confusion, we recommend that you

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

consistently configure an Image object to use Camera 1 when you want to access a color camera connected to port 1, and configure an Image object to use Camera 3 to access a color camera connected to port 3.

MVS-8100C Problems with Strobed Acquisitions

If you configure two Image objects to acquire strobed images on the MVS-8100C using the Semi trigger mode, a signal on either line fires both strobes. You can use Semi trigger mode for strobed acquisitions on any one port.

When you use Manual trigger mode to perform strobed acquisitions on the MVS-8100C, attempts to trigger an acquisition on port 1 may not fire the strobe on line 1 at all, or it may fire the strobe on line 0, if there is one.

When you do Master/Slave acquisition on the MVS-8100C using strobes, a strobe connected to the slave will not fire. You can work around this problem by connecting both strobes to the master.

KP-F100 Images Jump When Leaving Live Video

A KP-F100 image in the OMIWin view window “jumps up” when switching from live back to static display. The problem occurs when the **Exposure** property of the Image object is set to less than 7.5 ms.

Activating Live Video for Master or Slave Hangs OMI

OMIWin will hang if you enable live video for an Image object that is configured as a master or slave.

Problems Switching From Slave to Manual Mode On MVS-8110

If you have two Image objects configured for master/slave acquisition and are performing strobed acquisitions on an MVS-8110, then set the slave Image object to Manual trigger mode, subsequent acquisitions double-fire the strobe.

If you set a slaved Image object to Manual trigger mode, then switch the camera port of the master or former slave and acquire from the former slave, the application hangs.

6-Bit Live Video Appears Dark

6-bit live video appears dark on all except 256-color desktops. You can work around this problem by switching to 8-bit acquisitions before beginning live video display and changing back to 6-bit after leaving live display.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Images Black on MVS-8100 for Genlocked Sony XC-75/XC-75CE

Images acquired using a single genlocked XC-75 or XC-75CE camera for triggered strobed acquisitions are black for approximately 1 out of 200 acquires on the MVS-8100.

Strobe Does Not Fire on First Acquisition

The very first time you acquire a strobed image on an MVS-8100 or MVS-8110, the strobe does not fire. Perform a dummy acquisition at the start of your application to work around this problem.

Leftmost Pixels Dark When Using XC-75CE Under Certain Conditions

If you are using a Sony XC-75 CE camera with an MVS-8110 or MVS-8120 with CVM1 or CVM6 and the camera format "Sony XC-75CE 380x287 IntDrv (rapid-reset, shutter-sw-SDONPISHA) CCF", all of the pixels in the leftmost column will be black and all of the pixels of the next column will be grey.

Pulnix TM-6CN Requires Genlock Enabled on MVS-8100M and MVS-8100C

If you are using and 8100M or 8100C with the "Pulnix TM-6CN 760x574" video format, you must enable genlock. You can do this in the Advanced tab of the Image object dialog box or with the Image object's **SetGenlockState()** function.

OcvFont Object

ShowExtractArea() Only Works If Dialog Box Is Open

The OcvFont object's **ShowExtractArea()** function only works when the OcvFont object's dialog box is open. If the dialog box is not open, the function has no effect.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Overlay Object

Live Video Display Affected by Overlay Object

If you configure and display a large number of Overlay items, the OMI live video display frame rate can be reduced.

MVS-8110/CVM1 and XC-55: Moving Box Overlay Hangs OMI

The following combination of steps has been found to hang OMI 2.3.

1. Set up Image object with Format=5: "Sony XC55BB 640x480."
2. Create Overlay object with Type=4 "Box".
3. Set the Show mode to "Interactive."
4. Start live video.
5. Randomly move and resize the box.

After approximately 10-20 seconds, OMI locks up.

PMPattern Object

PMPattern Cannot Be Trained with Nonlinear Calibration

If you train a PMPattern using a training image whose World coordinates have been calibrated using a nonlinear grid of dots calibration, any attempt to locate that pattern using the PMTool object will return the wrong pattern location, regardless of how the search image is calibrated.

You can use the PMTool object with nonlinear calibration by following these steps:

1. Acquire an image of the calibration plate and perform a *linear* calibration.
2. Acquire the training image and train the PMPattern object.
3. Recalibrate the image from step 1 using the desired nonlinear calibration.
4. Acquire the search image and run the PMPattern tool as you would normally. The PMTool search results are returned in the current nonlinear World coordinate space.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Proces Object

Functions that Require 6-Bit Images Not Available with MVS-8100C

The following Proces object functions are not available when using the MVS-8100C because it does not support 6-bit acquisition: **EdgDir0**, **EdgMag**, **Equalize**, **Hipas**, and **Quantize**.

View Object

25% Zoom Can Produce Incorrect Offsets

There is a problem when using the following combination of factors:

- A Pixel object that has dimensions of less than 241 rows or 321 columns
- Top Left alignment in the View object
- Offsets of 0, 0
- Zoom of 25%

In this situation, when Apply and Update are performed in the View object, the offsets are modified to be negative numbers. The workaround is either not to use a zoom factor less than 50% or not to use Top Left alignment with images this small.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

OMI Documentation Notes

This section information about the documentation associated with this release.

Documentation Corrections

This section describes corrections of the OMI documentation.

Functions Return Zero As Warnings

Page 89 of the *OMI User's Guide* incorrectly states that any **Find** function will return a zero if no pattern was found. The function actually returns a 1 meaning that the function ran properly, not that it actually found anything. In general setter functions return zero as a warning rather than returning an error.

Documented Limit No Longer Exists for ImageSharpness

The documentation of the **Measure** command of the ImageSharpness object refers to a 65K area limit for auto-correlation mode that was removed in OMI 2.2. There is no limit on the input area. The incorrect information appears on page 367 of the *OMI Vision Tools Guide*.

IDB Editor Can Open Image and Mask Editor

The *Solving Common Problems* chapter of the *OMI User's Guide* incorrectly states that, to edit an image that is open in the IDB Editor, you must launch the Cognex Image and Mask Editor before you use the IDB Editor's **Edit->Edit Image** command. The **Edit Image** command does launch the Image and Mask Editor.

Artisan Technology Group - Quality Instrumentation ... Guaranteed | (888) 88-SOURCE | www.artisantg.com

Artisan Technology Group is an independent supplier of quality pre-owned equipment

Gold-standard solutions

Extend the life of your critical industrial, commercial, and military systems with our superior service and support.

We buy equipment

Planning to upgrade your current equipment? Have surplus equipment taking up shelf space? We'll give it a new home.

Learn more!

Visit us at **artisantg.com** for more info on price quotes, drivers, technical specifications, manuals, and documentation.

Artisan Scientific Corporation dba Artisan Technology Group is not an affiliate, representative, or authorized distributor for any manufacturer listed herein.

We're here to make your life easier. How can we help you today?

(217) 352-9330 | sales@artisantg.com | artisantg.com

ARTISAN® TECHNOLOGY GROUP