



Artisan Technology Group is your source for quality new and certified-used/pre-owned equipment

- FAST SHIPPING AND DELIVERY
- TENS OF THOUSANDS OF IN-STOCK ITEMS
- EQUIPMENT DEMOS
- HUNDREDS OF MANUFACTURERS SUPPORTED
- LEASING/MONTHLY RENTALS
- ITAR CERTIFIED SECURE ASSET SOLUTIONS

SERVICE CENTER REPAIRS

Experienced engineers and technicians on staff at our full-service, in-house repair center

*InstraView*SM REMOTE INSPECTION

Remotely inspect equipment before purchasing with our interactive website at www.instraview.com ↗

WE BUY USED EQUIPMENT


Sell your excess, underutilized, and idle used equipment. We also offer credit for buy-backs and trade-ins. www.artisanng.com/WeBuyEquipment ↗

LOOKING FOR MORE INFORMATION?

Visit us on the web at www.artisanng.com ↗ for more information on price quotations, drivers, technical specifications, manuals, and documentation

Contact us: (888) 88-SOURCE | sales@artisanng.com | www.artisanng.com

Future Domain TMC-1660

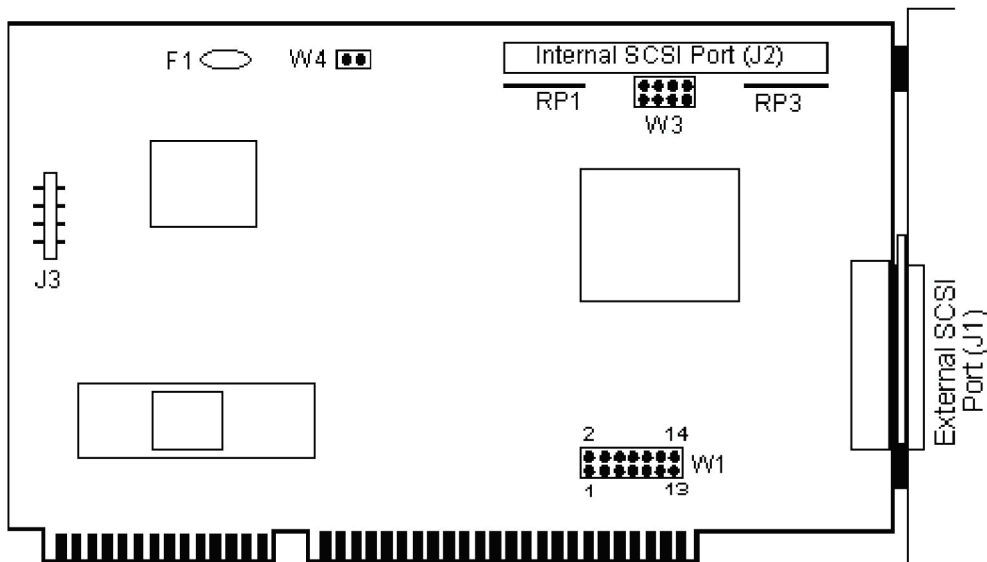

This is the Future Domain TMC-1660 SCSI adapter shown. Listed below are the possible Interrupt Request Line (IRQ), Base I/O Address, Base Memory Address, and other jumper/switch configurations:

Setup Choice for Windows NT 3.5
Future Domain 16xx

Type of External SCSI Connector
High Density Shielded

W1

| IRQ | J1 | J2 | J3 |
|----------|-----|-----|-----|
| 3 | OFF | OFF | OFF |
| 5 | ON | OFF | OFF |
| 10 | OFF | ON | OFF |
| 11 | ON | ON | OFF |
| 12 | OFF | OFF | ON |
| 14 | ON | OFF | ON |
| 15 | OFF | ON | ON |
| Disabled | ON | ON | ON |

I/O

| ADDRESS | J4 | J5 |
|-----------|-----|-----|
| 0140-014F | OFF | OFF |
| 0150-015F | ON | OFF |
| 0160-016F | OFF | ON |
| 0170-017F | ON | ON |

MEMORY

| ADDRESS | J6 | J7 |
|-------------|-----|-----|
| C8000-C9FFF | OFF | OFF |
| CA000-CBFFF | ON | OFF |
| CE000-CFFFF | OFF | ON |

DE000-DFFFF ON ON

W3

| | | | |
|---------|-----|-----|-----|
| FLOPPY | J1 | J2 | J3 |
| ENABLE | ON | ON | ON |
| DISABLE | OFF | OFF | OFF |

W4

Termination Power Enable/Disable

Note: It is possible under MS-DOS to use the 16-bit future domain adapters in a configuration where there is no interrupt for the 16-bit adapter. This configuration is not supported by Windows NT. If setup to a 16-bit Future Domain adapter hangs when attempting to go into GUI mode double check that the adapter is configured on an interrupt (jumper settable on adapter. setting is read by the Windows NT fd18xx.sys driver at initialization time).

Note: Some revisions of the firmware for the wangtek 5150es are incompatible with the 16-bit Future Domain adapters. If a system hangs due to this combination, contact Wangtek to get their latest revision of the firmware.



Artisan Technology Group is your source for quality new and certified-used/pre-owned equipment

- FAST SHIPPING AND DELIVERY
- TENS OF THOUSANDS OF IN-STOCK ITEMS
- EQUIPMENT DEMOS
- HUNDREDS OF MANUFACTURERS SUPPORTED
- LEASING/MONTHLY RENTALS
- ITAR CERTIFIED SECURE ASSET SOLUTIONS

SERVICE CENTER REPAIRS

Experienced engineers and technicians on staff at our full-service, in-house repair center

*InstraView*SM REMOTE INSPECTION

Remotely inspect equipment before purchasing with our interactive website at www.instraview.com ↗

WE BUY USED EQUIPMENT

Sell your excess, underutilized, and idle used equipment. We also offer credit for buy-backs and trade-ins. www.artisanng.com/WeBuyEquipment ↗

LOOKING FOR MORE INFORMATION?

Visit us on the web at www.artisanng.com ↗ for more information on price quotations, drivers, technical specifications, manuals, and documentation

Contact us: (888) 88-SOURCE | sales@artisanng.com | www.artisanng.com